


TREE PRESERVATION HOARDING

2  
[1] TREE PRESERVATION HOARDING - (SOLID HOARDING)  
CITY OF MISSISSAUGA STANDARD

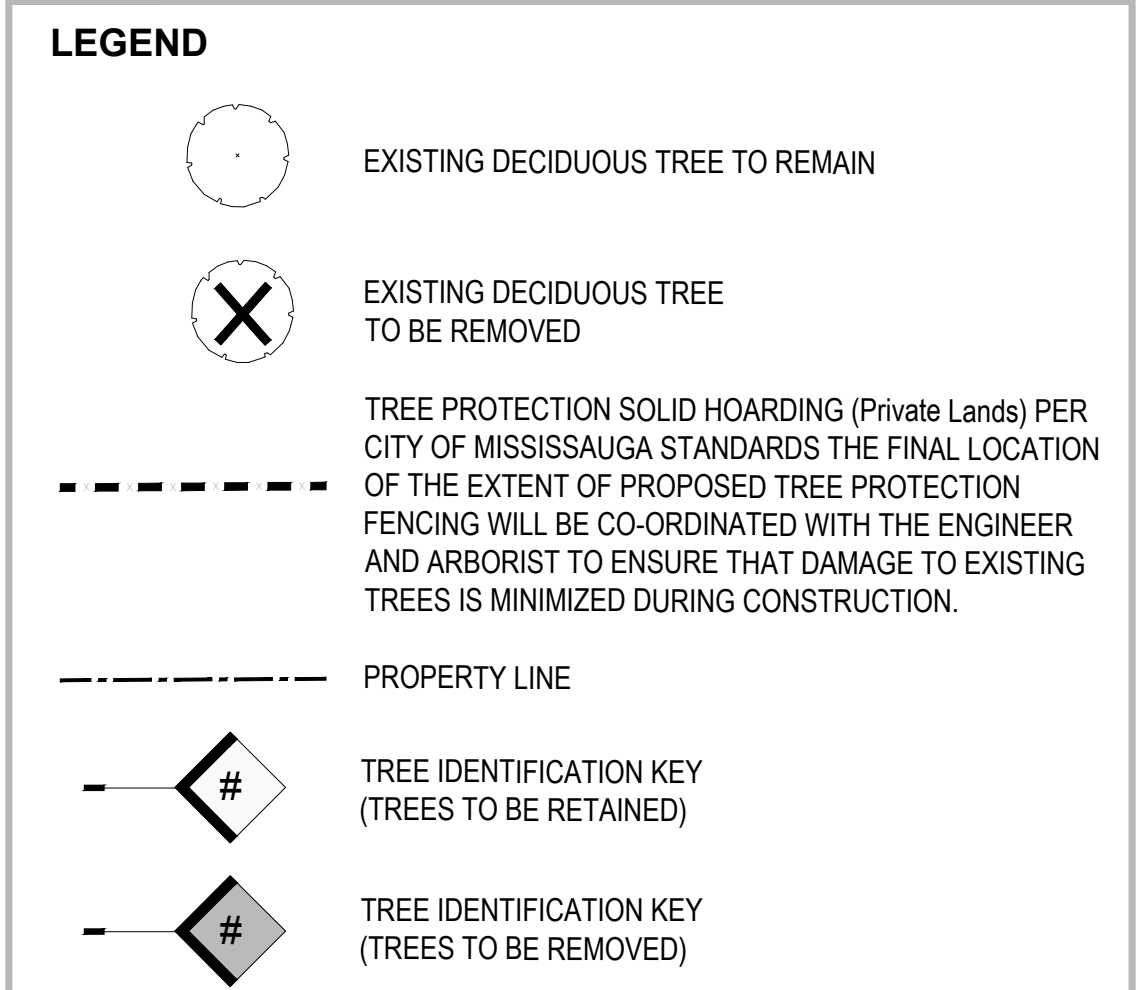


Tree #	Common Name	Botanical Name	DBH (CM)	Condition	Comments	Recommendation
1	Little Leaf Linden	Tilia cordata	34	F/G	Vines growing on tree	Retain
2	Little Leaf Linden	Tilia cordata	33	F/G		Retain
3	Little Leaf Linden	Tilia cordata	25	F/G		Retain
4	Little Leaf Linden	Tilia cordata	24	F/G		Retain
5	Little Leaf Linden	Tilia cordata	27	F/G		Retain
6	Little Leaf Linden	Tilia cordata	28	F/G		Retain
168	Manitoba Maple	Acer negundo	36	F	4 stem, tree showing signs of urban stress	Remove
169	Manitoba Maple	Acer negundo	35	F	3 stem, signs of rot in trunk, signs of urban stress	Remove
170	Manitoba Maple	Acer negundo	35	F/P	Significant canopy dieback	Retain
171	Manitoba Maple	Acer negundo	11	F/G		Remove (Neighbour's consent is required prior to removal)
172	Manitoba Maple	Acer negundo	60	F		Remove
173	Manitoba Maple	Acer negundo	11	F	2 stem	Remove
174	Manitoba Maple	Acer negundo	15	F	2 stem	Remove
175	Manitoba Maple	Acer negundo	120	F	Signs of rot, typical developing structural issues for aging tree	Remove
176	Grey Birch	Betula populifolia	35	P		Remove
177	Manitoba Maple	Acer negundo	27	F		Remove
178	Flowering Crabapple Tree	Malus	31	F/P		Remove
179	Manitoba Maple	Acer negundo	19	F		Remove
180	Manitoba Maple	Acer negundo	17	F		Remove
181	Manitoba Maple	Acer negundo	28	F	3 stem	Remove
182	Manitoba Maple	Acer negundo	30	F		Retain
183	Manitoba Maple	Acer negundo	27	F	3 stem	Retain
184	Manitoba Maple	Acer negundo	22	F	3 stem	Remove
185	Manitoba Maple	Acer negundo	28	P/D	95% dead, fruiting bodies present	Remove
186	Manitoba Maple	Acer negundo	33	F/P	4 stem, signs of rot in trunk	Retain
187	Manitoba Maple	Acer negundo	35	P	Past failures, trunk rot, significant deadwood	Retain
188	Manitoba Maple	Acer negundo	39	P	Significant lean, trunk rot	Remove
189	Manitoba Maple	Acer negundo	17	F	2 stem, significant lean	Remove
190	Manitoba Maple	Acer negundo	11	F	2 stem, moderate lean	Remove
191	Manitoba Maple	Acer negundo	13	F	2 stem, moderate lean	Remove
192	Manitoba Maple	Acer negundo	13	F	4 stem	Remove
193	Manitoba Maple	Acer negundo	14	F	2 stem	Remove
194	Manitoba Maple	Acer negundo	10	F		Retain
195	Manitoba Maple	Acer negundo	10	F	7 stem	Retain
196	Manitoba Maple	Acer negundo	10	F		Remove
197	Manitoba Maple	Acer negundo	13	F	3 stem	Remove
198	Manitoba Maple	Acer negundo	11	F	2 stem	Remove
199	Manitoba Maple	Acer negundo	12	F	3 stem	Retain
200	Manitoba Maple	Acer negundo	12	F	5 stem	Retain

NEIGHBOUR'S CONSENT WILL BE REQUIRED  
PRIOR TO THE REMOVAL OF TREE 171.



1. Do not scale the drawings. All dimensions are in millimeters unless noted otherwise.
2. This drawing is to be read in conjunction with the project site plan, landscape plan, and engineering plan.
3. The tree inventory includes assessment of trees >10cm DBH. The trees have been assessed based on species, size and condition.
4. The contractor shall check and verify all existing and proposed grading and conditions on the project and immediately report any discrepancies to the consultant before proceeding with any removals.
5. The contractor is to be aware of all existing and proposed services and utilities. The contractor is responsible for having all underground services and utility lines staked by each agency having jurisdiction prior to commencing work.
6. This drawing is to be used for development approval only.
7. Do not leave any holes open overnight.
8. Keep area outside construction zone clean and useable by others at all times. Contractor shall thoroughly clean areas surrounding the construction zone at the end of each work day.
9. Contractor to make good any and all damages outside of the development area that may occur as a result of tree removals at no extra cost.
10. This drawing is Copyright MHBC Planning, 2020.

4.	NOVEMBER 20, 2020	ISSUED FOR SPA	TT
3.	NOVEMBER 13, 2020	ISSUED FOR REVIEW	HH
2.	OCTOBER 14, 2020	ISSUED FOR REVIEW	HH
1.	SEPTEMBER 11, 2020	ISSUED FOR REVIEW	HH
REVISION NO.	DATE	ISSUED / REVISION	BY

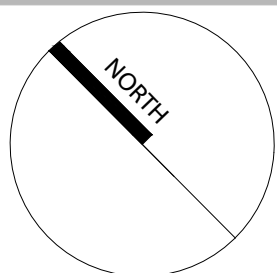 <h1>PLANNING URBAN DESIGN &amp; LANDSCAPE ARCHITECTURE</h1> <p>2320-7050 WESTON ROAD WOODBRIDGE, ON. L4L 8G7   P: 905 761 5388 F: 905 761 5389   <a href="http://WWW.MHBCPLAN.COM">WWW.MHBCPLAN.COM</a></p>	
<p><b>STAMP</b></p>  <p><b>ISSUED FOR SPA ONLY NOT FOR CONSTRUCTION</b></p> <p>All drawings and specifications are instruments of service and will remain the property of MHBC. Planning and must be returned at the completion of the work. This drawing shall not be used for construction purposes unless the drawings are marked 'Issued for Construction' and the professional seal is signed and dated by the landscape architect.</p>	<p><b>DATE</b></p> <p><b>AUGUST 2020</b></p>
	<p><b>DRAWN BY</b></p> <p><b>H.H.</b></p>
	<p><b>PLAN SCALE</b></p> <p><b>AS NOTED</b></p>
	<p><b>FILE NO.</b></p> <p><b>1625TAG</b></p>
	<p><b>CHECKED BY</b></p> <p><b>N.M.</b></p>
<p><b>OTHER</b></p>	
<p><b>PROJECT</b></p> <p><b>6333 HURONTARIO STREET</b></p> <p><b>MISSISSAUGA, ONTARIO</b></p>	
<p><b>FILE NAME</b></p> <p><b>TREE INVENTORY, PROTECTION, AND REMOVALS</b></p>	<p><b>DWG NO.</b></p> <p><b>TI-1</b></p>