


**Tree Protection Note:**

The applicant is responsible for ensuring that tree protection hoarding is maintained throughout all phases of demolition and construction in the location and condition as approved by the Planning and Building Department. No materials (building materials, soil, etc.) may be stockpiled within the area of hoarding. Failure to maintain the hoarding as originally approved or the storage of materials within the hoarding will be cause for the Letter of Credit to be held for two years following completion of all site works. Hoarding must be inspected prior to the removal of any tree hoarding from the site.

Owner's Signature: \_\_\_\_\_

Date: \_\_\_\_\_

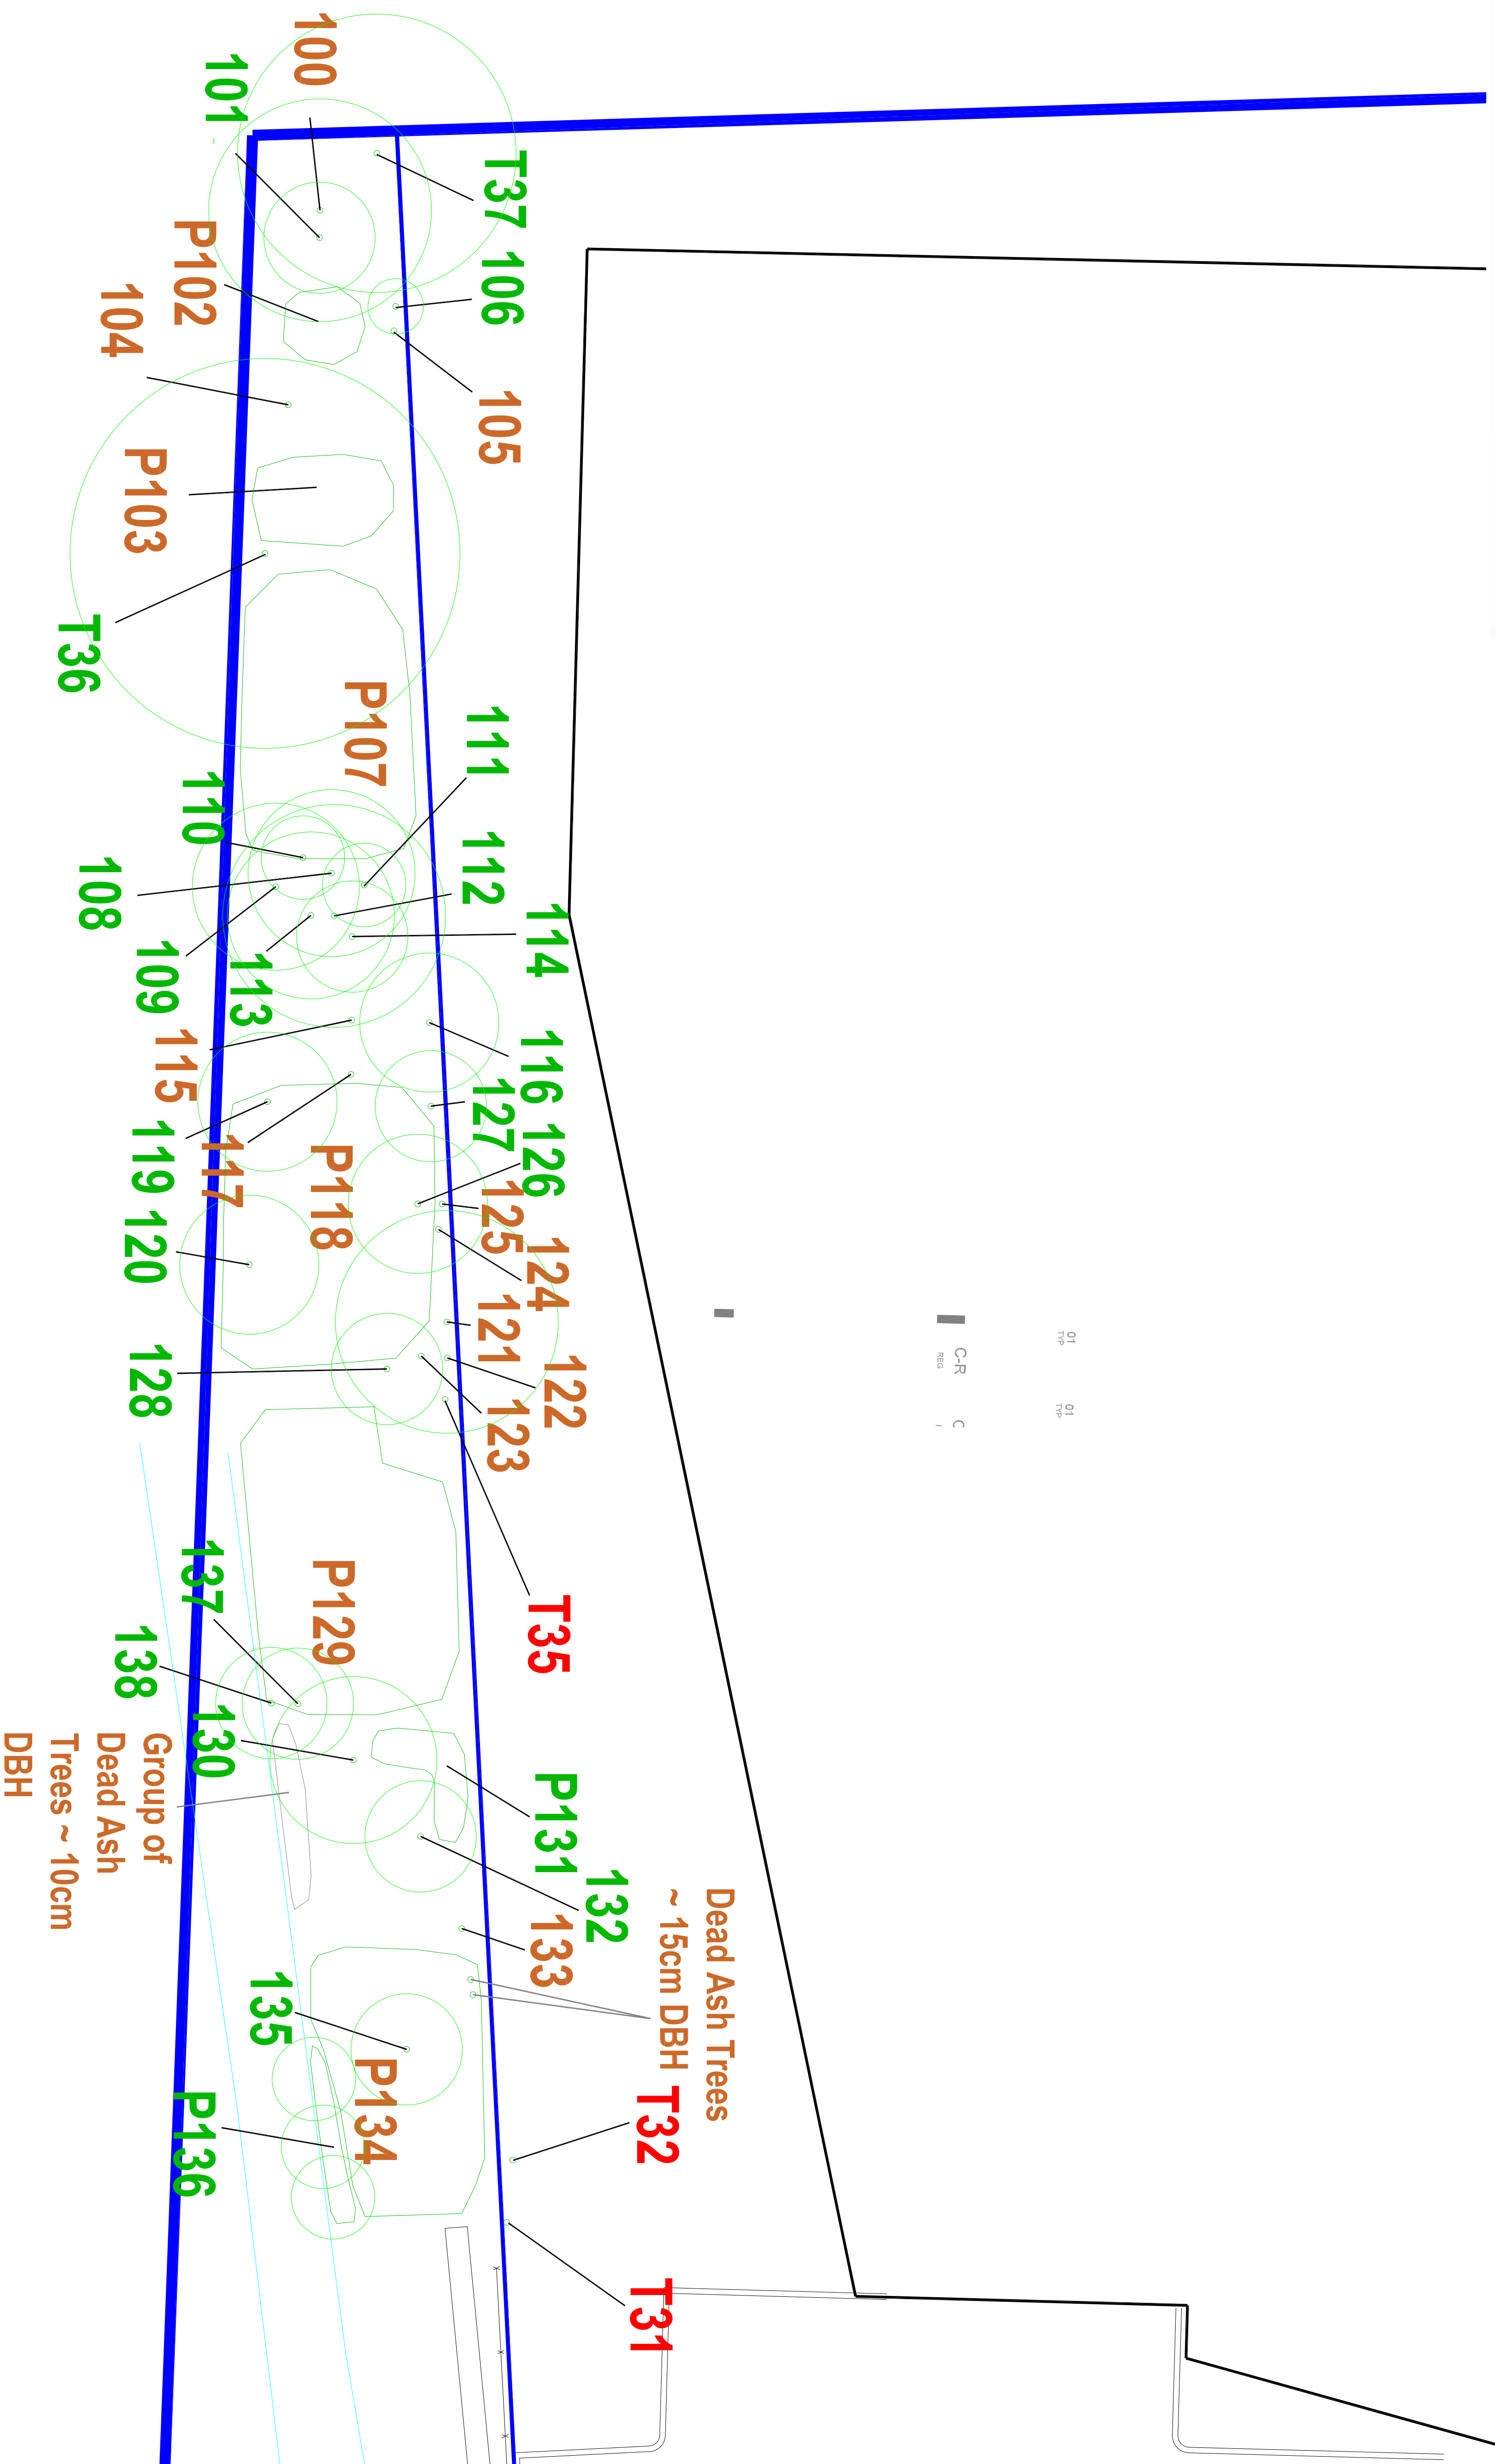

**LEGEND**

**Tree Inventory**

Refer to Table 1 of report dated 12 October 2021 for tree inventory information. Trees and large shrubs within the ravine area of the subject property were identified in the tree inventory.

**Tree Removals**

The removal of three trees is required to accommodate the proposed development. The removal of ten trees / shrubs and six tree / shrub polygons is recommended as part of the ravine rehabilitation stewardship efforts.

**Tree Preservation**

Preservation of 25 trees / shrubs will be possible with appropriate tree protection measures. Trees identified for preservation are indicated with GREEN labels. Tree protection measures will have to be implemented prior to construction in accordance with the Ferris + Associates Inc. preservation plan. Refer to Tree Protection Plan Notes for preservation details.

- Tree Label (GREEN), preservation recommended X
- Tree Label (RED), removal required due to development X
- Tree Label (ORANGE), removal recommended as part of the ravine rehabilitation stewardship efforts X
- Dripline (LIGHT GREEN circle)
- Estimated Location of Creek (CYAN)

**Specifications for the Protection and Preservation of Existing Vegetation**

The following notes are to be included on all tree preservation plans:

1. All existing trees, which are to remain, shall be fully protected with hoarding to City standards, erected beyond their "drip line" prior to the issuance of the Erosion and Sediment Control Permit, to the satisfaction of the Community Services Department. Groups of trees and other existing plantings to be protected, shall be treated in a like manner with hoarding around the entire clump(s). Areas within the protective fencing shall remain undisturbed and shall not be used for the storage of building materials or equipment.
2. No rigging cables shall be wrapped around or installed in trees. Surplus soil, equipment, debris or materials shall not be placed over root systems of the trees within the protective fencing. No contaminants will be dumped or flushed where feeder roots of trees exist.
3. The developer or his/her agents shall take every precaution necessary to prevent damage to trees or shrubs to be retained.
4. Where limbs or portions of trees are removed to accommodate construction work, they will be removed carefully in accordance with accepted arboricultural practices.
5. Where root systems of trees are exposed directly adjacent to or damaged by construction work, they shall be trimmed neatly and the area backfilled with appropriate material to prevent desiccation.
6. Where necessary, the trees will be given an overall pruning to restore the balance between roots and top growth or to restore the appearance of the trees.
7. Trees that have died or have been damaged beyond repair, shall be removed and replaced by the owner at the developer's own expense with trees of a size and species as approved by the Community Services Department.
8. If grades around trees to be protected are likely to change, the owner shall be required to take such precautions as dry walling, retaining walls and root feeding, to the satisfaction of the Community Services Department.

No.	Issue/Revisions	Date	By
1	Report Submission	12 Oct. 2021	KNH

Base Data: STUDIO Ila (file plan)

**KUNTZ FORESTRY CONSULTING INC.**  
 146 Lakeshore Road, West  
 PO Box 204  
 Oakville, ON L6K 0B3  
 T 289.837.1871  
 e consult@kuntzforestry.ca  
 web: www.kuntzforestry.ca

**Client**  
**STUDIOIla**  
 20 Champlain Boulevard, Suite 102  
 Toronto, Ontario M3H 2Z1

**Property**  
**2570 - 2590 Argyle Road**  
 Mississauga, Ontario

**Tree Inventory and Preservation Plan:  
 Ravine Rehabilitation Stewardship Efforts**

Project	P2950	Figure	<b>1</b>
Date	12 October 2021		
Scale	1:125		