



FINAL

Phase One Environmental Site Assessment

23, 25, 27, 29 and 31 Helene Street North, 53 Queen Street East
and Part of 70 Park Street East
Mississauga, Ontario

Prepared for:

**MPCT DIF 70 Park Street
East LP**

30 Adelaide Street East, Suite 301
Toronto, Ontario, M5C 3H1

December 20, 2022

Pinchin File: 314281.001



Phase One Environmental Site Assessment

23, 25, 27, 29 and 31 Helene Street North, 53 Queen Street East and Part of 70 Park Street East, Mississauga, Ontario
MPCT DIF 70 Park Street East LP

December 20, 2022

Pinchin File: 314281.001

FINAL

Issued To: MPCT DIF 70 Park Street East LP
Issued On: December 20, 2022
Pinchin File: 314281.001
Issuing Office: Mississauga, ON

Author:

Michaela Smith, B.Sc.H.
Project Technologist
905.299.1407
msmith@pinchin.com

Reviewer:

Francesco Gagliardi, C.E.T., LET, QP_{ESA}
Operations Manager, RSC Practice Specialist
289.678.0691
fgagliardi@pinchin.com



TABLE OF CONTENTS

1.0	EXECUTIVE SUMMARY	1
2.0	INTRODUCTION.....	4
2.1	Phase One Property Information	4
3.0	SCOPE OF INVESTIGATION.....	6
4.0	RECORDS REVIEW	6
4.1	General	6
4.1.1	Phase One Study Area Determination.....	7
4.1.2	First Developed Use Determination	7
4.1.3	Fire Insurance Plans	8
4.1.4	Chain of Title	10
4.1.5	Environmental Reports	11
4.1.5.1	Previous Environmental Report Summary	18
4.2	Environmental Source Information	18
4.2.1	Environmental Database Search – ERIS.....	18
4.2.1.1	National Pollutant Release Inventory	18
4.2.1.2	Ontario Inventory of PCB Storage Sites	19
4.2.1.3	National PCB Inventory	19
4.2.1.4	Certificates of Approval.....	19
4.2.1.5	Environmental Compliance Approvals, Permits To Take Water and Certificates of Property Use.....	20
4.2.1.6	Inventory of Coal Gasification Plants.....	20
4.2.1.7	Environmental Incidents, Orders, Offences and Spills	20
4.2.1.8	Waste Management Records	20
4.2.1.9	Fuel Storage Tanks	22
4.2.1.10	Notices and Instruments.....	22
4.2.1.11	Areas of Natural Significance	23
4.2.1.12	Landfill Information	23
4.2.1.13	Other ERIS Databases	23
4.2.2	Ministry of the Environment, Conservation and Parks Freedom of Information Search.....	24
4.2.3	Technical Standards and Safety Authority Search	24
4.2.4	Property Underwriters' Reports and Plans	25
4.2.5	City Directories.....	27
4.3	Physical Setting Sources	29
4.3.1	Aerial Photographs	29
4.3.2	Topography, Hydrology and Geology	30
4.3.3	Fill Materials.....	31
4.3.4	Water Bodies, Areas of Natural Significance and Groundwater Information.....	31
4.3.5	Well Records.....	32
4.4	Site Operating Records	32
5.0	INTERVIEWS.....	32
6.0	SITE RECONNAISSANCE	33
6.1	General Requirements	33
6.2	Specific Observations at Phase One Property	34
6.2.1	Description of Buildings and Structures.....	34
6.2.2	Description of Below-Ground Structures	34



Phase One Environmental Site Assessment

23, 25, 27, 29 and 31 Helene Street North, 53 Queen Street East and Part of 70 Park Street East, Mississauga, Ontario
MPCT DIF 70 Park Street East LP

December 20, 2022

Pinchin File: 314281.001

FINAL

6.2.3	Description of Tanks	35
6.2.4	Potable and Non-Potable Water Sources	35
6.2.5	Description and Location of Underground Utilities	35
6.2.6	Entry and Exit Points	35
6.2.7	Details of Heating System	35
6.2.8	Details of Cooling System	35
6.2.9	Details of Drains, Pits and Sumps	36
6.2.10	Unidentified Substances within Buildings and Structures	36
6.2.11	Details of Staining and Corrosion	36
6.2.12	Details of On-Site Wells	36
6.2.13	Details of Sewage Works	36
6.2.14	Details of Ground Cover	36
6.2.15	Details of Current or Former Railways	37
6.2.16	Areas of Stained Soil, Vegetation and Pavement	37
6.2.17	Areas of Stressed Vegetation	37
6.2.18	Areas of Fill and Debris Materials	37
6.2.19	Potentially Contaminating Activities	37
6.2.20	Unidentified Substances Outside Buildings and Structures	37
6.2.21	Surrounding Land Uses	37
6.3	Enhanced Investigation Property	38
6.4	Written Description of Investigation	39
6.4.1	Phase One Property	39
6.4.2	Phase One Study Area Outside of Phase One Property	40
7.0	REVIEW AND EVALUATION OF INFORMATION	41
7.1	Current and Past Uses	41
7.2	Potentially Contaminating Activities	41
7.3	Areas of Potential Environmental Concern	42
7.4	Phase One Conceptual Site Model	43
8.0	CONCLUSIONS	45
8.1	Signatures	46
8.2	Terms and Limitations	46
9.0	REFERENCES	48
10.0	APPENDICES	1



Phase One Environmental Site Assessment

23, 25, 27, 29 and 31 Helene Street North, 53 Queen Street East and Part of 70 Park Street East, Mississauga, Ontario
MPCT DIF 70 Park Street East LP

December 20, 2022
Pinchin File: 314281.001
FINAL

APPENDICES

APPENDIX A	Tables
APPENDIX B	Figures
APPENDIX C	Photographs
APPENDIX D	Survey Plan
APPENDIX E	Opta Records
APPENDIX F	ERIS Report
APPENDIX G	MECP FOI Search Results
APPENDIX H	TSSA Search Results
APPENDIX I	Aerial Photographs
APPENDIX J	Maps

TABLES

Table 1	Table of Current and Past Uses of the Phase One Property
Table 2	Table of Potentially Contaminating Activities
Table 3	Table of Areas of Potential Environmental Concern

FIGURES

Figure 1	Key Map
Figure 2	Phase One Property
Figure 3	Phase One Study Area
Figure 4	Potentially Contaminating Activities (On Site)
Figure 5	Potentially Contaminating Activities (Off Site)
Figure 6	Areas of Potential Environmental Concern



1.0 EXECUTIVE SUMMARY

Pinchin Ltd. (Pinchin) was retained by MPCT DIF 70 Park Street East LP (Client) to complete a Phase One Environmental Site Assessment (Phase One ESA) of the property located at 23, 25, 27, 29 and 31 Helene Street North, 53 Queen Street East and Part of 70 Park Street East in Mississauga, Ontario (hereafter referred to as the Site or Phase One Property). The Phase One Property is presently developed with a three-storey above-grade parking garage with retail space located on the ground level (Site Building), complete with an at-grade asphalt parking lot and landscaped areas. The Site Building also includes a single level underground parking garage.

Pinchin conducted this Phase One ESA in accordance with Part VII and Schedule D of the Province of Ontario's *Environmental Protection Act R.S.O. 1990, c. E.19* and *Ontario Regulation 153/04: Records of Site Condition – Part XV.1 of the Act*, as amended (O. Reg. 153/04). The purpose of the Phase One ESA was to assess the potential presence of environmental impacts at the Phase One Property due to activities at and near the Phase One Property.

This Phase One ESA was conducted at the request of the Client as a condition for the future redevelopment of the Phase One Property. It is Pinchin's understanding that the Phase One Property will be redeveloped from its current commercial land use to a mixed residential/commercial land use. Given that this constitutes a change to a more sensitive land use, the filing of a Record of Site Condition (RSC) for the Phase One Property with the Ontario Ministry of the Environment, Conservation and Parks (MECP) is a mandatory requirement of O. Reg. 153/04. As such, this Phase One ESA report has been prepared in accordance with O. Reg. 153/04 to support the filing of an RSC for the Phase One Property.

The scope of work for this Phase One ESA was consistent with O. Reg. 153/04 in support of filing an RSC and was comprised of the following:

- A Records Review: Reviewed available current and historical information sources pertaining to the Phase One Property and Phase One Study Area including the use of, but not limited to, aerial photographs, city directories, Fire Insurance Plans, Property Underwriters' Reports and Property Underwriters' Plans, historical environmental assessments relevant to the Phase One Property and a regulatory data base search. Regulatory agencies were also contacted to identify if any records of environmental non-compliance or other information associated with the environmental condition of the Phase One Property exists, including searches of MECP and Technical Standards and Safety Authority records.



- Interviews: Conducted interviews with Site Representatives (see Section 5.0) to determine if any current or historical operations have caused a concern with respect to the environmental condition of the Phase One Property and the surrounding properties within the Phase One Study Area.
- Site Reconnaissance: Completed a visual assessment of the Phase One Property and the surrounding properties within the Phase One Study Area (from publicly-accessible areas) including any associated buildings and/or facilities for the purpose of identifying the presence of potentially contaminating activities (PCAs).
- Evaluation: Evaluated the information gathered from the records review, interviews and Site reconnaissance.
- Reporting: Prepared a Phase One ESA report.
- Submission: Submitted the Phase One ESA report to the Client.

The Phase One Property consists of part of two lots situated at the municipal addresses of 23, 25, 27, 29 and 31 Helene Street North, 53 Queen Street East and Part of 70 Park Street East, Mississauga, Ontario and is currently owned by MPCT DIF 70 Park Street East LP. The Phase One Property is part of a larger property, which includes the above listed addresses as well as the remainder of the 70 Park Street East property. The Phase One Property is located on the southeast side of Queen Street East and the northeast side of Helene Street North. The current and past land uses of the Phase One Property are summarized in Table 1 (all Tables are provided in Appendix A and all appendices are provided in Section 10.0).

To the best of Pinchin's knowledge, the Phase One Property was developed sometime prior to 1928. The use of the property at this time is unknown, and it is assumed that it was used for residential purposes. The current building on the Phase One Property is assumed to have been built between 1966 and 1974 based on a review of aerial photographs provided by the City of Toronto Archives and Google Earth™, and is currently used as a parking garage for the adjacent multi-tenant residential building located at 70 Park Street East, and additionally contains five commercial retail units.

Based on the findings of this Phase One ESA, Pinchin identified two PCAs at the Phase One Property (i.e., on-Site) and 19 PCAs within the Phase One Study Area outside of the Phase One Property (i.e., off-Site) as summarized in Table 2. Of the off-Site PCAs, 18 are not considered to result in APECs at the Phase One Property given their distance from the Phase One Property and/or their downgradient or transgradient location with respect to the inferred groundwater flow direction at the Phase One Property. The remaining one off-Site PCA and two on-Site PCAs result in a total of three APECs at the Phase One Property.



The three PCAs that result in APECs at the Phase One Property include road salting activities on the parking lot and sidewalks at the Phase One Property, a hydro-vault present in the southern section of the Site Building adjacent to the parking lot, and coal storage and general industrial uses off-site of the Phase One Property. It is to be noted that it is the opinion of the QP_{ESA} supervising the Phase One ESA that, although salt-related parameters such as Sodium Adsorption Ratio and electrical conductivity in soil and sodium and chloride in groundwater may be present at concentrations exceeding the applicable Site Condition Standards (i.e., Table 3), the exemption provided in Section 49.1 of O. Reg. 153/04 can be applied. As such, these parameters would be deemed to meet the Site Condition Standards and do not need to be further assessed as part of a Phase Two ESA.

All APECs identified during the Phase One ESA, as well as their respective PCAs, contaminants of potential concern (COPCs) and the media which could potentially be impacted, are summarized in Table 3. The COPCs associated with each APEC were determined based on several sources of information including, but not limited to, Pinchin's experience with environmental contamination and hazardous substances, common industry standards for analysis of such contaminants and point sources, literature reviews of COPCs and associated hazardous substances, and evaluations of contaminant mobility and susceptibility for migration in the subsurface.

Pinchin recommends that a Phase Two ESA, defined as an "assessment of property conducted in accordance with the regulations by or under the supervision of a qualified person to determine the location and concentration of one or more contaminants in the land or water on, in or under the property", be conducted at the Phase One Property. Pinchin concludes that one or more contaminants originating from PCAs located on the Phase One Property and within the Phase One Study Area outside of the Phase One Property may have affected land or water on, in, or under the Phase One Property. Therefore, Pinchin recommends that a Phase Two ESA be conducted prior to filing an RSC for the Phase One Property.

This Executive Summary is subject to the same standard limitations as contained in the report and must be read in conjunction with the entire report.



2.0 INTRODUCTION

A Phase One ESA is defined as a systematic qualitative process to determine whether a particular property is, or may be subject to, actual or potential contamination. Under the Province of Ontario's *Environmental Protection Act R.S.O. 1990, c. E.19* (EPA) and *Ontario Regulation 153/04: Records of Site Condition – Part XV.1 of the Act*, as amended (O. Reg. 153/04), the purpose of a Phase One ESA is two-fold:

- To obtain and review records that relate to the Phase One Property, and to the current and past uses of and activities at or affecting the Phase One Property, in order to determine if an APEC exists and to interpret any APEC; and
- To obtain and review records that relate to properties in the Phase One Study Area, other than the Phase One Property, in order to determine if a PCA exists and interpret whether any such PCA results in an APEC at the Phase One Property.

This Phase One ESA was conducted at the request of the Client as a condition for the future redevelopment of the Phase One Property. It is Pinchin's understanding that the Phase One Property will be redeveloped from its current commercial land use to a mixed residential/commercial land use. Given that this constitutes a change to a more sensitive land use, the filing of an RSC for the Phase One Property with the Ontario Ministry of the Environment, Conservation and Parks (MECP) is a mandatory requirement of O. Reg. 153/04. As such, this Phase One ESA report has been prepared in accordance with O. Reg. 153/04 to support the filing of an RSC for the Phase One Property.

A Phase One ESA does not include sampling or testing of environmental media or building materials. The study period for this assessment was from September 2022 to October 2022, which included the records review, Site reconnaissance, interviews, and reporting.

2.1 Phase One Property Information

The Phase One Property consists of part of two lots situated at civic addresses 23, 25, 27, 29 and 31 Helene Street North, 53 Queen Street East and Part of 70 Park Street East, Mississauga, Ontario which are currently owned by 70 Park Street East Inc. The Phase One Property is part of a larger property, which includes the above listed addresses as well as the remainder of the 70 Park Street East property. The Phase One Property is located on the southeast side of Queen Street East and the northeast side of Helene Street North, as shown on Figure 1 (all Figures are provided in Appendix B). A plan showing the Phase One Property is provided as Figure 2, and the Phase One Study Area for which this Phase One ESA applies to is outlined on Figure 3. Photographs of the Phase One Property and surrounding properties are presented in Appendix C. A current legal survey of the Phase One Property is included in Appendix D. The extent of the Phase One Property has been marked up on the legal survey.



Phase One Environmental Site Assessment

23, 25, 27, 29 and 31 Helene Street North, 53 Queen Street East and Part of 70 Park Street East, Mississauga, Ontario
MPCT DIF 70 Park Street East LP

December 20, 2022
Pinchin File: 314281.001
FINAL

Pertinent details of the Phase One Property are provided in the following table:

Detail	Source / Reference	Information
Legal Description	Legal Survey Drawing provided by the Client	Lots 4 and 5 of Registered Plan PC2, Mississauga
Municipal Address	http://www6.mississauga.ca/missmaps/#map=16/-8867433.01/5421611.35/0.9075712110370517 , Client	23, 25, 27, 29 and 31 Helene Street, 53 Queen Street East and part of 70 Park Street East, Mississauga, Ontario, L5G 3B6
Parcel Identification Number (PIN)	Geowarehouse™	13463-0006 (LT)
Current Owner	Client	70 Park Street East Inc
Owner Contact Information	Client	70 Park Street East Inc c/o MPCT DIF 70 Park Street East LP 30 Adelaide Street East, Suite 301 Toronto, ON M5C 3H1 pcope@dream.ca
Current Occupant(s)	Client	23 Helene Street North: GeLatte 25 Helene Street North: Tech Solutions 27 Helene Street North: Vape 2 Go 29 Helene Street North: Impressive Salon and Spa 31 Helene Street North: Go Mart Variety
Client	Authorization to Proceed Form for Pinchin Proposal	MPCT DIF 70 Park Street East LP
Client Contact Information	Authorization to Proceed Form for Pinchin Proposal	Paul Cope c/o MPCT DIF 70 Park Street East LP30 Adelaide Street East, Suite 301 Toronto, ON M5C 3H1 pcope@dream.ca
Approximate Site Area	Google Earth™	5,045 m ² (1.25 acres)
Current Zoning	https://www.mississauga.ca/apps/#/property/view/zoning-information	RA5-27 - Apartment
Centroid UTM Co-ordinates	Google Earth™	614215 Easting
		482357 Northing
		Zone 17N



3.0 SCOPE OF INVESTIGATION

Pinchin conducted this Phase One ESA in accordance with O. Reg. 153/04, in particular Part VII and Schedule D of O. Reg. 153/04. The Phase One ESA scope of work was comprised of the following:

- **A Records Review:** Pinchin reviewed available current and historical information sources pertaining to the Phase One Property and surrounding properties within the Phase One Study Area including the use of, but not limited to, aerial photographs, city directories, Fire Insurance Plans (FIPs), Property Underwriters' Reports (PURs), Property Underwriters' Plans (PUPs), historical environmental assessments relevant to the Phase One Property, available Site operating records and a regulatory data base search. Regulatory agencies were also contacted to identify if any records of environmental non-compliance or other information associated with the environmental condition of the Phase One Property exist, including the MECP's Freedom of Information and Protection of Privacy Office and the Technical Standards and Safety Authority (TSSA).
- **Interviews:** Pinchin conducted interviews with Site Representatives (see Section 5.0) to determine if any current or historical operations have caused a concern with respect to the environmental condition of the Phase One Property and the surrounding properties within the Phase One Study Area.
- **Site Reconnaissance:** Pinchin completed a visual assessment of the Phase One Property and the surrounding properties within the Phase One Study Area (from publicly-accessible areas) including any associated for the purpose of identifying the presence of potentially contaminating activities (PCAs).
- **Evaluation:** Pinchin evaluated the information gathered from the records review, interviews and Site reconnaissance.
- **Reporting:** Pinchin prepared a Phase One ESA report summarizing the findings of the Phase One ESA.
- **Submission:** Pinchin submitted the Phase One ESA report to the Client.

4.0 RECORDS REVIEW

4.1 General

Identified on-Site and off-Site PCAs described in this and subsequent report Sections are summarized in Table 2 and their locations are shown on Figure 4 (on-Site PCAs) and Figure 5 (off-Site PCAs). APECs at the Phase One Property are illustrated on Figure 6.



Each on-Site PCA is associated with an APEC at the Phase One Property. Each off-Site PCA was characterized as to whether it resulted in an APEC at the Phase One Property. In making this determination, the proximity, location relative to the inferred groundwater flow direction, nature of operations and potential contaminants were considered. In general, PCAs that were relatively close to the Phase One Property and/or were at properties upgradient of the Phase One Property with respect to the inferred groundwater flow direction were considered PCAs resulting in APECs. Conversely, PCAs that were distant from the Phase One Property and/or were at properties downgradient or transgradient of the Phase One Property with respect to the inferred groundwater flow direction were not considered PCAs resulting in APECs. The type of operations and potential contaminants associated with the PCAs were also evaluated. Factors such as whether the PCA had a high probability of contamination (e.g., dry cleaners, retail fuel outlets (RFOs), automotive service garages, etc.) and mobility of the potential contaminants in the subsurface were considered during the evaluation.

4.1.1 Phase One Study Area Determination

Based on a review of the available historical information and observations made during the Site reconnaissance for the properties greater than 250 metres (m), but less than 1 kilometre (km), from the Phase One Property boundary, Pinchin did not note or observe any significant potentially contaminating properties that should be included as part of this assessment (e.g., landfills, large industrial manufacturers, etc.). As such, the Phase One Study Area consisted of the Phase One Property, as well as all properties situated wholly, or partly, within 250 m from the nearest point of a boundary of the Phase One Property, in order to meet the minimum requirements set forth in O. Reg. 153/04.

4.1.2 First Developed Use Determination

The first developed land use of the Phase One Property is defined by O. Reg. 153/04 to be the earlier of:

- The first use of a Phase One Property in or after 1875 that resulted in the development of a building or structure on the property; and
- The first potentially contaminating use or activity on the Phase One Property.

The Phase One Property was first listed in the city directories in 1961, at which time a section of the property was listed as being occupied for residential purposes. Therefore, it is Pinchin's opinion that the first developed use of the Phase One Property was prior to 1961.

To the best of Pinchin's knowledge, buildings and structures had been constructed on the Phase One Property prior to 1931, based on a review of a 1931 aerial photograph that showed the Phase One Property to have residential buildings located on it. The 1928 fire insurance plan (FIP) showed residential buildings located on the Phase One Property. Based on a comparison of the 1931 aerial photograph and the 1928 FIP, the first developed use of the Phase One Property occurred sometime before 1928.



The date of the first developed use of the Phase One Property was determined through a review of city directories, FIPs, aerial photographs and previous reports. No other information was reviewed by Pinchin during the records review or obtained during the Site reconnaissance or interviews which would have resulted in a different interpretation of the date of first developed use of the Phase One Property.

4.1.3 Fire Insurance Plans

Pinchin reviewed FIPs dated 1910, 1928 and 1952 from Pinchin's in-house FIP database. As part of this Phase One ESA, Pinchin contacted Opta Information Intelligence (Opta) and determined that no additional FIPs were available.

The following general information, including details regarding the Phase One Property, was noted in the FIPs:

1910

- Details of the Phase One Property, as well as properties farther to the northeast and northwest were not included.
- The Phase One Property was bounded by Park Street to the southeast and Helene Street North to the southwest.
- The Phase One Study Area to the south of the Phase One Property consisted of primarily residential and institutional buildings.

1928

- The Phase One Property was occupied by one residential building with the municipal address of 78 Park Street.
- The surrounding properties were mostly occupied with residential buildings.
- To the northwest of the Phase One Property, on the northwest side of Queen Street East, buildings associated with coal storage were present. The coal storage building located closest to the Phase One Property was located approximately 20 m northwest of the Phase One Property and was located hydraulically upgradient of the Phase One Property relative to the inferred groundwater flow direction.
- To the northwest of the Phase One Property, on the northwest side of Queen Street East, buildings associated with a railway line were present. The railway line was located approximately 25 m northwest of the Phase One Property and was located hydraulically upgradient of the Phase One Property relative to the inferred groundwater flow direction.



- To the northeast of the Phase One Property, located at 66 Park Street and 135, 137 and 139 Hurontario Street (present day 30 Queen Street East), was labelled as 'W.H. Thompson' and developed with a planning mill with carpentry and lumber storage activities. This property was located approximately 55 m northeast of the Phase One Property and was located hydraulically up/transgradient of the Phase One Property relative to the inferred groundwater flow direction.
- To the northeast of the Phase One Property, located north of the intersection of Hurontario Street and the railway lines, was a coal and wood yard, likely associated with the railway lines. This property was located approximately 185 m northeast of the Phase One Property and was located hydraulically up/transgradient of the Phase One Property relative to the inferred groundwater flow direction.
- To the northeast of the Phase One Property, located south of the intersection of Hurontario Street and the railway lines northwest of the Phase One Property, were two Imperial Oil tanks, likely associated with the railway lines. This property was located approximately 185 m northeast of the Phase One Property and was located hydraulically up/transgradient of the Phase One Property relative to the inferred groundwater flow direction.

1952

- The Phase One Property was similar to that observed in 1928, with the exception of an additional building constructed with the municipal address of 29 Helene Street North, on the location of the current Site Building, as well as the residential dwelling's municipal address having been changed to 70 Park Street East.
- To the southeast of the Phase One Property, located at 136 Lakeshore Road East, was a motor repair shop with two associated USTs. This property was located approximately 240 m southeast of the Phase One Property and was located hydraulically downgradient of the Phase One Property relative to the inferred groundwater flow direction.
- W.H. Thompson was still located at 66 Park Street and 135, 137 and 139 Hurontario Street (present day 30 Queen Street East) and had one UST in the central-eastern portion of the property. This property was located approximately 55 m northwest of the Phase One Property and was located hydraulically up/transgradient of the Phase One Property relative to the inferred groundwater flow direction.
- The coal storage buildings associated with the railway tracks northwest of the Phase One Property were still present.



Based on Pinchin's review of the information provided in the FIPs, the following is noted:

- No PCAs were identified at the Phase One Property.
- The following PCAs were located within the Phase One Study Area outside of the Phase One Property and were identified to result in one APEC at the Phase One Property:
 - Coal storage was located approximately 20 m northwest of the Phase One Property in 1928 and 1952;
- The following PCAs located within the Phase One Study Area outside of the Phase One Property were identified but are not considered to result in APECs at the Phase One Property:
 - W.H. Thompson, a planing mill with associated carpentry, was located at 30 Queen Street East, approximately 55 m northeast of the Phase One Property in 1928 and 1952;
 - A UST associated with W.H. Thompson, located at 30 Queen Street East, approximately 55 m northeast of the Phase One Property in 1952;
 - A motor repair shop, located at 136 Lakeshore Road East, approximately 240 m southeast of the Phase One Property in 1952; and
 - Two USTs, located at 136 Lakeshore Road East, approximately 240 m southeast of the Phase One Property in 1952.
 - A railway line was located approximately 25 m northwest of the Phase One Property in 1928 and 1952;
 - Additional coal storage was located approximately 185 m northeast of the Phase One Property in 1928 and 1952; and
 - Oil fuel storage was located approximately 185 m northeast of the Phase One Property in 1928 and 1952.

4.1.4 Chain of Title

A chain of title search was not completed for the Phase One ESA. The available historical records reviewed by Pinchin included aerial photographs from 1931, 1946, 1950, 1966, 1974, 1984, 1992, 2002, 2012 and 2019, FIPs from 1910, 1928 and 1952, and city directories for various years between 1961 and 2001. These records did not provide sufficient information to trace the owners of the Phase One Property back to the date of first developed use, and it was Pinchin's opinion that a chain of title search would be required upon the filing of an RSC.



4.1.5 Environmental Reports

The following previous environmental reports for the Phase One Property and properties located within the Phase One Study Area provided by the Client, or prepared by Pinchin, were reviewed by Pinchin:

Port Credit Go Station, 30 Queen Street East

- Report entitled “*Port Credit GO Station 30 Queen Street East, Mississauga, Ontario, Geotechnical Investigation Report*”, prepared by Englobe Corp. (Englobe) and dated February 25, 2016 (2016 Englobe Geotechnical Report).
- Report entitled “*Phase One Environmental Site Assessment Portion of 30 Queen Street East, Mississauga, Ontario*”, prepared by Englobe and dated August 2020 (2020 Englobe Phase One ESA).
- Report entitled “*Phase Two Environmental Site Assessment Portion of 30 Queen Street East, Mississauga, Ontario*”, prepared by Englobe and dated October 2020 (2020 Englobe Phase Two ESA).
- Letter entitled “*Opinion of Inferred Hydrogeological Conditions, 30 Queen Street East, Mississauga, Ontario*”, prepared by Arcadis Canada Inc. (Arcadis) and dated January 24, 2022 (2022 Arcadis Hydrogeological Conditions Letter).

84 & 90 High Street East, 17 & 19 Ann Street and Part of 91 Park Street East

- Report entitled “*Phase One Environmental Site Assessment 84, 90 High Street East, 17, 19 Ann Street East and Part of 91 Park Street East, Mississauga, Ontario*”, prepared by exp and dated January 12, 2021 (2021 exp Phase One ESA).
- Report entitled “*Phase Two Environmental Site Assessment 84, 90 High Street East, 17, 19 Ann Street and Part of 91 Park Street East, Mississauga, Ontario*”, prepared by exp and dated August 24, 2021 (2021 exp Phase Two ESA).
- Report entitled “*Proposed Mixed-Use Redevelopment: 17 & 19 Ann Street, 84 & 90 High Street East and Part of 91 Park Street East, Mississauga, ON*”, prepared by exp and dated December 17, 2021 (2021 exp Proposed Redevelopment).

Phase One Property – 23 – 31 Helene Street North and 53 Queen Street East

- Report entitled “*Phase I Environmental Site Assessment 70 Park Street East, 23 – 31 Helene Street North and 53 Queen Street East, Mississauga, Ontario*”, prepared by Pinchin and dated April 4, 2022 (2022 Pinchin Phase I ESA).

Pinchin reviewed the available soil and groundwater sample analytical data provided in the above-referenced reports to assess whether there are any known soil and groundwater impacts at the Phase One Property or on properties within the Phase One Study Area.



Given the available information on the characteristics of the Phase One Property and its future land use (i.e., residential), the applicable Site Condition Standards, as defined by the MECP in the document “*Soil, Ground Water and Sediment Standards for Use Under Part XV.1 of the Environmental Protection Act*”, dated April 15, 2011, are:

- *Table 3: Full Depth Generic Site Condition Standards in a Non-Potable Groundwater Condition (Table 3 Standards)* for residential property use (i.e., the proposed future use of the Phase One Property) and medium/fine-textured soils.

As such, the analytical data provided in the previous reports were compared with the *Table 3 Standards* to assess whether there are any known areas on the Phase One Property or in the Phase One Study Area where soil or groundwater has parameter concentrations exceeding the *Table 3 Standards*.

A summary of the salient information identified in the reports is provided below.

Port Credit Go Station, 30 Queen Street East

2016 Englobe Geotechnical Report Summary

The 2016 Englobe Geotechnical report presented the findings of a geotechnical investigation of the Port Credit GO Station at 30 Queen Street East, Mississauga. This purpose of this investigation was to determine the subsoil/rock conditions in order to provide recommendations for design of the foundation for the proposed two 22-storey buildings, including 4 levels of below grade parking. Based on Pinchin’s review of the 2016 Englobe Geotechnical Report, the following salient information was noted:

- The subgrade soil at the borehole locations was observed to consist of a mix of sandy silt, clayey silt and till (silty sand, sandy silt, clayey silt).
- Bedrock was located at approximately 9.0 to 10.5 mbgs, comprised of grey shale (Georgian Bay Formation) with limestone inclusions.
- Groundwater measurements conducted in the open boreholes upon completion of drilling indicated groundwater levels of 7.0, 9.1, and 4.0 mbgs, with no water levels observed in the other boreholes.

Two soil samples were submitted to Maxxam for analysis of soil chemistry. The laboratory results indicated that percentage of sulphate (SO₄) in the soil samples tested is between 0.008 and 0.025% and maximum chloride content in the samples tested was 710 µg/g. Based on these test results, there was no significant potential for sulphate attack.



2020 Englobe Phase One ESA Summary

The 2020 Englobe Phase One ESA presented the findings of a Phase One ESA completed by Englobe in general accordance with the CSA document entitled "*Phase I Environmental Site Assessment*" (CSA Document Z768-01), dated November 2001 (reaffirmed 2006), including a review of readily available historical records and reasonably ascertainable regulatory information, a Site reconnaissance, interviews, an evaluation of information and reporting for a portion of 30 Queen Street East. Based on Pinchin's review of the 2020 Englobe Phase One ESA Summary, the following salient information was noted:

- The property consisted of an asphalt-paved parking lot used for the GO Station, and no buildings were present.
- The property had previously been used as a lumber yard, composed of several buildings.
- 14 PCAs were identified on the property and on surrounding properties.
- Six APECs were identified on the property due to current and historical PCAs identified both on the property and on surrounding properties.

Englobe stated that a subsurface environmental investigation (Phase Two ESA) would be required and was recommended in order to assess the environmental quality of the soil and groundwater on the property.

2020 Englobe Phase Two ESA Summary

The Englobe Phase Two ESA was completed to further investigate the soil and groundwater quality and to address the potential issues and contaminants of concern (COCs) identified in the 2020 Englobe Phase One ESA for a portion of 30 Queen Street East.

Englobe drilled eight boreholes to depths ranging from 3.05 to 6.10 mbgs, with four of the boreholes completed as groundwater monitoring wells. Soil stratigraphy at the Englobe borehole locations generally consisted of surficial pavement structure underlain by fill overlying native deposits of silt and clay. Groundwater depths ranged from approximately 0.74 to 3.55 mbgs.

Soil and groundwater samples were submitted for the laboratory analyses of petroleum hydrocarbon fractions in the range of F1 to F4 (PHCs), benzene, toluene, ethylbenzene and xylenes (BTEX), polycyclic aromatic hydrocarbons (PAHs), volatile organic compounds (VOCs) and/or metals, and soil samples were submitted for the laboratory analysis of sodium adsorption ratio (SAR), electrical conductivity (EC), pH; and/or grain size. The results of the laboratory analyses were compared by Englobe with the *Table 3 Standards* and the following exceedances of the *Table 3 Standards* were identified:

- SAR: Soil samples collected from monitoring wells MW-01-20, MW-02-20, MW-03-20, MW-08-20 and MW-108D-20 and from boreholes BH-04-20, BH-05-20, BH-06-20 and BH-07-20 (14.7 SAR vs. the *Table 3 Standard* of 5 SAR).



- EC: Soil samples collected from monitoring wells MW-01-20, MW-02-20 and MW-03-20 and from boreholes BH-04-20, BH-05-20, BH-06-20 and BH-07-20 (1.08 through 3.18 mS/cm vs. the *Table 3 Standard* of 0.7 mS/cm).
- Sodium: Groundwater sample and its duplicate collected from monitoring well MW-02-20 (10,100,000 ug/L vs. the *Table 3 Standard* of 2,300,000 ug/L).

Englobe noted that the SAR and EC exceedances in the soil samples collected throughout the property, and the sodium exceedances in the groundwater sample collected at monitoring well MW-02-20 are likely solely due to the application of road salt for the safety of vehicular or pedestrian traffic under conditions of snow or ice or both.

After completion of the report, it was Englobe's opinion that the property met the requirements for the filing of an RSC under O.Reg 153/04, and therefore no further work was warranted at that time.

2022 Arcadis Hydrogeological Conditions Letter Summary

The 2022 Arcadis Hydrogeological Conditions Letter presented an opinion on the inferred hydrogeological conditions at 30 Queen Street East, Mississauga. Based on Arcadis' previous ESAs at neighbouring properties, the following information was given:

- It was anticipated that the stratigraphic and hydrogeological conditions at the 30 Queen Street East property would be similar to those encountered at the Park-Ann Street Property given the close proximity of the properties as well as the similar settings of the two properties. The following information was given in regards to this property:
 - The stratigraphy at the 78 Park Street East, 22, 24, 26 and 28 Ann Street Property was found to be fill to a maximum depth of approximately 1.5 m below grade underlain by sandy silt or silty clay or silt till to a maximum depth of approximately 8.9 m below grade. The top of bedrock (shale) was encountered at a depth of approximately 8.1 m below grade.
 - Groundwater levels were encountered at depths from approximately 5.2 to 6.7 m below grade in the overburden monitoring wells and from approximately 4.6 to 11.1 m below grade in the bedrock monitoring wells. Groundwater flow was interpreted to be towards the southwest, influenced by the Credit River to the west and Lake Ontario to the south.
 - Hydraulic conductivity ranged from approximately 3.7×10^{-5} to 4.2×10^{-5} cm/sec in the overburden (silt till), from approximately 1.4×10^{-5} to 2.8×10^{-5} cm/sec in the weathered shale bedrock and from approximately 5.6×10^{-8} to 1.0×10^{-6} cm/sec in the sound shale bedrock.



- Reported concentrations (except chloride) in groundwater were below the MECP Table 3 SCSs according to Arcadis. Chloride was determined to be naturally elevated in groundwater in this area and thus not indicative of contamination.
- The analytical results indicated that total suspended solids (TSS), total Kjeldahl nitrogen (TKN), aluminum, copper, manganese, phosphorus and zinc were present at concentrations that exceeded the storm sewer standard in analyzed unfiltered groundwater samples while TSS and manganese were present at concentrations above the sanitary sewer bylaw criteria.

84 & 90 High Street East, 17 & 19 Ann Street and Part of 91 Park Street East

2021 exp Phase One ESA Summary

The 2021 exp Phase One ESA presented the findings of a Phase One ESA completed by exp in general accordance with the CSA Document Z768-01, dated November 2001 (reaffirmed 2006), including a review of readily available historical records and reasonably ascertainable regulatory information, a Site reconnaissance, interviews, an evaluation of information and reporting for the addresses of 84 and 90 High Street East, 17 and 19 Ann Street and a parking lot with no municipal address. Based on Pinchin's review of the 2021 exp Phase One ESA Summary, the following salient information was noted:

- This property was developed with multiple residential buildings as well as a retail building.
- This property was assumed to have been developed in 1909 for residential use.
- The following potential environmental concern was noted:
 - A lumber yard was located to the north of the site, where wood was treated and chemical extraction processes occurred.

exp recommended a Phase Two ESA based on the findings of this report in order to assess the groundwater conditions at the site prior to filing of an RSC.

2021 exp Phase Two ESA Summary

The exp Phase Two ESA was completed to further investigate the soil and groundwater quality and to address the potential issues and contaminants of concern (COCs) identified in the 2021 exp Phase One ESA for the addresses of 84 and 90 High Street East, 17 and 19 Ann Street and a parking lot with no municipal address.

exp drilled twelve boreholes to depths ranging from 4.9 to 15.9 mbgs, with eight of the boreholes completed as groundwater monitoring wells. Soil stratigraphy at the exp borehole locations generally consisted of asphalt/topsoil at the surface generally overlying layers of fill/reworked native, followed by sandy silt and clayey silt till. Bedrock was encountered at depths ranging from 7.44 and 9.14 mbgs. Groundwater depths ranged from approximately 3.79 mbgs (BH/MW3S) to 11.19 mbgs (BH/MW5D).



Soil and groundwater samples were submitted for the laboratory analyses of metals (including As, Sb and Se), Cr(VI), and Hg, soil samples were submitted for the laboratory analysis of PAHs, B-HWS, cyanide, EC, SAR and pH, and groundwater samples were submitted for the laboratory analysis of PHCs including BTEX, VOCs, Chlorophenols and sodium. The results of the laboratory analyses were compared with the *Table 3 Standards* by exp and no exceedances of the *Table 3 Standards* were identified.

exp also found fill material in six of the boreholes (BH3D, BH3S, BH4, BH8, BH9 and BH10). The fill material consisted of brown clayey silt, sandy silt with trace clay, rootlets and black sand. This layer extended to depths varying from 0.90 m to 2.57 m below the existing ground surface.

Based on the findings of this investigation, exp did not recommend any further environmental investigations.

2021 exp Proposed Redevelopment Summary

The 2021 exp Proposed Redevelopment report presented a geotechnical investigation carried out for a proposed mixed-use redevelopment at the addresses of 84 and 90 High Street East, 17 and 19 Ann Street and includes the west portion of a parking lot generally known as 91 Park Street East. The purpose of this investigation was to determine the subsurface conditions at this property by drilling boreholes to provide geotechnical engineering guidelines for the design and construction of the proposed development.

exp drilled a total of ten boreholes, with depths of seven boreholes ranging from 15.4 m to 15.9 m below the existing grade in the vicinity of the new development, and with depths of two boreholes ranging from 4.9 m to 5.3 m below the existing grade in the area of the property that was planned to be used as conveyance land, with six of the boreholes completed as groundwater monitoring wells. Soil stratigraphy at the exp borehole locations generally consisted of asphalt/topsoil at the surface generally overlying layers of fill, followed by sandy silt and clayey silt till. Bedrock was encountered at depths ranging from approximately 7.5 to 9.25 mbgs. Groundwater depths ranged from approximately 4.8 meters below grade (mbg) (BH2) to 11.2 mbg (BH5).

Phase One Property – 23 – 31 Helene Street North, 53 Queen Street East and 70 Park Street East

2022 Pinchin Phase I ESA Summary

The 2022 Pinchin Phase I ESA presented the findings of a Phase I ESA completed by Pinchin in general accordance with the CSA Document Z768-01, dated November 2001 (reaffirmed 2016), including a review of readily available historical records and reasonably ascertainable regulatory information, a Site reconnaissance, interviews, an evaluation of information and reporting. The Phase I ESA was completed for the Phase One Property and the remaining portion of 70 Park Street East.



Based on Pinchin's review of the 2022 Pinchin Phase I ESA Summary, the following salient information was noted:

- At the time of the Site reconnaissance, the Phase One Property was used as a four-storey parking garage complete with five ground level commercial units at 23 – 31 Helene Street North and 53 Queen Street East built in 1971 (Site Building).
- A former possible dry cleaner was noted as operating in the Site Building. It was also noted that this possible dry cleaner was a dry-cleaning depot and no dry-cleaning operations had occurred on the property. Given this information, this has not been classified as a PCA.
- Occupants of the Site Building have always conducted retail operations.
- Tenants in 23 – 31 Helene Street North consisted of retail operations;
- The adjacent building located at 70 Park Street East was developed as a 27-storey multi-tenant residential building complete with penthouse mechanical rooms, built in 1971. Possible three hot water boilers with oil as a fuel type. However, it was noted in this report that the Site Representative had told the Pinchin assessor that the building had always been heated electrically, and that there had never been oil-fueled boilers at the property. Given this information, this has not been classified as a PCA.
- The following are noted as PCAs:
 - A railway line was located approximately 25 m northwest of the Phase One Property.
 - The Site Building reportedly contained a hydro vault.
 - Buildings associated with the railway lines, including coal storage buildings. The closest coal storage building to the Phase One Property was approximately 20 m northwest of the Phase One Property.
 - A planing mill with carpentry and lumber storage was located approximately 55 m northeast of the Phase One Property.
 - Additional buildings had been constructed at the planing mill, including the addition of a UST located in the east-central portion of this property.

Pinchin did not identify anything that was likely to result in potential subsurface impacts at the Phase One Property or remaining portion of 70 Park Street East, and therefore no subsurface investigation was recommended at that time.



4.1.5.1 Previous Environmental Report Summary

Based on Pinchin's review of the above-referenced previous environmental reports, the following PCAs were identified within the Phase One Study Area that are considered to result in APECs at the Phase One Property:

- A coal storage building was located approximately 20 m northwest of the Phase One Property.
- A hydro-vault located within the Site Building.

The following additional PCAs were identified in the reviewed reports within the Phase One Study Area but are not considered to result in APECs at the Phase One Property:

- A railway line was located approximately 25 m northwest of the Phase One Property.
- A lumber yard had previously been located at 30 Queen Street East.
- A UST had been associated with the lumber yard previously located at 30 Queen Street East.
- Fill material was identified at 30 Queen Street East.
- Fill material was identified at 84 and 90 High Street East, 17 and 19 Ann Street and a municipal lot with no address.

4.2 Environmental Source Information

Pinchin reviewed the historical use of the Phase One Study Area through the use of publicly available archives and databases, as well as through requesting information from regulatory agencies. The following provides a summary of the information obtained from these sources.

4.2.1 Environmental Database Search – ERIS

Pinchin retained Environmental Risk Information Services (ERIS) to search all available federal, provincial and private source databases for information pertaining to the Phase One Study Area. Unless otherwise noted, information obtained from the ERIS database search was reviewed for the entire Phase One Study Area. A copy of the ERIS report is provided in Appendix F and the results of the database search are described in the following sections.

4.2.1.1 National Pollutant Release Inventory

ERIS completed a search of the federal databases for information regarding the National Pollutant Release Inventory (NPRI). This database contains comprehensive national data regarding releases to air, water, or land, and waste transfers for recycling for more than 300 listed substances and identifies information such as the approximate location, type and quantity of contaminant, date of release, and media impacted.



Pinchin reviewed the ERIS report for NPRI information and found no records regarding the Phase One Study Area.

4.2.1.2 Ontario Inventory of PCB Storage Sites

The MECP's Waste Management Branch maintains an inventory of PCB storage sites within Ontario. Ontario Regulation 11/82 and Ontario Regulation 347 (O. Reg. 347), made under the EPA, require the registration of inactive PCB storage equipment and/or disposal sites of PCB waste with the MECP. This database contains information on waste quantities, major and minor sites storing liquid or solid waste, and a waste storage inventory.

ERIS completed a search of the Ontario Inventory of PCB Storage Sites for information regarding PCB storage and found no information regarding the Phase One Study Area.

4.2.1.3 National PCB Inventory

Environment Canada maintains an inventory of in-use PCB-containing equipment at federal, provincial and private facilities in Canada, and of out-of-service PCB-containing equipment and PCB waste owned by the federal government or federally regulated industries.

ERIS completed a search of the National PCB Inventory and found no information regarding the Phase One Study Area.

4.2.1.4 Certificates of Approval

ERIS completed a search of the MECP database for information regarding Certificates of Approval (Cs-of-A). The MECP maintains a database of approved Cs-of-A for Air & Noise, Industrial Sewage, Municipal & Private Sewage, Waste Management Systems and Renewable Energy Approvals. Prior to November 1, 2011, the MECP mandated that any facility that released emissions to the atmosphere, discharged contaminants to ground or surface water, provided potable water supplies, or stored, transported or disposed of waste, must have a C-of-A before it could operate lawfully. The MECP no longer issues Cs-of-A, which were replaced by Environmental Compliance Approvals (ECAs) as of November 1, 2011. O. Reg. 153/04 indicates that information from the C-of-A database only needs to be obtained for the Phase One Property and properties adjacent to the Phase One Property.

The ERIS search of the C-of-A database identified no information regarding Cs-of-A for the Phase One Property or for properties adjacent to the Phase One Property.



4.2.1.5 Environmental Compliance Approvals, Permits To Take Water and Certificates of Property Use

ERIS completed a search of the MECP database for information regarding ECAs, permits including Permits To Take Water (PTTWs) and Certificates of Property Use (CPUs). O. Reg. 153/04 indicates that information from these databases only needs to be obtained for the Phase One Property and properties adjacent to the Phase One Property. Details regarding these databases are provided in the ERIS report in Appendix F.

The ERIS database search identified no information regarding ECAs, PTTWs or CPUs for the Phase One Property and properties adjacent to the Phase One Property.

4.2.1.6 Inventory of Coal Gasification Plants

ERIS searched the following publications prepared for the MECP by Intera Technologies Inc. for information on industrial sites that formerly operated as coal gasification plants, and industrial sites that produced or used coal tar and other related tars:

- “*Inventory of Coal Gasification Plant Waste Sites in Ontario*”, dated April 1987; and
- “*Inventory of Industrial Sites Producing or Using Coal Tar and Related Tars in Ontario*”, dated November 1988.

The ERIS search yielded no records of former coal gasification plants or the production or use of coal tar and related tars within the Phase One Study Area.

4.2.1.7 Environmental Incidents, Orders, Offences and Spills

ERIS completed a search of the various provincial and federal databases for information regarding environmental incidents, orders, offences and spills. O. Reg. 153/04 indicates that information from these databases only needs to be obtained for the Phase One Property and properties adjacent to the Phase One Property. Details regarding the searched databases are provided in the ERIS report in Appendix F.

The ERIS database search revealed no records of environmental incidents, orders, offences or spills for the Phase One Property and properties adjacent to the Phase One Property.

4.2.1.8 Waste Management Records

Waste Generators

ERIS completed a search of the O. Reg. 347 Waste Generators database for information regarding waste generation. O. Reg. 347 defines a waste generation site as any site, equipment and/or operation involved in the production, collection, handling and/or storage of regulated wastes. A generator of regulated waste is required to register the waste generation site and each waste produced, collected, handled or stored at the site. This database contains the registration number, company name and address of registered generators including the types of hazardous wastes generated.



It includes data on waste generating facilities such as drycleaners, waste treatment and disposal facilities, machine shops, electric power distribution, etc. The database search results provide a summary of available waste generation information for the registered sites for all years from 1986 to the present.

O. Reg. 153/04 indicates that information from the Waste Generator database only needs to be obtained for the Phase One Property and properties adjacent to the Phase One Property. However, in addition to the Phase One Property and adjacent off-Site properties, Pinchin reviewed the database for waste generators within 50 m transgradient and 100 m upgradient of the Phase One Property with respect to the inferred groundwater flow direction. The area reviewed will be referred to as the Waste Generator Database Review Area.

The ERIS search of the O. Reg. 347 Waste Generators database found no information regarding the Phase One Property.

Two other properties located within the Waste Generator Database Review Area were listed within the O. Reg. 347 Waste Generators database search results as waste generators and are considered PCAs. Details regarding the types of waste and timeframe when wastes were generated at these properties are provided in the ERIS report in Appendix F and on Table 2.

Based on their location and distance relative to the Phase One Property (i.e., greater than 20 m and/or inferred to be hydraulically downgradient or transgradient of the Phase One Property) and/or the types and relatively small quantities of hazardous wastes generated at these properties, it is Pinchin's opinion that hazardous waste generation at these properties has not resulted in APECs at the Phase One Property.

Waste Receivers

ERIS completed a search of the O. Reg. 347 Waste Receivers database for information regarding waste receivers. O. Reg. 347 defines a waste receiving site as any site or facility to which waste is transferred by a waste carrier. A receiver of regulated waste is required to register the waste receiving facility. This database contains registered receivers of regulated wastes, identified by registration number, company name and address, and includes receivers of waste such as landfills, incinerators, transfer stations, PCB storage sites, sludge farms and water pollution control plants.

O. Reg. 153/04 indicates that information from the Waste Receivers database only needs to be obtained for the Phase One Property and properties adjacent to the Phase One Property. However, in addition to the Phase One Property and adjacent off-Site properties, Pinchin reviewed the database for waste generators within 50 m transgradient and 100 m upgradient of the Phase One Property with respect to the inferred groundwater flow direction. The area reviewed will be referred to as the Waste Receivers Database Review Area.



The ERIS search of the O. Reg. 347 Waste Receivers database found no information regarding the Waste Receivers Database Review Area.

4.2.1.9 Fuel Storage Tanks

ERIS completed a search of various private, provincial and federal databases for information regarding chemical storage tanks, as well as private and retail fuel storage tanks. Details regarding the searched databases are provided in the ERIS report in Appendix F.

The ERIS search of the chemical and fuel storage tank databases found no information regarding the Phase One Property.

The ERIS search of the chemical and fuel storage tank databases identified the following other properties within the Phase One Study Area with records of fuel storage tanks:

- 80 High Street East.
- 114 Lakeshore Road East.

The property located at 80 High Street East was listed in the Commercial Fuel Oil Tanks and Delisted Fuel Tanks databases as having one double wall UST fuel oil tank, with an unknown capacity installed in 2014. This property is located approximately 80 m to the southeast of the Phase One Property and is inferred to be hydraulically downgradient of the Phase One Property.

The property located at 114 Lakeshore Road East was listed in the Delisted Fuel Tanks, Fuel Storage Tank, and Private and Retail Fuel Storage Tanks databases as a motor repair company, retail fuel outlet (RFO) and car wash, with two gasoline fuel tanks with capacities of 27,200-Litres (L) and two gasoline fuel tanks with capacities of 36,300-L installed in 1989 and two gasoline fuel tanks with capacities of 27,250-L and two gasoline fuel tanks with capacities of 36,700-L installed in 1994. This property is located approximately 215 m to the southeast of the Phase One Property and is inferred to be hydraulically downgradient of the Phase One Property.

The 80 High Street East and 114 Lakeshore Road East properties are distant from the Phase One Property (i.e., greater than 75 m) and/or are inferred to be hydraulically transgradient or downgradient of the Phase One Property. As such, Pinchin considers that the likelihood of potential impacts to the Phase One Property due to storage tanks on these properties is low and these PCAs do not result in APECs at the Phase One Property.

4.2.1.10 Notices and Instruments

The ERIS database search of the Environmental Registry and Record of Site Condition database indicated the following for the Phase One Study Area:

- No records were found in the Environmental Registry and Record of Site Condition database for the Phase One Property.



- No records were found in the Environmental Registry and Record of Site Condition database for other properties within the Phase One Study Area except for the following:
 - Five database search results comprising of five RSCs. None of the search results were related to potential impacts on groundwater quality, which is considered the primary pathway of concern for contaminant migration to the Phase One Property. As such, there is a low potential for the Environmental Registry and Record of Site Condition database search results to be indicative of discharges to the environment that represent an environmental concern to the Phase One Property and the likelihood of potential impacts to the Phase One Property is considered low.

4.2.1.11 *Areas of Natural Significance*

ERIS reviewed available databases and records to assess whether any parks, wetlands, conservation areas, or other areas of natural significance, are located within the Phase One Study Area. The Area of Natural & Scientific Interest map is included in the ERIS report in Appendix F. In addition, Pinchin reviewed information provided on the Ministry of Natural Resources and Forestry's (MNRF) Natural Heritage Information Centre (NHIC) website. No areas of natural significance were identified within the Phase One Study Area from these information sources.

4.2.1.12 *Landfill Information*

ERIS reviewed available private and provincial databases for records of any current or inactive landfills and waste disposal sites within the Phase One Study Area. Details regarding the searched databases are provided in the ERIS report in Appendix F.

The ERIS search of the landfill and waste disposal sites databases found no information regarding the Phase One Study Area.

4.2.1.13 *Other ERIS Databases*

The ERIS database search of the Scott's Manufacturing Directory identified the following additional information for the Phase One Study Area:

- Excalibur International Consultants, a publishing house, was listed at 10 Hurontario Street, established in 1972, as a company that published books.
- Dens-Tek Dental Studios Inc. was listed at 114 Lakeshore Road East, established in 2002, as a company that manufactured medical equipment and supplies.
- Caspian Custom Canvas Inc. was listed at 106 Lakeshore Road East, established in 1988, as a company that manufactured canvas and related products.



Based on their location and distance relative to the Phase One Property (i.e., greater than 100 m and/or inferred to be hydraulically downgradient or transgradient of the Phase One Property), it is Pinchin's opinion that the above-noted companies are PCAs but have not resulted in APECs at the Phase One Property.

The ERIS search found information from other databases (e.g., Borehole, Environmental Activity and Sector Registry, ERIS Historical Searches, Pesticide Register and Scott's Manufacturing Directory); however, the information provided is either described elsewhere in the report or is not considered to be of environmental concern.

4.2.2 Ministry of the Environment, Conservation and Parks Freedom of Information Search

The MECP Freedom of Information and Protection of Privacy Office in Toronto, Ontario was previously and recently contacted to determine if records exist for environmental matters such as orders, spills, previous investigations, prosecutions, registered PCB waste storage sites, waste generators, waste receivers, Cs-of-A and ECAs associated with the Phase One Property.

The searches were previously requested during the 2022 Pinchin Phase I ESA, on March 16, 2022, and June 24, 2022, and responses were received from the MECP on March 23, 2022, and July 4, 2022. The MECP response indicated that no records were available for the Phase One Property at 23 – 31 Helene Street North, Mississauga. The second MECP response contained the following records for the Phase One Property that were not already available to Pinchin:

- An incident report for 70 Park Street East, Mississauga detailing a watermain break on a construction site. This is not classified as a PCA due to the watermain containing treated water.

A copy of the MECP responses are provided in Appendix G.

4.2.3 Technical Standards and Safety Authority Search

The TSSA is the regulatory body that governs the safe handling and storage of fuel in Ontario. All storage of gasoline, diesel and fuel oil is subject to the Technical Standards and Safety Act. The Technical Standards and Safety Act and its relevant documents and regulations (e.g., *Liquid Fuels Handling Code*, *Ontario Regulation 213/01 – Fuel Oil*, *Ontario Regulation 217/01 – Liquid Fuels*) require that all fuel storage devices such as aboveground storage tanks (ASTs) and underground storage tanks (USTs) be registered with the TSSA.



As part of the 2022 Pinchin Phase I ESA, Pinchin contacted the TSSA to determine whether any ASTs or USTs are, or were, registered for the Phase One Property, and to determine whether any records of regulatory non-compliance exist. Letter responses were issued by the TSSA on April 4, 2022, and April 13, 2022, indicating that following a search of the TSSA files, no outstanding instructions, incident reports, fuel oil spills or contamination records, or records of registered ASTs or USTs were found for the Phase One Property, or the off-Site properties listed above.

A copy of the TSSA response is provided in Appendix H.

4.2.4 Property Underwriters' Reports and Plans

Property Underwriters' Reports (PURs) provide detailed information on a site-specific basis, including descriptions of building construction, heating sources, production processes, and the presence of any hazardous chemicals or materials which may have been historically stored on the Phase One Property. They also indicate the presence of environmental hazards such as electrical rooms, transformers, boilers and storage tanks. Information provided on Property Underwriters' Plans (PUPs) includes the location, capacity, and contents of aboveground storage tanks (ASTs), USTs, chemical storage and other forms of environmental hazards.

Pinchin contacted Opta to obtain copies of PURs and PUPs related to the Phase One Property. Opta provided Pinchin with copies of the following (see Appendix E):

- PURs dated 1971, 1983 and 1995.
- PUPs dated 1983 and 1984.

Based on Pinchin's review of the PURs, the following was noted:

1971

- The Site Building was constructed with three storeys, including one basement level, and was used as a small commercial plaza and car park.
- In the Site Building, the basement was used for storage for individual units, the first floor contained a variety store and a hair stylist, the second floor had a dry-cleaning depot, pizza parlour, and a car park, the third floor had a car park, and the roof had a swimming pool, miniature golf course, change rooms, and washrooms.
- The Site Building had electric heating.
- The building located at 70 Park Street East had a boiler room with oil being used as a fuel type. As stated previously in the 2022 Pinchin Phase I ESA (see Section 4.1.5) a representative of this building told the Pinchin assessor that the building had always been heated electrically, and that there had never been oil-fueled boilers at the 70 Park Street East property. Given this information, this has not been classified as a PCA.



1983

- The Site Building was constructed in approximately the 1970s, with three storeys, including one basement level.
- The Site Building had an approximate total area of 9,984 m².
- The Site Building had multiple tenants, including Century Burgers, Presto TV Service, Sheridan Cleaners, Hair-Action, GO-Mart, as well as private and public parking and a recreational area. As stated elsewhere, it is understood that the former dry cleaners was a drop-off depot only.
- Heating for the Site Building was electric.

1995

- The tenant that this report was written for was Transit Donuts at 23-31 Helene Street North.
- The Site Building was constructed in approximately 1967.
- The Site Building had three storeys, excluding the basement.
- The approximate total area of the Site Building was 9,934 m².
- The Site Building was heated with 100% electric baseboard units.
- The Site Building had an emergency sprinkler system.
- The Site Building was connected to a natural gas supply, as this tenant had a natural gas fuelled oven and deep fat fryer.

Based on Pinchin's review of the PUPs, the following was noted:

1983

- The Phase One Property was occupied by the Site Building, constructed in approximately the 1970s, with a small portion of the central part of the Phase One Property that was used as a parking lot for customers. This Site Building is similar in size, configuration, and location to the present-day Site Building.
- The Site Building contained a parking lot on the lower basement level, a common hall behind tenant units on the southwest portion of the Site Building, two separate change rooms on the roof of the Site Building, and a swimming pool.
- The Phase One Property bordered a high-rise building located at 70 Park Street East to the southeast, similar in size and shape to the present-day structure, and Queen Street East to the northwest.



Phase One Environmental Site Assessment

23, 25, 27, 29 and 31 Helene Street North, 53 Queen Street East and Part of 70 Park Street East, Mississauga, Ontario
MPCT DIF 70 Park Street East LP

December 20, 2022
Pinchin File: 314281.001
FINAL

1984

- The Site Building was built in approximately the 1970s.
- The Site Building was of similar size and shape as the current structure.
- The Phase One Property was bordered by Helene Street North on the southwest side, by Queen Street East on the northwest side, and by Park Street East on the southeast side, with a structure of similar size and shape as the current structure at 70 Park Street East.
- No information was provided regarding tenants of the Site Building; however, unit numbers were provided and ranged from 23 through 31.

The PURs and PUPs for the Phase One Property did not contain any pertinent information which Pinchin considers resulting in PCAs at the Phase One Property.

4.2.5 City Directories

City directories for the years 1961 to 2001 were reviewed by Pinchin at the Toronto Reference Library, Toronto, Ontario for the area within 100 m of the Phase One Property (City Directory Search Area). It should be noted that no city directories were available for the City of Mississauga subsequent to 2001. A summary of information obtained with respect to the Phase One Property is provided in the following table:

Year(s)	Occupant Listings for Site Address
1961	23 Helene Street North: Residential 25 Helene Street North: Residential 27 Helene Street North: Residential 29 Helene Street North: Address not listed 31 Helene Street North: Address not listed 53 Queen Street East: Address not listed 70 Park Street East: Address not listed
1966	23 Helene Street North: Residential 25 Helene Street North: Residential 27 Helene Street North: Residential 29 Helene Street North: Address not listed 31 Helene Street North: Address not listed 53 Queen Street East: Address not listed 70 Park Street East: Address not listed

**Phase One Environmental Site Assessment**

23, 25, 27, 29 and 31 Helene Street North, 53 Queen Street East and Part of 70 Park Street East, Mississauga, Ontario
MPCT DIF 70 Park Street East LP

December 20, 2022
Pinchin File: 314281.001
FINAL

Year(s)	Occupant Listings for Site Address
1970 - 1971	23 Helene Street North: Residential 25 Helene Street North: Residential 27 Helene Street North: Residential 29 Helene Street North: Address not listed 31 Helene Street North: Address not listed 53 Queen Street East: Address not listed 70 Park Street East: Address not listed
1976	23 Helene Street North: Century Burger 25 Helene Street North: Address not listed 27 Helene Street North: Kwik-Kleen Dry-Cleaners 29 Helene Street North: Mr. Aldo Hair 31 Helene Street North: Go Mart 53 Queen Street East: Address not listed 70 Park Street East: Century Park Apartment
1981	23 Helene Street North: Century Burger 25 Helene Street North: Presto TV Service Ltd. 27 Helene Street North: Sheridan Dry Cleaners & Launderers 29 Helene Street North: Address not listed 31 Helene Street North: Go Mart 53 Queen Street East: Address not listed 70 Park Street East: Century Park Apartment
1986	23 Helene Street North: Century Burger 25 Helene Street North: Address not listed 27 Helene Street North: Sheridan Dry Cleaners & Launderers 29 Helene Street North: Hair-Action Hair Design 31 Helene Street North: Go Mart 53 Queen Street East: Address not listed 70 Park Street East: Residential building, Allport Boat Repairs and Century Park Apartments
1991	23 Helene Street North: Address not listed 25 Helene Street North: Address not listed 27 Helene Street North: Sheridan Dry Cleaners & Alterations 29 Helene Street North: Hair-Action Hair Design 31 Helene Street North: Go Mart 53 Queen Street East: Address not listed 70 Park Street East: Residential building

**Phase One Environmental Site Assessment**

23, 25, 27, 29 and 31 Helene Street North, 53 Queen Street East and Part of 70 Park Street East, Mississauga, Ontario
MPCT DIF 70 Park Street East LP

December 20, 2022

Pinchin File: 314281.001

FINAL

Year(s)	Occupant Listings for Site Address
1996	23 Helene Street North: Address not listed 25 Helene Street North: Transit Donuts 27 Helene Street North: Sheridan Drycleaners 29 Helene Street North: Hair-Action Hair Design 31 Helene Street North: Go Mart 53 Queen Street East: Address not listed 70 Park Street East: Century Park Apartments and Derich Terlin Management
2001	23 Helene Street North: Address not listed 25 Helene Street North: Address not listed 27 Helene Street North: Sheridan Cleaners 29 Helene Street North: Hair-Action Hair Design 31 Helene Street North: Go Mart 53 Queen Street East: Address not listed 70 Park Street East: Century Park Apartments and Cosway Cleaning Services

A dry cleaner operation was listed at the Phase One Property from 1976 until 2001 (Kwik-Kleen Dry Cleaners in 1976 and Sheridan Dry Cleaners from 1981 until 2001). Based on information provided in historical PURs, previous environmental reports and information provided by the Site Representatives, it is Pinchin's understanding that these historical dry cleaners operated as drop-off depots only and no dry-cleaning operations were conducted at the Phase One Property. Based on this information, it is Pinchin's opinion that these dry-cleaning drop-off depots are unlikely to result in any potential subsurface impacts at the Phase One Property. Based on Pinchin's review of the above-noted city directories, no PCAs were identified at the Phase One Property.

4.3 Physical Setting Sources

4.3.1 Aerial Photographs

Pinchin reviewed aerial photographs of the Phase One Property and surrounding properties within the Phase One Study Area to assess the potential for historical PCAs. Copies of aerial photographs dated 1931, 1946, 1950, 1974, 1984 and 2019 were obtained by ERIS and reviewed by Pinchin. In addition, Pinchin reviewed satellite images provided on the City of Mississauga website dated 1966, 1992, 2002 and 2012. The 1931 aerial photograph was the earliest available aerial photograph of the Phase One Study Area.

Efforts were made by Pinchin to obtain aerial photographs that:

- Illustrated the period between initial development of the Phase One Property to the present.



- Identified buildings and structures present on the Phase One Property since initial development.
- Identified PCAs within the Phase One Study Area.
- Identified APECs on the Phase One Property.

It should be noted that accurate details could not be determined from some of the aerial photographs due to the reference scale and the resolution of the photographs.

A summary of information obtained with respect to the Phase One Property from a review of the available aerial photography is provided in the following table:

Year of Photograph	Phase One Property
1931	The Phase One Property appears to be developed with residential buildings.
1946	Same as above.
1950	Same as above, however, multiple additional residential buildings are present.
1966	Same as above.
1974	A building of similar size and shape to the present-day Site Building is present on the site.
1984	Same as above.
1992	Same as above.
2002	Same as above.
2012	Same as above.
2019	Same as above.

Based on the aerial photographs reviewed for the Phase One Property and the surrounding area, it appears that the Phase One Property was developed prior to 1931. The aerial photographs indicated that multiple residential dwellings were present on the Phase One Property in 1931 and 1966. It is unclear if these dwellings had basement levels or how these buildings were heated. However, given that the Phase One Property was significantly redeveloped in 1974 with the construction of the present-day structures, it is unlikely that any remnants of these dwellings would have remained.

The aerial photograph review did not identify any PCAs within the Phase One Study Area, including the Phase One Property. Copies of the aerial photographs of the Phase One Property and surrounding area are provided in Appendix I.

4.3.2 Topography, Hydrology and Geology

The elevation of the Phase One Property, based on information obtained from the Ontario Base Map series, is approximately 78.85 m above mean sea level (mamsl). The general topography in the local and surrounding areas is generally flat with a slight grade upwards in elevation to the north.



No bedrock outcrops were observed on-Site or in the surrounding area. Based on data from the 2016 Englobe Geotechnical Report (section 4.1.5), the overburden thickness on-Site (i.e., depth to bedrock) is approximately 9.5 m.

A review of the available physiographical data indicates that the Phase One Property and the surrounding properties located within the Phase One Study Area are located within glaciolacustrine and fluvial deposits with the primary native material consisting of clay, silt, sand and gravel. Bedrock is expected to consist of shale, limestone, dolostone and siltstone of the Georgian Bay, Blue Mountain and Billings Formations, and the Collingwood and Eastview Members at an elevation of 69.3 mamsl. The topography is considered to be mainly flat to rolling low local relief with dry surface water drainage conditions. During previous Phase One Study Area environmental investigations, the soil stratigraphy was observed to consist of sandy silt, clayey silt, and till.

Based on general hydrogeological principles and Pinchin's familiarity with subsurface conditions at and near the Phase One Property and the surrounding properties within the Phase One Study Area, the unconfined groundwater beneath the Phase One Property is expected to flow in a southeasterly direction. No water bodies are located within the Phase One Study Area, and the nearest surface water body is Lake Ontario, located approximately 465 m southeast of the Phase One Property at an elevation of approximately 74 mamsl.

Copies of pertinent maps, illustrating local topographical, hydrogeological and drainage features are provided in Appendix J.

4.3.3 Fill Materials

The historical records review provided no information regarding the presence of fill material at the Phase One Property.

Although the Phase One ESA did not identify any historical or current fill material at the Phase One Property, potential future development plans should incorporate the appropriate procedures for the characterization of soils that may require off-Site disposal. Further assessment and/or costs may be incurred through re-development of the Phase One Property and/or change in land use scenarios.

4.3.4 Water Bodies, Areas of Natural Significance and Groundwater Information

No water bodies were identified on the Phase One Property or on surrounding properties within the Phase One Study Area.

A review of the Area of Natural & Scientific Interest map prepared by ERIS (see Appendix F) and information provided on the MNRF's NHIC website did not identify any provincial parks, wetlands, conservation areas, or other areas of natural significance, within the Phase One Study Area.



A review of the municipal plan for the City of Mississauga and the Region of Peel indicated that the Phase One Study Area is not located in whole or in part within a well head protection area or other designation identified by the City of Mississauga and the Region of Peel for the protection of groundwater.

Based on information provided in the Source Protection Information Atlas from the MECP, the Phase One Property and all other properties within the Phase One Study Area are serviced by a municipal drinking water system.

The records review did not identify the presence of wells within the Phase One Property or within the Phase One Study Area that currently supply water for human consumption or for agricultural purposes.

4.3.5 Well Records

The Water Well Information System database search did not identify any water well records for the Phase One Property but did identify 72 water well records within the Phase One Study Area outside of the Phase One Property. Details regarding these off-Site wells, including stratigraphic information, depth to bedrock and/or depth to the water table, are provided in the ERIS report included in Appendix F.

The ERIS report search results indicated that all of the wells identified within the Phase One Study Area were installed for monitoring purposes and that the margin of error associated with the UTM coordinates is reported to be 10 to 100 m.

It is unknown if the water wells currently exist within the Phase One Study Area or have been decommissioned.

4.4 Site Operating Records

The Phase One Property is not an Enhanced Investigation Property (see Section 6.3). As such, site operating records were not reviewed as part of the Phase One ESA.

5.0 INTERVIEWS

Pinchin interviewed individuals knowledgeable of the Phase One Property and its history to obtain or confirm information regarding the environmental condition of the Phase One Property. The following individuals provided information regarding the history of the Phase One Property and the surrounding properties within the Phase One Study Area to the best of their knowledge:

Person Interviewed	Relationship to Phase One Property	Date and Place of Interview	Interview Method
Mr. Alek Kostecki	Current superintendent of Phase One Property	September 27, 2022 (Phase One Property)	In-person interview during Site reconnaissance.

**Phase One Environmental Site Assessment**

23, 25, 27, 29 and 31 Helene Street North, 53 Queen Street East and Part of 70 Park Street East, Mississauga, Ontario
MPCT DIF 70 Park Street East LP

December 20, 2022

Pinchin File: 314281.001

FINAL

Person Interviewed	Relationship to Phase One Property	Date and Place of Interview	Interview Method
Mr. Alex Heath	Current Manager, Development at Dream Asset Management	September 27, 2022 (Phase One Property)	In-person interview during Site reconnaissance.

Mr. Kostecki was chosen to be interviewed given that he has been the superintendent of the Phase One Property for over 10 years and is familiar with the recent operational history of the Phase One Property. Mr. Heath was chosen to be interviewed given that he represents the owner of the Phase One Property and is familiar with the recent operational history of the Phase One Property. Mr. Kostecki and Mr. Heath are referred to herein as the “Site Representatives” and accompanied the Pinchin representatives (Ms. Michaela Smith and Ms. Kara Woolley) during the Site reconnaissance.

Pinchin compared the information obtained from the interviews with information obtained from the historical records. The information provided by the interviewees was corroborated by the available historical records. As such, Pinchin has no concerns regarding the validity of the information provided by the individuals interviewed for the Phase One ESA.

With respect to PCAs and APECs, no additional information was obtained from the interviews other than that documented elsewhere in this report.

6.0 SITE RECONNAISSANCE

6.1 General Requirements

A visual assessment of the Phase One Property and the surrounding properties within the Phase One Study Area was conducted for the purpose of identifying the presence of possible PCAs and associated APECs.

The Site reconnaissance was completed on September 27, 2022, by Pinchin representatives (i.e., Ms. Michaela Smith and Ms. Kara Woolley) under the direct supervision of Pinchin’s QP overseeing this project. Pinchin visited the Phase One Property and surrounding properties within the Phase One Study Area to document environmental conditions. During the Site reconnaissance, Pinchin viewed all accessible areas within the Phase One Property and viewed publicly-accessible portions of the adjacent lands for the presence of actual or potential issues of environmental concern.

The Site reconnaissance was conducted between the hours of 8:30 AM and 12:00 PM. During the Site reconnaissance, the weather was cloudy, and the ambient temperature was approximately 12° Celsius with a slight breeze from the west. The Phase One Property reconnaissance was conducted on foot and consisted of a full walk-through of the property. There were no access restrictions for Pinchin for the Phase One Property other than the hydro-vault.



At the time of the Site reconnaissance, the Phase One Property was operating as a parking garage for a nearby residential building, as well as five commercial tenant spaces.

A hydro-vault, owned by the City of Mississauga was present during the Site reconnaissance and located on the southern corner of the Site Building; however, it was inaccessible as the Site Representatives stated that only City of Mississauga employees are able to obtain access. This hydro-vault is a PCA that results in an APEC.

Photographs taken during the Site reconnaissance that illustrate the interior and exterior of the Site Building, Phase One Property and Phase One Study Area are provided in Appendix C.

With reference to Appendix C, the following table provides a summary of photographs that illustrate PCAs observed at other properties within the Phase One Study Area during the Site reconnaissance:

Photograph No.	Orientation	Description
12	Looking southeast	Suspect fill and vent pipes on a residential building located at 69 High Street East. This property is inferred to be downgradient of the Phase One Property.
13	Looking northeast	Suspect fill and vent pipes on a residential building located at 17 Elizabeth Street. This property is inferred to be downgradient of the Phase One Property.

6.2 Specific Observations at Phase One Property

6.2.1 Description of Buildings and Structures

During the Site reconnaissance, Pinchin observed one building/structure on the Phase One Property. The building consisted of a three-story structure constructed in approximately the 1970s. The building was divided into two separate spaces. The space to the southwest was used for retail units, and the remainder of the space was used as a parking garage for the connected adjacent building located at the remainder of the 70 Park Street East property.

The portion of the Phase One Property outside of the Site Building was comprised primarily of a paved parking lot, with a section of grass to the southeast of the Site Building.

6.2.2 Description of Below-Ground Structures

During the Site reconnaissance, Pinchin did not observe any current below-ground structures on the Phase One Property with the exception of a basement for the retail tenant spaces, one underground parking level beneath the Site Building and an underground tunnel connecting the Site Building to the adjacent residential building.

The basement consisted of a poured concrete structure, and some utilities entering at the south or west ends (i.e., sanitary sewer, water, and natural gas).



One sump pit was located in the basement of the tenant spaces and is expected to connect to the sewer system.

6.2.3 Description of Tanks

During the Site reconnaissance, Pinchin did not observe any tanks on the Phase One Property for the purpose of either fuel dispensing or storage, or other unidentified substance storage.

6.2.4 Potable and Non-Potable Water Sources

During the Site reconnaissance, Pinchin did not observe potable or non-potable water sources at the Phase One Property. The Phase One Property is serviced by a municipal water supply via underground piping running northwest from the building located at 70 Park Street East into the basement of the Site Building.

6.2.5 Description and Location of Underground Utilities

A number of underground utilities were observed at the Phase One Property, including natural gas and municipal water, storm and sanitary sewer lines.

The natural gas, water and sanitary sewer services enter the Site Building via underground lines running from the building at 70 Park Street East into the basement on the south or west sides of the Site Building. Stormwater is captured via catch basins and directed southwest via underground piping to a main storm sewer line under Helene Street North.

6.2.6 Entry and Exit Points

The main entry/exit points for customers of the Site Building are located along the southwestern wall of the Site Building, off Helene Street North. A second entry/exit point to the Site Building, for entrance into the parking structure, is located on the northwest side of the Site Building off of Queen Street East, and an additional entrance into the Site Building, for the parking structure, is located on the southeast side of the Site Building, off of the parking lot.

6.2.7 Details of Heating System

During the Site reconnaissance, Pinchin observed two natural gas-fired forced air-heating units on the roof of the Site Building, however these natural-gas fired forced air-heating units do not supply heating to the Site Building, but rather to the adjacent residential building. Heating for the Site Building is provided by electric baseboard or suspended unit heaters throughout the tenant spaces.

6.2.8 Details of Cooling System

During the Site reconnaissance, Pinchin observed commercial electric air conditioners mounted on the roof of the Site Building.



6.2.9 Details of Drains, Pits and Sumps

A sump was observed in the southwest area of the basement in the Site Building. The sump was observed to be free of any evidence of cracks and staining and is expected to connect to the outside sewer system.

Floor drains were seen throughout the lower level of the parking structure, as well as within the tenant spaces in the bathrooms. These drains are expected to connect to the outside sewer system.

Pinchin did not observe any additional drains, pits or sumps during the Site reconnaissance.

6.2.10 Unidentified Substances within Buildings and Structures

During the Site reconnaissance, Pinchin did not observe any unidentified substances or storage containers holding unidentified substances at the Phase One Property. Small volumes of various cleaning solutions were stored in their original containers on shelves within the tenant spaces in the Site Building. No bulk liquid storage was observed on-Site.

6.2.11 Details of Staining and Corrosion

During the Site reconnaissance, Pinchin did not observe any areas of staining or corrosion inside the Site Building.

6.2.12 Details of On-Site Wells

No water supply or groundwater monitoring wells were observed to be on or within the Phase One Property. No water supply or groundwater monitoring wells were reported by the Site Representatives to have been on-Site, prior to, or during their occupancy.

6.2.13 Details of Sewage Works

During the Site reconnaissance, Pinchin did not observe any sewage works or evidence of sewage disposal on the Phase One Property. The Site Representatives stated that the main sanitary sewer pipe exits through the southwestern wall in the basement of the Site Building and connects to the municipal sewer under Helene Street North.

6.2.14 Details of Ground Cover

During the Site reconnaissance, Pinchin visually inspected the Phase One Property ground cover. Any areas of the Phase One Property not covered by a structure, are covered by asphalt-pavement or vegetated areas. The asphalt-pavement is located in the central portion of the Phase One Property. Vegetated areas are located along the central-northeastern and southern perimeters of the Phase One Property. The remainder of the Phase One Property exterior consists of an asphalt-paved driveway, access routes and parking areas.



6.2.15 Details of Current or Former Railways

No current or former railway infrastructure was observed on the Phase One Property.

6.2.16 Areas of Stained Soil, Vegetation and Pavement

During the Site reconnaissance, Pinchin did not observe any areas of stained soil, vegetation or pavement on the Phase One Property.

6.2.17 Areas of Stressed Vegetation

During the Site reconnaissance, Pinchin did not observe any areas of stressed vegetation on the Phase One Property. Significant quantities of vegetation were not observed on-Site.

6.2.18 Areas of Fill and Debris Materials

No obvious areas where fill material or debris have been placed or graded were observed by Pinchin at the Phase One Property.

6.2.19 Potentially Contaminating Activities

A PCA is defined by O. Reg. 153/04 as a “use or activity set out in Column A of Table 2 of Schedule D that is occurring or has occurred in a Phase One Study Area” including the Phase One Property.

Pinchin did not identify any current PCAs at the Phase One Property during the Site reconnaissance other than the aforementioned hydro vault.

6.2.20 Unidentified Substances Outside Buildings and Structures

During the Site reconnaissance, Pinchin did not observe any unidentified substances or storage containers holding unidentified substances on the exterior of the Phase One Property.

6.2.21 Surrounding Land Uses

During the Site reconnaissance, Pinchin conducted a visual assessment of publicly-accessible portions of the Phase One Study Area for the presence of PCAs. The properties in the Phase One Study Area have various land uses, including industrial, residential, commercial and community. Land use types within the Phase One Study Area are presented on Figure 3.

**Phase One Environmental Site Assessment**

23, 25, 27, 29 and 31 Helene Street North, 53 Queen Street East and Part of 70 Park Street East, Mississauga, Ontario
MPCT DIF 70 Park Street East LP

December 20, 2022

Pinchin File: 314281.001

FINAL

The following table summarizes the land use on adjacent properties at the time of the Site reconnaissance:

Direction Relative to Phase One Property	Location Relative to Inferred Groundwater Flow Direction	Description of Property Use	Property Use	Potential Contribution to PCA and/or APEC
Northwest	Upgradient	GO Station terminal and railway line, followed by residential homes.	Industrial/Community/Residential	The Go Station railway is considered to represent a PCA but not an APEC. Other land uses are not considered to represent PCAs.
Northeast	Transgradient	A residential home and a construction site, followed by a GO Station parking lot, then residential homes.	Residential/Community	Land uses are not considered to represent PCAs.
Southeast	Downgradient	Multi-tenant residential buildings, followed by residential homes (two with possible fill and vent pipes), and multi-tenant commercial buildings.	Residential/Commercial	The fill and vent pipes are considered to represent PCAs but not APECs. Other land uses are not considered to represent PCAs.
Southwest	Transgradient	Multi-tenant residential buildings, followed by residential homes.	Residential	Land uses are not considered to represent PCAs.

Pinchin observed two PCAs at the time of the Site reconnaissance within the rest of the Phase One Study Area that were not identified during the historical information review and noted elsewhere in this report. These additional PCAs (PCA-12 and PCA-14) are summarized in Table 2.

6.3 Enhanced Investigation Property

O. Reg. 153/04 defines an “Enhanced Investigation Property” as a property that is being used or has been used, in whole or in part, in the following manner:

- For an industrial use or;
- For any of the following commercial uses:
 - As a garage;
 - As a bulk liquid dispensing facility, including a gasoline outlet; or
 - For the operation of dry cleaning equipment.



The findings of this Phase One ESA have not documented any of the above land uses as occurring at the Phase One Property, and the Phase One Property is therefore not an Enhanced Investigation Property.

6.4 Written Description of Investigation

The Phase One ESA completed by Pinchin included investigations of the Phase One Property and the Phase One Study Area outside of the Phase One Property pursuant to Sections 13 and 14 of Schedule D of O. Reg. 153/04. The main objective of these investigations was to identify PCAs at the Phase One Property or within the Phase One Study Area outside of the Phase One Property that could have resulted in APECs at the Phase One Property.

6.4.1 Phase One Property

The investigation of the Phase One Property consisted of the following components:

- Review of available historical records, including FIPs, previous environmental reports, ERIS regulatory search, information obtained through MECP FOI and TSSA requests, PURs, PUPs, city directories, aerial photographs, well records and Site operating records.
- A Site reconnaissance completed on September 27, 2022, by Ms. Michaela Smith and Ms. Kara Woolley of Pinchin that included an assessment of structures at the Phase One Property and the exterior of the Phase One Property.
- Interviews with individuals knowledgeable of the history and operations at the Phase One Property.
- Review of mapping provided by ERIS and information provided on-line by the MNRF for the presence of areas of natural significance.

Pinchin's investigation of the Phase One Property did not identify any PCAs other than the existing hydro-vault and road salting activity.

No areas of natural significance were identified at the Phase One Property.

Pinchin's investigation did not identify the presence of wells at the Phase One Property that currently supply water for human consumption or for agricultural purposes.

Plans identifying the locations of on-site PCAs and their associated APECs for this Phase One ESA are provided as Figures 4 and 6, respectively.



6.4.2 Phase One Study Area Outside of Phase One Property

The investigation of the Phase One Study Area outside of the Phase One Property consisted of the following components:

- Review of available historical records, including FIPs, previous environmental reports, ERIS regulatory search, city directories and aerial photographs.
- Visual inspection of properties from publicly-accessible areas for evidence of PCAs and water bodies.
- Review of mapping provided by ERIS and information provided on-line by the MNRF for the presence of areas of natural significance.

Pinchin's investigation of the Phase One Study Area outside of the Phase One Property identified one PCA that has the potential to impact groundwater quality at the Phase One Property given its proximity to the Phase One Property, its upgradient location relative to the inferred groundwater flow direction in the Phase One Study Area and the nature of operations and potential contaminants related to these operations. The description and location of this PCA is provided in Table 2. The APEC associated with this PCA is summarized in Table 3. A total of 18 additional PCAs were identified within the Phase One Study Area outside of the Phase One Property. These additional PCAs are not considered to result in APECs at the Phase One Property given the distance from the PCAs to the Phase One Property, their downgradient or transgradient locations relative to the inferred groundwater flow direction in the Phase One Study Area and/or the nature of operations and potential contaminants related to these operations. The descriptions and locations of these PCAs are provided in Table 2.

No areas of natural significance were identified within the Phase One Study Area outside of the Phase One Property.

Pinchin's investigation did not identify the presence of wells within the Phase One Study Area that currently supply water for human consumption or for agricultural purposes.

Based on a cursory review of the properties greater than 250 m (i.e., outside of the Phase One Study Area), but less than 1 km, from the Phase One Study Area, Pinchin did not note or observe any significant contaminating properties that should be included as part of this assessment (i.e., landfills, large industrial manufacturers, etc.).

Plans identifying the locations of the off-Site PCAs and associated APECs for this Phase One ESA are provided as Figures 5 and 6, respectively.



7.0 REVIEW AND EVALUATION OF INFORMATION

7.1 Current and Past Uses

The current and past land uses of the Phase One Property are listed in Table 1. To the best of Pinchin's knowledge, the Phase One Property was undeveloped until prior to 1928. The use of the property at this time is unknown, and it is assumed that it was used for residential purposes. The first building present on the Phase One Property is assumed to have been constructed prior to 1928. The current building on the Phase One Property is assumed to have been built between 1966 and 1974, based on a review of aerial photographs provided by the City of Toronto Archives and Google Earth™, and is currently used as a parking garage for the adjacent multi-tenant residential building located at 70 Park Street East, and additionally contains five commercial retail units.

It is Pinchin's opinion that the date of the first developed use of the Phase One Property is prior to 1928. The date of the first developed use of the Phase One Property was determined through a review of city directories, FIPs, aerial photographs and previous reports, which was completed for the property to its earliest time of ownership and possible development as possible. No other historical records were available to Pinchin that provided information for determining the date of first developed use of the Phase One Property.

7.2 Potentially Contaminating Activities

Table 2 summarizes the descriptions and locations of all PCAs as defined by O. Reg. 153/04 that were identified by Pinchin within the Phase One Study Area. The following presents a summary of these PCAs:

- A total of two PCAs were documented to have occurred at the Phase One Property.
- A total of 19 PCAs were documented to have occurred within the Phase One Study Area outside of the Phase One Property. Of these off-Site PCAs, one was identified that is considered to result in an APEC at the Phase One Property given its proximity to the Phase One Property, and its upgradient location relative to the inferred groundwater flow direction in the Phase One Study Area.
- The remaining 18 off-Site PCAs are not considered to result in APECs at the Phase One Property given the distance from the PCAs to the Phase One Property, their downgradient or transgradient locations relative to the inferred groundwater flow direction in the Phase One Study Area and/or the nature of operations and potential contaminants related to these operations.



7.3 Areas of Potential Environmental Concern

Table 3 summarizes all APECs identified during the Phase One ESA, as well as their respective PCAs, COPCs and the media which could potentially be impacted. As noted in Table 3, the Phase One ESA identified a total of three APECs at the Phase One Property.

The rationale used by the QP in assessing the available information to determine whether PCAs exist or have existed within the Phase One Study Area, including the Phase One Property, that represent an APEC at the Phase One Property has been provided in the preceding report sections. In general, the potential for environmental impacts to the Phase One Property was evaluated using a combined probability for a source to contaminate, and the ability of contaminants to migrate on, or to the Phase One Property. For example, a gasoline UST located on the Phase One Property, or on a property in close proximity and/or upgradient of the Phase One Property, would exhibit a high potential for contamination (and is therefore considered a PCA resulting in an APEC at the Phase One Property) since gasoline is highly mobile in the subsurface. In contrast, shallow soil/fill with metals impacts located on a property adjacent to the Phase One Property would be considered to have a low potential for contamination given that metals generally have low mobility in the subsurface (and would not be considered a PCA resulting in an APEC at the Phase One Property). Furthermore, non-adjacent properties with PCAs located downgradient or transgradient of the Phase One Property generally do not result in APECs at the Phase One Property. Groundwater is the media through which contaminants typically migrate from property to property, and if the source of the contaminant is downgradient or transgradient of the Phase One Property, contaminated groundwater from this source cannot migrate to the Phase One Property and the downgradient or transgradient PCA would not be considered to result in an APEC at the Phase One Property.

The COPCs listed in Table 3 are APEC-specific and were determined based on several sources of information, including but not limited to, Pinchin's experience with environmental contamination and hazardous substances, common industry standards for analysis of such contaminants and point sources, literature reviews of COPCs and associated hazardous substances, and an evaluation by Pinchin of the mobility and susceptibility for migration of the COPCs in the subsurface.

The evaluation of the presence/absence of APECs at the Phase One Property was based upon the analysis of available documents, records and drawings, and personal interviews. In evaluating the Phase One Property and Phase One Study Area, Pinchin has relied in good faith on information provided by other individuals or sources as noted in this report. Pinchin has assumed that the information provided is factual and accurate and has no reason to believe that any of the information provided in the available documentation or obtained through interviews is not factual or inaccurate.

Pinchin is not aware of any additional information that would alter the conclusions regarding the presence/absence of APECs at the Phase One Property.



7.4 Phase One Conceptual Site Model

A conceptual site model (CSM) has been created to provide a summary of the findings of the Phase One ESA. The Phase One CSM is summarized in Figures 1 through 6 which illustrate the following features within the Phase One Study Area, where present:

- Existing buildings and structures.
- Water bodies located in whole or in part within the Phase One Study Area.
- Areas of natural significance located in whole or in part within the Phase One Study Area.
- Drinking water wells located at the Phase One Property.
- Land use of adjacent properties.
- Roads within the Phase One Study Area.
- PCAs within the Phase One Study Area, including the locations of tanks.
- APECs at the Phase One Property.

The following provides a narrative summary of the Phase One CSM:

- The Phase One Property is an L-shaped parcel of land approximately 1.25 acres (0.50 hectares) in size located on the southeast side of Queen Street East and the northeast side of Helene Street North. The Phase One Property is improved with a commercial retail building that also acts as a parking garage (Site Building) for the adjacent multi-tenant residential building located at 70 Park Street East, as well as a parking lot located off Helene Street North, and a small grass area adjoining them. The Phase One Property has been used for retail purposes since initial development in the 1970s. There is no record of industrial use or of a commercial use (e.g., garage, bulk liquid dispensing facility or dry cleaner) that would require classifying the Phase One Property as an Enhanced Investigation Property.
- No water bodies were identified within the Phase One Study Area. The nearest surface water body is Lake Ontario, which is located approximately 465 m southeast of the Phase One Property.
- No areas of natural significance were identified within the Phase One Study Area.
- No drinking water wells were located on the Phase One Property.
- Queen Street East and Helene Street North are located immediately northwest and southwest of the Phase One Property, respectively. The adjacent property to the southeast of the Phase One Property is occupied by multi-tenant residential buildings, the adjacent property to the northeast is occupied by residential homes as well as a construction site.



- A total of 21 PCAs were identified within the Phase One Study Area, consisting of two PCAs at the Phase One Property and 19 PCAs within the Phase One Study Area, outside of the Phase One Property. As shown on Figure 5, 18 of the off-Site PCAs are a large distance from the Phase One Property. Groundwater flow within the Phase One Study Area is interpreted to be to the southeast towards Lake Ontario and these off-Site PCAs are inferred to be downgradient and/or transgradient of the Phase One Property. Given that these 18 PCAs are located at downgradient and/or transgradient properties that are at least 50 m from the Phase One Property, these off-Site PCAs are not considered to result in APECs at the Phase One Property. The other PCA identified within the Phase One Study Area represents an APEC at the Phase One Property. Figure 6 provides a detailed summary of the APECs and associated PCAs and COPCs.
- Underground utilities at the Phase One Property provide potable water, natural gas and sewer services to the Site Building. The natural gas, water and sanitary sewer services enter the Site Building via underground lines running from the building at 70 Park Street East into the basement on the south or west sides of the Site Building. Stormwater is captured via catch basins and directed southwest via underground piping to a main storm sewer line under Helene Street North. Plans were not available to confirm the depths of these utilities, but they are estimated to be located approximately 2 to 3 mbgs. The estimated depth to groundwater at the Phase One Property is approximately 0.74 to 3.55 mbgs, which coincides with the approximate depth to the water table. As such, it is possible that the utility corridors may act as preferential pathways for contaminant distribution and transport in the event that shallow subsurface contaminants exist at the Phase One Property.
- The Phase One Property and the surrounding properties located within the Phase One Study Area are located within glaciolacustrine and fluvial deposits with the primary native material consisting of clay, silt, sand and gravel. Bedrock is expected to consist of shale, limestone, dolostone and siltstone of the Georgian Bay, Blue Mountain and Billings Formations, and the Collingwood and Eastview Members at a depth of approximately 9.5 mbgs.
- The Phase One Property is relatively flat with little relief. The area surrounding the Phase One Property slopes gradually to the south towards Lake Ontario. Local groundwater flow is inferred to be to the southeast, based on the topography of the area surrounding the Phase One Property and the location of Lake Ontario. Regional groundwater flow is inferred to be to the south towards Lake Ontario.

The Phase One Property has a paved parking area located southeast of the Site Building. According to the Site Representatives, salt has historically been applied to the parking area for safety reasons during



winter conditions to remove snow and ice, which represents a PCA at the Phase One Property. However, it is the opinion of the QP_{ESA} supervising the Phase One ESA that, although salt-related parameters such as Sodium Adsorption Ratio and electrical conductivity in soil and sodium and chloride in groundwater may be present at concentrations exceeding the applicable Site Condition Standards (i.e., Table 3), the exemption provided in Section 49.1 of O. Reg. 153/04 can be applied. As such, these parameters would be deemed to meet the Site Condition Standards and do not need to be further assessed as part of a Phase Two ESA.

There were no deviations from the Phase One ESA requirements specified in O. Reg. 153/04 or absence of information that have resulted in uncertainty that would affect the validity of the Phase One CSM.

8.0 CONCLUSIONS

Pinchin conducted this Phase One ESA in accordance with Part VII and Schedule D of O. Reg. 153/04. The purpose of the Phase One ESA was to assess the potential presence of environmental impacts at the Phase One Property due to activities at and near the Phase One Property in support of filing an RSC in accordance with O. Reg. 153/04.

Based on the findings of this Phase One ESA, Pinchin identified two PCAs at the Phase One Property (i.e., on-Site) and 19 PCAs within the Phase One Study Area outside of the Phase One Property (i.e., off-Site). Of the off-Site PCAs, 18 are not considered to result in APECs at the Phase One Property given their distance from the Phase One Property and/or their downgradient or transgradient location with respect to the inferred groundwater flow direction at the Phase One Property. The remaining one off-Site PCA and the two on-Site PCAs have resulted in a total of three APECs at the Phase One Property. It is Pinchin's opinion that these PCAs may have impacted soil and groundwater quality at the Phase One Property and, as such, result in APECs at the Phase One Property that warrant further investigation prior to the submittal of an RSC.

It is to be noted that it is the opinion of the QP_{ESA} supervising the Phase One ESA that, although salt-related parameters such as Sodium Adsorption Ratio and electrical conductivity in soil and sodium and chloride in groundwater may be present at concentrations exceeding the applicable Site Condition Standards (i.e., Table 3), the exemption provided in Section 49.1 of O. Reg. 153/04 can be applied. As such, these parameters would be deemed to meet the Site Condition Standards and do not need to be further assessed as part of a Phase Two ESA.

Pinchin recommends that a Phase Two ESA be conducted at the Phase One Property as an *“assessment of property conducted in accordance with the regulations by or under the supervision of a qualified person to determine the location and concentration of one or more contaminants in the land or water on, in or under the property”*.



Pinchin concludes that one or more contaminants originating from PCAs located on the Phase One Property and within the Phase One Study Area outside of the Phase One Property may have affected land or water on, in, or under the Phase One Property. Therefore, Pinchin recommends that a Phase Two ESA be conducted prior to filing an RSC for the Phase One Property.

It should be noted that the references and sources for the information used in evaluating the Phase One Property are provided in the relevant sections of this report. Specific references are also summarized in Section 9.0.

8.1 Signatures

This Phase One ESA was undertaken under the supervision of Francesco Gagliardi, C.E.T., LET, QP_{ESA} in accordance with the requirements of O. Reg. 153/04 to support the filing of an RSC for the Phase One Property. The conclusions and recommendations provided in this report represent the best judgement of the assessor based on the Site conditions observed on September 27, 2022, and a review of available historical information and information obtained from interviews.

We trust that the information provided in this report meets your current requirements.

8.2 Terms and Limitations

This Phase One ESA was performed in order to identify potential issues of environmental concern associated with the property located at 23, 25, 27, 29 and 31 Helene Street North, 53 Queen Street East and Part of 70 Park Street East in Mississauga, Ontario (Site), at the time of the Site reconnaissance. This Phase One ESA was performed in general compliance with currently acceptable practices for environmental site investigations, and specific Client requests, as applicable to this Site. This report was prepared for the exclusive use of MPCT DIF 70 Park Street East LP (Client) subject to the terms, conditions and limitations contained within the duly authorized proposal for this project. Any use which a third party makes of this report, or any reliance on or decisions to be made based on it, is the sole responsibility of such third parties. Pinchin accepts no responsibility for damages suffered by any third party as a result of decisions made or actions conducted.

If additional parties require reliance on this report, written authorization from Pinchin will be required. Such reliance will only be provided by Pinchin following written authorization from the Client. Pinchin disclaims responsibility of consequential financial effects on transactions or property values, or requirements for follow-up actions and costs. No other warranties are implied or expressed. Pinchin will not provide results or information to any party unless disclosure by Pinchin is required by law.



Phase One Environmental Site Assessment

23, 25, 27, 29 and 31 Helene Street North, 53 Queen Street East and Part of 70 Park Street East, Mississauga, Ontario
MPCT DIF 70 Park Street East LP

December 20, 2022

Pinchin File: 314281.001

FINAL

The information provided in this report is based upon analysis of available documents, records and drawings, and personal interviews. In evaluating the Site, Pinchin has relied in good faith on information provided by other individuals noted in this report. Pinchin has assumed that the information provided is factual and accurate. In addition, the findings in this report are based, to a large degree, upon information provided by the current owner/occupant. Pinchin accepts no responsibility for any deficiency, misstatement or inaccuracy contained in this report as a result of omissions, misinterpretations or fraudulent acts of persons interviewed or contacted, or contained in reports that were reviewed. The scope of work for this Phase One ESA did not include a visual or intrusive investigation for designated substances (e.g., asbestos, mould, PCB-containing electrical equipment, etc.) and, therefore, these materials may be present at the Site.

Pinchin makes no other representations whatsoever, including those concerning the legal significance of its findings, or as to other legal matters touched on in this report, including, but not limited to, ownership of any property, or the application of any law to the facts set forth herein. With respect to regulatory compliance issues, regulatory statutes are subject to interpretation and these interpretations may change over time.

Ontario Regulation 153/04 does not apply to environmental auditing or environmental management systems. Therefore, with respect to Site operations and conditions, compliance with applicable federal, provincial or municipal acts, regulations, laws and/or statutes was not evaluated as part of the Phase One ESA.



9.0 REFERENCES

The following documents, persons or organizations provided information used in this report:

- Arcadis Canada Inc. Opinion of Inferred Hydrogeological Conditions, 30 Queen Street East, Mississauga, Ontario, January 24, 2022.
- City of Mississauga Archives
- Englobe Corp. Port Credit GO Station 30 Queen Street East, Mississauga, Ontario, Geotechnical Investigation Report, February 25, 2016.
- Englobe Corp. Phase One Environmental Site Assessment Portion of 30 Queen Street East, Mississauga, Ontario, August 2020.
- Englobe Corp. Phase Two Environmental Site Assessment Portion of 30 Queen Street East, Mississauga, Ontario, October 2020.
- Environmental Risk Information Services. Phase One ESA, 23 Helene St N, Mississauga, ON, L5G 3B6 (ERIS Project #22091501030). September 20, 2022.
- Exp. Phase One Environmental Site Assessment 84, 90 Park Street East, 17, 19 Ann Street East and Part of 91 Park Street East, Mississauga, Ontario, January 12, 2021.
- Exp. Phase Two Environmental Site Assessment 84, 90 Park Street East, 17, 19 Ann Street and Part of 91 Park Street East, Mississauga, Ontario, August 24, 2021.
- Exp. Proposed Mixed-Use Redevelopment: 17 & 19 Ann Street, 84 & 90 High Street East and Part of 91 Park Street East, Mississauga, ON, December 17, 2021.
- Geowarehouse™
- Google Earth™ Satellite Imagery.
- MECP Brownfields Environmental Site Registry.
- Ministry of Natural Resources and Forestry.
- Ministry of the Environment, Conservation and Parks.
- Opta Information Intelligence. 23, 25, 27, 29 & 31 Helene St N., Mississauga, ON, Canada (Opta Order ID: 106649), March 24, 2022.
- Opta Information Intelligence. 70 Park Street East, Mississauga, ON, Canada (Opta Order ID: 106126), March 15, 2022.
- Pinchin Ltd. Phase I Environmental Site Assessment 70 Park Street East, 23 – 31 Helene Street North and 53 Queen Street East, Mississauga, Ontario, April 4, 2022.



Phase One Environmental Site Assessment

23, 25, 27, 29 and 31 Helene Street North, 53 Queen Street East and Part of 70 Park Street East, Mississauga, Ontario
MPCT DIF 70 Park Street East LP

December 20, 2022

Pinchin File: 314281.001

FINAL

- Province of Ontario. Environmental Protection Act R.S.O. 1990, c. E.19 and Ontario Regulation 153/04: Records of Site Condition – Part XV.1 of the Act. Last amended by Ontario Regulation 274/20 on July 1, 2020.
- Technical Safety and Standards Authority.

314281.001 FINAL RSC Phase One ESA 23-31 Helene Street North Mississauga ON Dec 20 2022.docx

Template: Master Report for RSC Phase One ESA Report, EDR, October 16, 2020

10.0 APPENDICES

APPENDIX A
Tables



Table 1 - Table of Current and Past Uses of the Phase One Property

Year	Name of Owner	Description of Property Use	Property Use	Other Observations from Aerial Photographs, Fire Insurance Plans, etc
Pre-1928	Unknown	Unknown	Residential use	No records were available for review prior to 1928.
1928-1952	Unknown	Residential	Residential use	Based on the 1928 through 1952 Fire Insurance Plans, the Site was occupied by various residential structures.
1952-1966	Unknown	Residential	Residential use	Based on the 1950 and 1966 aerial photographs, the Site was occupied by various structures similar in size and shape to the 1952 Fire Insurance Plan.
1967-1974	Unknown	Residential	Residential use	No Fire Insurance Plans or aerial photographs were available for this time period. Based on the city directories, the Site was likely used for residential uses.
1974-1992	Unknown	Commercial	Residential use	Based on the 1974 through 1984 aerial photographs, the Site was occupied by a structure similar in size, shape and configuration to the current Site Building. Based on the 1976 through 1991 city directories, the property was used as a commercial building with multiple retail businesses operating within the Site Building.
1992-1999	1001935 Ontario Limited	Commercial	Commercial use	Based on the 1992 aerial photograph, the Site was occupied by a structure similar in size, shape and configuration to the current Site Building. Based on the 1996 city directories, the property was used as a commercial building due to multiple retail businesses operating within the Site Building.
1999-2022	Unknown	Commercial	Residential use	No Fire Insurance Plans or aerial photographs were available for this time period. Based on the city directories, the Site was used for commercial uses.
2022 to Present	70 Park Street East Inc.	Commercial	Commercial use	Based on the 2012 and 2019 aerial photographs, the Site was occupied by a structure similar in size, shape and configuration to the current Site Building. Observations made during the Phase One ESA Site reconnaissance confirmed the Site Building to be occupied by retail units and a parking garage.

Notes:

- 1 - for each owner, specify one of the following types of property use (as defined in O.Reg. 153/04) that applies: Agriculture or other use
Commercial use
Community use Industrial use
Institutional use Parkland use
Residential use
- 2 - when submitting a record of site condition for filing, a copy of this table must be attached

Table 2 - Table of Potentially Contaminating Activities

PCA Designation	Location of Potentially Contaminating Activity	Potentially Contaminating Activity	Location of PCA (On-Site or Off-Site)	Distance from Phase One Property (metres)	Location Relative to Inferred Groundwater Flow Direction ¹	Contributing to an APEC at the Site (Yes/No)	Media Potentially Impacted (Ground Water, Soil and/or Sediment)
PCA-1	Phase One Property (road salting of paved asphalt)	Other - Road Salting Activities	On-Site	NA – On-Site PCA	NA – On-Site PCA	Yes	Soil and Groundwater
PCA-2	Phase One Property (hydro-vault)	Other – Hydro-vault	On-Site	NA – On-Site PCA	NA – On-Site PCA	Yes	Soil
PCA-3	Northwest of Phase One Property (coal storage)	Other – Coal storage and general industrial use	Off-Site	20	Upgradient	Yes	Groundwater
PCA-4	28 Helene Street North (waste generator of paints/pigments/coatings)	Other - Hazardous Waste Generation	Off-Site	20	Transgradient	No	Not Applicable
PCA-5	Northwest of Phase One Property (Railway)	Item 46 - Rail Yards, Tracks and Spurs	Off-Site	25	Upgradient	No	Not Applicable
PCA-6	84 and 90 Park Street East, 17 and 19 Ann Street, and part of 91 Park Street East (known fill material)	Item 30 - Importation of Fill Material of Unknown Quality	Off-Site	45	Transgradient	No	Not Applicable
PCA-7	30 Queen Street East (known fill material)	Item 30 - Importation of Fill Material of Unknown Quality	Off-Site	55	Transgradient	No	Not Applicable
PCA-8	30 Queen Street East (waste generator of petroleum-based waste oils/sludges)	Other - Hazardous Waste Generation	Off-Site	55	Transgradient	No	Not Applicable
PCA-9	30 Queen Street East (planing mill with lumber yard)	Item 45 - Pulp, Paper and Paperboard Manufacturing and Processing	Off-Site	55	Upgradient/Transgradient	No	Not Applicable
PCA-10	30 Queen Street East (one UST)	Item 28 - Gasoline and Associated Products Storage in Fixed Tanks	Off-Site	55	Upgradient/Transgradient	No	Not Applicable
PCA-11	80 High Street East (one UST)	Item 28 - Gasoline and Associated Products Storage in Fixed Tanks	Off-Site	80	Downgradient	No	Not Applicable
PCA-12	69 High Street East (suspect fill and vent pipes observed during site reconnaissance)	Item 28 - Gasoline and Associated Products Storage in Fixed Tanks	Off-Site	145	Downgradient	No	Not Applicable
PCA-13	10 Hurontario Street (publishing company)	Item 31 - Ink Manufacturing, Processing and Bulk Storage	Off-Site	160	Downgradient	No	Not Applicable

PCA Designation	Location of Potentially Contaminating Activity	Potentially Contaminating Activity	Location of PCA (On-Site or Off-Site)	Distance from Phase One Property (metres)	Location Relative to Inferred Groundwater Flow Direction ¹	Contributing to an APEC at the Site (Yes/No)	Media Potentially Impacted (Ground Water, Soil and/or Sediment)
PCA-14	17 Elizabeth Street (suspect fill and vent pipes observed during site reconnaissance)	Item 28 - Gasoline and Associated Products Storage in Fixed Tanks	Off-Site	170	Downgradient	No	Not Applicable
PCA-15	North of intersection of Hurontario Street and railway lines (coal and wood storage)	Other – Coal storage	Off-Site	185	Upgradient/Transgradient	No	Not Applicable
PCA-16	East of intersection of Hurontario Street and railway lines (two Imperial oil USTs)	Item 28 - Gasoline and Associated Products Storage in Fixed Tanks	Off-Site	185	Upgradient/Transgradient	No	Not Applicable
PCA-17	114 Lakeshore Road East (RFO with associated USTs and car wash)	Item 28 - Gasoline and Associated Products Storage in Fixed Tanks	Off-Site	215	Downgradient	No	Not Applicable
PCA-18	114 Lakeshore Road East (medical manufacturing supplies)	Other – Medical equipment manufacturing	Off-Site	215	Downgradient	No	Not Applicable
PCA-19	106 Lakeshore Road East (canvas manufacturing company)	Item 45 - Pulp, Paper and Paperboard Manufacturing and Processing	Off-Site	240	Downgradient	No	Not Applicable
PCA-20	136 Lakeshore Road East (motor repair shop)	Item 27 - Garages and Maintenance and Repair of Railcars, Marine Vehicles and Aviation Vehicles	Off-Site	240	Downgradient	No	Not Applicable
PCA-21	136 Lakeshore Road East (two USTs)	Item 28 - Gasoline and Associated Products Storage in Fixed Tanks	Off-Site	240	Downgradient	No	Not Applicable

Notes:
APEC – Area of Potential Environmental Concern
PCA – Potentially Contaminating Activity
1 – Location of PCA relative to the Phase One Property in relation to the inferred groundwater flow direction in the Phase One Study Area

Table 3 - Table of Areas of Potential Environmental Concern

Area of Potential Environmental Concern ¹	Location of Area of Potential Environmental Concern on Phase One Property	Potentially Contaminating Activity ²	Location of PCA (On-Site or Off-Site)	Contaminants of Potential Concern ³	Media Potentially Impacted (Ground Water, Soil and/or Sediment)
APEC-1 (Road salting activities on Phase One Property)	Paved portion of Phase One Property – central parking lot and southwestern sidewalks.	Other - Road Salting Activities	On-Site	EC SAR Na Cl-	Soil and Groundwater
APEC-2 (Hydro-vault present in Site Building)	Southern section of Phase One Property adjacent to parking lot.	Item 55 - Transformer Manufacturing, Processing and Use	On-Site	PHCs PCBs	Soil
APEC-3 (Coal storage and general industrial use)	Northwest portion of Phase One Property.	Other – Coal storage and general industrial use	Off-Site	PHCs BTEX PAHs Metals	Groundwater

Notes:

- 1 - Areas of potential environmental concern means the area on, in or under a phase one property where one or more contaminants are potentially present, as determined through the phase one environmental site assessment, including through,
- (a) identification of past or present uses on, in or under the phase one property, and
 - (b) identification of potentially contaminating activity.

- 2 - Potentially contaminating activity means a use or activity set out in Column A of Table 2 of Schedule D that is occurring or has occurred in a phase one study area

- 3 - When completing this column, identify all contaminants of potential concern using the Method Groups as identified in the Protocol for in the Assessment of Properties under Part XV.1 of the Environmental Protection Act, March 9, 2004, amended as of July 1, 2011, as specified below:

List of Method Groups:

ABNs	PCBs	Metals	Electrical Conductivity
CPs	PAHs	As, Sb, Se	Cr (VI)
1,4-Dioxane	THMs	Na	Hg
Dioxins/Furans, PCDDs/PCDFs	VOCs	B-HWS	Methyl Mercury
OCs	BTEX	Cl-	Low or high pH,
PHCs	Ca, Mg	CN-	SAR

4 - When submitting a record of site condition for filing, a copy of this table must be attached

APPENDIX B
Figures



	PROJECT NAME: PHASE ONE ENVIRONMENTAL SITE ASSESSMENT					
	CLIENT NAME: MPCT DIF 70 PARK STREET EAST LP					
	PROJECT LOCATION: 23, 25, 27, 29 AND 31 HELENE STREET NORTH, 53 QUEEN STREET EAST AND PART OF 70 PARK STREET EAST, MISSISSAUGA, ONTARIO					
	FIGURE NAME: KEY MAP				FIGURE NUMBER	
PROJECT NUMBER:	SCALE:	DRAWN BY:	REVIEWED BY:	DATE:	1	
314281.001	1:15,000	SIN	MS	DEC. 2022		





N

LEGEND

— SITE BOUNDARY

▨ SITE BUILDING

++++ RAILWAY LINE

LEGEND IS COLOUR DEPENDENT.
NON-COLOUR COPIES MAY ALTER
INTERPRETATION.



PROJECT NAME:

PHASE ONE ENVIRONMENTAL
SITE ASSESSMENT

CLIENT NAME:

MPCT DIF
70 PARK STREET EAST LP

PROJECT LOCATION:

23, 25, 27, 29 AND 31 HELENE STREET NORTH,
53 QUEEN STREET EAST AND PART OF 70
PARK STREET EAST, MISSISSAUGA, ONTARIO

FIGURE NAME:

PHASE ONE PROPERTY

PROJECT NUMBER:	SCALE:
314281.001	AS SHOWN
DRAWN BY:	REVIEWED BY:
SIN	MS
DATE:	FIGURE NUMBER:
DEC. 2022	2



INFERRED
GROUNDWATER
FLOW DIRECTION



N

LEGEND

--- SITE BOUNDARY

--- PHASE ONE STUDY AREA BOUNDARY

SITE BUILDING

RES RESIDENTIAL

MTR MULTI-TENANT RESIDENTIAL

COM COMMERCIAL

P PARKING

RFO RETAIL FUEL OUTLET

VFP VENT/FILL PIPE

UST UNDERGROUND STORAGE TANK

RESIDENTIAL LAND USE / PARKLAND USE / INSTITUTIONAL LAND USE

INDUSTRIAL LAND USE / COMMERCIAL LAND USE / COMMUNITY LAND USE

LEGEND IS COLOUR DEPENDENT. NON-COLOUR COPIES MAY ALTER INTERPRETATION.

PROJECT NAME:

PHASE ONE ENVIRONMENTAL SITE ASSESSMENT

CLIENT NAME:

MPCT DIF
70 PARK STREET EAST LP

PROJECT LOCATION:

23, 25, 27, 29 AND 31 HELENE STREET NORTH
53 QUEEN STREET EAST AND PART OF 70 PARK STREET EAST, MISSISSAUGA, ONTARIO

FIGURE NAME:

PHASE ONE STUDY AREA

PROJECT NUMBER:	SCALE:
314281.001	AS SHOWN
DRAWN BY:	REVIEWED BY:
SIN	MS
DATE:	FIGURE NUMBER:
DEC. 2022	3


INFERRED GROUNDWATER FLOW DIRECTION





©Google Earth contributors

PCA Designation	Location of Potentially Contaminating Activity	Potentially Contaminating Activity	Location of PCA (On-Site or Off-Site)	Distance from Phase One Property (metres)	Location Relative to Inferred Groundwater Flow Direction ¹	Contributing to an APEC at the Site (Yes/No)	Media Potentially Impacted (Ground Water, Soil and/or Sediment)
PCA-3	Northwest of Phase One Property (coal storage)	Other - Coal storage and general industrial use	Off-Site	20	Upgradient	Yes	Groundwater
PCA-4	28 Helene Street North (waste generator of paints/pigments/coatings)	Other - Hazardous Waste Generation	Off-Site	20	Transgradient	No	Not Applicable
PCA-5	Northwest of Phase One Property (Railway)	Item 46 - Rail Yards, Tracks and Spurs	Off-Site	25	Upgradient	No	Not Applicable
PCA-6	84 and 90 Park Street East, 17 and 19 Ann Street, and part of 91 Park Street East (known fill material)	Item 30 - Importation of Fill Material of Unknown Quality	Off-Site	45	Transgradient	No	Not Applicable
PCA-7	30 Queen Street East (known fill material)	Item 30 - Importation of Fill Material of Unknown Quality	Off-Site	55	Transgradient	No	Not Applicable
PCA-8	30 Queen Street East (waste generator of petroleum-based waste oils/sludges)	Other - Hazardous Waste Generation	Off-Site	55	Transgradient	No	Not Applicable
PCA-9	30 Queen Street East (planing mill with lumber yard)	Item 45 - Pulp, Paper and Paperboard Manufacturing and Processing	Off-Site	55	Upgradient/Transgradient	No	Not Applicable
PCA-10	30 Queen Street East (one UST)	Item 25 - Gasoline and Associated Products Storage in Fixed Tanks	Off-Site	55	Upgradient/Transgradient	No	Not Applicable
PCA-11	80 High Street East (one UST)	Item 25 - Gasoline and Associated Products Storage in Fixed Tanks	Off-Site	80	Downgradient	No	Not Applicable
PCA-12	89 High Street East (suspect fill and vent pipes observed during site reconnaissance)	Item 28 - Gasoline and Associated Products Storage in Fixed Tanks	Off-Site	145	Downgradient	No	Not Applicable
PCA-13	10 Hurontario Street (publishing company)	Item 31 - Ink Manufacturing, Processing and Bulk Storage	Off-Site	160	Downgradient	No	Not Applicable
PCA-14	17 Elizabeth Street (suspect fill and vent pipes observed during site reconnaissance)	Item 28 - Gasoline and Associated Products Storage in Fixed Tanks	Off-Site	170	Downgradient	No	Not Applicable
PCA-15	North of intersection of Hurontario Street and railway lines (coal and wood storage)	Other - Coal storage	Off-Site	185	Upgradient/Transgradient	No	Not Applicable
PCA-16	East of intersection of Hurontario Street and railway lines (two Imperial oil USTs)	Item 28 - Gasoline and Associated Products Storage in Fixed Tanks	Off-Site	185	Upgradient/Transgradient	No	Not Applicable
PCA-17	114 Lakeshore Road East (RFO with associated USTs and car wash)	Item 28 - Gasoline and Associated Products Storage in Fixed Tanks	Off-Site	215	Downgradient	No	Not Applicable
PCA-18	114 Lakeshore Road East (medical manufacturing supplies)	Other - Medical equipment manufacturing	Off-Site	215	Downgradient	No	Not Applicable
PCA-19	106 Lakeshore Road East (carwash manufacturing company)	Item 45 - Pulp, Paper and Paperboard Manufacturing and Processing	Off-Site	240	Downgradient	No	Not Applicable
PCA-20	136 Lakeshore Road East (motor repair shop)	Item 27 - Garages and Maintenance and Repair of Railcars, Marine Vehicles and Aviation Vehicles	Off-Site	240	Downgradient	No	Not Applicable
PCA-21	136 Lakeshore Road East (two USTs)	Item 25 - Gasoline and Associated Products Storage in Fixed Tanks	Off-Site	240	Downgradient	No	Not Applicable

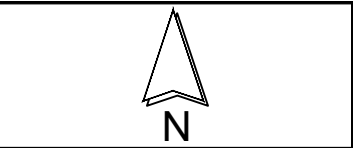

- LEGEND**
- SITE BOUNDARY
 - PHASE ONE STUDY AREA BOUNDARY
 - ▨ SITE BUILDING
 - (A) SITE BUILDING ID
 - RES RESIDENTIAL
 - MTR MULTI-TENANT RESIDENTIAL
 - (P) PARKING
 - PCA POTENTIALLY CONTAMINATING ACTIVITIES
 - (#) PCA NUMBER CONTRIBUTES TO AN APEC
 - (#) PCA NUMBER DOES NOT CONTRIBUTE TO AN APEC

LEGEND IS COLOUR DEPENDENT. NON-COLOUR COPIES MAY ALTER INTERPRETATION.




PROJECT NAME:
PHASE ONE ENVIRONMENTAL SITE ASSESSMENT

CLIENT NAME:
**MPCT DIF
70 PARK STREET EAST LP**


PROJECT LOCATION:
**23, 25, 27, 29 AND 31 HELENE STREET NORTH
53 QUEEN STREET EAST AND PART OF 70
PARK STREET EAST, MISSISSAUGA, ONTARIO**

FIGURE NAME:
**POTENTIALLY CONTAMINATING
ACTIVITIES (OFF SITE)**

PROJECT NUMBER: 314281.001	SCALE: AS SHOWN
DRAWN BY: SIN	REVIEWED BY: MS
DATE: DEC. 2022	FIGURE NUMBER: 5



INFERRED
GROUNDWATER
FLOW DIRECTION

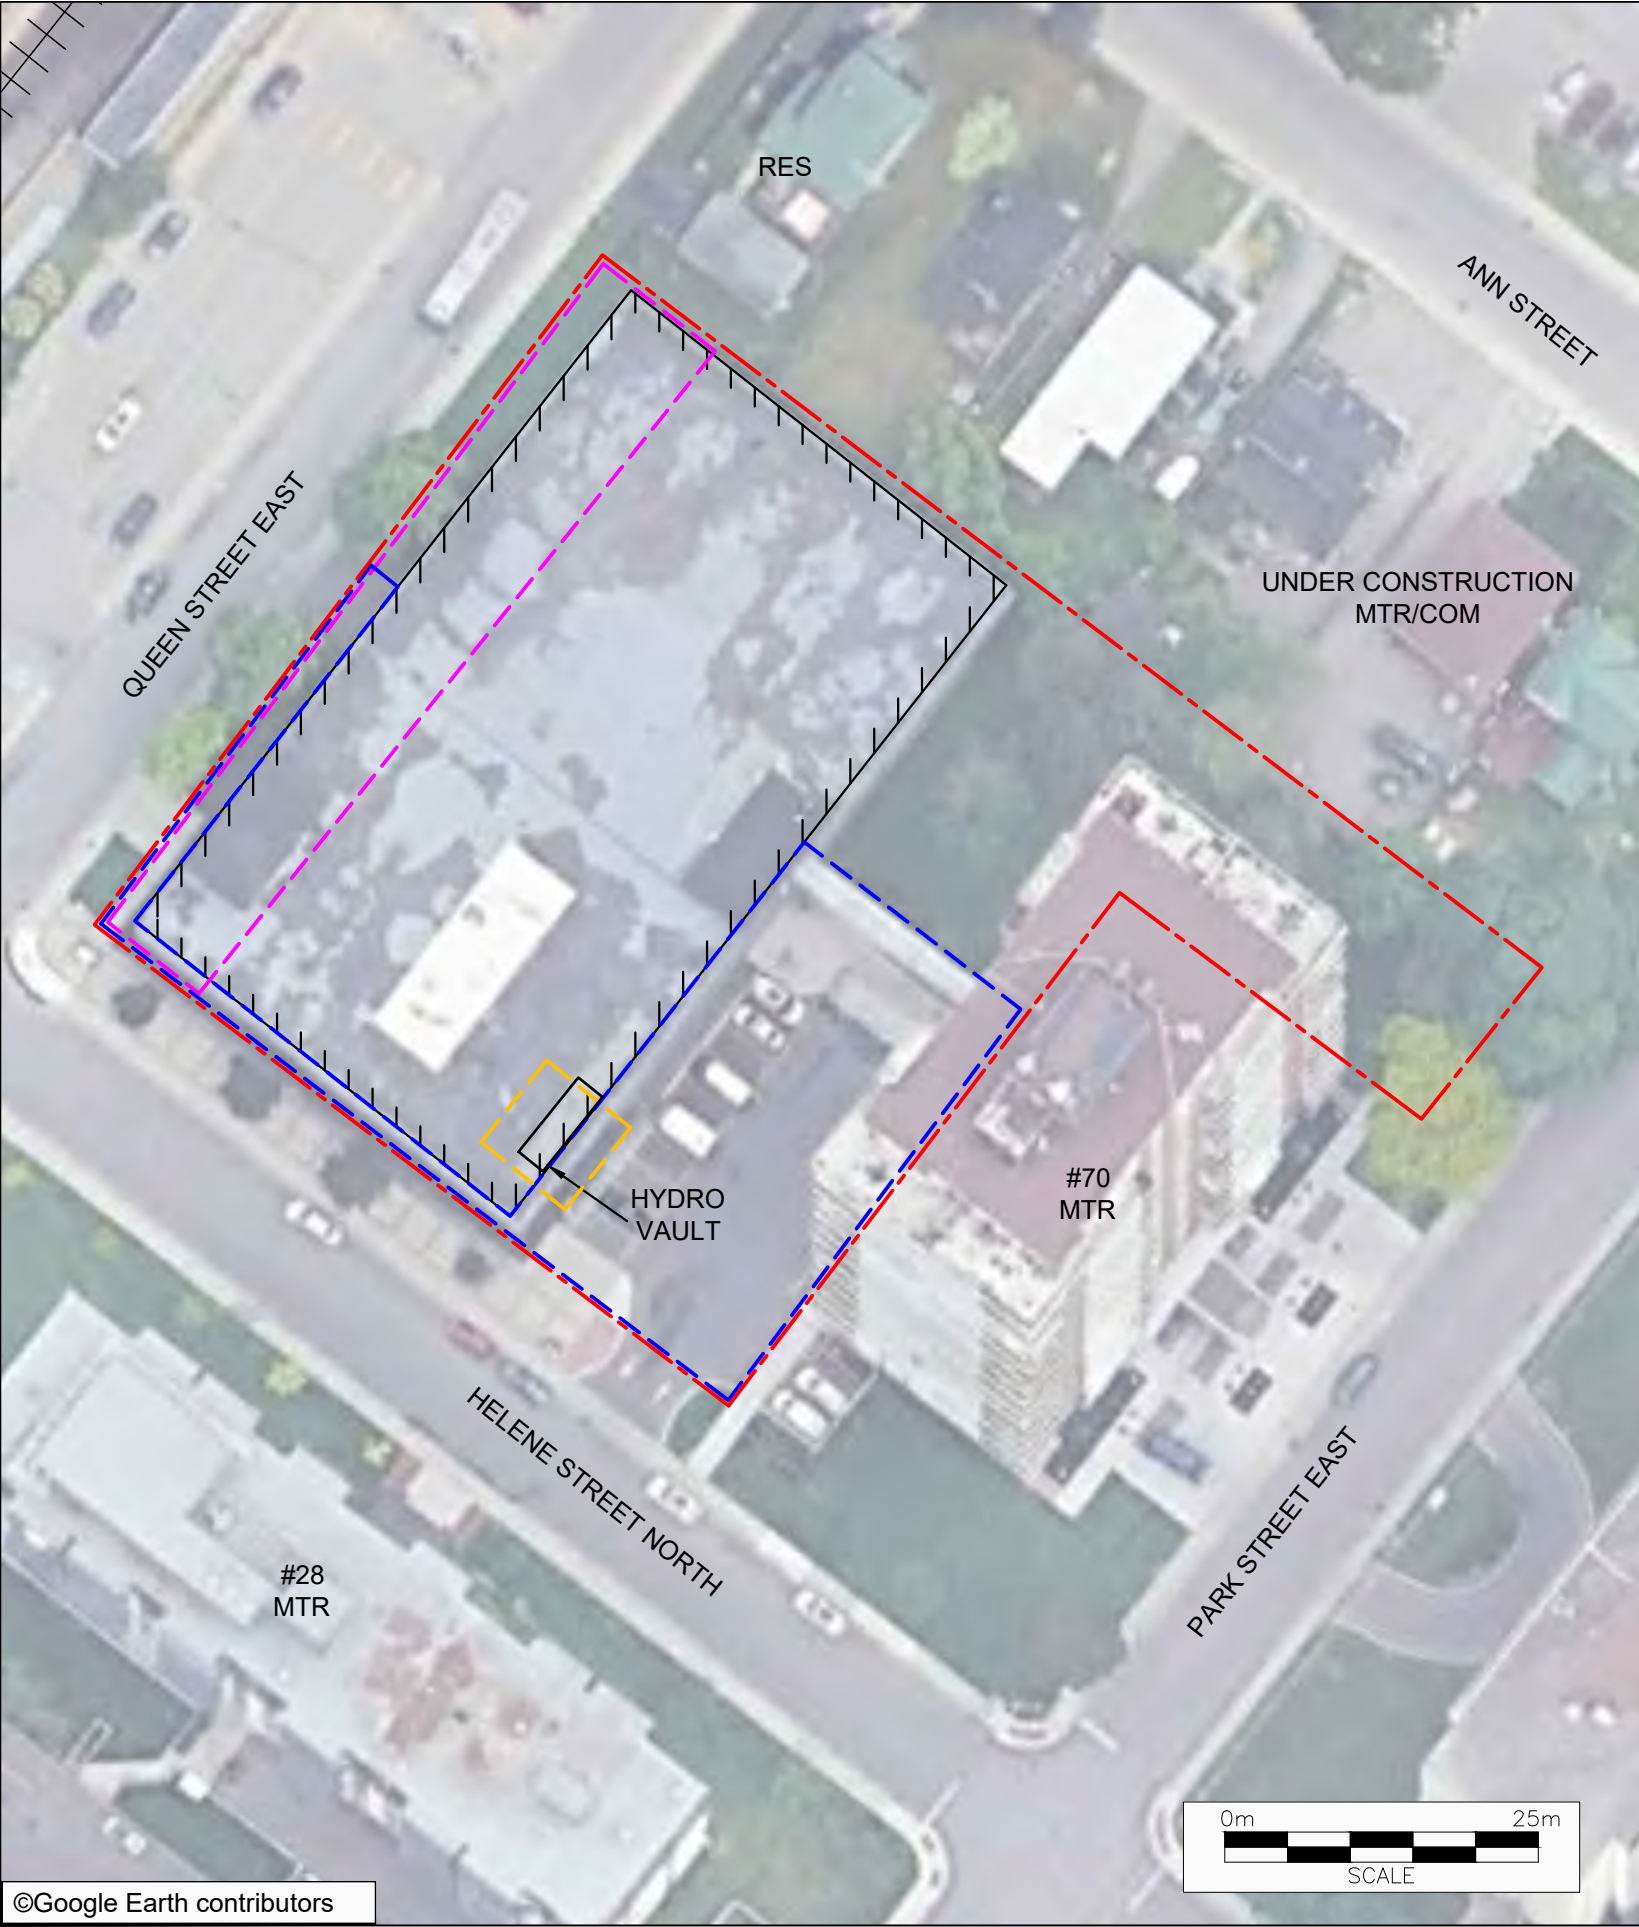

©Google Earth contributors

Area of Potential Environmental Concern ¹	Location of Area of Potential Environmental Concern on Phase One Property	Potentially Contaminating Activity ²	Location of PCA (On-Site or Off-Site)	Contaminants of Potential Concern ³	Media Potentially Impacted (Ground Water, Soil and/or Sediment)
APEC-1 (Road salting activities on Phase One Property)	Paved portion of Phase One Property – central parking lot and southwestern sidewalks.	Other - Road Salting Activities	On-Site	EC SAR Na Cl-	Soil and Groundwater
APEC-2 (Hydro-vault present in Site Building)	Southern section of Phase One Property adjacent to parking lot.	Item 55 - Transformer Manufacturing, Processing and Use	On-Site	PHCs PCBs	Soil
APEC-3 (Coal storage and general industrial use)	Northwest portion of Phase One Property.	Other – Coal storage and general industrial use	Off-Site	PHCs BTEX PAHs Metals	Groundwater



N

LEGEND

— SITE BOUNDARY

▨ SITE BUILDING

++++ RAILWAY LINE

APEC AREA OF POTENTIAL ENVIRONMENTAL CONCERN

▭ APEC-1

▭ APEC-2

▭ APEC-3

LEGEND IS COLOUR DEPENDENT. NON-COLOUR COPIES MAY ALTER INTERPRETATION.



PROJECT NAME:

PHASE ONE ENVIRONMENTAL SITE ASSESSMENT

CLIENT NAME:

MPCT DIF
70 PARK STREET EAST LP

PROJECT LOCATION:

23, 25, 27, 29 AND 31 HELENE STREET NORTH,
53 QUEEN STREET EAST AND PART OF 70
PARK STREET EAST, MISSISSAUGA, ONTARIO

FIGURE NAME:

AREAS OF POTENTIAL ENVIRONMENTAL CONCERN

PROJECT NUMBER:	SCALE:
314281.001	AS SHOWN
DRAWN BY:	REVIEWED BY:
SIN	MS
DATE:	FIGURE NUMBER:
DEC. 2022	6



INFERRED GROUNDWATER FLOW DIRECTION

APPENDIX C
Photographs



Photo 1 – Southwest corner of Site Building, looking southeast.



Photo 2 – Northwest side of Site Building, looking southeast.



Photo 3 – Southeast side of building, looking northeast.



Photo 4 – Tenant spaces in Site Building on southwest side, looking northeast.



Photo 5 – Tenant spaces in Site Building on southwest side, looking northeast.



Photo 6 – Lower level of parking garage in Site Building.



Photo 7 – Lower level of parking garage in Site Building.



Photo 8 – Green space on northeastern-central portion of Phase One Property, looking northwest.



Photo 9 – GO Station located northwest of Phase One Property.



Photo 10 – Example of multi-tenant residential buildings in Phase One Study Area.



Photo 11 – Example of multi-tenant residential buildings in Phase One Study Area.

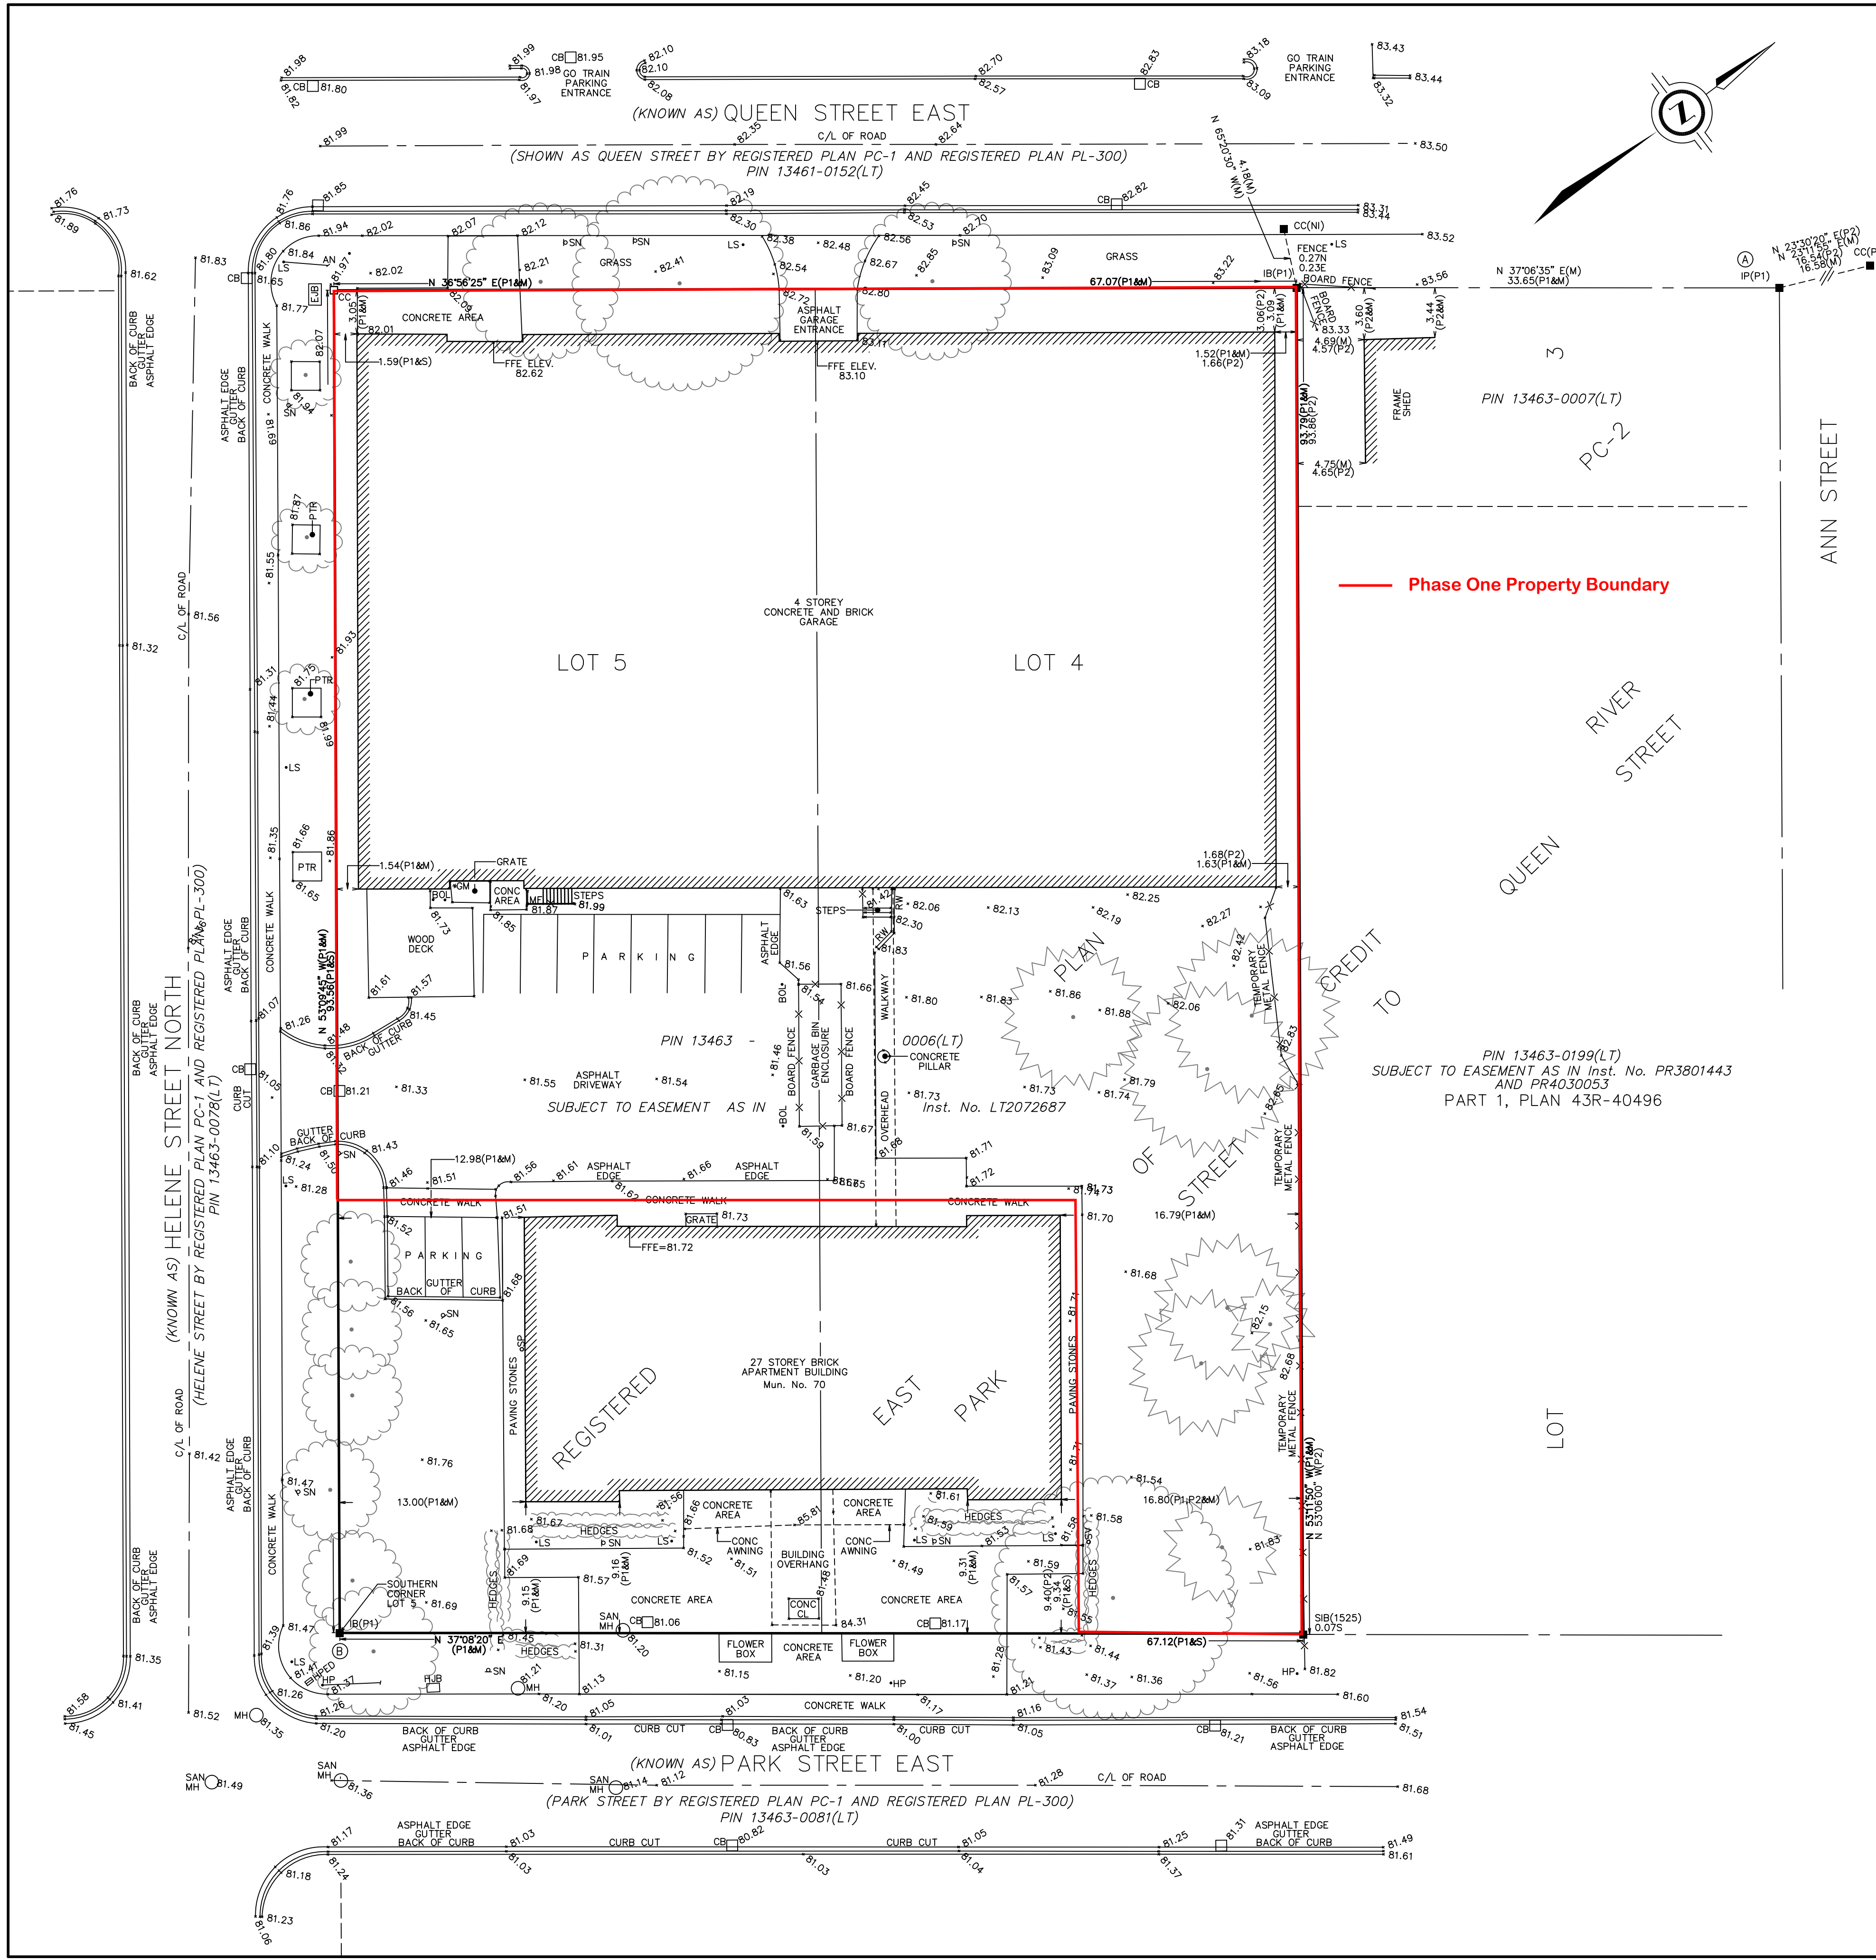


Photo 12 – Suspect fill and vent pipes located at 69 High Street East, looking southeast.



Photo 13 – Suspect fill and vent pipes located at 17 Elizabeth Street, looking northeast.

APPENDIX D
Survey Plan



PLAN OF SURVEY SHOWING TOPOGRAPHY OF
LOTS 4 AND 5
EAST OF CREDIT RIVER
PARK STREET TO QUEEN STREET
REGISTERED PLAN PC-2
CITY OF MISSISSAUGA
REGIONAL MUNICIPALITY OF PEEL

SCALE 1 : 250
J.D. BARNES LIMITED
© COPYRIGHT 2022

METRIC DISTANCES AND/OR COORDINATES SHOWN ON THIS PLAN ARE IN METRES AND CAN BE CONVERTED TO FEET BY DIVIDING BY 0.3048.

NOTES
BEARINGS ARE UTM GRID, DERIVED FROM OBSERVED REFERENCE POINTS A AND B, BY REAL TIME NETWORK (RTN) OBSERVATIONS, UTM ZONE 17, NAD83 (CSRS) (2010.0).
DISTANCES ARE GROUND AND CAN BE CONVERTED TO GRID BY MULTIPLYING BY THE COMBINED SCALE FACTOR OF 0.99975345.
FOR BEARING COMPARISONS, A ROTATION OF 00°57'35" COUNTER-CLOCKWISE WAS APPLIED TO BEARINGS ON PLAN P1.

FOR BEARING COMPARISONS, A ROTATION OF 00°57'35" COUNTER-CLOCKWISE WAS APPLIED TO BEARINGS ON PLAN P1.

INTEGRATION DATA		
OBSERVED REFERENCE POINTS (ORPs): UTM ZONE 17, NAD83 (CSRS) (2010.0).		
COORDINATES TO URBAN ACCURACY PER SECTION 14 (2) OF O.REG 216/10.		
POINT ID	EASTING	NORTHING
ORP (A)	614 227.11	4 823 600.32
ORP (B)	614 241.40	4 823 463.80
COORDINATES CANNOT, IN THEMSELVES, BE USED TO RE-ESTABLISH CORNERS OR BOUNDARIES SHOWN ON THIS PLAN.		
THE RESULTANT TIE BETWEEN ORP (A) AND ORP (B) IS 137.29 N 5°58'30" W		

BENCHMARK
ELEVATIONS SHOWN ON THIS PLAN ARE RELATED TO THE CANADIAN GEODETIC VERTICAL DATUM 1928, PRE 1978 ADJUSTMENT, AND ARE DERIVED FROM THE CITY OF MISSISSAUGA BENCHMARK No. 732 HAVING A PUBLISHED ELEVATION OF 78.128 METRES.


LEGEND	
■	DENOTES MONUMENT FOUND
□	DENOTES MONUMENT SET
CB	DENOTES CATCHBASIN
HJB	DENOTES HYDRO JUNCTION BOX
HPED	DENOTES HYDRO PEDESTAL
GM	DENOTES GAS METER
SP	DENOTES STAND PIPE
MH	DENOTES MANHOLE
SAN MH	DENOTES SANITARY MANHOLE
BOL	DENOTES BOLLARD
HP	DENOTES HYDRO POLE
PA	DENOTES POLE ANCHOR
AN	DENOTES LIGHT STANDARD
SV	DENOTES SPRINKLER VALVE
SN	DENOTES SIGN
XXDXXR	DENOTES DECIDUOUS TREE WITH RADIUS AND DIAMETER
XXDXXR	DENOTES CONIFEROUS TREE WITH RADIUS AND DIAMETER
CL	DENOTES COLUMN
CONC	DENOTES CONCRETE
FFE	DENOTES FINISHED FLOOR ELEVATION
GP	DENOTES GAS PIPE
MF	DENOTES METAL FENCE
PTR	DENOTES PLANTER
RW	DENOTES RETAINING WALL
CC	DENOTES CUT CROSS
IB	DENOTES IRON BAR
IP	DENOTES IRON PIPE
SIB	DENOTES STANDARD IRON BAR
NI	DENOTES NOT IDENTIFIABLE
M	DENOTES MEASURED
S	DENOTES SET
848	DENOTES WILLIAM BEVERLY STARR, OLS
1525	DENOTES RAVIS SURVEYING INC, OLS
P1	DENOTES PLAN OF SURVEY BY TARASICK, MCMILLAN LIMITED
	DATED MARCH 15, 2006
P2	DENOTES PLAN 43R-40496

ALL SET SSB AND PB MONUMENTS WERE USED DUE TO LACK OF OVERBURDEN AND/OR PROXIMITY OF UNDERGROUND UTILITIES IN ACCORDANCE WITH SECTION 11 (4) OF O.REG. 525/91.

SURVEYOR'S CERTIFICATE
I CERTIFY THAT:
1. THIS SURVEY AND PLAN ARE CORRECT AND IN ACCORDANCE WITH THE SURVEYS ACT, THE SURVEYORS ACT AND THE REGULATIONS MADE UNDER THEM.
2. THE SURVEY WAS COMPLETED ON SEPTEMBER 08, 2022.

SEPTEMBER 27 2022
DATE
AMIR KESHAVARZ
ONTARIO LAND SURVEYOR

THIS PLAN OF SURVEY RELATES TO AOLS PLAN SUBMISSION FORM NUMBER V-32930

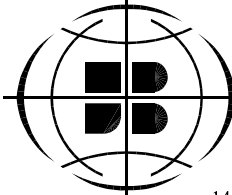

J.D. BARNES
LIMITED
LAND INFORMATION SPECIALISTS
140 RENFREW DRIVE, SUITE 100, MARKHAM, ON L3R 6B3
T: (905) 477-3600 F: (905) 477-3882 www.jdbarnes.com

DRAWN BY: IA

CHECKED BY: AK

REFERENCE NO.: 22-15-189-02

PLOTTED: 9/27/2022

DATED: SEPTEMBER 21, 2022

APPENDIX E
Opta Records



enviroscan



An SCM Company

175 Commerce Valley Drive W
Markham, Ontario L3T 7Z3

T: 905-882-6300
W: www.optaintel.ca

Report Completed By:

Midori

Site Address:

23, 25, 27, 29 & 31 Helene St. N., Mississauga, ON

Project No:

22031800030

Opta Order ID:


106649

Requested by:

Eleanor Goolab
ERIS

Date Completed:

3/24/2022 8:24:43 AM

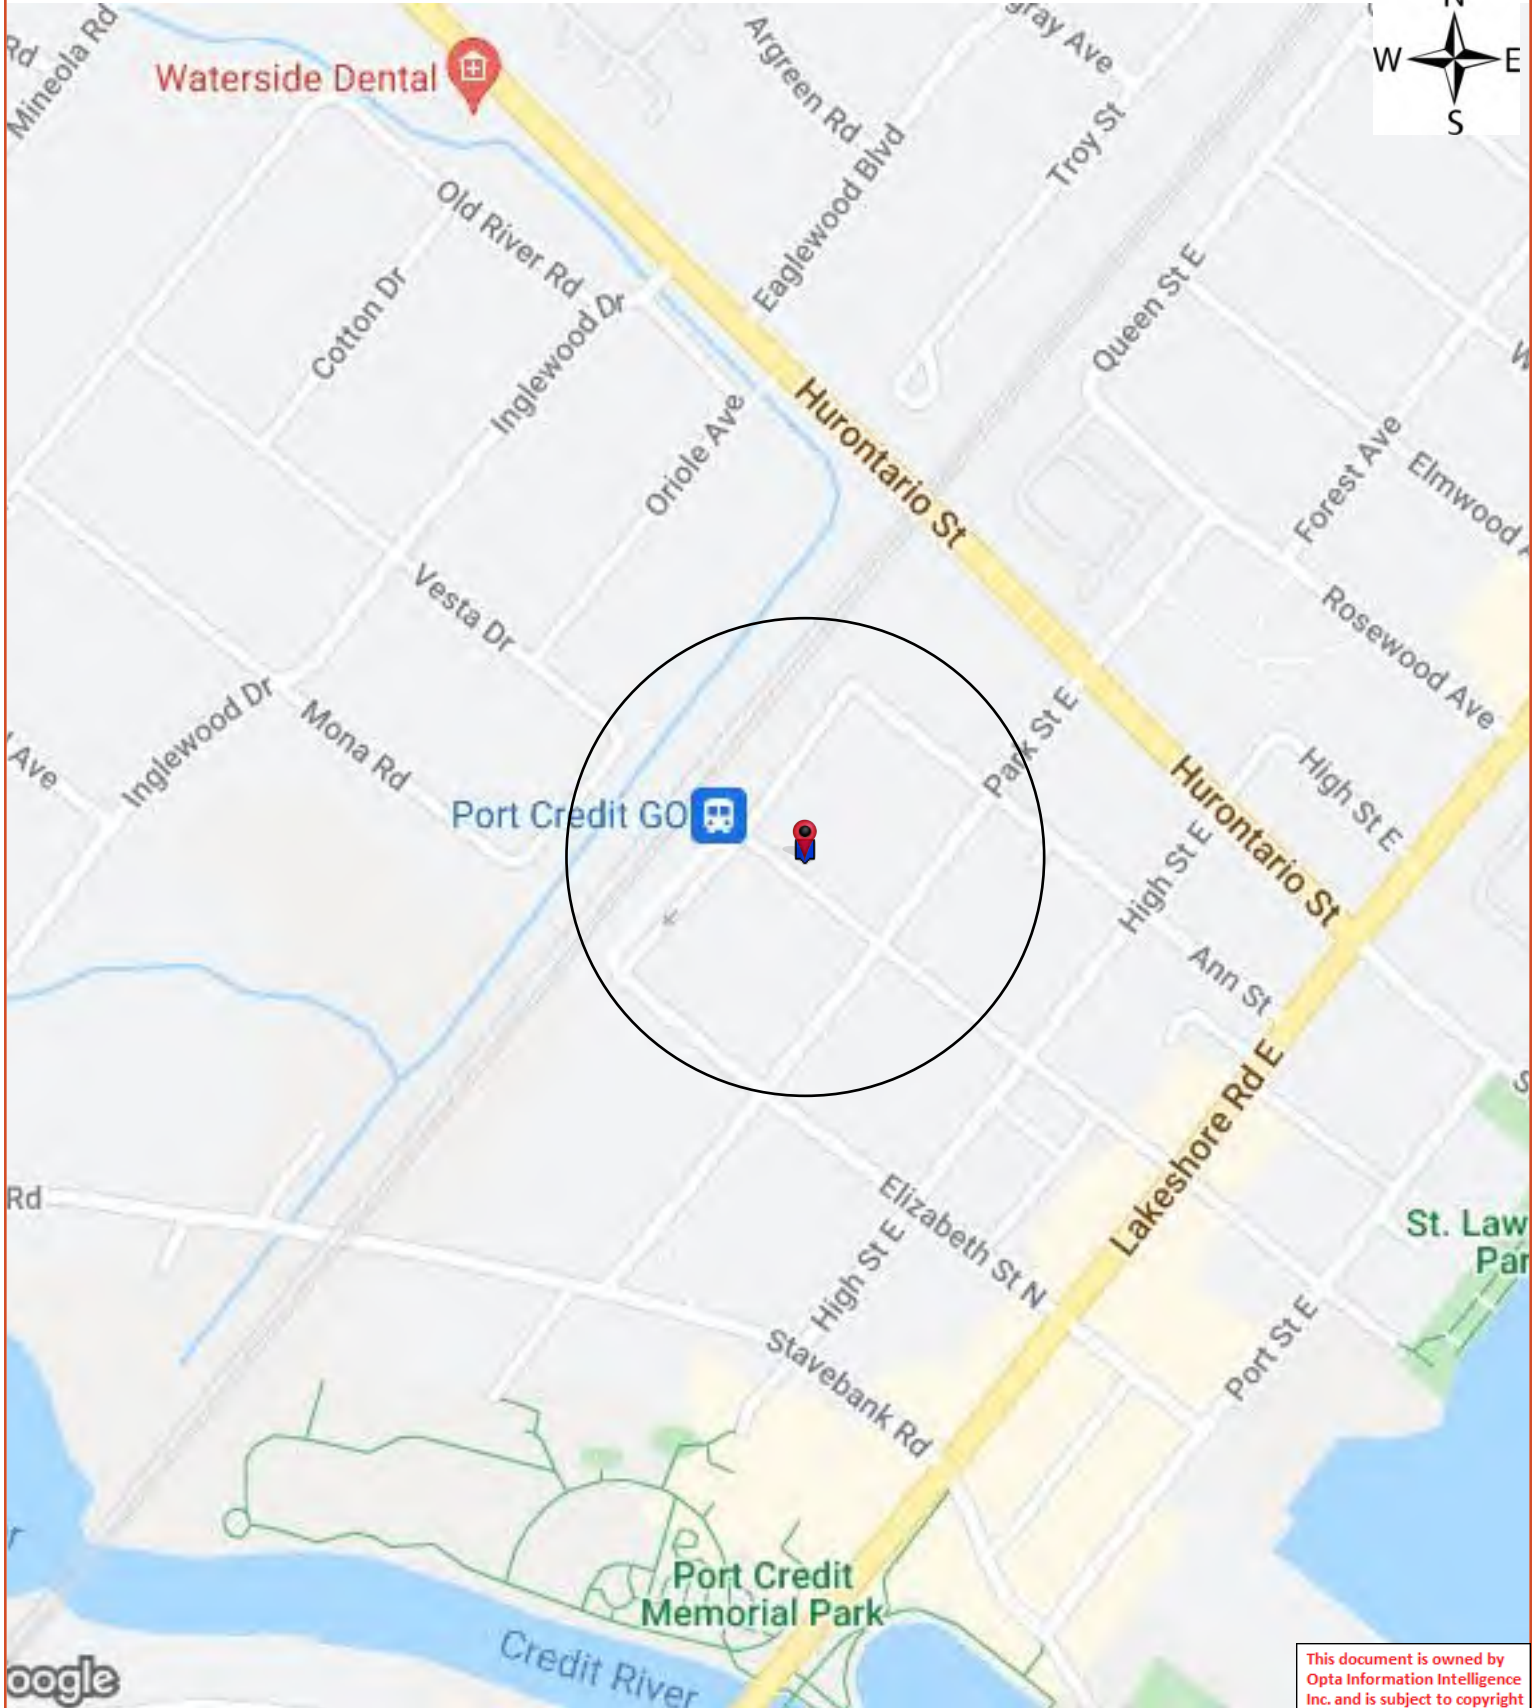

**Opta Historical Environmental Services Enviroscan
Terms and Conditions**

Requested by:

Eleanor Goolab

Date Completed: 03/24/2022 08:24:43



OPTA INFORMATION INTELLIGENCE

Opta Historical Environmental Services EnviroscanTM

Terms and Conditions

Report

The documents (hereinafter referred to as the "Documents") to be released as part of the report (hereinafter referred to as the "Report") to be delivered to the purchaser as set out above are documents in Opta's records relating to the described property (hereinafter referred to as the "Property"). Opta makes no representations or warranties respecting the Documents whatsoever, including, without limitation, with respect to the completeness, accuracy or usefulness of the Documents, and does not represent or warrant that these are the only plans and reports prepared in association with the Property or in Opta's possession at the time of Report delivery to the purchaser. The Documents are current as of the date(s) indicated on them. Interpretation of the Documents, if any, is by inference based upon the information which is apparent and obvious on the face of the Documents only. Opta does not represent, warrant or guarantee that interpretations other than those referred to do not exist from other sources. The Report will be prepared for use by the purchaser of the services as shown above hereof only.

Disclaimer

Opta disclaims responsibility for any losses or damages of any kind whatsoever, whether consequential or other, however caused, incurred or suffered, arising directly or indirectly as a result of the services (which services include, but are not limited to, the preparation of the Report provided hereunder), including but not limited to, any losses or damages arising directly or indirectly from any breach of contract, fundamental or otherwise, from reliance on Opta Reports or from any tortious acts or omissions of Opta's agents, employees or representatives.

Entire Agreement

The parties hereto acknowledge and agree to be bound by the terms and conditions hereof. The request form constitutes the entire agreement between the parties pertaining to the subject matter hereof and supersedes all prior and contemporaneous agreements, negotiations and discussions, whether oral or written, and there are no representations or warranties, or other agreements between the parties in connection with the subject matter hereof except as specifically set forth herein. No supplement, modification, waiver, or termination of the request shall be binding, unless confirmed in writing by the parties hereto.

Governing Document

In the event of any conflicts or inconsistencies between the provisions hereof and the Reports, the rights and obligations of the parties shall be deemed to be governed by the request form, which shall be the paramount document.

Law

This agreement shall be governed by and construed in accordance with the laws of the Province of Ontario and the laws of Canada applicable therein.

Report Index**Requested by:**

Eleanor Goolab

Date Completed: 03/24/2022 08:24:43



OPTA INFORMATION INTELLIGENCE

Page Report Title

5 (1995) Multirisk Report - 1995 TRANSIT DONUTS 23-31 Helene Street North Mississauga ON L5G3B6 (distance = 0 metres*)

15 (1983) Siteplan Report - 1983 CENTURY PLAZA 23-31 Helene Street North Mississauga ON L5G3B6 (distance = 0 metres*)

17 (1983) Commercial Property Fire Rating Form Report - 1983 CENTURY PLAZA 23-31 Helene Street North Mississauga ON L5G3B6 (distance = 0 metres*)

21 (1971) Survey for Rating Fire-Resistive Risks Report - 1971 TERLEN INVESTMENTS LTD. 23/31 Helene Street North Port Credit ON L5G3B6 (distance = 0 metres*)



**Multirisk Report - 1995 TRANSIT DONUTS 23-31
Helene Street North Mississauga ON L5G3B6**

Requested by:

Eleanor Goolab

Date Completed: 03/24/2022 08:24:43



OPTA INFORMATION INTELLIGENCE

Multirisk Report - 1995 TRANSIT DONUTS 23-31 Helene Street North Mississauga ON L5G3B6





Insurers' Advisory Organization (1989) Inc.

18 King Street East, Suite 700, Toronto, Ontario M5C 1C4 Tel.: (416) 368-1801 • Fax: (416) 368-7703

Ontario Branch Confidential Report

MULTIRISK SURVEY

Insured: TRANSIT DONUTS

Location Surveyed: 23 - 31 HELENE ST N
MISSISSAUGA, ONTARIO
L5G 3B6

Person Contacted: Yeganeh Kashamiam
Telephone number: (905) 891-8779

Customer: Citadel General Assurance Co.

Policy Number:
AIS Reference number: 10391988

Surveyed by: Dave McDevitt
Date of Survey: August 10, 1995

Committed to Service Excellence

IAO reports, prepared in compliance with commonly accepted risk control standards existing at the time services are rendered, are developed from an inspection of the premises and/or from data supplied by or on behalf of the Purchaser. IAO does not purport to list all hazards. While changes and modifications referred to in the reports are designed to upgrade protection and loss prevention of the premises, IAO assumes no responsibility for management and control of these activities. IAO will not be responsible to the Purchaser for any losses or damages, whether consequential or other, however caused, incurred or suffered, as a result of the services being provided.

MULTIRISK - FIRE, LIABILITY
AND BASIC CRIME

OCCUPANCY:

The insured is a tenant at this location. They have been in operation since 1995 and at this location for 6 months. They occupy 93 sq. m and are not the major occupant, having 2 employees. The premises are in good condition. The insured is interested in loss prevention, however there have not been any losses during the last 3 years.

- * Occupancy Description (Insured / major tenant if insured is non-occupant)

#23 1st Fl: The insured occupies the area as a donut and coffee shop operation with limited seating on the premises. There is a donut fryer set up at the rear with a hood and full automatic protection provided, but it is not used as the insured brings in all donuts from a supplier. No cooking is done. The kitchen arrangement is, however, described on the attached Cooking Supplement as the appliances are in working order.

- * Other Classes of Occupants

The remainder of the building is occupied as a dry cleaning depot, beauty salon, variety store and auto parking on the first floor. No access was made to the basement. The basement is sprinklered.

2nd & 3rd Fl: Auto parking. There is an unused swimming pool and change rooms on the top level, previously for the nearby high-rise apartment building.

- * Undesirable Features

None

It is recommended that this location be resurveyed in 1 year(s).

BUILDING:

- * Built - 1967 (est.) Height: Storey(s) (excluding basement) - 3
- * There are no additions.
- * There are no renovations.
- * Building Condition - Good
- * Area: Ground Floor - 2496 sq. m Total (including basement) - 9984 sq. m

BASIC CONSTRUCTION:

- * Walls - 80% Fire Resistive - Reinforced concrete
 - 20% Masonry - Concrete blocks, brick faced
- * Floors - (excluding basements) 100% Concrete
- * Roof - 100% - Concrete
 - Surface material(s) - Tar and gravel
 - Roof replaced, unable to determine when.

INTERIOR FINISH:

- * Walls - 10% non-combustible
 - 90% open
- * Ceilings - 10% non-combustible
 - 90% open

BASEMENTS:

- * Number of basements - 1
- * Total Area - 2496 sq. m
- * Finished - 0% Unfinished - 100%

VERTICAL OPENINGS:

- * Stairs - Non-fire rated enclosure

MEZZANINE: None

OUTBUILDINGS: None

HEATING:

- * Electric Baseboard Units - 100% - Electric
 - Original installation.
 - Installation appears safe

ELECTRICAL:

- * Condition - Good and appeared safe at the time of the survey.
- * Wiring - Conduit; BX
- * Overcurrent protection - Circuit Breakers.
- * Electrical system - Original installation.

PLUMBING:

- * Condition - Good at the time of the survey.
 - * Piping is Copper
 - * Plumbing - Original installation.
-

EXPOSURES: (within 15m of the risk):

* FRONT: OPEN

* REAR: TO TENANT

Construction - Masonry.
Occupancy - Parking garage.
Distance - 0 m Height - 3 storeys
Protection - Non-Sprinklered Grading - Moderate

* LEFT: TO TENANT

Construction - Masonry.
Occupancy - Dry Cleaners.
Distance - 0 m Height - 3 storeys
Protection - Non-Sprinklered Grading - Moderate

* RIGHT: OPEN

MUNICIPAL PROTECTION:

- * The FUS Public Fire Protection Classification is 2
- * Responding (career) fire department Mississauga
- * Distance from risk Less than 2.5 km
- * Access via Paved roads. Year-round.
- * The building itself is easily accessible to the fire department.
- * Two hydrants within 155m (standard)

PRIVATE PROTECTION at this location includes the following:

- * Standard extinguishers; Automatic sprinkler - Partial (The sprinkler system was neither tested nor evaluated during this survey, a sprinkler survey is available upon request)
 - * Fire detection/alarm system - Local - Full Heat & Smoke
 - * Restaurant cooking protection - Supplement attached
-

M U L T I R I S K - L I A B I L I T Y

OCCUPANCY - GENERAL INFORMATION

- * Neighbourhood is predominantly commercial / residential
 - * Insured - tenant Area occupied - 93 sq. m
 - * 50% accessible to public. Public access is considered moderate
 - * Gross revenue - could not be determined at time of survey.
-

PREMISES information at the time of this survey

- * The following appeared to be SATISFACTORY:

Floor Surfaces & Coverings; Walls & Ceilings; Interior Lighting; Exterior Lighting; Emergency Lighting; Interior Housekeeping; Exterior Housekeeping; Washrooms; Sidewalks, Yards & Parking Lots; Snow & ice removal; Signs & Awnings; Fire Exits; Fire Alarms

- * Other features present:

Sale of food

- * The food to liquor sales ratio is 100/0
- * Elevating devices in operation - none

M U L T I R I S K - B A S I C C R I M E

NEIGHBOURHOOD:

- * Predominantly commercial / residential
- * Stable
- * Best described as having a moderate crime rate

BUSINESS:

- * Description - Donut and coffee shop
- * Hours of Operation - 6am to 10pm 7 days/wk
- * Typical Stock - Donuts, coffee, soft drinks, equipment and fixtures, usual to class, also some cigarettes.
- * Smash & Grab exposure is low
- * There is no safe on the premises

GENERAL PROTECTION at the time of this survey:

- * The following appeared to be SATISFACTORY:

Exterior Lighting; Interior Lighting; Roof Accessibility;
Police Patrols

- * Security Alarm System - None
-

MULTIRISK - COOKING

BUSINESS:

- * The business operates as a donut shop at this location, with dining room. The insured has been at this location for 6 months and in this type of business for 6 months.
 - * Liquor permit - No
-

KITCHEN:

- * Wall Finish - Ceramic tiles
 - * Ceiling Finish - Susp. min. tiles
 - * Floor Covering - Concrete
 - * Wall finish near appliances - Non-combustible
 - * Cleanliness - Good
 - * Pest Control Program - None
-

REFRIGERATION INSTALLATION:

- * Refrigerators - 1 - in good repair.
-

APPLIANCES:

- * Oven - 1 Fuel - Natural gas
 - Automatic shut-off - Provided
 - Hood Construction - Stainless steel
 - Protection - None
 - * Deep fat fryer - 1 Fuel - Natural gas
 - Automatic shut-off - Provided
 - Hood Construction - Stainless steel
 - Protection - Fixed system
-

EXHAUST SYSTEM CLEANING:

- * Filter(s) - Not Cleaned (never Used)
 - Performed by
 - Filter(s) were clean at the time of the survey.
- * Hoods - Not Cleaned (never Used)
 - Performed by
 - Hoods were clean at the time of the survey.
- * Ducts - Not Cleaned
 - Performed by
 - It could not be determined if ducts were clean at time of survey.

EXHAUST DUCTS:

- * Installed in 1995
- * Arrangement - Discharges directly to the outside; Protected by a fixed extinguishing system
- * Ventilation equipment - adequate

FIXED EXTINGUISHING SYSTEMS:

- * Wet Chemical System labelled by ULC
 - Manual emergency operation is provided
 - Installation approved
 - Certificate available
 - Manufacturer - Rangeguard/Figgie
 - Model - 1.25G
-

MAINTENANCE CONTRACT:

- * Maintenance contract is not available
-

OTHER PROTECTION:

- * Automatic sprinklers are not provided
- * Kitchen extinguishers (40-B,C) are provided
- * Extinguisher types - Dry Chemical
- * ULC labelled grease extraction system not provided

M U L T I R I S K
R E M A R K S / R E C O M M E N D A T I O N S

REMARKS:

- * Fire, Liability & Basic Crime - The insured started business here in Feb. 1995. The risk is located in the Hurontario St. and Lakeshore Rd. area. The premises are clean and in good condition. The insured mentioned that the other named insured, Behnaz Perviz, is no longer involved in any way in the business and has been deleted from the policy. The portable fire extinguisher is tagged in June 1995, and has an "80B,C" rating.

The insured was co-operative and receptive to the survey and appears responsible. The premises were previously operated as a burger restaurant.

- * Cooking - The kitchen is clean and well arranged. The donut fryer is well set up and is adequately protected by the extinguishing system. The insured apparently had everything installed to meet all requirements, then decided instead to bring in all product from elsewhere on a daily basis; consequently, the cooking facilities have never been used. The system was installed in February 1995. The contractor's name was unavailable at the time of the visit. Regular maintenance will not be required unless the facilities are in use in the future.

- * No Recommendations made at this time

Siteplan Report - 1983 CENTURY PLAZA 23-31 Helene Street North Mississauga ON L5G3B6



DIAGRAM

IAO PLAN: Sheet No. 1922; Block No. 192211; Plan No. —; NOP ☒ Scale: 1cm = 6m ☒
1cm = 12m ☐

ESTIMATE ONLY

23-31 HELENE STREET NORTH — MISSISSAUGA

Age of building
early 1970's

QUEEN
EAST

1
E
20
1

300mm


~104m to hydrant →

-20m-

HELENE
STREET
NORTH

WEST

EAST

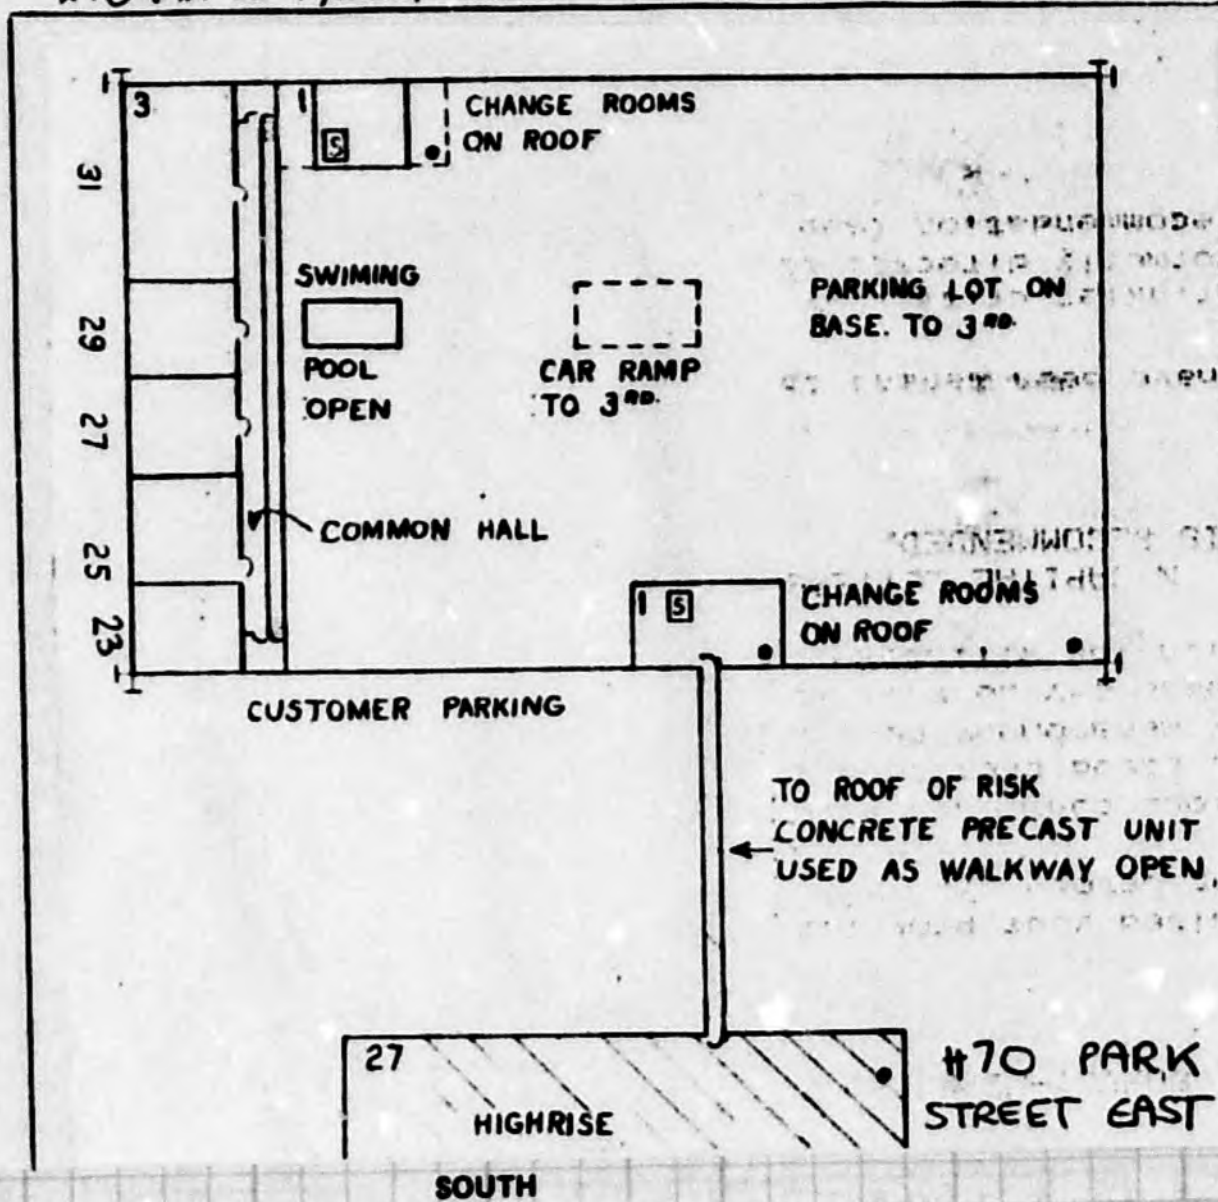

EXPOSURE - (SECTION VIII)

WALL OF BUILDING BEING RATED					BETWEEN BLDGS.		FACING WALL OF EXPOSURE						
Direction	Blnk.	Comb. & Non-Comb	Msnry. Up	Msnry. Sp	Distance	Party Wall	Blnk.	Msnry. Sp	Msnry. Up	Non-Comb.	Comb.	Occ'y Haz.	Length / Height
NORTH									X				
SOUTH			X		24								
EAST													
WEST													

Requested by: UNITED STATES
FIRE

Sig. Of Insp. G. Sparker
Dt. 18.5.83 / 24.5.83
(Inspected) (Written Up)

Report Date:
(Dt. Request Recd. In IAO Service Office)

Revised By:
Dt.

**Commercial Property Fire Rating Form Report -
1983 CENTURY PLAZA 23-31 Helene Street North
Mississauga ON L5G3B6**

Requested by:

Eleanor Goolab

Date Completed: 03/24/2022 08:24:43



OPTA INFORMATION INTELLIGENCE

Commercial Property Fire Rating Form Report - 1983 CENTURY PLAZA 23-31 Helene Street North Mississauga ON L5G3B6





COMMERCIAL PROPERTY FIRE RATING FORM

CODING			
NO.	TERM.	CODE	PROT.
754	91	1	2

LOCATION Mississauga NAME Century Plaza FILE NO. Mercantile
 ADDRESS 23-31 Helene Street North Insp'd. by G. Spencer Date 18.5.83
 Rated by G. Spencer Date 24.5.83

BASIC CONSTRUCTION: (SECTION II)

WALLS (ITEMS 210-215)

Construction Class 1 Bldg. Comb. Class L2

WALL AREA	MASONRY		FIRE RES.		NON COMB	COMB	DETAIL OF WALL CONSTRUCTION	% OF WALL PERIM	POINTS
	Wall Type	Wall Thick.	Dam. Type	Fire Res.					
	W-1	255mm	D-	HR			BK/HCB 10"	100 %	x 00
	W-		D-	HR				% x	
	W-		D-	HR				% x	
	W-		D-	HR				% x	
	W-		D-	HR				% x	
	W-		D-	HR				% x	
Columns in (or adjacent to) non-bearing masonry walls: Unprot. metal ☐ Comb. ☐								N/C	% x -
Panels in masonry or fire resistive walls: Comb. ☐ Non-comb. ☐ Glass ☒ Slow burning ☐								% x	
Special Conditions (Describe).....								% x	

FLOOR(S) AND ROOF (ITEMS 220-223)

LEVEL	DIMENSIONS	MAS. or F.R.		NON COMB	COMB	DETAILS OF FLOOR/ROOF MATERIALS	% of Total Floor/Roof Area	POINTS
		Dam. Type	Fire Res.					
Grade		D-1	HR			205mm POURED CONCRETE	100 %	x 00
2nd 3rd		D-1	HR			" " "	% x	
		D-	HR				% x	
		D-	HR				% x	
Roof		D-	HR				% x	

Total Basic Construction Charges:

Schedule Base

Building Base

Building Base x 0.7 Comb. Modifier (ITEM 230) x .001 = BASIC BUILDING RATE:

(carried fwd. overleaf)*

SECONDARY CONSTRUCTION: (SECTION III)

Height: (ITEM 300) Nbr. Storeys 3 Bast. 1 Comb. Stories (Without ground level access) 0

Vertical Openings: (ITEM 310)

Type	From	To	Enclosure	Doors	% Chgs.
V3	Bst	3rd	HCB / CONC/N	S/C Metal	1x.05
					+ 2.5
					+ 2.5

No. of Elevators: Passenger; Freight

Area: (ITEM 320) 39m x 64m x x
 Grade Floor Area 2496m² Total Area 9984m² Effective Area 2496m²

Roof Surface: (ITEM 330) Approved ☒ Other (Described).....

Combustible Concealed Spaces: (ITEM 340) Roof Space; Percentage of total roof area%
 Ceiling Space; Percentage of total floor area%

Combustible Interior Construction: (ITEM 350)
 Floor Surfacing; Percentage of total floor area%
 Interior Walls or Partitions; Percentage of total exterior wall area 1.6 % Wood
 Mezzanines or Decks; Percentage of total floor/roof area%

Combustible Interior Finish or Insulation: (ITEM 360)
 Walls: Percentage of total area of exterior walls; Ord. Dam.% Spec. Dam.%
 Roof & Floor(s): Percentage of total area of ceilings; Ord. Dam.% Spec. Dam.%

Combustible Exterior Finish or Attachments: (ITEM 370) None

Building Condition: (ITEM 380) Good ☒; Average ☐; Poor ☐;
 Built in 1970's; Est. ☐ Additions Built in; Est. ☐
 Air Conditioning:% Central ☒; Window ☐

Total Secondary Construction Charges: 23

OCCUPANCY: (SECTION IV, V, VI & VII)

St. No. Floor	Floor Area	% of Total Area	Occ'y Item No.	Name and Description of Occupancy and Hazards	Basic Occ'y Charge	Hazard Charges	Sep'd. Occ'y Factor	Total Occ'y Charge	Comb. Cl.	Succ. Cl.	Ind. Code
Common Hazards Applicable to Building				Electric Permanently installed 721-1-B		NIC					
Bst A ^{1st}	96	1.0	52-1	CENTURY BURGERS	63%		.4	49%	M3	S4	581
			52-2	Regular Cooking		60%					
Bst A ^{1st}	112	1.1	52-2	PRESTO TV SERVICE, (hand repair	50%		.4	26%	M3	S4	571
			52-2	one hand repair		15%					
Bst A ^{1st}	112	1.1	52-2	SHERIDAN CLEANERS	63%		.4	25%	M3	S3	722
Bst A ^{1st}	146	1.5	509	HAIR-ACTION 2, hair salon	20%		.4	08%	L2	S3	729
Bst A ^{1st}	158	1.6	52-2	GO-MART, grocery store	50%		.4	20%	M3	S3	543
Bst - 3 rd	9140	91.5	50-8	PARKING, public & private	20%		—	20%	L2	S2	754
3 rd	220	2.2	52-2	Recreational area -	30%		—	30%	L2	S2	799
TOTAL				9984							
										Building IND. CODE	754

Major Occupancy Charge 20 %
 20% of 158 (next 10 highest additional Total Occupancy Charges) 32 %
 Common Hazards applicable to the Building - %
 Net Occupancy Charge 52 %
 L1, L2 Area 95.2 %
 Net Occupancy Charge x .4 Occ'y Mod. Factor (ITEM 418) = 21 %
 **Total Secondary Construction Charge (brought forward from overleaf) + 23 %

*E.C. EXTRA		
IND. CODE	PERIL	ADD'L RATE

Facing Wall of Exposure						Facing Wall of Risk				Exposure Distance
Mas. Semi Prot.	Mas. Unprot.	Non Comb.	Comb.	Comb. Class	Lv/Ht	Comb. & Non Comb.	Masonry Unprot.	Masonry Semi Prot.		

Exposure Charge + - %
 Party Wall Charge (ITEM 831) + - %
 Communication Charge (ITEM 832) + - %

(brought forward from overleaf) BASIC BUILDING RATE 105 x 144 % = UNPROTECTED BLDG. RATE 151

MUNICIPAL PROTECTION: (SECTION IX)

F.U.S. Prot. Class 3 Revised Prot. Class _____
 Dist. to Hydrants: Stdr. ☒ Non Stdr. ☐ m. Accessibility: Good ☒ Poor ☐
 Dist. to Fire Hall: Stdr. ☒ Non Stdr. ☐ km. Congested Area: Yes ☐ No ☒
 Unprotected Bldg. Rate x .44 Protection Class Factor = PROTECTED BLDG. RATE 066

BUILDING ADJUSTMENT FACTOR: (SECTION X)

Protected Bldg. Rate x 1.28 Building Adjustment Factor = GROSS BLDG. RATE 084

INTERNAL PROTECTION: (SECTION XI)

Extinguishers Stdr. ☒ NA % Credit W. & C. Stdr. ☐ % Credit
 S.P. & H. Stdr. ☐ % Credit Automatic Fire Detection System Stdr. ☐ % Credit
 Automatic Sprinklers ☐ (Describe) % Credit
 Other Auto. Protection ☐ (Describe) % Credit
 GROSS BLDG. RATE Less % = Less % = Less % = FINAL BLDG. RATE 084

CONTENTS RATES (SECTION XII)

ITEM → 1200 1210 1220

Ind. Code	Succ. Class	OCCUPANCY	Succ. Charge	Hazards Adj.	Conts. Adj. Factor	Adj. Conts. Charge	Gross Bldg. Rate	Gross Conts. Rate	Int. Prot. Factor	FINAL CONTS. RATE
581	S4	RESTAURANT	.420	x 1.60	x 1.09	= .732	+ .084	= .816	x —	= .816
571	S4	TV SERVICE	.420	x 1.15	x .74	= .357	+ .084	= .441	x —	= .441
722	S3	CLEANERS	.280	x —	x .96	= .269	+ .084	= .353	x —	= .353
729	S3	HAIR SALON	.280	x —	x .96	= .269	+ .084	= .353	x —	= .353
543	S3	GROCERY STORE	.280	x —	x .92	= .258	+ .084	= .342	x —	= .342
754	S2	PARKING	.040	x —	x .96	= .038	+ .084	= .122	x —	= .122
799	S2	RECREATION	.040	x —	x 1.25	= .05	+ .084	= .134	x —	= .134

JW - 6/6/83.

ESTIMATE ONLY

COMMERCIAL PROPERTY FIRE INSPECTION SURVEY FORM OCCUPANCY & SPECIAL HAZARDS - (SECTIONS IV, V, VI & VII)

- **SEPARATED OCCUPANCY:** Is There Any Occupant(s) Cut-Off VERTICALLY ☐ /HORIZONTALLY ☐? Yes ☐; No ☐.
If Yes - Such Occupant Occupies _____ m², Comprising _____ % Of The Total Floor Area;

Describe: _____

OCCUPANCY DETAILS: Indicate:				1) Business Name Of Each Tenant, 2) Special Hazards Including Process Operation(s) And Faults Of Management, 3) Number, Type and Location Of Manual Fire Fighting Equipment, 4) Any Other Exceptional Features Of The Risk Not Discussed Elsewhere, and 5) Any Vacant Section(s).
CIVIC NO.	FLOOR LEVEL	AREA (m ²)	IBC IND. CODE	
23	Bst	48	581	storage no access
25	Bst	56	571	" " "
27	Bst	56	722	" " "
29	Bst	98	729	Mostly empty, some minor storage of assorted items.
31	Bst	54	543	Storage no access
23-31	Bst	2184	754	Parking lot -
23	1st	48	581	CENTURY BURGERS, restaurant - regular cooking. - No access.
25	1st	56	571	PRESTO TV SERVICE, one hand repair of TV's, Radios etc
27	1st	56	722	SHERIDAN CLEANERS, no access - locked
29	1st	48	729	HAIR - ACTION 1, hair salon. One - BC Size 1' extinguisher, dated May 27 th 1982.
31	1st	104	543	GO-MART, retail grocery store
23-31	1st	2184	754	PARKING -
23-31	2 nd	2496	754	"
23-31	3 rd	2276	754	" - open to general public & private.
23-31	3 rd	220	799	Swimming pool, recreational area and storage rooms, presumably used by 70 Park Street East.
				* #29 basement area was fully sprinklered as was common area in basement, sent from #2031 to building owner.
				Heating :- Electric permanently installed.
Total Floor Area				9984 754 ← (Building Owner's Interest) - Continued on attached sheet ☐ -

GENERAL UNDERWRITING COMMENTS

- **HOUSEKEEPING & MAINTENANCE:** Excellent ☐; Good ☒; Average ☒; Poor ☐ (describe) _____
#29
- **NEIGHBOURHOOD:** Isolated ☐; Residential ☒; Commercial ☒; Industrial ☐; Congested/Conflagration Hazard ☐ (describe) _____
- **OPINION OF RISK:** Excellent ☐; Good ☒; Average ☒; Poor ☐ (describe) _____
#29; fair build

Survey for Rating Fire-Resistive Risks Report - 1971 TERLEN INVESTMENTS LTD. 23/31 Helene Street North Port Credit ON L5G3B6



MERCANTILE DIVISION

Canadian Underwriters' Association

SURVEY FOR RATING FIRE-RESISTIVE RISKS

Questions and diagram must be completed and the form signed by the owner, occupant or architect of the building

Bas 20
+ 2.5 Int. of
22.5 outgr.

Location (Town and Street) PORT CREDIT, 25/31 HELENE ST. NTH. Ins. Plan-S 1922 a. 192211 No.
Owned by TERLEN INVESTMENTS LTD. Occupied by VARIOUS
For a SMALL PLAZA + CAR PARK No. of hands
Is building completely finished and out of workmen's hands? YES

OCCUPANCY

Give occupancy, kind of work, processes, machinery and number of hands on each floor

Basement STORAGE FOR INDIVIDUAL UNITS

1st 31 VARIETY STORE (GO'MART VARIETY)
29 HAIR STYLIST (CENTENARY PARK COIFFURE)
2nd 27 DRY CLEANING DEPOT (KWIK KLEEN) No work
25 PIZZA PARLOR (CENTURY PARK PIZZA) Take out

2ND. CAR PARK

3RD. CAR PARK

4TH. ROOF DECK, SWIMMING POOL, MINIATURE GOLF COURSE (NOT COMPLETED), CHANGE ROOMS, WASHROOMS. OPEN

6th

CONSTRUCTION OF BUILDING-

1. TYPE OF CONSTRUCTION - Floors & Roof Carried on:

- (a) Skeleton Steel Framework
(b) Reinforced Concrete, Framework
(c) Bearing Walls & Partitions

☐
☒
☐

- (d) Bearing Walls & Steel Columns
(e) Steel on Steel Walls & Roof
(f) Other Construction

☐
☐
☐

(Describe fully)

2. WALLS - State construction of external walls. BRICK ON HOLLOW CONCRETE BLOCK

If bearing walls give thickness of walls in inches at each floor

3. ROOF AND FLOOR - Materials

Roof ☒
Roof ☐
Roof ☐
Roof ☐

Floors ☒
Floors ☐
Floors ☐
Floors ☐

- (a) Concrete, reinforced - Poured in place 8" inches thick
(b) Concrete, on metal pan - Poured in place _____ inches thick
(c) Concrete, Precast Units _____ inches thick (Name of Manufacturer)
(d) Steel Deck, Construction #1 ☐ Otherwise ☐
If Construction #1 State method of attaching insulation to steel deck
Mechanical Fasteners ☐ Adhesive ☐ Otherwise ☐
If adhesive state trade name _____

Roof ☐

Floors ☐

- (e) Other Materials - Describe and Show Thickness _____

(over)

ROOF AND FLOOR - Method of support

Roof ☐

Floors ☐

(a) Unprotected Steel Beams.

Roof ☐

Floors ☐

(b) Steel Beams Protected by _____ inches of _____

Roof ☒

Floors ☒

(c) Reinforced Conc. Beams - Poured in place.

Roof ☐

Floors ☐

(d) Precast Concrete Structural Units _____ inches thick _____

(Name of Manufacturer)

Roof ☐

Floors ☐

(e) Bearing Walls Only. No Supporting Steel.

If building is composed of more than one type of construction, identify sections of floor involving each type and indicate on plan.

(a) Is there any roof space exceeding 3 feet in height? _____ If so, for what purpose is it used? _____

How is access obtained thereto? _____

If by trap or door, describe type _____

(b) Are all skylights of wired glass in metal frames? **NONE**

(c) Is there any wood in roof, louvers, ventilators or skylights; if so give details _____

(d) Is there a wood roof laid over an incombustible one? _____ If so, how is it supported? _____

(e) If so, what is the maximum and minimum height of this above the incombustible roof? _____

(f) Is the incombustible roof broken by Texas, louvers, ventilator, trapdoor, skylight, stair, elevator, other shaft? **STAIRWAY 4 CAR RAMP TO 3RD**

STAIRWAY 4 CAR RAMP TO ROOF

Is so, what is the construction of the sides through roof space? **N/A**

Is there any access or opening from these shafts to the roof space? Describe each separately. **N/A**

(g) Is there a superstructure, water cooling tower, or Penthouse of any kind on the roof? **N/A** If so, given dimensions, construction and occupancy **N/A**

How is access obtained? _____

(h) Is there a wood wearing floor? **N/A** If so, on which storeys? **N/A**

(i) Is it laid directly on incombustible floor or with an airspace? Describe _____

4. STEEL COLUMNS AND BEAMS - Are they fireproofed? **N/A** If "Yes" state nature and thickness of such protection.

(a) Columns **N/A**

(b) Beams **N/A**

FLOOR OPENINGS

5. STAIRWAYS - How many, and state from which floor to which? **2 STAIRWAYS, BASE TO 1ST.**

Is there an enclosure around them? **YES** If so, describe construction of enclosure, and the doors, and whether doors are self-closing **CONCRETE**

SELF CLOSING KALAMEIN DOORS

6. ELEVATORS - How many, and state from which floor to which? **NIL**

Is there an enclosure around them? _____ If so, describe construction of enclosure, and the doors, and whether doors are self-closing _____

7. CHUTES, VENTS, DUMB WAITERS & BELT HOLES & OTHER FLOOR OPENINGS - Give size, construction of enclosure (if any), type of door (if any), and whether self-closing, stating which floors are cut by each **NIL**

8. HEATING AND VENTILATING DUCTS - Are there any? **NIL** (a) Are ducts, which cut through floor, in masonry shafts _____

(b) Give construction of shaft _____

(c) State whether separate duct to each floor without communication to other floors _____

(d) Do ducts open into roof space? _____

9. HEIGHT - State number of floors and whether there is a basement **3 FLOORS WITH BASEMENT (PLUS ROOF)**

10. AREA - Give ground floor dimensions **127' x 210' (26,500 sq. ft. Total ground floor area)**

Commercial area - 3,300 sq. ft.

11. INTERIOR FINISH -

State separately for each floor, finish and method of attachment to walls and ceiling (If more than one type of finish is present on any one floor, state percentage of each type).

	Bas.	1st	2nd	3rd	4th	5th	6th	
(a) Walls	4CD/2	P/HCB	concrete	concrete				
(b) Ceilings	concrete	S.M.T	concrete	concrete				
(c) Partitions		P/MASONRY						

State extent of any wood partitions, or partitions having wood supports in square feet separately for each floor:-

MINOR IN STORES (LESS THAN 20 LINEAR FEET.)

(d) Is there any other inside or outside combustible finish or trim other than above? Describe fully. NIL

12. HEATING - What is the system of heating the building? ELECTRIC Where is heating plant located? ONE IN EACH STORE

Is it in fire-resistive room with standard fire door? Are there any stoves, if so, how many and where located? NIL

Do any heating devices vent otherwise than to brick or concrete chimney; if so, give details.

What fuel is used?

13. ELECTRIC WIRING - All wiring is in Rigid Conduit ☒ Otherwise ☒ BX CABLE

Are all circuits protected by type "S" tempo resisting fuses or non-interchangeable circuit breakers? CIRCUIT BREAKERS

14. POWER - Is any used? YES If so, what kind? ELECTRIC Total Horse Power? UNDER ONE

What used for? REFRIGERATION IN VARIETY STORE

If gasoline engine, state method of ignition, location and capacity of supply, tank, whether feed is pressure or gravity, quantity of gasoline in engine.

NIL

15. GASOLINE OR BENZINE, OR OTHER OILS - Are any kept? If so, what quantity of each?

What used for?

16. COMMUNICATIONS - Does the building communicate with any other building? YES (a) If so, give dimensions, height, construction and occupancy and indicate clearly on diagram BY A WALKWAY FROM THE ROOF OF RISK TO SOUTH, TO THE 3RD FLOOR OF THE HIGHRISE AT A DISTANCE OF 78'

(b) If so, are buildings separated by solid wall? NO (c) If so, are all openings in this wall protected by self-closing U.L. labelled Class A fire doors? NO

(d) If not, describe type of doors on each opening

PUBLIC PROTECTION

17. FIRE DEPARTMENT - State distance to the nearest fire station. 1/3 MILE

18. HYDRANTS - What is the distance to the nearest two hydrants? 60', 135' Give size of main HELENE ST & PARK

INTERNAL PROTECTION

6" CIRCULATING MAINS
QUEEN ST. 10" CIRCULATING MAINS

19. Show number units for each floor:

	Basement	1st	2nd	3rd	4th	5th	6th	7th	8th
Extrs. 2 1/2 Gal. Class A		2A	?	?					
Extrs. Class B & C		NOT INSTALLED AT TIME OF INSPECTION							
Stand Pipe & Hose		1	2	2					

20. WATCHMAN - Is there a Watchman making rounds of the whole premises, nights, Sundays, holidays, and at all times when plant is not in operation, rounds being made not less than once an hour during the night, i.e. from 6 p.m. to 6 a.m., and every two hours during the day?

(a) Does he use a portable clock, electric detector, or report to control station?

(b) Give name of manufacturer of clock

(c) Does it bear approval label of Underwriters' Laboratories

(d) Are the stations sufficient and so located that the Watchman must traverse each flat and every portion be visible to him?

21. AUTOMATIC FIRE DETECTION SYSTEM - If such system is present provide details on questionnaire obtainable from Canadian Underwriters' Association.

ONE HEAT DETECTOR IN EACH STORE + MANUALLY INTERNAL ALARM



enviroscan



An SCM Company

175 Commerce Valley Drive W
Markham, Ontario L3T 7Z3

T: 905-882-6300
W: www.optaintel.ca

Report Completed By:

Midori

Site Address:

70 Park Street East, Mississauga, ON

Project No:

22030800679

Opta Order ID:


106126

Requested by:

Eleanor Goolab
ERIS

Date Completed:

3/15/2022 12:09:07 PM

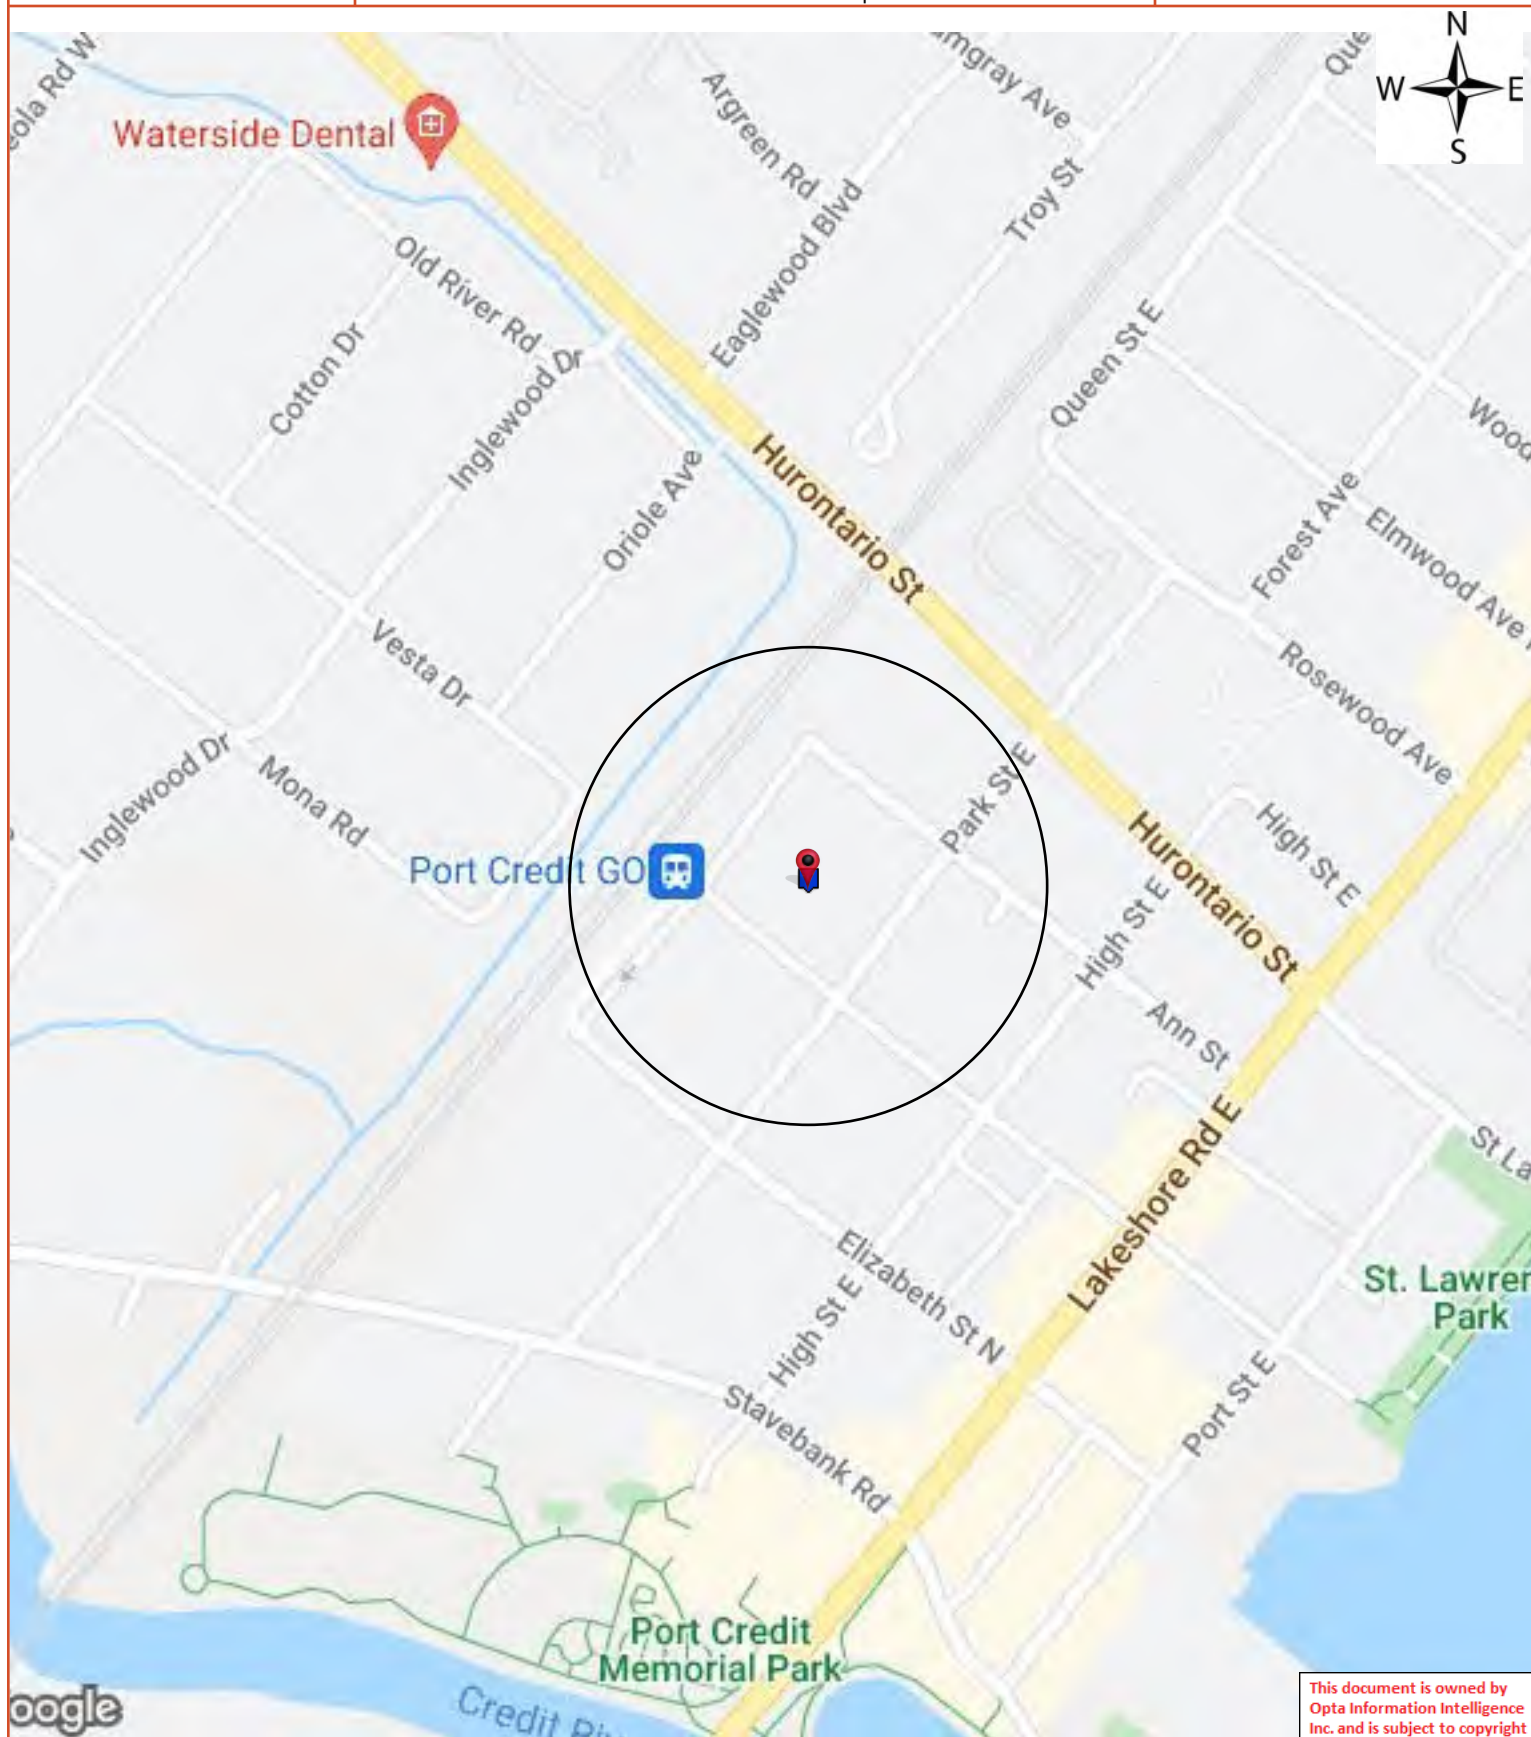

**Opta Historical Environmental Services Enviroscan
Terms and Conditions**

Requested by:

Eleanor Goolab

Date Completed: 03/15/2022 12:09:07



OPTA INFORMATION INTELLIGENCE

Opta Historical Environmental Services EnviroscanTM

Terms and Conditions

Report

The documents (hereinafter referred to as the "Documents") to be released as part of the report (hereinafter referred to as the "Report") to be delivered to the purchaser as set out above are documents in Opta's records relating to the described property (hereinafter referred to as the "Property"). Opta makes no representations or warranties respecting the Documents whatsoever, including, without limitation, with respect to the completeness, accuracy or usefulness of the Documents, and does not represent or warrant that these are the only plans and reports prepared in association with the Property or in Opta's possession at the time of Report delivery to the purchaser. The Documents are current as of the date(s) indicated on them. Interpretation of the Documents, if any, is by inference based upon the information which is apparent and obvious on the face of the Documents only. Opta does not represent, warrant or guarantee that interpretations other than those referred to do not exist from other sources. The Report will be prepared for use by the purchaser of the services as shown above hereof only.

Disclaimer

Opta disclaims responsibility for any losses or damages of any kind whatsoever, whether consequential or other, however caused, incurred or suffered, arising directly or indirectly as a result of the services (which services include, but are not limited to, the preparation of the Report provided hereunder), including but not limited to, any losses or damages arising directly or indirectly from any breach of contract, fundamental or otherwise, from reliance on Opta Reports or from any tortious acts or omissions of Opta's agents, employees or representatives.

Entire Agreement

The parties hereto acknowledge and agree to be bound by the terms and conditions hereof. The request form constitutes the entire agreement between the parties pertaining to the subject matter hereof and supersedes all prior and contemporaneous agreements, negotiations and discussions, whether oral or written, and there are no representations or warranties, or other agreements between the parties in connection with the subject matter hereof except as specifically set forth herein. No supplement, modification, waiver, or termination of the request shall be binding, unless confirmed in writing by the parties hereto.

Governing Document

In the event of any conflicts or inconsistencies between the provisions hereof and the Reports, the rights and obligations of the parties shall be deemed to be governed by the request form, which shall be the paramount document.

Law

This agreement shall be governed by and construed in accordance with the laws of the Province of Ontario and the laws of Canada applicable therein.

Report Index**Requested by:**

Eleanor Goolab

Date Completed: 03/15/2022 12:09:07



OPTA INFORMATION INTELLIGENCE

Page Report Title

5 (1971) Survey for Rating Fire-Resistive Risks Report - 1971 TERLIN INVESTMENTS 70 Park Street East Port Credit ON L5G1M5 (distance = 0 metres*)

9 (1984) Siteplan Report - 1984 70 Park Street East Mississauga ON L5G1M5 (distance = 0 metres*)

11 (1984) Commercial Property Fire Rating Form Report - 1984 TERLIN INVESTMENT 70 Park Street East Mississauga ON L5G1M5 (distance = 0 metres*)



**Survey for Rating Fire-Resistive Risks Report - 1971
TERLIN INVESTMENTS 70 Park Street East Port
Credit ON L5G1M5**

Requested by:

Eleanor Goolab

Date Completed: 03/15/2022 12:09:07



OPTA INFORMATION INTELLIGENCE

Survey for Rating Fire-Resistive Risks Report - 1971 TERLIN INVESTMENTS 70 Park Street East Port Credit ON L5G1M5



MERCANTILE DIVISION

Canadian Underwriters' Association

SURVEY FOR RATING FIRE-RESISTIVE RISKS

Questions and diagram must be completed and the form signed by the owner, occupant or architect of the building

Location (Town and Street) PORT CREDIT - PARK ST. E. Ins. Plan-S 1922 B. 192211 No. 70 (NOP)
Owned by TERLIN INVESTMENTS Occupied by _____
For a APARTMENTS No. of hands _____
Is building completely finished and out of workmen's hands? YES

OCCUPANCY

Give occupancy, kind of work, processes, machinery and number of hands on each floor

Basement B₂ - Boiler Room (for Hotwater Boilers - oil - (3)) - lockers. (SPRINKLERED)
B₁ - lockers - Laundry - Gym - Sauna - entrance to garage.
1st }
2nd } Apartment.
3rd }
4th }
5th }
6th }
7th }
8th }
9th }
10th }
11th }
12th }
13th }
14th }
15th }
16th }
17th }
18th }
19th }
20th }
21st }
22nd }
23rd }
24th }
25th }
26th }
27th }
28th }
29th }
30th }
31st }
32nd }
33rd }
34th }
35th }
36th }
37th }
38th }
39th }
40th }
41st }
42nd }
43rd }
44th }
45th }
46th }
47th }
48th }
49th }
50th }
51st }
52nd }
53rd }
54th }
55th }
56th }
57th }
58th }
59th }
60th }
61st }
62nd }
63rd }
64th }
65th }
66th }
67th }
68th }
69th }
70th }
71st }
72nd }
73rd }
74th }
75th }
76th }
77th }
78th }
79th }
80th }
81st }
82nd }
83rd }
84th }
85th }
86th }
87th }
88th }
89th }
90th }
91st }
92nd }
93rd }
94th }
95th }
96th }
97th }
98th }
99th }
100th }
101st }
102nd }
103rd }
104th }
105th }
106th }
107th }
108th }
109th }
110th }
111st }
112nd }
113rd }
114th }
115th }
116th }
117th }
118th }
119th }
120th }
121st }
122nd }
123rd }
124th }
125th }
126th }
127th }
128th }
129th }
130th }
131st }
132nd }
133rd }
134th }
135th }
136th }
137th }
138th }
139th }
140th }
141st }
142nd }
143rd }
144th }
145th }
146th }
147th }
148th }
149th }
150th }
151st }
152nd }
153rd }
154th }
155th }
156th }
157th }
158th }
159th }
160th }
161st }
162nd }
163rd }
164th }
165th }
166th }
167th }
168th }
169th }
170th }
171st }
172nd }
173rd }
174th }
175th }
176th }
177th }
178th }
179th }
180th }
181st }
182nd }
183rd }
184th }
185th }
186th }
187th }
188th }
189th }
190th }
191st }
192nd }
193rd }
194th }
195th }
196th }
197th }
198th }
199th }
200th }
201st }
202nd }
203rd }
204th }
205th }
206th }
207th }
208th }
209th }
210th }
211st }
212nd }
213rd }
214th }
215th }
216th }
217th }
218th }
219th }
220th }
221st }
222nd }
223rd }
224th }
225th }
226th }
227th }
228th }
229th }
230th }
231st }
232nd }
233rd }
234th }
235th }
236th }
237th }
238th }
239th }
240th }
241st }
242nd }
243rd }
244th }
245th }
246th }
247th }
248th }
249th }
250th }
251st }
252nd }
253rd }
254th }
255th }
256th }
257th }
258th }
259th }
260th }
261st }
262nd }
263rd }
264th }
265th }
266th }
267th }
268th }
269th }
270th }
271st }
272nd }
273rd }
274th }
275th }
276th }
277th }
278th }
279th }
280th }
281st }
282nd }
283rd }
284th }
285th }
286th }
287th }
288th }
289th }
290th }
291st }
292nd }
293rd }
294th }
295th }
296th }
297th }
298th }
299th }
300th }
301st }
302nd }
303rd }
304th }
305th }
306th }
307th }
308th }
309th }
310th }
311st }
312nd }
313rd }
314th }
315th }
316th }
317th }
318th }
319th }
320th }
321st }
322nd }
323rd }
324th }
325th }
326th }
327th }
328th }
329th }
330th }
331st }
332nd }
333rd }
334th }
335th }
336th }
337th }
338th }
339th }
340th }
341st }
342nd }
343rd }
344th }
345th }
346th }
347th }
348th }
349th }
350th }
351st }
352nd }
353rd }
354th }
355th }
356th }
357th }
358th }
359th }
360th }
361st }
362nd }
363rd }
364th }
365th }
366th }
367th }
368th }
369th }
370th }
371st }
372nd }
373rd }
374th }
375th }
376th }
377th }
378th }
379th }
380th }
381st }
382nd }
383rd }
384th }
385th }
386th }
387th }
388th }
389th }
390th }
391st }
392nd }
393rd }
394th }
395th }
396th }
397th }
398th }
399th }
400th }
401st }
402nd }
403rd }
404th }
405th }
406th }
407th }
408th }
409th }
410th }
411st }
412nd }
413rd }
414th }
415th }
416th }
417th }
418th }
419th }
420th }
421st }
422nd }
423rd }
424th }
425th }
426th }
427th }
428th }
429th }
430th }
431st }
432nd }
433rd }
434th }
435th }
436th }
437th }
438th }
439th }
440th }
441st }
442nd }
443rd }
444th }
445th }
446th }
447th }
448th }
449th }
450th }
451st }
452nd }
453rd }
454th }
455th }
456th }
457th }
458th }
459th }
460th }
461st }
462nd }
463rd }
464th }
465th }
466th }
467th }
468th }
469th }
470th }
471st }
472nd }
473rd }
474th }
475th }
476th }
477th }
478th }
479th }
480th }
481st }
482nd }
483rd }
484th }
485th }
486th }
487th }
488th }
489th }
490th }
491st }
492nd }
493rd }
494th }
495th }
496th }
497th }
498th }
499th }
500th }
501st }
502nd }
503rd }
504th }
505th }
506th }
507th }
508th }
509th }
510th }
511st }
512nd }
513rd }
514th }
515th }
516th }
517th }
518th }
519th }
520th }
521st }
522nd }
523rd }
524th }
525th }
526th }
527th }
528th }
529th }
530th }
531st }
532nd }
533rd }
534th }
535th }
536th }
537th }
538th }
539th }
540th }
541st }
542nd }
543rd }
544th }
545th }
546th }
547th }
548th }
549th }
550th }
551st }
552nd }
553rd }
554th }
555th }
556th }
557th }
558th }
559th }
560th }
561st }
562nd }
563rd }
564th }
565th }
566th }
567th }
568th }
569th }
570th }
571st }
572nd }
573rd }
574th }
575th }
576th }
577th }
578th }
579th }
580th }
581st }
582nd }
583rd }
584th }
585th }
586th }
587th }
588th }
589th }
590th }
591st }
592nd }
593rd }
594th }
595th }
596th }
597th }
598th }
599th }
600th }
601st }
602nd }
603rd }
604th }
605th }
606th }
607th }
608th }
609th }
610th }
611st }
612nd }
613rd }
614th }
615th }
616th }
617th }
618th }
619th }
620th }
621st }
622nd }
623rd }
624th }
625th }
626th }
627th }
628th }
629th }
630th }
631st }
632nd }
633rd }
634th }
635th }
636th }
637th }
638th }
639th }
640th }
641st }
642nd }
643rd }
644th }
645th }
646th }
647th }
648th }
649th }
650th }
651st }
652nd }
653rd }
654th }
655th }
656th }
657th }
658th }
659th }
660th }
661st }
662nd }
663rd }
664th }
665th }
666th }
667th }
668th }
669th }
670th }
671st }
672nd }
673rd }
674th }
675th }
676th }
677th }
678th }
679th }
680th }
681st }
682nd }
683rd }
684th }
685th }
686th }
687th }
688th }
689th }
690th }
691st }
692nd }
693rd }
694th }
695th }
696th }
697th }
698th }
699th }
700th }
701st }
702nd }
703rd }
704th }
705th }
706th }
707th }
708th }
709th }
710th }
711st }
712nd }
713rd }
714th }
715th }
716th }
717th }
718th }
719th }
720th }
721st }
722nd }
723rd }
724th }
725th }
726th }
727th }
728th }
729th }
730th }
731st }
732nd }
733rd }
734th }
735th }
736th }
737th }
738th }
739th }
740th }
741st }
742nd }
743rd }
744th }
745th }
746th }
747th }
748th }
749th }
750th }
751st }
752nd }
753rd }
754th }
755th }
756th }
757th }
758th }
759th }
760th }
761st }
762nd }
763rd }
764th }
765th }
766th }
767th }
768th }
769th }
770th }
771st }
772nd }
773rd }
774th }
775th }
776th }
777th }
778th }
779th }
780th }
781st }
782nd }
783rd }
784th }
785th }
786th }
787th }
788th }
789th }
790th }
791st }
792nd }
793rd }
794th }
795th }
796th }
797th }
798th }
799th }
800th }
801st }
802nd }
803rd }
804th }
805th }
806th }
807th }
808th }
809th }
810th }
811st }
812nd }
813rd }
814th }
815th }
816th }
817th }
818th }
819th }
820th }
821st }
822nd }
823rd }
824th }
825th }
826th }
827th }
828th }
829th }
830th }
831st }
832nd }
833rd }
834th }
835th }
836th }
837th }
838th }
839th }
840th }
841st }
842nd }
843rd }
844th }
845th }
846th }
847th }
848th }
849th }
850th }
851st }
852nd }
853rd }
854th }
855th }
856th }
857th }
858th }
859th }
860th }
861st }
862nd }
863rd }
864th }
865th }
866th }
867th }
868th }
869th }
870th }
871st }
872nd }
873rd }
874th }
875th }
876th }
877th }
878th }
879th }
880th }
881st }
882nd }
883rd }
884th }
885th }
886th }
887th }
888th }
889th }
890th }
891st }
892nd }
893rd }
894th }
895th }
896th }
897th }
898th }
899th }
900th }
901st }
902nd }
903rd }
904th }
905th }
906th }
907th }
908th }
909th }
910th }
911st }
912nd }
913rd }
914th }
915th }
916th }
917th }
918th }
919th }
920th }
921st }
922nd }
923rd }
924th }
925th }
926th }
927th }
928th }
929th }
930th }
931st }
932nd }
933rd }
934th }
935th }
936th }
937th }
938th }
939th }
940th }
941st }
942nd }
943rd }
944th }
945th }
946th }
947th }
948th }
949th }
950th }
951st }
952nd }
953rd }
954th }
955th }
956th }
957th }
958th }
959th }
960th }
961st }
962nd }
963rd }
964th }
965th }
966th }
967th }
968th }
969th }
970th }
971st }
972nd }
973rd }
974th }
975th }
976th }
977th }
978th }
979th }
980th }
981st }
982nd }
983rd }
984th }
985th }
986th }
987th }
988th }
989th }
990th }
991st }
992nd }
993rd }
994th }
995th }
996th }
997th }
998th }
999th }
1000th }

C.P. Code 012/013
Bedg. 13 x 35% = 4.5
annual inc E.C.E.
July 22/21
OK.

CONSTRUCTION OF BUILDING

1. TYPE OF CONSTRUCTION - Floors & Roof Carried on:

(a) Skeleton Steel Framework	☐	(d) Bearing Walls & Steel Columns	☐
(b) Reinforced Concrete, Framework	☒	(e) Steel on Steel Walls & Roof	☐
(c) Bearing Walls & Partitions	☐	(f) Other Construction	☐
- (Describe fully)

2. WALLS - State construction of external walls.

B/HED

If bearing walls give thickness of walls in inches at each floor

3. ROOF AND FLOOR - Materials

Roof ☒	Floors ☒	(a) Concrete, reinforced - Poured in place	8	inches thick
Roof ☐	Floors ☐	(b) Concrete, on metal pan - Poured in place		inches thick
Roof ☐	Floors ☐	(c) Concrete, Precast Units		inches thick (Name of Manufacturer)
Roof ☐	Floors ☐	(d) Steel Deck, Construction #1	☐	Otherwise ☐
		If Construction #1 State method of attaching insulation to steel deck		
		Mechanical Fasteners	☐	Adhesive ☐ Otherwise ☐
		If adhesive state trade name		
Roof ☐	Floors ☐	(e) Other Materials - Describe and Show Thickness		

ROOF AND FLOOR - Method of support

Roof ☐

Floors ☐

(a) Unprotected Steel Beams.

Roof ☐

Floors ☐

(b) Steel Beams Protected by _____ inches of _____

Roof ☒

Floors ☒

(c) Reinforced Conc. Beams - Poured in place.

Roof ☐

Floors ☐

(d) Precast Concrete Structural Units _____ inches thick

Roof ☐

Floors ☐

(e) Bearing Walls Only. No Supporting Steel.

(Name of Manufacturer)

If building is composed of more than one type of construction, identify sections of floor involving each type and indicate on plan.

(a) Is there any roof space exceeding 3 feet in height? No If so, for what purpose is it used? _____

How is access obtained thereto? _____

If by trap or door, describe type _____

(b) Are all skylights of wired glass in metal frames? No (garbage chute is only one)

(c) Is there any wood in roof, louvers, ventilators or skylights; if so give details. No

(d) Is there a wood roof laid over an incombustible one? No If so, how is it supported? _____

(e) If so, what is the maximum and minimum height of this above the incombustible roof? _____

(f) Is the incombustible roof broken by Texas, louver, ventilator, trapdoor, skylight, stair, elevator, other shafts? Yes

Is so, what is the construction of the sides through roof space? metal through concrete roof.

Is there any access or opening from these shafts to the roof space? Describe each separately. No

(g) Is there a superstructure, water cooling tower, or Penthouse of any kind on the roof? Yes. If so, given dimensions, construction and occupancy 15' x 15' 3320

B/Concrete

How is access obtained? stairway.

(h) Is there a wood wearing floor? No If so, on which storeys? _____

(i) Is it laid directly on incombustible floor or with an airspace? Describe _____

4. STEEL COLUMNS AND BEAMS - Are they fireproofed? _____ If "Yes" state nature and thickness of such protection.

(a) Columns

(b) Beams

FLOOR OPENINGS

5. STAIRWAYS - How many, and state from which floor to which? 3 (1) B₂ to 27 (1) B₂ to Penthouse

Is there an enclosure around them? Yes. If so, describe construction of enclosure, and the doors, and whether doors are self-closing HCB

SHAFT with S/C LAL Doors.

6. ELEVATORS - How many, and state from which floor to which? (1) B₂ to 27 (2) B₁ to 27

Is there an enclosure around them? Yes. If so, describe construction of enclosure, and the doors, and whether doors are self-closing

Masonry with S/C metal doors.

7. CHUTES, VENTS, DUMB WAITERS & BELT HOLES & OTHER FLOOR OPENINGS - Give size, construction of enclosure (if any), type of door (if any), and whether self-closing, stating which floors are cut by each. GARBAGE CHUTE in METAL LINED MASONRY SHAFT

OPENING. ON EACH FLOOR with S/C METAL DOOR.

8. HEATING AND VENTILATING DUCTS - Are there any? Yes

(a) Are ducts, which cut through floor, in masonry shafts? No

(b) Give construction of shaft METAL

(c) State whether separate duct to each floor without communication to other floors

(d) Do ducts open into roof space?

9. HEIGHT - State number of floors and whether there is a basement 27 + 2 BT.

10. AREA - Give ground floor dimensions R3 x 66 = 818 sq. ft.

11. INTERIOR FINISH -

State separately for each floor, finish and method of attachment to walls and ceiling (if more than one type of finish is present on any one floor, state percentage of each type).

	Bas.	1st	2nd	3rd	4th	5th	29th	RENT HOUSE.
(a) Walls	P/Conc	90% HCB					→	Conc. Open.
(b) Ceilings	L/P	PL/P					→	Conc. Open.
(c) Partitions	GYP.	GYP					→	

State extent of any wood partitions, or partitions having wood supports in square feet separately for each floor:-

(d) Is there any other inside or outside combustible finish or trim other than above? Describe fully

12. HEATING - What is the system of heating the building? ELECTRIC. Where is heating plant located?

Is it in fire-resistive room with standard fire door? Are there any stoves; if so, how many and where located? NO

Do any heating devices vent otherwise than to brick or concrete chimney; if so, give details

What fuel is used? ELECTRIC.

13. ELECTRIC WIRING - All wiring is in Rigid Conduit ☒ Otherwise ☐

Are all circuits protected by type "S" tamper resisting fuses or non-interchangeable circuit breakers? YES

14. POWER - Is any used? YES If so, what kind? ELECTRIC Total Horse Power? Over 1 H.P.

What used for? BUILDING SERVICES

If gasoline engine, state method of ignition, location and capacity of supply, tank, whether feed is pressure or gravity, quantity of gasoline in engine

15. GASOLINE OR BENZINE, OR OTHER OILS - Are any kept? NO. If so, what quantity of each?

What used for?

16. COMMUNICATIONS - Does the building communicate with any other building? YES. (a) If so, give dimensions, height, construction and occupancy and indicate clearly on diagram 3 story Auto Storage (F.R.) - communicates by 40' UNDERGROUND CONC. TUNNEL.

(b) If so, are buildings separated by solid wall? (c) If so, are all openings in this wall protected by self-closing U.L. labelled Class A fire doors?

(d) If not, describe type of doors on each opening

PUBLIC PROTECTION

17. FIRE DEPARTMENT - State distance to the nearest fire station. 1/2 mile.

18. HYDRANTS - What is the distance to the nearest two hydrants? 50' ; 150' Give size of main 4"

INTERNAL PROTECTION

19. Show number units for each floor:

	Basement	1st	2nd	3rd	4th	5th	6th	7th	29th	RENT HOUSE
Extrs. 2 1/2 Gal. Class A	(2) 2A								→	NIL
Extrs Class B & C										NIL
Stand Pipe & Hose	(2)								→	NIL.

20. WATCHMAN - Is there a Watchman making rounds of the whole premises, nights, Sundays, holidays, and at all times when plant is not in operation, rounds being made not less than once an hour during the night, i.e. from 6 p.m. to 6 a.m., and every two hours during the day? NO.

(a) Does he use a portable clock, electric detector, or report to central station?

(b) Give name of manufacturer of clock

(c) Does it bear approval label of Underwriters' Laboratories?

(d) Are the stations sufficient and so located that the Watchman must traverse each flat and every portion be visible to him?

21. AUTOMATIC FIRE DETECTION SYSTEM - If such system is present provide details on questionnaire obtainable from Canadian Underwriters' Association. INTERNAL Pull Alarm.


Siteplan Report - 1984 70 Park Street East Mississauga ON L5G1M5



DIAGRAM

IAO PLAN: Sheet No. 1922 ; Block No. 192211 ; Plan No. _____ ; NOP ☒ ; Scale: 1cm = 6m ☒
1cm = 12m ☐

This document is owned by Opta Information Intelligence Inc. and is subject to copyright protection. Please see the purchase order relating to the release of this document for complete terms and conditions.

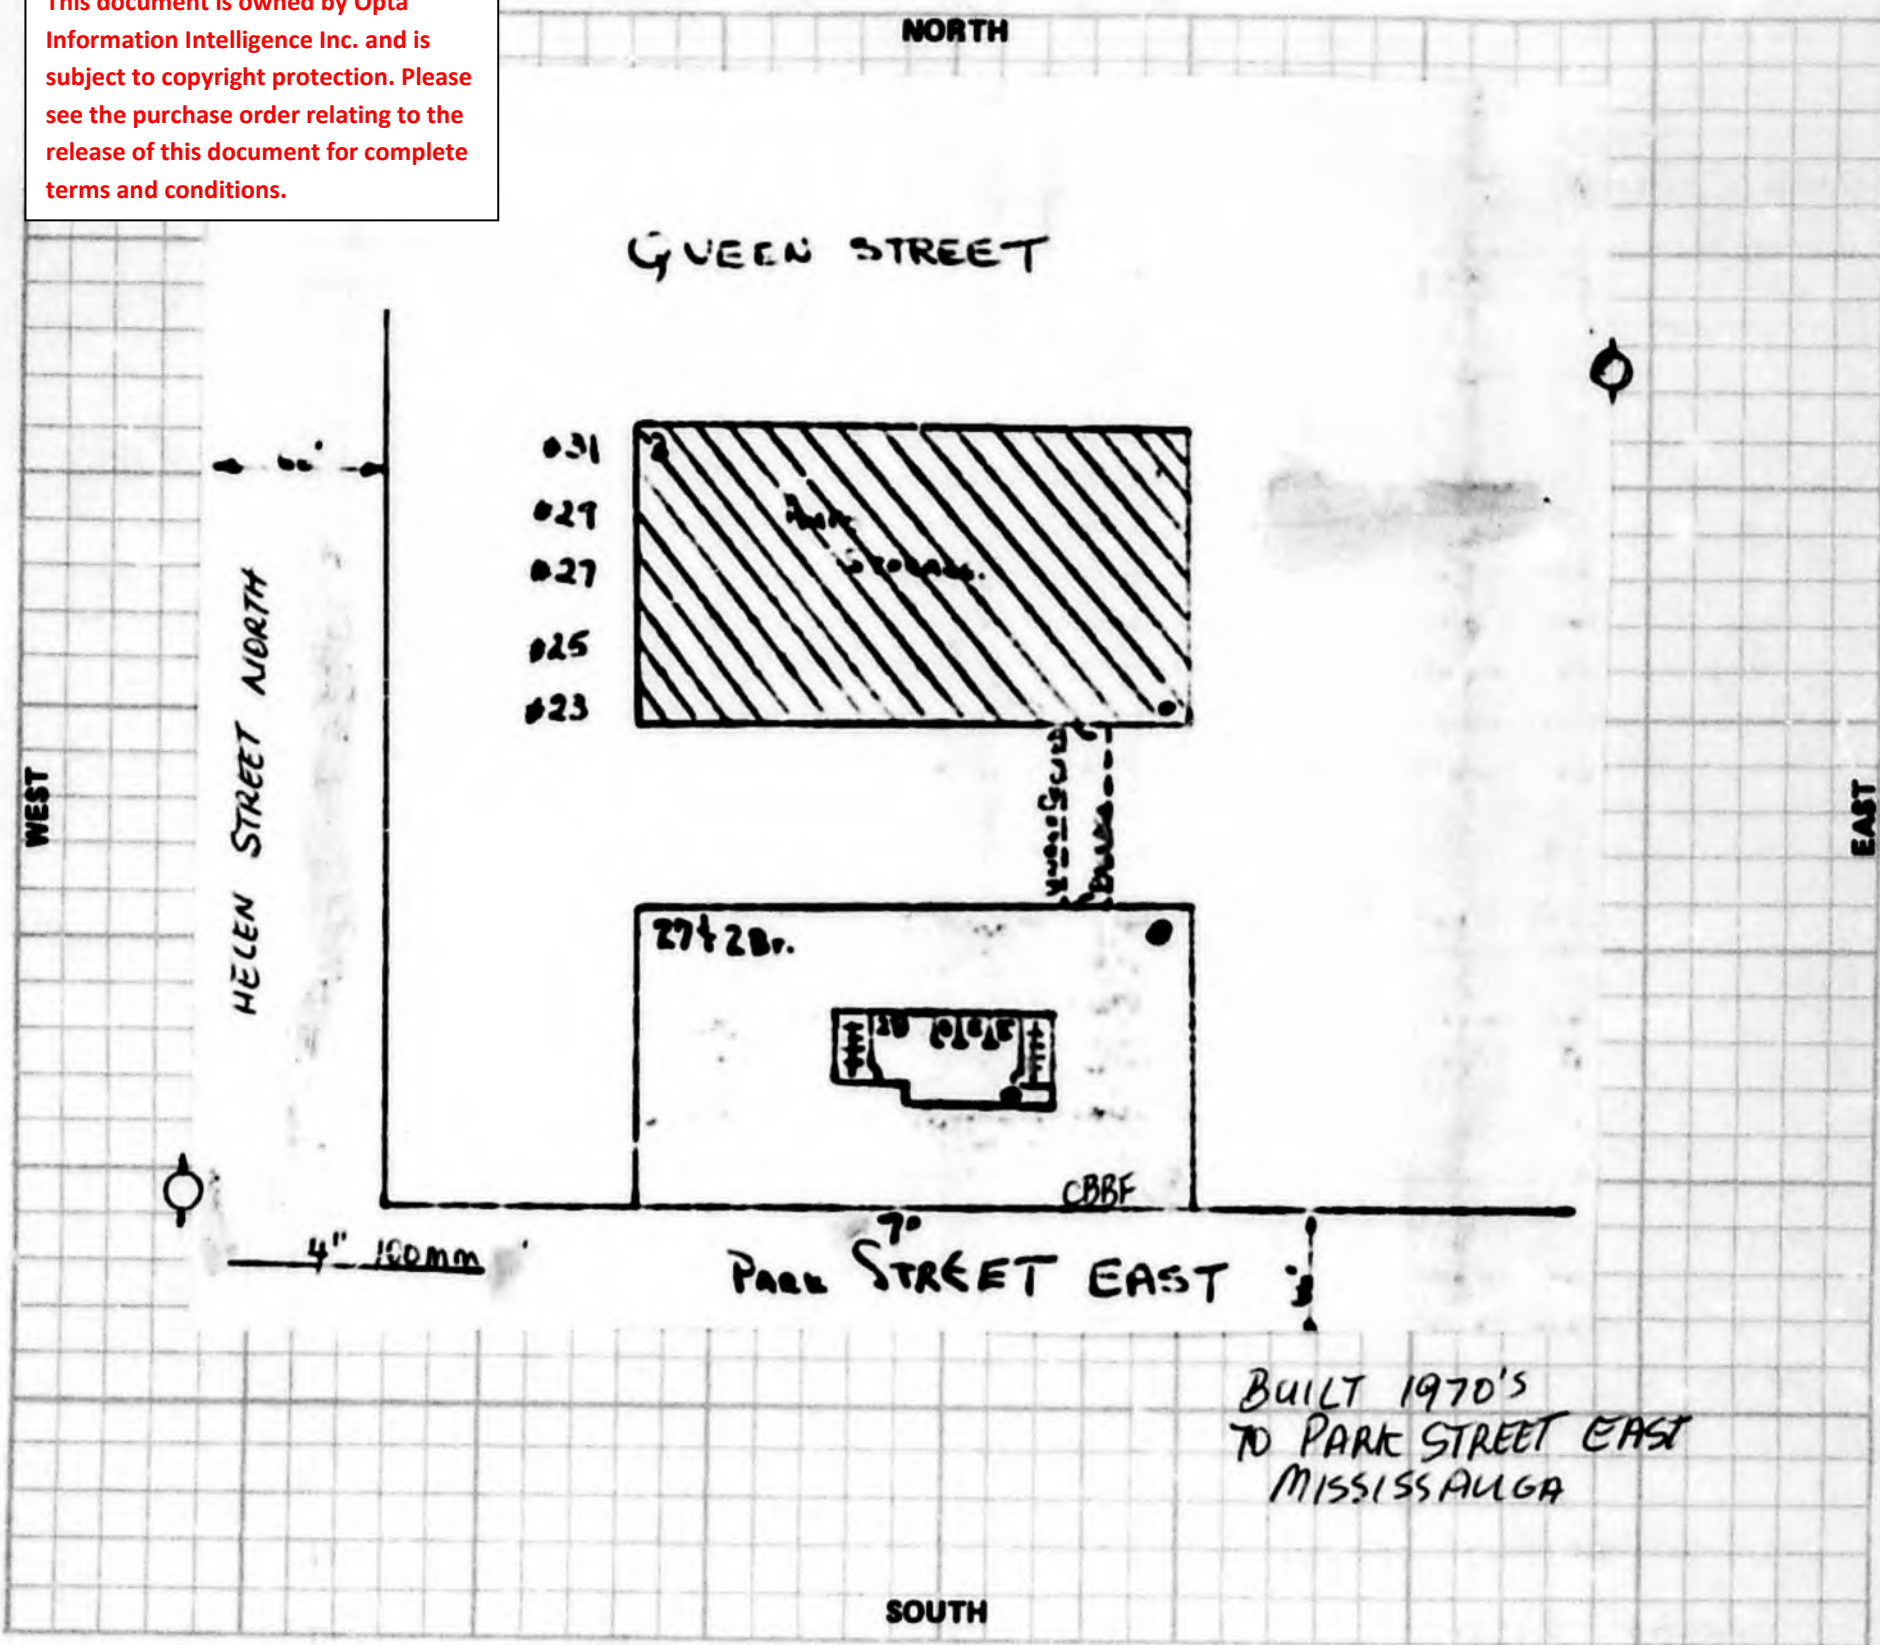

EXPOSURE - (SECTION VIII)

WALL OF BUILDING BEING RATED					BETWEEN BLDGS.		FACING WALL OF EXPOSURE						
Direction	Blnk.	Comb. & Non-Comb	Msnry. Up	Msnry. Sp	Distance	Party Wall	Blnk.	Msnry. Sp	Msnry. Up	Non-Comb.	Comb.	Occ'y Haz.	Length / Height
NORTH													
SOUTH													
EAST													
WEST													

Requested by: SUN ALLIANCE

Sig. Of Insp. C. MARTIN
Dt. 6-19-84 / 6-21-84
(Inspected) (Written Up)

Report Date: _____
(Dt. Request Recd. In IAO Service Office)

Revised By: _____
Dt. _____ / _____

**Commercial Property Fire Rating Form Report -
1984 TERLIN INVESTMENT 70 Park Street East
Mississauga ON L5G1M5**

Requested by:

Eleanor Goolab

Date Completed: 03/15/2022 12:09:07



OPTA INFORMATION INTELLIGENCE

Commercial Property Fire Rating Form Report - 1984 TERLIN INVESTMENT 70 Park Street East Mississauga ON L5G1M5





update

COMMERCIAL PROPERTY FIRE RATING FORM

CODING

IND.	YEAR	CODE	PROT.
662	91	1	2

LOCATION MISSISSAUGA NAME TERLIN INVESTMENT FILE NO. MERCANTILE

ADDRESS 70 PARK STREET EAST Insp'd. by C.M Date 6-19-84
Rated by C.M Date 6-21-84

BASIC CONSTRUCTION: (SECTION II)

WALLS (ITEMS 210-215)

Construction Class 1 Bldg. Comb. Class L2

WALL AREA	MASONRY		FIRE RES.		NON COMB	COMB	DETAIL OF WALL CONSTRUCTION	% OF WALL PERIM	POINTS	CHARGES
	Wall Type	Wall Thick.	Dem. Type	Fire Res.						
	W-1	12"	D-	HR			C.B.B.F	100 % x	0	0
	W-		D-	HR				% x		
	W-		D-	HR				% x		
	W-		D-	HR				% x		
	W-		D-	HR				% x		
	W-		D-	HR				% x		
	W-		D-	HR				% x		
	W-		D-	HR				% x		
	W-		D-	HR				% x		

Columns in (or adjacent to) non-bearing masonry walls: Unprot. metal ☐ Comb. ☐
Panels in masonry or fire resistive walls: Comb. ☐ Non-comb. ☐ Glass ☐ Slow burning ☐
Special Conditions (Describe).....

FLOOR(S) AND ROOF (ITEMS 220-223)

LEVEL	DIMENSIONS	MAS. or F.R.		NON COMB	COMB	DETAILS OF FLOOR/ROOF MATERIALS	% of Total Floor/Roof Area	POINTS
		Dem. Type	Fire Res.					
Grade		D-1	HR			CONCRETE	% x	
		D-	HR				% x	
		D-	HR				100 % x	0
		D-	HR				% x	
Roof		D-1	HR			CONCRETE	% x	

Total Basic Construction Charges:

Schedule Base +
Building Base =

Building Base x 7 Comb. Modifier (ITEM 230) x .001 = BASIC BUILDING RATE:

150
150
105

(carried fwd. overleaf) *

SECONDARY CONSTRUCTION: (SECTION III)

Height: (ITEM 300) Nbr. Storeys 27 Bast. YES Comb. Stories without ground level access. N/A

Vertical Openings: (ITEM 310)

Type	Fm	To	Enclosure	Doors	% Chgs
V2	BST	27th	MASONRY	W/F - METAL	1st.
					+
					+

No. of Elevators: Passenger YES; Freight

Area: (ITEM 320) 123 x 66m x x
Grade Floor Area 8118m² Total Area 21895m² Effective Area 755m²

Roof Surface: (ITEM 330) Approved ☒ Other (Described).....

Combustible Concealed Spaces: (ITEM 340) Roof Space; Percentage of total roof area %
Ceiling Space; Percentage of total floor area N/A %

Combustible Interior Construction: (ITEM 350)

Floor Surfacing; Percentage of total floor area %
Interior Walls or Partitions; Percentage of total exterior wall area N/A %
Mezzanines or Decks; Percentage of total floor/roof area %

Combustible Interior Finish or Insulation: (ITEM 360)

Walls: Percentage of total area of exterior walls; Ord. Dam. N/A % Spec. Dam. %
Roof & Floor(s): Percentage of total area of ceilings; Ord. Dam. N/A % Spec. Dam. %

Combustible Exterior Finish or Attachments: (ITEM 370) N/A

Building Condition: (ITEM 380) Good ☒; Average ☐; Poor ☐;

Built in 1970's; Est. ☐ Additions Built in; Est. ☐.

Air Conditioning: % Central ☐ Window ☐.

Basement: Finished ☐; Partially Finished ☒; Unfinished ☐.

Total Secondary Construction Charges:

COMMERCIAL PROPERTY FIRE INSPECTION SURVEY FORM
OCCUPANCY & SPECIAL HAZARDS - (SECTIONS IV, V, VI & VII)


- **SEPARATED OCCUPANCY:** Is There Any Occupant(s) Cut-Off VERTICALLY ☐ /HORIZONTALLY ☐? Yes ☒; No ☐.
 If Yes - Such Occupant Occupies 125 m², Comprising 3 % Of The Total Floor Area;


Describe: _____


OCCUPANCY DETAILS: Indicate: 1) Business Name Of Each Tenant, 2) Special Hazards Including Process Operation(s) And Faults Of Management, 3) Number, Type and Location Of Manual Fire Fighting Equipment, 4) Any Other Exceptional Features Of The Risk Not Discussed Elsewhere, and 5) Any Vacant Section(s).			
CIVIC NO.	FLOOR LEVEL	AREA (m ²)	IBC IND. CODE
70	1st to 27th	20785	662
	BST 1	755m ²	
	BST 2	755m ²	
TERLIN INVESTMENT: Occupied as an apartment building with two hundred and ten self contained units. Occupied as boiler room, and locker rooms. Occupied by locker rooms, Gymnasium and sauna. Both levels of the basement are sprinklered from 2031A mailed out to insurer. Heat is provided by permanently installed electric base board heaters. Each floor is protected by two stand pipe and hose and a standard supply of portable fire extinguishers.			
Total Floor Area <u>21897</u> <u>662</u> ← (Building Owner's Interest) - Continued on attached sheet ☐ -			


GENERAL UNDERWRITING COMMENTS


- **HOUSEKEEPING & MAINTENANCE:** Excellent ☐; Good ☒; Average ☐; Poor ☐ (describe) _____
- **NEIGHBOURHOOD:** Isolated ☐; Residential ☒; Commercial ☐; Industrial ☐; Congested/Conflagration Hazard ☐ (describe) _____
- **OPINION OF RISK:** Excellent ☐; Good ☒; Average ☐; Poor ☐ (describe) _____

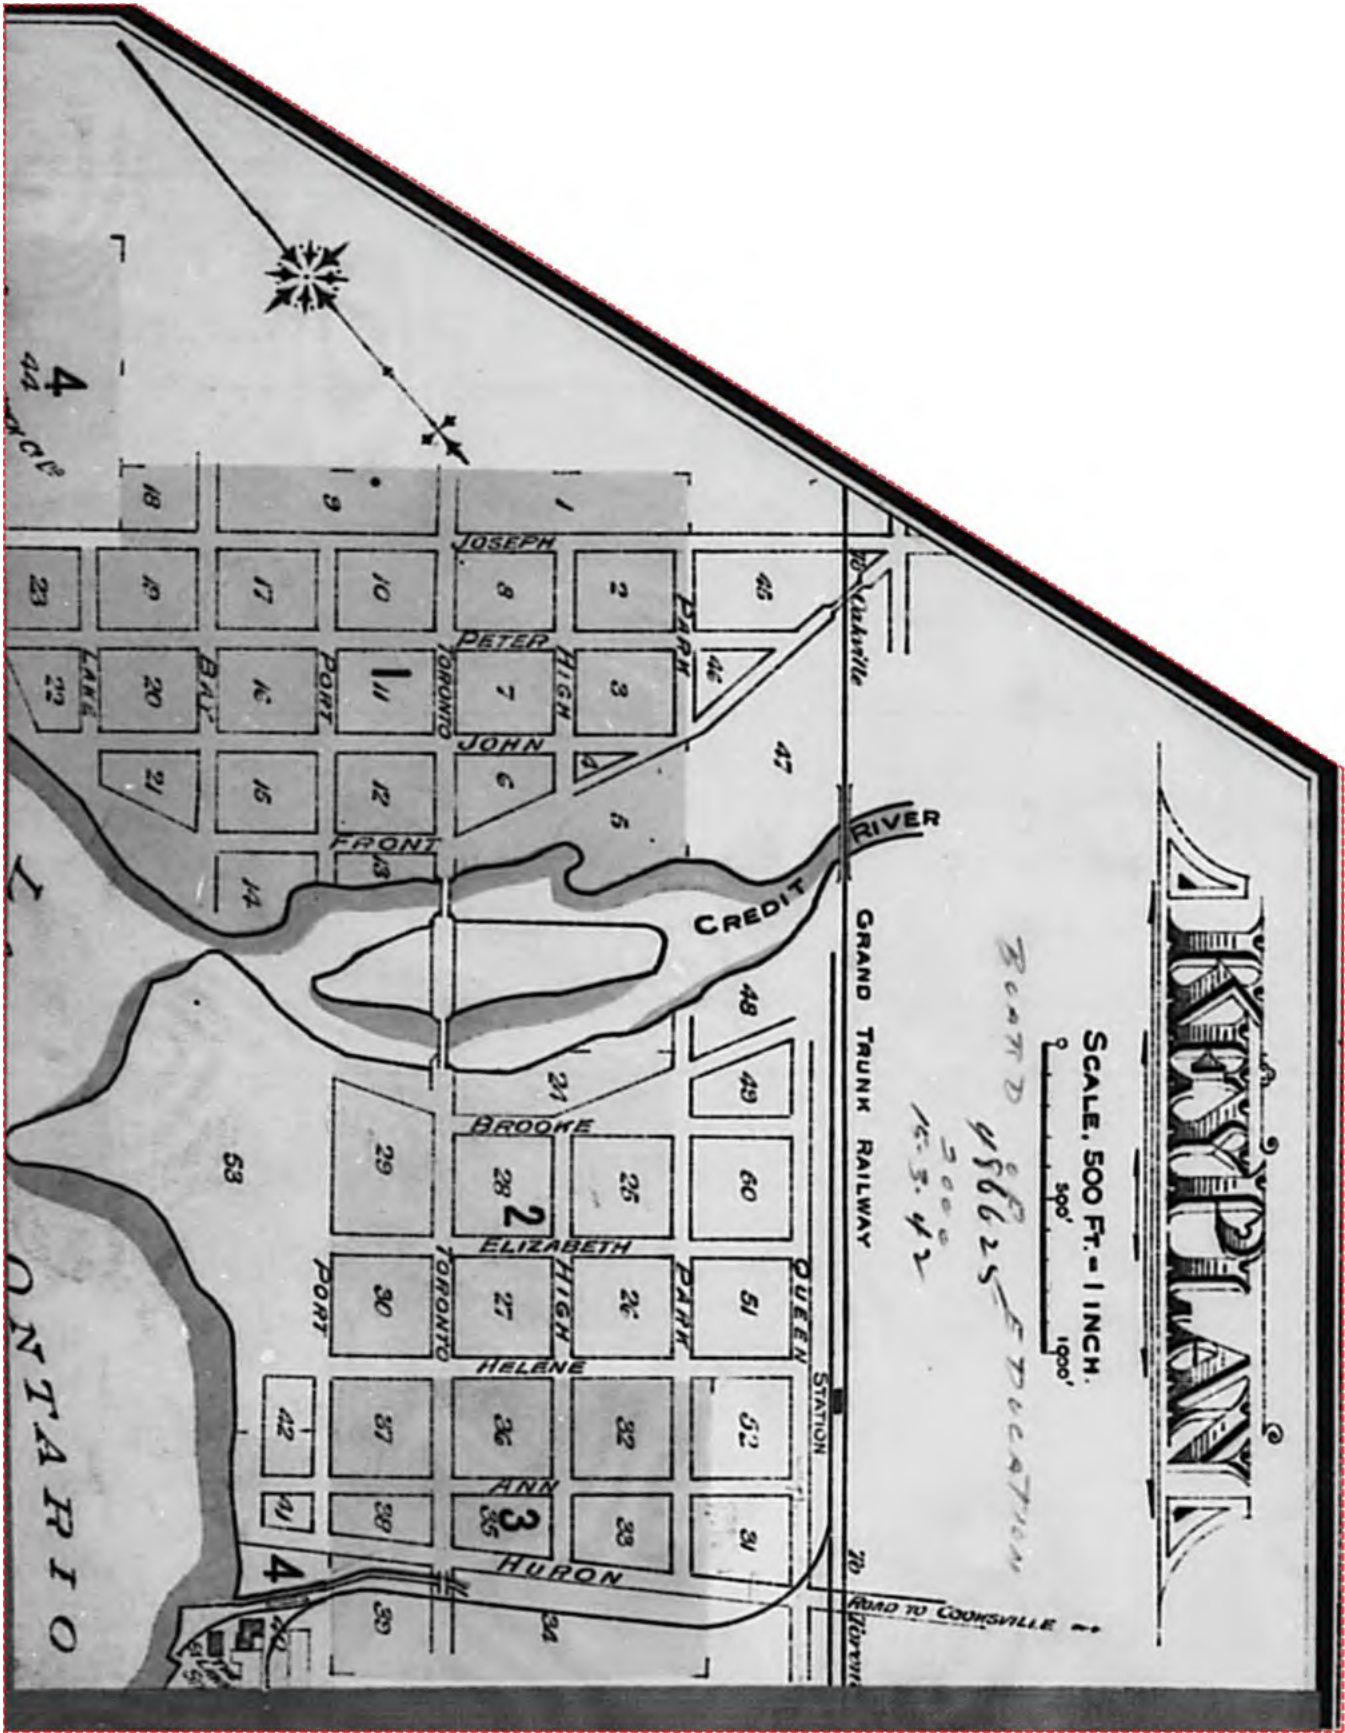

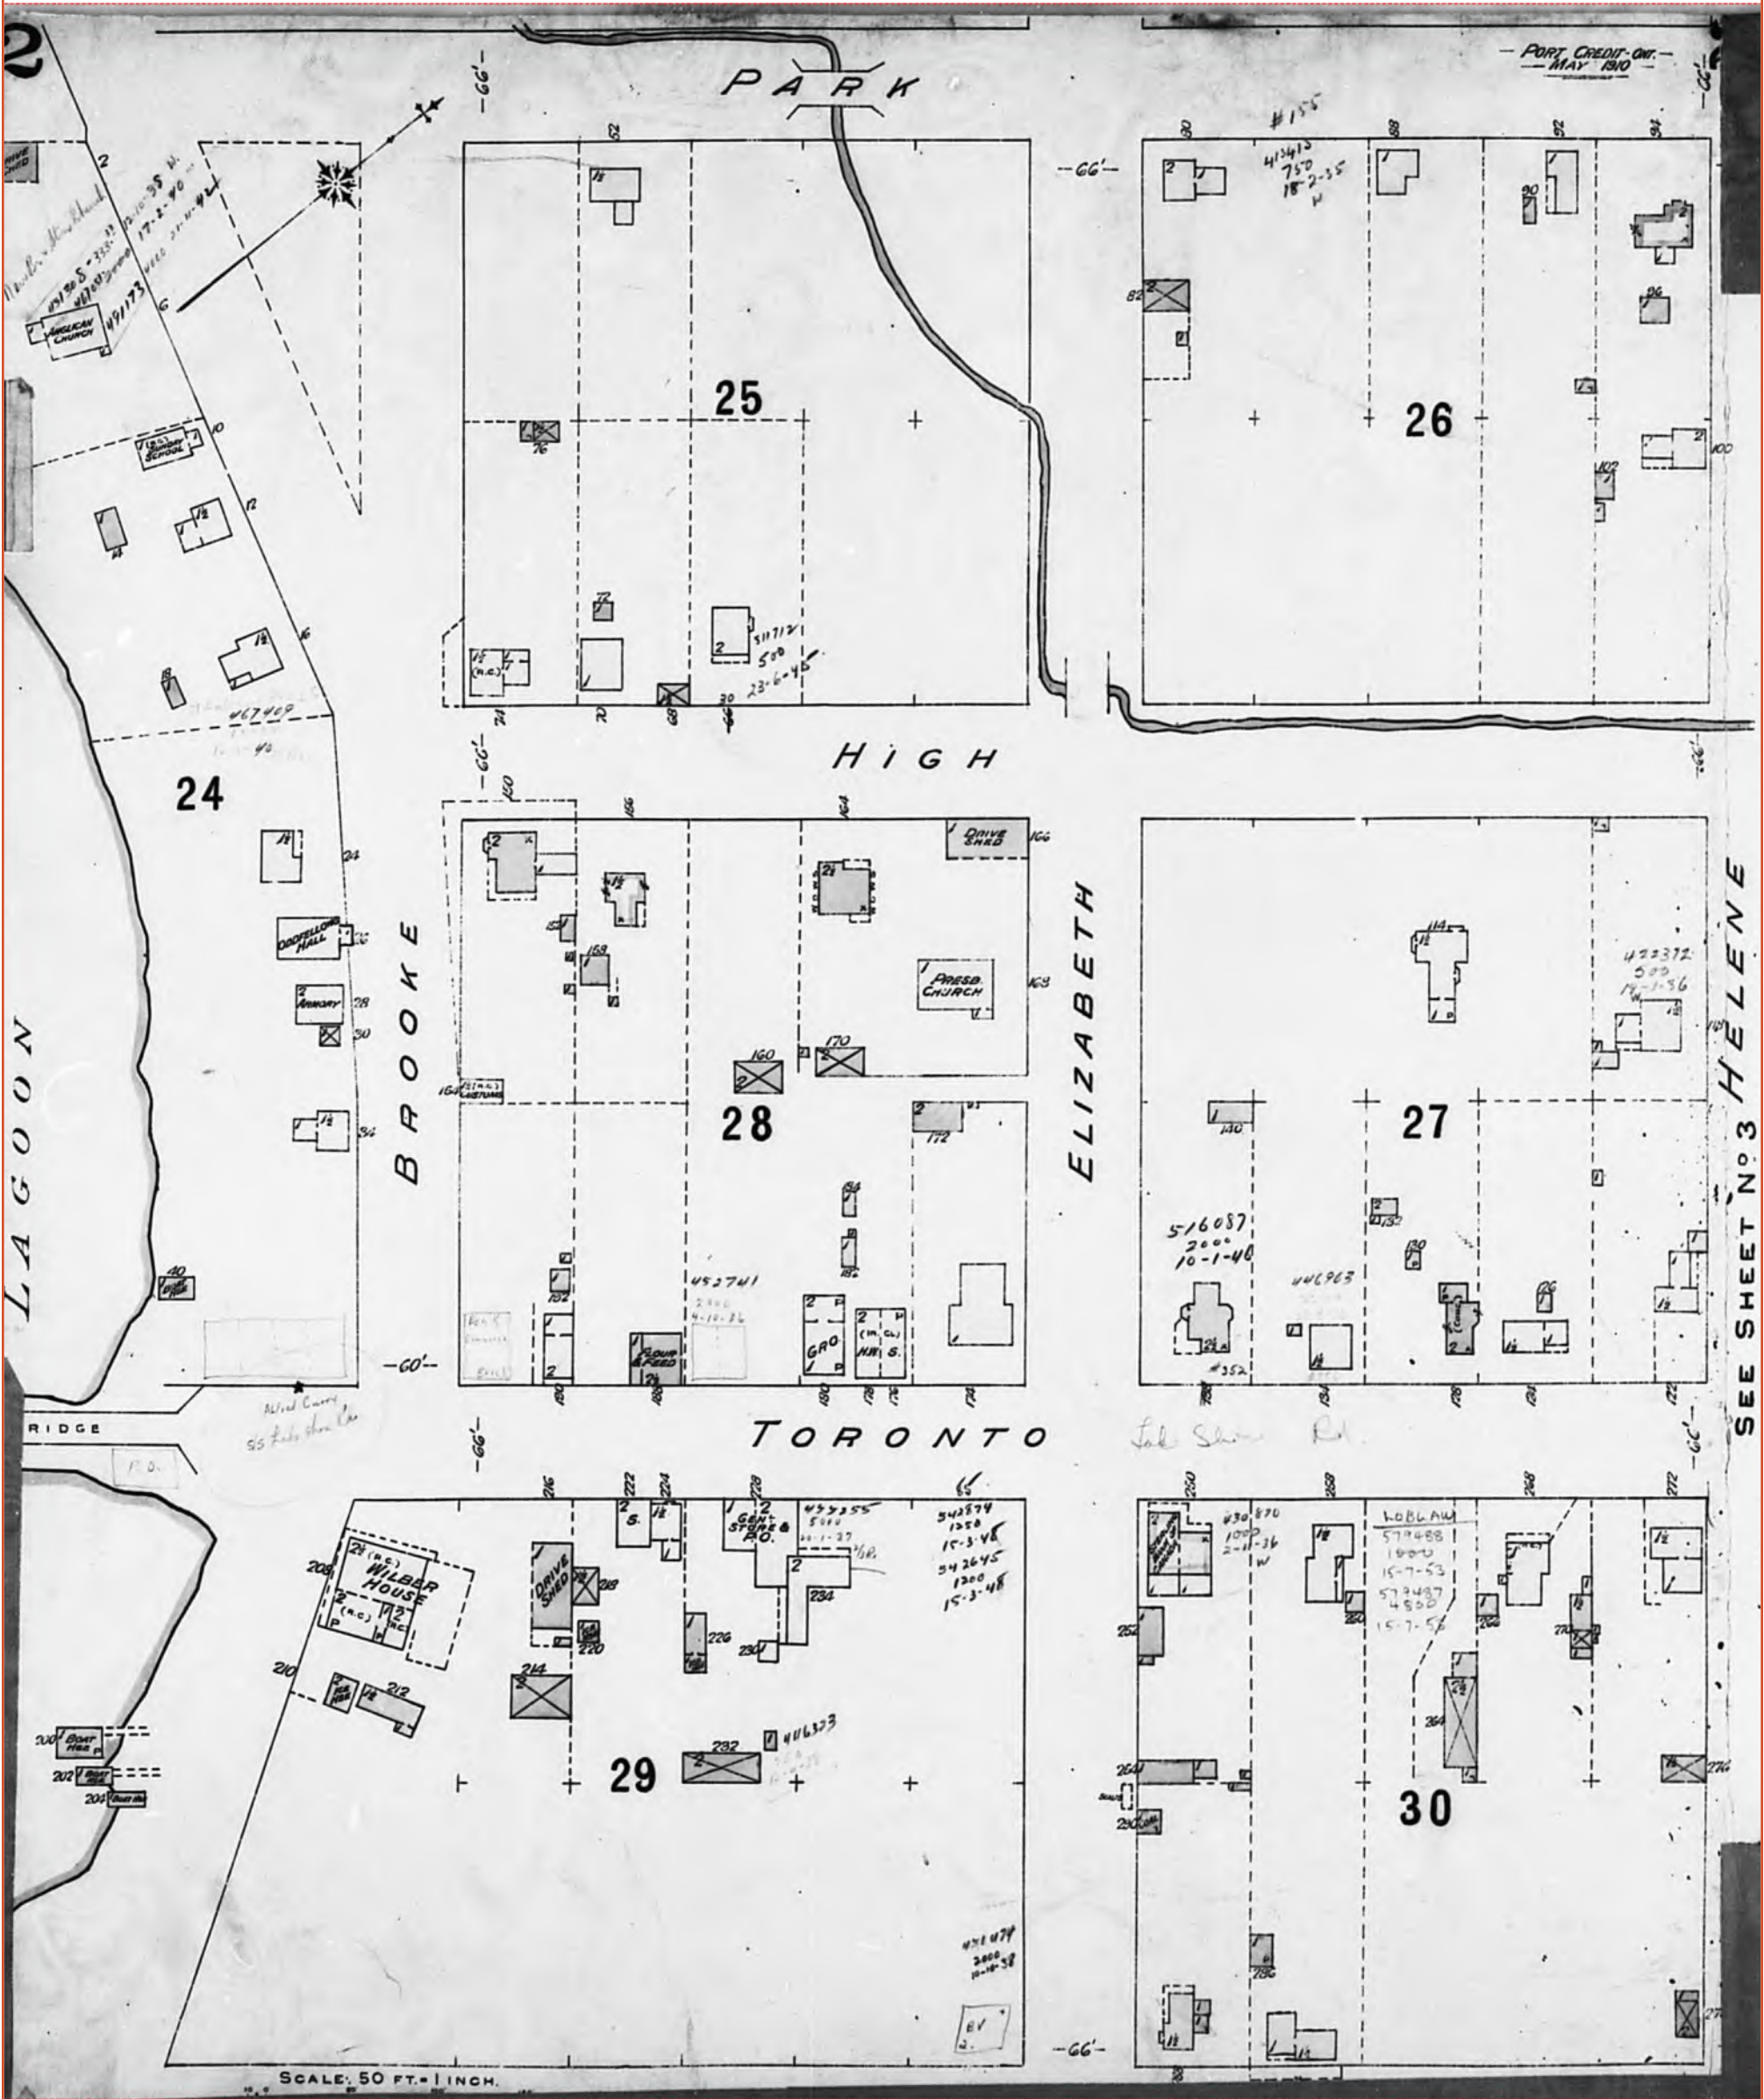


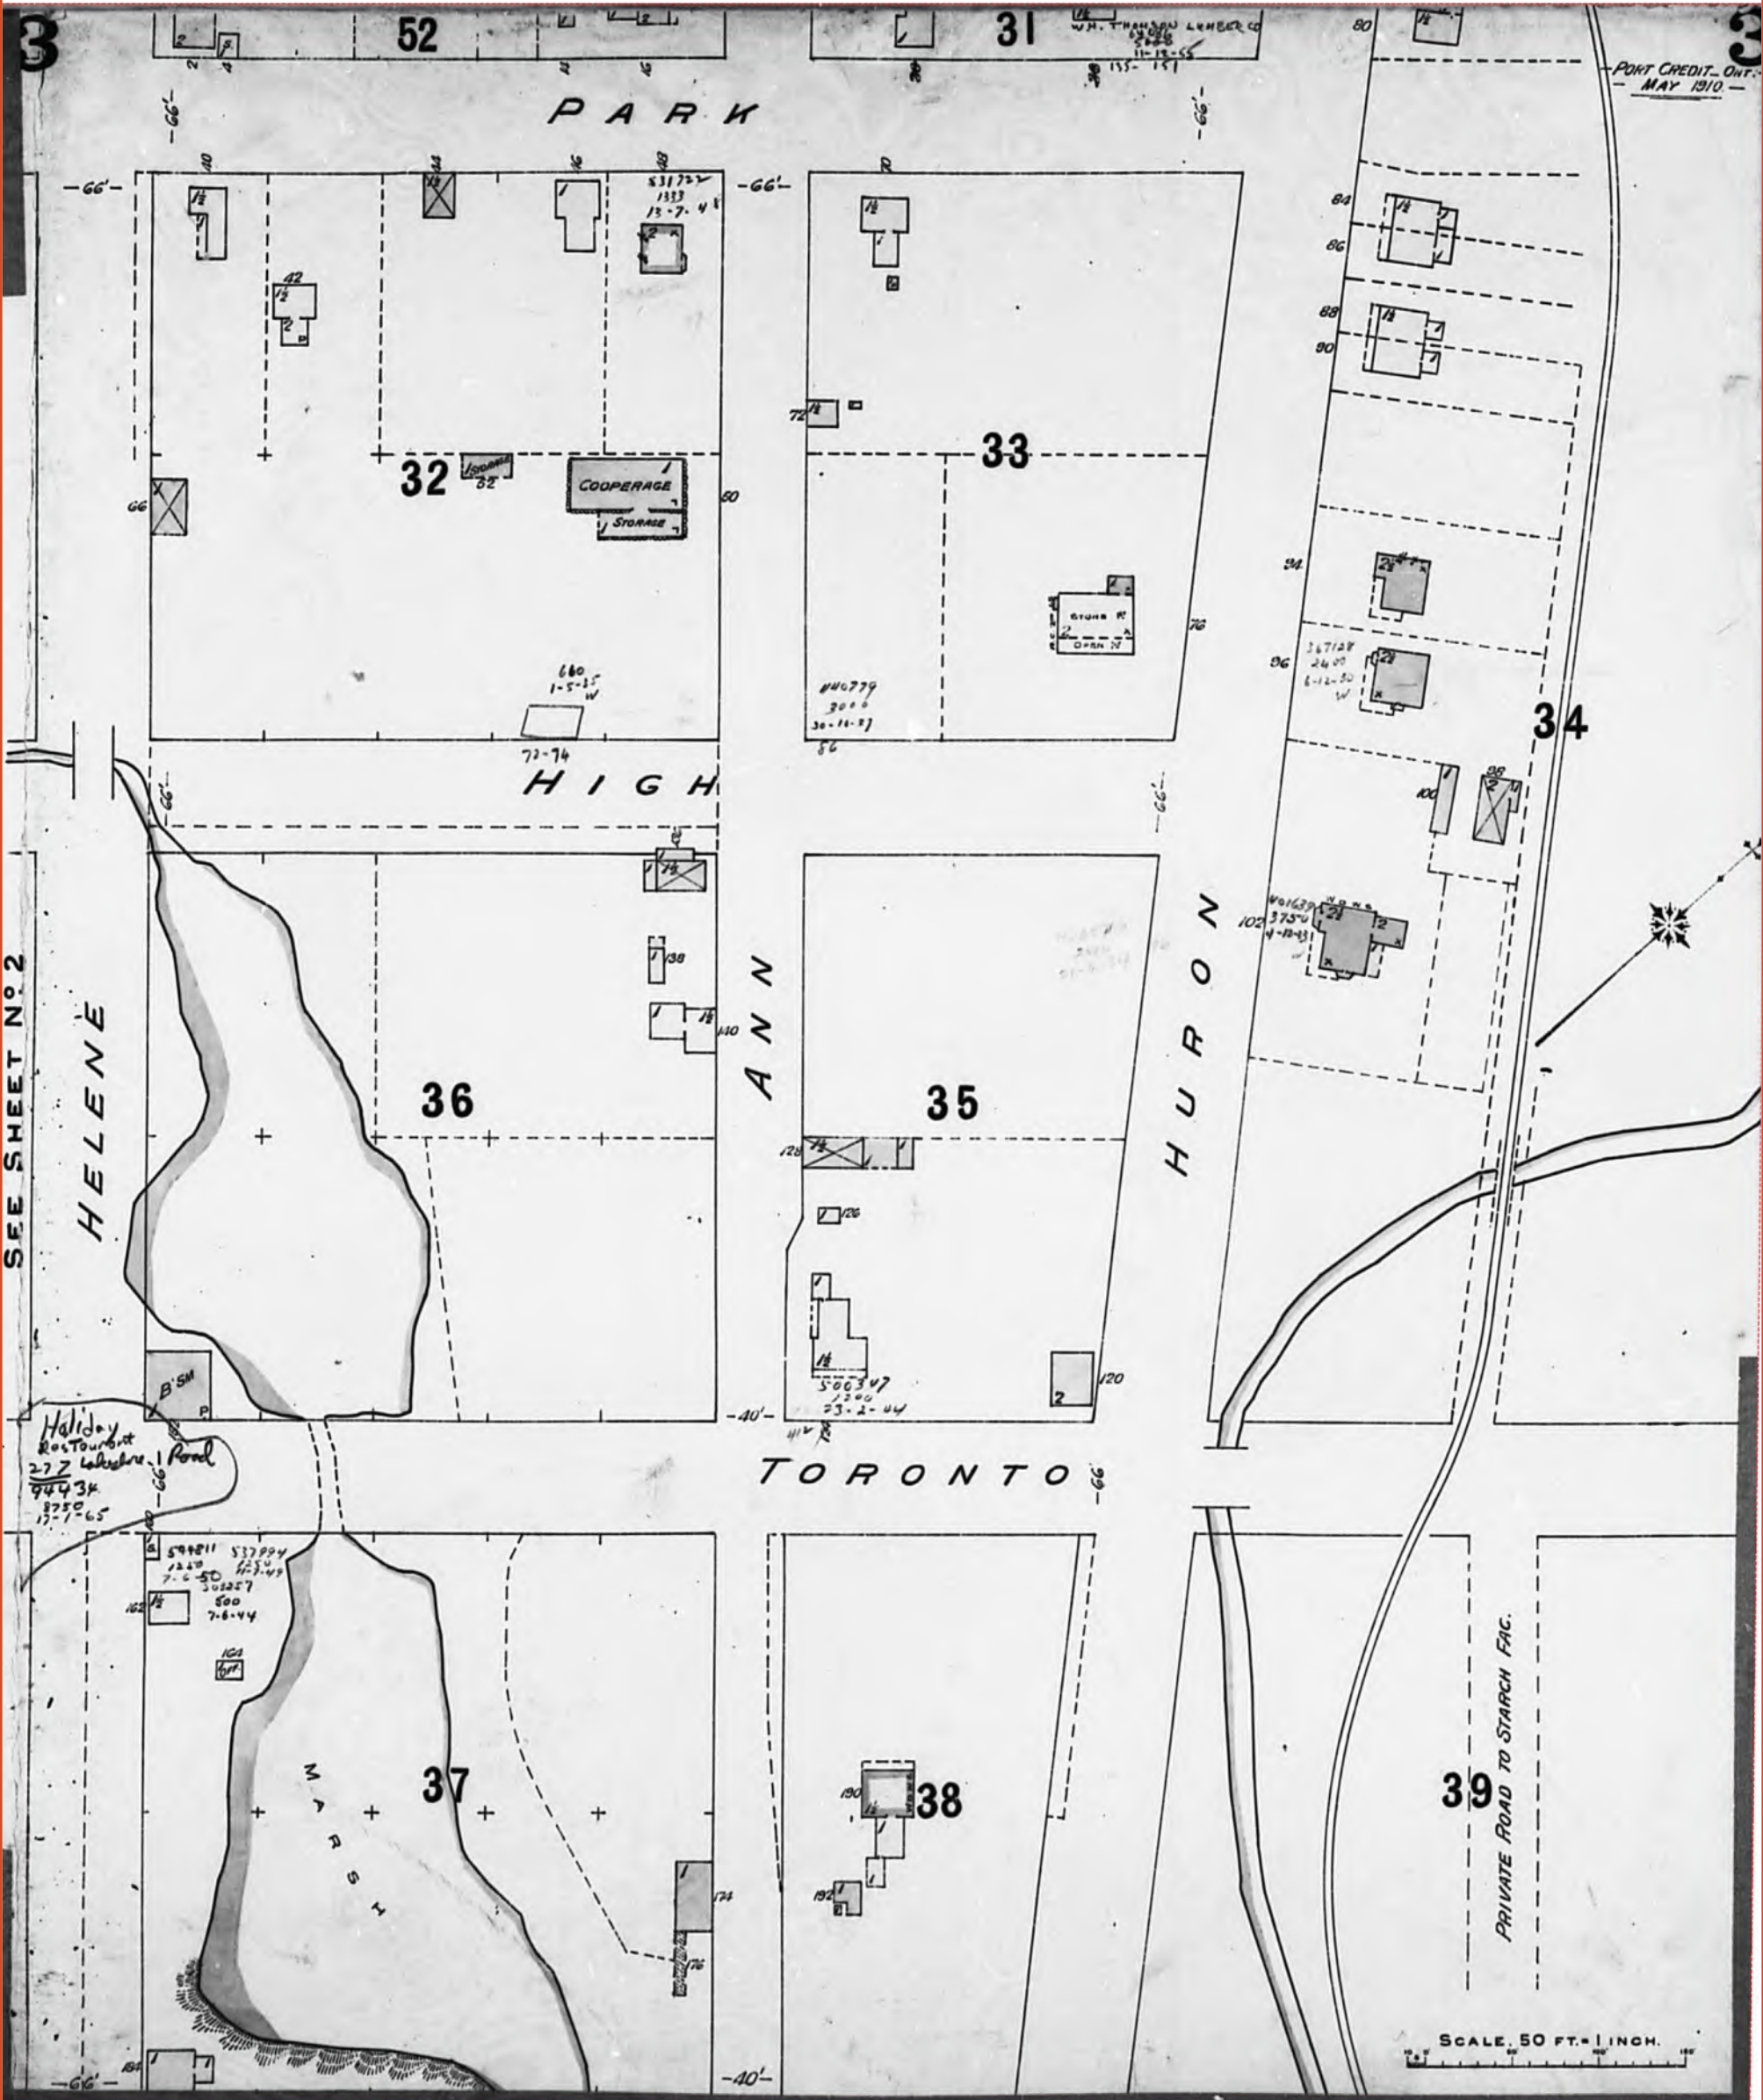


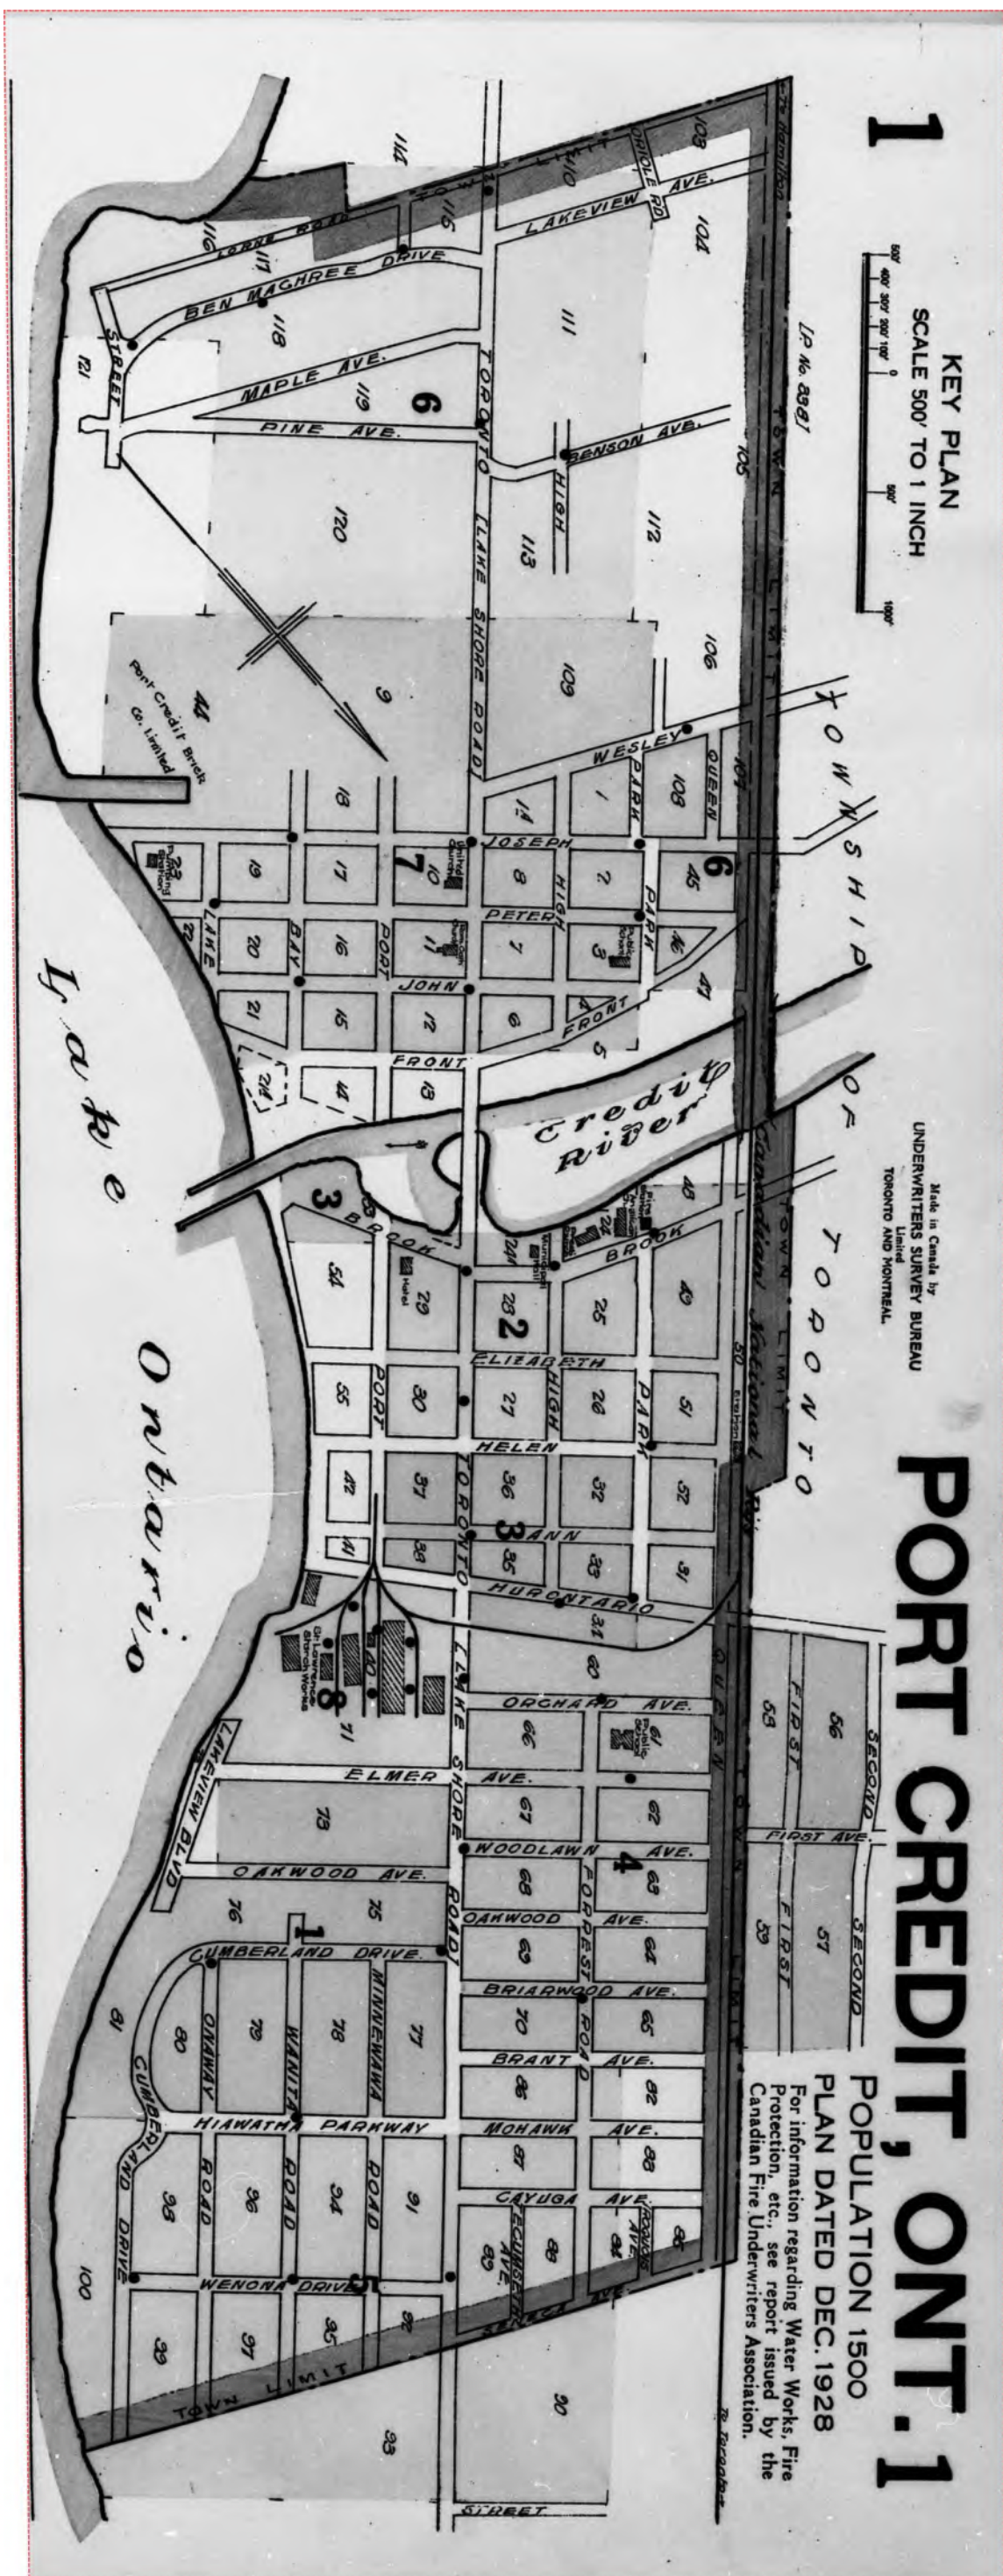


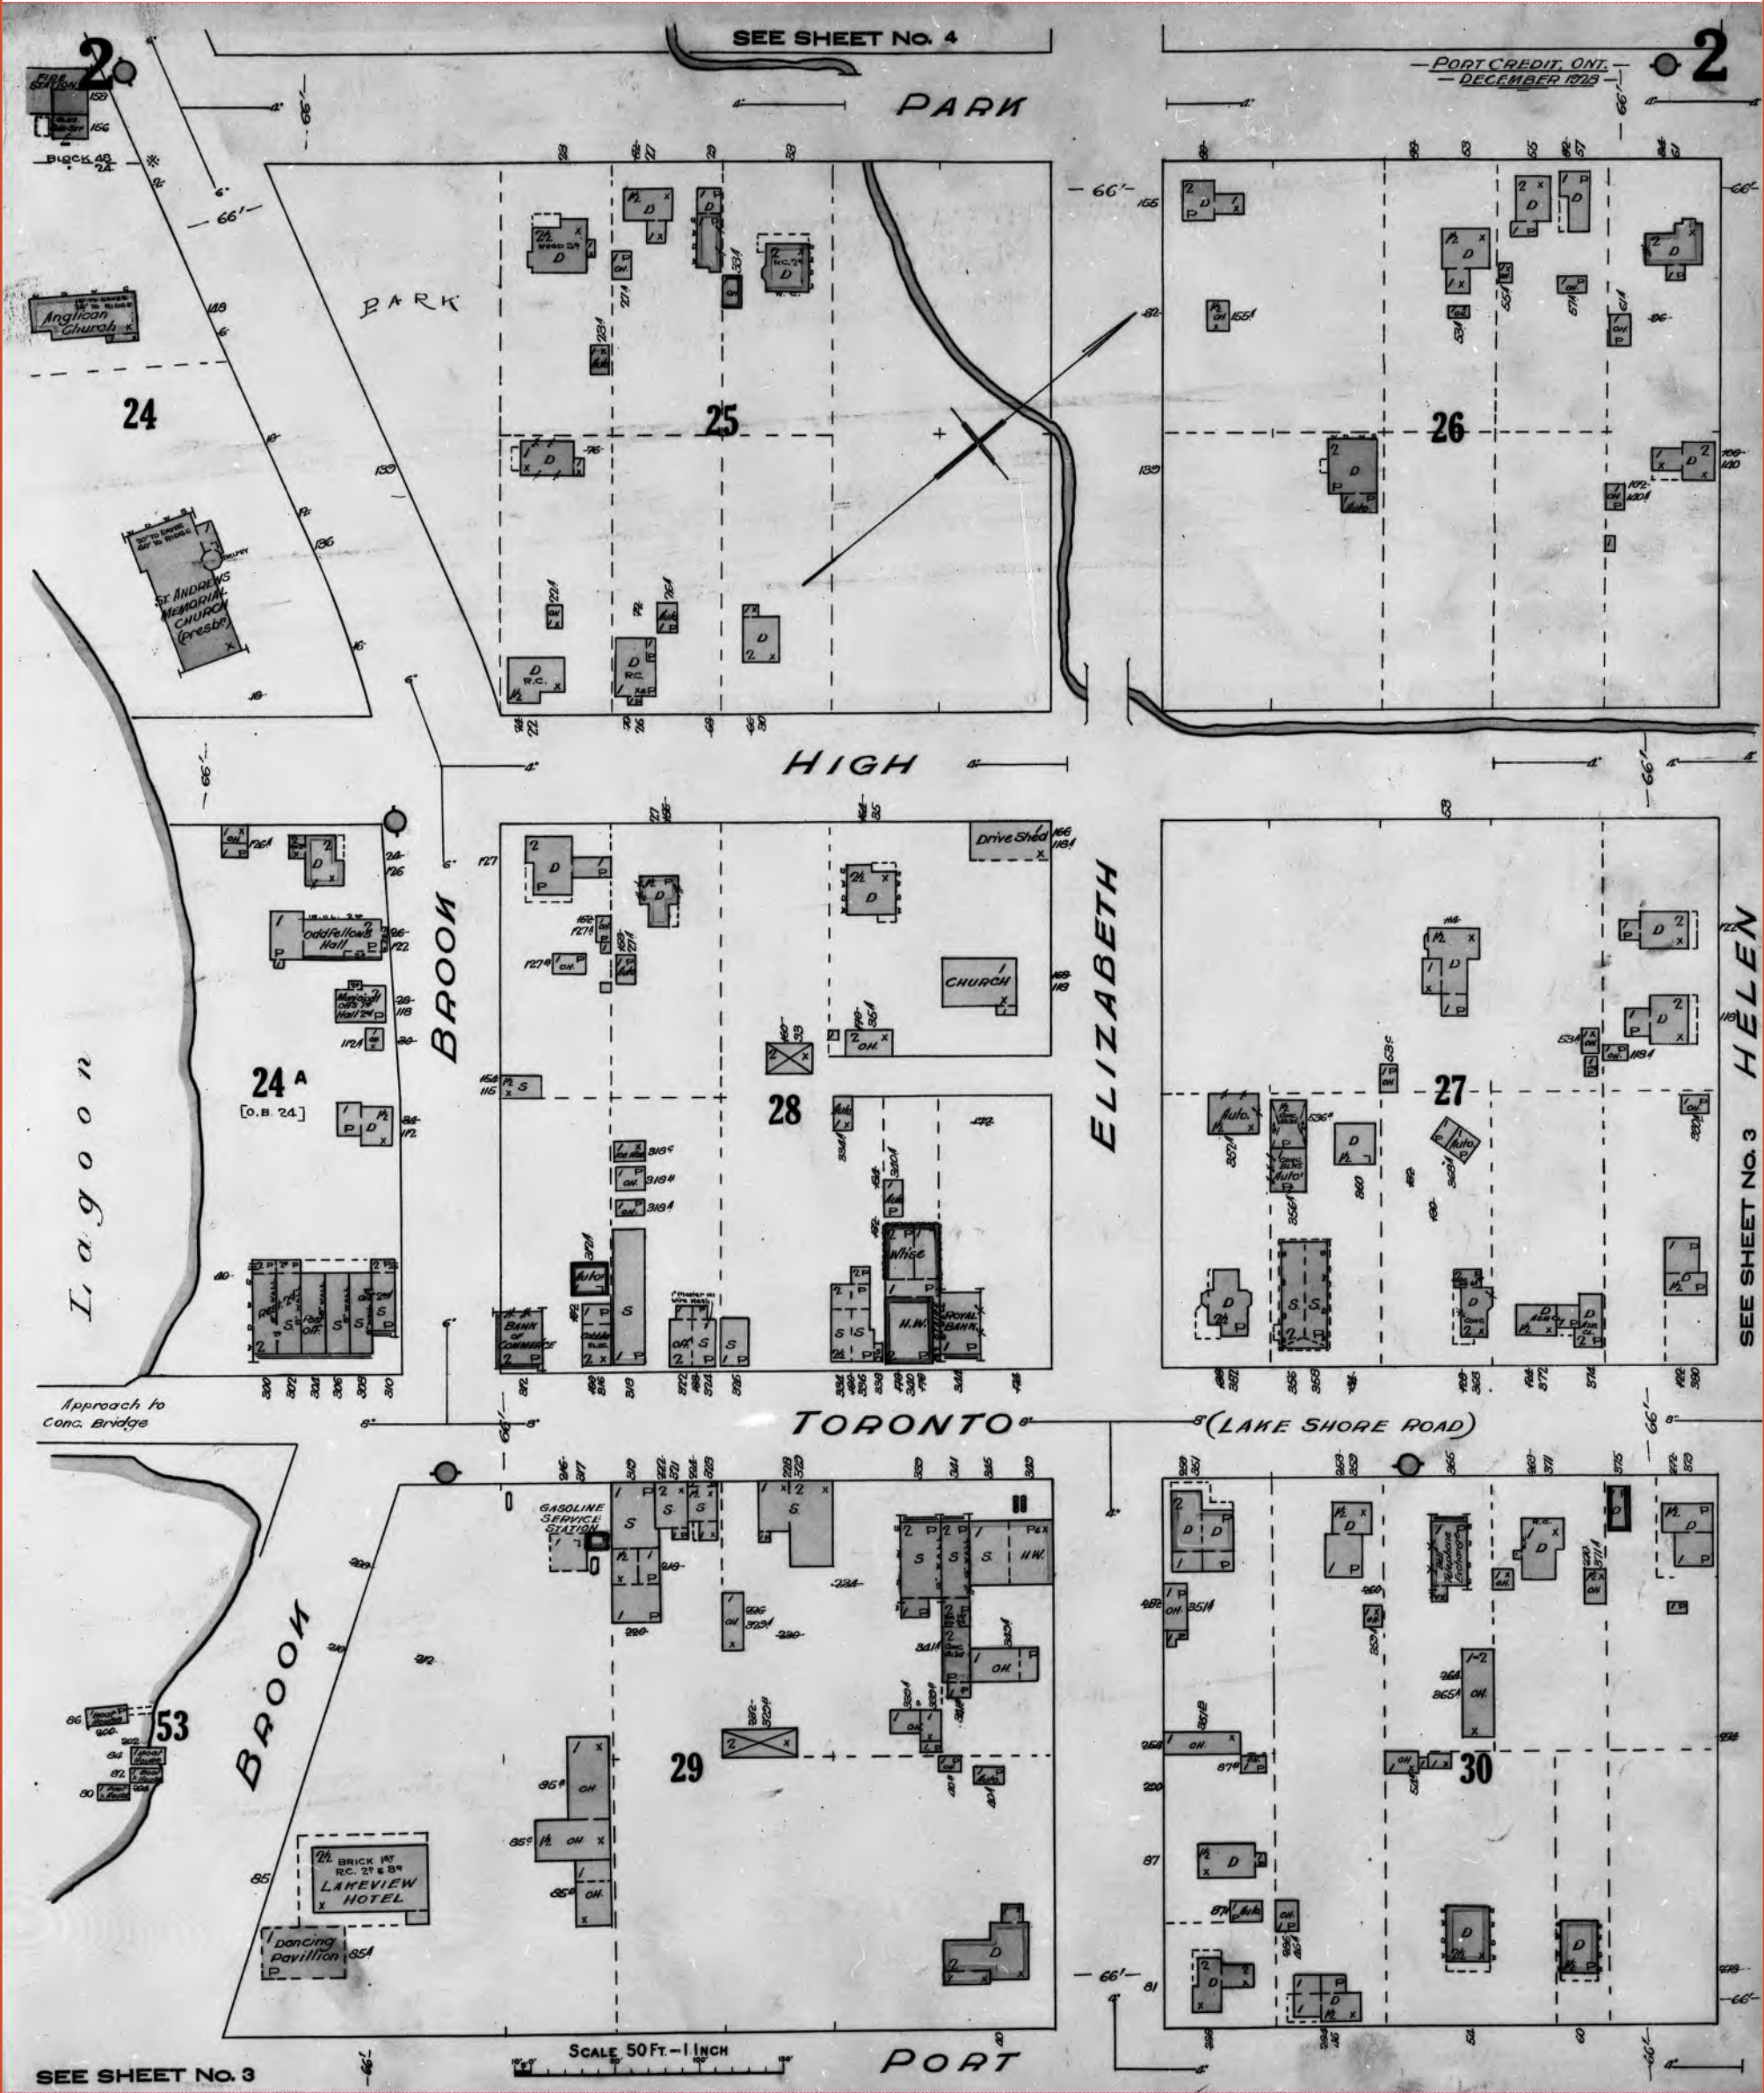





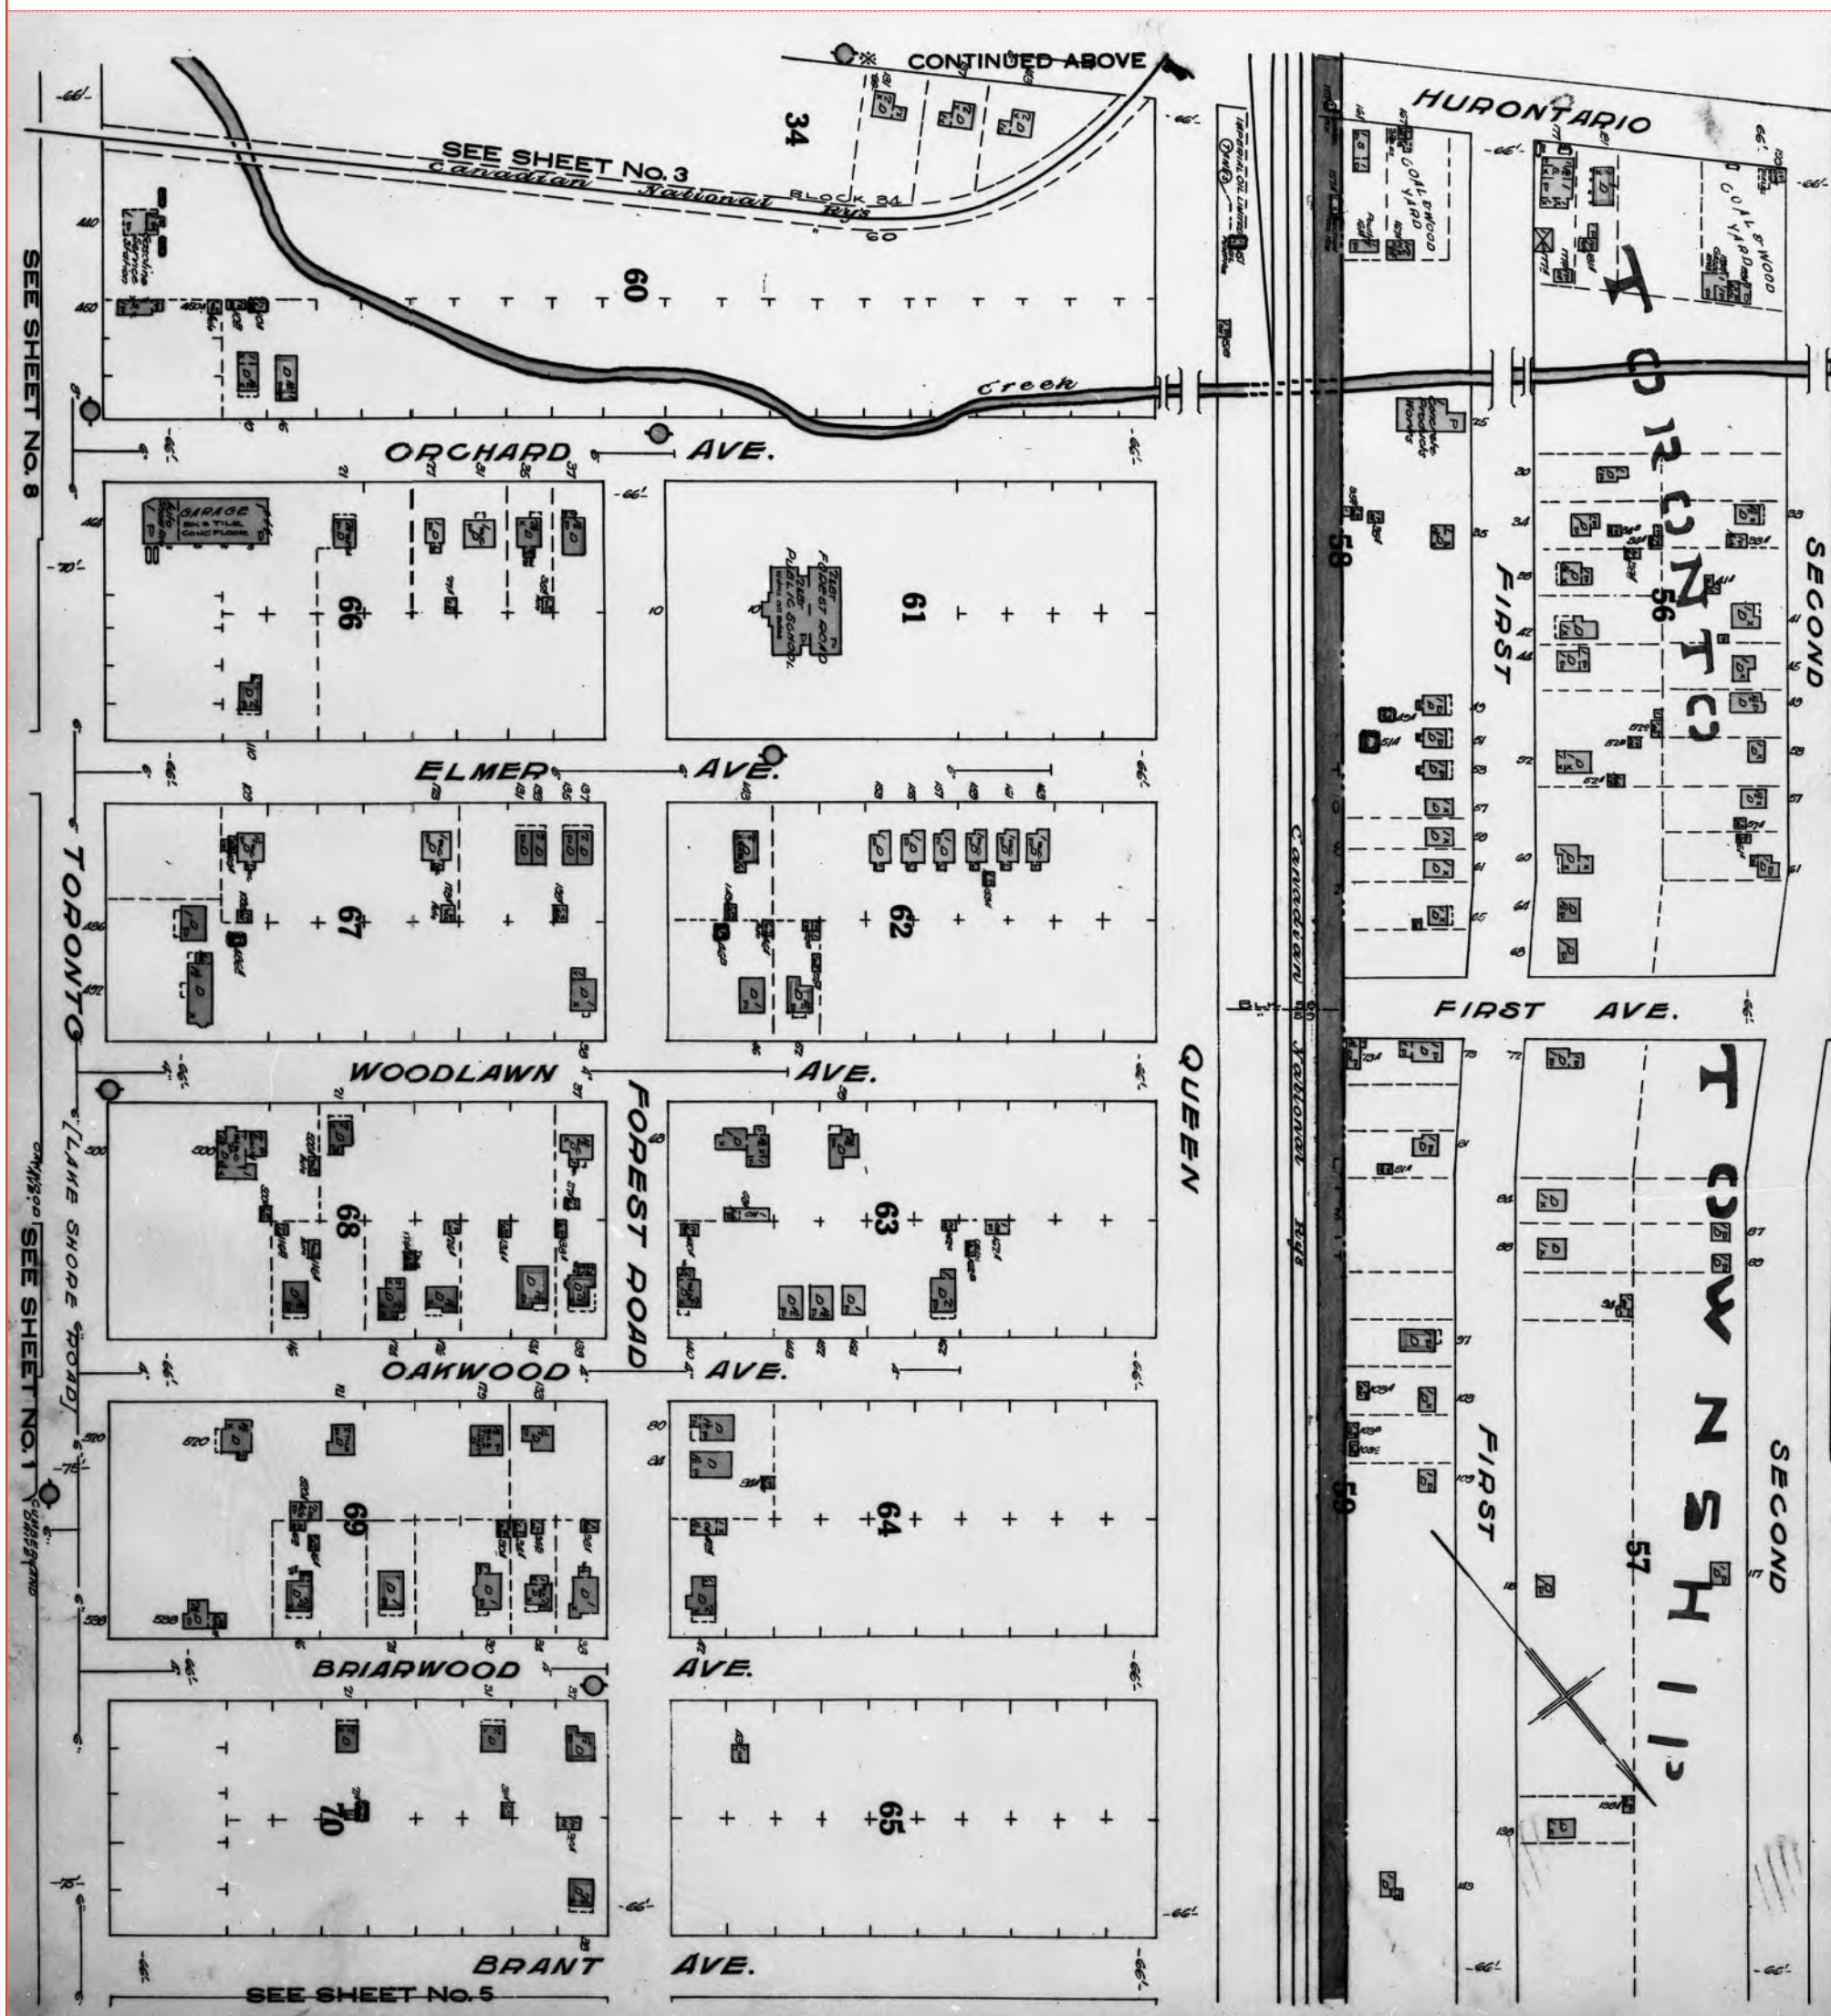


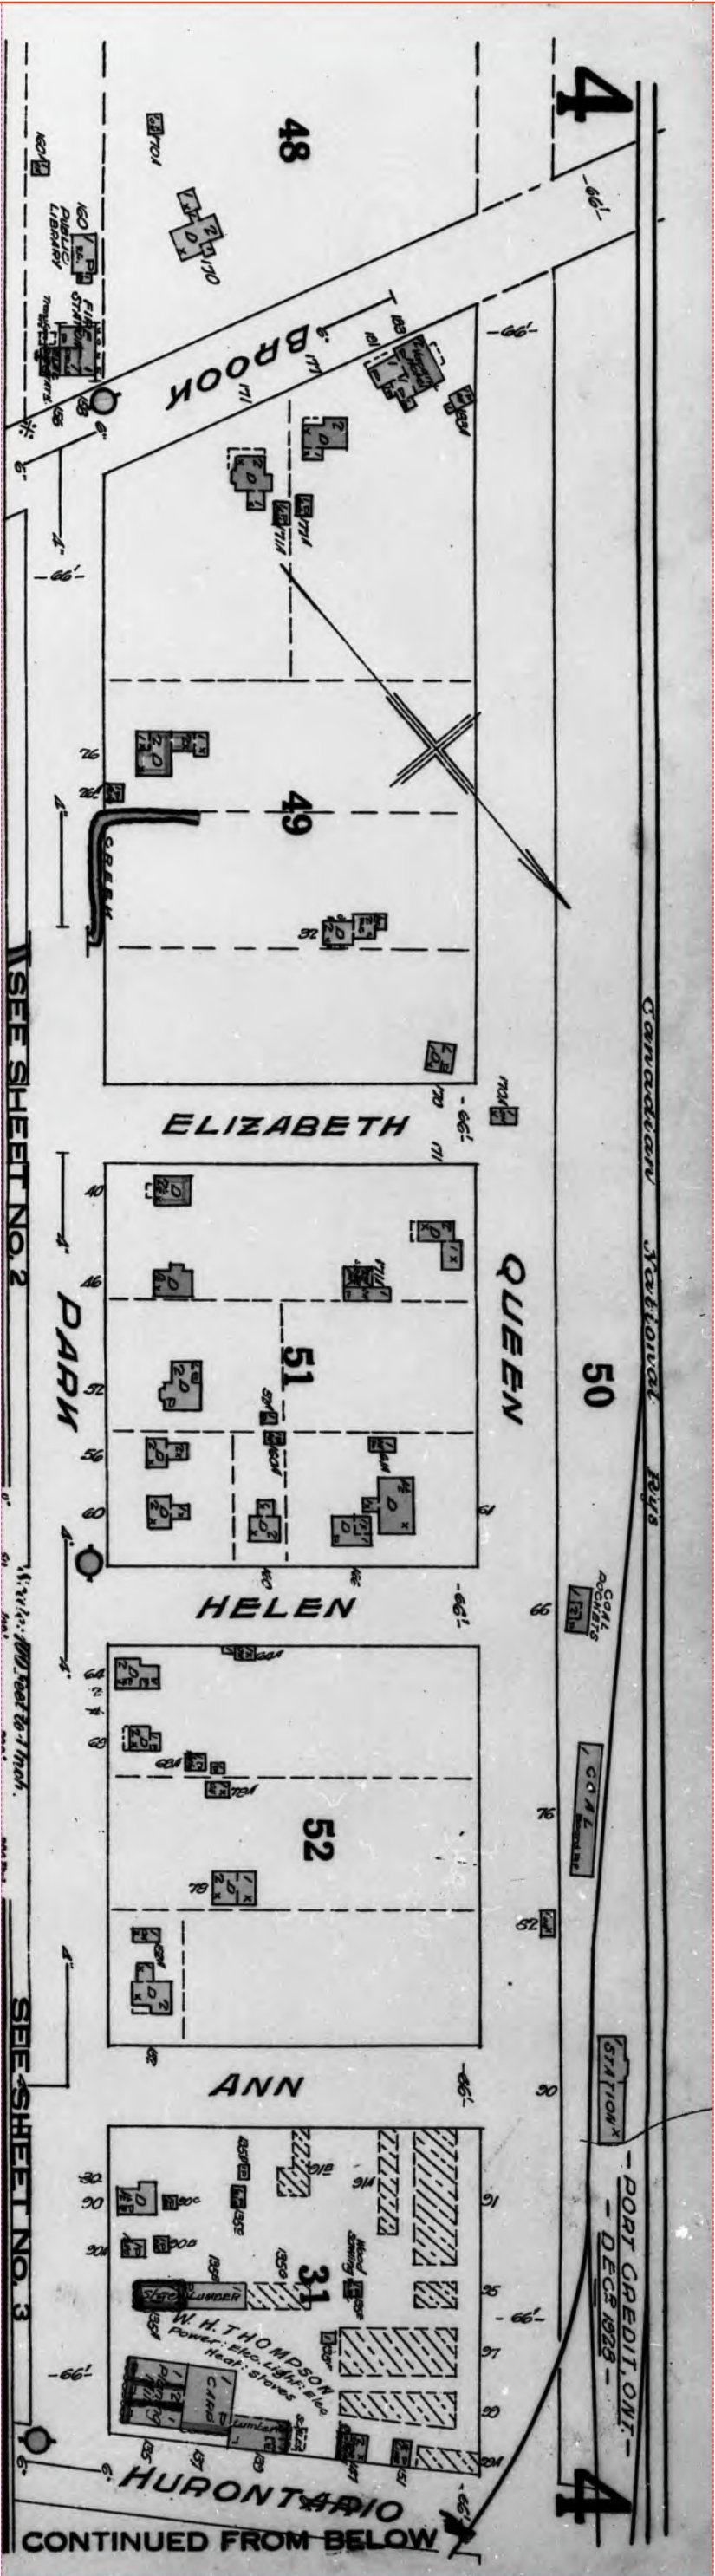


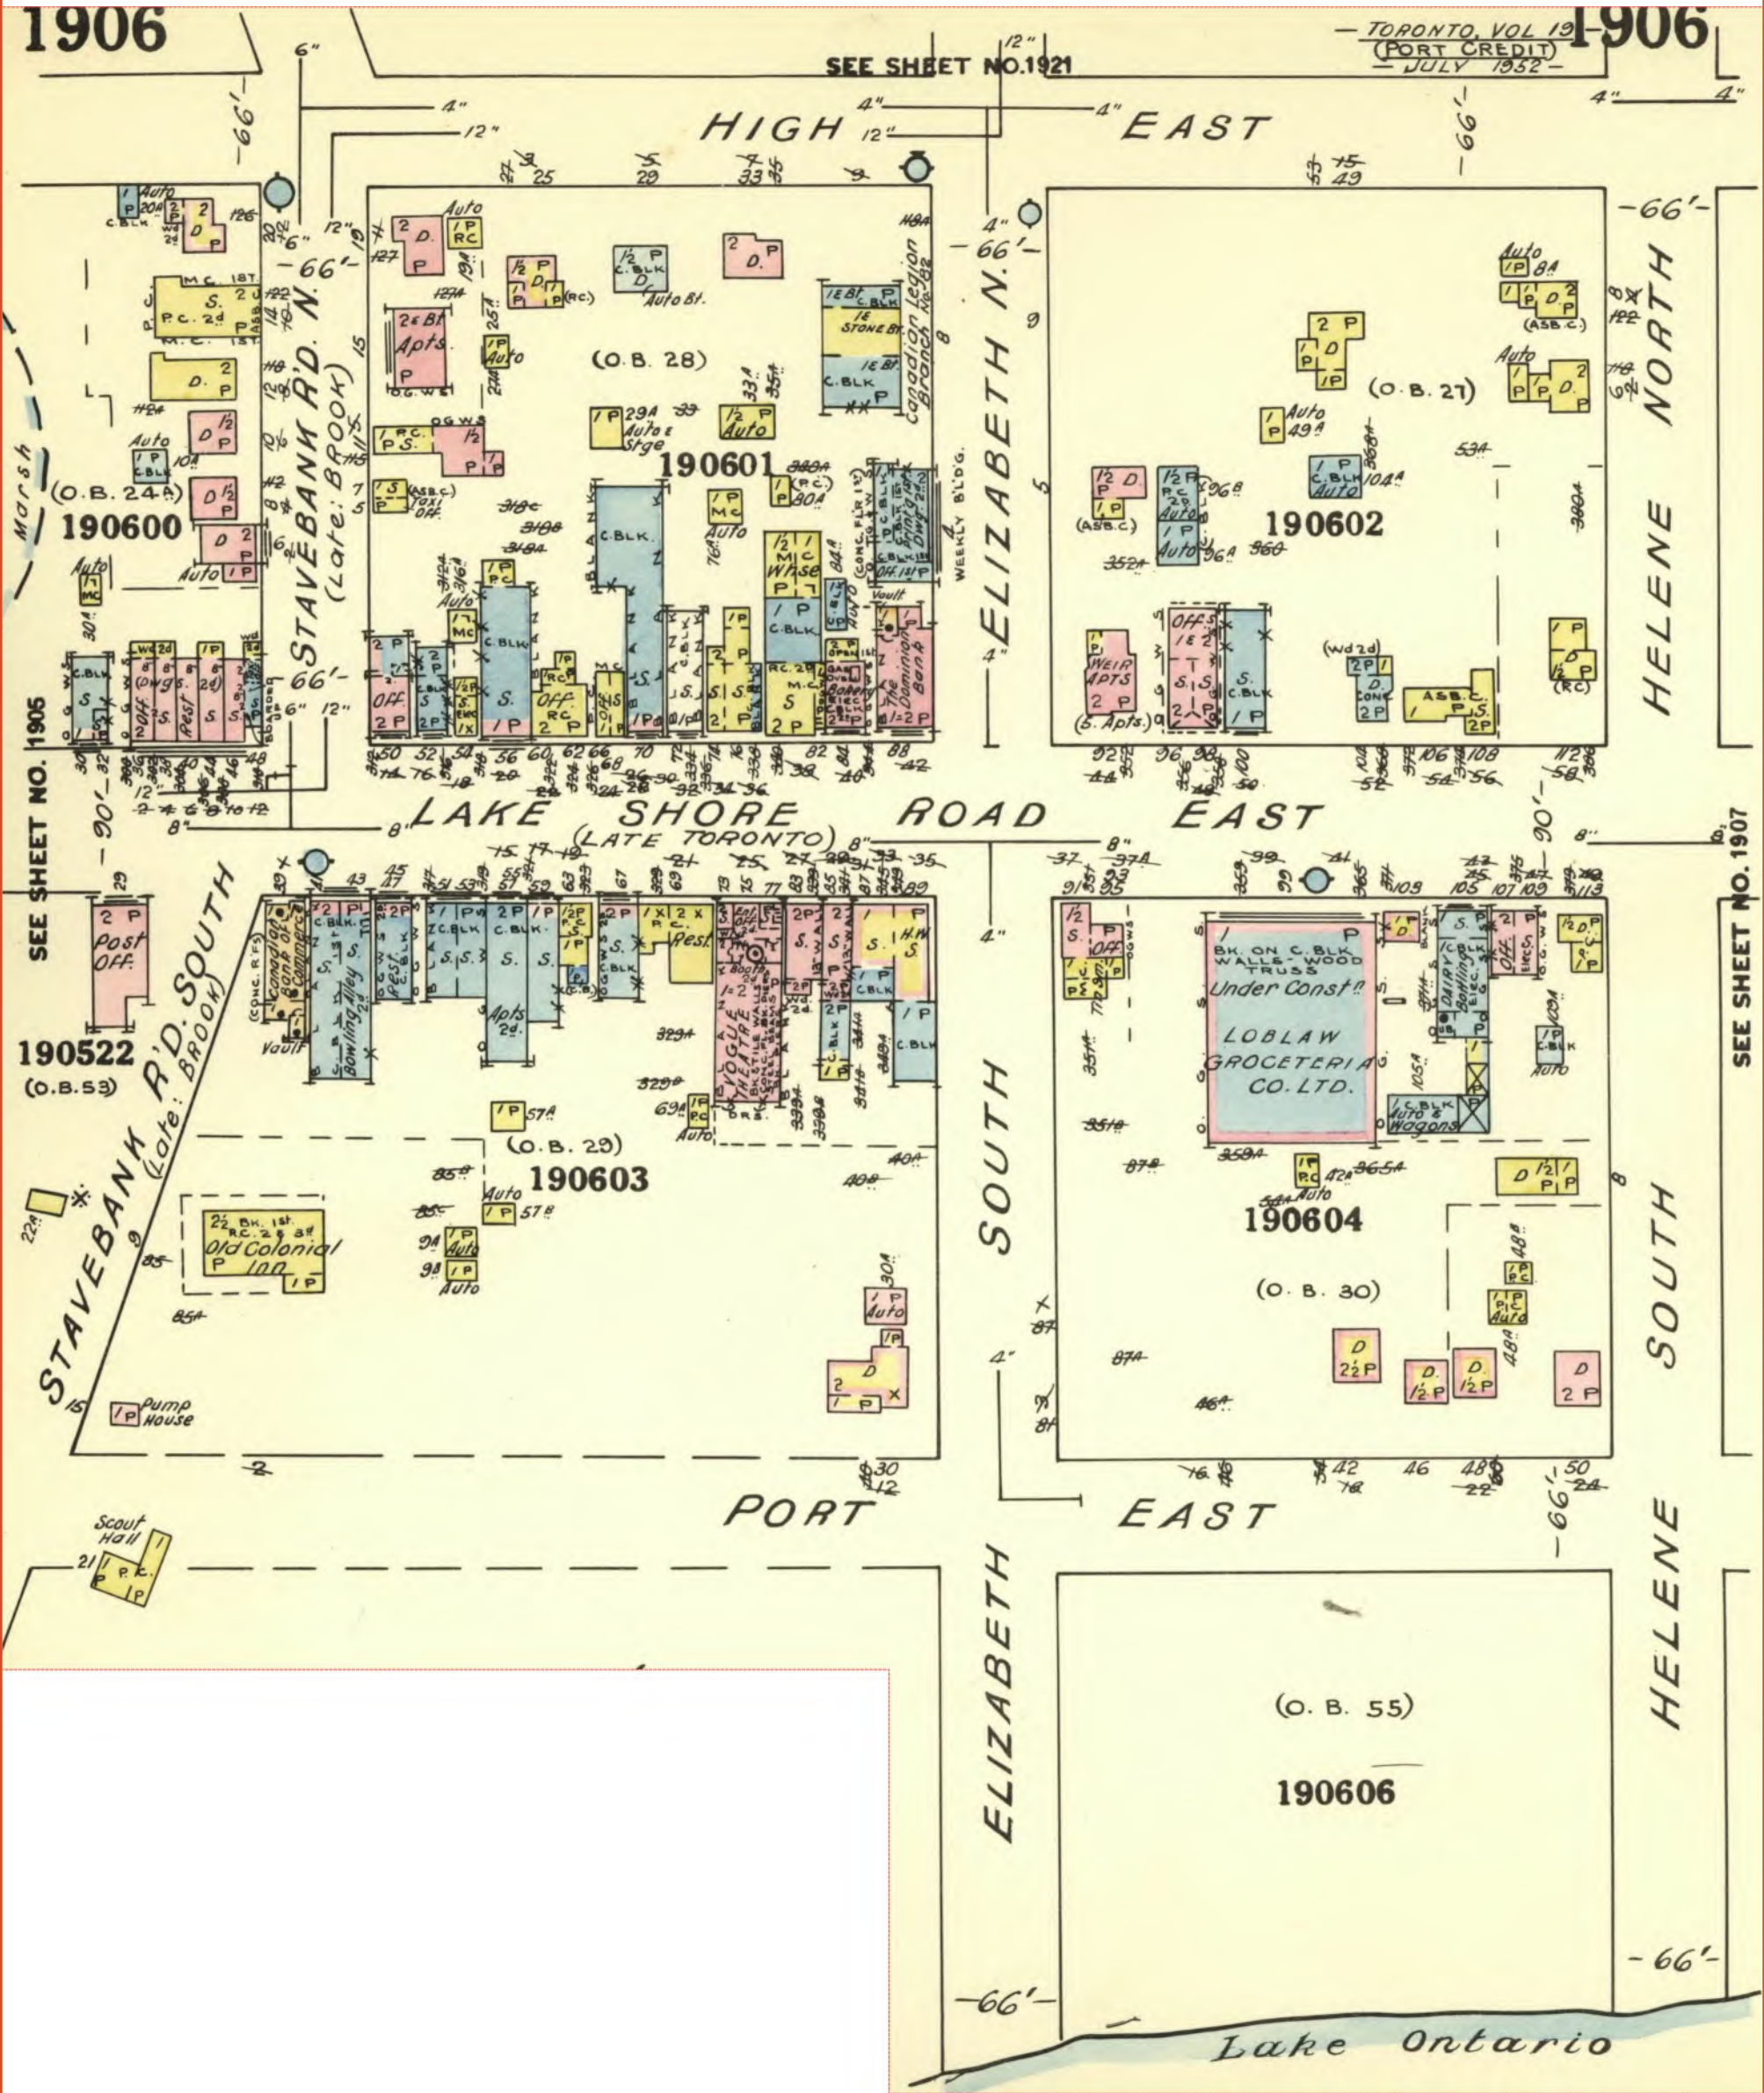


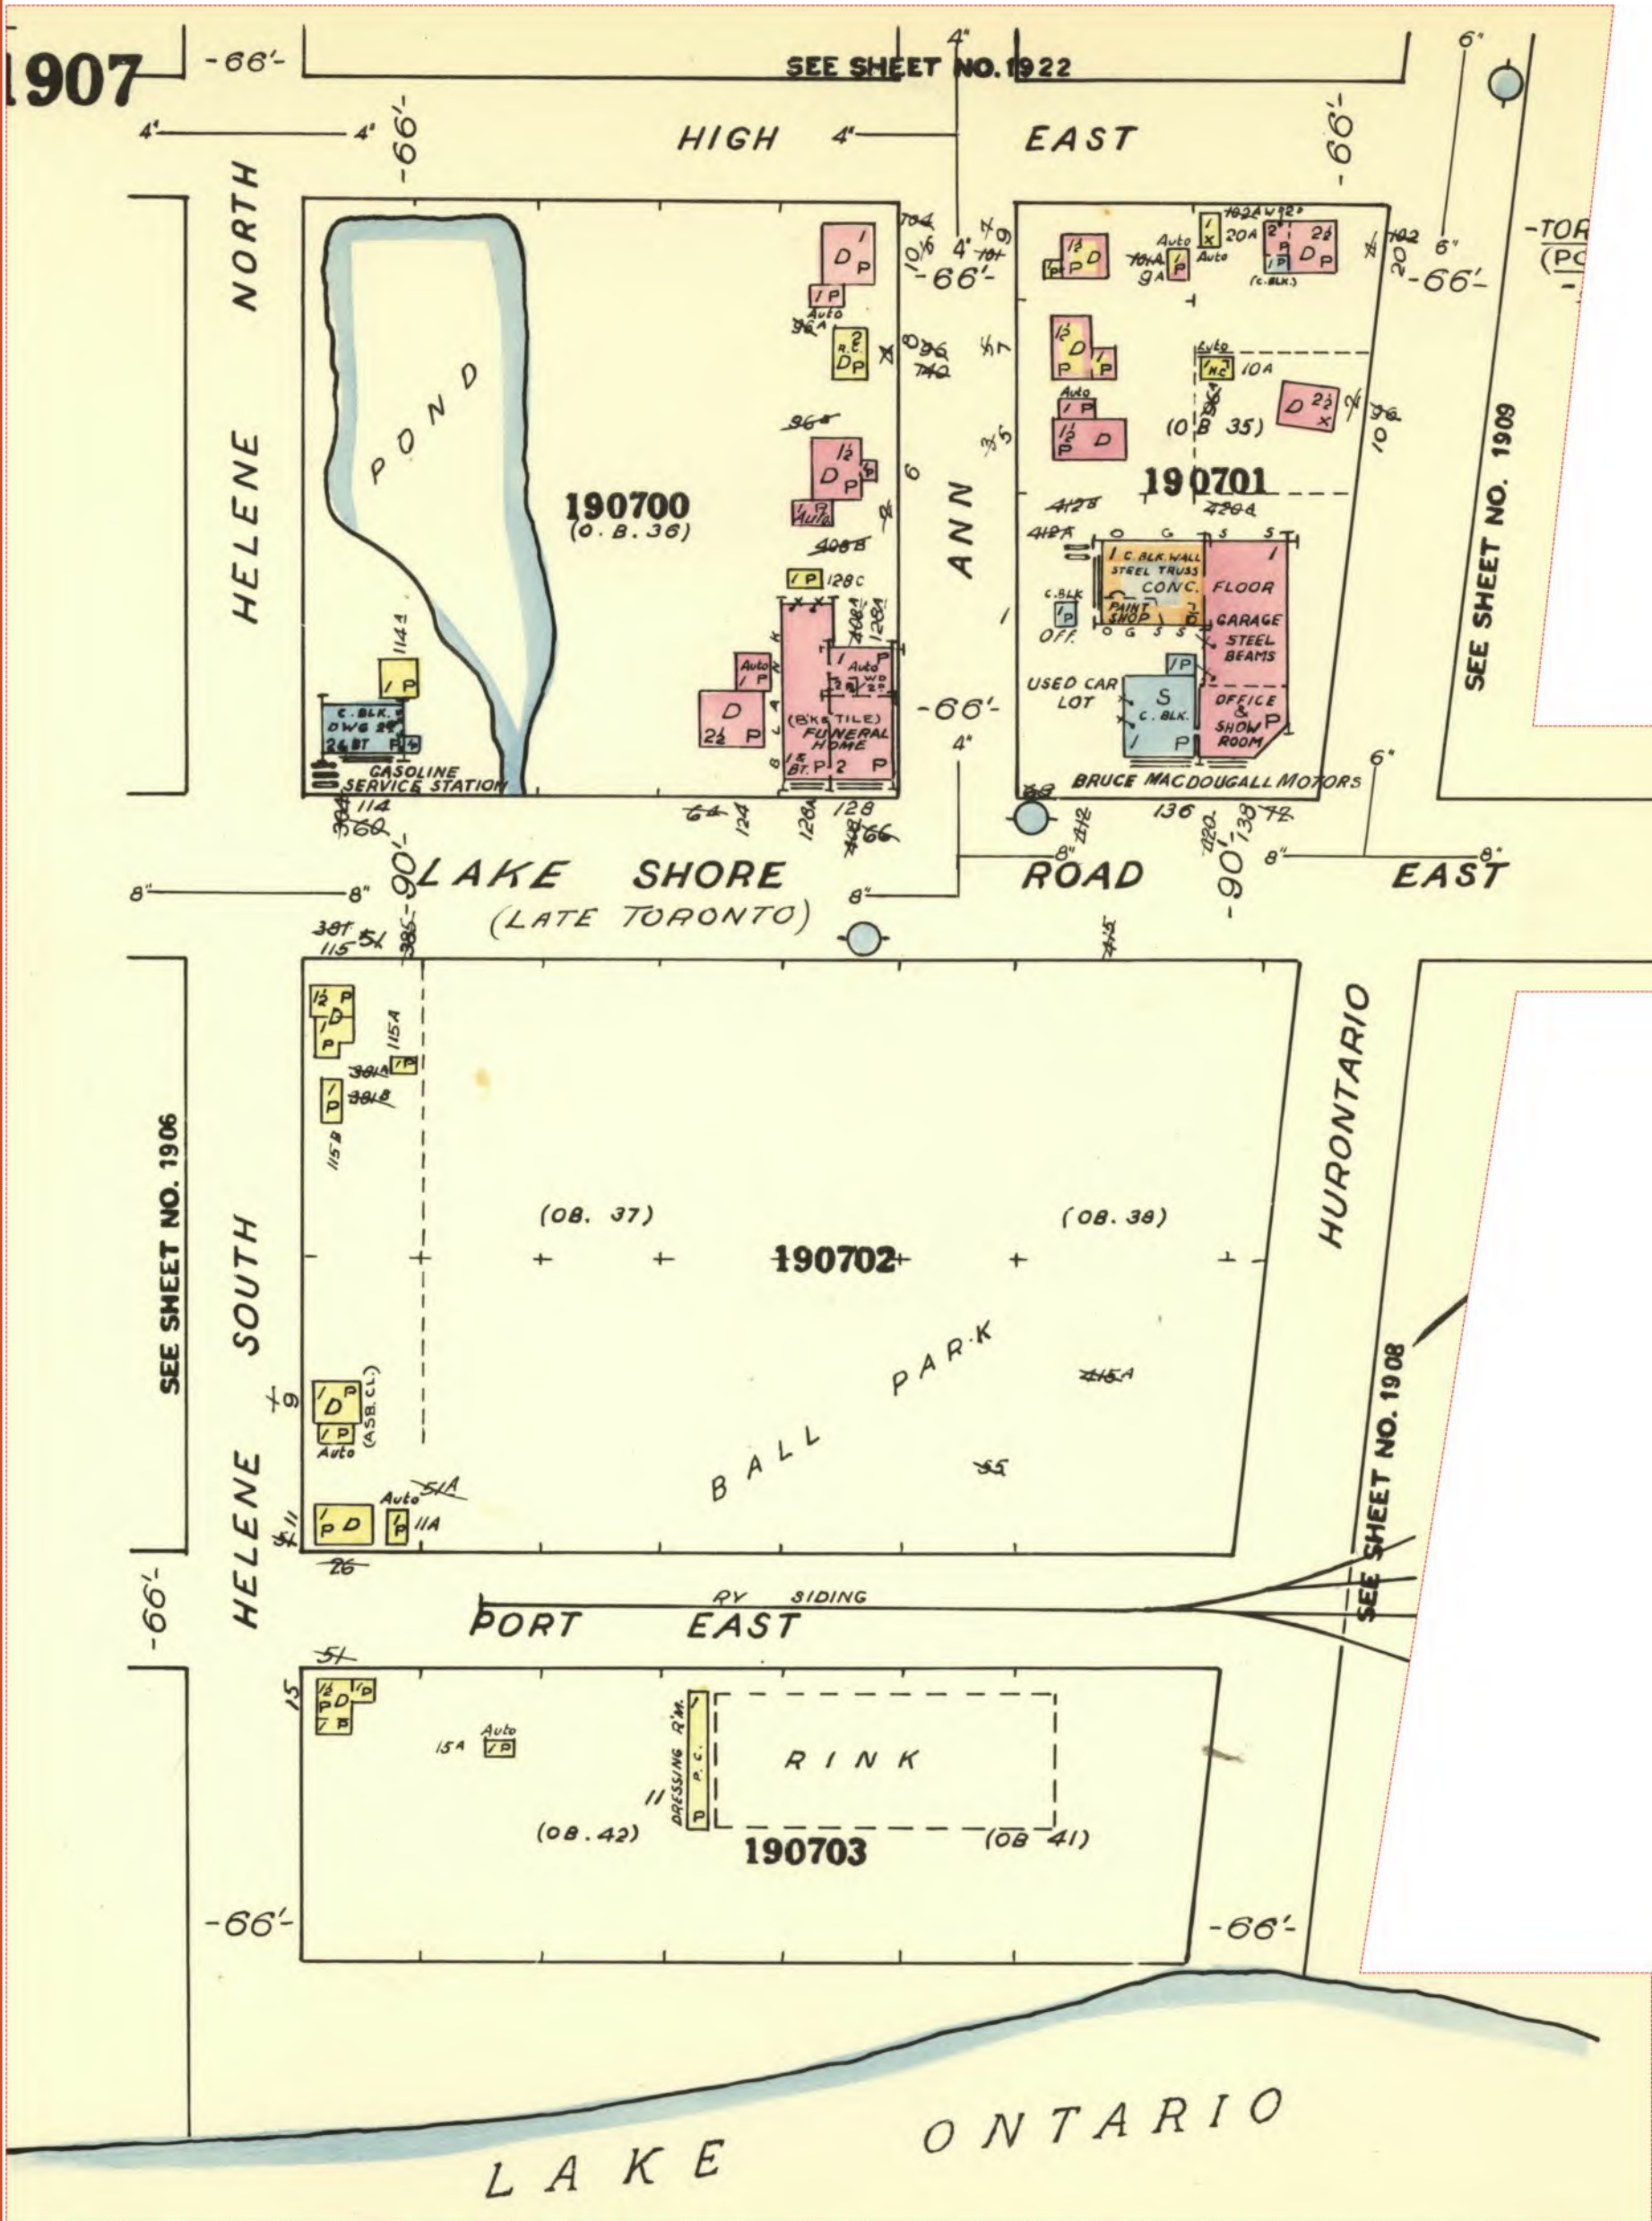


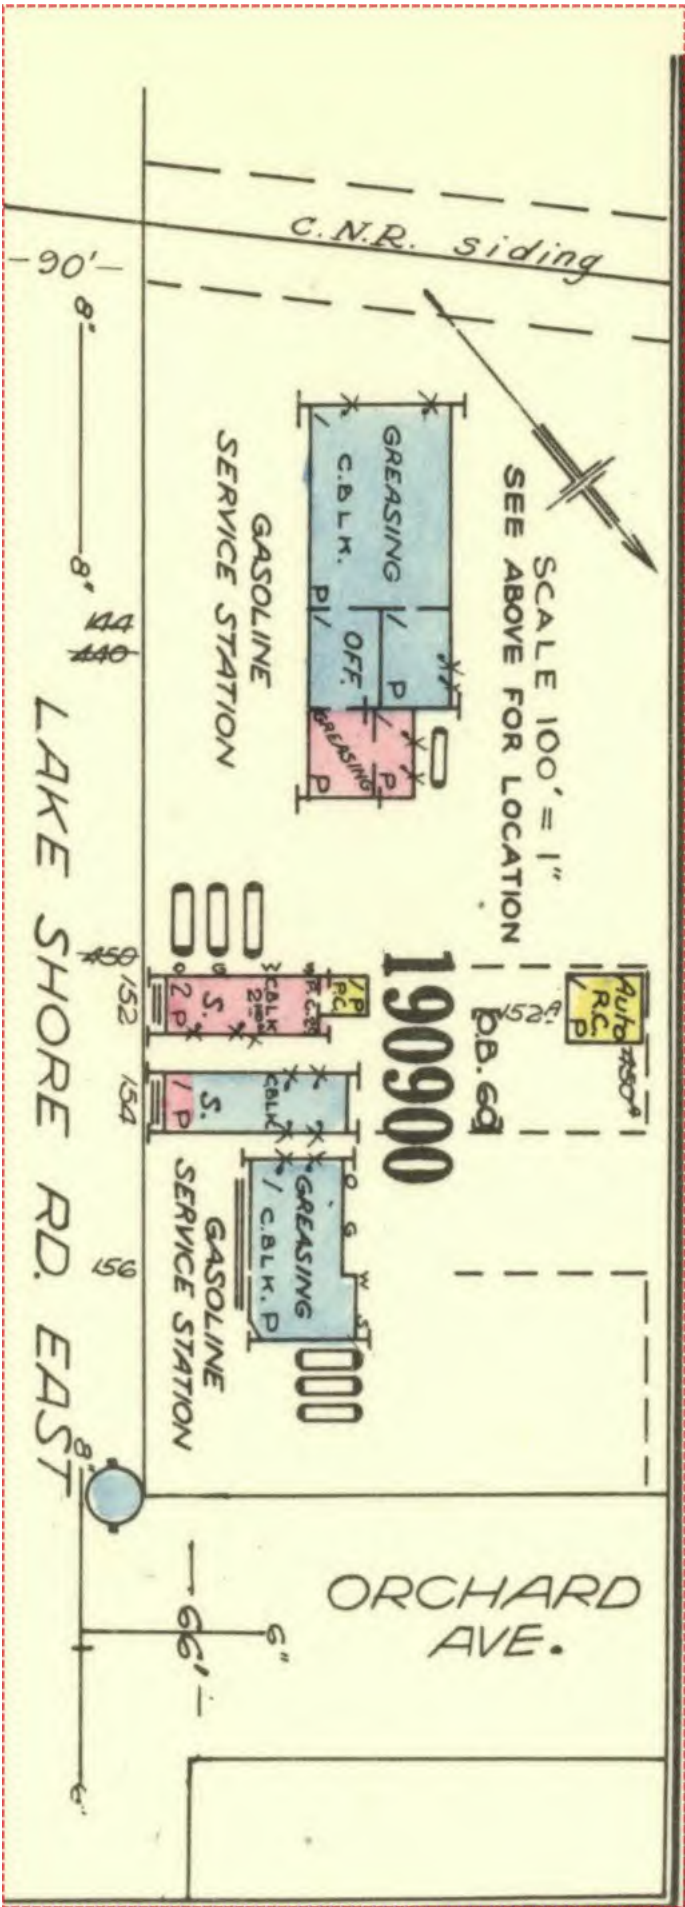

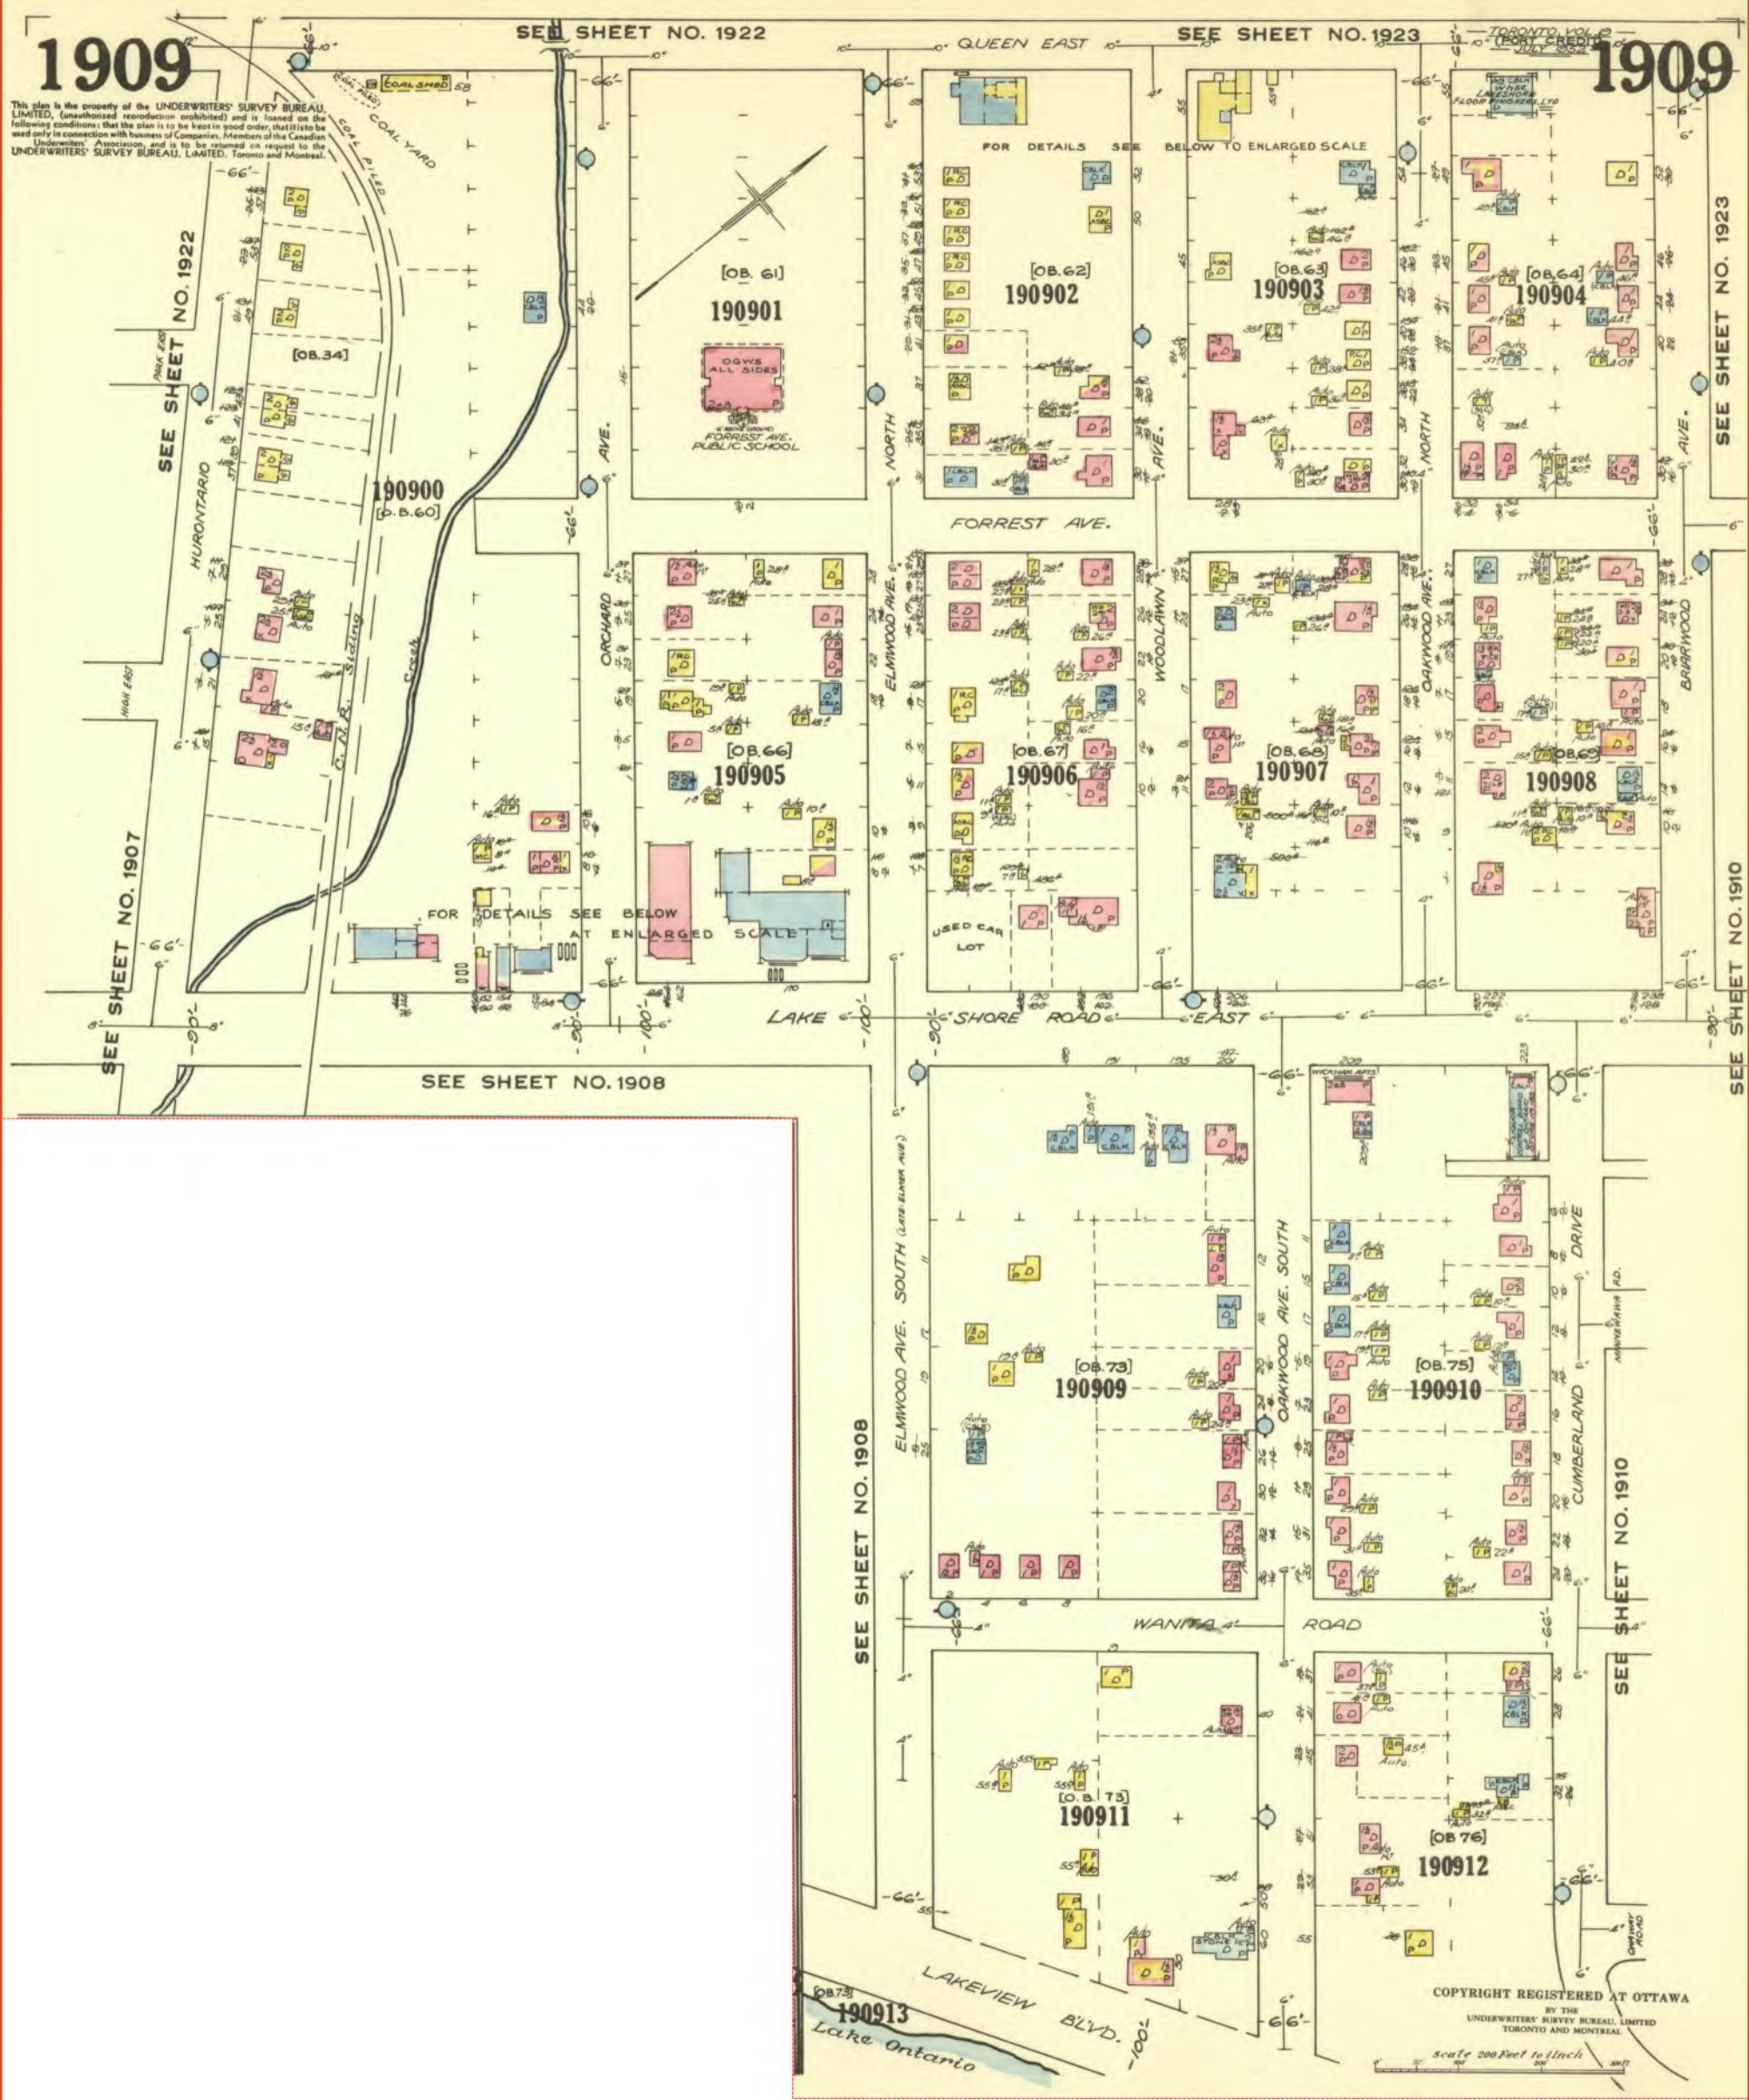

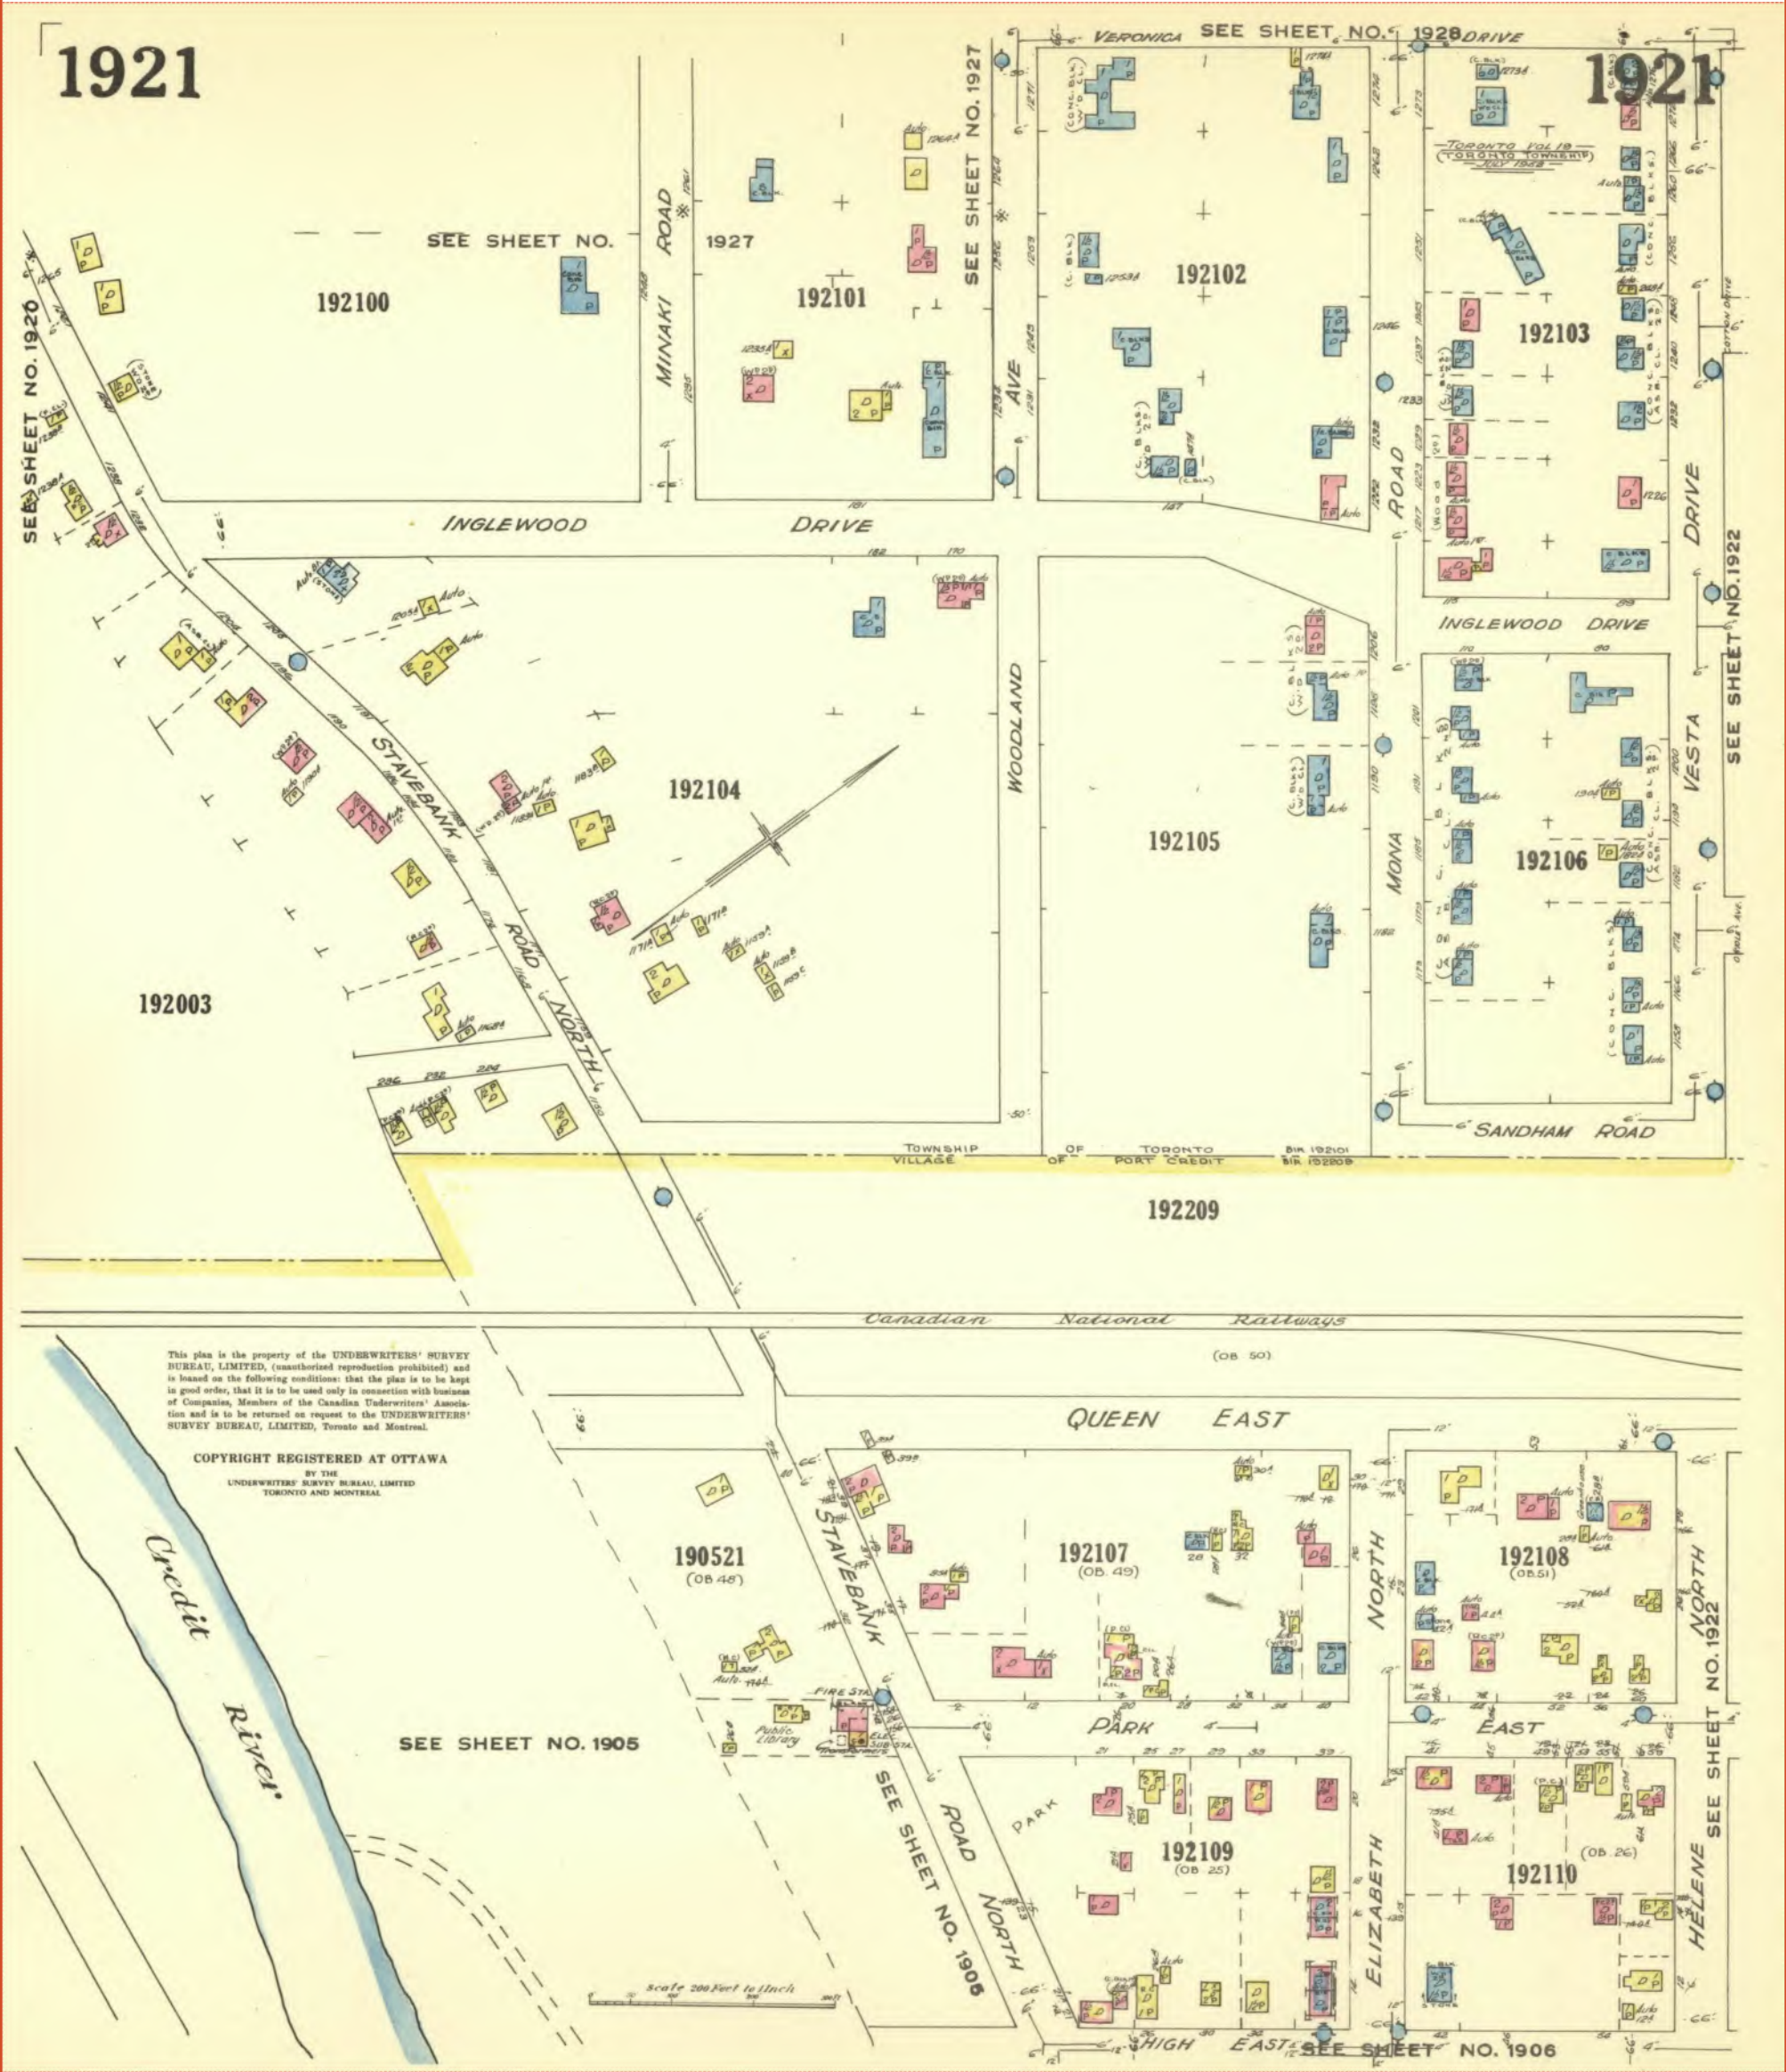

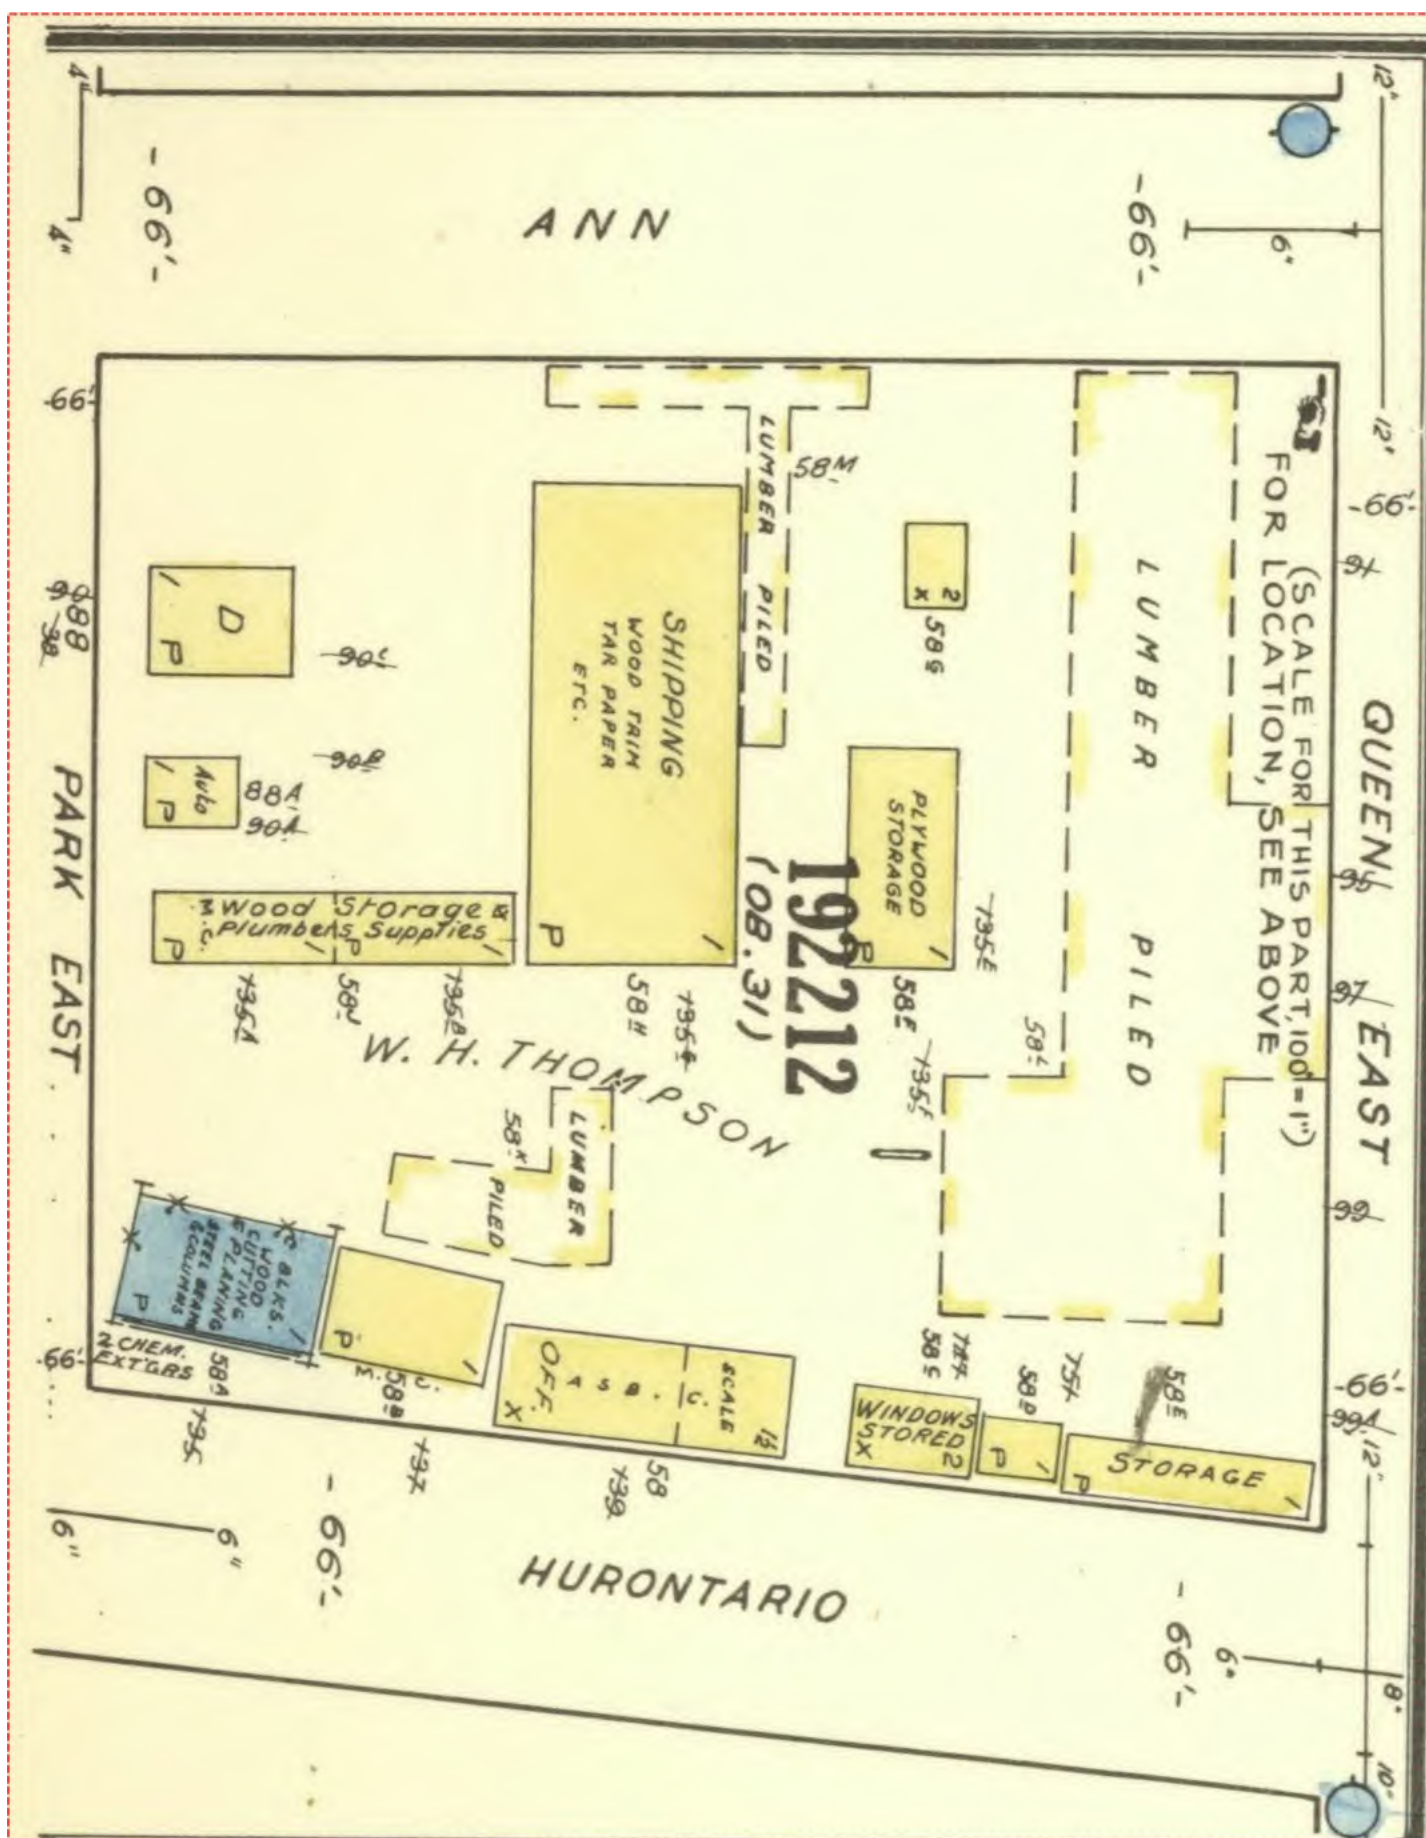

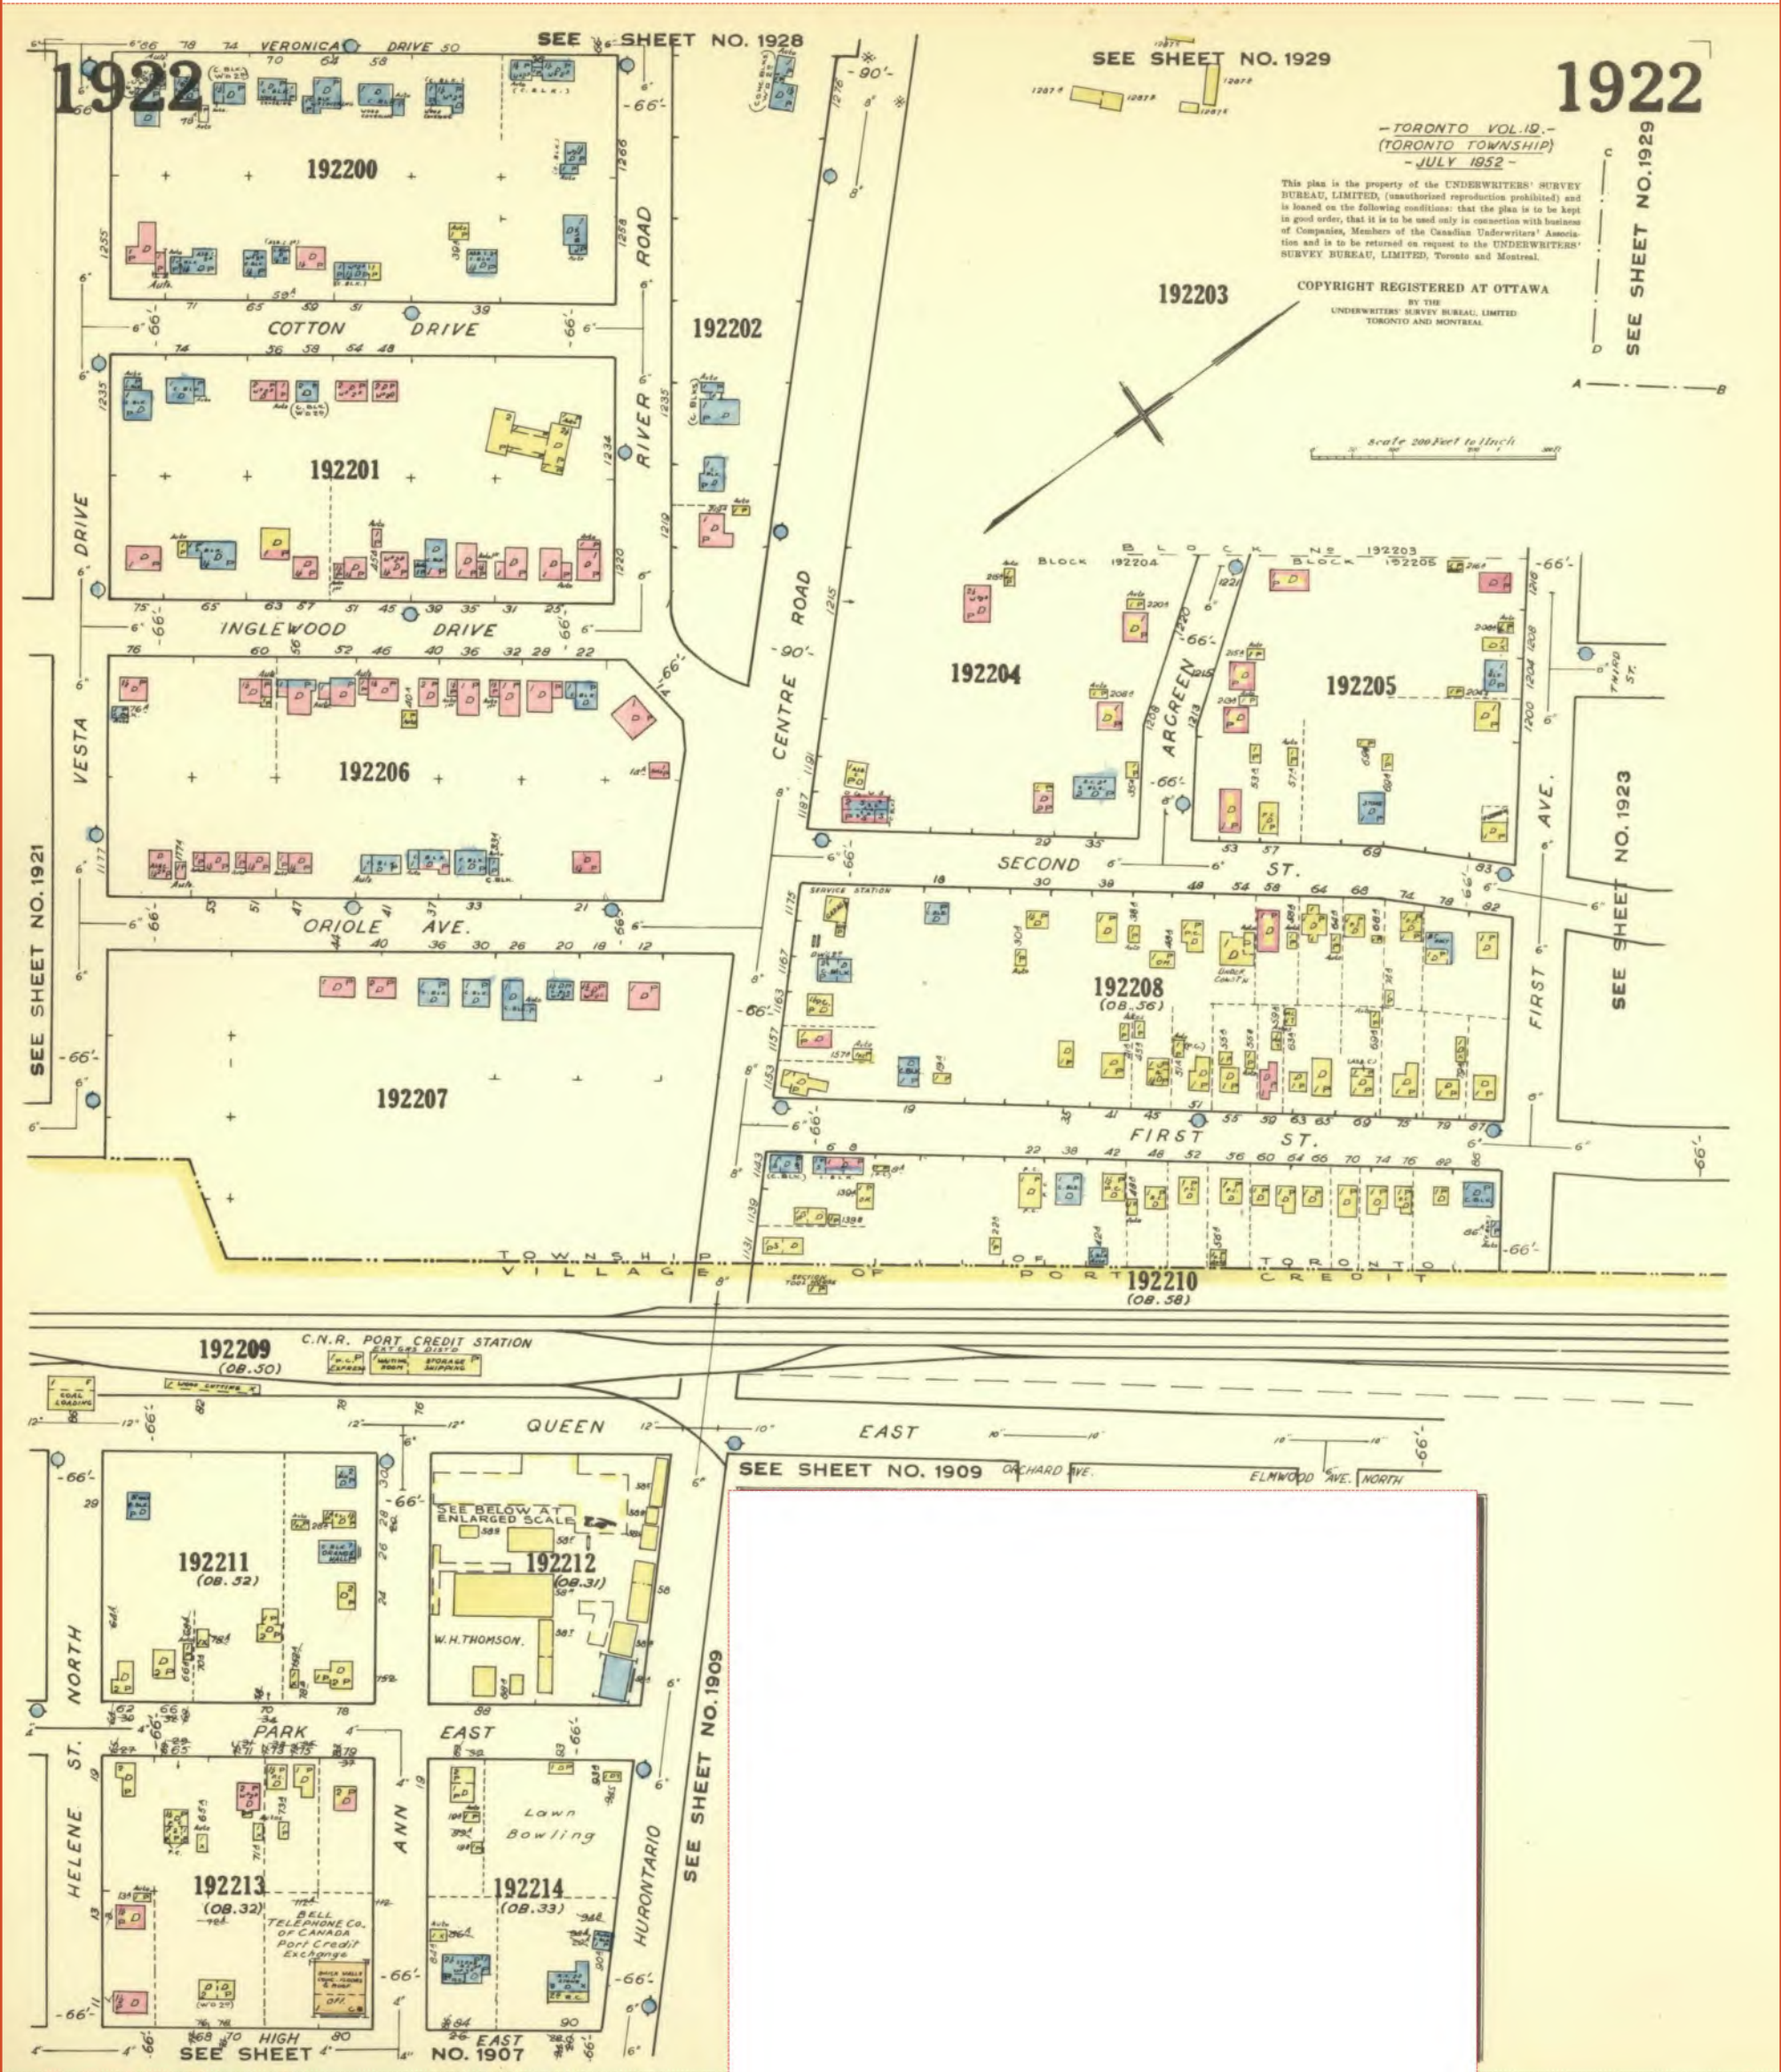

APPENDIX F
ERIS Report



DATABASE REPORT

Project Property:	<i>Phase One ESA 23 Helene St N Mississauga ON L5G 3B6</i>
Project No:	<i>314281</i>
Report Type:	<i>Quote - Custom-Build Your Own Report</i>
Order No:	<i>22091501030</i>
Requested by:	<i>Pinchin Ltd.</i>
Date Completed:	<i>September 20, 2022</i>

Table of Contents

Table of Contents.....	2
Executive Summary.....	3
Executive Summary: Report Summary.....	4
Executive Summary: Site Report Summary - Project Property.....	6
Executive Summary: Site Report Summary - Surrounding Properties.....	7
Executive Summary: Summary By Data Source.....	32
Map.....	63
Aerial.....	64
Topographic Map.....	65
Detail Report.....	66
Unplottable Summary.....	434
Unplottable Report.....	435
Appendix: Database Descriptions.....	440
Definitions.....	449

Notice: IMPORTANT LIMITATIONS and YOUR LIABILITY

Reliance on information in Report: This report DOES NOT replace a full Phase I Environmental Site Assessment but is solely intended to be used as a database review of environmental records.

License for use of information in Report: No page of this report can be used without this cover page, this notice and the project property identifier. The information in Report(s) may not be modified or re-sold.

Your Liability for misuse: Using this Service and/or its reports in a manner contrary to this Notice or your agreement will be in breach of copyright and contract and ERIS may obtain damages for such mis-use, including damages caused to third parties, and gives ERIS the right to terminate your account, rescind your license to any previous reports and to bar you from future use of the Service.

No warranty of Accuracy or Liability for ERIS: The information contained in this report has been produced by ERIS Information Limited Partnership ("ERIS") using various sources of information, including information provided by Federal and Provincial government departments. The report applies only to the address and up to the date specified on the cover of this report, and any alterations or deviation from this description will require a new report. This report and the data contained herein does not purport to be and does not constitute a guarantee of the accuracy of the information contained herein and does not constitute a legal opinion nor medical advice. Although ERIS has endeavored to present you with information that is accurate, ERIS disclaims, any and all liability for any errors, omissions, or inaccuracies in such information and data, whether attributable to inadvertence, negligence or otherwise, and for any consequences arising therefrom. Liability on the part of ERIS is limited to the monetary value paid for this report.

Trademark and Copyright: You may not use the ERIS trademarks or attribute any work to ERIS other than as outlined above. This Service and Report (s) are protected by copyright owned by ERIS Information Limited Partnership. Copyright in data used in the Service or Report(s) (the "Data") is owned by ERIS or its licensors. The Service, Report(s) and Data may not be copied or reproduced in whole or in any substantial part without prior written consent of ERIS.

Executive Summary

Property Information:

Project Property: *Phase One ESA
23 Helene St N Mississauga ON L5G 3B6*

Project No: *314281*

Order Information:

Order No: *22091501030*

Date Requested: *September 15, 2022*

Requested by: *Pinchin Ltd.*

Report Type: *Quote - Custom-Build Your Own Report*

Historical/Products:

Aerial Photographs *Aerials - National Collection*

City Directory Search *City Directory Search - URBAN*

ERIS Xplorer [*ERIS Xplorer*](#)

Physical Setting Report (PSR) *PSR*

Topographic Map *Ontario Base Map (OBM)*

Executive Summary: Report Summary

<i>Database</i>	<i>Name</i>	<i>Searched</i>	<i>Project Property</i>	<i>Boundary to 0.25km</i>	<i>Total</i>
AAGR	Abandoned Aggregate Inventory	Y	0	0	0
AGR	Aggregate Inventory	Y	0	0	0
AMIS	Abandoned Mine Information System	Y	0	0	0
ANDR	Anderson's Waste Disposal Sites	Y	0	0	0
AST	Aboveground Storage Tanks	Y	0	0	0
AUWR	Automobile Wrecking & Supplies	Y	0	0	0
BORE	Borehole	Y	1	92	93
CA	Certificates of Approval	Y	0	5	5
CDRY	Dry Cleaning Facilities	Y	0	0	0
CFOT	Commercial Fuel Oil Tanks	Y	0	1	1
CHEM	Chemical Manufacturers and Distributors	Y	0	0	0
CHM	Chemical Register	Y	0	0	0
CNG	Compressed Natural Gas Stations	Y	0	0	0
COAL	Inventory of Coal Gasification Plants and Coal Tar Sites	Y	0	0	0
CONV	Compliance and Convictions	Y	0	0	0
CPU	Certificates of Property Use	Y	0	0	0
DRL	Drill Hole Database	Y	0	0	0
DTNK	Delisted Fuel Tanks	Y	0	12	12
EASR	Environmental Activity and Sector Registry	Y	0	2	2
EBR	Environmental Registry	Y	0	0	0
ECA	Environmental Compliance Approval	Y	0	3	3
EEM	Environmental Effects Monitoring	Y	0	0	0
EHS	ERIS Historical Searches	Y	3	37	40
EIIS	Environmental Issues Inventory System	Y	0	0	0
EMHE	Emergency Management Historical Event	Y	0	0	0
EPAR	Environmental Penalty Annual Report	Y	0	0	0
EXP	List of Expired Fuels Safety Facilities	Y	0	0	0
FCON	Federal Convictions	Y	0	0	0
FCS	Contaminated Sites on Federal Land	Y	0	0	0
FOFT	Fisheries & Oceans Fuel Tanks	Y	0	0	0
FRST	Federal Identification Registry for Storage Tank Systems (FIRSTS)	Y	0	0	0
FST	Fuel Storage Tank	Y	0	8	8
FSTH	Fuel Storage Tank - Historic	Y	0	0	0
GEN	Ontario Regulation 347 Waste Generators Summary	Y	0	41	41
GHG	Greenhouse Gas Emissions from Large Facilities	Y	0	0	0
HINC	TSSA Historic Incidents	Y	0	0	0

<i>Database</i>	<i>Name</i>	<i>Searched</i>	<i>Project Property</i>	<i>Boundary to 0.25km</i>	<i>Total</i>
IAFT	Indian & Northern Affairs Fuel Tanks	Y	0	0	0
INC	Fuel Oil Spills and Leaks	Y	0	4	4
LIMO	Landfill Inventory Management Ontario	Y	0	0	0
MINE	Canadian Mine Locations	Y	0	0	0
MNR	Mineral Occurrences	Y	0	0	0
NATE	National Analysis of Trends in Emergencies System (NATES)	Y	0	0	0
NCPL	Non-Compliance Reports	Y	0	0	0
NDFT	National Defense & Canadian Forces Fuel Tanks	Y	0	0	0
NDSP	National Defense & Canadian Forces Spills	Y	0	0	0
NDWD	National Defence & Canadian Forces Waste Disposal Sites	Y	0	0	0
NEBI	National Energy Board Pipeline Incidents	Y	0	0	0
NEBP	National Energy Board Wells	Y	0	0	0
NEES	National Environmental Emergencies System (NEES)	Y	0	0	0
NPCB	National PCB Inventory	Y	0	0	0
NPRI	National Pollutant Release Inventory	Y	0	0	0
OGWE	Oil and Gas Wells	Y	0	0	0
OOGW	Ontario Oil and Gas Wells	Y	0	0	0
OPCB	Inventory of PCB Storage Sites	Y	0	0	0
ORD	Orders	Y	0	0	0
PAP	Canadian Pulp and Paper	Y	0	0	0
PCFT	Parks Canada Fuel Storage Tanks	Y	0	0	0
PES	Pesticide Register	Y	0	3	3
PINC	Pipeline Incidents	Y	0	4	4
PRT	Private and Retail Fuel Storage Tanks	Y	0	2	2
PTTW	Permit to Take Water	Y	0	1	1
REC	Ontario Regulation 347 Waste Receivers Summary	Y	0	0	0
RSC	Record of Site Condition	Y	0	5	5
RST	Retail Fuel Storage Tanks	Y	0	0	0
SCT	Scott's Manufacturing Directory	Y	1	4	5
SPL	Ontario Spills	Y	0	13	13
SRDS	Wastewater Discharger Registration Database	Y	0	0	0
TANK	Anderson's Storage Tanks	Y	0	0	0
TCFT	Transport Canada Fuel Storage Tanks	Y	0	0	0
VAR	Variances for Abandonment of Underground Storage Tanks	Y	0	0	0
WDS	Waste Disposal Sites - MOE CA Inventory	Y	0	0	0
WDSH	Waste Disposal Sites - MOE 1991 Historical Approval Inventory	Y	0	0	0
WWIS	Water Well Information System	Y	0	72	72
Total:			5	309	314

Executive Summary: Site Report Summary - Project Property

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev diff (m)</i>	<i>Page Number</i>
<u>1</u>	EHS		70 Park St E Mississauga ON L5G 1M5	ESE/0.0	0.00	<u>66</u>
<u>1</u>	EHS		70 Park St E Mississauga ON L5G 1M5	ESE/0.0	0.00	<u>66</u>
<u>2</u>	SCT	Richard's Fine Chocolates Inc.	25 Helene St N Mississauga ON L5G 3B6	SSE/0.0	0.00	<u>66</u>
<u>3</u>	BORE		ON	NW/0.0	0.00	<u>66</u>
<u>4</u>	EHS		n/a Mississauga ON	WNW/0.0	0.00	<u>68</u>

Executive Summary: Site Report Summary - Surrounding Properties

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
5	WWIS		PORT CREDIT GO STATION PORT CREDIT ON <i>Well ID: 7321813</i>	W/0.9	0.00	68
6	BORE		ON	WSW/1.8	0.00	71
7	WWIS		22 ANN ST. MISSISSAUGA ON <i>Well ID: 7341861</i>	E/6.6	0.00	73
8	WWIS		78 PARK ST. E MISSISSAUGA ON <i>Well ID: 7341887</i>	E/6.6	0.00	76
9	WWIS		ON <i>Well ID: 7380344</i>	E/7.3	0.00	80
10	BORE		ON	W/10.5	0.00	81
11	EHS		28 Helene St N Mississauga ON L5G 3B7	SSW/10.9	0.00	82
12	EHS		24 Ann St Mississauga ON L5G 3G1	ENE/17.1	0.00	82
13	BORE		ON	N/20.5	0.76	82
14	BORE		ON	W/21.6	0.00	84
15	WWIS		78 PARK ST. E MISSISSAUGA ON <i>Well ID: 7341823</i>	E/21.8	0.00	85
16	WWIS		ON	E/23.9	0.00	88

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
			Well ID: 7390272			
17	BORE		ON	S/25.0	0.00	89
18	GEN	IMH Pool VI-A LP	28 Helene St North Port Credit ON L5G 3B7	SSW/26.1	0.00	91
19	WWIS		PORT CREDIT GO STATION PORT CREDIT ON Well ID: 7243496	WNW/33.7	0.00	91
20	WWIS		ON Well ID: 7330113	NE/34.3	0.73	94
21	WWIS		26 ANN ST. MISSISSAUGA ON Well ID: 7341844	NE/35.0	0.37	95
21	WWIS		26 ANN ST. MISSISSAUGA ON Well ID: 7341883	NE/35.0	0.37	99
22	BORE		ON	W/36.5	0.00	103
23	BORE		ON	SW/37.2	0.00	104
24	EHS		Park St E and Hurontario St Mississauga ON	NW/41.6	0.00	105
25	BORE		ON	SSW/41.8	0.00	105
26	BORE		ON	ENE/42.2	0.00	107
27	EHS		28 Helene Street North Mississauga ON L5G 3B7	S/43.6	0.00	108
28	BORE		ON	NE/45.9	1.00	108

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>29</u>	GEN	Metrolinx	30 Queen Street East Mississauga ON L5H 1L4	WSW/46.6	0.00	<u>110</u>
<u>29</u>	PTTW	Salini Impregilo Civil Works Inc.	30 Queen Street East Mississauga, ON Canada ON	WSW/46.6	0.00	<u>110</u>
<u>29</u>	GEN	Metrolinx	30 Queen Street East Mississauga ON L5H 1L4	WSW/46.6	0.00	<u>111</u>
<u>29</u>	EASR	Salini Impregilo Civil Works Inc.	30 Queen ST E Mississauga ON L5R 4G7	WSW/46.6	0.00	<u>111</u>
<u>29</u>	GEN	Mobilinx	30 Queen Street East Mississauga ON L5G 4N6	WSW/46.6	0.00	<u>111</u>
<u>29</u>	GEN	Metrolinx	30 Queen Street East Mississauga ON L5H 1L4	WSW/46.6	0.00	<u>111</u>
<u>30</u>	BORE		ON	SE/46.7	0.58	<u>112</u>
<u>31</u>	WWIS		30 Queen St E ON Well ID: 7380055	N/48.7	1.00	<u>113</u>
<u>32</u>	WWIS		30 Queen St E ON Well ID: 7380056	N/49.7	1.00	<u>116</u>
<u>33</u>	BORE		ON	S/50.7	0.00	<u>119</u>
<u>34</u>	WWIS		GO STATION PARKING LOT PORT CREDIT ON Well ID: 7307873	WNW/53.3	0.00	<u>121</u>
<u>35</u>	WWIS		30 Queen St East Mississauga ON Well ID: 7363632	ENE/55.1	-0.15	<u>124</u>
<u>36</u>	WWIS		port credit go station Mississauga ON	NE/56.4	1.00	<u>127</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
			Well ID: 7355171			
37	WWIS		PORT CREDIT GO STATION ETOBICOKE ON	NNE/56.6	1.00	131
			Well ID: 7321758			
38	BORE		ON	NW/56.7	0.00	134
39	BORE		ON	W/58.4	0.00	136
40	BORE		ON	WSW/58.8	0.00	137
41	WWIS		30 Queen St East Mississauga ON	NE/59.7	1.00	138
			Well ID: 7363631			
42	BORE		ON	E/61.8	1.00	141
43	BORE		ON	ENE/61.9	-0.09	143
44	BORE		ON	W/62.7	0.00	144
45	EHS		80 High Street E Mississauga ON L5G 1K4	ESE/64.3	1.00	145
46	BORE		ON	N/64.7	1.00	145
47	BORE		ON	E/66.1	0.79	147
48	WWIS		ON	W/66.1	0.00	148
			Well ID: 7378962			
49	BORE		ON	WNW/67.3	0.00	149

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
50	BORE		ON	SSE/67.3	0.53	150
51	WWIS		PORT CREDIT GO STATION PORT CREDIT ON <i>Well ID: 7310439</i>	WNW/69.6	0.00	151
52	WWIS		PORT CREDIT GO STATION PORT CREDIT ON <i>Well ID: 7321737</i>	WNW/71.7	0.00	155
53	BORE		ON	NW/76.2	0.29	158
54	BORE		ON	SE/78.5	1.00	159
55	BORE		ON	NE/79.6	1.00	161
56	EHS		Port Credit Mississauga ON	NE/84.8	0.61	162
56	EHS		Port Credit Mississauga ON	NE/84.8	0.61	162
57	CFOT	BELL CANADA	80 HIGH ST E MISSISSAUGA L5G 1K2 ON CA ON	ESE/87.6	1.00	163
57	GEN	Bell	80 High St Mississauga ON L5G 1K2	ESE/87.6	1.00	163
57	GEN	Bell	80 High St Port Credit ON L5G 1K4	ESE/87.6	1.00	163
57	GEN	Bell	80 High St Mississauga ON L5G 1K2	ESE/87.6	1.00	164
57	GEN	Bell	80 High St Port Credit ON L5G 1K4	ESE/87.6	1.00	164

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
57	SPL		80 High Street East Mississauga ON	ESE/87.6	1.00	165
57	SPL	Bell Canada	80 High Street Mississauga ON	ESE/87.6	1.00	165
57	GEN	Bell	80 High St Port Credit ON L5G 1K4	ESE/87.6	1.00	165
57	DTNK	BELL CANADA	80 HIGH ST E MISSISSAUGA L5G 1K2 ON CA ON	ESE/87.6	1.00	166
57	GEN	Bell	80 High St Port Credit ON L5G 1K4	ESE/87.6	1.00	167
58	CA	Kanco-55 Park Ltd.	55 Park St E Mississauga ON	SSE/90.6	1.00	167
58	EHS		55 Park Street East Mississauga ON	SSE/90.6	1.00	167
58	INC		55 PARK STREET EAST, MISSISSAUGA ON	SSE/90.6	1.00	167
58	INC		55 PARK STREET EAST, MISSISSAUGA ON	SSE/90.6	1.00	168
58	INC		55 PARK STREET EAST, MISSISSAUGA ON	SSE/90.6	1.00	169
58	ECA	Kanco-55 Park Ltd.	55 Park St E Mississauga ON L4V 1R9	SSE/90.6	1.00	169
58	EHS		55 Park Street East Mississauga ON L5G 1L9	SSE/90.6	1.00	170
59	WWIS		GO STATION PARKING LOT PORT CREDIT ON	NNE/90.8	1.00	170

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
			Well ID: 7307874			
60	WWIS		30 QUEEN ST E Mississauga ON	ENE/91.9	0.98	173
			Well ID: 7234471			
60	GEN	Metrolinx	30 Queen Street East Mississauga ON L5H 1L4	ENE/91.9	0.98	176
60	GEN	Metrolinx	30 Queen Street East Mississauga ON L5H 1L4	ENE/91.9	0.98	176
60	GEN	Metrolinx	30 Queen Street East Mississauga ON L5H 1L4	ENE/91.9	0.98	176
60	GEN	Metrolinx	30 Queen Street East Mississauga ON L5H 1L4	ENE/91.9	0.98	177
60	GEN	Metrolinx	30 Queen Street East Mississauga ON L5G 3B7	ENE/91.9	0.98	177
60	GEN	Metrolinx Capital Projects Group	30 Queen St E Mississauga ON L5G 3B7	ENE/91.9	0.98	177
61	BORE		ON	WNW/94.0	0.00	177
62	BORE		ON	N/94.6	1.00	179
63	PES	VERSACE LAWN CARE	66 HIGH STREET EAST, #202 MISSISSAUGA ON L5G 1K2	ESE/95.0	1.00	180
63	PES	VERSACE LAWN CARE	66 HIGH STREET EAST, #202 MISSISSAUGA ON L5G1K2	ESE/95.0	1.00	180
63	PES	VERSACE LAWN CARE	66 HIGH STREET EAST, #202 MISSISSAUGA ON L5G1K2	ESE/95.0	1.00	181
64	BORE		ON	W/95.2	0.38	181

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
65	BORE		ON	ENE/95.5	1.00	183
66	WWIS		ON Well ID: 7388334	WNW/96.1	0.25	184
67	WWIS		ON Well ID: 7378960	N/97.7	1.00	185
68	WWIS		30 queen st e. Mississauga ON Well ID: 7355170	NNE/98.8	1.00	186
69	WWIS		HURONTARIO/ GO TRANSIT TRACKS ETOBICOKE ON Well ID: 7321771	NE/99.9	1.00	189
70	BORE		ON	WSW/100.0	0.96	192
71	BORE		ON	N/103.6	1.00	193
72	WWIS		ON Well ID: 7378961	N/103.7	1.00	194
73	EHS		HuLRT WZ1 WWIS Mississauga ON	N/103.7	1.00	194
73	EHS		HuLRT WZ1 WWIS Mississauga ON	N/103.7	1.00	195
74	WWIS		30 Queen St. East Mississauga ON Well ID: 7363633	ENE/105.1	1.00	195
75	EHS		91 Park St E Mississauga ON L5G4W1	E/105.4	1.00	198
76	EHS		91 Park St E Mississauga ON L5G4W1	E/105.7	1.00	198

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
77	EHS		Ann Street and High Street East Mississauga ON L5G	E/106.2	1.00	199
78	BORE		ON	WSW/107.1	0.63	199
79	EHS		23 Elizabeth Street North Mississauga ON L5G 2Z4	SW/107.6	0.00	200
79	EHS		23 Elizabeth Street North Mississauga ON L5G 2Z4	SW/107.6	0.00	200
80	EHS		High St. E., Ann St. Mississauga ON L5G	E/107.8	1.00	200
80	EHS		High St. E., Ann St. Mississauga ON L5G	E/107.8	1.00	200
81	WWIS		PORT CREDIT GO STATION PORT CREDIT ON Well ID: 7321814	WSW/108.0	0.00	201
82	BORE		ON	WSW/108.8	0.00	204
83	BORE		ON	E/110.0	1.00	205
84	BORE		ON	W/111.3	0.00	207
85	WWIS		ON Well ID: 7370471	SSW/112.3	0.19	208
86	WWIS		30 Queen St East Mississauga ON Well ID: 7363630	NE/114.0	1.00	209
87	EHS		28 Elizabeth St N Mississauga ON L5G 2Z6	SW/114.9	0.00	212

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
87	EHS		28 Elizabeth St N Mississauga ON L5G 2Z6	SW/114.9	0.00	212
88	BORE		ON	SW/115.3	0.00	212
89	BORE		ON	S/116.1	1.02	214
90	BORE		ON	ENE/117.6	1.00	215
91	BORE		ON	ESE/118.7	1.00	217
92	WWIS		PORT CREDIT GO STATION PORT CREDIT ON Well ID: 7321812	NE/120.4	1.00	218
93	BORE		ON	SSW/121.5	0.56	222
94	EHS		84 & 90 High Street East Mississauga ON L5G 1K4	E/123.5	1.00	223
95	EHS		12 Helene St N Mississauga ON L5G	SE/123.6	1.00	224
96	WWIS		GO STATION PARKING LOT (SOUTH SIDE) PORT CREDIT ON Well ID: 7321811	NE/126.2	1.00	224
97	WWIS		46 ORIOLE AVE Mississauga ON Well ID: 7290488	NNE/127.0	1.00	227
98	BORE		ON	NE/127.2	1.00	231
99	WWIS		1175 Hurontario St ON	NE/129.4	1.00	232

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
			Well ID: 7371903			
100	WWIS		1175 Hurontario St ON	NE/129.5	1.00	235
			Well ID: 7371901			
101	BORE		ON	SE/129.8	1.00	238
102	WWIS		ON	NE/130.1	1.00	240
			Well ID: 7378959			
103	BORE		ON	SE/130.3	1.00	240
104	WWIS		1155 VESTA DRIVE PORT CREDIT ON	WNW/130.4	1.07	242
			Well ID: 7306886			
105	WWIS		30 QUEEN ST E Mississauga ON	NNE/130.5	1.00	246
			Well ID: 7290480			
106	GEN	Mobilinx Hurontario General Partnership	515 Oriole Avenue Unit 12 Mississauga ON L5G 1V3	NNW/131.1	1.00	249
107	PINC		90 High Street East, Mississauga ON	E/131.4	1.00	250
108	WWIS		72 QUEEN STREET PORT CREDIT ON	NE/132.4	1.00	250
			Well ID: 7306887			
109	SPL	FRAM GROUP (CANADA) INC	Ann and High St Mississauga ON	ESE/132.7	1.00	253
110	WWIS		GO STATION PARKING LOT PORT CREDIT ON	N/133.4	1.00	254
			Well ID: 7307828			
111	WWIS		30 QUEEN ST E Mississauga ON	NE/134.5	1.00	257
			Well ID: 7290487			
112	SPL	Regional Municipality of Peel	Elizabeth St. and Park St. Mississauga ON	SSW/136.5	1.00	260

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
113	EHS		28 Elizabeth Street North Mississauga ON L5G 2Z6	SW/139.5	0.05	261
113	SPL	Compten Management Inc.	28 Elizabeth Street North Mississauga ON	SW/139.5	0.05	261
114	BORE		ON	S/140.6	1.00	262
115	WWIS		NORTH OF TRACKS NEAR ORICLE AVE Mississauga ON Well ID: 7290469	NNE/141.5	1.00	263
116	EHS		90 High St E Mississauga ON L5G1K4	E/142.5	1.00	267
117	WWIS		1175 Hurontario St ON Well ID: 7371902	N/143.4	1.00	267
118	WWIS		8 ANN ST ON Well ID: 7288429	ESE/144.1	1.00	270
119	BORE		ON	E/146.9	1.00	272
120	RSC	Home Alone Property Management Services Limited	10 ANN ST, MISSISSAUGA, ON, L5G 3E6 ON L5G 3E6	ESE/147.1	1.00	274
120	RSC	F.S. 6810 DEVELOPMENT INC.	10 ANN STREET, MISSISSAUGA, ON L5G 2E6 Mississauga ON	ESE/147.1	1.00	274
121	WWIS		ON Well ID: 7378963	N/147.7	1.00	275
122	BORE		ON	N/147.7	1.00	276
123	BORE		ON	SE/148.7	1.00	277

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
124	CA		High Street, Park Street East & Hurontario Street Mississauga ON	E/149.3	1.00	279
125	SPL	PRIVATE RESIDENCE	40 ORIOLE AVE. FURNACE OIL TANK MISSISSAUGA CITY ON L5G 1V2	NW/149.6	1.60	279
126	BORE		ON	ENE/149.7	1.00	279
127	SPL	FRAM GROUP (CANADA) INC	69 High St. E Mississauga ON	ESE/149.9	1.00	281
128	BORE		ON	WSW/150.6	-1.04	281
129	BORE		ON	ENE/152.4	1.00	282
130	WWIS		ON Well ID: 7267968	ESE/154.8	1.00	283
131	BORE		ON	NNE/155.6	1.00	284
132	BORE		ON	NE/156.2	1.00	286
133	BORE		ON	N/156.5	1.00	287
134	WWIS		ON Well ID: 7378965	N/156.8	1.00	289
135	CA	R.M. OF PEEL	QUEEN ST.E/HURONTARIO ST. MISSISSAUGA CITY ON	NE/157.6	1.00	290
135	CA	R.M. OF PEEL	QUEEN ST.E/HURONTARIO ST. MISSISSAUGA CITY ON	NE/157.6	1.00	290

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
136	BORE		ON	NE/157.9	1.00	290
137	BORE		ON	NE/158.1	1.00	291
138	BORE		ON	E/158.2	1.00	292
139	BORE		ON	WSW/159.1	-0.67	293
140	EHS		50 High Street Mississauga ON	SSE/160.1	1.00	294
141	BORE		ON	NNE/160.2	1.00	294
142	BORE		ON	SE/160.3	1.00	296
143	BORE		ON	S/161.1	1.00	297
144	BORE		ON	NE/161.9	1.00	299
145	PINC	PIPELINE HIT - 2"	8 ANN ST,,MISSISSAUGA,ON,L5G 3E6, CA ON	ESE/162.2	1.00	300
146	RSC	Scott Insley	8 ANN ST, MISSISSAUGA, ON, L5G 3E6 ON L5G 3E6	ESE/162.2	1.00	300
146	SPL	Enbridge Gas Distribution Inc.	8 Ann St. Mississauga Mississauga ON	ESE/162.2	1.00	301
147	ECA	Queenscorp (Mona) Inc.	1130 Mona Rd 1136 & 1138 Mona Road Mississauga ON M8Z 1L8	W/163.2	0.28	301

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
<u>148</u>	BORE		ON	E/166.4	1.00	<u>302</u>
<u>149</u>	SPL	PUC	7 HELENE ST. PORT CREDIT MISSISSAUGA CITY ON	SE/167.0	1.00	<u>303</u>
<u>150</u>	WWIS		15 HURNOTARIP STREET MISSISSAUGA ON <i>Well ID: 7104773</i>	E/168.1	1.00	<u>303</u>
<u>151</u>	BORE		ON	SSW/168.3	1.00	<u>305</u>
<u>152</u>	BORE		ON	NNE/168.9	1.00	<u>307</u>
<u>153</u>	EHS		8 Ann St, 6 Ann St, 10 Ann St. Mississauga ON	ESE/169.4	1.00	<u>308</u>
<u>154</u>	BORE		ON	NE/171.6	1.00	<u>308</u>
<u>155</u>	EHS		20 Elizabeth Street North Mississauga ON L5G 2Z1	S/172.3	1.00	<u>310</u>
<u>156</u>	BORE		ON	NNE/174.2	1.00	<u>310</u>
<u>157</u>	BORE		ON	SE/175.4	1.00	<u>312</u>
<u>158</u>	RSC	Scott Insley	6 ANN ST, MISSISSAUGA, ON, L5G 3E6, ON L5G 3E6	ESE/177.0	1.00	<u>313</u>
<u>159</u>	BORE		ON	ESE/181.6	1.00	<u>313</u>
<u>160</u>	BORE		ON	NNE/182.0	1.00	<u>315</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
161	BORE		ON	N/182.7	1.00	316
162	WWIS		PORT CREDIT GO STATION PORT CREDIT ON <i>Well ID:</i> 7310440	NNE/182.9	1.00	318
163	BORE		ON	NNE/184.5	1.00	321
164	BORE		ON	S/185.9	1.00	323
165	SPL	Enbridge Gas Distribution Inc.	26 Park Street Mississauga ON	SW/186.2	1.00	325
165	PINC	ENBRIDGE GAS INC	26 PARK ST E,,MISSISSAUGA,ON,L5G 1L6,CA ON	SW/186.2	1.00	325
165	EHS		26 Park Street East Mississauga ON L5G 1L6	SW/186.2	1.00	326
165	EHS		26 Park Street East Mississauga ON L5G 1L6	SW/186.2	1.00	326
166	BORE		ON	NNE/188.0	1.00	326
167	BORE		ON	SSE/190.3	1.00	327
168	WWIS		ON <i>Well ID:</i> 7388364	NNE/191.1	1.00	329
169	WWIS		ON <i>Well ID:</i> 7389869	WSW/192.2	0.20	329
170	SPL	OSHAWA FOODS	25 HURONTARIO STREET RETAIL STORE	E/194.4	1.00	330

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
			MISSISSAUGA CITY ON			
171	BORE		ON	N/196.8	1.00	331
172	SCT	EXCALIBUR INT'L CONSULTANTS	10 Hurontario St Mississauga ON L5G 3G7	E/198.4	1.00	332
172	SCT	Excalibur International Consultants Ltd.	10 Hurontario St Mississauga ON L5G 3G7	E/198.4	1.00	332
173	BORE		ON	SSW/198.4	1.00	332
174	WWIS		29 PARK ST. EAST MISSISSAUGA ON Well ID: 7296575	S/199.5	1.00	334
175	WWIS		1175 Hurontario St ON Well ID: 7380069	N/202.9	1.00	338
176	BORE		ON	N/204.0	1.27	341
177	GEN	Enersource Hydro Mississauga	5 Ann Street Mississauga ON L5G 3E8	ESE/207.5	1.00	342
178	BORE		ON	ESE/209.5	1.00	342
179	GEN	SKINNER & MIDDLEBROOK LTD.	128 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E4	ESE/212.0	1.00	343
179	GEN	SKINNER & MIDDLEBROOK LTD. 44-252	128 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E4	ESE/212.0	1.00	344
179	GEN	SKINNER & MIDDLEBROOK LTD	128 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E4	ESE/212.0	1.00	344

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>179</u>	GEN	Skinner & Middlebrook Ltd.	128 Lakeshore Rd.E. Mississauga ON L5G 1E4	ESE/212.0	1.00	<u>344</u>
<u>179</u>	GEN	Skinner & Middlebrook Ltd.	128 Lakeshore Rd.E. Mississauga ON L5G 1E4	ESE/212.0	1.00	<u>344</u>
<u>179</u>	GEN	Skinner & Middlebrook Ltd.	128 Lakeshore Rd.E. Mississauga ON L5G 1E4	ESE/212.0	1.00	<u>345</u>
<u>179</u>	GEN	Skinner & Middlebrook Ltd.	128 Lakeshore Rd.E. Mississauga ON L5G 1E4	ESE/212.0	1.00	<u>345</u>
<u>179</u>	GEN	Skinner & Middlebrook Ltd	128 Lakeshore Rd.E. Mississauga ON L5G 1E4	ESE/212.0	1.00	<u>345</u>
<u>179</u>	GEN	Skinner & Middlebrook Ltd	128 Lakeshore Rd.E. Mississauga ON L5G 1E4	ESE/212.0	1.00	<u>346</u>
<u>179</u>	GEN	Skinner & Middlebrook Ltd	128 Lakeshore Rd.E. Mississauga ON L5G 1E4	ESE/212.0	1.00	<u>346</u>
<u>180</u>	EHS		128 Lakeshore Rd E Mississauga ON L5G 1E4	ESE/213.1	1.00	<u>346</u>
<u>181</u>	EHS		7 Elizabeth Street North Mississauga ON	SE/213.5	1.00	<u>346</u>
<u>182</u>	WWIS		29 PARK ST. EAST MISSISSAUGA ON <i>Well ID: 7296574</i>	SSW/214.5	1.00	<u>346</u>
<u>183</u>	EHS		128 Lakeshore Road East Mississauga ON L5G 1E4	ESE/214.6	1.00	<u>350</u>
<u>183</u>	EHS		128 Lakeshore Road East Mississauga ON L5G 1E4	ESE/214.6	1.00	<u>350</u>
<u>184</u>	EHS		7 Elizabeth Street North Mississauga ON L5G 2Y8	SE/215.2	1.00	<u>350</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
185	WWIS		ON Well ID: 7388363	NNE/215.5	1.27	350
186	WWIS		27 PARK ST E PORT CREDIT ON Well ID: 7278219	SSW/215.7	1.00	351
187	WWIS		ON Well ID: 7378964	NNW/218.9	1.65	355
188	BORE		ON	WSW/220.6	-0.49	356
189	BORE		ON	E/220.8	1.00	357
190	RSC	F.S. Port Credit Development Limited	15 HURONTARIO ST, MISSISSAUGA, ON, L5G 3G8 ON	E/221.2	1.00	358
191	BORE		ON	ENE/222.1	1.00	358
192	BORE		ON	ESE/222.4	1.00	360
193	EHS		27 Park St E Mississauga ON L5G1L7	SSW/223.5	1.00	361
194	SPL	UNKNOWN	114 LAKESHORE BLVD ST HELENE ST. MISSISSAUGA CITY ON	SE/223.5	1.00	361
194	PRT	V V GAS AND WASH	114 LAKESHORE RD PORT CREDIT MISSISSAUGA ON	SE/223.5	1.00	362
194	PRT	V V GAS AND WASH	114 LAKESHORE RD PORT CREDIT MISSISSAUGA ON	SE/223.5	1.00	362
194	GEN	PETRO CANADA INC.	114 LAKESHORE ROAD E PORT CREDIT ON L5G 1E4	SE/223.5	1.00	362

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
194	GEN	PETRO CANADA INC.	114 LAKESHORE RD., EAST MISSISSAUGA C/O 5140 YONGE ST. SUITE 200 NORTH YORK ON L5G 1E4	SE/223.5	1.00	362
194	GEN	PETRO CANADA INC. 30-570	114 LAKESHORE RD., EAST MISSISSAUGA C/O 5140 YONGE ST. SUITE 200 NORTH YORK ON L5G 1E4	SE/223.5	1.00	363
194	SCT	Dens-Tek Dental Studio Inc.	114 Lakeshore Rd E Unit 4 Mississauga ON L5G 1E4	SE/223.5	1.00	363
194	EHS		114 Lakeshore Road E Mississauga ON L5G 1E4	SE/223.5	1.00	363
194	DTNK	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON L5G 1E4	SE/223.5	1.00	364
194	DTNK	V V GAS AND WASH	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON	SE/223.5	1.00	364
194	DTNK	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON	SE/223.5	1.00	365
194	DTNK	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	SE/223.5	1.00	365
194	DTNK	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	SE/223.5	1.00	366
194	DTNK	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	SE/223.5	1.00	367
194	DTNK	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	SE/223.5	1.00	367
194	DTNK	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	SE/223.5	1.00	368

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
194	DTNK	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	SE/223.5	1.00	369
194	DTNK	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	SE/223.5	1.00	369
194	DTNK	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	SE/223.5	1.00	370
194	FST	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	SE/223.5	1.00	371
194	FST	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	SE/223.5	1.00	371
194	FST	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	SE/223.5	1.00	372
194	FST	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	SE/223.5	1.00	372
194	FST	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	SE/223.5	1.00	373
194	FST	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	SE/223.5	1.00	373
194	FST	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	SE/223.5	1.00	374
194	FST	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	SE/223.5	1.00	374
195	BORE		ON	N/223.7	2.00	375

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
196	BORE		ON	N/225.3	2.00	376
197	CA	F.S. Port Credit Development Limited	1 Hurontario St Mississauga ON L5G 0A3	E/225.5	1.00	377
197	PINC		1 Hurontario Street, Mississauga ON	E/225.5	1.00	378
197	ECA	F.S. Port Credit Development Limited	1 Hurontario St Mississauga ON L5G 1E8	E/225.5	1.00	378
197	GEN	Dolce Vita Medical Spa & Salon	1 Hurontario Street Unit 1 Mississauga ON L5G0A3	E/225.5	1.00	378
197	GEN	Dolce Vita Medical Spa & Salon	1 Hurontario Street Unit 1 Mississauga ON L5G0A3	E/225.5	1.00	379
197	GEN	Thermo Cool Mechanical	1 Hurontario Street Mississauga ON L5G 0A3	E/225.5	1.00	379
197	GEN	Thermo Cool Mechanical	1 Hurontario Street Mississauga ON L5G 0A3	E/225.5	1.00	379
197	GEN	Dolce Vita Medical Spa & Salon	1 Hurontario Street Unit 1 Mississauga ON L5G0A3	E/225.5	1.00	379
198	WWIS		GRASS AREA WEST END OF TROY ST Mississauga ON Well ID: 7310446	NNE/225.7	1.65	380
199	BORE		ON	SE/226.2	1.00	383
200	BORE		ON	S/230.9	1.00	384
201	BORE		ON	E/231.7	1.00	386

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
202	WWIS		150 LAKESHORE BLVD. EAST Mississauga ON Well ID: 7155591	E/232.7	1.00	387
203	WWIS		ON Well ID: 7388365	N/234.8	2.00	393
204	GEN	MISSISSAUGA HYDRO PCB	12 PARK ST. EAST C/O 3355 MAVIS RD. MISSISSAUGA ON L5G 1L5	SSW/234.9	1.00	394
204	GEN	MISSISSAUGA HYDRO PCB 00-000	12 PARK ST. EAST C/O 3355 MAVIS RD. MISSISSAUGA ON L5G 1L5	SSW/234.9	1.00	394
205	EHS		1142 Mona Road Mississauga ON	WSW/235.0	1.45	394
206	WWIS		GRASS AREA WEST ENF OF TROY ST Mississauga ON Well ID: 7310447	N/237.1	2.00	394
207	WWIS		21 PARK ST E PORT CREDIT ON Well ID: 7278218	SSW/237.5	1.00	397
207	EASR	EDENSHAW PARK DEVELOPMENTS LIMITED	21 Park ST E Mississauga ON L5G 1L7	SSW/237.5	1.00	401
207	WWIS		21 Park Street East Port Credit ON Well ID: 7330662	SSW/237.5	1.00	402
208	WWIS		21 PARK ST E PORT CREDIT ON Well ID: 7278220	SSW/238.8	1.00	404
208	WWIS		21 Park Street East Port Credit ON Well ID: 7330661	SSW/238.8	1.00	408
209	BORE		ON	WSW/239.3	-0.48	411
210	BORE		ON	SSE/239.9	1.00	412

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
211	WWIS		HURONTARIO ST Mississauga ON Well ID: 7284674	N/240.8	2.00	413
212	WWIS		21 Park Street East Port Credit ON Well ID: 7330663	SSW/241.5	1.00	416
213	BORE		ON	S/243.0	1.00	419
214	WWIS		ON Well ID: 7161795	E/243.2	1.00	420
215	WWIS		ORIOLE AVE Mississauga ON Well ID: 7286063	NNW/243.3	2.00	421
216	WWIS		32 TROY ST. MISSISSAUGA ON Well ID: 7308370	NNE/243.5	2.00	424
217	BORE		ON	SSE/243.9	1.00	427
218	WWIS		ON Well ID: 7296325	SSW/244.6	1.00	428
219	SCT	CASPIAN CUSTOM CANVAS INC.	106 LAKESHORE RD E SUITE 104 MISSISSAUGA ON L5G 1E3	SE/244.6	1.00	429
220	BORE		ON	ESE/244.6	0.82	430
221	SPL	Greenspoon Specialty Contracting Ltd.;	20 Rosewood Avenue construction site<UNOFFICIAL> Mississauga ON	ENE/247.5	1.00	431
221	INC		20 Rosewood Avenue, Mississauga ON	ENE/247.5	1.00	432
222	GEN	PHOTOLINE LABS LTD. 31-649	110 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E3	SE/248.3	1.00	433

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
222	GEN	PHOTOLINE LABS LTD.	110 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E3	SE/248.3	1.00	433

Executive Summary: Summary By Data Source

BORE - Borehole

A search of the BORE database, dated 1875-Jul 2018 has found that there are 93 BORE site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON	0.0	<u>3</u>
	ON	1.8	<u>6</u>
	ON	10.5	<u>10</u>
	ON	20.5	<u>13</u>
	ON	21.6	<u>14</u>
	ON	25.0	<u>17</u>
	ON	36.5	<u>22</u>
	ON	37.2	<u>23</u>
	ON	41.8	<u>25</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON	42.2	<u>26</u>
	ON	45.9	<u>28</u>
	ON	46.7	<u>30</u>
	ON	50.7	<u>33</u>
	ON	56.7	<u>38</u>
	ON	58.4	<u>39</u>
	ON	58.8	<u>40</u>
	ON	61.8	<u>42</u>
	ON	61.9	<u>43</u>
	ON	62.7	<u>44</u>
	ON	64.7	<u>46</u>
	ON	66.1	<u>47</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON	67.3	<u>49</u>
	ON	67.3	<u>50</u>
	ON	76.2	<u>53</u>
	ON	78.5	<u>54</u>
	ON	79.6	<u>55</u>
	ON	94.0	<u>61</u>
	ON	94.6	<u>62</u>
	ON	95.2	<u>64</u>
	ON	95.5	<u>65</u>
	ON	100.0	<u>70</u>
	ON	103.6	<u>71</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON	107.1	<u>78</u>
	ON	108.8	<u>82</u>
	ON	110.0	<u>83</u>
	ON	111.3	<u>84</u>
	ON	115.3	<u>88</u>
	ON	116.1	<u>89</u>
	ON	117.6	<u>90</u>
	ON	118.7	<u>91</u>
	ON	121.5	<u>93</u>
	ON	127.2	<u>98</u>
	ON	129.8	<u>101</u>
	ON	130.3	<u>103</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON	140.6	<u>114</u>
	ON	146.9	<u>119</u>
	ON	147.7	<u>122</u>
	ON	148.7	<u>123</u>
	ON	149.7	<u>126</u>
	ON	150.6	<u>128</u>
	ON	152.4	<u>129</u>
	ON	155.6	<u>131</u>
	ON	156.2	<u>132</u>
	ON	156.5	<u>133</u>
	ON	157.9	<u>136</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON	158.1	<u>137</u>
	ON	158.2	<u>138</u>
	ON	159.1	<u>139</u>
	ON	160.2	<u>141</u>
	ON	160.3	<u>142</u>
	ON	161.1	<u>143</u>
	ON	161.9	<u>144</u>
	ON	166.4	<u>148</u>
	ON	168.3	<u>151</u>
	ON	168.9	<u>152</u>
	ON	171.6	<u>154</u>
	ON	174.2	<u>156</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON	175.4	<u>157</u>
	ON	181.6	<u>159</u>
	ON	182.0	<u>160</u>
	ON	182.7	<u>161</u>
	ON	184.5	<u>163</u>
	ON	185.9	<u>164</u>
	ON	188.0	<u>166</u>
	ON	190.3	<u>167</u>
	ON	196.8	<u>171</u>
	ON	198.4	<u>173</u>
	ON	204.0	<u>176</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON	209.5	<u>178</u>
	ON	220.6	<u>188</u>
	ON	220.8	<u>189</u>
	ON	222.1	<u>191</u>
	ON	222.4	<u>192</u>
	ON	223.7	<u>195</u>
	ON	225.3	<u>196</u>
	ON	226.2	<u>199</u>
	ON	230.9	<u>200</u>
	ON	231.7	<u>201</u>
	ON	239.3	<u>209</u>
	ON	239.9	<u>210</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON	243.0	213
	ON	243.9	217
	ON	244.6	220

CA - Certificates of Approval

A search of the CA database, dated 1985-Oct 30, 2011* has found that there are 5 CA site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Kanco-55 Park Ltd.	55 Park St E Mississauga ON	90.6	58
	High Street, Park Street East & Hurontario Street Mississauga ON	149.3	124
R.M. OF PEEL	QUEEN ST.E/HURONTARIO ST. MISSISSAUGA CITY ON	157.6	135
R.M. OF PEEL	QUEEN ST.E/HURONTARIO ST. MISSISSAUGA CITY ON	157.6	135
F.S. Port Credit Development Limited	1 Hurontario St Mississauga ON L5G 0A3	225.5	197

CFOT - Commercial Fuel Oil Tanks

A search of the CFOT database, dated Feb 28, 2022 has found that there are 1 CFOT site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
BELL CANADA	80 HIGH ST E MISSISSAUGA L5G 1K2 ON CA ON	87.6	57

DTNK - Delisted Fuel Tanks

A search of the DTNK database, dated Feb 28, 2022 has found that there are 12 DTNK site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
BELL CANADA	80 HIGH ST E MISSISSAUGA L5G 1K2 ON CA ON	87.6	57
CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON L5G 1E4	223.5	194
V V GAS AND WASH	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON	223.5	194
CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON	223.5	194
CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	223.5	194
CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	223.5	194
CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	223.5	194
CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	223.5	194
CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	223.5	194

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	223.5	194
CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	223.5	194
CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	223.5	194

EASR - Environmental Activity and Sector Registry

A search of the EASR database, dated Oct 2011- Jul 31, 2022 has found that there are 2 EASR site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Salini Impregilo Civil Works Inc.	30 Queen ST E Mississauga ON L5R 4G7	46.6	29
EDENSHAW PARK DEVELOPMENTS LIMITED	21 Park ST E Mississauga ON L5G 1L7	237.5	207

ECA - Environmental Compliance Approval

A search of the ECA database, dated Oct 2011- Jul 31, 2022 has found that there are 3 ECA site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Kanco-55 Park Ltd.	55 Park St E Mississauga ON L4V 1R9	90.6	58
Queenscorp (Mona) Inc.	1130 Mona Rd 1136 & 1138 Mona Road Mississauga ON M8Z 1L8	163.2	147
F.S. Port Credit Development Limited	1 Hurontario St Mississauga ON L5G 1E8	225.5	197

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>

EHS - ERIS Historical Searches

A search of the EHS database, dated 1999-Jul 31, 2022 has found that there are 40 EHS site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	70 Park St E Mississauga ON L5G 1M5	0.0	<u>1</u>
	70 Park St E Mississauga ON L5G 1M5	0.0	<u>1</u>
	n/a Mississauga ON	0.0	<u>4</u>
	28 Helene St N Mississauga ON L5G 3B7	10.9	<u>11</u>
	24 Ann St Mississauga ON L5G 3G1	17.1	<u>12</u>
	Park St E and Hurontario St Mississauga ON	41.6	<u>24</u>
	28 Helene Street North Mississauga ON L5G 3B7	43.6	<u>27</u>
	80 High Street E Mississauga ON L5G 1K4	64.3	<u>45</u>
	Port Credit Mississauga ON	84.8	<u>56</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	Port Credit Mississauga ON	84.8	<u>56</u>
	55 Park Street East Mississauga ON L5G 1L9	90.6	<u>58</u>
	55 Park Street East Mississauga ON	90.6	<u>58</u>
	HuLRT WZ1 WWIS Mississauga ON	103.7	<u>73</u>
	HuLRT WZ1 WWIS Mississauga ON	103.7	<u>73</u>
	91 Park St E Mississauga ON L5G4W1	105.4	<u>75</u>
	91 Park St E Mississauga ON L5G4W1	105.7	<u>76</u>
	Ann Street and High Street East Mississauga ON L5G	106.2	<u>77</u>
	23 Elizabeth Street North Mississauga ON L5G 2Z4	107.6	<u>79</u>
	23 Elizabeth Street North Mississauga ON L5G 2Z4	107.6	<u>79</u>
	High St. E., Ann St. Mississauga ON L5G	107.8	<u>80</u>
	High St. E., Ann St. Mississauga ON L5G	107.8	<u>80</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	28 Elizabeth St N Mississauga ON L5G 2Z6	114.9	<u>87</u>
	28 Elizabeth St N Mississauga ON L5G 2Z6	114.9	<u>87</u>
	84 & 90 High Street East Mississauga ON L5G 1K4	123.5	<u>94</u>
	12 Helene St N Mississauga ON L5G	123.6	<u>95</u>
	28 Elizabeth Street North Mississauga ON L5G 2Z6	139.5	<u>113</u>
	90 High St E Mississauga ON L5G1K4	142.5	<u>116</u>
	50 High Street Mississauga ON	160.1	<u>140</u>
	8 Ann St, 6 Ann St, 10 Ann St. Mississauga ON	169.4	<u>153</u>
	20 Elizabeth Street North Mississauga ON L5G 2Z1	172.3	<u>155</u>
	26 Park Street East Mississauga ON L5G 1L6	186.2	<u>165</u>
	26 Park Street East Mississauga ON L5G 1L6	186.2	<u>165</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	128 Lakeshore Rd E Mississauga ON L5G 1E4	213.1	<u>180</u>
	7 Elizabeth Street North Mississauga ON	213.5	<u>181</u>
	128 Lakeshore Road East Mississauga ON L5G 1E4	214.6	<u>183</u>
	128 Lakeshore Road East Mississauga ON L5G 1E4	214.6	<u>183</u>
	7 Elizabeth Street North Mississauga ON L5G 2Y8	215.2	<u>184</u>
	27 Park St E Mississauga ON L5G1L7	223.5	<u>193</u>
	114 Lakeshore Road E Mississauga ON L5G 1E4	223.5	<u>194</u>
	1142 Mona Road Mississauga ON	235.0	<u>205</u>

FST - Fuel Storage Tank

A search of the FST database, dated Feb 28, 2022 has found that there are 8 FST site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	223.5	<u>194</u>
CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	223.5	<u>194</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	223.5	<u>194</u>
CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	223.5	<u>194</u>
CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	223.5	<u>194</u>
CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	223.5	<u>194</u>
CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	223.5	<u>194</u>
CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	223.5	<u>194</u>

GEN - Ontario Regulation 347 Waste Generators Summary

A search of the GEN database, dated 1986-Apr 30, 2022 has found that there are 41 GEN site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
IMH Pool VI-A LP	28 Helene St North Port Credit ON L5G 3B7	26.1	<u>18</u>
Metrolinx	30 Queen Street East Mississauga ON L5H 1L4	46.6	<u>29</u>
Metrolinx	30 Queen Street East Mississauga ON L5H 1L4	46.6	<u>29</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Mobilinx	30 Queen Street East Mississauga ON L5G 4N6	46.6	<u>29</u>
Metrolinx	30 Queen Street East Mississauga ON L5H 1L4	46.6	<u>29</u>
Bell	80 High St Port Credit ON L5G 1K4	87.6	<u>57</u>
Bell	80 High St Port Credit ON L5G 1K4	87.6	<u>57</u>
Bell	80 High St Mississauga ON L5G 1K2	87.6	<u>57</u>
Bell	80 High St Port Credit ON L5G 1K4	87.6	<u>57</u>
Bell	80 High St Mississauga ON L5G 1K2	87.6	<u>57</u>
Bell	80 High St Port Credit ON L5G 1K4	87.6	<u>57</u>
Metrolinx	30 Queen Street East Mississauga ON L5H 1L4	91.9	<u>60</u>
Metrolinx	30 Queen Street East Mississauga ON L5H 1L4	91.9	<u>60</u>
Metrolinx	30 Queen Street East Mississauga ON L5H 1L4	91.9	<u>60</u>
Metrolinx	30 Queen Street East Mississauga ON L5G 3B7	91.9	<u>60</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Metrolinx Capital Projects Group	30 Queen St E Mississauga ON L5G 3B7	91.9	<u>60</u>
Metrolinx	30 Queen Street East Mississauga ON L5H 1L4	91.9	<u>60</u>
Mobilinx Hurontario General Partnership	515 Oriole Avenue Unit 12 Mississauga ON L5G 1V3	131.1	<u>106</u>
Enersource Hydro Mississauga	5 Ann Street Mississauga ON L5G 3E8	207.5	<u>177</u>
SKINNER & MIDDLEBROOK LTD.	128 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E4	212.0	<u>179</u>
SKINNER & MIDDLEBROOK LTD. 44-252	128 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E4	212.0	<u>179</u>
SKINNER & MIDDLEBROOK LTD	128 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E4	212.0	<u>179</u>
Skinner & Middlebrook Ltd.	128 Lakeshore Rd.E. Mississauga ON L5G 1E4	212.0	<u>179</u>
Skinner & Middlebrook Ltd.	128 Lakeshore Rd.E. Mississauga ON L5G 1E4	212.0	<u>179</u>
Skinner & Middlebrook Ltd.	128 Lakeshore Rd.E. Mississauga ON L5G 1E4	212.0	<u>179</u>
Skinner & Middlebrook Ltd.	128 Lakeshore Rd.E. Mississauga ON L5G 1E4	212.0	<u>179</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Skinner & Middlebrook Ltd	128 Lakeshore Rd.E. Mississauga ON L5G 1E4	212.0	<u>179</u>
Skinner & Middlebrook Ltd	128 Lakeshore Rd.E. Mississauga ON L5G 1E4	212.0	<u>179</u>
Skinner & Middlebrook Ltd	128 Lakeshore Rd.E. Mississauga ON L5G 1E4	212.0	<u>179</u>
PETRO CANADA INC.	114 LAKESHORE ROAD E PORT CREDIT ON L5G 1E4	223.5	<u>194</u>
PETRO CANADA INC.	114 LAKESHORE RD., EAST MISSISSAUGA C/O 5140 YONGE ST. SUITE 200 NORTH YORK ON L5G 1E4	223.5	<u>194</u>
PETRO CANADA INC. 30-570	114 LAKESHORE RD., EAST MISSISSAUGA C/O 5140 YONGE ST. SUITE 200 NORTH YORK ON L5G 1E4	223.5	<u>194</u>
Dolce Vita Medical Spa & Salon	1 Hurontario Street Unit 1 Mississauga ON L5G0A3	225.5	<u>197</u>
Dolce Vita Medical Spa & Salon	1 Hurontario Street Unit 1 Mississauga ON L5G0A3	225.5	<u>197</u>
Thermo Cool Mechanical	1 Hurontario Street Mississauga ON L5G 0A3	225.5	<u>197</u>
Thermo Cool Mechanical	1 Hurontario Street Mississauga ON L5G 0A3	225.5	<u>197</u>
Dolce Vita Medical Spa & Salon	1 Hurontario Street Unit 1 Mississauga ON L5G0A3	225.5	<u>197</u>
MISSISSAUGA HYDRO PCB	12 PARK ST. EAST C/O 3355 MAVIS RD. MISSISSAUGA ON L5G 1L5	234.9	<u>204</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
MISSISSAUGA HYDRO PCB 00-000	12 PARK ST. EAST C/O 3355 MAVIS RD. MISSISSAUGA ON L5G 1L5	234.9	204
PHOTOLINE LABS LTD. 31-649	110 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E3	248.3	222
PHOTOLINE LABS LTD.	110 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E3	248.3	222

INC - Fuel Oil Spills and Leaks

A search of the INC database, dated Feb 28, 2022 has found that there are 4 INC site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	55 PARK STREET EAST, MISSISSAUGA ON	90.6	58
	55 PARK STREET EAST, MISSISSAUGA ON	90.6	58
	55 PARK STREET EAST, MISSISSAUGA ON	90.6	58
	20 Rosewood Avenue, Mississauga ON	247.5	221

PES - Pesticide Register

A search of the PES database, dated Oct 2011- Jul 31, 2022 has found that there are 3 PES site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
VERSACE LAWN CARE	66 HIGH STREET EAST, #202 MISSISSAUGA ON L5G 1K2	95.0	63

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
VERSACE LAWN CARE	66 HIGH STREET EAST, #202 MISSISSAUGA ON L5G1K2	95.0	63
VERSACE LAWN CARE	66 HIGH STREET EAST, #202 MISSISSAUGA ON L5G1K2	95.0	63

PINC - Pipeline Incidents

A search of the PINC database, dated Feb 28, 2021 has found that there are 4 PINC site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	90 High Street East, Mississauga ON	131.4	107
PIPELINE HIT - 2"	8 ANN ST.,MISSISSAUGA,ON,L5G 3E6,CA ON	162.2	145
ENBRIDGE GAS INC	26 PARK ST E,,MISSISSAUGA,ON,L5G 1L6, CA ON	186.2	165
	1 Hurontario Street, Mississauga ON	225.5	197

PRT - Private and Retail Fuel Storage Tanks

A search of the PRT database, dated 1989-1996* has found that there are 2 PRT site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
V V GAS AND WASH	114 LAKESHORE RD PORT CREDIT MISSISSAUGA ON	223.5	194
V V GAS AND WASH	114 LAKESHORE RD PORT CREDIT MISSISSAUGA ON	223.5	194

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>

PTTW - Permit to Take Water

A search of the PTTW database, dated 1994 - Jul 31, 2022 has found that there are 1 PTTW site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Salini Impregilo Civil Works Inc.	30 Queen Street East Mississauga, ON Canada ON	46.6	29

RSC - Record of Site Condition

A search of the RSC database, dated 1997-Sept 2001, Oct 2004-Jul 2022 has found that there are 5 RSC site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Home Alone Property Management Services Limited	10 ANN ST, MISSISSAUGA, ON, L5G 3E6 ON L5G 3E6	147.1	120
F.S. 6810 DEVELOPMENT INC.	10 ANN STREET, MISSISSAUGA, ON L5G 2E6 Mississauga ON	147.1	120
Scott Insley	8 ANN ST, MISSISSAUGA, ON, L5G 3E6 ON L5G 3E6	162.2	146
Scott Insley	6 ANN ST, MISSISSAUGA, ON, L5G 3E6, ON L5G 3E6	177.0	158
F.S. Port Credit Development Limited	15 HURONTARIO ST, MISSISSAUGA, ON, L5G 3G8 ON	221.2	190

SCT - Scott's Manufacturing Directory

A search of the SCT database, dated 1992-Mar 2011* has found that there are 5 SCT site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Richard's Fine Chocolates Inc.	25 Helene St N Mississauga ON L5G 3B6	0.0	<u>2</u>
EXCALIBUR INT'L CONSULTANTS	10 Hurontario St Mississauga ON L5G 3G7	198.4	<u>172</u>
Excalibur International Consultants Ltd.	10 Hurontario St Mississauga ON L5G 3G7	198.4	<u>172</u>
Dens-Tek Dental Studio Inc.	114 Lakeshore Rd E Unit 4 Mississauga ON L5G 1E4	223.5	<u>194</u>
CASPIAN CUSTOM CANVAS INC.	106 LAKESHORE RD E SUITE 104 MISSISSAUGA ON L5G 1E3	244.6	<u>219</u>

SPL - Ontario Spills

A search of the SPL database, dated 1988-Sep 2020; Dec 2020-Mar 2021 has found that there are 13 SPL site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	80 High Street East Mississauga ON	87.6	<u>57</u>
Bell Canada	80 High Street Mississauga ON	87.6	<u>57</u>
FRAM GROUP (CANADA) INC	Ann and High St Mississauga ON	132.7	<u>109</u>
Regional Municipality of Peel	Elizabeth St. and Park St. Mississauga ON	136.5	<u>112</u>
Compten Management Inc.	28 Elizabeth Street North Mississauga ON	139.5	<u>113</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
PRIVATE RESIDENCE	40 ORIOLE AVE. FURNACE OIL TANK MISSISSAUGA CITY ON L5G 1V2	149.6	<u>125</u>
FRAM GROUP (CANADA) INC	69 High St. E Mississauga ON	149.9	<u>127</u>
Enbridge Gas Distribution Inc.	8 Ann St. Mississauga Mississauga ON	162.2	<u>146</u>
PUC	7 HELENE ST. PORT CREDIT MISSISSAUGA CITY ON	167.0	<u>149</u>
Enbridge Gas Distribution Inc.	26 Park Street Mississauga ON	186.2	<u>165</u>
OSHAWA FOODS	25 HURONTARIO STREET RETAIL STORE MISSISSAUGA CITY ON	194.4	<u>170</u>
UNKNOWN	114 LAKESHORE BLVD ST HELENE ST. MISSISSAUGA CITY ON	223.5	<u>194</u>
Greenspoon Specialty Contracting Ltd.;	20 Rosewood Avenue construction site<UNOFFICIAL> Mississauga ON	247.5	<u>221</u>

WWIS - Water Well Information System

A search of the WWIS database, dated Jun 30 2022 has found that there are 72 WWIS site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	PORT CREDIT GO STATION PORT CREDIT ON	0.9	<u>5</u>
	Well ID: 7321813		

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	22 ANN ST. MISSISSAUGA ON <i>Well ID: 7341861</i>	6.6	<u>7</u>
	78 PARK ST. E MISSISSAUGA ON <i>Well ID: 7341887</i>	6.6	<u>8</u>
	ON <i>Well ID: 7380344</i>	7.3	<u>9</u>
	78 PARK ST. E MISSISSAUGA ON <i>Well ID: 7341823</i>	21.8	<u>15</u>
	ON <i>Well ID: 7390272</i>	23.9	<u>16</u>
	PORT CREDIT GO STATION PORT CREDIT ON <i>Well ID: 7243496</i>	33.7	<u>19</u>
	ON <i>Well ID: 7330113</i>	34.3	<u>20</u>
	26 ANN ST. MISSISSAUGA ON <i>Well ID: 7341844</i>	35.0	<u>21</u>
	26 ANN ST. MISSISSAUGA ON <i>Well ID: 7341883</i>	35.0	<u>21</u>
	30 Queen St E ON <i>Well ID: 7380055</i>	48.7	<u>31</u>
	30 Queen St E ON <i>Well ID: 7380056</i>	49.7	<u>32</u>
	GO STATION PARKING LOT PORT CREDIT ON	53.3	<u>34</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	Well ID: 7307873		
	30 Queen St East Mississauga ON	55.1	<u>35</u>
	Well ID: 7363632		
	port credit go station Mississauga ON	56.4	<u>36</u>
	Well ID: 7355171		
	PORT CREDIT GO STATION ETOBICOKE ON	56.6	<u>37</u>
	Well ID: 7321758		
	30 Queen St East Mississauga ON	59.7	<u>41</u>
	Well ID: 7363631		
	ON	66.1	<u>48</u>
	Well ID: 7378962		
	PORT CREDIT GO STATION PORT CREDIT ON	69.6	<u>51</u>
	Well ID: 7310439		
	PORT CREDIT GO STATION PORT CREDIT ON	71.7	<u>52</u>
	Well ID: 7321737		
	GO STATION PARKING LOT PORT CREDIT ON	90.8	<u>59</u>
	Well ID: 7307874		
	30 QUEEN ST E Mississauga ON	91.9	<u>60</u>
	Well ID: 7234471		
	ON	96.1	<u>66</u>
	Well ID: 7388334		
	ON	97.7	<u>67</u>
	Well ID: 7378960		


<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	30 queen st e. Mississauga ON <i>Well ID: 7355170</i>	98.8	<u>68</u>
	HURONTARIO/ GO TRANSIT TRACKS ETOBICOKE ON <i>Well ID: 7321771</i>	99.9	<u>69</u>
	ON <i>Well ID: 7378961</i>	103.7	<u>72</u>
	30 Queen St. East Mississauga ON <i>Well ID: 7363633</i>	105.1	<u>74</u>
	PORT CREDIT GO STATION PORT CREDIT ON <i>Well ID: 7321814</i>	108.0	<u>81</u>
	ON <i>Well ID: 7370471</i>	112.3	<u>85</u>
	30 Queen St East Mississauga ON <i>Well ID: 7363630</i>	114.0	<u>86</u>
	PORT CREDIT GO STATION PORT CREDIT ON <i>Well ID: 7321812</i>	120.4	<u>92</u>
	GO STATION PARKING LOT (SOUTH SIDE) PORT CREDIT ON <i>Well ID: 7321811</i>	126.2	<u>96</u>
	46 ORIOLE AVE Mississauga ON <i>Well ID: 7290488</i>	127.0	<u>97</u>
	1175 Hurontario St ON <i>Well ID: 7371903</i>	129.4	<u>99</u>
	1175 Hurontario St ON	129.5	<u>100</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	Well ID: 7371901		
	ON	130.1	102
	Well ID: 7378959		
	1155 VESTA DRIVE PORT CREDIT ON	130.4	104
	Well ID: 7306886		
	30 QUEEN ST E Mississauga ON	130.5	105
	Well ID: 7290480		
	72 QUEEN STREET PORT CREDIT ON	132.4	108
	Well ID: 7306887		
	GO STATION PARKING LOT PORT CREDIT ON	133.4	110
	Well ID: 7307828		
	30 QUEEN ST E Mississauga ON	134.5	111
	Well ID: 7290487		
	NORTH OF TRACKS NEAR ORICLE AVE Mississauga ON	141.5	115
	Well ID: 7290469		
	1175 Hurontario St ON	143.4	117
	Well ID: 7371902		
	8 ANN ST ON	144.1	118
	Well ID: 7288429		
	ON	147.7	121
	Well ID: 7378963		
	ON	154.8	130
	Well ID: 7267968		

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON <i>Well ID: 7378965</i>	156.8	<u>134</u>
	15 HURNOTARIP STREET MISSISSAUGA ON <i>Well ID: 7104773</i>	168.1	<u>150</u>
	PORT CREDIT GO STATION PORT CREDIT ON <i>Well ID: 7310440</i>	182.9	<u>162</u>
	ON <i>Well ID: 7388364</i>	191.1	<u>168</u>
	ON <i>Well ID: 7389869</i>	192.2	<u>169</u>
	29 PARK ST. EAST MISSISSAUGA ON <i>Well ID: 7296575</i>	199.5	<u>174</u>
	1175 Hurontario St ON <i>Well ID: 7380069</i>	202.9	<u>175</u>
	29 PARK ST. EAST MISSISSAUGA ON <i>Well ID: 7296574</i>	214.5	<u>182</u>
	ON <i>Well ID: 7388363</i>	215.5	<u>185</u>
	27 PARK ST E PORT CREDIT ON <i>Well ID: 7278219</i>	215.7	<u>186</u>
	ON <i>Well ID: 7378964</i>	218.9	<u>187</u>
	GRASS AREA WEST END OF TROY ST Mississauga ON	225.7	<u>198</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	Well ID: 7310446		
	150 LAKESHORE BLVD. EAST Mississauga ON	232.7	202
	Well ID: 7155591		
	ON	234.8	203
	Well ID: 7388365		
	GRASS AREA WEST ENF OF TROY ST Mississauga ON	237.1	206
	Well ID: 7310447		
	21 PARK ST E PORT CREDIT ON	237.5	207
	Well ID: 7278218		
	21 Park Street East Port Credit ON	237.5	207
	Well ID: 7330662		
	21 PARK ST E PORT CREDIT ON	238.8	208
	Well ID: 7278220		
	21 Park Street East Port Credit ON	238.8	208
	Well ID: 7330661		
	HURONTARIO ST Mississauga ON	240.8	211
	Well ID: 7284674		
	21 Park Street East Port Credit ON	241.5	212
	Well ID: 7330663		
	ON	243.2	214
	Well ID: 7161795		
	ORIOLE AVE Mississauga ON	243.3	215
	Well ID: 7286063		

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	32 TROY ST. MISSISSAUGA ON <i>Well ID:</i> 7308370	243.5	<u>216</u>
	ON <i>Well ID:</i> 7296325	244.6	<u>218</u>

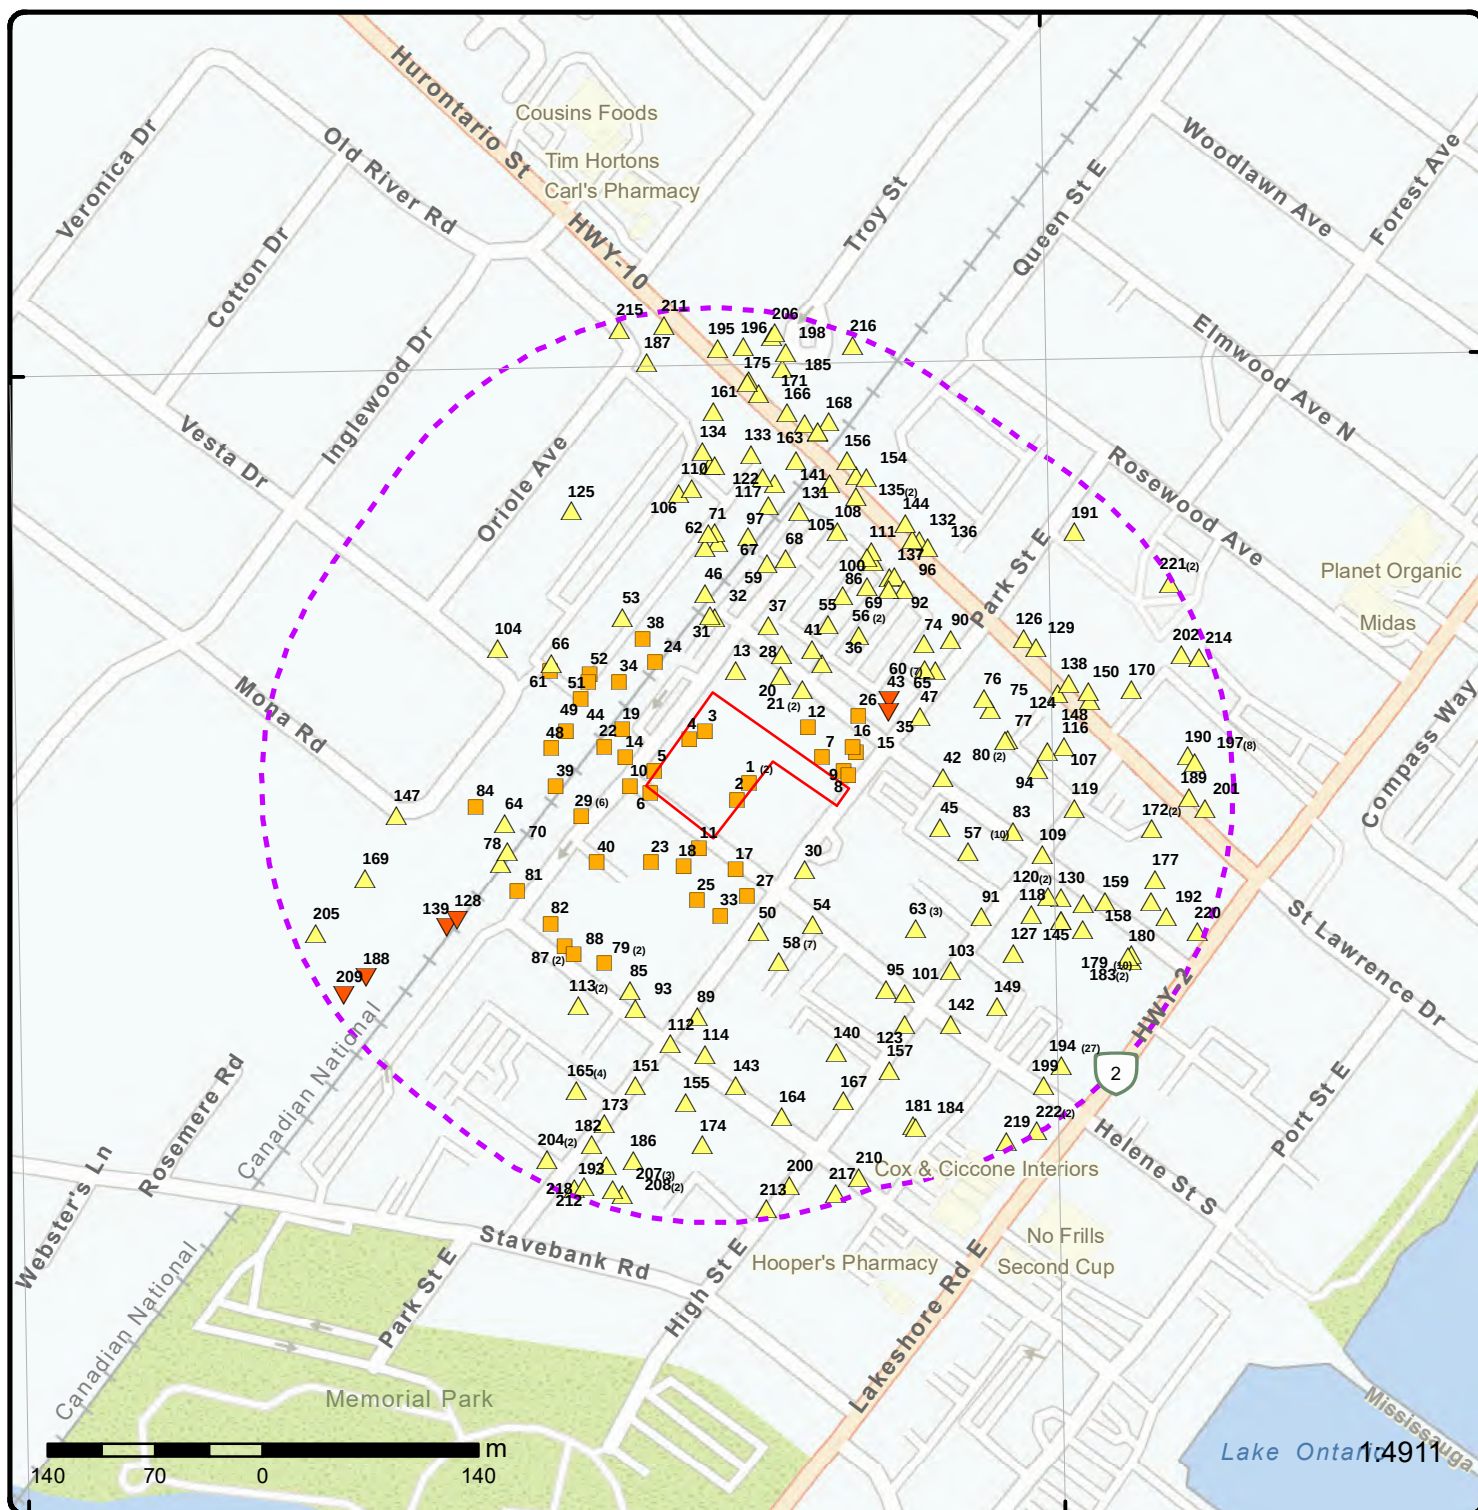

Map: 0.25 Kilometer Radius

Order Number: 22091501030

Address: 23 Helene St N, Mississauga, ON



Project Property	Freeways; Highways	Beach	Shopping & Sports Area
Buffer Outline	Traffic Circle; Ramp	Airport	University/College
Eris Sites with Higher Elevation	Major Arterial; Minor Arterial	Industrial Area	Cemetery; Golf Course
Eris Sites with Same Elevation	Local Road	Military Base	Parkt (National)
Eris Sites with Lower Elevation	Service Road; Traffic Circle; Ramp	Aircraft Roads	Park (City/County)
Eris Sites with Unknown Elevation	Rail	Native Reservation	
		Hospital	



Aerial Year: 2021

Order Number: 22091501030

Address: 23 Helene St N, Mississauga, ON



Source: ESRI World Imagery

© ERIS Information Limited Partnership

79°36'W


79°34'30"W

43°34'30"N

43°34'30"N

43°33'N

43°33'N

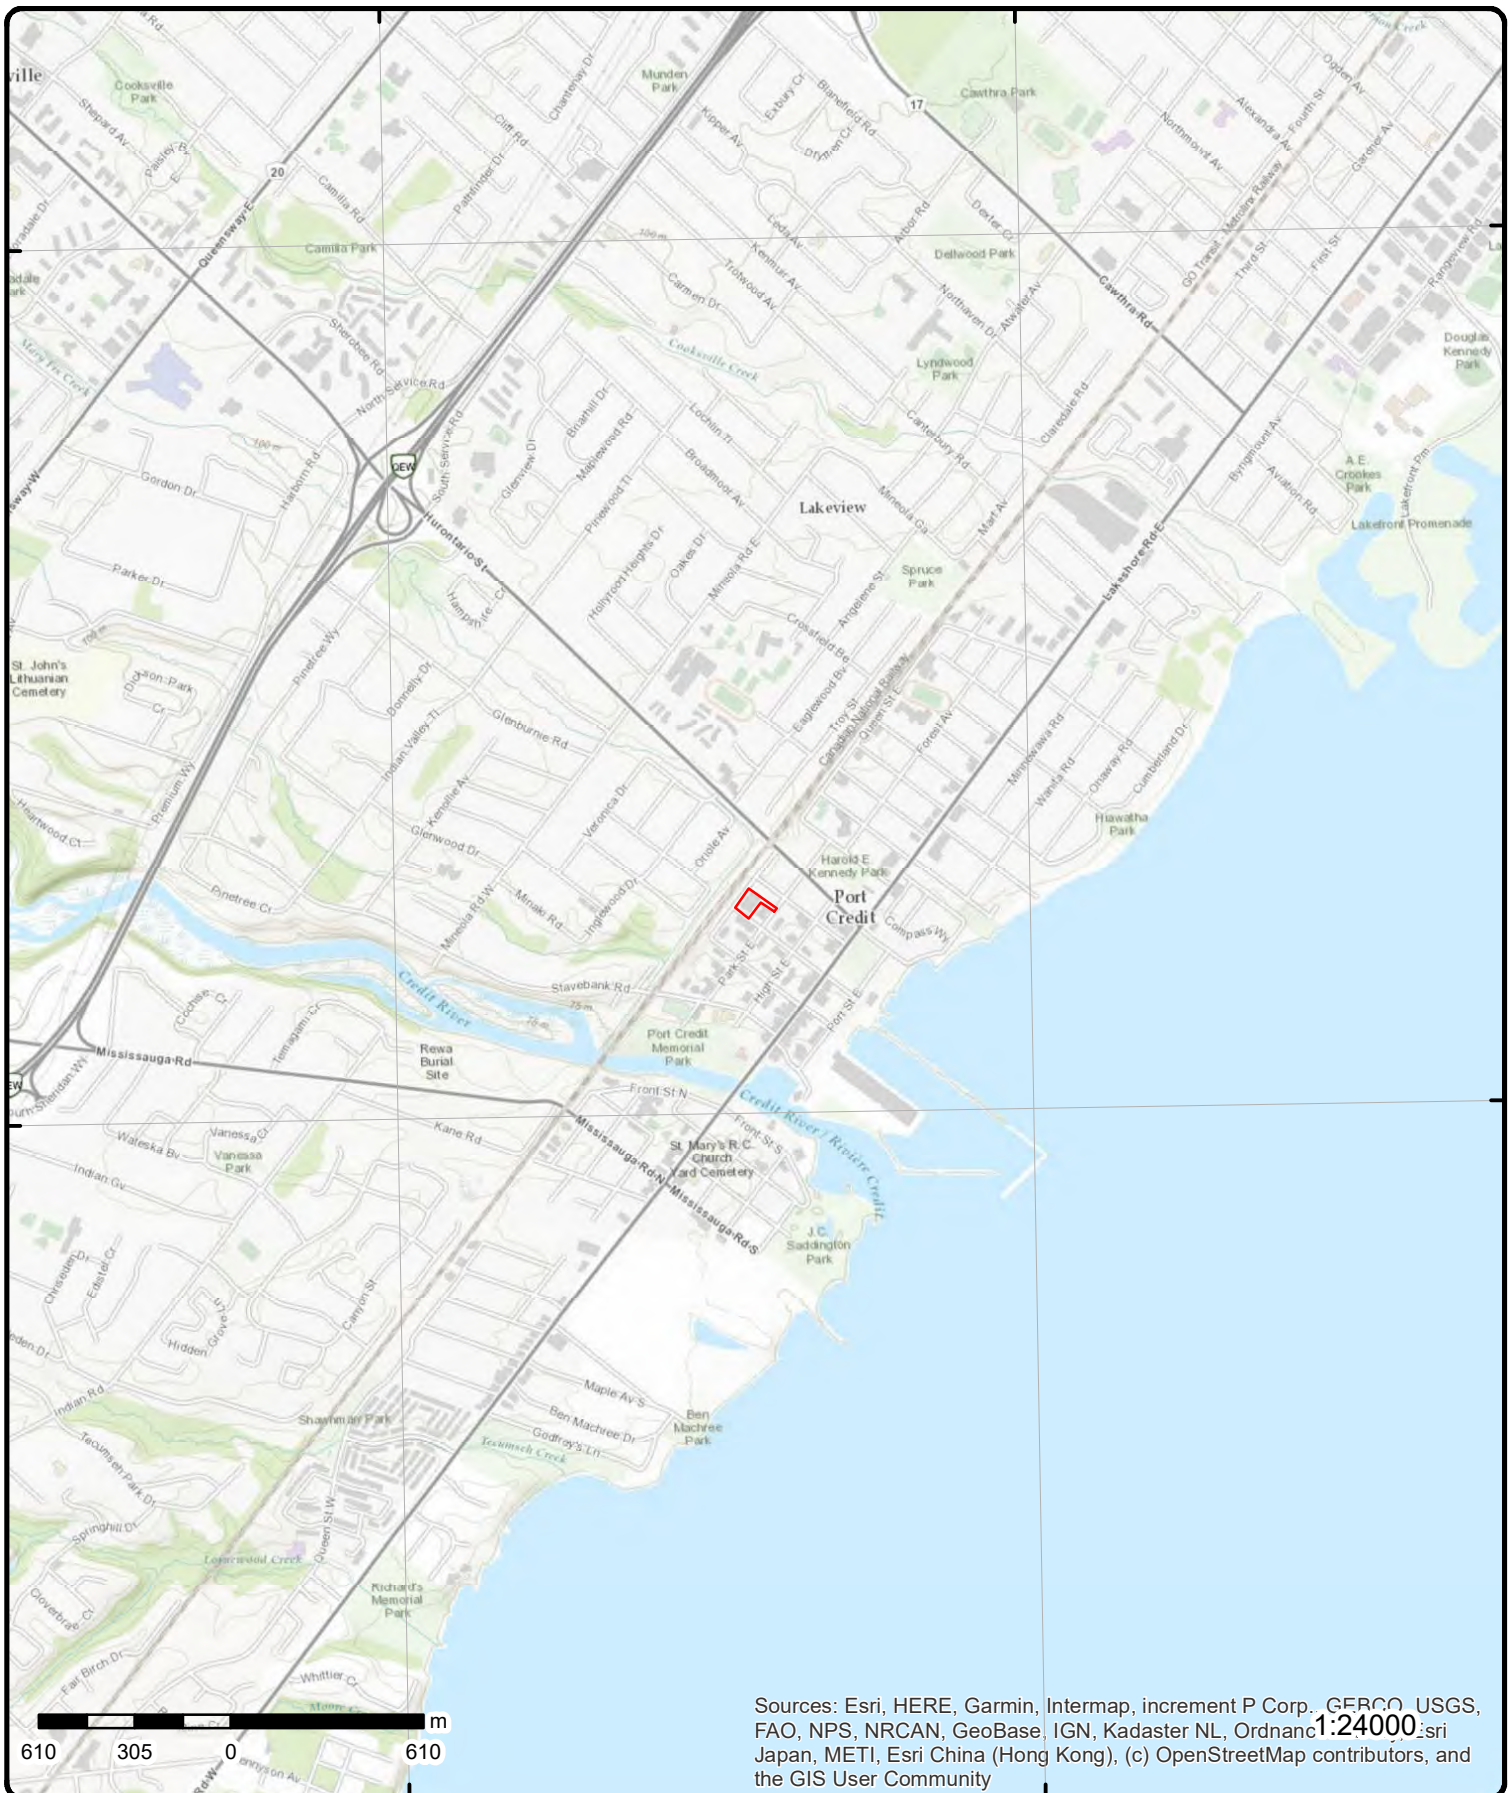

Topographic Map

Address: 23 Helene St N, ON

Source: ESRI World Topographic Map

Order Number: 22091501030



© ERIS Information Limited Partnership

Detail Report

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
1	1 of 2	ESE/0.0	78.8 / 0.00	70 Park St E Mississauga ON L5G 1M5	EHS
Order No: 22030800679 Status: C Report Type: Custom Report Report Date: 11-MAR-22 Date Received: 08-MAR-22 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.58582111 Y: 43.55588489			
1	2 of 2	ESE/0.0	78.8 / 0.00	70 Park St E Mississauga ON L5G 1M5	EHS
Order No: 22030800679 Status: C Report Type: Custom Report Report Date: 11-MAR-22 Date Received: 08-MAR-22 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.58582111 Y: 43.55588489			
2	1 of 1	SSE/0.0	78.8 / 0.00	Richard's Fine Chocolates Inc. 25 Helene St N Mississauga ON L5G 3B6	SCT
Established: 8/1/1996 Plant Size (ft²): Employment:					
--Details-- Description: Confectionery Manufacturing from Purchased Chocolate SIC/NAICS Code: 311330					
3	1 of 1	NW/0.0	78.8 / 0.00	ON	BORE
Borehole ID: 640916 OGF ID: 215541311 Status: Type: Borehole Use: Geotechnical/Geological Investigation Completion Date: JAN-1965 Static Water Level: Primary Water Use: Not Used Sec. Water Use: Total Depth m: 1.2 Depth Ref: Ground Surface		Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD: 43.556191 Longitude DD: -79.586171 UTM Zone: 17			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth Elev:				Easting:	614195
Drill Method:			Power auger	Northing:	4823553
Orig Ground Elev m:			82.9	Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:			82.5		
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:			218494061	Mat Consistency:	
Top Depth:			.3	Material Moisture:	
Bottom Depth:			1.2	Material Texture:	Medium
Material Color:				Non Geo Mat Type:	
Material 1:			Sand	Geologic Formation:	
Material 2:			Silt	Geologic Group:	
Material 3:			Clay	Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:			SAND-MEDIUM,SILT, CLAY. ALLUVIAL,AGE POST-GLACIAL. T,CLAY.		
Geology Stratum ID:			218494060	Mat Consistency:	
Top Depth:			0	Material Moisture:	
Bottom Depth:			.3	Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:			Fill	Geologic Formation:	
Material 2:			Sand	Geologic Group:	
Material 3:			Silt	Geologic Period:	
Material 4:			Gravel	Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:			FILL,SAND,SILT, GRAVEL.		
Geology Stratum ID:			218494059	Mat Consistency:	
Top Depth:			0	Material Moisture:	
Bottom Depth:			0	Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:			Asphalt	Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:			ASPHALT.		
<u>Source</u>					
Source Type:			Data Survey	Source Appl:	Spatial/Tabular
Source Orig:			Geological Survey of Canada	Source Iden:	1
Source Date:			1956-1972	Scale or Res:	Varies
Confidence:			M	Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:			Urban Geology Automated Information System (UGAIS)		
Source Details:			File: TOR1B.txt RecordID: 088820 NTS_Sheet: 30M12A		
Confiden 1:			Logs are approximately correct. Lack of information. Doubtful terminology.		
<u>Source List</u>					
Source Identifier:			1	Horizontal Datum:	NAD27
Source Type:			Data Survey	Vertical Datum:	Mean Average Sea Level
Source Date:			1956-1972	Projection Name:	Universal Transverse Mercator
Scale or Resolution:			Varies		
Source Name:			Urban Geology Automated Information System (UGAIS)		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Originators:		Geological Survey of Canada			
4	1 of 1	WNW/0.0	78.8 / 0.00	n/a Mississauga ON	EHS
Order No:		20180312162		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Custom Report		Client Prov/State: ON	
Report Date:		04-APR-18		Search Radius (km): .25	
Date Received:		12-MAR-18		X: -79.586293	
Previous Site Name:				Y: 43.556143	
Lot/Building Size:					
Additional Info Ordered:		Fire Insur. Maps and/or Site Plans; City Directory; Aerial Photos			
5	1 of 1	W/0.9	78.8 / 0.00	PORT CREDIT GO STATION PORT CREDIT ON	WWIS
Well ID:		7321813		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring		Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:		Observation Wells		Date Received: 07-Nov-2018 00:00:00	
Water Type:				Selected Flag: TRUE	
Casing Material:				Abandonment Rec:	
Audit No:		Z266905		Contractor: 6607	
Tag:		A232825		Form Version: 7	
Constructn Method:				Owner:	
Elevation (m):				County: PEEL	
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY (PORT CREDIT)			
Site Info:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2018/01/18			
Year Completed:		2018			
Depth (m):		15.2			
Latitude:		43.5559635526998			
Longitude:		-79.5865799874411			
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:		1007307137		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				East83: 614162.00	
Code OB Desc:				North83: 4823527.00	
Open Hole:				Org CS: UTM83	
Cluster Kind:				UTMRC: 4	
Date Completed:		18-Jan-2018 00:00:00		UTMRC Desc: margin of error : 30 m - 100 m	
Remarks:				Location Method: wwr	
Loc Method Desc:		on Water Well Record			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007605511			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		6.0			
Formation End Depth:		9.100000381469727			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007605512			
Layer:		4			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:		26			
Mat2 Desc:		ROCK			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		9.100000381469727			
Formation End Depth:		15.199999809265137			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007605510			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		1.5			
Formation End Depth:		6.0			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007605509			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		1.5			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007605520			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007605521			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		11.800000190734863			
Plug Depth UOM:		m			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1007605519			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007605508			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007605516			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		12.100000381469727			
Casing Diameter:		5.099999904632568			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007605517			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Slot:		10			
Screen Top Depth:		12.100000381469727			
Screen End Depth:		15.199999809265137			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.400000095367432			
 <u>Water Details</u>					
Water ID:		1007605515			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
 <u>Hole Diameter</u>					
Hole ID:		1007605514			
Diameter:		9.600000381469727			
Depth From:		9.100000381469727			
Depth To:		15.199999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Hole Diameter</u>					
Hole ID:		1007605513			
Diameter:		21.0			
Depth From:		0.0			
Depth To:		9.100000381469727			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Links</u>					
Bore Hole ID:	1007307137			Tag No:	A232825
Depth M:	15.2			Contractor:	6607
Year Completed:	2018			Path:	732\7321813.pdf
Well Completed Dt:	2018/01/18			Latitude:	43.5559635526998
Audit No:	Z266905			Longitude:	-79.5865799874411

<u>6</u>	1 of 1	WSW/1.8	78.8 / 0.00	ON	BORE
Borehole ID:	640917			Inclin FLG:	No
OGF ID:	215541312			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.555836
Total Depth m:	2.1			Longitude DD:	-79.586613
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614160
Drill Method:	Power auger			Northing:	4823513
Orig Ground Elev m:	82			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
DEM Ground Elev m: 81.9 Concession: Location D: Survey D: Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218494065			Mat Consistency:	
Top Depth:	.3			Material Moisture:	
Bottom Depth:	.9			Material Texture:	Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM,CLAY, SILT. BROWN,ALLUVIAL, AGE POST-GLACIAL.				
Geology Stratum ID:	218494064			Mat Consistency:	
Top Depth:	.2			Material Moisture:	
Bottom Depth:	.3			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND,SILT,CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL.				
Geology Stratum ID:	218494066			Mat Consistency:	
Top Depth:	.9			Material Moisture:	
Bottom Depth:	1.5			Material Texture:	Medium
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM,SILT, CLAY. ALLUVIAL,AGE POST-GLACIAL.				
Geology Stratum ID:	218494062			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ASPHALT.				
Geology Stratum ID:	218494063			Mat Consistency:	
Top Depth:	.1			Material Moisture:	
Bottom Depth:	.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:	Sand			Geologic Period:	
Material 4:	Silt			Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL,GRAVEL,SAND, SILT.				
Geology Stratum ID:	218494067			Mat Consistency:	
Top Depth:	1.5			Material Moisture:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bottom Depth: 2.1 Material Color: Material 1: Sand Material 2: Silt Material 3: Clay Material 4: Gsc Material Description: Stratum Description: SAND,SILT,CLAY. ALLUVIAL,AGE POST-GLACIAL.					
Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen: alluvial					
Source					
Source Type: Data Survey Source Orig: Geological Survey of Canada Source Date: 1956-1972 Confidence: M Observatio: Source Name: Urban Geology Automated Information System (UGAIS) Source Details: File: TOR1B.txt RecordID: 088830 NTS_Sheet: 30M12A Confiden 1: Logs are approximately correct. Lack of information. Doubtful terminology.					
Source Appl: Spatial/Tabular Source Iden: 1 Scale or Res: Varies Horizontal: NAD27 Verticalda: Mean Average Sea Level					
Source List					
Source Identifier: 1 Source Type: Data Survey Source Date: 1956-1972 Scale or Resolution: Varies Source Name: Urban Geology Automated Information System (UGAIS) Source Originators: Geological Survey of Canada					
Horizontal Datum: NAD27 Vertical Datum: Mean Average Sea Level Projection Name: Universal Transverse Mercator					
7	1 of 1	E/6.6	78.8 / 0.00	22 ANN ST. MISSISSAUGA ON	WWIS
Well ID: 7341861 Construction Date: Use 1st: Monitoring Use 2nd: Final Well Status: Observation Wells Water Type: Casing Material: Audit No: LBX2P5WQ Tag: A264691 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: MISSISSAUGA CITY (PORT CREDIT) Site Info: MW 19-3					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 16-Sep-2019 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 6607 Form Version: 9 Owner: County: PEEL Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/734\7341861.pdf					
Additional Detail(s) (Map)					
Well Completed Date: 2019/08/22 Year Completed: 2019 Depth (m): 8.2296 Latitude: 43.556027876375 Longitude: -79.5852289863524					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Path:		734\7341861.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	1007643258			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614271.00
Code OB Desc:				North83:	4823536.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	22-Aug-2019 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007643895				
Layer:	2				
Color:	2				
General Color:	GREY				
Mat1:	34				
Most Common Material:	TILL				
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:	15.0				
Formation End Depth:	27.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007643894				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	34				
Most Common Material:	TILL				
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:	15.0				
Formation End Depth UOM:	ft				
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1007644464				
Layer:	1				
Plug From:	0.0				
Plug To:	1.0				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007644465			
Layer:		2			
Plug From:		1.0			
Plug To:		16.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007644310			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007643598			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007643462			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007644028			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		17.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007644108			
Layer:		1			
Slot:		10			
Screen Top Depth:		17.0			
Screen End Depth:		27.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.5			
<u>Results of Well Yield Testing</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pumping Test Method Desc:					
Pump Test ID:	1007643463				
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:	ft				
Rate UOM:	GPM				
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:	1007644210				
Diameter:	8.0				
Depth From:	0.0				
Depth To:	27.0				
Hole Depth UOM:	ft				
Hole Diameter UOM:	inch				
<u>Links</u>					
Bore Hole ID:	1007643258			Tag No:	A264691
Depth M:	8.2296			Contractor:	6607
Year Completed:	2019			Path:	734\7341861.pdf
Well Completed Dt:	2019/08/22			Latitude:	43.556027876375
Audit No:	LBX2P5WQ			Longitude:	-79.5852289863524
8	1 of 1	E/6.6	78.8 / 0.00	78 PARK ST. E MISSISSAUGA ON	WWIS
Well ID:	7341887			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	16-Sep-2019 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	WBYVTTLTD			Contractor:	6607
Tag:	A264678			Form Version:	9
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:	MW 19-1				
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/734\7341887.pdf				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2019/08/14			
Year Completed:		2019			
Depth (m):		26.5176			
Latitude:		43.5559172544505			
Longitude:		-79.5850211032385			
Path:		734\7341887.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	1007643336			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614288.00
Code OB Desc:				North83:	4823524.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	14-Aug-2019 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007643964				
Layer:	3				
Color:	2				
General Color:	GREY				
Mat1:	17				
Most Common Material:	SHALE				
Mat2:	15				
Mat2 Desc:	LIMESTONE				
Mat3:					
Mat3 Desc:					
Formation Top Depth:	27.0				
Formation End Depth:	87.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007643962				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	34				
Most Common Material:	TILL				
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:	15.0				
Formation End Depth UOM:	ft				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007643963			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		34			
Most Common Material:		TILL			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		15.0			
Formation End Depth:		27.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007644523			
Layer:		2			
Plug From:		1.0			
Plug To:		82.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007644336			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007644522			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007643635			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007643636			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pipe ID:		1007643514			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007644053			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		82.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007644133			
Layer:		1			
Slot:		10			
Screen Top Depth:		82.0			
Screen End Depth:		87.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.5			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007643515			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007644247			
Diameter:		8.0			
Depth From:		0.0			
Depth To:		30.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Hole Diameter</u>					
Hole ID:		1007644248			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Diameter:		4.0			
Depth From:		30.0			
Depth To:		87.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
Links					
Bore Hole ID:	1007643336			Tag No:	A264678
Depth M:	26.5176			Contractor:	6607
Year Completed:	2019			Path:	734\7341887.pdf
Well Completed Dt:	2019/08/14			Latitude:	43.5559172544505
Audit No:	WBYVTTLTD			Longitude:	-79.5850211032385

<u>9</u>	1 of 1	E/7.3	78.8 / 0.00	ON	WWIS
Well ID:	7380344			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	17-Feb-2021 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z346438			Contractor:	7215
Tag:				Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY (PORT CREDIT)			
Site Info:					

Bore Hole Information

Bore Hole ID:	1008631301			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614285.00
Code OB Desc:				North83:	4823527.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	13-Jan-2021 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					

Links

Bore Hole ID:	1008631301			Tag No:	
Depth M:				Contractor:	7215
Year Completed:	2021			Path:	738\7380344.pdf

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well Completed Dt:	2021/01/13			Latitude:	43.5559447184594
Audit No:	Z346438			Longitude:	-79.5850576025616

10	1 of 1	W/10.5	78.8 / 0.00	ON	BORE
Borehole ID:	833907			Inclin FLG:	No
OGF ID:	215586038			SP Status:	Initial Entry
Status:	Decommissioned			Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	03-FEB-1977			Municipality:	
Static Water Level:	0.8			Lot:	
Primary Water Use:				Township:	
Sec. Water Use:				Latitude DD:	43.555876
Total Depth m:	6.1			Longitude DD:	-79.58678
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614146
Drill Method:	Hollow stem auger			Northing:	4823517
Orig Ground Elev m:	82.3			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Within 10 metres
DEM Ground Elev m:	82.1				
Concession:					
Location D:	PORT CREDIT GO STATION * PLATFORM SHELTER				
Survey D:					
Comments:					

Borehole Geology Stratum

Geology Stratum ID:	6014840			Mat Consistency:	Compact
Top Depth:	.6			Material Moisture:	
Bottom Depth:	2.9			Material Texture:	Fine
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	Silty fine sand, compact, (brown) **Note: Many records provided by the department have a truncated [Stratum Description] field.				

Geology Stratum ID:	6014839			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.6			Material Texture:	
Material Color:				Non Geo Mat Type:	Fill-Misc
Material 1:	Sand			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	Concrete pavement, sand and gravel fill **Note: Many records provided by the department have a truncated [Stratum Description] field.				

Geology Stratum ID:	6014841			Mat Consistency:	Very Stiff
Top Depth:	2.9			Material Moisture:	
Bottom Depth:	6.1			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Sand			Geologic Period:	
Material 4:	Gravel			Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	(Grey), heterogeneous mixture of clayey silt, sand and gravel, (glacial till), very stiff to hard **Note: Many records provided by the department have a truncated [Stratum Description] field.				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
11	1 of 1	SSW/10.9	78.8 / 0.00	28 Helene St N Mississauga ON L5G 3B7	EHS
Order No: 20080326002				Nearest Intersection:	
Status: C				Municipality:	
Report Type: Custom Report				Client Prov/State: ON	
Report Date: 4/3/2008				Search Radius (km): 0.25	
Date Received: 3/26/2008				X: -79.586315	
Previous Site Name:				Y: 43.555375	
Lot/Building Size:					
Additional Info Ordered:					
12	1 of 1	ENE/17.1	78.8 / 0.00	24 Ann St Mississauga ON L5G 3G1	EHS
Order No: 20180426226				Nearest Intersection:	
Status: C				Municipality:	
Report Type: Standard Report				Client Prov/State: ON	
Report Date: 04-MAY-18				Search Radius (km): .25	
Date Received: 26-APR-18				X: -79.585342	
Previous Site Name:				Y: 43.556205	
Lot/Building Size:					
Additional Info Ordered:		Fire Insur. Maps and/or Site Plans; City Directory; Aerial Photos			
13	1 of 1	N/20.5	79.6 / 0.76	ON	BORE
Borehole ID: 640915				Inclin FLG: No	
OGF ID: 215541310				SP Status: Initial Entry	
Status:				Surv Elev: No	
Type: Borehole				Piezometer: No	
Use: Geotechnical/Geological Investigation				Primary Name:	
Completion Date: JAN-1965				Municipality:	
Static Water Level:				Lot:	
Primary Water Use: Not Used				Township:	
Sec. Water Use:				Latitude DD: 43.556548	
Total Depth m: 2.1				Longitude DD: -79.585915	
Depth Ref: Ground Surface				UTM Zone: 17	
Depth Elev:				Easting: 614215	
Drill Method: Power auger				Northing: 4823593	
Orig Ground Elev m: 83.7				Location Accuracy:	
Elev Reliabil Note:				Accuracy: Not Applicable	
DEM Ground Elev m: 83.6					
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: 218494057				Mat Consistency:	
Top Depth: .3				Material Moisture:	
Bottom Depth: 1.5				Material Texture:	
Material Color: Brown				Non Geo Mat Type:	
Material 1: Sand				Geologic Formation:	
Material 2: Silt				Geologic Group:	
Material 3: Clay				Geologic Period:	
Material 4:				Depositional Gen: alluvial	
Gsc Material Description:					
Stratum Description:		SAND,SILT,CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL.			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Geology Stratum ID:	218494058			Mat Consistency:	
Top Depth:	1.5			Material Moisture:	
Bottom Depth:	2.1			Material Texture:	Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM,SILT, CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL. CI **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	218494056			Mat Consistency:	
Top Depth:	.2			Material Moisture:	
Bottom Depth:	.3			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND,SILT,CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL.				
Geology Stratum ID:	218494055			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.2			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL,GRAVEL. BROWN.				
Geology Stratum ID:	218494054			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	0			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ASPHALT.				
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 088810 NTS_Sheet: 30M12A				
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.				
<u>Source List</u>					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Originators:		Geological Survey of Canada			
14	1 of 1	W/21.6	78.8 / 0.00	ON	BORE
Borehole ID:		833908	Inclin FLG:		No
OGF ID:		215586039	SP Status:		Initial Entry
Status:		Decommissioned	Surv Elev:		No
Type:		Borehole	Piezometer:		No
Use:		Geotechnical/Geological Investigation	Primary Name:		
Completion Date:		03-FEB-1977	Municipality:		
Static Water Level:		0.9	Lot:		
Primary Water Use:			Township:		
Sec. Water Use:			Latitude DD:		43.556047
Total Depth m:		6.1	Longitude DD:		-79.586813
Depth Ref:		Ground Surface	UTM Zone:		17
Depth Elev:			Easting:		614143
Drill Method:		Hollow stem auger	Northing:		4823536
Orig Ground Elev m:		82.3	Location Accuracy:		
Elev Reliabil Note:			Accuracy:		Within 10 metres
DEM Ground Elev m:		83.3			
Concession:					
Location D:		PORT CREDIT GO STATION * PLATFORM SHELTER			
Survey D:					
Comments:					
Borehole Geology Stratum					
Geology Stratum ID:		6014843	Mat Consistency:		Compact
Top Depth:		1.1	Material Moisture:		
Bottom Depth:		2.7	Material Texture:		Fine
Material Color:			Non Geo Mat Type:		
Material 1:		Sand	Geologic Formation:		
Material 2:		Silt	Geologic Group:		
Material 3:			Geologic Period:		
Material 4:			Depositional Gen:		
Gsc Material Description:					
Stratum Description:		Silty fine sand, compact to very dense **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:		6014844	Mat Consistency:		Very Stiff
Top Depth:		2.7	Material Moisture:		
Bottom Depth:		6.1	Material Texture:		
Material Color:			Non Geo Mat Type:		
Material 1:		Till	Geologic Formation:		
Material 2:		Silt	Geologic Group:		
Material 3:		Sand	Geologic Period:		
Material 4:		Gravel	Depositional Gen:		glacial
Gsc Material Description:					
Stratum Description:		Het. mix of clayey silt, sand and gravel (glacial till), very stiff to hard **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:		6014842	Mat Consistency:		
Top Depth:		0	Material Moisture:		
Bottom Depth:		1.1	Material Texture:		
Material Color:			Non Geo Mat Type:		Fill-Misc
Material 1:		Silt	Geologic Formation:		
Material 2:		Sand	Geologic Group:		
Material 3:		Gravel	Geologic Period:		
Material 4:		organic material	Depositional Gen:		
Gsc Material Description:					
Stratum Description:		Clayey silt, sand and few gravel, traces of organics - fill **Note: Many records provided by the department have a truncated [Stratum Description] field.			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
15	1 of 1	E/21.8	78.8 / 0.00	78 PARK ST. E MISSISSAUGA ON	WWIS
Well ID:7341823 Construction Date: Use 1st:Monitoring Use 2nd: Final Well Status:Observation Wells Water Type: Casing Material: Audit No:8MUQDAWX Tag:A271784 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info: MISSISSAUGA CITY (PORT CREDIT) MW 19-2 Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received:16-Sep-2019 00:00:00 Selected Flag:TRUE Abandonment Rec: Contractor:6607 Form Version:9 Owner: County:PEEL Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/734\7341823.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2019/08/15			
Year Completed:		2019			
Depth (m):		27.432			
Latitude:		43.5560515102986			
Longitude:		-79.5849560576027			
Path:		734\7341823.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1007643144			
DP2BR:		Elevrc:			
Spatial Status:		Zone:17			
Code OB:		East83:614293.00			
Code OB Desc:		North83:4823539.00			
Open Hole:		Org CS:UTM83			
Cluster Kind:		UTMRC:4			
Date Completed:		15-Aug-2019 00:00:00			
Remarks:		UTMRC Desc:margin of error : 30 m - 100 m			
Loc Method Desc:		Location Method:wwr			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007643796			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		17			

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/734\7341823.pdf

Additional Detail(s) (Map)

Well Completed Date: 2019/08/15
Year Completed: 2019
Depth (m): 27.432
Latitude: 43.5560515102986
Longitude: -79.5849560576027
Path: 734\7341823.pdf

Bore Hole Information

Bore Hole ID: 1007643144
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 15-Aug-2019 00:00:00
Remarks:
Loc Method Desc: on Water Well Record
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 17
East83: 614293.00
North83: 4823539.00
Org CS: UTM83
UTMRC: 4
UTMRC Desc: margin of error : 30 m - 100 m
Location Method: wwr

Overburden and Bedrock
Materials Interval

Formation ID: 1007643796
Layer: 3
Color: 2
General Color: GREY
Mat1: 17

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Most Common Material:		SHALE			
Mat2:		15			
Mat2 Desc:		LIMESTONE			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		27.0			
Formation End Depth:		90.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007643794			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		34			
Most Common Material:		TILL			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		15.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007643795			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		34			
Most Common Material:		TILL			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		15.0			
Formation End Depth:		27.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007644272			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007644379			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Sealing Record</u>					
Plug ID:		1007644380			
Layer:		2			
Plug From:		1.0			
Plug To:		85.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007643547			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007643546			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007643386			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007643994			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		85.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007644074			
Layer:		1			
Slot:		10			
Screen Top Depth:		85.0			
Screen End Depth:		90.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.5			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007643387			
Pump Set At:					
Static Level:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Final Level After Pumping: Recommended Pump Depth: Pumping Rate: Flowing Rate: Recommended Pump Rate: Levels UOM: ft Rate UOM: GPM Water State After Test Code: Water State After Test: Pumping Test Method: Pumping Duration HR: Pumping Duration MIN: Flowing:					
<u>Hole Diameter</u>					
Hole ID:			1007644161		
Diameter:			4.0		
Depth From:			30.0		
Depth To:			90.0		
Hole Depth UOM:			ft		
Hole Diameter UOM:			inch		
<u>Hole Diameter</u>					
Hole ID:			1007644160		
Diameter:			8.0		
Depth From:			0.0		
Depth To:			30.0		
Hole Depth UOM:			ft		
Hole Diameter UOM:			inch		
<u>Links</u>					
Bore Hole ID:	1007643144			Tag No:	A271784
Depth M:	27.432			Contractor:	6607
Year Completed:	2019			Path:	734\7341823.pdf
Well Completed Dt:	2019/08/15			Latitude:	43.5560515102986
Audit No:	8MUQDAWX			Longitude:	-79.5849560576027
16	1 of 1	E/23.9	78.8 / 0.00	ON	WWIS
Well ID:	7390272			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	18-Jun-2021 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z346504			Contractor:	7215
Tag:				Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY (PORT CREDIT)			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Info:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1008700557			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614291.00
Code OB Desc:				North83:	4823543.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	19-Apr-2021 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Links</u>					
Bore Hole ID:	1008700557			Tag No:	
Depth M:				Contractor:	7215
Year Completed:	2021			Path:	739\7390272.pdf
Well Completed Dt:	2021/04/19			Latitude:	43.556087822575
Audit No:	Z346504			Longitude:	-79.5849799691683
17	1 of 1	S/25.0	78.8 / 0.00	ON	BORE
Borehole ID:	641140			Inclin FLG:	No
OGF ID:	215541535			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.555378
Total Depth m:	2.7			Longitude DD:	-79.585943
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614215
Drill Method:	Power auger			Northing:	4823463
Orig Ground Elev m:	81.7			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	81.3				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218494927			Mat Consistency:	
Top Depth:	.4			Material Moisture:	
Bottom Depth:	1.2			Material Texture:	Medium
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:		SAND-MEDIUM,SILT, CLAY. ALLUVIAL,AGE POST-GLACIAL.			
Geology Stratum ID:	218494924			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		ASPHALT.			
Geology Stratum ID:	218494925			Mat Consistency:	
Top Depth:	.1			Material Moisture:	
Bottom Depth:	.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:		FILL,GRAVEL.			
Geology Stratum ID:	218494926			Mat Consistency:	
Top Depth:	.1			Material Moisture:	
Bottom Depth:	.4			Material Texture:	Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:		SAND-MEDIUM,SILT, CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL.			
Geology Stratum ID:	218494928			Mat Consistency:	
Top Depth:	1.2			Material Moisture:	
Bottom Depth:	2.7			Material Texture:	Medium
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:		SAND-MEDIUM,SILT. GREY,ALLUVIAL, AGE POST-GLACIAL. SAND- **Note: Many records provided by the department have a truncated [Stratum Description] field.			
 Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 091060 NTS_Sheet: 30M12A				
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.				
 Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Date:		1956-1972		Projection Name:	Universal Transverse Mercator
Scale or Resolution:		Varies			
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Originators:		Geological Survey of Canada			
18	1 of 1	SSW/26.1	78.8 / 0.00	IMH Pool VI-A LP 28 Helene St North Port Credit ON L5G 3B7	GEN
Generator No:		ON5013248		Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:		As of Dec 2018		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:		Canada		MHSW Facility:	
Detail(s)					
Waste Class:		145 T			
Waste Class Desc:		Wastes from the use of pigments, coatings and paints			
19	1 of 1	WNW/33.7	78.8 / 0.00	PORT CREDIT GO STATION PORT CREDIT ON	WWIS
Well ID:		7243496		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring		Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:		Observation Wells		Date Received:	25-Jun-2015 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:		Z203315		Contractor:	7147
Tag:		A175784		Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY (PORT CREDIT)			
Site Info:					
PDF URL (Map):					
Additional Detail(s) (Map)					
Well Completed Date:		2015/06/06			
Year Completed:		2015			
Depth (m):		6.1			
Latitude:		43.5562098059175			
Longitude:		-79.5868342262533			
Path:					
Bore Hole Information					
Bore Hole ID:		1005439505		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614141.00

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Code OB Desc:				North83:	4823554.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	06-Jun-2015 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1005616492			
Layer:		1			
Color:		2			
General Color:		GREY			
Mat1:					
Most Common Material:					
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.20000000298023224			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1005616493			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:					
Most Common Material:					
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.20000000298023224			
Formation End Depth:		3.299999952316284			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1005616494			
Layer:		3			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		34			
Mat2 Desc:		TILL			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		3.299999952316284			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005616502			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		2.799999952316284			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005616503			
Layer:		3			
Plug From:		2.799999952316284			
Plug To:		6.099999904632568			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005616501			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005616500			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005616491			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005616497			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.0999999046325684			
Casing Diameter:		5.0			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1005616498			
Layer:		1			
Slot:		.10			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen Top Depth:		3.0999999046325684			
Screen End Depth:		6.099999904632568			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.300000190734863			
<u>Water Details</u>					
Water ID:		1005616496			
Layer:		1			
Kind Code:		8			
Kind:		Untested			
Water Found Depth:		3.700000047683716			
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1005616495			
Diameter:		11.399999618530273			
Depth From:		0.0			
Depth To:		6.099999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:	1005439505			Tag No:	A175784
Depth M:	6.1			Contractor:	7147
Year Completed:	2015			Path:	724\7243496.pdf
Well Completed Dt:	2015/06/06			Latitude:	43.5562098059175
Audit No:	Z203315			Longitude:	-79.5868342262533

20	1 of 1	NE/34.3	79.6 / 0.73	ON	WWIS
Well ID:	7330113			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	15-Mar-2019 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	C44114			Contractor:	7215
Tag:	A259438			Form Version:	8
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY (PORT CREDIT)			
Site Info:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2019/02/19			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Year Completed:		2019			
Depth (m):					
Latitude:		43.5565090894966			
Longitude:		-79.5855520075791			
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:		1007451879		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				17	
Code OB Desc:				East83:	
Open Hole:				614244.00	
Cluster Kind:				North83:	
Date Completed:		19-Feb-2019 00:00:00		4823589.00	
Remarks:				Org CS:	
Loc Method Desc:		on Water Well Record		UTM83	
Elevrc Desc:				4	
Location Source Date:				UTMRC Desc:	
Improvement Location Source:				margin of error : 30 m - 100 m	
Improvement Location Method:				Location Method:	
Source Revision Comment:				wwr	
Supplier Comment:					
<u>Links</u>					
Bore Hole ID:		1007451879		Tag No:	
Depth M:				A259438	
Year Completed:		2019		Contractor:	
Well Completed Dt:		2019/02/19		7215	
Audit No:		C44114		Path:	
				Latitude:	
				43.5565090894966	
				Longitude:	
				-79.5855520075791	
21	1 of 2	NE/35.0	79.2 / 0.37	26 ANN ST. MISSISSAUGA ON	WWIS
Well ID:		7341844		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring		Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:		Observation Wells		Date Received:	
Water Type:				16-Sep-2019 00:00:00	
Casing Material:				Selected Flag:	
Audit No:		GNLFU7D8		TRUE	
Tag:		A271735		Abandonment Rec:	
Constructn Method:				Contractor:	
Elevation (m):				6607	
Elevatn Reliabilty:				Form Version:	
Depth to Bedrock:				9	
Well Depth:				Owner:	
Overburden/Bedrock:				County:	
Pump Rate:				PEEL	
Static Water Level:				Lot:	
Clear/Cloudy:				Concession:	
Municipality:		MISSISSAUGA CITY (PORT CREDIT)		Concession Name:	
Site Info:		MW 19-4 SH		Easting NAD83:	
				Northing NAD83:	
				Zone:	
				UTM Reliability:	
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/734\7341844.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2019/08/19			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Year Completed:		2019			
Depth (m):		36.576			
Latitude:		43.5564259320474			
Longitude:		-79.5853806219843			
Path:		734\7341844.pdf			
 <u>Bore Hole Information</u>					
Bore Hole ID:	1007643207			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614258.00
Code OB Desc:				North83:	4823580.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	19-Aug-2019 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007643850				
Layer:	2				
Color:	2				
General Color:	GREY				
Mat1:	34				
Most Common Material:	TILL				
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:	15.0				
Formation End Depth:	27.0				
Formation End Depth UOM:	ft				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007643849				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	34				
Most Common Material:	TILL				
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:	15.0				
Formation End Depth UOM:	ft				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		1007643851			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		17			
Most Common Material:		SHALE			
Mat2:		15			
Mat2 Desc:		LIMESTONE			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		27.0			
Formation End Depth:		120.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007644428			
Layer:		2			
Plug From:		1.0			
Plug To:		115.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007644293			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007644427			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1007643575			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1007643576			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1007643428			
Casing No:		0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007644013			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		115.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007644093			
Layer:		1			
Slot:		10			
Screen Top Depth:		115.0			
Screen End Depth:		120.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.5			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007643429			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007644188			
Diameter:		8.0			
Depth From:		0.0			
Depth To:		30.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Hole Diameter</u>					
Hole ID:		1007644189			
Diameter:		4.0			
Depth From:		30.0			
Depth To:		120.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
Links					
Bore Hole ID:	1007643207			Tag No:	A271735
Depth M:	36.576			Contractor:	6607
Year Completed:	2019			Path:	734\7341844.pdf
Well Completed Dt:	2019/08/19			Latitude:	43.5564259320474
Audit No:	GNLFU7D8			Longitude:	-79.5853806219843

21	2 of 2	NE/35.0	79.2 / 0.37	26 ANN ST. MISSISSAUGA ON	WWIS
Well ID:	7341883			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	16-Sep-2019 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	TOJ5WP3R			Contractor:	6607
Tag:	A271753			Form Version:	9
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:	MW 19-4 DH				
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/734\7341883.pdf				

Additional Detail(s) (Map)

Well Completed Date: 2019/08/21
 Year Completed: 2019
 Depth (m): 47.5488
 Latitude: 43.5564259320474
 Longitude: -79.5853806219843
 Path: 734\7341883.pdf

Bore Hole Information

Bore Hole ID:	1007643324	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614258.00
Code OB Desc:		North83:	4823580.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	21-Aug-2019 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Loc Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007643951			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		34			
Most Common Material:		TILL			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		15.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007643953			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		17			
Most Common Material:		SHALE			
Mat2:		15			
Mat2 Desc:		LIMESTONE			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		27.0			
Formation End Depth:		156.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007643952			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		34			
Most Common Material:		TILL			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		15.0			
Formation End Depth:		27.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007644515			
Layer:		2			
Plug From:		1.0			
Plug To:		151.0			
Plug Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007644514			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007644332			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007643627			
Method Construction Code:		3			
Method Construction:		Rotary (Reverse)			
Other Method Construction:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007643628			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007643626			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007643506			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007644049			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		151.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007644129			
Layer:		1			
Slot:		10			
Screen Top Depth:		151.0			
Screen End Depth:		156.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.5			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007643507			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007644239			
Diameter:		8.0			
Depth From:		0.0			
Depth To:		30.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Hole Diameter</u>					
Hole ID:		1007644240			
Diameter:		4.0			
Depth From:		30.0			
Depth To:		156.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Links</u>					
Bore Hole ID:	1007643324		Tag No:	A271753	
Depth M:	47.5488		Contractor:	6607	
Year Completed:	2019		Path:	734\7341883.pdf	
Well Completed Dt:	2019/08/21		Latitude:	43.5564259320474	
Audit No:	TOJ5WP3R		Longitude:	-79.5853806219843	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
22	1 of 1	W/36.5	78.8 / 0.00	ON	BORE
Borehole ID: 649445		Inclin FLG: No			
OGF ID: 215549820		SP Status: Initial Entry			
Status:		Surv Elev: No			
Type: Borehole		Piezometer: No			
Use: Geotechnical/Geological Investigation		Primary Name:			
Completion Date: JUN-1969		Municipality:			
Static Water Level: 0.3		Lot:			
Primary Water Use: Not Used		Township:			
Sec. Water Use:		Latitude DD: 43.556111			
Total Depth m: 4		Longitude DD: -79.586978			
Depth Ref: Ground Surface		UTM Zone: 17			
Depth Elev:		Easting: 614130			
Drill Method: Digging		Northing: 4823543			
Orig Ground Elev m: 83.8		Location Accuracy:			
Elev Reliabil Note:		Accuracy: Not Applicable			
DEM Ground Elev m: 84.6					
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: 218526999		Mat Consistency: Dense			
Top Depth: 0		Material Moisture:			
Bottom Depth: 3.4		Material Texture:			
Material Color: Brown		Non Geo Mat Type:			
Material 1: Sand		Geologic Formation:			
Material 2: Silt		Geologic Group:			
Material 3:		Geologic Period:			
Material 4:		Depositional Gen:			
Gsc Material Description:					
Stratum Description: SAND,SILT. BROWN,DENSE.					
Geology Stratum ID: 218527000		Mat Consistency: Stiff			
Top Depth: 3.4		Material Moisture:			
Bottom Depth: 4		Material Texture:			
Material Color: Grey		Non Geo Mat Type:			
Material 1: Till		Geologic Formation:			
Material 2: Silt		Geologic Group:			
Material 3: Clay		Geologic Period:			
Material 4: Sand		Depositional Gen:			
Gsc Material Description:					
Stratum Description: TILL,SILT,CLAY,SAND.GREY,STIFF, WATER STABLE AT 274.1 FEET.0000004400110029 **Note: Many records provided by the department have a truncated [Stratum Description] field.					
<u>Source</u>					
Source Type: Data Survey		Source Appl: Spatial/Tabular			
Source Orig: Geological Survey of Canada		Source Iden: 1			
Source Date: 1956-1972		Scale or Res: Varies			
Confidence: H		Horizontal: NAD27			
Observatio:		Verticalda: Mean Average Sea Level			
Source Name: Urban Geology Automated Information System (UGAIS)					
Source Details: File: TOR3.txt RecordID: 201040 NTS_Sheet: 30M12A					
Confiden 1: Logged by professional. Exact and complete description of material and properties.					
<u>Source List</u>					
Source Identifier: 1		Horizontal Datum: NAD27			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Type:		Data Survey		Vertical Datum:	Mean Average Sea Level
Source Date:		1956-1972		Projection Name:	Universal Transverse Mercator
Scale or Resolution:		Varies			
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Originators:		Geological Survey of Canada			
23	1 of 1	SW/37.2	78.8 / 0.00	ON	BORE
Borehole ID:		646201		Inclin FLG:	No
OGF ID:		215546584		SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:		Borehole		Piezometer:	No
Use:		Geotechnical/Geological Investigation		Primary Name:	
Completion Date:		JUN-1968		Municipality:	
Static Water Level:		0.5		Lot:	
Primary Water Use:		Not Used		Township:	
Sec. Water Use:				Latitude DD:	43.555431
Total Depth m:		6.1		Longitude DD:	-79.586622
Depth Ref:		Ground Surface		UTM Zone:	17
Depth Elev:				Easting:	614160
Drill Method:		Power auger		Northing:	4823468
Orig Ground Elev m:		81.9		Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:		82.2			
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:		218514005		Mat Consistency:	Dense
Top Depth:		.2		Material Moisture:	
Bottom Depth:		4.4		Material Texture:	
Material Color:		Brown		Non Geo Mat Type:	
Material 1:		Silt		Geologic Formation:	
Material 2:		Sand		Geologic Group:	
Material 3:		Clay		Geologic Period:	
Material 4:				Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:		SILT,SAND,CLAY. BROWN,GREY,GLACIAL,DENSE, LAYERED,AGE GLACIAL.			
Geology Stratum ID:		218514006		Mat Consistency:	Hard
Top Depth:		4.4		Material Moisture:	
Bottom Depth:		6.1		Material Texture:	
Material Color:		Grey		Non Geo Mat Type:	
Material 1:		Till		Geologic Formation:	
Material 2:		Clay		Geologic Group:	
Material 3:		Silt		Geologic Period:	
Material 4:				Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:		TILL,CLAY,SILT. GREY,GLACIAL,HARD,AGE GLACIAL,WATER STABLE AT 267.3 FEET. 018 012 **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:		218514004		Mat Consistency:	
Top Depth:		0		Material Moisture:	
Bottom Depth:		.2		Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:		Soil		Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Stratum Description:		SOIL.			
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR2.txt RecordID: 142230 NTS_Sheet: 30M12A				
Confiden 1:	Reliable information but incomplete.				
<u>Source List</u>					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
24	1 of 1	NW/41.6	78.8 / 0.00	Park St E and Hurontario St Mississauga ON	EHS
Order No:	20140828058			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	RSC Premium Package (Urban)			Client Prov/State:	ON
Report Date:	05-SEP-14			Search Radius (km):	.3
Date Received:	28-AUG-14			X:	-79.58656
Previous Site Name:				Y:	43.5566
Lot/Building Size:					
Additional Info Ordered:					
25	1 of 1	SSW/41.8	78.8 / 0.00	ON	BORE
Borehole ID:	646200			Inclin FLG:	No
OGF ID:	215546583			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JUN-1968			Municipality:	
Static Water Level:	0.6			Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.555202
Total Depth m:	6.3			Longitude DD:	-79.586256
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614190
Drill Method:	Power auger			Northing:	4823443
Orig Ground Elev m:	81.1			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	82.1				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218514003			Mat Consistency:	Hard

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Top Depth:	3.2			Material Moisture:	
Bottom Depth:	6.3			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:	Shale			Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:		TILL,CLAY,SILT,SHALEGREY,GLACIAL,HARD,AGE GLACIAL. 019 033 017 00005 **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:	218514001			Mat Consistency:	Dense
Top Depth:	.2			Material Moisture:	
Bottom Depth:	2.6			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Silt			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:		SILT,SAND. BROWN,GREY,GLACIAL,DENSE, AGE GLACIAL.			
Geology Stratum ID:	218514002			Mat Consistency:	Stiff
Top Depth:	2.6			Material Moisture:	
Bottom Depth:	3.2			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	lacustrine
Gsc Material Description:					
Stratum Description:		CLAY,SILT. GREY,LACUSTRINE,STIFF, AGE GLACIAL, WATER STABLE AT 264.0 FEET.			
Geology Stratum ID:	218514000			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Soil			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		SOIL.			
Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Details:		File: TOR2.txt RecordID: 142220 NTS_Sheet: 30M12A			
Confiden 1:		Reliable information but incomplete.			
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Originators:		Geological Survey of Canada			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
26	1 of 1	ENE/42.2	78.8 / 0.00	ON	BORE
Borehole ID:		640930	Inclin FLG: No		
OGF ID:		215541325	SP Status: Initial Entry		
Status:			Surv Elev: No		
Type:		Borehole	Piezometer: No		
Use:		Geotechnical/Geological Investigation	Primary Name:		
Completion Date:		JAN-1965	Municipality:		
Static Water Level:			Lot:		
Primary Water Use:		Not Used	Township:		
Sec. Water Use:			Latitude DD: 43.556266		
Total Depth m:		2.1	Longitude DD: -79.584931		
Depth Ref:		Ground Surface	UTM Zone: 17		
Depth Elev:			Easting: 614295		
Drill Method:		Power auger	Northing: 4823563		
Orig Ground Elev m:		82.9	Location Accuracy:		
Elev Reliabil Note:			Accuracy: Not Applicable		
DEM Ground Elev m:		82.6			
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:		218494130	Mat Consistency:		
Top Depth:		.5	Material Moisture:		
Bottom Depth:		2.1	Material Texture: Medium		
Material Color:			Non Geo Mat Type:		
Material 1:		Sand	Geologic Formation:		
Material 2:		Silt	Geologic Group:		
Material 3:		Clay	Geologic Period:		
Material 4:			Depositional Gen: alluvial		
Gsc Material Description:					
Stratum Description:		SAND-MEDIUM,SILT, CLAY. ALLUVIAL,AGE POST-GLACIAL. GE **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:		218494127	Mat Consistency:		
Top Depth:		0	Material Moisture:		
Bottom Depth:		0	Material Texture:		
Material Color:			Non Geo Mat Type:		
Material 1:		Asphalt	Geologic Formation:		
Material 2:			Geologic Group:		
Material 3:			Geologic Period:		
Material 4:			Depositional Gen:		
Gsc Material Description:					
Stratum Description:		ASPHALT.			
Geology Stratum ID:		218494128	Mat Consistency:		
Top Depth:		0	Material Moisture:		
Bottom Depth:		.2	Material Texture:		
Material Color:			Non Geo Mat Type:		
Material 1:		Fill	Geologic Formation:		
Material 2:		Gravel	Geologic Group:		
Material 3:			Geologic Period:		
Material 4:			Depositional Gen: fill		
Gsc Material Description:					
Stratum Description:		FILL,GRAVEL.			
Geology Stratum ID:		218494129	Mat Consistency:		
Top Depth:		.2	Material Moisture:		
Bottom Depth:		.5	Material Texture: Medium		
Material Color:		Brown	Non Geo Mat Type:		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 1: Soil Material 2: Sand Material 3: Silt Material 4: Clay Gsc Material Description: Stratum Description: SOIL,SAND-MEDIUM, SILT,CLAY. BROWN. Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					
Source Source Type: Data Survey Source Orig: Geological Survey of Canada Source Date: 1956-1972 Confidence: M Observatio: Source Name: Urban Geology Automated Information System (UGAIS) Source Details: File: TOR1B.txt RecordID: 088960 NTS_Sheet: 30M12A Confiden 1: Logs are approximately correct. Lack of information. Doubtful terminology. Source Appl: Spatial/Tabular Source Iden: 1 Scale or Res: Varies Horizontal: NAD27 Verticalda: Mean Average Sea Level					
Source List Source Identifier: 1 Source Type: Data Survey Source Date: 1956-1972 Scale or Resolution: Varies Source Name: Urban Geology Automated Information System (UGAIS) Source Originators: Geological Survey of Canada Horizontal Datum: NAD27 Vertical Datum: Mean Average Sea Level Projection Name: Universal Transverse Mercator					
27	1 of 1	S/43.6	78.8 / 0.00	28 Helene Street North Mississauga ON L5G 3B7	EHS
Order No: 20190822021 Status: C Report Type: Standard Report Report Date: 27-AUG-19 Date Received: 22-AUG-19 Previous Site Name: Lot/Building Size: Additional Info Ordered: Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.586357 Y: 43.555403					
28	1 of 1	NE/45.9	79.8 / 1.00	ON	BORE
Borehole ID: 640931 OGF ID: 215541326 Status: Type: Borehole Use: Geotechnical/Geological Investigation Completion Date: JAN-1965 Static Water Level: Primary Water Use: Not Used Sec. Water Use: Total Depth m: 2.4 Depth Ref: Ground Surface Depth Elev: Drill Method: Power auger Orig Ground Elev m: 83.8 Elev Reliabil Note: DEM Ground Elev m: 83.7 Concession: Location D: Survey D: Comments: Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD: 43.556633 Longitude DD: -79.585542 UTM Zone: 17 Easting: 614245 Northing: 4823603 Location Accuracy: Accuracy: Not Applicable					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218494132			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.3			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL, GRAVEL.				
Geology Stratum ID:	218494136			Mat Consistency:	
Top Depth:	1.5			Material Moisture:	
Bottom Depth:	2.4			Material Texture:	Medium
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM, CLAY, SILT. ALLUVIAL, AGE POST-GLACIAL.				
Geology Stratum ID:	218494131			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	0			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ASPHALT.				
Geology Stratum ID:	218494134			Mat Consistency:	
Top Depth:	.6			Material Moisture:	
Bottom Depth:	.9			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	CLAY, SAND, SILT. ALLUVIAL, AGE POST-GLACIAL.				
Geology Stratum ID:	218494133			Mat Consistency:	
Top Depth:	.3			Material Moisture:	
Bottom Depth:	.6			Material Texture:	Medium
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM, SILT, CLAY. ALLUVIAL, AGE POST-GLACIAL.				
Geology Stratum ID:	218494135			Mat Consistency:	
Top Depth:	.9			Material Moisture:	
Bottom Depth:	1.5			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Silt			Geologic Period:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 4: Gsc Material Description: Stratum Description:				Depositional Gen:	alluvial
				CLAY,SAND,SILT. ALLUVIAL,AGE POST-GLACIAL.	
Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 088970 NTS_Sheet: 30M12A				
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.				
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
29	1 of 6	WSW/46.6	78.8 / 0.00	Metrolinx 30 Queen Street East Mississauga ON L5H 1L4	GEN
Generator No:	ON5182768			Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:	As of Jul 2020			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:	Canada			MHSW Facility:	
Detail(s)					
Waste Class:	146 L				
Waste Class Desc:	Other specified inorganic sludges, slurries or solids				
29	2 of 6	WSW/46.6	78.8 / 0.00	Salini Impregilo Civil Works Inc. 30 Queen Street East Mississauga, ON Canada ON	PTTW
EBR Registry No:	019-3001			Decision Posted:	May\s21,\s2021
Ministry Ref No:	7721-BW3NJF			Exception Posted:	
Notice Type:	Instrument			Section:	Section\s34
Notice Stage:	Decision			Act 1:	Ontario\sWater\sResources\sAct,\sR.S.O.\s1990
Notice Date:				Act 2:	Ontario\sWater\sResources\sAct
Proposal Date:	January\s21,\s2021			Site Location Map:	43.55674,-79.585817
Year:	2021				
Instrument Type:	Permit\sto\stake\swater				
Off Instrument Name:	Permit\sto\stake\swater\s(OWRA\ss.\s34)				
Posted By:	Ministry\sof\sthe\sEnvironment,\sConservation\sand\sParks				
Company Name:					
Site Address:	30\sQueen\sStreet\sEast\sMississauga,\sON\sCanada				
Location Other:					
Proponent Name:	Salini\sImpregilo\sCivil\sWorks\sInc.				
Proponent Address:	Salini\sImpregilo\sCivil\sWorks\sInc.\s110\sMatheson\sBoulevard\sWest\sSuite\s400\sMississauga,\sON\sL5R\s4G7\sCanada				
Comment Period:	January\s21,\s2021\s-\sFebruary\s20,\s2021\s(30\sdays)\sClosed				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
URL:		https://ero.ontario.ca/notice/019-3001			
Site Location Details:					
29	3 of 6	WSW/46.6	78.8 / 0.00	Metrolinx 30 Queen Street East Mississauga ON L5H 1L4	GEN
Generator No:	ON5182768			Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:	As of Nov 2021			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:	Canada			MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:	146 L				
Waste Class Desc:	Other specified inorganic sludges, slurries or solids				
29	4 of 6	WSW/46.6	78.8 / 0.00	Salini Impregilo Civil Works Inc. 30 Queen ST E Mississauga ON L5R 4G7	EASR
Approval No:	R-009-7113160571			MOE District:	Halton-Peel
Status:	REGISTERED			Municipality:	Mississauga
Date:	2021-04-30			Latitude:	43.55527778
Record Type:	EASR			Longitude:	-79.5875
Link Source:	MOFA			Geometry X:	-8859639.9735
Project Type:	Water Taking - Construction Dewatering			Geometry Y:	5396876.357299998
Full Address:					
Approval Type:	EASR-Water Taking - Construction Dewatering				
SWP Area Name:	Credit Valley				
PDF URL:					
PDF Site Location:					
29	5 of 6	WSW/46.6	78.8 / 0.00	Mobilinx 30 Queen Street East Mississauga ON L5G 4N6	GEN
Generator No:	ON3332947			Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:	As of Nov 2021			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:	Canada			MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:	221 L				
Waste Class Desc:	Light fuels				
29	6 of 6	WSW/46.6	78.8 / 0.00	Metrolinx 30 Queen Street East Mississauga ON L5H 1L4	GEN
Generator No:	ON5182768			Status:	Registered
SIC Code:				Co Admin:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Description:				Choice of Contact:	
Approval Years:	As of Apr 2022			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:	Canada			MHSW Facility:	
Detail(s)					
Waste Class:	146 L				
Waste Class Desc:	OTHER SPECIFIED INORGANICS				
30	1 of 1	SE/46.7	79.4 / 0.58	ON	BORE
Borehole ID:	639272			Inclin FLG:	No
OGF ID:	215539669			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.555371
Total Depth m:	2.7			Longitude DD:	-79.585386
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614260
Drill Method:	Power auger			Northing:	4823463
Orig Ground Elev m:	81.4			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	80.7				
Concession:					
Location D:					
Survey D:					
Comments:					
Borehole Geology Stratum					
Geology Stratum ID:	218487715			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.3			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL, GRAVEL. GREY.				
Geology Stratum ID:	218487717			Mat Consistency:	
Top Depth:	1.2			Material Moisture:	Moist
Bottom Depth:	2.7			Material Texture:	Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM, CLAY, SILT. BROWN, ALLUVIAL, MOIST, AGE POST-GLACIAL. LUVIAL				**Note: Many records provided by the department have a truncated [Stratum Description] field.
Geology Stratum ID:	218487716			Mat Consistency:	
Top Depth:	.3			Material Moisture:	
Bottom Depth:	1.2			Material Texture:	
Material Color:				Non Geo Mat Type:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	Sand Clay Silt SAND,CLAY,SILT. ALLUVIAL,AGE POST-GLACIAL.			Geologic Formation: Geologic Group: Geologic Period: Depositional Gen: alluvial	
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218487714 0 0 Asphalt ASPHALT.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	
Source					
Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	Data Survey Geological Survey of Canada 1956-1972 M Urban Geology Automated Information System (UGAIS) File: TOR1B.txt RecordID: 072350 NTS_Sheet: 30M12A Logs are approximately correct. Lack of information. Doubtful terminology.			Source Appl: Source Iden: Scale or Res: Horizontal: Verticalda: Spatial/Tabular 1 Varies NAD27 Mean Average Sea Level	
Source List					
Source Identifier: Source Type: Source Date: Scale or Resolution: Source Name: Source Originators:	1 Data Survey 1956-1972 Varies Urban Geology Automated Information System (UGAIS) Geological Survey of Canada			Horizontal Datum: Vertical Datum: Projection Name: NAD27 Mean Average Sea Level Universal Transverse Mercator	
31	1 of 1	N/48.7	79.8 / 1.00	30 Queen St E ON	WWIS
Well ID: Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: Tag: Constructn Method: Elevation (m): Elevatn Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:	7380055 Monitoring Observation Wells KTPNZ5WC A295479 MISSISSAUGA CITY (PORT CREDIT)			Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: Selected Flag: Abandonment Rec: Contractor: Form Version: Owner: County: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Bore Hole Information</u>					
Bore Hole ID:	1008564214			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614201.00
Code OB Desc:				North83:	4823627.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	26-Jun-2020 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1008564330				
Layer:	4				
Color:					
General Color:					
Mat1:	06				
Most Common Material:	SILT				
Mat2:	11				
Mat2 Desc:	GRAVEL				
Mat3:					
Mat3 Desc:					
Formation Top Depth:	20.0				
Formation End Depth:	35.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1008564328				
Layer:	2				
Color:					
General Color:					
Mat1:	28				
Most Common Material:	SAND				
Mat2:	05				
Mat2 Desc:	CLAY				
Mat3:					
Mat3 Desc:					
Formation Top Depth:	5.0				
Formation End Depth:	10.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1008564327				
Layer:	1				
Color:					
General Color:					
Mat1:	28				
Most Common Material:	SAND				
Mat2:	11				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat2 Desc:		GRAVEL			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		5.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008564329			
Layer:		3			
Color:					
General Color:					
Mat1:		28			
Most Common Material:		SAND			
Mat2:		34			
Mat2 Desc:		TILL			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		10.0			
Formation End Depth:		20.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008564406			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008564421			
Layer:		1			
Plug From:		0.0			
Plug To:		23.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1008564278			
Method Construction Code:		E			
Method Construction:		Auger			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1008564254			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1008564361			
Layer:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material:					
Open Hole or Material:		5			
Depth From:		PLASTIC			
Depth To:		0.0			
Casing Diameter:		25.0			
Casing Diameter UOM:		2.0			
Casing Depth UOM:		inch			
		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1008564375			
Layer:		1			
Slot:		0.1			
Screen Top Depth:		25.0			
Screen End Depth:		35.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.25			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1008564255			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1008564391			
Diameter:		6.0			
Depth From:		0.0			
Depth To:		35.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Links</u>					
Bore Hole ID:		1008564214		Tag No:	A295479
Depth M:		10.668		Contractor:	7360
Year Completed:		2020		Path:	738\7380055.pdf
Well Completed Dt:		2020/06/26		Latitude:	43.5568577295378
Audit No:		KTPNZ5WC		Longitude:	-79.5860762288303
32	1 of 1	N/49.7	79.8 / 1.00	30 Queen St E ON	WWIS
Well ID:		7380056		Flowing (Y/N):	
Construction Date:				Flow Rate:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	29-Jan-2021 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	RXRFRGV6			Contractor:	7360
Tag:	A295480			Form Version:	9
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:					

Bore Hole Information

Bore Hole ID:	1008564217	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614198.00
Code OB Desc:		North83:	4823628.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	26-Jun-2020 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Loc Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock

Materials Interval

Formation ID:	1008564331
Layer:	1
Color:	
General Color:	
Mat1:	28
Most Common Material:	SAND
Mat2:	11
Mat2 Desc:	GRAVEL
Mat3:	
Mat3 Desc:	
Formation Top Depth:	0.0
Formation End Depth:	5.0
Formation End Depth UOM:	ft

Overburden and Bedrock

Materials Interval

Formation ID:	1008564333
Layer:	3
Color:	
General Color:	
Mat1:	28

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Most Common Material:					
Mat2:		SAND	34		
Mat2 Desc:		TILL			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		10.0			
Formation End Depth:		20.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008564332			
Layer:		2			
Color:					
General Color:					
Mat1:		28			
Most Common Material:		SAND			
Mat2:		05			
Mat2 Desc:		CLAY			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		5.0			
Formation End Depth:		10.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008564407			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008564422			
Layer:		1			
Plug From:		0.0			
Plug To:		13.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1008564279			
Method Construction Code:		E			
Method Construction:		Auger			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1008564256			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing ID: 1008564362					
Layer: 1					
Material: 5					
Open Hole or Material: PLASTIC					
Depth From: 0.0					
Depth To: 15.0					
Casing Diameter: 2.0					
Casing Diameter UOM: inch					
Casing Depth UOM: ft					
<u>Construction Record - Screen</u>					
Screen ID: 1008564376					
Layer: 1					
Slot: 0.1					
Screen Top Depth: 15.0					
Screen End Depth: 20.0					
Screen Material: 5					
Screen Depth UOM: ft					
Screen Diameter UOM: inch					
Screen Diameter: 2.25					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID: 1008564257					
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM: ft					
Rate UOM: GPM					
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID: 1008564392					
Diameter: 6.0					
Depth From: 0.0					
Depth To: 20.0					
Hole Depth UOM: ft					
Hole Diameter UOM: inch					
<u>Links</u>					
Bore Hole ID:	1008564217			Tag No:	A295480
Depth M:	6.096			Contractor:	7360
Year Completed:	2020			Path:	738\7380056.pdf
Well Completed Dt:	2020/06/26			Latitude:	43.5568671902916
Audit No:	RXRFRGV6			Longitude:	-79.5861131502184
33	1 of 1	S/50.7	78.8 / 0.00	ON	BORE

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Borehole ID:	646199			Inclin FLG:	No
OGF ID:	215546582			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JUN-1968			Municipality:	
Static Water Level:	0.6			Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.555109
Total Depth m:	6.4			Longitude DD:	-79.586073
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614205
Drill Method:	Power auger			Northing:	4823433
Orig Ground Elev m:	82.3			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	81.9				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218513996			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Soil			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	SOIL.				
Geology Stratum ID:	218513997			Mat Consistency:	Dense
Top Depth:	.2			Material Moisture:	
Bottom Depth:	4.1			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Silt			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	SILT,SAND,CLAY. BROWN,GREY,GLACIAL,DENSE, LAYERED,AGE GLACIAL.				
Geology Stratum ID:	218513998			Mat Consistency:	Stiff
Top Depth:	4.1			Material Moisture:	
Bottom Depth:	4.9			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	lacustrine
Gsc Material Description:					
Stratum Description:	CLAY,SILT. GREY,LACUSTRINE,STIFF,LAYERED,AGE GLACIAL, WATER STABLE AT 267.9 FEET.				
Geology Stratum ID:	218513999			Mat Consistency:	Hard
Top Depth:	4.9			Material Moisture:	
Bottom Depth:	6.4			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:	Shale			Depositional Gen:	glacial
Gsc Material Description:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Stratum Description:		TILL,CLAY,SILT,SHALEGLACIAL,HARD,AGE GLACIAL. 018 018032038 010 000050390 **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR2.txt RecordID: 142210 NTS_Sheet: 30M12A				
Confiden 1:	Reliable information but incomplete.				
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
34	1 of 1	WNW/53.3	78.8 / 0.00	GO STATION PARKING LOT PORT CREDIT ON	WWIS
Well ID:	7307873			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	15-Mar-2018 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z266884			Contractor:	6607
Tag:	A241364			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:					
PDF URL (Map):					
Additional Detail(s) (Map)					
Well Completed Date:	2018/01/10				
Year Completed:	2018				
Depth (m):	1.61544				
Latitude:	43.5564891574472				
Longitude:	-79.5868524583307				
Path:					
Bore Hole Information					
Bore Hole ID:	1007003609			Elevation:	
DP2BR:				Elevrc:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Spatial Status:				Zone:	17
Code OB:				East83:	614139.00
Code OB Desc:				North83:	4823585.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	10-Jan-2018 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007230193			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		4.5			
Formation End Depth:		5.300000190734863			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007230192			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		1.5			
Formation End Depth:		4.5			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007230191			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth:		1.5			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007230200			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007230201			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		1.5			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1007230199			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:		DIAMOND			
 <u>Pipe Information</u>					
Pipe ID:		1007230190			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1007230196			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.5			
Casing Diameter:		5.099999904632568			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1007230197			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.5			
Screen End Depth:		5.300000190734863			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		6.610000133514404			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Water Details</u>					
Water ID:		1007230195			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1007230194			
Diameter:		21.0			
Depth From:		0.0			
Depth To:		5.300000190734863			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Links</u>					
Bore Hole ID:	1007003609			Tag No:	A241364
Depth M:	1.61544			Contractor:	6607
Year Completed:	2018			Path:	730\7307873.pdf
Well Completed Dt:	2018/01/10			Latitude:	43.5564891574472
Audit No:	Z266884			Longitude:	-79.5868524583307

35	1 of 1	ENE/55.1	78.7 / -0.15	30 Queen St East Mississauga ON	WWIS
Well ID:	7363632			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	07-Aug-2020 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	5NZ4J5JW			Contractor:	7609
Tag:	A283540			Form Version:	9
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1008371677			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614314.00
Code OB Desc:				North83:	4823565.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	27-Jul-2020 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008371791			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		01			
Most Common Material:		FILL			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:		77			
Mat3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		1.5199999809265137			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008371792			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		1.5199999809265137			
Formation End Depth:		3.049999952316284			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008371793			
Layer:		3			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		11			
Mat3 Desc:		GRAVEL			
Formation Top Depth:		3.049999952316284			
Formation End Depth:		4.570000171661377			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008371856			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008371882			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008371883			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		1.5199999809265137			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008371884			
Layer:		3			
Plug From:		1.5199999809265137			
Plug To:		4.570000171661377			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1008371757			
Method Construction Code:		E			
Method Construction:		Auger			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1008371726			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1008371818			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.5199999809265137			
Casing Diameter:		5.0			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen ID: 1008371828					
Layer: 1					
Slot: 010					
Screen Top Depth: 1.5199999809265137					
Screen End Depth: 4.570000171661377					
Screen Material: 5					
Screen Depth UOM: m					
Screen Diameter UOM: cm					
Screen Diameter: 6.0					
Results of Well Yield Testing					
Pumping Test Method Desc:					
Pump Test ID: 1008371727					
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM: m					
Rate UOM: LPM					
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
Hole Diameter					
Hole ID: 1008371841					
Diameter: 21.0					
Depth From: 0.0					
Depth To: 4.570000171661377					
Hole Depth UOM: m					
Hole Diameter UOM: cm					
Links					
Bore Hole ID: 1008371677					
Depth M: 4.57					
Year Completed: 2020					
Well Completed Dt: 2020/07/27					
Audit No: 5NZ4J5JW					
Tag No: A283540					
Contractor: 7609					
Path: 736\7363632.pdf					
Latitude: 43.5562823303872					
Longitude: -79.5846906593135					
36	1 of 1	NE/56.4	79.8 / 1.00	port credit go station Mississauga ON	WWIS
Well ID: 7355171					
Construction Date:					
Use 1st: Test Hole					
Use 2nd: Monitoring					
Final Well Status: Observation Wells					
Water Type:					
Casing Material:					
Audit No: Z275350					
Tag: A239126					
Constructn Method:					
Elevation (m):					
Flowing (Y/N):					
Flow Rate:					
Data Entry Status:					
Data Src:					
Date Received: 28-Nov-2018 00:00:00					
Selected Flag: TRUE					
Abandonment Rec:					
Contractor: 7383					
Form Version: 7					
Owner:					
County: PEEL					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:			Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:		
MISSISSAUGA CITY (PORT CREDIT)					
PDF URL (Map):					
Additional Detail(s) (Map)					
Well Completed Date:			2018/01/13		
Year Completed:			2018		
Depth (m):			9.144		
Latitude:			43.5565769655308		
Longitude:			-79.5852161374119		
Path:					
Bore Hole Information					
Bore Hole ID:			1008221295		
DP2BR:					
Spatial Status:			Elevation:		
Code OB:			Elevrc:		
Code OB Desc:			Zone:		
Open Hole:			17		
Cluster Kind:			East83:		
Date Completed:			13-Jan-2018 00:00:00		
Remarks:			North83:		
Loc Method Desc:			4823597.00		
Elevrc Desc:			Org CS:		
Location Source Date:			UTM83		
Improvement Location Source:			UTMRC:		
Improvement Location Method:			4		
Source Revision Comment:			UTMRC Desc:		
Supplier Comment:			margin of error : 30 m - 100 m		
			Location Method:		
			wwr		
Overburden and Bedrock					
Materials Interval					
Formation ID:			1008268350		
Layer:			1		
Color:					
General Color:					
Mat1:			28		
Most Common Material:			SAND		
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:			0.0		
Formation End Depth:					
Formation End Depth UOM:					
Overburden and Bedrock					
Materials Interval					
Formation ID:			1008268353		
Laver:			4		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Color:					
General Color:					
Mat1:		17			
Most Common Material:		SHALE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:					
Formation End Depth:		30.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1008268351			
Layer:		2			
Color:					
General Color:					
Mat1:		06			
Most Common Material:		SILT			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1008268352			
Layer:		3			
Color:					
General Color:					
Mat1:		34			
Most Common Material:		TILL			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:					
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1008268739			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1008268740			
Layer:		2			
Plug From:		1.0			
Plug To:		19.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008268741			
Layer:		3			
Plug From:		19.0			
Plug To:		30.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1008269236			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1008267822			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1008269425			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		20.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1008269595			
Layer:		1			
Slot:		10			
Screen Top Depth:		20.0			
Screen End Depth:		30.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.375			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1008269861			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Levels UOM: ft Rate UOM: GPM Water State After Test Code: Water State After Test: Pumping Test Method: 0 Pumping Duration HR: Pumping Duration MIN: Flowing:					
<u>Water Details</u>					
Water ID: 1008269724 Layer: 1 Kind Code: Kind: Water Found Depth: 19.0 Water Found Depth UOM: ft					
<u>Hole Diameter</u>					
Hole ID: 1008269041 Diameter: 8.5 Depth From: 0.0 Depth To: 30.0 Hole Depth UOM: ft Hole Diameter UOM: Inch					
<u>Links</u>					
Bore Hole ID: 1008221295 Depth M: 9.144 Year Completed: 2018 Well Completed Dt: 2018/01/13 Audit No: Z275350					
Tag No: A239126 Contractor: 7383 Path: 735\7355171.pdf Latitude: 43.5565769655308 Longitude: -79.5852161374119					
37	1 of 1	NNE/56.6	79.8 / 1.00	PORT CREDIT GO STATION ETOBICOKE ON	WWIS
Well ID: 7321758 Construction Date: Use 1st: Monitoring Use 2nd: Final Well Status: Observation Wells Water Type: Casing Material: Audit No: Z266972 Tag: A232612 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: MISSISSAUGA CITY (PORT CREDIT) Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 07-Nov-2018 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 6607 Form Version: 7 Owner: County: PEEL Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well Completed Date:		2018/01/27			
Year Completed:		2018			
Depth (m):		12.192			
Latitude:		43.5568073629561			
Longitude:		-79.5856440763172			
Path:					
 <u>Bore Hole Information</u>					
Bore Hole ID:	1007306972			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614236.00
Code OB Desc:				North83:	4823622.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	27-Jan-2018 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007600790				
Layer:	3				
Color:	2				
General Color:	GREY				
Mat1:	17				
Most Common Material:	SHALE				
Mat2:					
Mat2 Desc:					
Mat3:	26				
Mat3 Desc:	ROCK				
Formation Top Depth:	30.0				
Formation End Depth:	40.0				
Formation End Depth UOM:	ft				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007600789				
Layer:	2				
Color:	2				
General Color:	GREY				
Mat1:	05				
Most Common Material:	CLAY				
Mat2:	11				
Mat2 Desc:	GRAVEL				
Mat3:	34				
Mat3 Desc:	TILL				
Formation Top Depth:	5.0				
Formation End Depth:	30.0				
Formation End Depth UOM:	ft				
 <u>Overburden and Bedrock</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Materials Interval</u>					
Formation ID:		1007600788			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:		01			
Mat3 Desc:		FILL			
Formation Top Depth:		0.0			
Formation End Depth:		5.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007600798			
Layer:		1			
Plug From:		0.0			
Plug To:		29.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007600799			
Layer:		2			
Plug From:		29.0			
Plug To:		40.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007600797			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007600787			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007600794			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		30.0			
Casing Diameter:		5.099999904632568			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Screen</u>					
Screen ID:		1007600795			
Layer:		1			
Slot:		10			
Screen Top Depth:		30.0			
Screen End Depth:		40.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		6.400000095367432			
<u>Water Details</u>					
Water ID:		1007600793			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1007600792			
Diameter:		4.0			
Depth From:		30.0			
Depth To:		40.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Hole Diameter</u>					
Hole ID:		1007600791			
Diameter:		8.0			
Depth From:		0.0			
Depth To:		30.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Links</u>					
Bore Hole ID:	1007306972			Tag No:	A232612
Depth M:	12.192			Contractor:	6607
Year Completed:	2018			Path:	732\7321758.pdf
Well Completed Dt:	2018/01/27			Latitude:	43.5568073629561
Audit No:	Z266972			Longitude:	-79.5856440763172

<u>38</u>	1 of 1	NW/56.7	78.8 / 0.00	ON	BORE
Borehole ID:	649449			Inclin FLG:	No
OGF ID:	215549824			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	DEC-1959			Municipality:	
Static Water Level:	0.2			Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.556737
Total Depth m:	5			Longitude DD:	-79.586654
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614155

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Drill Method:	Diamond Drill			Nothing:	4823613
Orig Ground Elev m:	83.8			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	83.6				
Concession:					
Location D:					
Survey D:					
Comments:					

Borehole Geology Stratum

Geology Stratum ID:	218527011			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.3			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Soil			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	SOIL.				
Geology Stratum ID:	218527013			Mat Consistency:	Dense
Top Depth:	3.7			Material Moisture:	
Bottom Depth:	5			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:	Gravel			Depositional Gen:	
Gsc Material Description:					
Stratum Description:	TILL,CLAY,SILT, GRAVEL. GREY,DENSE. 019 010 0001001700120050				**Note: Many records provided by the department have a truncated [Stratum Description] field.
Geology Stratum ID:	218527012			Mat Consistency:	Compact
Top Depth:	.3			Material Moisture:	
Bottom Depth:	3.7			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	SAND,SILT,CLAY. BROWN,COMPACT, WATER STABLE AT 274.4 FEET.				

Source

Source Type:	Data Survey	Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada	Source Iden:	1
Source Date:	1956-1972	Scale or Res:	Varies
Confidence:	H	Horizontal:	NAD27
Observatio:		Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)		
Source Details:	File: TOR3.txt RecordID: 201080 NTS_Sheet: 30M12A		
Confiden 1:	Logged by professional. Exact and complete description of material and properties.		

Source List

Source Identifier:	1	Horizontal Datum:	NAD27
Source Type:	Data Survey	Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972	Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies		
Source Name:	Urban Geology Automated Information System (UGAIS)		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Originators:		Geological Survey of Canada			
39	1 of 1	W/58.4	78.8 / 0.00	ON	BORE
Borehole ID:		833902	Inclin FLG:		No
OGF ID:		215586033	SP Status:		Initial Entry
Status:		Decommissioned	Surv Elev:		No
Type:		Borehole	Piezometer:		No
Use:		Geotechnical/Geological Investigation	Primary Name:		
Completion Date:		25-MAY-1972	Municipality:		
Static Water Level:		4.1	Lot:		
Primary Water Use:			Township:		
Sec. Water Use:			Latitude DD:		43.555883
Total Depth m:		5.9	Longitude DD:		-79.587374
Depth Ref:		Ground Surface	UTM Zone:		17
Depth Elev:			Easting:		614098
Drill Method:		Boring	Northing:		4823517
Orig Ground Elev m:		85.5	Location Accuracy:		
Elev Reliabil Note:			Accuracy:		Within 10 metres
DEM Ground Elev m:		84.2			
Concession:					
Location D:		PORT CREDIT GO STATION * PLATFORM SHELTER			
Survey D:					
Comments:		W.L measured on May 26, 1972			
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:		6014830	Mat Consistency:		Hard
Top Depth:		5.8	Material Moisture:		
Bottom Depth:		5.9	Material Texture:		
Material Color:			Non Geo Mat Type:		
Material 1:		Till	Geologic Formation:		
Material 2:			Geologic Group:		
Material 3:			Geologic Period:		
Material 4:			Depositional Gen:		glacial
Gsc Material Description:					
Stratum Description:		Glacial till - hard **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:		6014828	Mat Consistency:		Loose
Top Depth:		0	Material Moisture:		
Bottom Depth:		4.1	Material Texture:		
Material Color:			Non Geo Mat Type:		Fill-Misc
Material 1:		Sand	Geologic Formation:		
Material 2:		Gravel	Geologic Group:		
Material 3:		Coal fragments	Geologic Period:		
Material 4:		Wood Fragments	Depositional Gen:		
Gsc Material Description:					
Stratum Description:		Asphalt top 0.03m, sand and gravel (occasional pieces of coal and wood), (fill), loose to compact **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:		6014829	Mat Consistency:		Very Dense
Top Depth:		4.1	Material Moisture:		
Bottom Depth:		5.8	Material Texture:		Fine
Material Color:		Brown	Non Geo Mat Type:		
Material 1:		Sand	Geologic Formation:		
Material 2:		Boulders	Geologic Group:		
Material 3:		Silt	Geologic Period:		
Material 4:			Depositional Gen:		
Gsc Material Description:					
Stratum Description:		Silty fine sand, brown, very dense, boulder **Note: Many records provided by the department have a truncated [Stratum Description] field.			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
40	1 of 1	WSW/58.8	78.8 / 0.00	ON	BORE
Borehole ID: 640918				Inclin FLG:	No
OGF ID: 215541313				SP Status:	Initial Entry
Status:				Surv Elev:	No
Type: Borehole				Piezometer:	No
Use: Geotechnical/Geological Investigation				Primary Name:	
Completion Date: JAN-1965				Municipality:	
Static Water Level:				Lot:	
Primary Water Use: Not Used				Township:	
Sec. Water Use:				Latitude DD:	43.555437
Total Depth m: 2.1				Longitude DD:	-79.587055
Depth Ref: Ground Surface				UTM Zone:	17
Depth Elev:				Easting:	614125
Drill Method: Power auger				Northing:	4823468
Orig Ground Elev m: 86.9				Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m: 83.3					
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: 218494069				Mat Consistency:	
Top Depth: .1				Material Moisture:	
Bottom Depth: .3				Material Texture:	
Material Color: Brown				Non Geo Mat Type:	
Material 1: Fill				Geologic Formation:	
Material 2: Gravel				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description: FILL,GRAVEL. BROWN.					
Geology Stratum ID: 218494070				Mat Consistency:	
Top Depth: .3				Material Moisture:	
Bottom Depth: 2.1				Material Texture:	
Material Color: Brown				Non Geo Mat Type:	
Material 1: Sand				Geologic Formation:	
Material 2: Silt				Geologic Group:	
Material 3: Clay				Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description: SAND,SILT,CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL. SAND **Note: Many records provided by the department have a truncated [Stratum Description] field.					
Geology Stratum ID: 218494068				Mat Consistency:	
Top Depth: 0				Material Moisture:	
Bottom Depth: .1				Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1: Asphalt				Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description: ASPHALT.					
<u>Source</u>					
Source Type: Data Survey				Source Appl:	Spatial/Tabular
Source Orig: Geological Survey of Canada				Source Iden:	1

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 088840 NTS_Sheet: 30M12A				
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.				
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
41	1 of 1	NE/59.7	79.8 / 1.00	30 Queen St East Mississauga ON	WWIS
Well ID:	7363631			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	07-Aug-2020 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	4XE7ZMP4			Contractor:	7609
Tag:	A283618			Form Version:	9
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:					
Bore Hole Information					
Bore Hole ID:	1008371674			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614264.00
Code OB Desc:				North83:	4823606.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	24-Jul-2020 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
Overburden and Bedrock					
Materials Interval					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		1008371789			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		1.5199999809265137			
Formation End Depth:		3.049999952316284			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008371788			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		01			
Most Common Material:		FILL			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:		77			
Mat3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		1.5199999809265137			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008371790			
Layer:		3			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		11			
Mat3 Desc:		GRAVEL			
Formation Top Depth:		3.049999952316284			
Formation End Depth:		4.570000171661377			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008371879			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008371881			
Layer:		3			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug From:		1.5199999809265137			
Plug To:		4.570000171661377			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008371855			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008371880			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		1.5199999809265137			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1008371756			
Method Construction Code:		E			
Method Construction:		Auger			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1008371724			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1008371817			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.5199999809265137			
Casing Diameter:		5.0			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1008371827			
Layer:		1			
Slot:		010			
Screen Top Depth:		1.5199999809265137			
Screen End Depth:		4.570000171661377			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Results of Well Yield Testing

Pumping Test Method Desc:

Pump Test ID: 1008371725

Pump Set At:

Static Level:

Final Level After Pumping:

Recommended Pump Depth:

Pumping Rate:

Flowing Rate:

Recommended Pump Rate:

Levels UOM: m

Rate UOM: LPM

Water State After Test Code:

Water State After Test:

Pumping Test Method:

Pumping Duration HR:

Pumping Duration MIN:

Flowing:

Hole Diameter

Hole ID: 1008371840

Diameter: 21.0

Depth From: 0.0

Depth To: 4.570000171661377

Hole Depth UOM: m

Hole Diameter UOM: cm

Links

Bore Hole ID: 1008371674

Depth M: 4.57

Year Completed: 2020

Well Completed Dt: 2020/07/24

Audit No: 4XE7ZMP4

Tag No: A283618

Contractor: 7609

Path: 736\7363631.pdf

Latitude: 43.5566590509865

Longitude: -79.585300882414

42	1 of 1	E/61.8	79.8 / 1.00	ON	BORE
Borehole ID:	640929			Inclin FLG:	No
OGF ID:	215541324			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.555897
Total Depth m:	2.1			Longitude DD:	-79.584259
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614350
Drill Method:	Power auger			Northing:	4823523
Orig Ground Elev m:	81.7			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	81.4				
Concession:					
Location D:					
Survey D:					
Comments:					

Borehole Geology Stratum

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Geology Stratum ID:	218494122			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:	Stones			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ASPHALT,STONES.				
Geology Stratum ID:	218494126			Mat Consistency:	
Top Depth:	.7			Material Moisture:	
Bottom Depth:	2.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Silt			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Sand			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SILT,CLAY,SAND. ALLUVIAL,AGE POST-GLACIAL. SAND-M **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	218494123			Mat Consistency:	
Top Depth:	.1			Material Moisture:	
Bottom Depth:	.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL,GRAVEL.				
Geology Stratum ID:	218494124			Mat Consistency:	
Top Depth:	.2			Material Moisture:	
Bottom Depth:	.4			Material Texture:	Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM,SILT, CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL.				
Geology Stratum ID:	218494125			Mat Consistency:	
Top Depth:	.4			Material Moisture:	
Bottom Depth:	.7			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	CLAY,SAND,SILT. ALLUVIAL,AGE POST-GLACIAL.				
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Details:		File: TOR1B.txt RecordID: 088950 NTS_Sheet: 30M12A			
Confiden 1:		Logs are approximately correct. Lack of information. Doubtful terminology.			
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				

43	1 of 1	ENE/61.9	78.8 / -0.09	ON	BORE
Borehole ID:	646205			Inclin FLG:	No
OGF ID:	215546588			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	MAY-1968			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.556353
Total Depth m:	8.2			Longitude DD:	-79.584682
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614315
Drill Method:	Diamond Drill			Northing:	4823573
Orig Ground Elev m:	81.1			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	82.9				
Concession:					
Location D:					
Survey D:					
Comments:					

Borehole Geology Stratum

Geology Stratum ID:	218514022	Mat Consistency:	Dense
Top Depth:	0	Material Moisture:	
Bottom Depth:	3	Material Texture:	
Material Color:	Brown	Non Geo Mat Type:	
Material 1:	Silt	Geologic Formation:	
Material 2:	Clay	Geologic Group:	
Material 3:	Sand	Geologic Period:	
Material 4:		Depositional Gen:	glacial

Gsc Material Description:
Stratum Description: SILT,CLAY,SAND. BROWN,GLACIAL,DENSE, AGE GLACIAL.

Geology Stratum ID:	218514023	Mat Consistency:	Hard
Top Depth:	3	Material Moisture:	
Bottom Depth:	7.1	Material Texture:	
Material Color:	Grey	Non Geo Mat Type:	
Material 1:	Till	Geologic Formation:	
Material 2:	Clay	Geologic Group:	
Material 3:		Geologic Period:	
Material 4:		Depositional Gen:	glacial

Gsc Material Description:
Stratum Description: TILL,CLAY. GREY,GLACIAL,HARD,AGE GLACIAL.

Geology Stratum ID:	218514024	Mat Consistency:	
Top Depth:	7.1	Material Moisture:	
Bottom Depth:	8.2	Material Texture:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material Color: Grey Material 1: Shale Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description: SHALE. GREY,MARINE,AGE ORDOVICIAN. 00000025AGE GLACIAL **Note: Many records provided by the department have a truncated [Stratum Description] field.					
Source					
Source Type: Data Survey Source Orig: Geological Survey of Canada Source Date: 1956-1972 Confidence: M Observatio: Source Name: Urban Geology Automated Information System (UGAIS) Source Details: File: TOR2.txt RecordID: 142270 NTS_Sheet: 30M12A Confiden 1: Reliable information but incomplete.					
Source Appl: Spatial/Tabular Source Iden: 1 Scale or Res: Varies Horizontal: NAD27 Verticalda: Mean Average Sea Level					
Source List					
Source Identifier: 1 Source Type: Data Survey Source Date: 1956-1972 Scale or Resolution: Varies Source Name: Urban Geology Automated Information System (UGAIS) Source Originators: Geological Survey of Canada					
Horizontal Datum: NAD27 Vertical Datum: Mean Average Sea Level Projection Name: Universal Transverse Mercator					
44	1 of 1	W/62.7	78.8 / 0.00	ON	BORE
Borehole ID: 649446 OGF ID: 215549821 Status: Type: Borehole Use: Geotechnical/Geological Investigation Completion Date: JUN-1969 Static Water Level: 0.2 Primary Water Use: Not Used Sec. Water Use: Total Depth m: 5.9 Depth Ref: Ground Surface Depth Elev: Drill Method: Power auger Orig Ground Elev m: 83.8 Elev Reliabil Note: DEM Ground Elev m: 83.7 Concession: Location D: Survey D: Comments:					
Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD: 43.556205 Longitude DD: -79.587285 UTM Zone: 17 Easting: 614105 Northing: 4823553 Location Accuracy: Accuracy: Not Applicable					
Borehole Geology Stratum					
Geology Stratum ID: 218527001 Top Depth: 0 Bottom Depth: .5 Material Color: Material 1: Fill Material 2: Sand Material 3: Gravel					
Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:		FILL,SAND,GRAVEL.			
Geology Stratum ID:	218527003			Mat Consistency:	Hard
Top Depth:	5.5			Material Moisture:	
Bottom Depth:	5.9			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:	Sand			Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:		TILL,SILT,CLAY,SAND.GREY,GLACIAL,HARD. 0001505000180075			**Note: Many records provided by the department have a truncated [Stratum Description] field.
Geology Stratum ID:	218527002			Mat Consistency:	Dense
Top Depth:	.5			Material Moisture:	
Bottom Depth:	5.5			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		SAND,SILT. BROWN,VERY DENSE, WATER STABLE AT 274.2 FEET.			
Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	H			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR3.txt RecordID: 201050 NTS_Sheet: 30M12A				
Confiden 1:	Logged by professional. Exact and complete description of material and properties.				
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
<u>45</u>	1 of 1	ESE/64.3	79.8 / 1.00	80 High Street E Mississauga ON L5G 1K4	EHS
Order No:	22033100164			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	RSC Report (Urban)			Client Prov/State:	ON
Report Date:	08-APR-22			Search Radius (km):	.3
Date Received:	31-MAR-22			X:	-79.58429309
Previous Site Name:				Y:	43.55560629
Lot/Building Size:					
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans; City Directory; Aerial Photos				
<u>46</u>	1 of 1	N/64.7	79.8 / 1.00	ON	BORE

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Borehole ID:	649450			Inclin FLG:	No
OGF ID:	215549825			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JUN-1969			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.557001
Total Depth m:	2.1			Longitude DD:	-79.586152
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614195
Drill Method:	Digging			Northing:	4823643
Orig Ground Elev m:	84.4			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	84.6				
Concession:					
Location D:					
Survey D:					
Comments:					

Borehole Geology Stratum

Geology Stratum ID:	218527014	Mat Consistency:	Compact
Top Depth:	0	Material Moisture:	
Bottom Depth:	1.2	Material Texture:	
Material Color:	Brown	Non Geo Mat Type:	
Material 1:	Sand	Geologic Formation:	
Material 2:	Silt	Geologic Group:	
Material 3:		Geologic Period:	
Material 4:		Depositional Gen:	
Gsc Material Description:			
Stratum Description:	SAND,SILT. BROWN,COMPACT.		

Geology Stratum ID:	218527015	Mat Consistency:	Stiff
Top Depth:	1.2	Material Moisture:	
Bottom Depth:	2.1	Material Texture:	
Material Color:		Non Geo Mat Type:	
Material 1:	Till	Geologic Formation:	
Material 2:	Silt	Geologic Group:	
Material 3:	Clay	Geologic Period:	
Material 4:	Sand	Depositional Gen:	glacial
Gsc Material Description:			
Stratum Description:	TILL,SILT,CLAY,SAND.GLACIAL,STIFF. 0000001500040025GRAVEL.		

Source

Source Type:	Data Survey	Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada	Source Iden:	1
Source Date:	1956-1972	Scale or Res:	Varies
Confidence:	H	Horizontal:	NAD27
Observatio:		Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)		
Source Details:	File: TOR3.txt RecordID: 201090 NTS_Sheet: 30M12A		
Confiden 1:	Logged by professional. Exact and complete description of material and properties.		

Source List

Source Identifier:	1	Horizontal Datum:	NAD27
Source Type:	Data Survey	Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972	Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies		
Source Name:	Urban Geology Automated Information System (UGAIS)		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Originators:		Geological Survey of Canada			
47	1 of 1	E/66.1	79.6 / 0.79	ON	BORE
Borehole ID: 639273		Inclin FLG: No			
OGF ID: 215539670		SP Status: Initial Entry			
Status:		Surv Elev: No			
Type: Borehole		Piezometer: No			
Use: Geotechnical/Geological Investigation		Primary Name:			
Completion Date: JAN-1965		Municipality:			
Static Water Level:		Lot:			
Primary Water Use: Not Used		Township:			
Sec. Water Use:		Latitude DD: 43.556259			
Total Depth m: 1.2		Longitude DD: -79.584436			
Depth Ref: Ground Surface		UTM Zone: 17			
Depth Elev:		Easting: 614335			
Drill Method: Power auger		Northing: 4823563			
Orig Ground Elev m: 82.8		Location Accuracy:			
Elev Reliabil Note:		Accuracy: Not Applicable			
DEM Ground Elev m: 82.5					
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: 218487720		Mat Consistency:			
Top Depth: .3		Material Moisture:			
Bottom Depth: .5		Material Texture: Medium			
Material Color: Brown		Non Geo Mat Type:			
Material 1: Fill		Geologic Formation:			
Material 2: Sand		Geologic Group:			
Material 3: Silt		Geologic Period:			
Material 4: Clay		Depositional Gen: fill			
Gsc Material Description:					
Stratum Description: FILL,SAND-MEDIUM, SILT,CLAY. BROWN.					
Geology Stratum ID: 218487722		Mat Consistency:			
Top Depth: .6		Material Moisture: Wet			
Bottom Depth: 1.2		Material Texture:			
Material Color: Brown		Non Geo Mat Type:			
Material 1: Sand		Geologic Formation:			
Material 2: Silt		Geologic Group:			
Material 3: Clay		Geologic Period:			
Material 4:		Depositional Gen: alluvial			
Gsc Material Description:					
Stratum Description: SAND,SILT,CLAY. BROWN,ALLUVIAL,WET. GLACIAL.					
Geology Stratum ID: 218487718		Mat Consistency:			
Top Depth: 0		Material Moisture:			
Bottom Depth: 0		Material Texture:			
Material Color:		Non Geo Mat Type:			
Material 1: Asphalt		Geologic Formation:			
Material 2:		Geologic Group:			
Material 3:		Geologic Period:			
Material 4:		Depositional Gen:			
Gsc Material Description:					
Stratum Description: ASPHALT.					
Geology Stratum ID: 218487719		Mat Consistency:			
Top Depth: 0		Material Moisture:			
Bottom Depth: .3		Material Texture:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material Color:			Non Geo Mat Type:		
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL,GRAVEL.				
Geology Stratum ID:	218487721			Mat Consistency:	
Top Depth:	.5			Material Moisture:	
Bottom Depth:	.6			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Soil			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:	Clay			Depositional Gen:	
Gsc Material Description:					
Stratum Description:	SOIL,SAND,SILT,CLAY.BROWN.				
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 072360 NTS_Sheet: 30M12A				
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.				
<u>Source List</u>					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
48	1 of 1	W/66.1	78.8 / 0.00	ON	WWIS
Well ID:	7378962			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	29-Jan-2021 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z348113			Contractor:	7644
Tag:	A312084			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Bore Hole Information

Bore Hole ID: 1008614901
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 18-Dec-2020 00:00:00
Remarks:
Loc Method Desc: on Water Well Record
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 17
East83: 614095.00
North83: 4823542.00
Org CS: UTM83
UTMRC: 4
UTMRC Desc: margin of error : 30 m - 100 m
Location Method: wwr

Links

Bore Hole ID: 1008614901
Depth M:
Year Completed: 2020
Well Completed Dt: 2020/12/18
Audit No: Z348113

Tag No: A312084
Contractor: 7644
Path: 737\7378962.pdf
Latitude: 43.5561088255329
Longitude: -79.5874060999537

[49](#)

1 of 1

WNW/67.3

78.8 / 0.00

ON

BORE

Borehole ID: 833844
OGF ID: 215585975
Status: Decommissioned
Type: Borehole
Use: Geotechnical/Geological Investigation
Completion Date: 20-JUN-1969
Static Water Level: 2.7
Primary Water Use:
Sec. Water Use:
Total Depth m: 4
Depth Ref: Ground Surface
Depth Elev:
Drill Method: Hand auger
Orig Ground Elev m: 83.8
Elev Reliabil Note:
DEM Ground Elev m: 82.4
Concession:
Location D: CNR (PORT CREDIT) * GO TRANSIT PARKING LOT EXTENSION
Survey D:
Comments: W.L measured in hand augered hole on June 21st, 1969

Inclin FLG: No
SP Status: Initial Entry
Surv Elev: No
Piezometer: No
Primary Name:
Municipality:
Lot:
Township:
Latitude DD: 43.556394
Longitude DD: -79.587164
UTM Zone: 17
Easting: 614114
Northing: 4823574
Location Accuracy:
Accuracy: Within 10 metres

Borehole Geology Stratum

Geology Stratum ID: 6014612
Top Depth: 0
Bottom Depth: 3.3
Material Color: Brown-Grey
Material 1: Sand
Material 2: Silt
Material 3:
Material 4:
Gsc Material Description:

Mat Consistency: Dense
Material Moisture:
Material Texture: Fine
Non Geo Mat Type:
Geologic Formation:
Geologic Group:
Geologic Period:
Depositional Gen:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Stratum Description:		Silty fine sand, brown to grey, dense **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:	6014613			Mat Consistency:	Very Stiff
Top Depth:	3.3			Material Moisture:	
Bottom Depth:	4			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Sand			Geologic Period:	
Material 4:	Gravel			Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:		Clayey silt, some sand and gravel, (glacial till), grey, very stiff **Note: Many records provided by the department have a truncated [Stratum Description] field.			
<u>50</u>	1 of 1	SSE/67.3	79.4 / 0.53	ON	BORE
Borehole ID:	640920			Inclin FLG:	No
OGF ID:	215541315			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.555015
Total Depth m:	2.7			Longitude DD:	-79.585765
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614230
Drill Method:	Power auger			Northing:	4823423
Orig Ground Elev m:	81.7			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	81.2				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218494073			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		ASPHALT.			
Geology Stratum ID:	218494074			Mat Consistency:	
Top Depth:	.1			Material Moisture:	
Bottom Depth:	.3			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:		FILL, GRAVEL. BROWN.			
Geology Stratum ID:	218494076			Mat Consistency:	

51	1 of 1	WNW/69.6	78.8 / 0.00	PORT CREDIT GO STATION PORT CREDIT ON	WWIS
Well ID:	7310439			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	17-Apr-2018 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z266994			Contractor:	6607

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Tag:	A232662			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY (PORT CREDIT)			
Site Info:					
PDF URL (Map):					
Additional Detail(s) (Map)					
Well Completed Date: 2018/02/03					
Year Completed: 2018					
Depth (m): 12.2					
Latitude: 43.5564922174492					
Longitude: -79.5871000029076					
Path:					
Bore Hole Information					
Bore Hole ID: 1007036930					
DP2BR:					
Spatial Status:					
Code OB:					
Code OB Desc:					
Open Hole:					
Cluster Kind:					
Date Completed: 03-Feb-2018 00:00:00					
Remarks:					
Loc Method Desc: on Water Well Record					
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
Overburden and Bedrock					
Materials Interval					
Formation ID: 1007268326					
Layer: 3					
Color: 6					
General Color: BROWN					
Mat1: 06					
Most Common Material: SILT					
Mat2: 17					
Mat2 Desc: SHALE					
Mat3: 73					
Mat3 Desc: HARD					
Formation Top Depth: 3.200000047683716					
Formation End Depth: 7.599999904632568					
Formation End Depth UOM: m					
Overburden and Bedrock					
Materials Interval					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		1007268325			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.699999988079071			
Formation End Depth:		3.200000047683716			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007268324			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		01			
Mat3 Desc:		FILL			
Formation Top Depth:		0.0			
Formation End Depth:		0.699999988079071			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007268327			
Layer:		4			
Color:		7			
General Color:		RED			
Mat1:		17			
Most Common Material:		SHALE			
Mat2:		15			
Mat2 Desc:		LIMESTONE			
Mat3:		26			
Mat3 Desc:		ROCK			
Formation Top Depth:		7.599999904632568			
Formation End Depth:		12.199999809265137			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007268337			
Layer:		3			
Plug From:		7.599999904632568			
Plug To:		8.899999618530273			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007268335			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007268336			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		7.599999904632568			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1007268334			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:		DIAMOND			
 <u>Pipe Information</u>					
Pipe ID:		1007268323			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1007268331			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		9.199999809265137			
Casing Diameter:		5.099999904632568			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1007268332			
Layer:		1			
Slot:		10			
Screen Top Depth:		9.199999809265137			
Screen End Depth:		12.199999809265137			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.400000095367432			
 <u>Water Details</u>					
Water ID:		1007268330			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Hole Diameter

Hole ID: 1007268329
Diameter: 9.600000381469727
Depth From: 7.599999904632568
Depth To: 12.199999809265137
Hole Depth UOM: m
Hole Diameter UOM: cm

Hole Diameter

Hole ID: 1007268328
Diameter: 21.0
Depth From: 0.0
Depth To: 7.599999904632568
Hole Depth UOM: m
Hole Diameter UOM: cm

Links

Bore Hole ID:	1007036930	Tag No:	A232662
Depth M:	12.2	Contractor:	6607
Year Completed:	2018	Path:	731\7310439.pdf
Well Completed Dt:	2018/02/03	Latitude:	43.5564922174492
Audit No:	Z266994	Longitude:	-79.5871000029076

52	1 of 1	WNW/71.7	78.8 / 0.00	PORT CREDIT GO STATION PORT CREDIT ON	WWIS

Well ID: 7321737 Construction Date: Use 1st: Monitoring Use 2nd: Final Well Status: Observation Wells Water Type: Casing Material: Audit No: Z266906 Tag: A232817 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: MISSISSAUGA CITY (PORT CREDIT) Site Info:	Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 07-Nov-2018 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 6607 Form Version: 7 Owner: County: PEEL Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:

PDF URL (Map):

Additional Detail(s) (Map)

Well Completed Date: 2018/01/19
Year Completed: 2018
Depth (m): 15.2
Latitude: 43.5565370718042
Longitude: -79.5870865738659
Path:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Bore Hole Information</u>					
Bore Hole ID:	1007306909			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614120.00
Code OB Desc:				North83:	4823590.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	19-Jan-2018 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007599590				
Layer:	2				
Color:	2				
General Color:	GREY				
Mat1:	05				
Most Common Material:	CLAY				
Mat2:	06				
Mat2 Desc:	SILT				
Mat3:	85				
Mat3 Desc:	SOFT				
Formation Top Depth:	1.5				
Formation End Depth:	6.0				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007599591				
Layer:	3				
Color:	2				
General Color:	GREY				
Mat1:	06				
Most Common Material:	SILT				
Mat2:	11				
Mat2 Desc:	GRAVEL				
Mat3:	73				
Mat3 Desc:	HARD				
Formation Top Depth:	6.0				
Formation End Depth:	9.100000381469727				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007599592				
Layer:	4				
Color:	2				
General Color:	GREY				
Mat1:	15				
Most Common Material:	LIMESTONE				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat2:		26			
Mat2 Desc:		ROCK			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		9.100000381469727			
Formation End Depth:		15.199999809265137			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007599589			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		1.5			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007599600			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007599601			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		11.800000190734863			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007599599			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:		DIAMOND			
<u>Pipe Information</u>					
Pipe ID:		1007599588			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007599596			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:					
		1			
Material:					
		5			
Open Hole or Material:					
		PLASTIC			
Depth From:					
		0.0			
Depth To:					
		12.100000381469727			
Casing Diameter:					
		5.099999904632568			
Casing Diameter UOM:					
		cm			
Casing Depth UOM:					
		m			
Construction Record - Screen					
Screen ID:					
		1007599597			
Layer:					
		1			
Slot:					
		10			
Screen Top Depth:					
		12.100000381469727			
Screen End Depth:					
		15.199999809265137			
Screen Material:					
		5			
Screen Depth UOM:					
		m			
Screen Diameter UOM:					
		cm			
Screen Diameter:					
		6.400000095367432			
Water Details					
Water ID:					
		1007599595			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:					
		m			
Hole Diameter					
Hole ID:					
		1007599593			
Diameter:					
		21.0			
Depth From:					
		0.0			
Depth To:					
		9.100000381469727			
Hole Depth UOM:					
		m			
Hole Diameter UOM:					
		cm			
Hole Diameter					
Hole ID:					
		1007599594			
Diameter:					
		9.600000381469727			
Depth From:					
		9.100000381469727			
Depth To:					
		15.199999809265137			
Hole Depth UOM:					
		m			
Hole Diameter UOM:					
		cm			
Links					
Bore Hole ID:					
		1007306909		Tag No:	A232817
Depth M:					
		15.2		Contractor:	6607
Year Completed:					
		2018		Path:	732\7321737.pdf
Well Completed Dt:					
		2018/01/19		Latitude:	43.5565370718042
Audit No:					
		Z266906		Longitude:	-79.5870865738659
53	1 of 1	NW/76.2	79.1 / 0.29	ON	BORE
Borehole ID:					
		833865		Inclin FLG:	No
OGF ID:					
		215585996		SP Status:	Initial Entry

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status:	Decommissioned			Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	17-DEC-1959			Municipality:	
Static Water Level:	1.8			Lot:	
Primary Water Use:				Township:	
Sec. Water Use:				Latitude DD:	43.556867
Total Depth m:	5			Longitude DD:	-79.586819
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614141
Drill Method:	Hollow stem auger			Northing:	4823627
Orig Ground Elev m:	83.8			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Within 10 metres
DEM Ground Elev m:	81.1				
Concession:					
Location D:	CNR AT PORT CREDIT * CREEK DIVERSION				
Survey D:					
Comments:					
 <u>Borehole Geology Stratum</u>					
Geology Stratum ID:	6014682			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.3			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Topsoil			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	Topsoil **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	6014683			Mat Consistency:	Dense
Top Depth:	.3			Material Moisture:	
Bottom Depth:	3.7			Material Texture:	Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	Medium to dense, light brown, silty sand with a seam of brown, sandy clay at 2.13m **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	6014684			Mat Consistency:	Dense
Top Depth:	3.7			Material Moisture:	
Bottom Depth:	5			Material Texture:	Fine
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Gravel			Geologic Period:	
Material 4:	Sand			Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	Dense glacial till (grey, silty clay with gravel & fine sand) **Note: Many records provided by the department have a truncated [Stratum Description] field.				

54

1 of 1

SE/78.5

79.8 / 1.00

ON

BORE

Borehole ID: 641139
OGF ID: 215541534
Status:
Type: Borehole
Use: Geotechnical/Geological Investigation

Inclin FLG: No
SP Status: Initial Entry
Surv Elev: No
Piezometer: No
Primary Name:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.555055
Total Depth m:	2.7			Longitude DD:	-79.585331
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614265
Drill Method:	Power auger			Northing:	4823428
Orig Ground Elev m:	80.2			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	80.2				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218494918			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	0			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ASPHALT.				
Geology Stratum ID:	218494920			Mat Consistency:	
Top Depth:	.2			Material Moisture:	
Bottom Depth:	.3			Material Texture:	Medium
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM,SILT, CLAY. GREY,ALLUVIAL, AGE POST-GLACIAL.				
Geology Stratum ID:	218494921			Mat Consistency:	
Top Depth:	.3			Material Moisture:	
Bottom Depth:	1.2			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Silt			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SILT,SAND,CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL.				
Geology Stratum ID:	218494919			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL,GRAVEL.				
Geology Stratum ID:	218494922			Mat Consistency:	
Top Depth:	1.2			Material Moisture:	
Bottom Depth:	2.1			Material Texture:	Medium

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM,SILT, CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL.				
Geology Stratum ID:	218494923			Mat Consistency:	
Top Depth:	2.1			Material Moisture:	
Bottom Depth:	2.7			Material Texture:	Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM,SILT. BROWN,ALLUVIAL, AGE POST-GLACIAL.				
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 091050 NTS_Sheet: 30M12A				
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.				
<u>Source List</u>					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
55	1 of 1	NE/79.6	79.8 / 1.00	ON	BORE
Borehole ID:	646209			Inclin FLG:	No
OGF ID:	215546592			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	MAY-1968			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.556809
Total Depth m:	3.5			Longitude DD:	-79.585166
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614275
Drill Method:	Diamond Drill			Northing:	4823623
Orig Ground Elev m:	81.4			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	83.8				
Concession:					
Location D:					
Survey D:					
Comments:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218514036			Mat Consistency:	Dense
Top Depth:	0			Material Moisture:	
Bottom Depth:	2.3			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Silt			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	SILT,SAND,CLAY. BROWN,GLACIAL,DENSE, AGE GLACIAL.				
Geology Stratum ID:	218514037			Mat Consistency:	Hard
Top Depth:	2.3			Material Moisture:	
Bottom Depth:	3.5			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	TILL,CLAY. GREY,GLACIAL,HARD,AGE GLACIAL. 028 012 0000002600075044 **Note: Many records provided by the department have a truncated [Stratum Description] field.				
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR2.txt RecordID: 142310 NTS_Sheet: 30M12A				
Confiden 1:	Reliable information but incomplete.				
<u>Source List</u>					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
56	1 of 2	NE/84.8	79.5 / 0.61	Port Credit Mississauga ON	EHS
Order No:	20200612061			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	17-JUN-20			Search Radius (km):	.25
Date Received:	12-JUN-20			X:	-79.5849211
Previous Site Name:				Y:	43.5567367
Lot/Building Size:					
Additional Info Ordered:					
56	2 of 2	NE/84.8	79.5 / 0.61	Port Credit Mississauga ON	EHS
Order No:	20200612061			Nearest Intersection:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status: C Report Type: Standard Report Report Date: 17-JUN-20 Date Received: 12-JUN-20 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.5849211 Y: 43.5567367					
57	1 of 10	ESE/87.6	79.8 / 1.00	BELL CANADA 80 HIGH ST E MISSISSAUGA L5G 1K2 ON CA ON	CFOT
Licence No: Registration No: Posse File No: Posse Reg No: Status Name: Tank Type: Double Wall UST Tank Size: 5000 Tank Material: Fiberglass (FRP) Instance No: 64643253 Inst Creation Date: 3/6/2014 12:20:42 PM Inst Install Date: 3/6/2014 12:20:42 PM Item: FS FUEL OIL TANK Tank Age (as of 05/1992): Device Installed Location: 80 HIGH ST E MISSISSAUGA L5G 1K2 ON CA Description: Veeder-Root Leak Detection System. Brine interstitial monitoring Contact Name: Contact Address: Contact Address2: Contact Suite: Contact City: Contact Prov: Contact Postal:					
Item Description: Fuel Oil Tank Instance Type: Facility Type: Fuel Type: Distributor: Letter Sent: Comments: Corrosion Protect: Province: Nbr: Context: FS Fuel Oil Tank					
57	2 of 10	ESE/87.6	79.8 / 1.00	Bell 80 High St Mississauga ON L5G 1K2	GEN
Generator No: ON8534293 SIC Code: 517210, 517510, 517910 SIC Description: WIRELESS TELECOMMUNICATIONS CARRIERS (EXCEPT SATELLITE), 517510, OTHER TELECOMMUNICATIONS Approval Years: 2015 PO Box No: Country: Canada					
Status: Co Admin: Julie Labelle Choice of Contact: CO_ADMIN Phone No Admin: 5148700688 Ext. Contam. Facility: No MHSW Facility: No					
Detail(s)					
Waste Class: 251 Waste Class Desc: OIL SKIMMINGS & SLUDGES Waste Class: 221 Waste Class Desc: LIGHT FUELS					
57	3 of 10	ESE/87.6	79.8 / 1.00	Bell 80 High St Port Credit ON L5G 1K4	GEN
Generator No: ON9607199 Status:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Code: SIC Description:	517210, 517510, 517910 WIRELESS TELECOMMUNICATIONS CARRIERS (EXCEPT SATELLITE), 517510, OTHER TELECOMMUNICATIONS			Co Admin: Choice of Contact:	Chloé Lamothe-Luneau CO_ADMIN
Approval Years: PO Box No: Country:	2016 Canada			Phone No Admin: Contam. Facility: MHSW Facility:	514-391-1021 Ext. No No
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:	243 PCBS				
Waste Class: Waste Class Desc:	121 ALKALINE WASTES - HEAVY METALS				
57	4 of 10	ESE/87.6	79.8 / 1.00	Bell 80 High St Mississauga ON L5G 1K2	GEN
Generator No: SIC Code: SIC Description:	ON8534293 517210, 517510, 517910 WIRELESS TELECOMMUNICATIONS CARRIERS (EXCEPT SATELLITE), 517510, OTHER TELECOMMUNICATIONS			Status: Co Admin: Choice of Contact:	Julie Labelle CO_ADMIN
Approval Years: PO Box No: Country:	2014 Canada			Phone No Admin: Contam. Facility: MHSW Facility:	5148700688 Ext. No No
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:	221 LIGHT FUELS				
Waste Class: Waste Class Desc:	251 OIL SKIMMINGS & SLUDGES				
57	5 of 10	ESE/87.6	79.8 / 1.00	Bell 80 High St Port Credit ON L5G 1K4	GEN
Generator No: SIC Code: SIC Description:	ON9607199 			Status: Co Admin: Choice of Contact:	Registered
Approval Years: PO Box No: Country:	As of Dec 2018 Canada			Phone No Admin: Contam. Facility: MHSW Facility:	
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:	121 C Alkaline slutions - containing heavy metals				
Waste Class: Waste Class Desc:	221 L Light fuels				
Waste Class: Waste Class Desc:	243 D PCB				
Waste Class: Waste Class Desc:	251 L Waste oils/sludges (petroleum based)				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
57	6 of 10	ESE/87.6	79.8 / 1.00	80 High Street East Mississauga ON	SPL
Ref No: 6026-AP7STY Site No: NA Incident Dt: 7/12/2017 Year: Incident Cause: Incident Event: Overflow/Surcharge Contaminant Code: 44 Contaminant Name: SEWAGE,RAW UNCHLORINATED Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: n/a Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: Land MOE Response: No Dt MOE Arvl on Scn: MOE Reported Dt: 7/12/2017 Dt Document Closed: 7/19/2017 Incident Reason: Blockage Site Name: Sanitary sewer blockage<UNOFFICIAL> Site County/District: Regional Municipality of Peel Site Geo Ref Meth: Incident Summary: DWMD: Rgn of Peel sanitary sewer blockage surcharge to prvt property. Contaminant Qty: 1 n/a		Discharger Report: Material Group: Health/Env Conseq: 2 - Minor Environment Client Type: Sector Type: Municipal Sewage Agency Involved: Nearest Watercourse: Site Address: 80 High Street East Site District Office: Halton-Peel Site Postal Code: Site Region: Central Site Municipality: Mississauga Site Lot: Site Conc: Northing: 4823475.24 Easting: 614406.87 Site Geo Ref Accu: Site Map Datum: SAC Action Class: Land Spills Source Type: Sewer (Private or Municipal)			
57	7 of 10	ESE/87.6	79.8 / 1.00	Bell Canada 80 High Street Mississauga ON	SPL
Ref No: 7617-B5LNZS Site No: NA Incident Dt: 2018/10/16 Year: Incident Cause: Incident Event: Overflow/Surcharge Contaminant Code: 13 Contaminant Name: DIESEL FUEL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: 1202 Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: Land MOE Response: No Dt MOE Arvl on Scn: MOE Reported Dt: 2018/10/16 Dt Document Closed: 2018/11/27 Incident Reason: Equipment Failure Site Name: Commerical Area<UNOFFICIAL> Site County/District: Regional Municipality of Peel Site Geo Ref Meth: Incident Summary: Bell: 5L diesel spill to ground, cntd. Contaminant Qty: 5 L		Discharger Report: Material Group: Health/Env Conseq: 2 - Minor Environment Client Type: Corporation Sector Type: Miscellaneous Communal Agency Involved: Nearest Watercourse: Site Address: 80 High Street Site District Office: Halton-Peel Site Postal Code: Site Region: Central Site Municipality: Mississauga Site Lot: Site Conc: Northing: 4823475.22 Easting: 614406.87 Site Geo Ref Accu: Site Map Datum: SAC Action Class: Land Spills Source Type: Tank - Above Ground			
57	8 of 10	ESE/87.6	79.8 / 1.00	Bell 80 High St	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Port Credit ON L5G 1K4					
Generator No:	ON9607199			Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:	As of Jul 2020			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:	Canada			MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:	121 C				
Waste Class Desc:	Alkaline slutions - containing heavy metals				
Waste Class:	221 L				
Waste Class Desc:	Light fuels				
Waste Class:	251 L				
Waste Class Desc:	Waste oils/sludges (petroleum based)				
Waste Class:	243 D				
Waste Class Desc:	PCB				
57	9 of 10	ESE/87.6	79.8 / 1.00	BELL CANADA 80 HIGH ST E MISSISSAUGA L5G 1K2 ON CA ON	DTNK
<u>Delisted Fuel Storage Tank</u>					
Instance No:	64643253			Creation Date:	3/6/2014 12:21:32 PM
Status:	Active			Overfill Prot Type:	
Instance Type:				Facility Location:	80 HIGH ST E MISSISSAUGA L5G 1K2 ON CA
Fuel Type:				Piping SW Steel:	
Cont Name:				Piping SW Galvan:	
Capacity:	5000			Tanks SW Steel:	
Tank Material:	Fiberglass (FRP)			Piping Underground:	
Corrosion Prot:	Fiberglass			No Underground:	
Tank Type:	Double Wall UST			Max Hazard Rank:	NULL
Install Year:	2014			Max Hazard Rank 1:	NULL
Facility Type:	FS FUEL OIL TANK			Nxt Period Start Dt:	NULL
Device Installed Loc:				Program Area 1:	NULL
Fuel Type 2:				Program Area 2:	NULL
Fuel Type 3:				Nxt Period Strt Dt 2:	NULL
Item:				Risk Based Periodic:	NULL
Item Description:	Fuel Oil Tank			Vol of Directives:	NULL
Model:	NULL			Years in Service:	NULL
Description:	Veeder-Root Leak Detection System. Brine interstitial monitoring			Created Date:	NULL
Instance Creation Dt:	3/6/2014 12:20:42 PM			Federal Device:	NULL
Instance Install Dt:	3/6/2014 12:20:42 PM			Periodic Exempt:	NULL
Manufacturer:	NULL			Statutory Interval:	NULL
Serial No:	NULL			Rcomnd Insp Interval:	NULL
ULC Standard:	NULL			Recommended Toler:	NULL
Quantity:	1			Panam Venue Name:	NULL
Unit of Measure:	EA			External Identifier:	NULL
Parent Fac Type:					
TSSA Base Sched Cycle 1:	NULL				
TSSA Base Sched Cycle 2:	NULL				
Original Source:	FST				
Record Date:	31-MAY-2021				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
57	10 of 10	ESE/87.6	79.8 / 1.00	Bell 80 High St Port Credit ON L5G 1K4	GEN
Generator No:		ON9607199	Status: Registered		
SIC Code:			Co Admin:		
SIC Description:			Choice of Contact:		
Approval Years:		As of Nov 2021	Phone No Admin:		
PO Box No:			Contam. Facility:		
Country:		Canada	MHSW Facility:		
<u>Detail(s)</u>					
Waste Class:		221 L			
Waste Class Desc:		Light fuels			
Waste Class:		251 L			
Waste Class Desc:		Waste oils/sludges (petroleum based)			
Waste Class:		121 C			
Waste Class Desc:		Alkaline slutions - containing heavy metals			
Waste Class:		243 D			
Waste Class Desc:		PCB			
58	1 of 7	SSE/90.6	79.8 / 1.00	Kanco-55 Park Ltd. 55 Park St E Mississauga ON	CA
Certificate #:		8999-7PKSRW			
Application Year:		2009			
Issue Date:		2/27/2009			
Approval Type:		Air			
Status:		Approved			
Application Type:					
Client Name:					
Client Address:					
Client City:					
Client Postal Code:					
Project Description:					
Contaminants:					
Emission Control:					
58	2 of 7	SSE/90.6	79.8 / 1.00	55 Park Street East Mississauga ON	EHS
Order No:		20110531030	Nearest Intersection:		
Status:		C	Municipality:		
Report Type:		Custom Report	Client Prov/State: ON		
Report Date:		6/7/2011	Search Radius (km): 0.25		
Date Received:		5/31/2011 1:34:06 PM	X: -79.585866		
Previous Site Name:			Y: 43.554916		
Lot/Building Size:					
Additional Info Ordered:					
58	3 of 7	SSE/90.6	79.8 / 1.00	55 PARK STREET EAST, MISSISSAUGA ON	INC
Incident No:		1351280	Any Health Impact: No		
Incident ID:			Any Enviro Impact: No		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Instance No: Status Code: Attribute Category: FS-Perform L1 Incident Insp Context: Date of Occurrence: 2014/03/10 00:00:00 Time of Occurrence: 03:35:00 Incident Created On: Instance Creation Dt: Instance Install Dt: Occur Insp Start Date: 2014/03/10 00:00:00 Approx Quant Rel: Tank Capacity: Fuels Occur Type: Fire Fuel Type Involved: Natural Gas Enforcement Policy: NULL Prc Escalation Req: NULL Tank Material Type: Tank Storage Type: Tank Location Type: Pump Flow Rate Cap: Task No: 4837033 Notes: Drainage System: Sub Surface Contam.: Aff Prop Use Water: Contam. Migrated: Contact Natural Env: Incident Location: 55 PARK STREET EAST, MISSISSAUGA - FIRE Occurrence Narrative: CO produced by boiler with poor maintenance Operation Type Involved: Multi-unit Residential Item: Item Description: Device Installed Location: Service Interrupted: Yes Was Prop Damaged: Yes Reside App. Type: Commer App. Type: Indus App. Type: Institut App. Type: Venting Type: Vent Conn Mater: Vent Chimney Mater: Pipeline Type: Pipeline Involved: Pipe Material: Depth Ground Cover: Regulator Location: Regulator Type: Operation Pressure: Liquid Prop Make: Liquid Prop Model: Liquid Prop Serial No: Liquid Prop Notes: Equipment Type: Equipment Model: Serial No: Cylinder Capacity: Cylinder Cap Units: Cylinder Mat Type: Near Body of Water:					
58	4 of 7	SSE/90.6	79.8 / 1.00	55 PARK STREET EAST, MISSISSAUGA ON	INC
Incident No: 1351280 Incident ID: Instance No: Status Code: Attribute Category: FS-Perform L1 Incident Insp Context: Date of Occurrence: 2014/03/10 00:00:00 Time of Occurrence: 03:35:00 Incident Created On: Instance Creation Dt: Instance Install Dt: Occur Insp Start Date: 2014/03/10 00:00:00 Approx Quant Rel: Tank Capacity: Fuels Occur Type: Fire Fuel Type Involved: Natural Gas Enforcement Policy: NULL Prc Escalation Req: NULL Tank Material Type: Tank Storage Type: Tank Location Type: Pump Flow Rate Cap: Task No: 4900638 Notes: Drainage System: Sub Surface Contam.: Aff Prop Use Water: Any Health Impact: No Any Enviro Impact: No Service Interrupted: Yes Was Prop Damaged: Yes Reside App. Type: Commer App. Type: Indus App. Type: Institut App. Type: Venting Type: Vent Conn Mater: Vent Chimney Mater: Pipeline Type: Pipeline Involved: Pipe Material: Depth Ground Cover: Regulator Location: Regulator Type: Operation Pressure: Liquid Prop Make: Liquid Prop Model: Liquid Prop Serial No: Liquid Prop Notes: Equipment Type: Equipment Model: Serial No: Cylinder Capacity: Cylinder Cap Units:					

169 erisinfo.com | Environmental Risk Information Services Order No: 22091501030

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Full Address: Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/3718-7NWSDQ-14.pdf PDF Site Location:					
58	7 of 7	SSE/90.6	79.8 / 1.00	55 Park Street East Mississauga ON L5G 1L9	EHS
Order No: 20190822037 Status: C Report Type: Standard Report Report Date: 27-AUG-19 Date Received: 22-AUG-19 Previous Site Name: Lot/Building Size: Additional Info Ordered:		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.585619 Y: 43.55483			
59	1 of 1	NNE/90.8	79.8 / 1.00	GO STATION PARKING LOT PORT CREDIT ON	WWIS
Well ID: 7307874 Construction Date: Use 1st: Monitoring Use 2nd: Final Well Status: Observation Wells Water Type: Casing Material: Audit No: Z255690 Tag: A241358 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: MISSISSAUGA CITY (PORT CREDIT) Site Info:		Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 15-Mar-2018 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 6607 Form Version: 7 Owner: County: PEEL Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:			
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 2018/01/12 Year Completed: 2018 Depth (m): 5.3 Latitude: 43.557167574587 Longitude: -79.5856480304261 Path:					
<u>Bore Hole Information</u>					
Bore Hole ID: 1007003612 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 12-Jan-2018 00:00:00		Elevation: Elevrc: Zone: 17 East83: 614235.00 North83: 4823662.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Remarks:		Location Method:			WWF
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007230203			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		1.5			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007230205			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		4.5			
Formation End Depth:		5.300000190734863			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007230204			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		1.5			
Formation End Depth:		4.5			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		1007230212			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007230213			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		1.5			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007230211			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007230202			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007230208			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.5			
Casing Diameter:		5.099999904632568			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007230209			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.5			
Screen End Depth:		5.300000190734863			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.400000095367432			
<u>Water Details</u>					
Water ID:		1007230207			
Layer:					
Kind Code:					
Kind:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1007230206			
Diameter:		21.0			
Depth From:		0.0			
Depth To:		5.300000190734863			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:		1007003612		Tag No:	A241358
Depth M:		5.3		Contractor:	6607
Year Completed:		2018		Path:	730\7307874.pdf
Well Completed Dt:		2018/01/12		Latitude:	43.557167574587
Audit No:		Z255690		Longitude:	-79.5856480304261

60	1 of 7	ENE/91.9	79.8 / 0.98	30 QUEEN ST E Mississauga ON	WWIS
Well ID: 7234471					
Construction Date:				Flowing (Y/N):	
Use 1st: Monitoring				Flow Rate:	
Use 2nd:				Data Entry Status:	
Final Well Status: Observation Wells				Data Src:	
Water Type:				Date Received: 30-Dec-2014 00:00:00	
Casing Material:				Selected Flag: TRUE	
Audit No: Z192922				Abandonment Rec:	
Tag: A168568				Contractor: 7295	
Constructn Method:				Form Version: 7	
Elevation (m):				Owner:	
Elevatn Reliabilty:				County:	
Depth to Bedrock:				Lot:	
Well Depth:				Concession:	
Overburden/Bedrock:				Concession Name:	
Pump Rate:				Easting NAD83:	
Static Water Level:				Northing NAD83:	
Clear/Cloudy:				Zone:	
Municipality:				UTM Reliability:	
Site Info:					

Bore Hole Information

Bore Hole ID: 1005281118		Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone: 17	
Code OB:		East83:	
Code OB Desc:		North83:	
Open Hole:		Org CS: UTM83	
Cluster Kind:		UTMRC: 9	
Date Completed: 24-Oct-2014 00:00:00		UTMRC Desc: unknown UTM	
Remarks:		Location Method: wwr	
Loc Method Desc: on Water Well Record			
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005471808			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		34			
Most Common Material:		TILL			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		8.0			
Formation End Depth:		22.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005471806			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		01			
Most Common Material:		FILL			
Mat2:					
Mat2 Desc:					
Mat3:		11			
Mat3 Desc:		GRAVEL			
Formation Top Depth:		0.0			
Formation End Depth:		3.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005471807			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:					
Mat2 Desc:					
Mat3:		08			
Mat3 Desc:		FINE SAND			
Formation Top Depth:		3.0			
Formation End Depth:		8.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005471809			
Layer:		4			
Color:		2			
General Color:		GREY			
Mat1:		34			
Most Common Material:		TILL			
Mat2:		17			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat2 Desc:		SHALE			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		22.0			
Formation End Depth:		30.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005471816			
Layer:		1			
Plug From:		0.0			
Plug To:		24.0			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1005471815			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1005471805			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1005471812			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		25.0			
Casing Diameter:		1.7999999523162842			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1005471813			
Layer:		1			
Slot:		10			
Screen Top Depth:		25.0			
Screen End Depth:		30.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.0			
 <u>Water Details</u>					
Water ID:		1005471811			
Layer:					
Kind Code:					
Kind:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water Found Depth:					
Water Found Depth UOM:	ft				
<u>Hole Diameter</u>					
Hole ID:	1005471810				
Diameter:					
Depth From:					
Depth To:					
Hole Depth UOM:	ft				
Hole Diameter UOM:	inch				
60	2 of 7	ENE/91.9	79.8 / 0.98	Metrolinx 30 Queen Street East Mississauga ON L5H 1L4	GEN
Generator No:	ON5182768			Status:	
SIC Code:	482114			Co Admin:	Cathy Lumsden
SIC Description:	482114			Choice of Contact:	CO_ADMIN
Approval Years:	2016			Phone No Admin:	416-202-5167 Ext.
PO Box No:				Contam. Facility:	No
Country:	Canada			MHSW Facility:	No
<u>Detail(s)</u>					
Waste Class:	146				
Waste Class Desc:	OTHER SPECIFIED INORGANICS				
60	3 of 7	ENE/91.9	79.8 / 0.98	Metrolinx 30 Queen Street East Mississauga ON L5H 1L4	GEN
Generator No:	ON5182768			Status:	
SIC Code:	482114			Co Admin:	Cathy Lumsden
SIC Description:	482114			Choice of Contact:	CO_ADMIN
Approval Years:	2015			Phone No Admin:	905-803-8008 Ext.2607
PO Box No:				Contam. Facility:	No
Country:	Canada			MHSW Facility:	No
<u>Detail(s)</u>					
Waste Class:	146				
Waste Class Desc:	OTHER SPECIFIED INORGANICS				
60	4 of 7	ENE/91.9	79.8 / 0.98	Metrolinx 30 Queen Street East Mississauga ON L5H 1L4	GEN
Generator No:	ON5182768			Status:	
SIC Code:	482114			Co Admin:	Emily Cosburn
SIC Description:	482114			Choice of Contact:	CO_OFFICIAL
Approval Years:	2014			Phone No Admin:	(416) 869-3600 Ext.5209
PO Box No:				Contam. Facility:	No
Country:	Canada			MHSW Facility:	No
<u>Detail(s)</u>					
Waste Class:	146				
Waste Class Desc:	OTHER SPECIFIED INORGANICS				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
60	5 of 7	ENE/91.9	79.8 / 0.98	Metrolinx 30 Queen Street East Mississauga ON L5H 1L4	GEN
Generator No:	ON5182768			Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:	As of Dec 2018			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:	Canada			MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:	146 L				
Waste Class Desc:	Other specified inorganic sludges, slurries or solids				
60	6 of 7	ENE/91.9	79.8 / 0.98	Metrolinx 30 Queen Street East Mississauga ON L5G 3B7	GEN
Generator No:	ON2615101			Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:	As of Dec 2018			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:	Canada			MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:	146 L				
Waste Class Desc:	Other specified inorganic sludges, slurries or solids				
60	7 of 7	ENE/91.9	79.8 / 0.98	Metrolinx Capital Projects Group 30 Queen St E Mississauga ON L5G 3B7	GEN
Generator No:	ON7891479			Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:	As of Oct 2019			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:	Canada			MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:	251 U				
Waste Class Desc:	Waste oils/sludges (petroleum based)				
Waste Class:	221 L				
Waste Class Desc:	Light fuels				
Waste Class:	251 L				
Waste Class Desc:	Waste oils/sludges (petroleum based)				
61	1 of 1	WNW/94.0	78.8 / 0.00	ON	BORE
Borehole ID:	833841			Inclin FLG:	No
OGF ID:	215585972			SP Status:	Initial Entry
Status:	Decommissioned			Surv Elev:	No

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	20-JUN-1969			Municipality:	
Static Water Level:	2.4			Lot:	
Primary Water Use:				Township:	
Sec. Water Use:				Latitude DD:	43.556559
Total Depth m:	5.9			Longitude DD:	-79.587408
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614094
Drill Method:	Power auger			Northing:	4823592
Orig Ground Elev m:	83.8			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Within 10 metres
DEM Ground Elev m:	82.6				
Concession:					
Location D:	CNR (PORT CREDIT) * GO TRANSIT PARKING LOT EXTENSION				
Survey D:					
Comments:					

Borehole Geology Stratum

Geology Stratum ID:	6014602	Mat Consistency:	
Top Depth:	0	Material Moisture:	
Bottom Depth:	.1	Material Texture:	
Material Color:		Non Geo Mat Type:	Asphalt
Material 1:		Geologic Formation:	
Material 2:		Geologic Group:	
Material 3:		Geologic Period:	
Material 4:		Depositional Gen:	
Gsc Material Description:			
Stratum Description:	Asphalt **Note: Many records provided by the department have a truncated [Stratum Description] field.		
Geology Stratum ID:	6014603	Mat Consistency:	
Top Depth:	.1	Material Moisture:	
Bottom Depth:	.5	Material Texture:	
Material Color:		Non Geo Mat Type:	Fill-Misc
Material 1:	Sand	Geologic Formation:	
Material 2:	Gravel	Geologic Group:	
Material 3:		Geologic Period:	
Material 4:		Depositional Gen:	
Gsc Material Description:			
Stratum Description:	Sand & gravel (fill) **Note: Many records provided by the department have a truncated [Stratum Description] field.		
Geology Stratum ID:	6014604	Mat Consistency:	Compact
Top Depth:	.5	Material Moisture:	
Bottom Depth:	5.5	Material Texture:	Fine
Material Color:	Brown-Grey	Non Geo Mat Type:	
Material 1:	Sand	Geologic Formation:	
Material 2:	Silt	Geologic Group:	
Material 3:		Geologic Period:	
Material 4:		Depositional Gen:	
Gsc Material Description:			
Stratum Description:	Silty fine sand, brown to grey, compact to very dense **Note: Many records provided by the department have a truncated [Stratum Description] field.		
Geology Stratum ID:	6014605	Mat Consistency:	Hard
Top Depth:	5.5	Material Moisture:	
Bottom Depth:	5.9	Material Texture:	
Material Color:	Grey	Non Geo Mat Type:	
Material 1:	Till	Geologic Formation:	
Material 2:	Silt	Geologic Group:	
Material 3:	Sand	Geologic Period:	
Material 4:	Gravel	Depositional Gen:	glacial
Gsc Material Description:			
Stratum Description:	Clayey silt with some sand and gravel, glacial till, grey, hard **Note: Many records provided by the department have a truncated [Stratum Description] field.		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
62	1 of 1	N/94.6	79.8 / 1.00	ON	BORE
Borehole ID:		649451	Inclin FLG: No		
OGF ID:		215549826	SP Status: Initial Entry		
Status:			Surv Elev: No		
Type:		Borehole	Piezometer: No		
Use:		Geotechnical/Geological Investigation	Primary Name:		
Completion Date:		JUN-1969	Municipality:		
Static Water Level:		0.2	Lot:		
Primary Water Use:		Not Used	Township:		
Sec. Water Use:			Latitude DD: 43.557271		
Total Depth m:		5.9	Longitude DD: -79.586146		
Depth Ref:		Ground Surface	UTM Zone: 17		
Depth Elev:			Easting: 614195		
Drill Method:		Power auger	Northing: 4823673		
Orig Ground Elev m:		84.4	Location Accuracy:		
Elev Reliabil Note:			Accuracy: Not Applicable		
DEM Ground Elev m:		83.6			
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:		218527016	Mat Consistency:		
Top Depth:		0	Material Moisture:		
Bottom Depth:		.3	Material Texture:		
Material Color:			Non Geo Mat Type:		
Material 1:		Fill	Geologic Formation:		
Material 2:		Sand	Geologic Group:		
Material 3:		Gravel	Geologic Period:		
Material 4:			Depositional Gen: fill		
Gsc Material Description:					
Stratum Description:		FILL,SAND,GRAVEL.			
Geology Stratum ID:		218527017	Mat Consistency: Dense		
Top Depth:		.3	Material Moisture:		
Bottom Depth:		1.8	Material Texture:		
Material Color:		Brown	Non Geo Mat Type:		
Material 1:		Sand	Geologic Formation:		
Material 2:		Silt	Geologic Group:		
Material 3:			Geologic Period:		
Material 4:			Depositional Gen:		
Gsc Material Description:					
Stratum Description:		SAND,SILT. BROWN,DENSE, WATER STABLE AT 276.2 FEET.			
Geology Stratum ID:		218527018	Mat Consistency: Hard		
Top Depth:		1.8	Material Moisture:		
Bottom Depth:		5.9	Material Texture:		
Material Color:		Grey	Non Geo Mat Type:		
Material 1:		Till	Geologic Formation:		
Material 2:		Silt	Geologic Group:		
Material 3:		Clay	Geologic Period:		
Material 4:		Sand	Depositional Gen: glacial		
Gsc Material Description:					
Stratum Description:		TILL,SILT,CLAY,SAND.GREY,GLACIAL,HARD. 0001003500060079 **Note: Many records provided by the department have a truncated [Stratum Description] field.			

Source

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Type: Data Survey Source Orig: Geological Survey of Canada Source Date: 1956-1972 Confidence: H Observatio: Source Name: Urban Geology Automated Information System (UGAIS) Source Details: File: TOR3.txt RecordID: 201100 NTS_Sheet: 30M12A Confiden 1: Logged by professional. Exact and complete description of material and properties.					
Source Appl: Spatial/Tabular					
Source Iden: 1					
Scale or Res: Varies					
Horizontal: NAD27					
Verticalda: Mean Average Sea Level					
Source List					
Source Identifier: 1					
Source Type: Data Survey					
Source Date: 1956-1972					
Scale or Resolution: Varies					
Source Name: Urban Geology Automated Information System (UGAIS)					
Source Originators: Geological Survey of Canada					
Horizontal Datum: NAD27					
Vertical Datum: Mean Average Sea Level					
Projection Name: Universal Transverse Mercator					
63	1 of 3	ESE/95.0	79.8 / 1.00	VERSACE LAWN CARE 66 HIGH STREET EAST, #202 MISSISSAUGA ON L5G 1K2	PES
Detail Licence No: Licence No: Status: Approval Date: Report Source: Licence Type: Operator Licence Type Code: 02 Licence Class: Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL: PDF Site Location:					
Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: Oper Phone No: Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:					
63	2 of 3	ESE/95.0	79.8 / 1.00	VERSACE LAWN CARE 66 HIGH STREET EAST, #202 MISSISSAUGA ON L5G1K2	PES
Detail Licence No: Licence No: 04313 Status: Approval Date: Report Source: Legacy Licenses (Excluding TS) Licence Type: Operator Licence Type Code: 02 Licence Class: 01 Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County:					
Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: 416 Oper Phone No: 2690458 Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Trade Name: PDF URL: PDF Site Location:					
63	3 of 3	ESE/95.0	79.8 / 1.00	VERSACE LAWN CARE 66 HIGH STREET EAST, #202 MISSISSAUGA ON L5G1K2	PES
Detail Licence No: Licence No: 04313 Status: Approval Date: Report Source: Legacy Licenses (Excluding TS) Licence Type: Operator Licence Type Code: 01 Licence Class: 06 Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL: PDF Site Location:				Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: 416 Oper Phone No: 2690458 Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:	
64	1 of 1	W/95.2	79.2 / 0.38	ON	BORE
Borehole ID: 649443 OGF ID: 215549818 Status: Type: Borehole Use: Geotechnical/Geological Investigation Completion Date: DEC-1959 Static Water Level: 0.2 Primary Water Use: Not Used Sec. Water Use: Total Depth m: 4.9 Depth Ref: Ground Surface Depth Elev: Drill Method: Diamond Drill Orig Ground Elev m: 82.2 Elev Reliabil Note: DEM Ground Elev m: 83.4 Concession: Location D: Survey D: Comments:				Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD: 43.555671 Longitude DD: -79.587793 UTM Zone: 17 Easting: 614065 Northing: 4823493 Location Accuracy: Accuracy: Not Applicable	
Borehole Geology Stratum					
Geology Stratum ID: 218526994 Top Depth: 1.2 Bottom Depth: 2.4 Material Color: Brown Material 1: Sand Material 2: Silt Material 3: Organic				Mat Consistency: Compact Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 4:				Depositional Gen:	organic
Gsc Material Description:					
Stratum Description:		SAND,SILT,ORGANIC. BROWN,COMPACT.			
Geology Stratum ID:		218526995	Mat Consistency:		Dense
Top Depth:		2.4	Material Moisture:		
Bottom Depth:		3.7	Material Texture:		
Material Color:		Grey	Non Geo Mat Type:		
Material 1:		Sand	Geologic Formation:		
Material 2:		Silt	Geologic Group:		
Material 3:			Geologic Period:		
Material 4:			Depositional Gen:		
Gsc Material Description:					
Stratum Description:		SAND,SILT. GREY,VERY DENSE.			
Geology Stratum ID:		218526993	Mat Consistency:		
Top Depth:		.3	Material Moisture:		
Bottom Depth:		1.2	Material Texture:		
Material Color:		Brown	Non Geo Mat Type:		
Material 1:		Fill	Geologic Formation:		
Material 2:		Sand	Geologic Group:		
Material 3:			Geologic Period:		
Material 4:			Depositional Gen:		fill
Gsc Material Description:					
Stratum Description:		FILL,SAND. BROWN, WATER STABLE AT 269.1 FEET.			
Geology Stratum ID:		218526996	Mat Consistency:		Dense
Top Depth:		3.7	Material Moisture:		
Bottom Depth:		4.9	Material Texture:		
Material Color:		Grey	Non Geo Mat Type:		
Material 1:		Till	Geologic Formation:		
Material 2:		Clay	Geologic Group:		
Material 3:		Silt	Geologic Period:		
Material 4:		Gravel	Depositional Gen:		
Gsc Material Description:					
Stratum Description:		TILL,CLAY,SILT, GRAVEL. GREY,DENSE. 021 013 008 0004001300080050001 **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:		218526992	Mat Consistency:		
Top Depth:		0	Material Moisture:		
Bottom Depth:		.3	Material Texture:		
Material Color:			Non Geo Mat Type:		
Material 1:		Soil	Geologic Formation:		
Material 2:			Geologic Group:		
Material 3:			Geologic Period:		
Material 4:			Depositional Gen:		
Gsc Material Description:					
Stratum Description:		SOIL.			
<u>Source</u>					
Source Type:		Data Survey	Source Appl:		Spatial/Tabular
Source Orig:		Geological Survey of Canada	Source Iden:		1
Source Date:		1956-1972	Scale or Res:		Varies
Confidence:		H	Horizontal:		NAD27
Observatio:			Verticalda:		Mean Average Sea Level
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Details:		File: TOR3.txt RecordID: 201020 NTS_Sheet: 30M12A			
Confiden 1:		Logged by professional. Exact and complete description of material and properties.			
<u>Source List</u>					
Source Identifier:		1	Horizontal Datum:		NAD27
Source Type:		Data Survey	Vertical Datum:		Mean Average Sea Level

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Date:		1956-1972		Projection Name:	Universal Transverse Mercator
Scale or Resolution:		Varies			
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Originators:		Geological Survey of Canada			
65	1 of 1	ENE/95.5	79.8 / 1.00	ON	BORE
Borehole ID:		646206		Inclin FLG:	No
OGF ID:		215546589		SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:		Borehole		Piezometer:	No
Use:		Geotechnical/Geological Investigation		Primary Name:	
Completion Date:		MAY-1968		Municipality:	
Static Water Level:				Lot:	
Primary Water Use:		Not Used		Township:	
Sec. Water Use:				Latitude DD:	43.556528
Total Depth m:		9.9		Longitude DD:	-79.584306
Depth Ref:		Ground Surface		UTM Zone:	17
Depth Elev:				Easting:	614345
Drill Method:		Diamond Drill		Northing:	4823593
Orig Ground Elev m:		80.6		Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:		82.5			
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:		218514026		Mat Consistency:	Dense
Top Depth:		1.1		Material Moisture:	
Bottom Depth:		1.8		Material Texture:	
Material Color:		Brown		Non Geo Mat Type:	
Material 1:		Silt		Geologic Formation:	
Material 2:		Sand		Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:		SILT,SAND. BROWN,GLACIAL,DENSE, AGE GLACIAL.			
Geology Stratum ID:		218514027		Mat Consistency:	Hard
Top Depth:		1.8		Material Moisture:	
Bottom Depth:		6.7		Material Texture:	
Material Color:		Grey		Non Geo Mat Type:	
Material 1:		Till		Geologic Formation:	
Material 2:		Clay		Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:		TILL,CLAY. GREY,GLACIAL,HARD,AGE GLACIAL.			
Geology Stratum ID:		218514025		Mat Consistency:	
Top Depth:		0		Material Moisture:	
Bottom Depth:		1.1		Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:		Fill		Geologic Formation:	
Material 2:		Sand		Geologic Group:	
Material 3:		Stones		Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:		FILL,SAND,STONES.			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Geology Stratum ID:	218514028			Mat Consistency:	
Top Depth:	6.7			Material Moisture:	
Bottom Depth:	9.9			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Shale			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	Ordovician
Material 4:				Depositional Gen:	marine
Gsc Material Description:					
Stratum Description:	SHALE. GREY,MARINE,LAYERED, AGE ORDOVICIAN. 014 010 0003502300060060 **Note: Many records provided by the department have a truncated [Stratum Description] field.				
 <u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR2.txt RecordID: 142280 NTS_Sheet: 30M12A				
Confiden 1:	Reliable information but incomplete.				
 <u>Source List</u>					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
66	1 of 1	WNW/96.1	79.1 / 0.25	ON	WWIS
Well ID:	7388334			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	01-Jun-2021 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	C47539			Contractor:	7693
Tag:	A241261			Form Version:	8
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:					
 <u>Bore Hole Information</u>					
Bore Hole ID:	1008663822			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614095.00

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Code OB Desc: Open Hole: Cluster Kind: Date Completed: 18-May-2021 00:00:00 Remarks: Loc Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:				North83: 4823597.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr	
Links					
Bore Hole ID: 1008663822 Depth M: Year Completed: 2021 Well Completed Dt: 2021/05/18 Audit No: C47539				Tag No: A241261 Contractor: 7693 Path: Latitude: 43.5566039063798 Longitude: -79.5873945326509	

67	1 of 1	N/97.7	79.8 / 1.00	ON	WWIS
Well ID: 7378960 Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: Z348115 Tag: A312091 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: MISSISSAUGA CITY (PORT CREDIT) Site Info:				Flowing (Y/N): Flow Rate: Data Entry Status: Yes Data Src: Date Received: 29-Jan-2021 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 7644 Form Version: 7 Owner: County: PEEL Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	

Bore Hole Information

Bore Hole ID: 1008614895 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 15-Dec-2020 00:00:00 Remarks: Loc Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:		Elevation: Elevrc: Zone: 17 East83: 614203.00 North83: 4823676.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Links					
Bore Hole ID:	1008614895			Tag No:	A312091
Depth M:				Contractor:	7644
Year Completed:	2020			Path:	737\7378960.pdf
Well Completed Dt:	2020/12/15			Latitude:	43.5572984950517
Audit No:	Z348115			Longitude:	-79.5860411586813
68	1 of 1	NNE/98.8	79.8 / 1.00	30 queen st e. Mississauga ON	WWIS
Well ID:	7355170			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Test Hole			Data Entry Status:	
Use 2nd:	Monitoring			Data Src:	
Final Well Status:	Observation Wells			Date Received:	28-Nov-2018 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z275303			Contractor:	7383
Tag:	A235313			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:					
PDF URL (Map):					
Additional Detail(s) (Map)					
Well Completed Date:	2018/10/20				
Year Completed:	2018				
Depth (m):					
Latitude:	43.5571927411251				
Longitude:	-79.5854988702987				
Path:					
Bore Hole Information					
Bore Hole ID:	1008221292			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614247.00
Code OB Desc:				North83:	4823665.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	20-Oct-2018 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008268356			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		34			
Most Common Material:		TILL			
Mat2:		17			
Mat2 Desc:		SHALE			
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008268354			
Layer:		1			
Color:		8			
General Color:		BLACK			
Mat1:		27			
Most Common Material:		OTHER			
Mat2:					
Mat2 Desc:					
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		0.0			
Formation End Depth:					
Formation End Depth UOM:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008268355			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008268749			
Layer:		2			
Plug From:		1.0			
Plug To:		24.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Sealing Record</u>					
Plug ID:		1008268750			
Layer:		3			
Plug From:		24.0			
Plug To:		35.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008268748			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1008269239			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1008267825			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1008269428			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		25.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1008269598			
Layer:		1			
Slot:		10			
Screen Top Depth:		25.0			
Screen End Depth:		35.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.375			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1008269864			
Pump Set At:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Static Level: Final Level After Pumping: Recommended Pump Depth: Pumping Rate: Flowing Rate: Recommended Pump Rate: Levels UOM: ft Rate UOM: GPM Water State After Test Code: Water State After Test: Pumping Test Method: 0 Pumping Duration HR: Pumping Duration MIN: Flowing:					
<u>Water Details</u>					
Water ID: 1008269726 Layer: 1 Kind Code: 8 Kind: Untested Water Found Depth: 33.5 Water Found Depth UOM: ft					
<u>Hole Diameter</u>					
Hole ID: 1008269044 Diameter: 6.0 Depth From: 0.0 Depth To: 35.0 Hole Depth UOM: ft Hole Diameter UOM: Inch					
<u>Links</u>					
Bore Hole ID: 1008221292 Depth M: Year Completed: 2018 Well Completed Dt: 2018/10/20 Audit No: Z275303					
Tag No: A235313 Contractor: 7383 Path: Latitude: 43.5571927411251 Longitude: -79.5854988702987					
69	1 of 1	NE/99.9	79.8 / 1.00	HURONTARIO/ GO TRANSIT TRACKS ETOBICOKE ON	WWIS
Well ID: 7321771 Construction Date: Use 1st: Monitoring Use 2nd: Final Well Status: Observation Wells Water Type: Casing Material: Audit No: Z266878 Tag: A232639 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 07-Nov-2018 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 6607 Form Version: 7 Owner: County: PEEL Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Municipality:		MISSISSAUGA CITY (PORT CREDIT)			
Site Info:					
PDF URL (Map):					
Additional Detail(s) (Map)					
Well Completed Date:		2018/07/21			
Year Completed:		2018			
Depth (m):		7.62			
Latitude:		43.5569710381831			
Longitude:		-79.5850459639712			
Path:					
Bore Hole Information					
Bore Hole ID:		1007307011		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				17	
Code OB Desc:				East83:	
Open Hole:				614284.00	
Cluster Kind:				North83:	
Date Completed:		21-Jul-2018 00:00:00		4823641.00	
Remarks:				Org CS:	
Loc Method Desc:		on Water Well Record		UTM83	
Elevrc Desc:				UTMRC:	
Location Source Date:				4	
Improvement Location Source:				UTMRC Desc:	
Improvement Location Method:				margin of error : 30 m - 100 m	
Source Revision Comment:				Location Method:	
Supplier Comment:				wwr	
Overburden and Bedrock					
Materials Interval					
Formation ID:		1007602917			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		5.0			
Formation End Depth:		15.0			
Formation End Depth UOM:		ft			
Overburden and Bedrock					
Materials Interval					
Formation ID:		1007602916			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		5.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007602918			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		15.0			
Formation End Depth:		25.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007602925			
Layer:		1			
Plug From:		0.0			
Plug To:		24.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007602926			
Layer:		2			
Plug From:		24.0			
Plug To:		35.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007602924			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:		DIAMOND			
<u>Pipe Information</u>					
Pipe ID:		1007602915			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007602921			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth From: 0.0					
Depth To: 25.0					
Casing Diameter: 5.099999904632568					
Casing Diameter UOM: inch					
Casing Depth UOM: ft					
<u>Construction Record - Screen</u>					
Screen ID: 1007602922					
Layer: 1					
Slot: 10					
Screen Top Depth: 25.0					
Screen End Depth: 35.0					
Screen Material: 5					
Screen Depth UOM: ft					
Screen Diameter UOM: inch					
Screen Diameter: 6.400000095367432					
<u>Water Details</u>					
Water ID: 1007602920					
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM: ft					
<u>Hole Diameter</u>					
Hole ID: 1007602919					
Diameter: 5.5					
Depth From: 0.0					
Depth To: 35.0					
Hole Depth UOM: ft					
Hole Diameter UOM: inch					
<u>Links</u>					
Bore Hole ID:	1007307011			Tag No:	A232639
Depth M:	7.62			Contractor:	6607
Year Completed:	2018			Path:	732\7321771.pdf
Well Completed Dt:	2018/07/21			Latitude:	43.5569710381831
Audit No:	Z266878			Longitude:	-79.5850459639712
<u>70</u>	1 of 1	WSW/100.0	79.8 / 0.96	ON	BORE
Borehole ID:	833906			Inclin FLG:	No
OGF ID:	215586037			SP Status:	Initial Entry
Status:	Decommissioned			Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	30-MAY-1972			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:				Township:	
Sec. Water Use:				Latitude DD:	43.55551
Total Depth m:	3.2			Longitude DD:	-79.587779
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614066
Drill Method:	Boring			Northing:	4823475
Orig Ground Elev m:	85.6			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Within 10 metres

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
DEM Ground Elev m:	83.9				
Concession:					
Location D:		PORT CREDIT GO STATION * PLATFORM SHELTER			
Survey D:					
Comments:		Met practical refusal to driving at 1.52m (probable boulder), moved 0.76m west and resumed sampling at 1.83m			
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	6014838			Mat Consistency:	Loose
Top Depth:	0			Material Moisture:	
Bottom Depth:	3.2			Material Texture:	
Material Color:				Non Geo Mat Type:	Fill-Misc
Material 1:	Sand			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:	Wood Fragments			Depositional Gen:	
Gsc Material Description:					
Stratum Description:		Asphalt top 0.03m, sand and gravel, trace of silt, (occasional pieces of wood and brick), fill, loose to compact **Note: Many records provided by the department have a truncated [Stratum Description] field.			
71	1 of 1	N/103.6	79.8 / 1.00	ON	BORE
Borehole ID:	833843			Inclin FLG:	No
OGF ID:	215585974			SP Status:	Initial Entry
Status:	Decommissioned			Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	21-JUN-1969			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:				Township:	
Sec. Water Use:				Latitude DD:	43.557353
Total Depth m:	2.1			Longitude DD:	-79.586114
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614197
Drill Method:	Hand auger			Northing:	4823682
Orig Ground Elev m:	84.4			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Within 10 metres
DEM Ground Elev m:	83.2				
Concession:					
Location D:		CNR (PORT CREDIT) * GO TRANSIT PARKING LOT EXTENSION			
Survey D:					
Comments:		Hole dry on June 21, 1969			
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	6014611			Mat Consistency:	Very Stiff
Top Depth:	1.2			Material Moisture:	
Bottom Depth:	2.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Sand			Geologic Period:	
Material 4:	Gravel			Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:		Clayey silt, some sand & gravel, (glacial till), very stiff **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:	6014610			Mat Consistency:	Compact
Top Depth:	0			Material Moisture:	
Bottom Depth:	1.2			Material Texture:	Fine
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	

194 erisinfo.com | Environmental Risk Information Services Order No: 22091501030

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Report Type: Custom Report Report Date: 24-SEP-20 Date Received: 21-SEP-20 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Client Prov/State: ON Search Radius (km): .5 X: -79.58579642 Y: 43.55732685					
73	2 of 2	N/103.7	79.8 / 1.00	HuLRT WZ1 WWIS Mississauga ON	EHS
Order No: 20292100310 Status: C Report Type: Custom Report Report Date: 24-SEP-20 Date Received: 21-SEP-20 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .5 X: -79.58579642 Y: 43.55732685					
74	1 of 1	ENE/105.1	79.8 / 1.00	30 Queen St. East Mississauga ON	WWIS
Well ID: 7363633 Construction Date: Use 1st: Monitoring Use 2nd: Final Well Status: Observation Wells Water Type: Casing Material: Audit No: 2DEKHQS6 Tag: A283539 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: MISSISSAUGA CITY (PORT CREDIT) Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 07-Aug-2020 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 7609 Form Version: 9 Owner: County: PEEL Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
<u>Bore Hole Information</u>					
Bore Hole ID: 1008371680 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 27-Jul-2020 00:00:00 Remarks: Loc Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
Elevation: Elevrc: Zone: 17 East83: 614337.00 North83: 4823610.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008371795			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		1.5199999809265137			
Formation End Depth:		3.049999952316284			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008371794			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		01			
Most Common Material:		FILL			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:		77			
Mat3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		1.5199999809265137			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008371796			
Layer:		3			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		11			
Mat3 Desc:		GRAVEL			
Formation Top Depth:		3.049999952316284			
Formation End Depth:		5.179999828338623			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008371886			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		1.8300000429153442			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Sealing Record</u>					
Plug ID:		1008371857			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008371887			
Layer:		3			
Plug From:		1.8300000429153442			
Plug To:		5.179999828338623			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008371885			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1008371758			
Method Construction Code:		E			
Method Construction:		Auger			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1008371728			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1008371819			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		2.130000114440918			
Casing Diameter:		5.0			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1008371829			
Layer:		1			
Slot:		010			
Screen Top Depth:		2.130000114440918			
Screen End Depth:		5.179999828338623			
Screen Material:		5			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen Depth UOM: m Screen Diameter UOM: cm Screen Diameter: 6.0					
Results of Well Yield Testing					
Pumping Test Method Desc: Pump Test ID: 1008371729 Pump Set At: Static Level: Final Level After Pumping: Recommended Pump Depth: Pumping Rate: Flowing Rate: Recommended Pump Rate: Levels UOM: m Rate UOM: LPM Water State After Test Code: Water State After Test: Pumping Test Method: Pumping Duration HR: Pumping Duration MIN: Flowing:					
Hole Diameter					
Hole ID: 1008371842 Diameter: 21.0 Depth From: 0.0 Depth To: 5.179999828338623 Hole Depth UOM: m Hole Diameter UOM: cm					
Links					
Bore Hole ID: 1008371680 Depth M: 5.18 Year Completed: 2020 Well Completed Dt: 2020/07/27 Audit No: 2DEKHQS6					
Tag No: A283539 Contractor: 7609 Path: 736\7363633.pdf Latitude: 43.5566838709673 Longitude: -79.5843965000502					
75	1 of 1	E/105.4	79.8 / 1.00	91 Park St E Mississauga ON L5G4W1	EHS
Order No: 20180404020 Status: C Report Type: RSC Report (Urban) Report Date: 10-APR-18 Date Received: 04-APR-18 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Mississauga Client Prov/State: ON Search Radius (km): .3 X: -79.583872 Y: 43.556293					
76	1 of 1	E/105.7	79.8 / 1.00	91 Park St E Mississauga ON L5G4W1	EHS
Order No: 20140106044 Status: C Report Type: Custom Report Report Date: 15-JAN-14 Date Received: 06-JAN-14					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.583921					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Previous Site Name: Lot/Building Size: Additional Info Ordered:				Y: 43.556359	
77	1 of 1	E/106.2	79.8 / 1.00	Ann Street and High Street East Mississauga ON L5G	EHS
Order No: 22070500121 Status: C Report Type: Custom Report Report Date: 08-JUL-22 Date Received: 05-JUL-22 Previous Site Name: Lot/Building Size: Additional Info Ordered:		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.58375796 Y: 43.55610953			
78	1 of 1	WSW/107.1	79.5 / 0.63	ON	BORE
Borehole ID: 833903 OGF ID: 215586034 Status: Decommissioned Type: Borehole Use: Geotechnical/Geological Investigation Completion Date: 26-MAY-1972 Static Water Level: Primary Water Use: Sec. Water Use: Total Depth m: 6.9 Depth Ref: Ground Surface Depth Elev: Drill Method: Boring Orig Ground Elev m: 85.6 Elev Reliabil Note: DEM Ground Elev m: 83.9 Concession: Location D: PORT CREDIT GO STATION * PLATFORM SHELTER Survey D: Comments: No W.L - hole caved in		Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD: 43.555439 Longitude DD: -79.58783 UTM Zone: 17 Easting: 614062 Northing: 4823467 Location Accuracy: Accuracy: Within 10 metres			
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: 6014831 Top Depth: 0 Bottom Depth: 4.7 Material Color: Material 1: Sand Material 2: Gravel Material 3: Silt Material 4: organic material Gsc Material Description: Stratum Description: Asphalt top 0.04m, sand and gravel, trace of silt, (trace of organic matter throughout), fill, compact to very loose **Note: Many records provided by the department have a truncated [Stratum Description] field.		Mat Consistency: Compact Material Moisture: Material Texture: Non Geo Mat Type: Fill-Misc Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:			
Geology Stratum ID: 6014833 Top Depth: 6.4 Bottom Depth: 6.9 Material Color: Material 1: Till Material 2: Silt Material 3: Sand		Mat Consistency: Very Stiff Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 4: Gravel Gsc Material Description: Stratum Description: Heterogeneous mixture of clayey silt, sand and gravel (glacial till), very stiff **Note: Many records provided by the department have a truncated [Stratum Description] field.					
Geology Stratum ID: 6014832 Top Depth: 4.7 Bottom Depth: 6.4 Material Color: Grey Material 1: Silt Material 2: Clay Material 3: Material 4: Gsc Material Description: Stratum Description: Clayey silt, grey, very stiff **Note: Many records provided by the department have a truncated [Stratum Description] field.					
Mat Consistency: Very Stiff Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					
79	1 of 2	SW/107.6	78.8 / 0.00	23 Elizabeth Street North Mississauga ON L5G 2Z4	EHS
Order No: 20200501130 Status: C Report Type: Standard Report Report Date: 04-MAY-20 Date Received: 01-MAY-20 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.5870105 Y: 43.5548451					
79	2 of 2	SW/107.6	78.8 / 0.00	23 Elizabeth Street North Mississauga ON L5G 2Z4	EHS
Order No: 20200501130 Status: C Report Type: Standard Report Report Date: 04-MAY-20 Date Received: 01-MAY-20 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.5870105 Y: 43.5548451					
80	1 of 2	E/107.8	79.8 / 1.00	High St. E., Ann St. Mississauga ON L5G	EHS
Order No: 20312600085 Status: C Report Type: Custom Report Report Date: 01-DEC-20 Date Received: 26-NOV-20 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .3 X: -79.5837371 Y: 43.5561117					
80	2 of 2	E/107.8	79.8 / 1.00	High St. E., Ann St. Mississauga ON L5G	EHS
Order No: 20312600085 Status: C Report Type: Custom Report Report Date: 01-DEC-20					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .3					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Date Received:	26-NOV-20			X:	-79.5837371
Previous Site Name:				Y:	43.5561117
Lot/Building Size:					
Additional Info Ordered:					

81	1 of 1	WSW/108.0	78.8 / 0.00	PORT CREDIT GO STATION PORT CREDIT ON	WWIS
Well ID:	7321814			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	07-Nov-2018 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z266907			Contractor:	6607
Tag:	A232747			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:					

PDF URL (Map):

Additional Detail(s) (Map)

Well Completed Date: 2018/01/19
Year Completed: 2018
Depth (m): 4.5
Latitude: 43.5552750532576
Longitude: -79.5876979521631
Path:

Bore Hole Information

Bore Hole ID:	1007307140	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614073.00
Code OB Desc:		North83:	4823449.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	19-Jan-2018 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	www
Loc Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock Materials Interval

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		1007605523			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		1.5			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007605525			
Layer:		3			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		3.0			
Formation End Depth:		4.5			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007605524			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		1.5			
Formation End Depth:		3.0			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007605532			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007605533			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		1.5			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007605531			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007605522			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007605528			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.5			
Casing Diameter:		5.099999904632568			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007605529			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.5			
Screen End Depth:		4.5			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.400000095367432			
<u>Water Details</u>					
Water ID:		1007605527			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1007605526			
Diameter:		15.0			
Depth From:		0.0			
Depth To:		4.5			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Links					
Bore Hole ID:	1007307140			Tag No:	A232747
Depth M:	4.5			Contractor:	6607
Year Completed:	2018			Path:	732\7321814.pdf
Well Completed Dt:	2018/01/19			Latitude:	43.5552750532576
Audit No:	Z266907			Longitude:	-79.5876979521631
82	1 of 1	WSW/108.8	78.8 / 0.00	ON	BORE
Borehole ID:	640919			Inclin FLG:	No
OGF ID:	215541314			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.555081
Total Depth m:	2.1			Longitude DD:	-79.587435
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614095
Drill Method:	Power auger			Northing:	4823428
Orig Ground Elev m:	83.4			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	83.5				
Concession:					
Location D:					
Survey D:					
Comments:					
Borehole Geology Stratum					
Geology Stratum ID:	218494071			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ASPHALT.				
Geology Stratum ID:	218494072			Mat Consistency:	
Top Depth:	.1			Material Moisture:	
Bottom Depth:	2.1			Material Texture:	Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Silt			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SILT,SAND-MEDIUM, CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL. -GLACIAL				**Note: Many records provided by the department have a truncated [Stratum Description] field.
Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 088850 NTS_Sheet: 30M12A				
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.				
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				

83	1 of 1	E/110.0	79.8 / 1.00	ON	BORE
Borehole ID:	640928			Inclin FLG:	No
OGF ID:	215541323			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.555575
Total Depth m:	-999			Longitude DD:	-79.583709
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614395
Drill Method:	Power auger			Northing:	4823488
Orig Ground Elev m:	80.6			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	80.3				
Concession:					
Location D:					
Survey D:					
Comments:					

Borehole Geology Stratum

Geology Stratum ID:	218494116			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ASPHALT.				
Geology Stratum ID:	218494118			Mat Consistency:	
Top Depth:	.3			Material Moisture:	
Bottom Depth:	.8			Material Texture:	Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Soil			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:	Clay			Depositional Gen:	
Gsc Material Description:					
Stratum Description:	SOIL,SAND-MEDIUM, SILT,CLAY. BROWN.				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Geology Stratum ID:	218494120			Mat Consistency:	
Top Depth:	1.2			Material Moisture:	
Bottom Depth:	1.5			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	CLAY,SAND,SILT. ALLUVIAL,AGE POST-GLACIAL.				
Geology Stratum ID:	218494121			Mat Consistency:	
Top Depth:	1.5			Material Moisture:	
Bottom Depth:				Material Texture:	Medium
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM. ALLUVIAL,AGE POST-GLACIAL.				
Geology Stratum ID:	218494117			Mat Consistency:	
Top Depth:	.1			Material Moisture:	
Bottom Depth:	.3			Material Texture:	Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:	Clay			Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL-MEDIUM,SAND, SILT,CLAY. BROWN.				
Geology Stratum ID:	218494119			Mat Consistency:	
Top Depth:	.8			Material Moisture:	
Bottom Depth:	1.2			Material Texture:	Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM,CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL.				
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 088940 NTS_Sheet: 30M12A				
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.				
<u>Source List</u>					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
84	1 of 1	W/111.3	78.8 / 0.00	ON	BORE
Borehole ID: 833866 OGF ID: 215585997 Status: Decommissioned Type: Borehole Use: Geotechnical/Geological Investigation Completion Date: 18-DEC-1959 Static Water Level: 2.1 Primary Water Use: Sec. Water Use: Total Depth m: 5 Depth Ref: Ground Surface Depth Elev: Drill Method: Hollow stem auger Orig Ground Elev m: 82.2 Elev Reliabil Note: DEM Ground Elev m: 79.6 Concession: Location D: CNR AT PORT CREDIT * CREEK DIVERSION Survey D: Comments: Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD: 43.555774 Longitude DD: -79.588021 UTM Zone: 17 Easting: 614046 Northing: 4823504 Location Accuracy: Accuracy: Within 10 metres					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: 6014689 Top Depth: 3.7 Bottom Depth: 5 Material Color: Grey Material 1: Till Material 2: Clay Material 3: Gravel Material 4: Silt Gsc Material Description: Stratum Description: Dense, glacial till (grey, silty clay with fine gravel) **Note: Many records provided by the department have a truncated [Stratum Description] field. Mat Consistency: Dense Material Moisture: Material Texture: Fine Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen: glacial					
Geology Stratum ID: 6014688 Top Depth: 2.4 Bottom Depth: 3.7 Material Color: Grey Material 1: Sand Material 2: Silt Material 3: Material 4: Gsc Material Description: Stratum Description: Dense, grey, fine sand with silt **Note: Many records provided by the department have a truncated [Stratum Description] field. Mat Consistency: Dense Material Moisture: Material Texture: Fine Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					
Geology Stratum ID: 6014687 Top Depth: 1.2 Bottom Depth: 2.4 Material Color: Brown Material 1: Sand Material 2: organic material Material 3: Silt Material 4: Gsc Material Description: Stratum Description: Medium brown, silty sand mixed with organic matter above 1.77m **Note: Many records provided by the department have a truncated [Stratum Description] field. Mat Consistency:					
Geology Stratum ID: 6014685 Mat Consistency:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Top Depth:	0			Material Moisture:	
Bottom Depth:	.3			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Topsoil			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	Topsoil **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	6014686			Mat Consistency:	
Top Depth:	.3			Material Moisture:	
Bottom Depth:	1.2			Material Texture:	Fine
Material Color:	Brown			Non Geo Mat Type:	Fill-Misc
Material 1:	Sand			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	Fill material (medium, brown, fine sand) **Note: Many records provided by the department have a truncated [Stratum Description] field.				

85

1 of 1

SSW/112.3

79.0 / 0.19

ON

WWIS

Well ID:

7370471

Construction Date:

Use 1st:

Use 2nd:

Final Well Status:

Water Type:

Casing Material:

Audit No:

C49171

Tag:

A276698

Constructn Method:

Elevation (m):

Elevatn Reliabilty:

Depth to Bedrock:

Well Depth:

Overburden/Bedrock:

Pump Rate:

Static Water Level:

Clear/Cloudy:

Municipality:

MISSISSAUGA CITY (PORT CREDIT)

Site Info:

Flowing (Y/N):

Flow Rate:

Data Entry Status:

Yes

Data Src:

Date Received:

16-Oct-2020 00:00:00

Selected Flag:

TRUE

Abandonment Rec:

Contractor:

6988

Form Version:

8

Owner:

County:

PEEL

Lot:

Concession:

Concession Name:

Easting NAD83:

Northing NAD83:

Zone:

UTM Reliability:

Bore Hole Information

Bore Hole ID:

1008492719

DP2BR:

Spatial Status:

Code OB:

Code OB Desc:

Open Hole:

Cluster Kind:

Date Completed:

02-Jun-2020 00:00:00

Remarks:

Loc Method Desc:

on Water Well Record

Elevrc Desc:

Location Source Date:

Improvement Location Source:

Improvement Location Method:

Source Revision Comment:

Supplier Comment:

Elevation:

Elevrc:

Zone:

17

East83:

614146.00

North83:

4823385.00

Org CS:

UTM83

UTMRC:

4

UTMRC Desc:

margin of error : 30 m - 100 m

Location Method:

wwr

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Links</u>					
Bore Hole ID:	1008492719			Tag No:	A276698
Depth M:				Contractor:	6988
Year Completed:	2020			Path:	
Well Completed Dt:	2020/06/02			Latitude:	43.5546877925646
Audit No:	C49171			Longitude:	-79.5868078977923
86	1 of 1	NE/114.0	79.8 / 1.00	30 Queen St East Mississauga ON	WWIS
Well ID:	7363630			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	07-Aug-2020 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	2QGO89A5			Contractor:	7609
Tag:	A283617			Form Version:	9
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1008371671			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614300.00
Code OB Desc:				North83:	4823647.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	24-Jul-2020 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1008371787				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	01				
Most Common Material:	FILL				
Mat2:	28				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat2 Desc:		SAND			
Mat3:		77			
Mat3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		1.5199999809265137			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008371876			
Layer:		1			
Plug From:		0.30000001192092896			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008371854			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008371877			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		1.5199999809265137			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008371878			
Layer:		3			
Plug From:		1.5199999809265137			
Plug To:		4.570000171661377			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1008371754			
Method Construction Code:		E			
Method Construction:		Auger			
Other Method Construction:		Augering			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1008371755			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:					
<u>Pipe Information</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pipe ID: 1008371722					
Casing No: 0					
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID: 1008371816					
Layer: 1					
Material: 5					
Open Hole or Material: PLASTIC					
Depth From: 0.0					
Depth To: 1.5199999809265137					
Casing Diameter: 5.0					
Casing Diameter UOM: cm					
Casing Depth UOM: m					
<u>Construction Record - Screen</u>					
Screen ID: 1008371826					
Layer: 1					
Slot: 20					
Screen Top Depth: 1.5199999809265137					
Screen End Depth: 4.570000171661377					
Screen Material: 5					
Screen Depth UOM: m					
Screen Diameter UOM: cm					
Screen Diameter: 6.0					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID: 1008371723					
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM: m					
Rate UOM: LPM					
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID: 1008371839					
Diameter: 21.0					
Depth From: 0.0					
Depth To: 4.570000171661377					
Hole Depth UOM: m					
Hole Diameter UOM: cm					
<u>Links</u>					
Bore Hole ID:	1008371671	Tag No:		A283617	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth M:	1.52			Contractor:	7609
Year Completed:	2020			Path:	736\7363630.pdf
Well Completed Dt:	2020/07/24			Latitude:	43.5570225953993
Audit No:	2QGO89A5			Longitude:	-79.5848466627181
87	1 of 2	SW/114.9	78.8 / 0.00	28 Elizabeth St N Mississauga ON L5G 2Z6	EHS
Order No:	20200505105			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	08-MAY-20			Search Radius (km):	.25
Date Received:	05-MAY-20			X:	-79.5873253
Previous Site Name:				Y:	43.5549456
Lot/Building Size:					
Additional Info Ordered:					
87	2 of 2	SW/114.9	78.8 / 0.00	28 Elizabeth St N Mississauga ON L5G 2Z6	EHS
Order No:	20200505105			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	08-MAY-20			Search Radius (km):	.25
Date Received:	05-MAY-20			X:	-79.5873253
Previous Site Name:				Y:	43.5549456
Lot/Building Size:					
Additional Info Ordered:					
88	1 of 1	SW/115.3	78.8 / 0.00	ON	BORE
Borehole ID:	640914			Inclin FLG:	No
OGF ID:	215541309			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.554899
Total Depth m:	2.7			Longitude DD:	-79.587254
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614110
Drill Method:	Power auger			Northing:	4823408
Orig Ground Elev m:	82.7			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	82.7				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218494049			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	0			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3: Material 4: Gsc Material Description: Stratum Description:				Geologic Period: Depositional Gen:	
ASPHALT.					
Geology Stratum ID: 218494051 Top Depth: .2 Bottom Depth: 1.2 Material Color: Grey Material 1: Sand Material 2: Clay Material 3: Silt Material 4:				Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen: alluvial	
Gsc Material Description: Stratum Description:					
SAND,CLAY,SILT. GREY,ALLUVIAL, AGE POST-GLACIAL.					
Geology Stratum ID: 218494053 Top Depth: 2.1 Bottom Depth: 2.7 Material Color: Grey Material 1: Sand Material 2: Silt Material 3: Clay Material 4:				Mat Consistency: Material Moisture: Moist Material Texture: Medium Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen: alluvial	
Gsc Material Description: Stratum Description:					
SAND-MEDIUM,SILT, CLAY. GREY,ALLUVIAL,MOIST, AGE POST-GLACIAL.					
Geology Stratum ID: 218494052 Top Depth: 1.2 Bottom Depth: 2.1 Material Color: Grey Material 1: Sand Material 2: Clay Material 3: Silt Material 4:				Mat Consistency: Material Moisture: Material Texture: Medium Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen: alluvial	
Gsc Material Description: Stratum Description:					
SAND-MEDIUM,CLAY, SILT. GREY,ALLUVIAL, AGE POST-GLACIAL.					
Geology Stratum ID: 218494050 Top Depth: 0 Bottom Depth: .2 Material Color: Grey Material 1: Fill Material 2: Gravel Material 3: Material 4:				Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen: fill	
Gsc Material Description: Stratum Description:					
FILL,GRAVEL. GREY.					
Source					
Source Type: Data Survey Source Orig: Geological Survey of Canada Source Date: 1956-1972 Confidence: M Observatio:				Source Appl: Spatial/Tabular Source Iden: 1 Scale or Res: Varies Horizontal: NAD27 Verticalda: Mean Average Sea Level	
Source Name: Urban Geology Automated Information System (UGAIS) Source Details: File: TOR1B.txt RecordID: 088800 NTS_Sheet: 30M12A Confiden 1: Logs are approximately correct. Lack of information. Doubtful terminology.					
Source List					
Source Identifier: 1 Source Type: Data Survey				Horizontal Datum: NAD27 Vertical Datum: Mean Average Sea Level	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				

89	1 of 1	S/116.1	79.9 / 1.02	ON	BORE
Borehole ID:	640921			Inclin FLG:	No
OGF ID:	215541316			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.554526
Total Depth m:	2.7			Longitude DD:	-79.586272
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614190
Drill Method:	Power auger			Northing:	4823368
Orig Ground Elev m:	80.3			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	80.1				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218494078			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ASPHALT.				
Geology Stratum ID:	218494079			Mat Consistency:	
Top Depth:	.1			Material Moisture:	
Bottom Depth:	.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL,GRAVEL.				
Geology Stratum ID:	218494082			Mat Consistency:	
Top Depth:	1.5			Material Moisture:	
Bottom Depth:	2.1			Material Texture:	Medium
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM,SILT, CLAY. GREY,ALLUVIAL, AGE POST-GLACIAL.				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Geology Stratum ID:	218494080			Mat Consistency:	
Top Depth:	.2			Material Moisture:	
Bottom Depth:	.3			Material Texture:	Medium
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM,SILT, CLAY. ALLUVIAL,AGE POST-GLACIAL.				
Geology Stratum ID:	218494081			Mat Consistency:	
Top Depth:	.3			Material Moisture:	
Bottom Depth:	1.5			Material Texture:	Medium
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM,SILT, CLAY. GREY,ALLUVIAL, AGE POST-GLACIAL.				
Geology Stratum ID:	218494083			Mat Consistency:	
Top Depth:	2.1			Material Moisture:	
Bottom Depth:	2.7			Material Texture:	Coarse
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM TO COARSE,CLAY,SILT. GREY,ALLUVIAL, AGE POST-GLACIAL.				
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 088870 NTS_Sheet: 30M12A				
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.				
<u>Source List</u>					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
90	1 of 1	ENE/117.6	79.8 / 1.00	ON	BORE
Borehole ID:	646207			Inclin FLG:	No
OGF ID:	215546590			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	MAY-1968			Municipality:	
Static Water Level:				Lot:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.556706
Total Depth m:	8.2			Longitude DD:	-79.584178
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614355
Drill Method:	Diamond Drill			Northing:	4823613
Orig Ground Elev m:	80.7			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	82.2				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218514032			Mat Consistency:	
Top Depth:	6.7			Material Moisture:	
Bottom Depth:	8.2			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Shale			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	Ordovician
Material 4:				Depositional Gen:	marine
Gsc Material Description:					
Stratum Description:	SHALE. GREY,MARINE,AGE ORDOVICIAN. 012 000300420003502 **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	218514031			Mat Consistency:	Hard
Top Depth:	2.4			Material Moisture:	
Bottom Depth:	6.7			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	TILL,CLAY. GREY,GLACIAL,HARD,AGE GLACIAL.				
Geology Stratum ID:	218514029			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.9			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	SAND,SILT. BROWN.				
Geology Stratum ID:	218514030			Mat Consistency:	Dense
Top Depth:	.9			Material Moisture:	
Bottom Depth:	2.4			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:	Gravel			Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	TILL,SILT,CLAY, GRAVEL. BROWN,GLACIAL,DENSE, AGE GLACIAL.				
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	Geological Survey of Canada 1956-1972 M			Source Iden: Scale or Res: Horizontal: Verticalda:	1 Varies NAD27 Mean Average Sea Level
Urban Geology Automated Information System (UGAIS) File: TOR2.txt RecordID: 142290 NTS_Sheet: 30M12A Reliable information but incomplete.					
Source List					
Source Identifier: Source Type: Source Date: Scale or Resolution: Source Name: Source Originators:	1 Data Survey 1956-1972 Varies Urban Geology Automated Information System (UGAIS) Geological Survey of Canada			Horizontal Datum: Vertical Datum: Projection Name:	NAD27 Mean Average Sea Level Universal Transverse Mercator
91	1 of 1	ESE/118.7	79.8 / 1.00	ON	BORE
Borehole ID: OGF ID: Status: Type: Use: Completion Date: Static Water Level: Primary Water Use: Sec. Water Use: Total Depth m: Depth Ref: Depth Elev: Drill Method: Orig Ground Elev m: Elev Reliabil Note: DEM Ground Elev m: Concession: Location D: Survey D: Comments:	640925 215541320 Borehole Geotechnical/Geological Investigation JAN-1965 Not Used 1.2 Ground Surface Power auger 78.3 78.3 			Inclin FLG: SP Status: Surv Elev: Piezometer: Primary Name: Municipality: Lot: Township: Latitude DD: Longitude DD: UTM Zone: Easting: Northing: Location Accuracy: Accuracy:	No Initial Entry No No 43.555083 -79.583969 17 614375 4823433 Not Applicable
Borehole Geology Stratum					
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218494104 .6 1.2 Silt Sand Clay SILT(45),SAND(37), CLAY(18). ALLUVIAL,AGE POST-GLACIAL. L.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	 alluvial
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description:	218494103 .2 .6 Brown Clay Silt Sand 			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	 alluvial

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Stratum Description:		CLAY,SILT,SAND. BROWN,ALLUVIAL, AGE POST-GLACIAL.			
Geology Stratum ID:	218494101			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	0			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		ASPHALT.			
Geology Stratum ID:	218494102			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:		FILL,GRAVEL.			
Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 088910 NTS_Sheet: 30M12A				
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.				
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
92	1 of 1	NE/120.4	79.8 / 1.00	PORT CREDIT GO STATION PORT CREDIT ON	WWIS
Well ID:	7321812			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	0			Date Received:	07-Nov-2018 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z266902			Contractor:	6607
Tag:	A241249			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Static Water Level: Clear/Cloudy: Municipality: Site Info:		MISSISSAUGA CITY (PORT CREDIT)		Zone: UTM Reliability:	
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2018/01/15				
Year Completed:	2018				
Depth (m):	15.2				
Latitude:	43.5570024471017				
Longitude:	-79.5846738016095				
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1007307134			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614314.00
Code OB Desc:				North83:	4823645.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	15-Jan-2018 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007605495				
Layer:	2				
Color:	2				
General Color:	GREY				
Mat1:	05				
Most Common Material:	CLAY				
Mat2:	06				
Mat2 Desc:	SILT				
Mat3:	85				
Mat3 Desc:	SOFT				
Formation Top Depth:	1.5				
Formation End Depth:	6.0				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007605497				
Layer:	4				
Color:	2				
General Color:	GREY				
Mat1:	15				
Most Common Material:	LIMESTONE				
Mat2:	26				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat2 Desc:		ROCK			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		9.100000381469727			
Formation End Depth:		15.199999809265137			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007605496			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		6.0			
Formation End Depth:		9.100000381469727			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007605494			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		1.5			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007605507			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		11.8000000190734863			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007605506			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Method Construction ID:		1007605505			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007605493			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007605501			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		12.100000381469727			
Casing Diameter:		5.099999904632568			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Casing</u>					
Casing ID:		1007605502			
Layer:		2			
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007605503			
Layer:		1			
Slot:		10			
Screen Top Depth:		12.100000381469727			
Screen End Depth:		15.199999809265137			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.400000095367432			
<u>Water Details</u>					
Water ID:		1007605500			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1007605499			
Diameter:		9.600000381469727			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth From:		9.100000381469727			
Depth To:		15.199999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1007605498			
Diameter:		21.0			
Depth From:		0.0			
Depth To:		9.100000381469727			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:	1007307134			Tag No:	A241249
Depth M:	15.2			Contractor:	6607
Year Completed:	2018			Path:	732\7321812.pdf
Well Completed Dt:	2018/01/15			Latitude:	43.5570024471017
Audit No:	Z266902			Longitude:	-79.5846738016095

93	1 of 1	SSW/121.5	79.4 / 0.56	ON	BORE
Borehole ID:	640913			Inclin FLG:	No
OGF ID:	215541308			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.554578
Total Depth m:	-999			Longitude DD:	-79.586766
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614150
Drill Method:	Power auger			Northing:	4823373
Orig Ground Elev m:	80.5			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	80.6				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218494047			Mat Consistency:	
Top Depth:	.1			Material Moisture:	
Bottom Depth:	1.2			Material Texture:	Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM,SILT, CLAY. BROWN,ALLUVIAL,LAYERED, AGE POST-GLACIAL.				
Geology Stratum ID:	218494046			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.1			Material Texture:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:		FILL, GRAVEL.			
Geology Stratum ID:	218494048			Mat Consistency:	
Top Depth:	1.2			Material Moisture:	Wet
Bottom Depth:				Material Texture:	Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:		SAND-MEDIUM, CLAY, SILT. BROWN, ALLUVIAL, WET, AGE POST-GLACIAL.			
Geology Stratum ID:	218494045			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	0			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		ASPHALT.			
 Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Details:		File: TOR1B.txt RecordID: 088790 NTS_Sheet: 30M12A			
Confiden 1:		Logs are approximately correct. Lack of information. Doubtful terminology.			
 Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Originators:		Geological Survey of Canada			
94	1 of 1	E/123.5	79.8 / 1.00	84 & 90 High Street East Mississauga ON L5G 1K4	EHS
Order No:	20190924039			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	RSC Report (Urban)			Client Prov/State:	ON
Report Date:	26-SEP-19			Search Radius (km):	.3
Date Received:	24-SEP-19			X:	-79.583497
Previous Site Name:				Y:	43.555938
Lot/Building Size:					
Additional Info Ordered:		City Directory			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
95	1 of 1	SE/123.6	79.8 / 1.00	12 Helene St N Mississauga ON L5G	EHS
Order No:		20120124021	Nearest Intersection:		
Status:		C	Municipality:		
Report Type:		Standard Report	Client Prov/State: ON		
Report Date:		2/2/2012 2:39:53 PM	Search Radius (km): 0.25		
Date Received:		1/24/2012 2:38:53 PM	X: -79.584748		
Previous Site Name:			Y: 43.554666		
Lot/Building Size:					
Additional Info Ordered:					
96	1 of 1	NE/126.2	79.8 / 1.00	GO STATION PARKING LOT (SOUTH SIDE) PORT CREDIT ON	WWIS
Well ID:		7321811	Flowing (Y/N):		
Construction Date:			Flow Rate:		
Use 1st:		Monitoring	Data Entry Status:		
Use 2nd:			Data Src:		
Final Well Status:		Observation Wells	Date Received: 07-Nov-2018 00:00:00		
Water Type:			Selected Flag: TRUE		
Casing Material:			Abandonment Rec:		
Audit No:		Z266901	Contractor: 6607		
Tag:		A241299	Form Version: 7		
Constructn Method:			Owner:		
Elevation (m):			County: PEEL		
Elevatn Reliabilty:			Lot:		
Depth to Bedrock:			Concession:		
Well Depth:			Concession Name:		
Overburden/Bedrock:			Easting NAD83:		
Pump Rate:			Northing NAD83:		
Static Water Level:			Zone:		
Clear/Cloudy:			UTM Reliability:		
Municipality:		MISSISSAUGA CITY (PORT CREDIT)			
Site Info:					
PDF URL (Map):					
Additional Detail(s) (Map)					
Well Completed Date:		2018/01/14			
Year Completed:		2018			
Depth (m):		4.63296			
Latitude:		43.557000914527			
Longitude:		-79.5845500284015			
Path:					
Bore Hole Information					
Bore Hole ID:		1007307131	Elevation:		
DP2BR:			Elevrc:		
Spatial Status:			Zone: 17		
Code OB:			East83: 614324.00		
Code OB Desc:			North83: 4823645.00		
Open Hole:			Org CS: UTM83		
Cluster Kind:			UTMRC: 4		
Date Completed:		14-Jan-2018 00:00:00	UTMRC Desc: margin of error : 30 m - 100 m		
Remarks:			Location Method: wwr		
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007605479			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		34			
Mat3 Desc:		TILL			
Formation Top Depth:		6.0			
Formation End Depth:		7.599999904632568			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007605478			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		28			
Mat3 Desc:		SAND			
Formation Top Depth:		1.5			
Formation End Depth:		6.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007605477			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		1.5			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007605480			
Layer:		4			
Color:		2			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		7.599999904632568			
Formation End Depth:		15.199999809265137			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007605488			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007605489			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		11.800000190734863			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1007605487			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:		DIAMOND			
 <u>Pipe Information</u>					
Pipe ID:		1007605476			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1007605484			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		12.100000381469727			
Casing Diameter:		5.099999904632568			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1007605485			
Layer:		1			
Slot:		10			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen Top Depth:		12.100000381469727			
Screen End Depth:		15.199999809265137			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		6.400000095367432			
<u>Water Details</u>					
Water ID:		1007605483			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1007605481			
Diameter:		21.0			
Depth From:		0.0			
Depth To:		9.100000381469727			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Hole Diameter</u>					
Hole ID:		1007605482			
Diameter:					
Depth From:		9.100000381469727			
Depth To:		15.199999809265137			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Links</u>					
Bore Hole ID:	1007307131			Tag No:	A241299
Depth M:	4.63296			Contractor:	6607
Year Completed:	2018			Path:	732\7321811.pdf
Well Completed Dt:	2018/01/14			Latitude:	43.557000914527
Audit No:	Z266901			Longitude:	-79.5845500284015

97	1 of 1	NNE/127.0	79.8 / 1.00	46 ORIOLE AVE Mississauga ON	WWIS
Well ID:	7290488			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	18-Jul-2017 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z248281			Contractor:	6607
Tag:	A224419			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Clear/Cloudy:		MISSISSAUGA CITY (PORT CREDIT)		UTM Reliability:	
Municipality:					
Site Info:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2017/05/23			
Year Completed:		2017			
Depth (m):		13.5			
Latitude:		43.5575094769784			
Longitude:		-79.5856276508326			
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1006630840			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614236.00
Code OB Desc:				North83:	4823700.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	23-May-2017 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006696712				
Layer:	2				
Color:	6				
General Color:	BROWN				
Mat1:	28				
Most Common Material:	SAND				
Mat2:	06				
Mat2 Desc:	SILT				
Mat3:	77				
Mat3 Desc:	LOOSE				
Formation Top Depth:	1.0				
Formation End Depth:	2.0				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006696713				
Layer:	3				
Color:	6				
General Color:	BROWN				
Mat1:	06				
Most Common Material:	SILT				
Mat2:	05				
Mat2 Desc:	CLAY				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:		2.0			
Formation End Depth:		3.0			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006696711			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		01			
Mat3 Desc:		FILL			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006696714			
Layer:		4			
Color:		2			
General Color:		GREY			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		05			
Mat2 Desc:		CLAY			
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:		3.0			
Formation End Depth:		9.100000381469727			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006696715			
Layer:		5			
Color:		2			
General Color:		GREY			
Mat1:		17			
Most Common Material:		SHALE			
Mat2:		15			
Mat2 Desc:		LIMESTONE			
Mat3:		74			
Mat3 Desc:		LAYERED			
Formation Top Depth:		9.100000381469727			
Formation End Depth:		13.5			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006696723			
Layer:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug From:					
Plug To:					
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006696725			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		9.199999809265137			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006696724			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006696722			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:		DIAMOND			
<u>Pipe Information</u>					
Pipe ID:		1006696710			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006696719			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.10000000149011612			
Depth To:		9.699999809265137			
Casing Diameter:		5.099999904632568			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1006696720			
Layer:		1			
Slot:		10			
Screen Top Depth:		9.699999809265137			
Screen End Depth:		12.800000190734863			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.400000095367432			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Water Details</u>					
Water ID:		1006696718			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1006696716			
Diameter:		21.0			
Depth From:		0.0			
Depth To:		9.100000381469727			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1006696717			
Diameter:		9.600000381469727			
Depth From:		9.100000381469727			
Depth To:		13.5			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:	1006630840			Tag No:	A224419
Depth M:	13.5			Contractor:	6607
Year Completed:	2017			Path:	
Well Completed Dt:	2017/05/23			Latitude:	43.5575094769784
Audit No:	Z248281			Longitude:	-79.5856276508326
<u>98</u> 1 of 1 NE/127.2 79.8 / 1.00 ON BORE					
Borehole ID:	646208			Inclin FLG:	No
OGF ID:	215546591			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	MAY-1968			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.557073
Total Depth m:	4.6			Longitude DD:	-79.584665
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614315
Drill Method:	Diamond Drill			Northing:	4823653
Orig Ground Elev m:	82.3			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	83				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Geology Stratum ID:	218514035			Mat Consistency:	Hard
Top Depth:	3.9			Material Moisture:	
Bottom Depth:	4.6			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Shale			Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	TILL,CLAY,SHALE. GREY,HARD. 014 015 00000032000700363004 **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	218514034			Mat Consistency:	Dense
Top Depth:	2.1			Material Moisture:	
Bottom Depth:	3.9			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Silt			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Sand			Geologic Period:	
Material 4:				Depositional Gen:	lacustrine
Gsc Material Description:					
Stratum Description:	SILT,CLAY,SAND. GREY,LACUSTRINE,DENSE, AGE GLACIAL.				
Geology Stratum ID:	218514033			Mat Consistency:	Dense
Top Depth:	0			Material Moisture:	
Bottom Depth:	2.1			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	SAND,SILT. BROWN,GLACIAL,DENSE, AGE GLACIAL.				
Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR2.txt RecordID: 142300 NTS_Sheet: 30M12A				
Confiden 1:	Reliable information but incomplete.				
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
99	1 of 1	NE/129.4	79.8 / 1.00	1175 Hurontario St ON	WWIS
Well ID:	7371903			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	03-Nov-2020 00:00:00
Water Type:				Selected Flag:	TRUE

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Material:					
Audit No:	99H24M77			Abandonment Rec:	
Tag:	A295536			Contractor:	7360
Constructn Method:				Form Version:	9
Elevation (m):				Owner:	
Elevatn Reliabilty:				County:	PEEL
Depth to Bedrock:				Lot:	
Well Depth:				Concession:	
Overburden/Bedrock:				Concession Name:	
Pump Rate:				Easting NAD83:	
Static Water Level:				Northing NAD83:	
Clear/Cloudy:				Zone:	
Municipality:		MISSISSAUGA CITY (PORT CREDIT)		UTM Reliability:	
Site Info:					

Bore Hole Information

Bore Hole ID:	1008490876	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614304.00
Code OB Desc:		North83:	4823663.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	28-Apr-2020 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Loc Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock

Materials Interval

Formation ID:	1008491006
Layer:	2
Color:	2
General Color:	GREY
Mat1:	34
Most Common Material:	TILL
Mat2:	
Mat2 Desc:	
Mat3:	73
Mat3 Desc:	HARD
Formation Top Depth:	10.0
Formation End Depth:	30.0
Formation End Depth UOM:	ft

Overburden and Bedrock

Materials Interval

Formation ID:	1008491005
Layer:	1
Color:	6
General Color:	BROWN
Mat1:	01
Most Common Material:	FILL
Mat2:	
Mat2 Desc:	
Mat3:	73

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat3 Desc:		HARD			
Formation Top Depth:		0.0			
Formation End Depth:		10.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008491091			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008491120			
Layer:		1			
Plug From:		0.0			
Plug To:		18.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1008490949			
Method Construction Code:		E			
Method Construction:		Auger			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1008490924			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1008491042			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		20.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1008491057			
Layer:		1			
Slot:		0.1			
Screen Top Depth:		20.0			
Screen End Depth:		30.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.25			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:	1008490925				
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:	ft				
Rate UOM:	GPM				
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:	1008491072				
Diameter:	6.0				
Depth From:	0.0				
Depth To:	30.0				
Hole Depth UOM:	ft				
Hole Diameter UOM:	inch				
<u>Links</u>					
Bore Hole ID:	1008490876			Tag No:	A295536
Depth M:	9.144			Contractor:	7360
Year Completed:	2020			Path:	737\7371903.pdf
Well Completed Dt:	2020/04/28			Latitude:	43.5571660057986
Audit No:	99H24M77			Longitude:	-79.5847937820893
100	1 of 1	NE/129.5	79.8 / 1.00	1175 Hurontario St ON	WWIS
Well ID:	7371901			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	03-Nov-2020 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	S8J2AU54			Contractor:	7360
Tag:	A295534			Form Version:	9
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Bore Hole Information</u>					
Bore Hole ID:	1008490870			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614300.00
Code OB Desc:				North83:	4823666.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	28-Apr-2020 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1008491001				
Layer:	2				
Color:	2				
General Color:	GREY				
Mat1:	34				
Most Common Material:	TILL				
Mat2:					
Mat2 Desc:					
Mat3:	73				
Mat3 Desc:	HARD				
Formation Top Depth:	10.0				
Formation End Depth:	30.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1008491000				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	01				
Most Common Material:	FILL				
Mat2:					
Mat2 Desc:					
Mat3:	73				
Mat3 Desc:	HARD				
Formation Top Depth:	0.0				
Formation End Depth:	10.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1008491002				
Layer:	3				
Color:	2				
General Color:	GREY				
Mat1:	26				
Most Common Material:	ROCK				
Mat2:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		30.0			
Formation End Depth:		50.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008491089			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008491118			
Layer:		1			
Plug From:		0.0			
Plug To:		38.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1008490947			
Method Construction Code:		E			
Method Construction:		Auger			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1008490920			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1008491040			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		40.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1008491055			
Layer:		1			
Slot:		0.1			
Screen Top Depth:		40.0			
Screen End Depth:		50.0			
Screen Material:		5			
Screen Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen Diameter UOM:		inch			
Screen Diameter:		2.25			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1008490921			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1008491070			
Diameter:		6.0			
Depth From:		0.0			
Depth To:		50.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Links</u>					
Bore Hole ID:		1008490870		Tag No:	A295534
Depth M:		15.24		Contractor:	7360
Year Completed:		2020		Path:	737\7371901.pdf
Well Completed Dt:		2020/04/28		Latitude:	43.5571936231171
Audit No:		S8J2AU54		Longitude:	-79.5848426594078
<u>101</u>	1 of 1	SE/129.8	79.8 / 1.00	ON	BORE
Borehole ID:		641138		Inclin FLG:	No
OGF ID:		215541533		SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:		Borehole		Piezometer:	No
Use:		Geotechnical/Geological Investigation		Primary Name:	
Completion Date:		JAN-1965		Municipality:	
Static Water Level:				Lot:	
Primary Water Use:		Not Used		Township:	
Sec. Water Use:				Latitude DD:	43.554641
Total Depth m:		2.4		Longitude DD:	-79.584598
Depth Ref:		Ground Surface		UTM Zone:	17
Depth Elev:				Easting:	614325
Drill Method:		Power auger		Northing:	4823383
Orig Ground Elev m:		77.3		Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:		77.6			
Concession:					
Location D:					
Survey D:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218494915			Mat Consistency:	
Top Depth:	.1			Material Moisture:	
Bottom Depth:	.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL, GRAVEL.				
Geology Stratum ID:	218494914			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ASPHALT.				
Geology Stratum ID:	218494916			Mat Consistency:	
Top Depth:	.2			Material Moisture:	
Bottom Depth:	1.5			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND, SILT, CLAY. BROWN, ALLUVIAL, AGE POST-GLACIAL.				
Geology Stratum ID:	218494917			Mat Consistency:	
Top Depth:	1.5			Material Moisture:	
Bottom Depth:	2.4			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND, SILT, CLAY. BROWN, ALLUVIAL, AGE POST-GLACIAL. . SAND-M **Note: Many records provided by the department have a truncated [Stratum Description] field.				
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 091040 NTS_Sheet: 30M12A				
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.				
<u>Source List</u>					
Source Identifier:	1			Horizontal Datum:	NAD27

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				

102	1 of 1	NE/130.1	79.8 / 1.00	ON	WWIS
Well ID:	7378959			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	29-Jan-2021 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z348116			Contractor:	7644
Tag:	A312088			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:					

Bore Hole Information

Bore Hole ID:	1008614892	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614318.00
Code OB Desc:		North83:	4823654.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	18-Dec-2020 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Loc Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Links

Bore Hole ID:	1008614892	Tag No:	A312088
Depth M:		Contractor:	7644
Year Completed:	2020	Path:	737\7378959.pdf
Well Completed Dt:	2020/12/18	Latitude:	43.5570828472105
Audit No:	Z348116	Longitude:	-79.5846223957281

103	1 of 1	SE/130.3	79.8 / 1.00	ON	BORE
Borehole ID:	640926	Inclin FLG:	No		
OGF ID:	215541321	SP Status:	Initial Entry		
Status:		Surv Elev:	No		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.554771
Total Depth m:	2.7			Longitude DD:	-79.584224
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614355
Drill Method:	Power auger			Northing:	4823398
Orig Ground Elev m:	77.1			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	77.6				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218494106			Mat Consistency:	
Top Depth:	.2			Material Moisture:	
Bottom Depth:	.3			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:	Granuls			Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL, GRAVEL, CINDERS.				
Geology Stratum ID:	218494108			Mat Consistency:	
Top Depth:	.5			Material Moisture:	
Bottom Depth:	.9			Material Texture:	
Material Color:	Yellow			Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:	Clay			Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL, SAND, SILT, CLAY. YELLOW.				
Geology Stratum ID:	218494111			Mat Consistency:	
Top Depth:	2.4			Material Moisture:	
Bottom Depth:	2.7			Material Texture:	
Material Color:	Black			Non Geo Mat Type:	
Material 1:	Silt			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	SILT, SAND, CLAY. BLACK, LAYERED, AGE POST-GLACIAL.				
Geology Stratum ID:	218494105			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL, GRAVEL.				
Geology Stratum ID:	218494109			Mat Consistency:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	.9 1.8 Fill Granuls Sand Silt			Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	 fill
Gsc Material Description: Stratum Description:	 FILL,CINDERS,SAND, SILT.				
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218494110 1.8 2.4 Organic Sand Silt Clay			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	
Gsc Material Description: Stratum Description:	 ORGANIC,SAND,SILT, CLAY. AGE POST-GLACIAL.				
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218494107 .3 .5 Brown Fill Sand Silt Clay			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	 fill
Gsc Material Description: Stratum Description:	 FILL,SAND,SILT,CLAY.BROWN.				
Source					
Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	Data Survey Geological Survey of Canada 1956-1972 M Urban Geology Automated Information System (UGAIS) File: TOR1B.txt RecordID: 088920 NTS_Sheet: 30M12A Logs are approximately correct. Lack of information. Doubtful terminology.			Source Appl: Source Iden: Scale or Res: Horizontal: Verticalda:	Spatial/Tabular 1 Varies NAD27 Mean Average Sea Level
Source List					
Source Identifier: Source Type: Source Date: Scale or Resolution: Source Name: Source Originators:	1 Data Survey 1956-1972 Varies Urban Geology Automated Information System (UGAIS) Geological Survey of Canada			Horizontal Datum: Vertical Datum: Projection Name:	NAD27 Mean Average Sea Level Universal Transverse Mercator
104	1 of 1	WNW/130.4	79.9 / 1.07	1155 VESTA DRIVE PORT CREDIT ON	WWIS
Well ID: Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No:	7306886 Monitoring Observation Wells Z255682			Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: Selected Flag: Abandonment Rec: Contractor:	 08-Mar-2018 00:00:00 TRUE 6607

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Tag:	A241261			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY (PORT CREDIT)			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/730\7306886.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2017/12/08			
Year Completed:		2017			
Depth (m):		12.5			
Latitude:		43.5566992737001			
Longitude:		-79.5878256340761			
Path:		730\7306886.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1006995692		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614060.00
Code OB Desc:				North83:	4823607.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		08-Dec-2017 00:00:00		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007194415			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		3.0			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID: 1007194417					
Layer: 3					
Color: 2					
General Color: GREY					
Mat1: 17					
Most Common Material: SHALE					
Mat2: 15					
Mat2 Desc: LIMESTONE					
Mat3:					
Mat3 Desc:					
Formation Top Depth: 9.399999618530273					
Formation End Depth: 12.5					
Formation End Depth UOM: m					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID: 1007194416					
Layer: 2					
Color: 2					
General Color: GREY					
Mat1: 06					
Most Common Material: SILT					
Mat2: 28					
Mat2 Desc: SAND					
Mat3: 11					
Mat3 Desc: GRAVEL					
Formation Top Depth: 3.0					
Formation End Depth: 9.399999618530273					
Formation End Depth UOM: m					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID: 1007194425					
Layer: 1					
Plug From: 0.0					
Plug To: 0.30000001192092896					
Plug Depth UOM: m					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID: 1007194426					
Layer: 2					
Plug From: 0.30000001192092896					
Plug To: 9.100000381469727					
Plug Depth UOM: m					
<u>Method of Construction & Well Use</u>					
Method Construction ID: 1007194424					
Method Construction Code: 6					
Method Construction: Boring					
Other Method Construction: DIAMOND					
<u>Pipe Information</u>					
Pipe ID: 1007194414					
Casing No: 0					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007194421			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		9.399999618530273			
Casing Diameter:		5.099999904632568			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007194422			
Layer:		1			
Slot:		10			
Screen Top Depth:		9.399999618530273			
Screen End Depth:		12.5			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.400000095367432			
<u>Water Details</u>					
Water ID:		1007194420			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1007194418			
Diameter:		21.0			
Depth From:		0.0			
Depth To:		9.399999618530273			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1007194419			
Diameter:		9.600000381469727			
Depth From:		9.399999618530273			
Depth To:		12.5			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:	1006995692			Tag No:	A241261
Depth M:	12.5			Contractor:	6607
Year Completed:	2017			Path:	730\7306886.pdf
Well Completed Dt:	2017/12/08			Latitude:	43.5566992737001
Audit No:	Z255682			Longitude:	-79.5878256340761

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
105	1 of 1	NNE/130.5	79.8 / 1.00	30 QUEEN ST E Mississauga ON	WWIS
Well ID: 7290480 Construction Date: Use 1st: Monitoring Use 2nd: Final Well Status: Observation Wells Water Type: Casing Material: Audit No: Z248282 Tag: A209829 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: MISSISSAUGA CITY (PORT CREDIT) Site Info: Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 18-Jul-2017 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 6607 Form Version: 7 Owner: County: PEEL Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 2017/05/26 Year Completed: 2017 Depth (m): 11.9 Latitude: 43.5574704078907 Longitude: -79.5853809447429 Path:					
<u>Bore Hole Information</u>					
Bore Hole ID: 1006630636 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 26-May-2017 00:00:00 Remarks: Loc Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment: Elevation: Elevrc: Zone: 17 East83: 614256.00 North83: 4823696.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID: 1006694572 Layer: 4 Color: 2 General Color: GREY					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:		7.599999904632568			
Formation End Depth:		9.0			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006694571			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		05			
Mat2 Desc:		CLAY			
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:		3.4000000953674316			
Formation End Depth:		7.599999904632568			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006694569			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		01			
Mat3 Desc:		FILL			
Formation Top Depth:		0.0			
Formation End Depth:		0.6000000238418579			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006694570			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:		0.6000000238418579			
Formation End Depth:		3.4000000953674316			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Materials Interval</u>					
Formation ID:		1006694573			
Layer:		5			
Color:		2			
General Color:		GREY			
Mat1:		17			
Most Common Material:		SHALE			
Mat2:		15			
Mat2 Desc:		LIMESTONE			
Mat3:		74			
Mat3 Desc:		LAYERED			
Formation Top Depth:		9.0			
Formation End Depth:		11.899999618530273			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006694582			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006694583			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		8.399999618530273			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006694581			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006694580			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006694568			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006694577			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:1 Material:5 Open Hole or Material:PLASTIC Depth From:0.10000000149011612 Depth To:9.0 Casing Diameter:5.099999904632568 Casing Diameter UOM:cm Casing Depth UOM:m					
Construction Record - Screen Screen ID:1006694578 Layer:1 Slot:10 Screen Top Depth:9.0 Screen End Depth:11.8999999618530273 Screen Material:5 Screen Depth UOM:m Screen Diameter UOM:cm Screen Diameter:6.400000095367432					
Water Details Water ID:1006694576 Layer: Kind Code: Kind: Water Found Depth: Water Found Depth UOM:m					
Hole Diameter Hole ID:1006694574 Diameter:21.0 Depth From:0.0 Depth To:9.0 Hole Depth UOM:m Hole Diameter UOM:cm					
Hole Diameter Hole ID:1006694575 Diameter:9.600000381469727 Depth From:9.0 Depth To:11.8999999618530273 Hole Depth UOM:m Hole Diameter UOM:cm					
Links Bore Hole ID:1006630636 Depth M:11.9 Year Completed:2017 Well Completed Dt:2017/05/26 Audit No:Z248282 Tag No:A209829 Contractor:6607 Path: Latitude:43.5574704078907 Longitude:-79.5853809447429					
106	1 of 1	NNW/131.1	79.8 / 1.00	Mobilinx Hurontario General Partnership 515 Oriole Avenue Unit 12 Mississauga ON L5G 1V3	GEN
Generator No:		ON4494168		Status:	Registered

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Code: SIC Description: Approval Years: As of Nov 2021 PO Box No: Country: Canada					
Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
Detail(s)					
Waste Class: 146 L Waste Class Desc: Other specified inorganic sludges, slurries or solids					
107	1 of 1	E/131.4	79.8 / 1.00	90 High Street East, Mississauga ON	PINC
Incident Id: Incident No: 789716 Incident Reported Dt: Type: FS-Pipeline Incident Status Code: Pipeline Damage Reason Est Tank Status: RC Established Task No: 3788069 Spills Action Centre: Fuel Type: Fuel Occurrence Tp: Date of Occurrence: Occurrence Start Dt: 2012/04/13 Depth: Customer Acct Name: Incident Address: Operation Type: Pipeline Type: Regulator Type: Summary: 90 High Street East, Mississauga - 1/2" Pipeline Hit Reported By: Jeffrey.Bruce@enbridge.com Affiliation: Occurrence Desc: Damage Reason: Excavation practices not sufficient Notes:					
Pipe Material: Fuel Category: Natural Gas Health Impact: Environment Impact: Property Damage: Yes Service Interrupt: Enforce Policy: Yes Public Relation: Pipeline System: PSIG: Attribute Category: FS-Perform P-line Inc Invest Regulator Location: Method Details: E-mail					
108	1 of 1	NE/132.4	79.8 / 1.00	72 QUEEN STREET PORT CREDIT ON	WWIS
Well ID: 7306887 Construction Date: Use 1st: Test Hole Use 2nd: Final Well Status: Observation Wells Water Type: Casing Material: Audit No: Z255689 Tag: A241274 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: MISSISSAUGA CITY (PORT CREDIT) Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 08-Mar-2018 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 6607 Form Version: 7 Owner: County: PEEL Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/730\7306887.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2017/12/15			
Year Completed:		2017			
Depth (m):		15.2			
Latitude:		43.5573495591138			
Longitude:		-79.5850742479462			
Path:		730\7306887.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1006995695		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				East83:	
Code OB Desc:				North83:	
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	
Date Completed:		15-Dec-2017 00:00:00		UTMRC Desc:	
Remarks:				Location Method:	
Loc Method Desc:		on Water Well Record		margin of error : 30 m - 100 m	
Elevrc Desc:				www	
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007194429			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:		11			
Mat3 Desc:		GRAVEL			
Formation Top Depth:		3.0			
Formation End Depth:		8.800000190734863			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007194430			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		17			
Most Common Material:		SHALE			
Mat2:		15			
Mat2 Desc:		LIMESTONE			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		8.800000190734863			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth:		15.199999809265137			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007194428			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		3.0			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007194438			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007194439			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		8.800000190734863			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007194437			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:		TRICONE			
<u>Pipe Information</u>					
Pipe ID:		1007194427			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007194434			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		9.100000381469727			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Diameter:		10.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1007194435			
Layer:		1			
Slot:		10			
Screen Top Depth:		9.100000381469727			
Screen End Depth:		15.199999809265137			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		11.5			
 <u>Water Details</u>					
Water ID:		1007194433			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
 <u>Hole Diameter</u>					
Hole ID:		1007194432			
Diameter:		16.0			
Depth From:		9.100000381469727			
Depth To:		15.199999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Hole Diameter</u>					
Hole ID:		1007194431			
Diameter:		25.0			
Depth From:		0.0			
Depth To:		9.100000381469727			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Links</u>					
Bore Hole ID:	1006995695			Tag No:	A241274
Depth M:	15.2			Contractor:	6607
Year Completed:	2017			Path:	730\7306887.pdf
Well Completed Dt:	2017/12/15			Latitude:	43.5573495591138
Audit No:	Z255689			Longitude:	-79.5850742479462
109	1 of 1	ESE/132.7	79.8 / 1.00	FRAM GROUP (CANADA) INC Ann and High St Mississauga ON	SPL
Ref No:	0641-ARZQ9U			Discharger Report:	
Site No:	NA			Material Group:	
Incident Dt:	2017/10/10			Health/Env Conseq:	2 - Minor Environment
Year:				Client Type:	Corporation
Incident Cause:				Sector Type:	Miscellaneous Industrial
Incident Event:	Leak/Break			Agency Involved:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: Dt Document Closed: Incident Reason: Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: Contaminant Qty:	28 WASHWATER (N.O.S.) n/a Surface Water No 2017/10/10 Operator/Human Error spill<UNOFFICIAL> Regional Municipality of Peel Fran Group discharge of cement washout of trucks 20 L			Nearest Watercourse: Site Address: Site District Office: Site Postal Code: Site Region: Site Municipality: Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:	Lake Ontario Ann and High St Halton-Peel Central Mississauga 4823474 614413 Land Spills Truck - Transport/Hauling

110	1 of 1	N/133.4	79.8 / 1.00	GO STATION PARKING LOT PORT CREDIT ON	WWIS
Well ID: Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: Tag: Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:	7307828 Test Hole Monitoring Observation Wells Z266924 A241368 MISSISSAUGA CITY (PORT CREDIT)			Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: Selected Flag: Abandonment Rec: Contractor: Form Version: Owner: County: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	 15-Mar-2018 00:00:00 TRUE 6607 7 PEEL
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/730\7307828.pdf				

Additional Detail(s) (Map)

Well Completed Date: 2018/01/18
Year Completed: 2018
Depth (m): 8.53
Latitude: 43.5576161488494
Longitude: -79.5862442070135
Path: 730\7307828.pdf

Bore Hole Information

Bore Hole ID: DP2BR: Spatial Status: Code OB: Code OB Desc:	1007003204 	Elevation: Elevrc: Zone: East83: North83:	 17 614186.00 4823711.00

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed: 18-Jan-2018 00:00:00				UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc: on Water Well Record					
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:				1007229587	
Layer:				2	
Color:				6	
General Color:				BROWN	
Mat1:				28	
Most Common Material:				SAND	
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:				1.0	
Formation End Depth:				3.0	
Formation End Depth UOM:				m	
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:				1007229588	
Layer:				3	
Color:				2	
General Color:				GREY	
Mat1:				28	
Most Common Material:				SAND	
Mat2:				12	
Mat2 Desc:				STONES	
Mat3:				73	
Mat3 Desc:				HARD	
Formation Top Depth:				3.0	
Formation End Depth:				8.529999732971191	
Formation End Depth UOM:				m	
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:				1007229586	
Layer:				1	
Color:				6	
General Color:				BROWN	
Mat1:				28	
Most Common Material:				SAND	
Mat2:				11	
Mat2 Desc:				GRAVEL	
Mat3:				01	
Mat3 Desc:				FILL	
Formation Top Depth:				0.0	
Formation End Depth:				1.0	
Formation End Depth UOM:				m	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007229597			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		4.800000190734863			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007229596			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007229595			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007229585			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007229591			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		5.5			
Casing Diameter:		5.099999904632568			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007229592			
Layer:		1			
Slot:		10			
Screen Top Depth:		5.5			
Screen End Depth:		8.5			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.400000095367432			
<u>Water Details</u>					
Water ID:		1007229590			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Kind Code:		8			
Kind:		Untested			
Water Found Depth:		2.5999999046325684			
Water Found Depth UOM:		m			
 <u>Hole Diameter</u>					
Hole ID:		1007229589			
Diameter:		21.0			
Depth From:					
Depth To:					
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Links</u>					
Bore Hole ID:	1007003204			Tag No:	A241368
Depth M:	8.53			Contractor:	6607
Year Completed:	2018			Path:	730\7307828.pdf
Well Completed Dt:	2018/01/18			Latitude:	43.5576161488494
Audit No:	Z266924			Longitude:	-79.5862442070135
111	1 of 1	NE/134.5	79.8 / 1.00	30 QUEEN ST E Mississauga ON	WWIS
Well ID:	7290487			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	18-Jul-2017 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z248283			Contractor:	6607
Tag:	A224322			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY (PORT CREDIT)			
Site Info:					
 PDF URL (Map):					
 <u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2017/05/24				
Year Completed:	2017				
Depth (m):	13.2				
Latitude:	43.557229169246				
Longitude:	-79.5848046844955				
Path:					
 <u>Bore Hole Information</u>					
Bore Hole ID:	1006630824			Elevation:	
DP2BR:				Elevrc:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Spatial Status:				Zone:	17
Code OB:				East83:	614303.00
Code OB Desc:				North83:	4823670.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		24-May-2017 00:00:00	UTMRC Desc:		margin of error : 30 m - 100 m
Remarks:		Location Method:		wwr	
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006696661			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		05			
Mat2 Desc:		CLAY			
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:		2.299999952316284			
Formation End Depth:		8.800000190734863			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006696660			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:		0.699999988079071			
Formation End Depth:		2.299999952316284			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006696662			
Layer:		4			
Color:		2			
General Color:		GREY			
Mat1:		17			
Most Common Material:		SHALE			
Mat2:		15			
Mat2 Desc:		LIMESTONE			
Mat3:		74			
Mat3 Desc:		LAYERED			
Formation Top Depth:		8.800000190734863			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth:		13.199999809265137			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006696659			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		01			
Mat3 Desc:		FILL			
Formation Top Depth:		0.0			
Formation End Depth:		0.699999988079071			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006696671			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		9.600000381469727			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006696670			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006696669			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:		DIAMOND			
<u>Pipe Information</u>					
Pipe ID:		1006696658			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006696666			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.10000000149011612			
Depth To:		10.300000190734863			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Diameter:		5.099999904632568			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1006696667			
Layer:		1			
Slot:		10			
Screen Top Depth:		10.300000190734863			
Screen End Depth:		13.199999809265137			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.400000095367432			
<u>Water Details</u>					
Water ID:		1006696665			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1006696664			
Diameter:		9.600000381469727			
Depth From:		8.800000190734863			
Depth To:		13.199999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1006696663			
Diameter:		21.0			
Depth From:		0.0			
Depth To:		8.800000190734863			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:		1006630824	Tag No:		A224322
Depth M:		13.2	Contractor:		6607
Year Completed:		2017	Path:		
Well Completed Dt:		2017/05/24	Latitude:		43.557229169246
Audit No:		Z248283	Longitude:		-79.5848046844955
112	1 of 1	SSW/136.5	79.8 / 1.00	Regional Municipality of Peel Elizabeth St. and Park St. Mississauga ON	SPL
Ref No:		5502-9EN45T		Discharger Report:	
Site No:				Material Group:	
Incident Dt:		2013/12/22		Health/Env Conseq:	
Year:				Client Type:	
Incident Cause:		Leak/Break		Sector Type: Water Supply	
Incident Event:				Agency Involved:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: Dt Document Closed: Incident Reason: Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: Contaminant Qty:	99 WATER Not Anticipated Surface Water Pollution No Field Response 2013/12/22 Equipment Failure Elizabeth St. and Park St.<UNOFFICIAL> Region of Peel: Potable water to SS, Credit River, L. Ont. 0 other - see incident description			Nearest Watercourse: Site Address: Site District Office: Site Postal Code: Site Region: Site Municipality: Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:	Elizabeth St. and Park St. Mississauga Watercourse Spills
113	1 of 2	SW/139.5	78.9 / 0.05	28 Elizabeth Street North Mississauga ON L5G 2Z6	EHS
Order No: Status: Report Type: Report Date: Date Received: Previous Site Name: Lot/Building Size: Additional Info Ordered:	20051130005 C Site Report 12/1/2005 11/30/2005 Additional Info Ordered:			Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): X: Y:	Park Street East ON 0.25 -79.6753 43.554739
113	2 of 2	SW/139.5	78.9 / 0.05	Compten Management Inc. 28 Elizabeth Street North Mississauga ON	SPL
Ref No: Site No: Incident Dt: Year: Incident Cause: Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: Dt Document Closed: Incident Reason: Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: Contaminant Qty:	7523-B46RN2 NA 2018/08/30 Overflow/Surcharge 13 DIESEL FUEL 1202 Land Yes 2018/09/05 2018/08/31 Operator/Human Error Apartment building - back of the building<UNOFFICIAL> Regional Municipality of Peel 28 Elizabeth: ~ 5 L of diesel to asphalt, cntd, clnup ongn 5 L			Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office: Site Postal Code: Site Region: Site Municipality: Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:	2 - Minor Environment Corporation Miscellaneous Communal 28 Elizabeth Street North Halton-Peel Central Mississauga 4823385 614121 Land Spills Other

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
114	1 of 1	S/140.6	79.8 / 1.00	ON	BORE
Borehole ID:		640912	Inclin FLG: No		
OGF ID:		215541307	SP Status: Initial Entry		
Status:			Surv Elev: No		
Type:		Borehole	Piezometer: No		
Use:		Geotechnical/Geological Investigation	Primary Name:		
Completion Date:		JAN-1965	Municipality:		
Static Water Level:			Lot:		
Primary Water Use:		Not Used	Township:		
Sec. Water Use:			Latitude DD: 43.554301		
Total Depth m:		2.1	Longitude DD: -79.586215		
Depth Ref:		Ground Surface	UTM Zone: 17		
Depth Elev:			Easting: 614195		
Drill Method:		Power auger	Northing: 4823343		
Orig Ground Elev m:		77.4	Location Accuracy:		
Elev Reliabil Note:			Accuracy: Not Applicable		
DEM Ground Elev m:		79.1			
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:		218494040	Mat Consistency:		
Top Depth:		0	Material Moisture:		
Bottom Depth:		.1	Material Texture:		
Material Color:			Non Geo Mat Type:		
Material 1:		Fill	Geologic Formation:		
Material 2:		Gravel	Geologic Group:		
Material 3:			Geologic Period:		
Material 4:			Depositional Gen: fill		
Gsc Material Description:					
Stratum Description:		FILL, GRAVEL.			
Geology Stratum ID:		218494041	Mat Consistency:		
Top Depth:		.1	Material Moisture:		
Bottom Depth:		.5	Material Texture: Medium		
Material Color:			Non Geo Mat Type:		
Material 1:		Sand	Geologic Formation:		
Material 2:		Clay	Geologic Group:		
Material 3:		Silt	Geologic Period:		
Material 4:			Depositional Gen:		
Gsc Material Description:					
Stratum Description:		SAND-MEDIUM, CLAY, SILT.			
Geology Stratum ID:		218494042	Mat Consistency:		
Top Depth:		.5	Material Moisture: Wet		
Bottom Depth:		1.5	Material Texture: Medium		
Material Color:		Grey	Non Geo Mat Type:		
Material 1:		Sand	Geologic Formation:		
Material 2:		Silt	Geologic Group:		
Material 3:		Clay	Geologic Period:		
Material 4:			Depositional Gen: alluvial		
Gsc Material Description:					
Stratum Description:		SAND-MEDIUM, SILT, CLAY. GREY, ALLUVIAL, WET, AGE POST-GLACIAL.			
Geology Stratum ID:		218494043	Mat Consistency:		
Top Depth:		1.5	Material Moisture:		
Bottom Depth:		1.8	Material Texture:		
Material Color:		Black	Non Geo Mat Type:		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	Muck			Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:alluvial	
	MUCK. BLACK,ALLUVIAL, AGE POST-GLACIAL.				
Geology Stratum ID: Top Depth: Bottom Depth: Material Color:	218494044 1.8 2.1			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type:	Firm
Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	Clay Sand Silt			Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:alluvial	
	CLAY,SAND,SILT. ALLUVIAL,FIRM, AGE POST-GLACIAL. PO **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Source					
Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	Data Survey Geological Survey of Canada 1956-1972 M			Source Appl: Source Iden: Scale or Res: Horizontal: Verticalda:	Spatial/Tabular 1 Varies NAD27 Mean Average Sea Level
	Urban Geology Automated Information System (UGAIS) File: TOR1B.txt RecordID: 088780 NTS_Sheet: 30M12A Logs are approximately correct. Lack of information. Doubtful terminology.				
Source List					
Source Identifier: Source Type: Source Date: Scale or Resolution: Source Name: Source Originators:	1 Data Survey 1956-1972 Varies Urban Geology Automated Information System (UGAIS) Geological Survey of Canada			Horizontal Datum: Vertical Datum: Projection Name:	NAD27 Mean Average Sea Level Universal Transverse Mercator
115	1 of 1	NNE/141.5	79.8 / 1.00	NORTH OF TRACKS NEAR ORICLE AVE Mississauga ON	WWIS
Well ID: Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: Tag: Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:	7290469 Monitoring Test Hole Z248389 A224416 MISSISSAUGA CITY (PORT CREDIT)			Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: Selected Flag: Abandonment Rec: Contractor: Form Version: Owner: County: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	 18-Jul-2017 00:00:00 TRUE 6607 7 PEEL

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2017/05/03				
Year Completed:	2017				
Depth (m):	10.1				
Latitude:	43.5576348848251				
Longitude:	-79.5855751927829				
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1006630455			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614240.00
Code OB Desc:				North83:	4823714.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	03-May-2017 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006694198				
Layer:	2				
Color:	6				
General Color:	BROWN				
Mat1:	27				
Most Common Material:	OTHER				
Mat2:	28				
Mat2 Desc:	SAND				
Mat3:	77				
Mat3 Desc:	LOOSE				
Formation Top Depth:	0.20000000298023224				
Formation End Depth:	0.699999988079071				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006694197				
Layer:	1				
Color:	8				
General Color:	BLACK				
Mat1:	27				
Most Common Material:	OTHER				
Mat2:	11				
Mat2 Desc:	GRAVEL				
Mat3:	66				
Mat3 Desc:	DENSE				
Formation Top Depth:	0.0				
Formation End Depth:	0.20000000298023224				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006694199			
Layer:		3			
Color:		6			
General Color:		BROWN			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:		27			
Mat3 Desc:		OTHER			
Formation Top Depth:		0.699999988079071			
Formation End Depth:		2.299999952316284			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006694200			
Layer:		4			
Color:		2			
General Color:		GREY			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		11			
Mat3 Desc:		GRAVEL			
Formation Top Depth:		2.299999952316284			
Formation End Depth:		10.100000381469727			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006694210			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		6.5			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006694211			
Layer:		3			
Plug From:		6.5			
Plug To:		10.399999618530273			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006694212			
Layer:		4			
Plug From:		10.399999618530273			
Plug To:		13.100000381469727			
Plug Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006694209			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006694208			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006694196			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006694205			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		6.699999809265137			
Casing Diameter:		5.099999904632568			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1006694206			
Layer:		1			
Slot:		10			
Screen Top Depth:		6.699999809265137			
Screen End Depth:		9.800000190734863			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.400000095367432			
<u>Water Details</u>					
Water ID:		1006694204			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole ID: 1006694203					
Diameter: 10.0					
Depth From: 10.100000381469727					
Depth To: 13.100000381469727					
Hole Depth UOM: m					
Hole Diameter UOM: cm					
<u>Hole Diameter</u>					
Hole ID: 1006694202					
Diameter: 21.0					
Depth From: 0.0					
Depth To: 10.100000381469727					
Hole Depth UOM: m					
Hole Diameter UOM: cm					
<u>Links</u>					
Bore Hole ID:	1006630455			Tag No:	A224416
Depth M:	10.1			Contractor:	6607
Year Completed:	2017			Path:	
Well Completed Dt:	2017/05/03			Latitude:	43.5576348848251
Audit No:	Z248389			Longitude:	-79.5855751927829
<u>116</u>	1 of 1	E/142.5	79.8 / 1.00	90 High St E Mississauga ON L5G1K4	EHS
Order No:	20180301170			Nearest Intersection:	
Status:	C			Municipality:	Mississauga
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	08-MAR-18			Search Radius (km):	.25
Date Received:	01-MAR-18			X:	-79.583282
Previous Site Name:				Y:	43.556065
Lot/Building Size:	0.22 hectares				
Additional Info Ordered:					
<u>117</u>	1 of 1	N/143.4	79.8 / 1.00	1175 Hurontario St ON	WWIS
Well ID:	7371902			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	03-Nov-2020 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	L8EQ62BY			Contractor:	7360
Tag:	A295535			Form Version:	9
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:					

Bore Hole Information

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bore Hole ID:	1008490873			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614232.00
Code OB Desc:				North83:	4823718.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	29-Apr-2020 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1008491004				
Layer:	2				
Color:	2				
General Color:	GREY				
Mat1:	34				
Most Common Material:	TILL				
Mat2:	66				
Mat2 Desc:	DENSE				
Mat3:	73				
Mat3 Desc:	HARD				
Formation Top Depth:	10.0				
Formation End Depth:	30.0				
Formation End Depth UOM:	ft				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1008491003				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	01				
Most Common Material:	FILL				
Mat2:					
Mat2 Desc:					
Mat3:	85				
Mat3 Desc:	SOFT				
Formation Top Depth:	0.0				
Formation End Depth:	10.0				
Formation End Depth UOM:	ft				
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1008491090				
Layer:	1				
Plug From:					
Plug To:					
Plug Depth UOM:	ft				
 <u>Annular Space/Abandonment</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Sealing Record</u>					
Plug ID:		1008491119			
Layer:		1			
Plug From:		0.0			
Plug To:		18.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1008490948			
Method Construction Code:		E			
Method Construction:		Auger			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1008490922			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1008491041			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		20.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1008491056			
Layer:		1			
Slot:		0.1			
Screen Top Depth:		20.0			
Screen End Depth:		30.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.25			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1008490923			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pumping Test Method: Pumping Duration HR: Pumping Duration MIN: Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1008491071			
Diameter:		6.0			
Depth From:		0.0			
Depth To:		30.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Links</u>					
Bore Hole ID:	1008490873			Tag No:	A295535
Depth M:	9.144			Contractor:	7360
Year Completed:	2020			Path:	737\7371902.pdf
Well Completed Dt:	2020/04/29			Latitude:	43.5576721158667
Audit No:	L8EQ62BY			Longitude:	-79.5856733701059
<u>118</u>	1 of 1	ESE/144.1	79.8 / 1.00	8 ANN ST ON	WWIS
Well ID:	7288429			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	19-Jun-2017 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	Z230821			Contractor:	7230
Tag:	A203341			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY (PORT CREDIT)			
Site Info:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:					
Year Completed:					
Depth (m):					
Latitude:		43.5550888818842			
Longitude:		-79.5835672081283			
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1006547861			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Code OB:				East83:	614407.00
Code OB Desc:				North83:	4823434.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:				UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006778043			
Layer:					
Color:					
General Color:					
Mat1:					
Most Common Material:					
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006778050			
Layer:		1			
Plug From:		0.0			
Plug To:		6.099999904632568			
Plug Depth UOM:		ft			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1006778049			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006778042			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006778046			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth To:		3.0999999046325684			
Casing Diameter:		5.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006778047			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.0999999046325684			
Screen End Depth:		6.099999904632568			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		5.199999809265137			
<u>Water Details</u>					
Water ID:		1006778045			
Layer:		1			
Kind Code:		8			
Kind:		Untested			
Water Found Depth:		4.699999809265137			
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006778044			
Diameter:		15.0			
Depth From:		0.0			
Depth To:		61.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Links</u>					
Bore Hole ID:	1006547861			Tag No:	A203341
Depth M:				Contractor:	7230
Year Completed:				Path:	728\7288429.pdf
Well Completed Dt:				Latitude:	43.5550888818842
Audit No:	Z230821			Longitude:	-79.5835672081283
119	1 of 1	E/146.9	79.8 / 1.00	ON	BORE
Borehole ID:	640924			Inclin FLG:	No
OGF ID:	215541319			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.555704
Total Depth m:	1.2			Longitude DD:	-79.583211
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614435
Drill Method:	Power auger			Northing:	4823503
Orig Ground Elev m:	190			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	80.5				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Concession: Location D: Survey D: Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218494099			Mat Consistency:	
Top Depth:	.4			Material Moisture:	
Bottom Depth:	.6			Material Texture:	Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM,SILT, CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL.				
Geology Stratum ID:	218494096			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ASPHALT.				
Geology Stratum ID:	218494097			Mat Consistency:	
Top Depth:	.1			Material Moisture:	
Bottom Depth:	.2			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL,GRAVEL. BROWN.				
Geology Stratum ID:	218494100			Mat Consistency:	
Top Depth:	.6			Material Moisture:	
Bottom Depth:	1.2			Material Texture:	Medium
Material Color:	Yellow			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM. YELLOW,ALLUVIAL, AGE POST-GLACIAL. SAND- **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	218494098			Mat Consistency:	
Top Depth:	.2			Material Moisture:	
Bottom Depth:	.4			Material Texture:	Medium
Material Color:	Yellow			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM. YELLOW,ALLUVIAL, AGE POST-GLACIAL.				

Source

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Type: Data Survey Source Orig: Geological Survey of Canada Source Date: 1956-1972 Confidence: M Observatio: Source Name: Urban Geology Automated Information System (UGAIS) Source Details: File: TOR1B.txt RecordID: 088900 NTS_Sheet: 30M12A Confiden 1: Logs are approximately correct. Lack of information. Doubtful terminology.					
Source Appl: Spatial/Tabular Source Iden: 1 Scale or Res: Varies Horizontal: NAD27 Verticalda: Mean Average Sea Level					
Source List					
Source Identifier: 1 Source Type: Data Survey Source Date: 1956-1972 Scale or Resolution: Varies Source Name: Urban Geology Automated Information System (UGAIS) Source Originators: Geological Survey of Canada					
Horizontal Datum: NAD27 Vertical Datum: Mean Average Sea Level Projection Name: Universal Transverse Mercator					
120	1 of 2	ESE/147.1	79.8 / 1.00	Home Alone Property Management Services Limited 10 ANN ST, MISSISSAUGA, ON, L5G 3E6 ON L5G 3E6	RSC
RSC ID: 112316 RA No: RSC Type: Curr Property Use: Commercial Ministry District: MISSISSAUGA Filing Date: 21-Jun-11 Date Ack: Date Returned: Restoration Type: Soil Type: Criteria: CPU Issued Sect 1686: No Asmt Roll No: Prop ID No (PIN): 13463-0038 (LT) Property Municipal Address: 10 ANN ST, MISSISSAUGA, ON, L5G 3E6 Mailing Address: 10 ANN ST, MISSISSAUGA, ON, L5G 3E6 Latitude & Longitude: 43.55517830N 79.58351560W (converted from UTM) UTM Coordinates: NAD83 17-614411-4823444 Consultant: Legal Desc: Parts of Lots No. 2 and 3 South side of High Street East of the River Credit City of Mississauga Regional Municipality of Peel Land Registry Office of Peel (No. 3) More particularly described in Schedule "A" attached. Measurement Method: Digitized from a map Applicable Standards: ESA Phase 1 RSC PDF:					
Cert Date: 7-Jun-11 Cert Prop Use No: No CPU Intended Prop Use: Residential Qual Person Name: Rob Jones Stratified (Y/N): Audit (Y/N): Entire Leg Prop. (Y/N): Yes Accuracy Estimate: 0 to 1 meters Telephone: 905-2719922 Fax: Email:					
120	2 of 2	ESE/147.1	79.8 / 1.00	F.S. 6810 DEVELOPMENT INC. 10 ANN STREET, MISSISSAUGA, ON L5G 2E6 Mississauga ON	RSC
RSC ID: 223748 RA No: RSC Type: Phase 1 and 2 RSC Curr Property Use: Commercial Ministry District: Halton-Peel District Office Filing Date: 2017/09/05 Date Ack: Date Returned: Restoration Type:					
Cert Date: Cert Prop Use No: Intended Prop Use: Residential Qual Person Name: SAMUEL OYEDOKUN Stratified (Y/N): Audit (Y/N): Entire Leg Prop. (Y/N): Accuracy Estimate: Telephone:					

275 erisinfo.com | Environmental Risk Information Services Order No: 22091501030

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	29-Jan-2021 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z348112			Contractor:	7644
Tag:	A312083			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY (PORT CREDIT)			
Site Info:					

Bore Hole Information

Bore Hole ID:	1008614904	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614198.00
Code OB Desc:		North83:	4823726.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	18-Dec-2020 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	www
Loc Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Links

Bore Hole ID:	1008614904	Tag No:	A312083
Depth M:		Contractor:	7644
Year Completed:	2020	Path:	737\7378963.pdf
Well Completed Dt:	2020/12/18	Latitude:	43.5577493337049
Audit No:	Z348112	Longitude:	-79.5860925197754

[122](#)

1 of 1

N/147.7

79.8 / 1.00

ON

BORE

Borehole ID:	833842	Inclin FLG:	No
OGF ID:	215585973	SP Status:	Initial Entry
Status:	Decommissioned	Surv Elev:	No
Type:	Borehole	Piezometer:	No
Use:	Geotechnical/Geological Investigation	Primary Name:	
Completion Date:	20-JUN-1969	Municipality:	
Static Water Level:	2.4	Lot:	
Primary Water Use:		Township:	
Sec. Water Use:		Latitude DD:	43.557749
Total Depth m:	5.9	Longitude DD:	-79.586055
Depth Ref:	Ground Surface	UTM Zone:	17
Depth Elev:		Easting:	614201
Drill Method:	Power auger	Northing:	4823726

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Orig Ground Elev m:	84.4			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Within 10 metres
DEM Ground Elev m:	81.5				
Concession:					
Location D:		CNR (PORT CREDIT) * GO TRANSIT PARKING LOT EXTENSION			
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	6014609			Mat Consistency:	Hard
Top Depth:	1.8			Material Moisture:	
Bottom Depth:	5.9			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Sand			Geologic Period:	
Material 4:	Gravel			Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:		Clayey silt with some sand and gravel, (glacial till), grey, hard **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:	6014606			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.1			Material Texture:	
Material Color:				Non Geo Mat Type:	Asphalt
Material 1:				Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		Asphalt **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:	6014607			Mat Consistency:	
Top Depth:	.1			Material Moisture:	
Bottom Depth:	.3			Material Texture:	
Material Color:				Non Geo Mat Type:	Fill-Misc
Material 1:	Sand			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		Sand and gravel (fill) **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:	6014608			Mat Consistency:	Dense
Top Depth:	.3			Material Moisture:	
Bottom Depth:	1.8			Material Texture:	Fine
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		Silty fine sand, brown, dense **Note: Many records provided by the department have a truncated [Stratum Description] field.			

123

1 of 1

SE/148.7

79.8 / 1.00

ON

BORE

Borehole ID: 639274
 OGF ID: 215539671
 Status:
 Type: Borehole

Inclin FLG: No
 SP Status: Initial Entry
 Surv Elev: No
 Piezometer: No

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.554461
Total Depth m:	.9			Longitude DD:	-79.584602
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614325
Drill Method:	Power auger			Northing:	4823363
Orig Ground Elev m:	76.5			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	77.4				
Concession:					
Location D:					
Survey D:					
Comments:					
 <u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218487723			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Water-bearing			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	WATER.				
Geology Stratum ID:	218487725			Mat Consistency:	Firm
Top Depth:	.8			Material Moisture:	
Bottom Depth:	.9			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Silt			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SILT,SAND,CLAY. GREY,ALLUVIAL,FIRM, AGE POST-GLACIAL. CLAY. BR				**Note: Many records provided by the department have a truncated [Stratum Description] field.
Geology Stratum ID:	218487724			Mat Consistency:	
Top Depth:	.2			Material Moisture:	
Bottom Depth:	.8			Material Texture:	
Material Color:	Black			Non Geo Mat Type:	
Material 1:	Organic			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ORGANIC. BLACK,AGE POST-GLACIAL.				
 <u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 072370 NTS_Sheet: 30M12A				
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
124	1 of 1	E/149.3	79.8 / 1.00	High Street, Park Street East & Hurontario Street Mississauga ON	CA
Certificate #:	0657-4SGM38				
Application Year:	00				
Issue Date:	12/29/00				
Approval Type:	Municipal & Private water				
Status:	Approved				
Application Type:	New Certificate of Approval				
Client Name:	Corporation of the Regional Municipality of Peel				
Client Address:	10 Peel Centre Drive				
Client City:	Brampton				
Client Postal Code:	L6T 4B9				
Project Description:	Watermain and appurtenances to be constructed in conjunction with Project no. 00-1310 in the City of Mississauga, on High Street, Park Street East and Hurontario Street.				
Contaminants:					
Emission Control:					
125	1 of 1	NW/149.6	80.5 / 1.60	PRIVATE RESIDENCE 40 ORIOLE AVE. FURNACE OIL TANK MISSISSAUGA CITY ON L5G 1V2	SPL
Ref No:	121312				
Site No:					
Incident Dt:	11/28/1995				
Year:					
Incident Cause:	PIPE/HOSE LEAK				
Incident Event:					
Contaminant Code:					
Contaminant Name:					
Contaminant Limit 1:					
Contam Limit Freq 1:					
Contaminant UN No 1:					
Environment Impact:	POSSIBLE				
Nature of Impact:	Soil contamination				
Receiving Medium:	LAND				
Receiving Env:					
MOE Response:					
Dt MOE Arvl on Scn:					
MOE Reported Dt:	11/29/1995				
Dt Document Closed:					
Incident Reason:	OVERSTRESS/OVERPRESSURE				
Site Name:					
Site County/District:					
Site Geo Ref Meth:					
Incident Summary:	PRIVATE RESIDENCE: 1/2 L FURNACE OIL TO GROUND FROM VENT PIPE BACK-UP.				
Contaminant Qty:					
126	1 of 1	ENE/149.7	79.8 / 1.00	ON	BORE
Borehole ID:	833856			Inclin FLG:	No

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
OGF ID:	215585987			SP Status:	Initial Entry
Status:	Decommissioned			Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	02-JUN-1959			Municipality:	
Static Water Level:	3.5			Lot:	
Primary Water Use:				Township:	
Sec. Water Use:				Latitude DD:	43.556701
Total Depth m:	6.9			Longitude DD:	-79.583591
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614402
Drill Method:	Hollow stem auger			Northing:	4823613
Orig Ground Elev m:	82.6			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Within 20 metres
DEM Ground Elev m:	82.5				
Concession:					
Location D:		PORT CREDIT CREEK TO LAKE ONTARIO * STORM SEWER			
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	6014653			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.6			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Topsoil			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		Topsoil **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:	6014655			Mat Consistency:	
Top Depth:	.9			Material Moisture:	
Bottom Depth:	2.4			Material Texture:	Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		Medium brown silty clay **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:	6014656			Mat Consistency:	Stiff
Top Depth:	2.4			Material Moisture:	
Bottom Depth:	6.9			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:	Sand			Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:		Stiff silty clay or clayey silt with sand and small stones, (glacial till) **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:	6014654			Mat Consistency:	
Top Depth:	.6			Material Moisture:	
Bottom Depth:	.9			Material Texture:	Fine
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Gsc Material Description: Stratum Description: Fine sand **Note: Many records provided by the department have a truncated [Stratum Description] field.					
127	1 of 1	ESE/149.9	79.8 / 1.00	FRAM GROUP (CANADA) INC 69 High St. E Mississauga ON	SPL
Ref No: 3448-AMNA27				Discharger Report:	
Site No:				Material Group:	
Incident Dt: 5/24/2017				Health/Env Conseq:	2 - Minor Environment
Year:				Client Type:	Corporation
Incident Cause:				Sector Type:	Other
Incident Event: Operator/Human error				Agency Involved:	
Contaminant Code: 27				Nearest Watercourse:	
Contaminant Name: CONCRETE				Site Address:	69 High St. E
Contaminant Limit 1:				Site District Office:	Halton-Peel
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1: n/a				Site Region:	Central
Environment Impact:				Site Municipality:	Mississauga
Nature of Impact:				Site Lot:	
Receiving Medium:				Site Conc:	
Receiving Env: Land				Northing:	
MOE Response:				Easting:	
Dt MOE Arvl on Scn:				Site Geo Ref Accu:	
MOE Reported Dt: 5/24/2017				Site Map Datum:	
Dt Document Closed:				SAC Action Class:	
Incident Reason: Deliberate Act				Source Type:	Other
Site Name: Concrete waste to CB's<UNOFFICIAL>					
Site County/District: Regional Municipality of Peel					
Site Geo Ref Meth:					
Incident Summary: Mississauga: concrete, drill bits and wash water to CB's					
Contaminant Qty: 1 n/a					
128	1 of 1	WSW/150.6	77.8 / -1.04	ON	BORE
Borehole ID: 833905				Inclin FLG:	No
OGF ID: 215586036				SP Status:	Initial Entry
Status: Decommissioned				Surv Elev:	No
Type: Borehole				Piezometer:	No
Use: Geotechnical/Geological Investigation				Primary Name:	
Completion Date: 29-MAY-1972				Municipality:	
Static Water Level:				Lot:	
Primary Water Use:				Township:	
Sec. Water Use:				Latitude DD:	43.55511
Total Depth m: 4.1				Longitude DD:	-79.588185
Depth Ref: Ground Surface				UTM Zone:	17
Depth Elev:				Easting:	614034
Drill Method: Boring				Northing:	4823430
Orig Ground Elev m: 85.6				Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Within 10 metres
DEM Ground Elev m: 84.1					
Concession:					
Location D: PORT CREDIT GO STATION * PLATFORM SHELTER					
Survey D:					
Comments: Hole dry					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: 6014836				Mat Consistency:	Very Loose
Top Depth: 0				Material Moisture:	
Bottom Depth: 4.1				Material Texture:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material Color: Material 1: Coal fragments Material 2: Sand Material 3: Gravel Material 4: Silt Gsc Material Description: Stratum Description: Asphalt - top 0.05m, (fill); crushed coal with sand and gravel; sand and gravel, some silt, (occasional pieces of coal throughout), very loose to compact **Note: Many records provided by the department have a truncated [Stratum Description] field.					
129	1 of 1	ENE/152.4	79.8 / 1.00	ON	BORE
Borehole ID: 649448 OGF ID: 215549823 Status: Type: Borehole Use: Geotechnical/Geological Investigation Completion Date: JUN-1959 Static Water Level: Primary Water Use: Not Used Sec. Water Use: Total Depth m: 6.9 Depth Ref: Ground Surface Depth Elev: Drill Method: Diamond Drill Orig Ground Elev m: 82.6 Elev Reliabil Note: DEM Ground Elev m: 82.4 Concession: Location D: Survey D: Comments:					
Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD: 43.556653 Longitude DD: -79.583498 UTM Zone: 17 Easting: 614410 Northing: 4823608 Location Accuracy: Accuracy: Not Applicable					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: 218527010 Top Depth: 2.4 Bottom Depth: 6.9 Material Color: Material 1: Till Material 2: Clay Material 3: Silt Material 4: Sand Gsc Material Description: Stratum Description: TILL,CLAY,SILT,SAND.HARD. 016 010 0003004000080080 **Note: Many records provided by the department have a truncated [Stratum Description] field.					
Mat Consistency: Hard Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					
Geology Stratum ID: 218527008 Top Depth: .6 Bottom Depth: .9 Material Color: Material 1: Sand Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description: SAND.					
Mat Consistency: Hard Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation:					
Geology Stratum ID: 218527009 Top Depth: .9 Bottom Depth: 2.4 Material Color: Brown Material 1: Clay					
Mat Consistency: Hard Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation:					

283 erisinfo.com | Environmental Risk Information Services Order No: 22091501030

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2016/06/22				
Year Completed:	2016				
Depth (m):					
Latitude:	43.5551849837195				
Longitude:	-79.5833297265704				
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1006177173			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614426.00
Code OB Desc:				North83:	4823445.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	22-Jun-2016 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Links</u>					
Bore Hole ID:	1006177173			Tag No:	A203341
Depth M:				Contractor:	7230
Year Completed:	2016			Path:	
Well Completed Dt:	2016/06/22			Latitude:	43.5551849837195
Audit No:	C33944			Longitude:	-79.5833297265704
<u>131</u>	1 of 1	NNE/155.6	79.8 / 1.00	ON	BORE
Borehole ID:	833871			Inclin FLG:	No
OGF ID:	215586002			SP Status:	Initial Entry
Status:	Decommissioned			Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	01-MAR-1962			Municipality:	
Static Water Level:	1.7			Lot:	
Primary Water Use:				Township:	
Sec. Water Use:				Latitude DD:	43.557629
Total Depth m:	10.7			Longitude DD:	-79.58513
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614276
Drill Method:	Diamond Drill			Northing:	4823714
Orig Ground Elev m:	84.8			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Within 10 metres
DEM Ground Elev m:	83.6				
Concession:					
Location D:	CNR & HWY NO 10 * UNDERPASS				
Survey D:					
Comments:	Hole by BX casing drilled to various sampling intervals; W.L after casing withdrawn = 1.77m; W.L after stabilization = 1.71m				
<u>Borehole Geology Stratum</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Geology Stratum ID:	6014716			Mat Consistency:	
Top Depth:	9.4			Material Moisture:	
Bottom Depth:	10.7			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Bedrock			Geologic Formation:	
Material 2:	Limestone			Geologic Group:	
Material 3:	Shale			Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	Bedrock - Hard limestone with some interbeds of dark grey shale **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	6014712			Mat Consistency:	
Top Depth:	1.8			Material Moisture:	Moist
Bottom Depth:	2.5			Material Texture:	Fine
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	Brown, moist, clayey silty fine sand **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	6014713			Mat Consistency:	Hard
Top Depth:	2.5			Material Moisture:	
Bottom Depth:	3.8			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:	Pebbles			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	Hard, brown, clay with some pebbles **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	6014710			Mat Consistency:	Stiff
Top Depth:	.9			Material Moisture:	
Bottom Depth:	1.6			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	Fill-Misc
Material 1:	Silt			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Gravel			Geologic Period:	
Material 4:	Clay			Depositional Gen:	
Gsc Material Description:					
Stratum Description:	Stiff, grey, clayey silt and sand and gravel fill **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	6014709			Mat Consistency:	Loose
Top Depth:	0			Material Moisture:	
Bottom Depth:	.9			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	Cinder Ash
Material 1:	Silt			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	Loose, brown, silt, sand, and cinders **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	6014714			Mat Consistency:	Hard
Top Depth:	3.8			Material Moisture:	
Bottom Depth:	7.6			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Silt			Geologic Formation:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 2:	Gravel			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:	Sand			Depositional Gen:	
Gsc Material Description:					
Stratum Description:		Hard, grey, sandy clayey silt with some gravel; limestone gravel or slabs at least 0.05m thick between 6m and 6.4m **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:	6014715			Mat Consistency:	Very Dense
Top Depth:	7.6			Material Moisture:	
Bottom Depth:	9.4			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		Very dense, slightly cohesive silty sand with some gravel **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:	6014711			Mat Consistency:	
Top Depth:	1.6			Material Moisture:	
Bottom Depth:	1.8			Material Texture:	
Material Color:				Non Geo Mat Type:	Brick
Material 1:	Topsoil			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		Sandy topsoil, brick fragments **Note: Many records provided by the department have a truncated [Stratum Description] field.			

[132](#)

1 of 1

NE/156.2

79.8 / 1.00

ON

[BORE](#)

Borehole ID:	649453	Inclin FLG:	No
OGF ID:	215549828	SP Status:	Initial Entry
Status:		Surv Elev:	No
Type:	Borehole	Piezometer:	No
Use:	Geotechnical/Geological Investigation	Primary Name:	
Completion Date:	DEC-1959	Municipality:	
Static Water Level:	0.2	Lot:	
Primary Water Use:	Not Used	Township:	
Sec. Water Use:		Latitude DD:	43.557295
Total Depth m:	5	Longitude DD:	-79.584474
Depth Ref:	Ground Surface	UTM Zone:	17
Depth Elev:		Easting:	614330
Drill Method:	Power auger	Northing:	4823678
Orig Ground Elev m:	83.5	Location Accuracy:	
Elev Reliabil Note:		Accuracy:	Not Applicable
DEM Ground Elev m:	81.5		
Concession:			
Location D:			
Survey D:			
Comments:			

Borehole Geology Stratum

Geology Stratum ID:	218527024	Mat Consistency:	Dense
Top Depth:	2.4	Material Moisture:	
Bottom Depth:	5	Material Texture:	
Material Color:	Grey	Non Geo Mat Type:	
Material 1:	Till	Geologic Formation:	
Material 2:	Clay	Geologic Group:	
Material 3:	Sand	Geologic Period:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 4:		Gravel		Depositional Gen:	
Gsc Material Description:					
Stratum Description:		TILL,CLAY,SAND, GRAVEL. GREY,VERY DENSE. 020 011 0001005000080065 **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:		218527023		Mat Consistency:	Dense
Top Depth:		.3		Material Moisture:	
Bottom Depth:		2.4		Material Texture:	
Material Color:		Grey		Non Geo Mat Type:	
Material 1:		Sand		Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		SAND. GREY,VERY DENSE, WATER STABLE AT 273.5 FEET.			
Geology Stratum ID:		218527022		Mat Consistency:	
Top Depth:		0		Material Moisture:	
Bottom Depth:		.3		Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:		Soil		Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		SOIL.			
<u>Source</u>					
Source Type:		Data Survey		Source Appl:	Spatial/Tabular
Source Orig:		Geological Survey of Canada		Source Iden:	1
Source Date:		1956-1972		Scale or Res:	Varies
Confidence:		H		Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Details:		File: TOR3.txt RecordID: 201120 NTS_Sheet: 30M12A			
Confiden 1:		Logged by professional. Exact and complete description of material and properties.			
<u>Source List</u>					
Source Identifier:		1		Horizontal Datum:	NAD27
Source Type:		Data Survey		Vertical Datum:	Mean Average Sea Level
Source Date:		1956-1972		Projection Name:	Universal Transverse Mercator
Scale or Resolution:		Varies			
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Originators:		Geological Survey of Canada			
133	1 of 1	N/156.5	79.8 / 1.00	ON	BORE
Borehole ID:		649455		Inclin FLG:	No
OGF ID:		215549830		SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:		Borehole		Piezometer:	No
Use:		Geotechnical/Geological Investigation		Primary Name:	
Completion Date:		DEC-1959		Municipality:	
Static Water Level:				Lot:	
Primary Water Use:		Not Used		Township:	
Sec. Water Use:				Latitude DD:	43.557807
Total Depth m:		5		Longitude DD:	-79.585762
Depth Ref:		Ground Surface		UTM Zone:	17
Depth Elev:				Easting:	614225
Drill Method:		Diamond Drill		Northing:	4823733

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Orig Ground Elev m: Elev Reliabil Note: DEM Ground Elev m: Concession: Location D: Survey D: Comments:	84.3 82.7			Location Accuracy: Accuracy:	Not Applicable
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218527031 1.5 2.4 Sand			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Dense
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218527029 0 .3 Soil			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218527030 .3 1.5 Sand Silt Clay			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Dense
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218527032 2.4 5 Till Clay Silt Gravel			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Dense
TILL,CLAY,SILT, GRAVEL. VERY DENSE. 026 014 010 0001004200050055000 **Note: Many records provided by the department have a truncated [Stratum Description] field.					
<u>Source</u>					
Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details:	Data Survey Geological Survey of Canada 1956-1972 H Urban Geology Automated Information System (UGAIS) File: TOR3.txt RecordID: 201140 NTS Sheet: 30M12A			Source Appl: Source Iden: Scale or Res: Horizontal: Verticalda:	Spatial/Tabular 1 Varies NAD27 Mean Average Sea Level

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Confiden 1:		Logged by professional. Exact and complete description of material and properties.			
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				

134	1 of 1	N/156.8	79.8 / 1.00	ON	WWIS
Well ID:	7378965			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	29-Jan-2021 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z348111			Contractor:	7644
Tag:	A312082			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:					

Bore Hole Information

Bore Hole ID:	1008614910	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614193.00
Code OB Desc:		North83:	4823735.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	18-Dec-2020 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Loc Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Links

Bore Hole ID:	1008614910	Tag No:	A312082
Depth M:		Contractor:	7644
Year Completed:	2020	Path:	737\7378965.pdf
Well Completed Dt:	2020/12/18	Latitude:	43.55783111235
Audit No:	Z348111	Longitude:	-79.5861525125888

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218527019 0 1.1 Sand SAND.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218527020 1.1 2.4 Grey Clay Silt CLAY,SILT. GREY,DENSE, WATER STABLE AT 272.1 FEET.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Dense
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218527021 2.4 7.6 Grey Till Clay Silt Stones TILL,CLAY,SILT, STONES. GREY,VERY DENSE. 022 010 0003504000080085 **Note: Many records provided by the department have a truncated [Stratum Description] field.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Dense
Source					
Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	Data Survey Geological Survey of Canada 1956-1972 H Urban Geology Automated Information System (UGAIS) File: TOR3.txt RecordID: 201110 NTS_Sheet: 30M12A Logged by professional. Exact and complete description of material and properties.			Source Appl: Source Iden: Scale or Res: Horizontal: Verticalda:	Spatial/Tabular 1 Varies NAD27 Mean Average Sea Level
Source List					
Source Identifier: Source Type: Source Date: Scale or Resolution: Source Name: Source Originators:	1 Data Survey 1956-1972 Varies Urban Geology Automated Information System (UGAIS) Geological Survey of Canada			Horizontal Datum: Vertical Datum: Projection Name:	NAD27 Mean Average Sea Level Universal Transverse Mercator
137	1 of 1	NE/158.1	79.8 / 1.00	ON	BORE
Borehole ID: OGF ID: Status: Type: Use: Completion Date:	833855 215585986 Decommissioned Borehole Geotechnical/Geological Investigation 02-JUN-1959			Inclin FLG: SP Status: Surv Elev: Piezometer: Primary Name: Municipality:	No Initial Entry No No

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Static Water Level:	3.7			Lot:	
Primary Water Use:				Township:	
Sec. Water Use:				Latitude DD:	43.557287
Total Depth m:	7.6			Longitude DD:	-79.58442
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614334
Drill Method:	Hollow stem auger			Northing:	4823677
Orig Ground Elev m:	83.3			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Within 20 metres
DEM Ground Elev m:	81.6				
Concession:					
Location D:		PORT CREDIT CREEK TO LAKE ONTARIO * STORM SEWER			
Survey D:					
Comments:					

Borehole Geology Stratum

Geology Stratum ID:	6014650	Mat Consistency:	
Top Depth:	0	Material Moisture:	
Bottom Depth:	1.1	Material Texture:	Fine
Material Color:		Non Geo Mat Type:	
Material 1:	Sand	Geologic Formation:	
Material 2:		Geologic Group:	
Material 3:		Geologic Period:	
Material 4:		Depositional Gen:	
Gsc Material Description:			
Stratum Description:	Fine sand **Note: Many records provided by the department have a truncated [Stratum Description] field.		

Geology Stratum ID:	6014652	Mat Consistency:	
Top Depth:	2.4	Material Moisture:	
Bottom Depth:	7.6	Material Texture:	
Material Color:	Grey	Non Geo Mat Type:	
Material 1:	Till	Geologic Formation:	
Material 2:	Clay	Geologic Group:	
Material 3:	Silt	Geologic Period:	
Material 4:	Sand	Depositional Gen:	glacial
Gsc Material Description:			
Stratum Description:	Grey, silty clay or clayey silt with sand and small stones, (glacial till) **Note: Many records provided by the department have a truncated [Stratum Description] field.		

Geology Stratum ID:	6014651	Mat Consistency:	
Top Depth:	1.1	Material Moisture:	
Bottom Depth:	2.4	Material Texture:	
Material Color:	Grey	Non Geo Mat Type:	
Material 1:	Clay	Geologic Formation:	
Material 2:	Silt	Geologic Group:	
Material 3:		Geologic Period:	
Material 4:		Depositional Gen:	
Gsc Material Description:			
Stratum Description:	Grey, silty clay **Note: Many records provided by the department have a truncated [Stratum Description] field.		

[138](#) 1 of 1 E/158.2 79.8 / 1.00 ON [BORE](#)

Borehole ID:	833854	Inclin FLG:	No
OGF ID:	215585985	SP Status:	Initial Entry
Status:	Decommissioned	Surv Elev:	No
Type:	Borehole	Piezometer:	No
Use:	Geotechnical/Geological Investigation	Primary Name:	
Completion Date:	01-JUN-1959	Municipality:	
Static Water Level:	1.4	Lot:	
Primary Water Use:		Township:	
Sec. Water Use:		Latitude DD:	43.556435
Total Depth m:	6.7	Longitude DD:	-79.583239

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614431
Drill Method:	Hollow stem auger			Northing:	4823584
Orig Ground Elev m:	81.8			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Within 20 metres
DEM Ground Elev m:	82.3				
Concession:					
Location D:		PORT CREDIT CREEK TO LAKE ONTARIO * STORM SEWER			
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	6014647			Mat Consistency:	
Top Depth:	0			Material Moisture:	Wet
Bottom Depth:	2.7			Material Texture:	Fine
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		Fine to very fine sand (saturated below 1.52m) **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:	6014648			Mat Consistency:	Hard
Top Depth:	2.7			Material Moisture:	
Bottom Depth:	5.3			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Sand			Geologic Period:	
Material 4:	Stones			Depositional Gen:	
Gsc Material Description:					
Stratum Description:		Grey, hard, silty clay or clayey silt, with sand and stones up to 0.05m in diameter **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:	6014649			Mat Consistency:	
Top Depth:	5.3			Material Moisture:	
Bottom Depth:	6.7			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:		Glacial till **Note: Many records provided by the department have a truncated [Stratum Description] field.			
139	1 of 1	WSW/159.1	78.2 / -0.67	ON	BORE
Borehole ID:	833904			Inclin FLG:	No
OGF ID:	215586035			SP Status:	Initial Entry
Status:	Decommissioned			Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	29-MAY-1972			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:				Township:	
Sec. Water Use:				Latitude DD:	43.555066
Total Depth m:	7			Longitude DD:	-79.588272
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614027
Drill Method:	Boring			Northing:	4823425

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Orig Ground Elev m: Elev Reliabil Note: DEM Ground Elev m: Concession: Location D: Survey D: Comments:	85.6 84			Location Accuracy: Accuracy: Within 10 metres	
PORT CREDIT GO STATION * PLATFORM SHELTER					
No W.L - hole caved in					
Borehole Geology Stratum					
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	6014834 0 5.6 Silt Sand Gravel Coal fragments			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Very Loose Fill-Misc
Asphalt top 0.05; clayey silt with sand and gravel (fill), stiff; sand and gravel, trace of silt, (occasional pieces of coal and wood), fill, very loose to compact **Note: Many records provided by the department have a truncated [Stratum Description] field.					
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	6014835 5.6 7 Grey Sand Silt			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Dense Fine
Silty fine sand, dense, grey **Note: Many records provided by the department have a truncated [Stratum Description] field.					
140	1 of 1	SSE/160.1	79.8 / 1.00	50 High Street Mississauga ON	EHS
Order No: Status: Report Type: Report Date: Date Received: Previous Site Name: Lot/Building Size: Additional Info Ordered:	20130726007 C Custom Report 01-AUG-13 26-JUL-13			Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): X: Y:	 ON .25 -79.585158 43.554303
141	1 of 1	NNE/160.2	79.8 / 1.00	ON	BORE
Borehole ID: OGF ID: Status: Type: Use: Completion Date: Static Water Level: Primary Water Use: Sec. Water Use: Total Depth m: Depth Ref: Depth Elev:	833872 215586003 Decommissioned Borehole Geotechnical/Geological Investigation 01-MAR-1962 6.1 11.5 Ground Surface			Inclin FLG: SP Status: Surv Elev: Piezometer: Primary Name: Municipality: Lot: Township: Latitude DD: Longitude DD: UTM Zone: Easting:	No Initial Entry No No 43.557768 -79.585399 17 614254

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Drill Method:	Diamond Drill			Nothing:	4823729
Orig Ground Elev m:	85.2			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Within 10 metres
DEM Ground Elev m:	83.9				
Concession:					
Location D:		CNR & HWY NO 10 * UNDERPASS			
Survey D:					
Comments:		Installed porous piezometer; hole filled with sand and gravel to 7.01m; W.L stabilized to 6.13m after four days			
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	6014720			Mat Consistency:	
Top Depth:	2			Material Moisture:	
Bottom Depth:	3.8			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:				Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		(No data) **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:	6014721			Mat Consistency:	Hard
Top Depth:	3.8			Material Moisture:	
Bottom Depth:	7.6			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Silt			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:	Sand			Depositional Gen:	
Gsc Material Description:					
Stratum Description:		Hard, grey, sandy clayey silt with gravel (limestone gravel or slabs up to 0.13m thick from 6.46m to 6.77m) **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:	6014717			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.6			Material Texture:	
Material Color:				Non Geo Mat Type:	Cinder Ash
Material 1:	Gravel			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		Cinders and gravel up to 0.08m **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:	6014718			Mat Consistency:	Stiff
Top Depth:	.6			Material Moisture:	
Bottom Depth:	1.2			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	Fill-Misc
Material 1:	Clay			Geologic Formation:	
Material 2:	organic material			Geologic Group:	
Material 3:	Gravel			Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		Stiff to very stiff, brown clay fill - some organic material and gravel **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:	6014722			Mat Consistency:	Dense
Top Depth:	7.6			Material Moisture:	
Bottom Depth:	11.5			Material Texture:	Coarse
Material Color:				Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Gravel			Geologic Period:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 4: Gsc Material Description: Stratum Description:	Boulders			Depositional Gen:	glacial
		Dense, slightly cohesive, silty sand with coarse gravel, limestone boulders or slabs below 8.69m, drilled 10.03m to 11.52m through limestone boulders in glacial till; drill on partial pressure - not bedrock **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	6014719 1.2 2 Sand Topsoil Moist to wet, uniform fine sand, some sandy topsoil at 1.83m **Note: Many records provided by the department have a truncated [Stratum Description] field.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	 Moist Fine

142	1 of 1	SE/160.3	79.8 / 1.00	ON	BORE
Borehole ID: OGF ID: Status: Type: Use: Completion Date: Static Water Level: Primary Water Use: Sec. Water Use: Total Depth m: Depth Ref: Depth Elev: Drill Method: Orig Ground Elev m: Elev Reliabil Note: DEM Ground Elev m: Concession: Location D: Survey D: Comments:	641137 215541532 Borehole Geotechnical/Geological Investigation JAN-1965 Not Used 2.4 Ground Surface Power auger 77.1 77.5 			Inclin FLG: SP Status: Surv Elev: Piezometer: Primary Name: Municipality: Lot: Township: Latitude DD: Longitude DD: UTM Zone: Easting: Northing: Location Accuracy: Accuracy:	No Initial Entry No No 43.554456 -79.584231 17 614355 4823363 Not Applicable

Borehole Geology Stratum

Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218494910 0 .3 Gravel GRAVEL. ALLUVIAL,AGE POST-GLACIAL.		Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	 alluvial
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description:	218494911 .3 .8 Brown Sand Silt Clay alluvial		Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	 alluvial

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Stratum Description: SAND,SILT,CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL.					
Geology Stratum ID:	218494912			Mat Consistency:	
Top Depth:	.8			Material Moisture:	
Bottom Depth:	1.8			Material Texture:	Medium
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description: SAND-MEDIUM,CLAY. ALLUVIAL,AGE POST-GLACIAL.					
Geology Stratum ID:	218494913			Mat Consistency:	
Top Depth:	1.8			Material Moisture:	
Bottom Depth:	2.4			Material Texture:	Medium
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description: SAND-MEDIUM,SILT. ALLUVIAL,AGE POST-GLACIAL.					
Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 091030 NTS_Sheet: 30M12A				
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.				
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
143	1 of 1	S/161.1	79.8 / 1.00	ON	BORE
Borehole ID:	640911			Inclin FLG:	No
OGF ID:	215541306			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.554118
Total Depth m:	2.4			Longitude DD:	-79.585972
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614215
Drill Method:	Power auger			Northing:	4823323
Orig Ground Elev m:	77			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	77.9				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Concession: Location D: Survey D: Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218494035			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ASPHALT.				
Geology Stratum ID:	218494036			Mat Consistency:	
Top Depth:	.1			Material Moisture:	
Bottom Depth:	.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL,GRAVEL.				
Geology Stratum ID:	218494038			Mat Consistency:	
Top Depth:	.9			Material Moisture:	Wet
Bottom Depth:	1.8			Material Texture:	Medium
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:	Organic			Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM,CLAY, SILT,ORGANIC. GREY,ALLUVIAL,WET, AGE POST-GLACIAL.				
Geology Stratum ID:	218494039			Mat Consistency:	Firm
Top Depth:	1.8			Material Moisture:	
Bottom Depth:	2.4			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	CLAY,SAND,SILT. ALLUVIAL,FIRM, AGE POST-GLACIAL.				
Geology Stratum ID:	218494037			Mat Consistency:	
Top Depth:	.2			Material Moisture:	
Bottom Depth:	.9			Material Texture:	Medium
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:	Organic			Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM,SILT, CLAY,ORGANIC. GREY,ALLUVIAL, AGE POST-GLACIAL.				

Source

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Type: Data Survey Source Orig: Geological Survey of Canada Source Date: 1956-1972 Confidence: M Observatio: Source Name: Urban Geology Automated Information System (UGAIS) Source Details: File: TOR1B.txt RecordID: 088770 NTS_Sheet: 30M12A Confiden 1: Logs are approximately correct. Lack of information. Doubtful terminology. Source Appl: Spatial/Tabular Source Iden: 1 Scale or Res: Varies Horizontal: NAD27 Verticalda: Mean Average Sea Level					
Source List					
Source Identifier: 1 Source Type: Data Survey Source Date: 1956-1972 Scale or Resolution: Varies Source Name: Urban Geology Automated Information System (UGAIS) Source Originators: Geological Survey of Canada Horizontal Datum: NAD27 Vertical Datum: Mean Average Sea Level Projection Name: Universal Transverse Mercator					
144	1 of 1	NE/161.9	79.8 / 1.00	ON	BORE
Borehole ID: 833849 OGF ID: 215585980 Status: Decommissioned Type: Borehole Use: Geotechnical/Geological Investigation Completion Date: 10-DEC-1959 Static Water Level: 1.5 Primary Water Use: Sec. Water Use: Total Depth m: 5 Depth Ref: Ground Surface Depth Elev: Drill Method: Hollow stem auger Orig Ground Elev m: 83.5 Elev Reliabil Note: DEM Ground Elev m: 81.5 Concession: Location D: HWY 10 & CNR (AT PORT CREDIT) * RETAINING WALLS Survey D: Comments: Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD: 43.557388 Longitude DD: -79.584529 UTM Zone: 17 Easting: 614325 Northing: 4823688 Location Accuracy: Accuracy: Within 20 metres					
Borehole Geology Stratum					
Geology Stratum ID: 6014631 Top Depth: .3 Bottom Depth: 2.4 Material Color: Grey-Brown Material 1: Sand Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description: Dense, grey - brown, fine sand **Note: Many records provided by the department have a truncated [Stratum Description] field. Mat Consistency: Dense Material Moisture: Material Texture: Fine Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					
Geology Stratum ID: 6014630 Top Depth: 0 Bottom Depth: .3 Material Color: Material 1: Topsoil Material 2: Material 3: Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 4: Gsc Material Description: Stratum Description: Topsoil **Note: Many records provided by the department have a truncated [Stratum Description] field.					
Geology Stratum ID: 6014632 Top Depth: 2.4 Bottom Depth: 5 Material Color: Grey Material 1: Till Material 2: Clay Material 3: Gravel Material 4: Sand Gsc Material Description: Stratum Description: Dense, glacial till of grey, sandy clay with fine gravel layer of fine sand from 4.27m to 4.57m **Note: Many records provided by the department have a truncated [Stratum Description] field.					
Depositional Gen: Mat Consistency: Dense Material Moisture: Material Texture: Fine Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					
145	1 of 1	ESE/162.2	79.8 / 1.00	PIPELINE HIT - 2" 8 ANN ST,,MISSISSAUGA,ON,L5G 3E6,CA ON	PINC
Incident Id: Incident No: 2278716 Incident Reported Dt: 4/6/2018 Type: FS-Pipeline Incident Status Code: Tank Status: Pipeline Damage Reason Est Task No: Spills Action Centre: Fuel Type: Fuel Occurrence Tp: Date of Occurrence: Occurrence Start Dt: Depth: Customer Acct Name: PIPELINE HIT - 2" Incident Address: 8 ANN ST,,MISSISSAUGA,ON,L5G 3E6,CA Operation Type: Pipeline Type: Regulator Type: Summary: Reported By: Affiliation: Occurrence Desc: Damage Reason: Notes:					
Pipe Material: Fuel Category: Health Impact: Environment Impact: Property Damage: Service Interrupt: Enforce Policy: Public Relation: Pipeline System: PSIG: Attribute Category: Regulator Location: Method Details:					
146	1 of 2	ESE/162.2	79.8 / 1.00	Scott Insley 8 ANN ST, MISSISSAUGA, ON, L5G 3E6 ON L5G 3E6	RSC
RSC ID: 112315 RA No: RSC Type: Curr Property Use: Residential Ministry District: MISSISSAUGA Filing Date: 21-Jun-11 Date Ack: Date Returned: Restoration Type: Soil Type: Criteria: CPU Issued Sect 1686: No Asmt Roll No:					
Cert Date: 7-Jun-11 Cert Prop Use No: No CPU Intended Prop Use: Residential Qual Person Name: Stratified (Y/N): Audit (Y/N): Entire Leg Prop. (Y/N): Yes Accuracy Estimate: 0 to 1 meters Telephone: 905-2711318 Fax: Email:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Prop ID No (PIN): Property Municipal Address: Mailing Address: Latitude & Longitude: UTM Coordinates: Consultant: Legal Desc: Measurement Method: Applicable Standards: RSC PDF:		13463-0073(LT) 8 ANN ST, MISSISSAUGA, ON, L5G 3E6 6 ANN ST, MISSISSAUGA, ON, L5G 3E6 43.55500570N 79.58339580W (converted from UTM) NAD83 17-614421-4823425 Part Lots 2 and 3, Plan PC2 ECR, S/S High Street, as in No. PC12760 Digitized from a map ESA Phase 1			
146	2 of 2	ESE/162.2	79.8 / 1.00	Enbridge Gas Distribution Inc. 8 Ann St. Mississauga Mississauga ON	SPL
Ref No: Site No: Incident Dt: Year: Incident Cause: Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: Dt Document Closed: Incident Reason: Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: Contaminant Qty:		8866-AXKLZJ NA 2018/04/06 Leak/Break 35 NATURAL GAS (METHANE) 1075 Air No 2018/04/06 2018/04/21 Operator/Human Error Commercial - building is under construction<UNOFFICIAL> Regional Municipality of Peel TSSA FSB: 2 inch pl IP gas line dmgd; made safe 0 other - see incident description			
Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office: Site Postal Code: Site Region: Site Municipality: Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:		 2 - Minor Environment Corporation Miscellaneous Communal 8 Ann St. Mississauga Halton-Peel Central Mississauga 4823433.07 614459.39 TSSA - Fuel Safety Branch - Hydrocarbon Fuel Release/Spill Pipeline/Components			
147	1 of 1	W/163.2	79.1 / 0.28	Queenscorp (Mona) Inc. 1130 Mona Rd 1136 & 1138 Mona Road Mississauga ON M8Z 1L8	ECA
Approval No: Approval Date: Status: Record Type: Link Source: SWP Area Name: Approval Type: Project Type: Business Name: Address: Full Address: Full PDF Link: PDF Site Location:		8719-CCUGYB April 13, 2022 Approved ECA IDS Credit Valley ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS MUNICIPAL AND PRIVATE SEWAGE WORKS Queenscorp (Mona) Inc. 1130 Mona Rd 1136 & 1138 Mona Road https://www.accessenvironment.ene.gov.on.ca/instruments/3724-CCBT3E-14.pdf 1130, 1136 and 1138 Mona Road City of Mississauga, Regional Municipality of Peel			
MOE District: City: Longitude: Latitude: Geometry X: Geometry Y:		Halton-Peel -8859862.6125000007 5397007.8787000021			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
148	1 of 1	E/166.4	79.8 / 1.00	ON	BORE
Borehole ID: 649447 OGF ID: 215549822 Status: Type: Borehole Use: Geotechnical/Geological Investigation Completion Date: JAN-1959 Static Water Level: 0.1 Primary Water Use: Not Used Sec. Water Use: Total Depth m: 6.8 Depth Ref: Ground Surface Depth Elev: Drill Method: Diamond Drill Orig Ground Elev m: 81.8 Elev Reliabil Note: DEM Ground Elev m: 82.2 Concession: Location D: Survey D: Comments: Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD: 43.556333 Longitude DD: -79.583073 UTM Zone: 17 Easting: 614445 Northing: 4823573 Location Accuracy: Accuracy: Not Applicable					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: 218527006 Top Depth: 5.3 Bottom Depth: 6.8 Material Color: Material 1: Till Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description: TILL. 010 00000040CLAY **Note: Many records provided by the department have a truncated [Stratum Description] field. Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					
Geology Stratum ID: 218527005 Top Depth: 2.7 Bottom Depth: 5.3 Material Color: Material 1: Clay Material 2: Silt Material 3: Material 4: Gsc Material Description: Stratum Description: CLAY,SILT. WATER STABLE AT 268.2 FEET. Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					
Geology Stratum ID: 218527004 Top Depth: 0 Bottom Depth: 2.7 Material Color: Material 1: Sand Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description: SAND. DENSE. Mat Consistency: Dense Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					
<u>Source</u>					
Source Type: Data Survey Source Orig: Geological Survey of Canada Source Appl: Spatial/Tabular Source Iden: 1					

303 erisinfo.com | Environmental Risk Information Services Order No: 22091501030

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY			
Site Info:					
PDF URL (Map):				https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/710\7104773.pdf	
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2008/04/22			
Year Completed:		2008			
Depth (m):					
Latitude:		43.5563884173103			
Longitude:		-79.5830786741158			
Path:		710\7104773.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1001585176		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				17	
Code OB Desc:				East83:	
Open Hole:				614444.00	
Cluster Kind:				North83:	
Date Completed:		22-Apr-2008 00:00:00		4823579.00	
Remarks:				Org CS:	
Loc Method Desc:		on Water Well Record		UTM83	
Elevrc Desc:				UTMRC:	
Location Source Date:				3	
Improvement Location Source:				UTMRC Desc:	
Improvement Location Method:				margin of error : 10 - 30 m	
Source Revision Comment:				Location Method:	
Supplier Comment:				wwr	
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1001628743			
Layer:		1			
Plug From:		0.0			
Plug To:		7.159999847412109			
Plug Depth UOM:		m			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1001628747			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:		AUGERING			
<u>Pipe Information</u>					
Pipe ID:		1001628740			
Casing No:		0			
Comment:					
Alt Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:		1001628745			
Layer:					
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1001628746			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:					
<u>Water Details</u>					
Water ID:		1001628744			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1001628742			
Diameter:		15.239999771118164			
Depth From:		0.0			
Depth To:		7.159999847412109			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:	1001585176			Tag No:	A057183
Depth M:				Contractor:	7082
Year Completed:	2008			Path:	710\7104773.pdf
Well Completed Dt:	2008/04/22			Latitude:	43.5563884173103
Audit No:	Z70743			Longitude:	-79.5830786741158

151	1 of 1	SSW/168.3	79.8 / 1.00	ON	BORE
Borehole ID:	640922			Inclin FLG:	No
OGF ID:	215541317			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Sec. Water Use:				Latitude DD:	43.554128
Total Depth m:	2.7			Longitude DD:	-79.586777
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614150
Drill Method:	Power auger			Northing:	4823323
Orig Ground Elev m:	78.3			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	78.1				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218494086			Mat Consistency:	
Top Depth:	.3			Material Moisture:	
Bottom Depth:	1.2			Material Texture:	Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:	Silt			Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL-MEDIUM,SAND, CLAY,SILT. BROWN.				
Geology Stratum ID:	218494087			Mat Consistency:	
Top Depth:	1.2			Material Moisture:	Wet
Bottom Depth:	1.8			Material Texture:	Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:	Silt			Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL-MEDIUM,SAND, CLAY,SILT. BROWN,WET.				
Geology Stratum ID:	218494085			Mat Consistency:	
Top Depth:	.1			Material Moisture:	
Bottom Depth:	.3			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL,GRAVEL.				
Geology Stratum ID:	218494088			Mat Consistency:	
Top Depth:	1.8			Material Moisture:	
Bottom Depth:	2.6			Material Texture:	
Material Color:	Black			Non Geo Mat Type:	
Material 1:	Organic			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Sand			Geologic Period:	
Material 4:	Silt			Depositional Gen:	organic
Gsc Material Description:					
Stratum Description:	ORGANIC,CLAY,SAND, SILT. BLACK.				
Geology Stratum ID:	218494084			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3: Material 4: Gsc Material Description: Stratum Description:				Geologic Period: Depositional Gen:	
ASPHALT.					
Geology Stratum ID:	218494089			Mat Consistency:	Firm
Top Depth:	2.6			Material Moisture:	
Bottom Depth:	2.7			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description: Stratum Description:	SAND,CLAY,SILT. BROWN,ALLUVIAL,FIRM, AGE POST-GLACIAL. D- **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 088880 NTS_Sheet: 30M12A				
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.				
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
152	1 of 1	NNE/168.9	79.8 / 1.00	ON	BORE
Borehole ID:	833850			Inclin FLG:	No
OGF ID:	215585981			SP Status:	Initial Entry
Status:	Decommissioned			Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	11-DEC-1959			Municipality:	
Static Water Level:	1.5			Lot:	
Primary Water Use:				Township:	
Sec. Water Use:				Latitude DD:	43.557672
Total Depth m:	5.8			Longitude DD:	-79.584918
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614293
Drill Method:	Hollow stem auger			Northing:	4823719
Orig Ground Elev m:	83.8			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Within 20 metres
DEM Ground Elev m:	81.8				
Concession:					
Location D:	HWY 10 & CNR (AT PORT CREDIT) * RETAINING WALLS				
Survey D:					
Comments:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Geology Stratum ID:	6014635			Mat Consistency:	Dense
Top Depth:	2.1			Material Moisture:	
Bottom Depth:	3			Material Texture:	Fine
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Gravel			Geologic Period:	
Material 4:	Sand			Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	Dense, brown, glacial till of sandy clay with fine gravel **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	6014633			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.6			Material Texture:	
Material Color:				Non Geo Mat Type:	Fill-Misc
Material 1:	Gravel			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	Gravel, sand and cinders (fill material) **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	6014634			Mat Consistency:	Dense
Top Depth:	.6			Material Moisture:	
Bottom Depth:	2.1			Material Texture:	Fine to Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	Medium to dense, brown, fine, sand **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	6014636			Mat Consistency:	Dense
Top Depth:	3			Material Moisture:	
Bottom Depth:	5.8			Material Texture:	Fine
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Gravel			Geologic Period:	
Material 4:	Silt			Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	Dense, grey, glacial till of silty clay with fine gravel **Note: Many records provided by the department have a truncated [Stratum Description] field.				
153	1 of 1	ESE/169.4	79.8 / 1.00	8 Ann St, 6 Ann St, 10 Ann St. Mississauga ON	EHS
Order No:	20110516026			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	5/18/2011			Search Radius (km):	0.25
Date Received:	5/16/2011 3:36:21 PM			X:	-79.583198
Previous Site Name:				Y:	43.555214
Lot/Building Size:					
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans				
154	1 of 1	NE/171.6	79.8 / 1.00	ON	BORE

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Borehole ID:	649454			Inclin FLG:	No
OGF ID:	215549829			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	DEC-1959			Municipality:	
Static Water Level:	0.2			Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.55766
Total Depth m:	5.8			Longitude DD:	-79.584837
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614300
Drill Method:	Power auger			Northing:	4823718
Orig Ground Elev m:	83.8			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	81.7				
Concession:					
Location D:					
Survey D:					
Comments:					
 <u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218527026			Mat Consistency:	Compact
Top Depth:	.6			Material Moisture:	
Bottom Depth:	2.1			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	SAND. BROWN,COMPACT, WATER STABLE AT 274.5 FEET.				
Geology Stratum ID:	218527028			Mat Consistency:	Dense
Top Depth:	3			Material Moisture:	
Bottom Depth:	5.8			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:	Gravel			Depositional Gen:	
Gsc Material Description:					
Stratum Description:	TILL,CLAY,SILT, GRAVEL. GREY,VERY DENSE. 022 009 005 00020035000700 **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	218527025			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.6			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:	Sand			Geologic Period:	
Material 4:	Granuls			Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL,GRAVEL,SAND, CINDERS.				
Geology Stratum ID:	218527027			Mat Consistency:	Dense
Top Depth:	2.1			Material Moisture:	
Bottom Depth:	3			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Sand			Geologic Period:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 4: Gsc Material Description: Stratum Description:	Gravel			Depositional Gen:	
		TILL,CLAY,SAND, GRAVEL. BROWN,VERY DENSE.			
 <u>Source</u>					
Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	Data Survey Geological Survey of Canada 1956-1972 H Urban Geology Automated Information System (UGAIS) File: TOR3.txt RecordID: 201130 NTS_Sheet: 30M12A Logged by professional. Exact and complete description of material and properties.			Source Appl: Source Iden: Scale or Res: Horizontal: Verticalda:	Spatial/Tabular 1 Varies NAD27 Mean Average Sea Level
 <u>Source List</u>					
Source Identifier: Source Type: Source Date: Scale or Resolution: Source Name: Source Originators:	1 Data Survey 1956-1972 Varies Urban Geology Automated Information System (UGAIS) Geological Survey of Canada			Horizontal Datum: Vertical Datum: Projection Name:	NAD27 Mean Average Sea Level Universal Transverse Mercator
<u>155</u>	1 of 1	S/172.3	79.8 / 1.00	20 Elizabeth Street North Mississauga ON L5G 2Z1	EHS
Order No: Status: Report Type: Report Date: Date Received: Previous Site Name: Lot/Building Size: Additional Info Ordered:	22042800151 C Standard Report 03-MAY-22 28-APR-22 City Directory			Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): X: Y:	 ON .25 -79.5863741 43.5540249
<u>156</u>	1 of 1	NNE/174.2	79.8 / 1.00	ON	BORE
Borehole ID: OGF ID: Status: Type: Use: Completion Date: Static Water Level: Primary Water Use: Sec. Water Use: Total Depth m: Depth Ref: Depth Elev: Drill Method: Orig Ground Elev m: Elev Reliabil Note: DEM Ground Elev m: Concession: Location D: Survey D: Comments:	833870 215586001 Decommissioned Borehole Geotechnical/Geological Investigation 01-MAR-1962 5.6 12.3 Ground Surface Diamond Drill 84.6 82.9 CNR & HWY NO 10 * UNDERPASS Hole by BX casing drilled to various sampling intervals; W.L confirmed after a 3 day period			Inclin FLG: SP Status: Surv Elev: Piezometer: Primary Name: Municipality: Lot: Township: Latitude DD: Longitude DD: UTM Zone: Easting: Northing: Location Accuracy: Accuracy:	No Initial Entry No No 43.557763 -79.58499 17 614287 4823729 Within 10 metres
 <u>Borehole Geology Stratum</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Geology Stratum ID:	6014703			Mat Consistency:	Loose
Top Depth:	0			Material Moisture:	Dry
Bottom Depth:	1.4			Material Texture:	
Material Color:				Non Geo Mat Type:	Cinder Ash
Material 1:				Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	Loose cinders (dry) **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	6014708			Mat Consistency:	Hard
Top Depth:	10.7			Material Moisture:	
Bottom Depth:	12.3			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Bedrock			Geologic Formation:	
Material 2:	Shale			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	Bedrock - hard, dark grey, shale **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	6014705			Mat Consistency:	Hard
Top Depth:	1.8			Material Moisture:	
Bottom Depth:	3.7			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	Hard, brown, clay with some gravel **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	6014704			Mat Consistency:	
Top Depth:	1.4			Material Moisture:	Wet
Bottom Depth:	1.8			Material Texture:	
Material Color:				Non Geo Mat Type:	Brick
Material 1:	Topsoil			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	Wet, sandy topsoil (pieces of brick and cinders) **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	6014706			Mat Consistency:	Hard
Top Depth:	3.7			Material Moisture:	
Bottom Depth:	7			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Silt			Geologic Formation:	
Material 2:	Pebbles			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:	Sand			Depositional Gen:	
Gsc Material Description:					
Stratum Description:	Hard, grey, sandy clayey silt with pebbles, more sand and gravel sizes below 6.1m **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	6014707			Mat Consistency:	Very Dense
Top Depth:	7			Material Moisture:	
Bottom Depth:	10.7			Material Texture:	Fine
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3:	Silt			Geologic Period:	
Material 4:	Limestone			Depositional Gen:	
Gsc Material Description:					
Stratum Description:	Very dense, slightly cohesive silty fine sand with medium to coarse limestone gravel **Note: Many records provided by the department have a truncated [Stratum Description] field.				

<u>157</u>	1 of 1	SE/175.4	79.8 / 1.00	ON	BORE
Borehole ID:	639275			Inclin FLG:	No
OGF ID:	215539672			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.554192
Total Depth m:	1.5			Longitude DD:	-79.584732
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614315
Drill Method:	Power auger			Northing:	4823333
Orig Ground Elev m:	76.5			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	77.5				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218487729			Mat Consistency:	
Top Depth:	1.1			Material Moisture:	
Bottom Depth:	1.5			Material Texture:	Medium
Material Color:				Non Geo Mat Type:	
Material 1:	Silt			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Sand			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SILT,CLAY,SAND MEDIUM. ALLUVIAL,AGE POST-GLACIAL.				
Geology Stratum ID:	218487727			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.1			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL,GRAVEL. BROWN.				
Geology Stratum ID:	218487728			Mat Consistency:	
Top Depth:	.1			Material Moisture:	
Bottom Depth:	1.1			Material Texture:	Coarse
Material Color:	Black			Non Geo Mat Type:	
Material 1:	Organic			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ORGANIC-MEDIUM TO COARSE,SAND. BLACK,AGE POST-GLACIAL.				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Geology Stratum ID: 218487726 Top Depth: 0 Bottom Depth: 0 Material Color: Material 1: Asphalt Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description: ASPHALT. Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					
Source					
Source Type: Data Survey Source Orig: Geological Survey of Canada Source Date: 1956-1972 Confidence: M Observatio: Source Name: Urban Geology Automated Information System (UGAIS) Source Details: File: TOR1B.txt RecordID: 072380 NTS_Sheet: 30M12A Confiden 1: Logs are approximately correct. Lack of information. Doubtful terminology. Source Appl: Spatial/Tabular Source Iden: 1 Scale or Res: Varies Horizontal: NAD27 Verticalda: Mean Average Sea Level					
Source List					
Source Identifier: 1 Source Type: Data Survey Source Date: 1956-1972 Scale or Resolution: Varies Source Name: Urban Geology Automated Information System (UGAIS) Source Originators: Geological Survey of Canada Horizontal Datum: NAD27 Vertical Datum: Mean Average Sea Level Projection Name: Universal Transverse Mercator					
158	1 of 1	ESE/177.0	79.8 / 1.00	Scott Insley 6 ANN ST, MISSISSAUGA, ON, L5G 3E6, ON L5G 3E6	RSC
RSC ID: 112310 RA No: RSC Type: Curr Property Use: Residential Ministry District: MISSISSAUGA Filing Date: 21-Jun-11 Date Ack: Date Returned: Restoration Type: Soil Type: Criteria: CPU Issued Sect 1686: No Asmt Roll No: Prop ID No (PIN): 13463-0072(LT) Property Municipal Address: 6 ANN ST, MISSISSAUGA, ON, L5G 3E6, Mailing Address: 6 ANN ST, MISSISSAUGA, ON, L5G 3E6 Latitude & Latitude: 43.55496660N 79.58314910W (converted from UTM) UTM Coordinates: NAD83 17-614441-4823421 Consultant: Legal Desc: Part Lot 2, Plan PC2 ECR, N/S Toronto Street; Part Lots 2 & 3, Plan PC2 ECR, S/S High Street as in VS113631 Measurement Method: Digitized from a map Applicable Standards: ESA Phase 1 RSC PDF: Cert Date: 7-Jun-11 Cert Prop Use No: No CPU Intended Prop Use: Residential Qual Person Name: Stratified (Y/N): Audit (Y/N): Entire Leg Prop. (Y/N): Yes Accuracy Estimate: 0 to 1 meters Telephone: 905-2711318 Fax: Email:					
159	1 of 1	ESE/181.6	79.8 / 1.00		BORE

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
ON					
Borehole ID:	640927			Inclin FLG:	No
OGF ID:	215541322			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.555161
Total Depth m:	1.5			Longitude DD:	-79.582976
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614455
Drill Method:	Power auger			Northing:	4823443
Orig Ground Elev m:	80.2			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	79.9				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218494113			Mat Consistency:	
Top Depth:	.1			Material Moisture:	
Bottom Depth:	.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL, GRAVEL.				
Geology Stratum ID:	218494115			Mat Consistency:	
Top Depth:	.4			Material Moisture:	
Bottom Depth:	1.5			Material Texture:	Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM, CLAY. BROWN, ALLUVIAL, AGE POST-GLACIAL. LAY. AGE				**Note: Many records provided by the department have a truncated [Stratum Description] field.
Geology Stratum ID:	218494112			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ASPHALT.				
Geology Stratum ID:	218494114			Mat Consistency:	
Top Depth:	.2			Material Moisture:	
Bottom Depth:	.4			Material Texture:	Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	Silt Clay			Geologic Group: Geologic Period: Depositional Gen: alluvial	
		SAND-MEDIUM,SILT, CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL.			
Source					
Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	Data Survey Geological Survey of Canada 1956-1972 M			Source Appl: Source Iden: Scale or Res: Horizontal: Verticalda: Urban Geology Automated Information System (UGAIS) File: TOR1B.txt RecordID: 088930 NTS_Sheet: 30M12A Logs are approximately correct. Lack of information. Doubtful terminology.	Spatial/Tabular 1 Varies NAD27 Mean Average Sea Level
Source List					
Source Identifier: Source Type: Source Date: Scale or Resolution: Source Name: Source Originators:	1 Data Survey 1956-1972 Varies Urban Geology Automated Information System (UGAIS) Geological Survey of Canada			Horizontal Datum: Vertical Datum: Projection Name:	NAD27 Mean Average Sea Level Universal Transverse Mercator
160	1 of 1	NNE/182.0	79.8 / 1.00	ON	BORE
Borehole ID: OGF ID: Status: Type: Use: Completion Date: Static Water Level: Primary Water Use: Sec. Water Use: Total Depth m: Depth Ref: Depth Elev: Drill Method: Orig Ground Elev m: Elev Reliabil Note: DEM Ground Elev m: Concession: Location D: Survey D: Comments:	833873 215586004 Decommissioned Borehole Geotechnical/Geological Investigation 01-MAR-1962 1.1 11.3 Ground Surface Diamond Drill 85.1 83 CNR & HWY NO 10 * UNDERPASS W.L measured after 30 hours			Inclin FLG: SP Status: Surv Elev: Piezometer: Primary Name: Municipality: Lot: Township: Latitude DD: Longitude DD: UTM Zone: Easting: Northing: Location Accuracy: Accuracy:	No Initial Entry No No 43.557928 -79.585222 17 614268 4823747 Within 10 metres
Borehole Geology Stratum					
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	6014725 1.6 3.8 Brown Sand Topsoil Clay Wet, clayey sand, topsoil; becoming wet, brown, uniform fine sand **Note: Many records provided by the			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Wet Fine

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
department have a truncated [Stratum Description] field.					
Geology Stratum ID:	6014727			Mat Consistency:	Hard
Top Depth:	4.1			Material Moisture:	
Bottom Depth:	8			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Silt			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:	Boulders			Geologic Period:	
Material 4:	Clay			Depositional Gen:	
Gsc Material Description:					
Stratum Description:	Hard, grey, sandy clayey silt with gravel, coarser gravel and boulders below 5.79m **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	6014724			Mat Consistency:	Dense
Top Depth:	.9			Material Moisture:	
Bottom Depth:	1.6			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	Fill-Misc
Material 1:	Clay			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:	Sand			Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	Dense, brown, sandy clay, fill, with large gravel sizes **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	6014728			Mat Consistency:	Very Dense
Top Depth:	8			Material Moisture:	
Bottom Depth:	11.3			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:	Limestone			Geologic Period:	
Material 4:	Boulders			Depositional Gen:	
Gsc Material Description:					
Stratum Description:	Very dense, slightly cohesive silty sand with gravel, numerous limestone slabs and boulders below 9.14m **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	6014726			Mat Consistency:	Very Stiff
Top Depth:	3.8			Material Moisture:	
Bottom Depth:	4.1			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	Very stiff, brown, clay **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	6014723			Mat Consistency:	
Top Depth:	0			Material Moisture:	Dry
Bottom Depth:	.9			Material Texture:	
Material Color:				Non Geo Mat Type:	Cinder Ash
Material 1:				Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	Dry cinders **Note: Many records provided by the department have a truncated [Stratum Description] field.				
161	1 of 1	N/182.7	79.8 / 1.00	ON	BORE
Borehole ID:	833864			Inclin FLG:	No

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
OGF ID:	215585995			SP Status:	Initial Entry
Status:	Decommissioned			Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	17-DEC-1959			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:				Township:	
Sec. Water Use:				Latitude DD:	43.558064
Total Depth m:	5			Longitude DD:	-79.58606
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614200
Drill Method:	Hollow stem auger			Northing:	4823761
Orig Ground Elev m:	84.3			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Within 10 metres
DEM Ground Elev m:	82				
Concession:					
Location D:		CNR AT PORT CREDIT * CREEK DIVERSION			
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	6014678			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.3			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Topsoil			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		Topsoil	**Note: Many records provided by the department have a truncated [Stratum Description] field.		
Geology Stratum ID:	6014679			Mat Consistency:	Dense
Top Depth:	.3			Material Moisture:	
Bottom Depth:	1.5			Material Texture:	Fine to Medium
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		Medium to dense, silty fine to medium sand with clay	**Note: Many records provided by the department have a truncated [Stratum Description] field.		
Geology Stratum ID:	6014681			Mat Consistency:	Dense
Top Depth:	2.4			Material Moisture:	
Bottom Depth:	5			Material Texture:	Fine
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Gravel			Geologic Period:	
Material 4:	Sand			Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:		Dense, glacial till (grey, silty clay with gravel and pockets of fine sand)	**Note: Many records provided by the department have a truncated [Stratum Description] field.		
Geology Stratum ID:	6014680			Mat Consistency:	Dense
Top Depth:	1.5			Material Moisture:	
Bottom Depth:	2.4			Material Texture:	Fine
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Gsc Material Description: Stratum Description: Dense, grey, fine, sand **Note: Many records provided by the department have a truncated [Stratum Description] field.					
162	1 of 1	NNE/182.9	79.8 / 1.00	PORT CREDIT GO STATION PORT CREDIT ON	WWIS
Well ID: 7310440				Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st: Monitoring				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status: Observation Wells				Date Received: 17-Apr-2018 00:00:00	
Water Type:				Selected Flag: TRUE	
Casing Material:				Abandonment Rec:	
Audit No: Z266809				Contractor: 6607	
Tag: A232621				Form Version: 7	
Constructn Method:				Owner:	
Elevation (m):				County: PEEL	
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality: MISSISSAUGA CITY (PORT CREDIT)					
Site Info:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 2018/02/06					
Year Completed: 2018					
Depth (m): 17.8					
Latitude: 43.5579366455754					
Longitude: -79.5852214620033					
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID: 1007036933				Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone: 17	
Code OB:				East83: 614268.00	
Code OB Desc:				North83: 4823748.00	
Open Hole:				Org CS: UTM83	
Cluster Kind:				UTMRC: 4	
Date Completed: 06-Feb-2018 00:00:00				UTMRC Desc: margin of error : 30 m - 100 m	
Remarks:				Location Method: wwr	
Loc Method Desc: on Water Well Record					
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID: 1007268339					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		01			
Mat3 Desc:		FILL			
Formation Top Depth:		0.0			
Formation End Depth:		2.799999952316284			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007268340			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		2.799999952316284			
Formation End Depth:		5.699999809265137			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007268343			
Layer:		5			
Color:		2			
General Color:		GREY			
Mat1:		17			
Most Common Material:		SHALE			
Mat2:		15			
Mat2 Desc:		LIMESTONE			
Mat3:		26			
Mat3 Desc:		ROCK			
Formation Top Depth:		13.699999809265137			
Formation End Depth:		17.799999237060547			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007268342			
Layer:		4			
Color:		7			
General Color:		RED			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		17			
Mat2 Desc:		SHALE			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		7.400000095367432			
Formation End Depth:		13.699999809265137			
Formation End Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007268341			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		13			
Mat2 Desc:		BOULDERS			
Mat3:		74			
Mat3 Desc:		LAYERED			
Formation Top Depth:		5.699999809265137			
Formation End Depth:		7.400000095367432			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007268352			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		13.899999618530273			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007268353			
Layer:		3			
Plug From:		13.899999618530273			
Plug To:		14.5			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007268351			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007268350			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:		DIAMOND			
<u>Pipe Information</u>					
Pipe ID:		1007268338			
Casing No:		0			
Comment:					
Alt Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:		1007268347			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		14.800000190734863			
Casing Diameter:		5.099999904632568			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007268348			
Layer:		1			
Slot:		10			
Screen Top Depth:		14.800000190734863			
Screen End Depth:		17.799999237060547			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.400000095367432			
<u>Water Details</u>					
Water ID:		1007268346			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1007268345			
Diameter:		9.600000381469727			
Depth From:		13.699999809265137			
Depth To:		17.100000381469727			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1007268344			
Diameter:		2.0999999046325684			
Depth From:		0.0			
Depth To:		13.699999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:	1007036933			Tag No:	A232621
Depth M:	17.8			Contractor:	6607
Year Completed:	2018			Path:	731\7310440.pdf
Well Completed Dt:	2018/02/06			Latitude:	43.5579366455754
Audit No:	Z266809			Longitude:	-79.5852214620033
<u>163</u>	1 of 1	NNE/184.5	79.8 / 1.00	ON	BORE

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Borehole ID:	649456			Inclin FLG:	No
OGF ID:	215549831			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	DEC-1959			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.557981
Total Depth m:	6.2			Longitude DD:	-79.585325
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614260
Drill Method:	Power auger			Northing:	4823753
Orig Ground Elev m:	84.1			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	81.8				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218527033			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	1.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Gravel			Geologic Period:	
Material 4:	Granuls			Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL,SAND,GRAVEL, CINDERS.				
Geology Stratum ID:	218527035			Mat Consistency:	Dense
Top Depth:	1.8			Material Moisture:	
Bottom Depth:	2.7			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Sand			Geologic Period:	
Material 4:	Gravel			Depositional Gen:	
Gsc Material Description:					
Stratum Description:	TILL,CLAY,SAND, GRAVEL. BROWN,VERY DENSE.				
Geology Stratum ID:	218527034			Mat Consistency:	Dense
Top Depth:	1.2			Material Moisture:	
Bottom Depth:	1.8			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	SAND. BROWN,DENSE.				
Geology Stratum ID:	218527036			Mat Consistency:	Dense
Top Depth:	2.7			Material Moisture:	
Bottom Depth:	6.2			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Gravel			Geologic Period:	
Material 4:				Depositional Gen:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Gsc Material Description:					
Stratum Description:		CLAY,SILT,GRAVEL. GREY,VERY DENSE. 016 009 010 00040045000600530009 **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	H			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR3.txt RecordID: 201150 NTS_Sheet: 30M12A				
Confiden 1:	Logged by professional. Exact and complete description of material and properties.				
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
164	1 of 1	S/185.9	79.8 / 1.00	ON	BORE
Borehole ID:	640910			Inclin FLG:	No
OGF ID:	215541305			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.553933
Total Depth m:	2.1			Longitude DD:	-79.585605
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614245
Drill Method:	Power auger			Northing:	4823303
Orig Ground Elev m:	76.8			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	77.5				
Concession:					
Location D:					
Survey D:					
Comments:					
Borehole Geology Stratum					
Geology Stratum ID:	218494033			Mat Consistency:	
Top Depth:	1.2			Material Moisture:	
Bottom Depth:	1.5			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:	Organic			Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:		SAND,SILT,CLAY, ORGANIC. ALLUVIAL,AGE POST-GLACIAL.			
Geology Stratum ID: 218494029 Mat Consistency:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Top Depth:	0			Material Moisture:	
Bottom Depth:	0			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		ASPHALT.			
Geology Stratum ID:	218494031			Mat Consistency:	
Top Depth:	.2			Material Moisture:	
Bottom Depth:	.4			Material Texture:	
Material Color:	Yellow			Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:	Clay			Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:		FILL,SAND,SILT,CLAY.YELLOW.			
Geology Stratum ID:	218494032			Mat Consistency:	
Top Depth:	.4			Material Moisture:	Wet
Bottom Depth:	1.2			Material Texture:	
Material Color:	Black			Non Geo Mat Type:	
Material 1:	Organic			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:	Clay			Depositional Gen:	organic
Gsc Material Description:					
Stratum Description:		ORGANIC,SAND,SILT, CLAY. BLACK,WET.			
Geology Stratum ID:	218494034			Mat Consistency:	Firm
Top Depth:	1.5			Material Moisture:	
Bottom Depth:	2.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:		CLAY,SAND,SILT. ALLUVIAL,FIRM, AGE POST-GLACIAL.			
Geology Stratum ID:	218494030			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:		FILL,GRAVEL.			
Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Details:		File: TOR1B.txt RecordID: 088760 NTS_Sheet: 30M12A			
Confiden 1:		Logs are approximately correct. Lack of information. Doubtful terminology.			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
165	1 of 4	SW/186.2	79.8 / 1.00	Enbridge Gas Distribution Inc. 26 Park Street Mississauga ON	SPL
Ref No:	2741-BG4W3L			Discharger Report:	
Site No:	NA			Material Group:	
Incident Dt:	9/17/2019			Health/Env Conseq:	2 - Minor Environment
Year:				Client Type:	Corporation
Incident Cause:				Sector Type:	Miscellaneous Industrial
Incident Event:	Leak/Break			Agency Involved:	
Contaminant Code:	35			Nearest Watercourse:	
Contaminant Name:	NATURAL GAS (METHANE)			Site Address:	26 Park Street
Contaminant Limit 1:				Site District Office:	Halton-Peel
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:	1075			Site Region:	Central
Environment Impact:				Site Municipality:	Mississauga
Nature of Impact:				Site Lot:	
Receiving Medium:				Site Conc:	
Receiving Env:	Air			Northing:	
MOE Response:	No			Easting:	
Dt MOE Arvl on Scn:				Site Geo Ref Accu:	
MOE Reported Dt:	9/17/2019			Site Map Datum:	
Dt Document Closed:	9/28/2019			SAC Action Class:	TSSA - Fuel Safety Branch - Hydrocarbon Fuel Release/Spill
Incident Reason:	Operator/Human Error			Source Type:	Pipeline/Components
Site Name:	Residential<UNOFFICIAL>				
Site County/District:	Regional Municipality of Peel				
Site Geo Ref Meth:					
Incident Summary:	TSSA FSB: 2" steel IP service natural gas strike to atm.				
Contaminant Qty:	0 other - see incident description				
165	2 of 4	SW/186.2	79.8 / 1.00	ENBRIDGE GAS INC 26 PARK ST E,,MISSISSAUGA,ON,L5G 1L6,CA ON	PINC
Incident Id:				Pipe Material:	
Incident No:	2685652			Fuel Category:	
Incident Reported Dt:	9/18/2019			Health Impact:	
Type:	FS-Pipeline Incident			Environment Impact:	
Status Code:				Property Damage:	
Tank Status:	Pipeline Damage Reason Est			Service Interrupt:	
Task No:				Enforce Policy:	
Spills Action Centre:				Public Relation:	
Fuel Type:				Pipeline System:	
Fuel Occurrence Tp:				PSIG:	
Date of Occurrence:				Attribute Category:	
Occurrence Start Dt:				Regulator Location:	
Depth:				Method Details:	
Customer Acct Name:	ENBRIDGE GAS INC				
Incident Address:	26 PARK ST E,,MISSISSAUGA,ON,L5G 1L6,CA				
Operation Type:					
Pipeline Type:					
Regulator Type:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Summary: Reported By: Affiliation: Occurrence Desc: Damage Reason: Notes:					
165	3 of 4	SW/186.2	79.8 / 1.00	26 Park Street East Mississauga ON L5G 1L6	EHS
Order No: 20323000054 Status: C Report Type: Standard Report Report Date: 05-JAN-21 Date Received: 30-DEC-20 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.5872519 Y: 43.5541054			
165	4 of 4	SW/186.2	79.8 / 1.00	26 Park Street East Mississauga ON L5G 1L6	EHS
Order No: 20323000054 Status: C Report Type: Standard Report Report Date: 05-JAN-21 Date Received: 30-DEC-20 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.5872519 Y: 43.5541054			
166	1 of 1	NNE/188.0	79.8 / 1.00	ON	BORE
Borehole ID: 833851 OGF ID: 215585982 Status: Decommissioned Type: Borehole Use: Geotechnical/Geological Investigation Completion Date: 14-DEC-1959 Static Water Level: Primary Water Use: Sec. Water Use: Total Depth m: 6.2 Depth Ref: Ground Surface Depth Elev: Drill Method: Hollow stem auger Orig Ground Elev m: 84.1 Elev Reliabil Note: DEM Ground Elev m: 81.5 Concession: Location D: HWY 10 & CNR (AT PORT CREDIT) * RETAINING WALLS Survey D: Comments:		Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD: 43.558048 Longitude DD: -79.585466 UTM Zone: 17 Easting: 614248 Northing: 4823760 Location Accuracy: Accuracy: Within 20 metres			
Borehole Geology Stratum					
Geology Stratum ID: 6014637 Top Depth: 0 Bottom Depth: 1.2		Mat Consistency: Material Moisture: Material Texture:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material Color:				Non Geo Mat Type:	Fill-Misc
Material 1:	Sand			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		Sand, gravel and cinders (fill material)	**Note: Many records provided by the department have a truncated [Stratum Description] field.		
Geology Stratum ID:	6014640			Mat Consistency:	Dense
Top Depth:	2.7			Material Moisture:	
Bottom Depth:	6.2			Material Texture:	Fine
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Gravel			Geologic Period:	
Material 4:	Silt			Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:		Dense, glacial till of grey silty clay with fine gravel	**Note: Many records provided by the department have a truncated [Stratum Description] field.		
Geology Stratum ID:	6014639			Mat Consistency:	Dense
Top Depth:	1.8			Material Moisture:	
Bottom Depth:	2.7			Material Texture:	Fine
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Gravel			Geologic Period:	
Material 4:	Sand			Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:		Dense, glacial till of brown sandy clay with fine gravel	**Note: Many records provided by the department have a truncated [Stratum Description] field.		
Geology Stratum ID:	6014638			Mat Consistency:	Dense
Top Depth:	1.2			Material Moisture:	
Bottom Depth:	1.8			Material Texture:	Fine to Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		Dense, brown, fine to medium sand	**Note: Many records provided by the department have a truncated [Stratum Description] field.		

167	1 of 1	SSE/190.3	79.8 / 1.00	ON	BORE
Borehole ID:	639276			Inclin FLG:	No
OGF ID:	215539673			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.554017
Total Depth m:	1.5			Longitude DD:	-79.585108
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614285
Drill Method:	Power auger			Northing:	4823313
Orig Ground Elev m:	76.6			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	77.5				
Concession:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Location D: Survey D: Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218487733			Mat Consistency:	
Top Depth:	1.5			Material Moisture:	
Bottom Depth:	1.5			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:	Clay			Depositional Gen:	
Gsc Material Description:					
Stratum Description:	TILL,SAND,SILT,CLAY.BROWN,GLACIAL,AGE GLACIAL. POST-GLACIAL **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	218487732			Mat Consistency:	
Top Depth:	.3			Material Moisture:	
Bottom Depth:	1.5			Material Texture:	
Material Color:	Black			Non Geo Mat Type:	
Material 1:	Organic			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:	Clay			Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ORGANIC,SAND,SILT, CLAY. BLACK,AGE POST-GLACIAL.				
Geology Stratum ID:	218487730			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	0			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ASPHALT.				
Geology Stratum ID:	218487731			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.3			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL,GRAVEL.				
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 072390 NTS_Sheet: 30M12A				
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Identifier: 1 Source Type: Data Survey Source Date: 1956-1972 Scale or Resolution: Varies Source Name: Urban Geology Automated Information System (UGAIS) Source Originators: Geological Survey of Canada Horizontal Datum: NAD27 Vertical Datum: Mean Average Sea Level Projection Name: Universal Transverse Mercator					
168	1 of 1	NNE/191.1	79.8 / 1.00	ON	WWIS
Well ID: 7388364 Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: Z324807 Tag: A232621 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: MISSISSAUGA CITY (PORT CREDIT) Site Info: Flowing (Y/N): Flow Rate: Data Entry Status: Yes Data Src: Date Received: 01-Jun-2021 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 7693 Form Version: 7 Owner: County: PEEL Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
<u>Bore Hole Information</u>					
Bore Hole ID: 1008669515 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 18-May-2021 00:00:00 Remarks: Loc Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment: Elevation: Elevrc: Zone: 17 East83: 614275.00 North83: 4823754.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					
<u>Links</u>					
Bore Hole ID: 1008669515 Depth M: Year Completed: 2021 Well Completed Dt: 2021/05/18 Audit No: Z324807 Tag No: A232621 Contractor: 7693 Path: Latitude: 43.5579895819355 Longitude: -79.5851335554152					

169	1 of 1	WSW/192.2	79.0 / 0.20	ON	WWIS
Well ID: 7389869 Flowing (Y/N):					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	21-Jun-2021 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	C49294			Contractor:	6988
Tag:	A314261			Form Version:	8
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY (PORT CREDIT)			
Site Info:					

Bore Hole Information

Bore Hole ID:	1008686007	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	613974.00
Code OB Desc:		North83:	4823457.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	17-Mar-2021 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Loc Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Links

Bore Hole ID:	1008686007	Tag No:	A314261
Depth M:		Contractor:	6988
Year Completed:	2021	Path:	
Well Completed Dt:	2021/03/17	Latitude:	43.5553621974538
Audit No:	C49294	Longitude:	-79.5889215934009

[170](#)

1 of 1

E/194.4

79.8 / 1.00

OSHAWA FOODS
25 HURONTARIO STREET RETAIL STORE
MISSISSAUGA CITY ON

SPL

Ref No:	123765	Discharger Report:	
Site No:		Material Group:	
Incident Dt:	2/19/1996	Health/Env Conseq:	
Year:		Client Type:	
Incident Cause:	PIPE/HOSE LEAK	Sector Type:	
Incident Event:		Agency Involved:	
Contaminant Code:		Nearest Watercourse:	
Contaminant Name:		Site Address:	
Contaminant Limit 1:		Site District Office:	
Contam Limit Freq 1:		Site Postal Code:	
Contaminant UN No 1:		Site Region:	
Environment Impact:	POSSIBLE	Site Municipality:	21102

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Nature of Impact: Receiving Medium: Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: Dt Document Closed: Incident Reason: Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: Contaminant Qty:	Air Pollution AIR 2/20/1996 EQUIPMENT FAILURE			Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:	
		HURONTARIO PRICE CHOPPER-34 KG FREON R-22 TO ATM, LINE LEAK,REPAIRED.			

171	1 of 1	N/196.8	79.8 / 1.00	ON	BORE
Borehole ID: OGF ID: Status: Type: Use: Completion Date: Static Water Level: Primary Water Use: Sec. Water Use: Total Depth m: Depth Ref: Depth Elev: Drill Method: Orig Ground Elev m: Elev Reliabil Note: DEM Ground Elev m: Concession: Location D: Survey D: Comments:	649457 215549832 Borehole Geotechnical/Geological Investigation JUN-1959 0.2 Not Used 6.9 Ground Surface Diamond Drill 84.2 82.3			Inclin FLG: SP Status: Surv Elev: Piezometer: Primary Name: Municipality: Lot: Township: Latitude DD: Longitude DD: UTM Zone: Easting: Northing: Location Accuracy: Accuracy:	No Initial Entry No No 43.558166 -79.585692 17 614230 4823773 Not Applicable
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218527037 0 2.1 Sand Clay SAND,CLAY. VERY DENSE.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Dense
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218527038 2.1 6.9 Till Clay Silt Sand			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Dense
	TILL,CLAY,SILT,SAND.VERY DENSE, WATER STABLE AT 275.6 FEET. 010 0000005000070065VERY **Note: Many records provided by the department have a truncated [Stratum Description] field.				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	H			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR3.txt RecordID: 201160 NTS_Sheet: 30M12A				
Confiden 1:	Logged by professional. Exact and complete description of material and properties.				
<u>Source List</u>					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
172	1 of 2	E/198.4	79.8 / 1.00	EXCALIBUR INT'L CONSULTANTS 10 Hurontario St Mississauga ON L5G 3G7	SCT
Established:	1972				
Plant Size (ft²):	1800				
Employment:	3				
<u>--Details--</u>					
Description:	Other Publishers				
SIC/NAICS Code:	511190				
172	2 of 2	E/198.4	79.8 / 1.00	Excalibur International Consultants Ltd. 10 Hurontario St Mississauga ON L5G 3G7	SCT
Established:	1972				
Plant Size (ft²):	1800				
Employment:	4				
173	1 of 1	SSW/198.4	79.8 / 1.00	ON	BORE
Borehole ID:	640923			Inclin FLG:	No
OGF ID:	215541318			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.553906
Total Depth m:	2.7			Longitude DD:	-79.587029
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614130
Drill Method:	Power auger			Northing:	4823298
Orig Ground Elev m:	78.2			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	78.1				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Concession: Location D: Survey D: Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218494094			Mat Consistency:	
Top Depth:	2.4			Material Moisture:	
Bottom Depth:	2.6			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	CLAY,SAND,SILT. LACUSTRINE,AGE POST-GLACIAL.				
Geology Stratum ID:	218494091			Mat Consistency:	
Top Depth:	.1			Material Moisture:	
Bottom Depth:	.3			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL,GRAVEL.				
Geology Stratum ID:	218494090			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ASPHALT.				
Geology Stratum ID:	218494092			Mat Consistency:	
Top Depth:	.3			Material Moisture:	Wet
Bottom Depth:	1.8			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND,SILT,CLAY. BROWN,ALLUVIAL,WET, AGE POST-GLACIAL.				
Geology Stratum ID:	218494095			Mat Consistency:	Firm
Top Depth:	2.6			Material Moisture:	
Bottom Depth:	2.7			Material Texture:	Fine
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-FINE,CLAY,SILT.GREY,ALLUVIAL,FIRM, AGE POST-GLACIAL.				
Geology Stratum ID:	218494093			Mat Consistency:	
Top Depth:	1.8			Material Moisture:	
Bottom Depth:	2.4			Material Texture:	Coarse

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material Color: Grey Material 1: Sand Material 2: Clay Material 3: Silt Material 4: Gsc Material Description: Stratum Description: SAND-MEDIUM TO COARSE,CLAY,SILT. GREY,ALLUVIAL, AGE POST-GLACIAL.					
Source Source Type: Data Survey Source Orig: Geological Survey of Canada Source Date: 1956-1972 Confidence: M Observatio: Source Name: Urban Geology Automated Information System (UGAIS) Source Details: File: TOR1B.txt RecordID: 088890 NTS_Sheet: 30M12A Confiden 1: Logs are approximately correct. Lack of information. Doubtful terminology. Source Appl: Spatial/Tabular Source Iden: 1 Scale or Res: Varies Horizontal: NAD27 Verticalda: Mean Average Sea Level					
Source List Source Identifier: 1 Source Type: Data Survey Source Date: 1956-1972 Scale or Resolution: Varies Source Name: Urban Geology Automated Information System (UGAIS) Source Originators: Geological Survey of Canada Horizontal Datum: NAD27 Vertical Datum: Mean Average Sea Level Projection Name: Universal Transverse Mercator					
174	1 of 1	S/199.5	79.8 / 1.00	29 PARK ST. EAST MISSISSAUGA ON	WWIS
Well ID: 7296575 Construction Date: Use 1st: Test Hole Use 2nd: Monitoring Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z258526 Tag: A189871 Constructn Method: Elevation (m): Elevatn Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: MISSISSAUGA CITY (PORT CREDIT) Site Info: Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 05-Oct-2017 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: PEEL Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map):					
Additional Detail(s) (Map) Well Completed Date: 2017/08/30 Year Completed: 2017 Depth (m): 7.3152 Latitude: 43.5537714511117 Longitude: -79.5862474432159 Path:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Bore Hole Information</u>					
Bore Hole ID:	1006758610			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614193.00
Code OB Desc:				North83:	4823284.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	30-Aug-2017 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006953361				
Layer:	3				
Color:	2				
General Color:	GREY				
Mat1:	34				
Most Common Material:	TILL				
Mat2:	73				
Mat2 Desc:	HARD				
Mat3:	66				
Mat3 Desc:	DENSE				
Formation Top Depth:	7.0				
Formation End Depth:	13.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006953359				
Layer:	1				
Color:	2				
General Color:	GREY				
Mat1:	11				
Most Common Material:	GRAVEL				
Mat2:	09				
Mat2 Desc:	MEDIUM SAND				
Mat3:	79				
Mat3 Desc:	PACKED				
Formation Top Depth:	0.0				
Formation End Depth:	1.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006953363				
Layer:	5				
Color:	2				
General Color:	GREY				
Mat1:	17				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Most Common Material:		SHALE			
Mat2:					
Mat2 Desc:					
Mat3:		71			
Mat3 Desc:		FRACTURED			
Formation Top Depth:		18.0			
Formation End Depth:		24.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006953360			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		34			
Most Common Material:		TILL			
Mat2:		73			
Mat2 Desc:		HARD			
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:		1.0			
Formation End Depth:		7.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006953362			
Layer:		4			
Color:		2			
General Color:		GREY			
Mat1:		17			
Most Common Material:		SHALE			
Mat2:					
Mat2 Desc:					
Mat3:		92			
Mat3 Desc:		WEATHERED			
Formation Top Depth:		13.0			
Formation End Depth:		18.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006953372			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006953373			
Layer:		2			
Plug From:		1.0			
Plug To:		2.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Sealing Record</u>					
Plug ID:		1006953375			
Layer:		4			
Plug From:		17.5			
Plug To:		24.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006953374			
Layer:		3			
Plug From:		2.0			
Plug To:		17.5			
Plug Depth UOM:		ft			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1006953371			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:		DIRECT PUSH			
<u>Pipe Information</u>					
Pipe ID:		1006953358			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006953367			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		19.0			
Casing Diameter:		1.3799999952316284			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006953368			
Layer:		1			
Slot:		10			
Screen Top Depth:		19.0			
Screen End Depth:		24.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.659999966621399			
<u>Water Details</u>					
Water ID:		1006953366			
Layer:					
Kind Code:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006953364			
Diameter:		2.875			
Depth From:		0.0			
Depth To:		14.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Hole Diameter</u>					
Hole ID:		1006953365			
Diameter:		2.375			
Depth From:		14.0			
Depth To:		24.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Links</u>					
Bore Hole ID:	1006758610			Tag No:	A189871
Depth M:	7.3152			Contractor:	7241
Year Completed:	2017			Path:	729\7296575.pdf
Well Completed Dt:	2017/08/30			Latitude:	43.5537714511117
Audit No:	Z258526			Longitude:	-79.5862474432159
175	1 of 1	N/202.9	79.8 / 1.00	1175 Hurontario St ON	WWIS
Well ID:	7380069			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	01-Feb-2021 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	7KGN0B7V			Contractor:	7360
Tag:	A310018			Form Version:	9
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1008564516			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614222.00
Code OB Desc:				North83:	4823780.00
Open Hole:				Org CS:	UTM83

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Cluster Kind:				UTMRC:	4
Date Completed:	22-Apr-2020 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1008564626				
Layer:	2				
Color:	2				
General Color:	GREY				
Mat1:	34				
Most Common Material:	TILL				
Mat2:					
Mat2 Desc:					
Mat3:	73				
Mat3 Desc:	HARD				
Formation Top Depth:	10.0				
Formation End Depth:	20.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1008564625				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	01				
Most Common Material:	FILL				
Mat2:					
Mat2 Desc:					
Mat3:	73				
Mat3 Desc:	HARD				
Formation Top Depth:	0.0				
Formation End Depth:	10.0				
Formation End Depth UOM:	ft				
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1008564714				
Layer:	1				
Plug From:					
Plug To:					
Plug Depth UOM:	ft				
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1008564732				
Layer:	1				
Plug From:	0.0				
Plug To:	8.0				
Plug Depth UOM:	ft				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1008564583			
Method Construction Code:		E			
Method Construction:		Auger			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1008564557			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1008564666			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		10.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1008564682			
Layer:		1			
Slot:		0.1			
Screen Top Depth:		10.0			
Screen End Depth:		20.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.25			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1008564558			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole ID: 1008564697 Diameter: 6.0 Depth From: 0.0 Depth To: 20.0 Hole Depth UOM: ft Hole Diameter UOM: inch					
Links					
Bore Hole ID:	1008564516			Tag No:	A310018
Depth M:	6.096			Contractor:	7360
Year Completed:	2020			Path:	738\7380069.pdf
Well Completed Dt:	2020/04/22			Latitude:	43.5582317378366
Audit No:	7KGN0B7V			Longitude:	-79.5857840896598

176	1 of 1	N/204.0	80.1 / 1.27	ON	BORE
Borehole ID: 833860 OGF ID: 215585991 Status: Decommissioned Type: Borehole Use: Geotechnical/Geological Investigation Completion Date: 03-JUN-1959 Static Water Level: 1.4 Primary Water Use: Sec. Water Use: Total Depth m: 6.9 Depth Ref: Ground Surface Depth Elev: Drill Method: Hollow stem auger Orig Ground Elev m: 84.2 Elev Reliabil Note: DEM Ground Elev m: 82.3 Concession: Location D: PORT CREDIT CREEK TO LAKE ONTARIO * STORM SEWER Survey D: Comments:					
Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD: 43.558241 Longitude DD: -79.585772 UTM Zone: 17 Easting: 614223 Northing: 4823781 Location Accuracy: Accuracy: Within 20 metres					

Borehole Geology Stratum

Geology Stratum ID:	6014664	Mat Consistency:	
Top Depth:	2.1	Material Moisture:	
Bottom Depth:	6.9	Material Texture:	
Material Color:		Non Geo Mat Type:	
Material 1:	Till	Geologic Formation:	
Material 2:	Clay	Geologic Group:	
Material 3:	Stones	Geologic Period:	
Material 4:	Silt	Depositional Gen:	glacial
Gsc Material Description:			
Stratum Description:	Sandy silty clay with some stones, (glacial till) **Note: Many records provided by the department have a truncated [Stratum Description] field.		
Geology Stratum ID:	6014663	Mat Consistency:	
Top Depth:	0	Material Moisture:	
Bottom Depth:	2.1	Material Texture:	Fine
Material Color:		Non Geo Mat Type:	
Material 1:	Sand	Geologic Formation:	
Material 2:	Clay	Geologic Group:	
Material 3:		Geologic Period:	
Material 4:		Depositional Gen:	
Gsc Material Description:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Stratum Description:		Fine sand with some clay **Note: Many records provided by the department have a truncated [Stratum Description] field.			
177	1 of 1	ESE/207.5	79.8 / 1.00	Enersource Hydro Mississauga 5 Ann Street Mississauga ON L5G 3E8	GEN
Generator No: ON4489026 SIC Code: 221122 SIC Description: Approval Years: 2011 PO Box No: Country:		Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:			
178	1 of 1	ESE/209.5	79.8 / 1.00	ON	BORE
Borehole ID: 646204 OGF ID: 215546587 Status: Type: Borehole Use: Geotechnical/Geological Investigation Completion Date: JUL-1969 Static Water Level: Primary Water Use: Not Used Sec. Water Use: Total Depth m: 9.9 Depth Ref: Ground Surface Depth Elev: Drill Method: Power auger Orig Ground Elev m: 79.7 Elev Reliabil Note: DEM Ground Elev m: 79.4 Concession: Location D: Survey D: Comments:		Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD: 43.555156 Longitude DD: -79.582605 UTM Zone: 17 Easting: 614485 Northing: 4823443 Location Accuracy: Accuracy: Not Applicable			
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: 218514020 Top Depth: 2.4 Bottom Depth: 2.5 Material Color: Grey Material 1: Till Material 2: Silt Material 3: Sand Material 4: Gravel Gsc Material Description: Stratum Description: TILL,SILT,SAND, GRAVEL. GREY,GLACIAL,DENSE, AGE GLACIAL.		Mat Consistency: Dense Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen: glacial			
Geology Stratum ID: 218514017 Top Depth: 0 Bottom Depth: .1 Material Color: Material 1: Asphalt Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description: ASPHALT.		Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:			
Geology Stratum ID: 218514021		Mat Consistency:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	2.5 9.9 Grey Bedrock Shale Limestone			Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Ordovician marine
BEDROCK, SHALE, LIMESTONE. GREY, MARINE, LAYERED, AGE ORDOVICIAN. 018 010 000500 **Note: Many records provided by the department have a truncated [Stratum Description] field.					
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218514018 .1 1.5 Fill Silt Sand Gravel			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Dense Dense Medium fill
FILL, SILT, SAND, GRAVEL. DENSE.					
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218514019 1.5 2.4 Brown Sand Silt			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Dense Medium glacial
SAND-MEDIUM, SILT. BROWN, GLACIAL, DENSE, AGE GLACIAL.					
Source					
Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	Data Survey Geological Survey of Canada 1956-1972 M			Source Appl: Source Iden: Scale or Res: Horizontal: Verticalda:	Spatial/Tabular 1 Varies NAD27 Mean Average Sea Level
Urban Geology Automated Information System (UGAIS) File: TOR2.txt RecordID: 142260 NTS_Sheet: 30M12A Reliable information but incomplete.					
Source List					
Source Identifier: Source Type: Source Date: Scale or Resolution: Source Name: Source Originators:	1 Data Survey 1956-1972 Varies			Horizontal Datum: Vertical Datum: Projection Name:	NAD27 Mean Average Sea Level Universal Transverse Mercator
Urban Geology Automated Information System (UGAIS) Geological Survey of Canada					
179	1 of 10	ESE/212.0	79.8 / 1.00	SKINNER & MIDDLEBROOK LTD. 128 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E4	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country:	ONF025200 9731 FUNERAL HOMES 88,89,90,00,01,03,04			Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Desc:		PATHOLOGICAL WASTES			
179	2 of 10	ESE/212.0	79.8 / 1.00	SKINNER & MIDDLEBROOK LTD. 44-252 128 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E4	GEN
Generator No:		ONF025200		Status:	
SIC Code:		9731		Co Admin:	
SIC Description:		FUNERAL HOMES		Choice of Contact:	
Approval Years:		92,93,94,95,96		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Desc:		PATHOLOGICAL WASTES			
179	3 of 10	ESE/212.0	79.8 / 1.00	SKINNER & MIDDLEBROOK LTD 128 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E4	GEN
Generator No:		ONF025200		Status:	
SIC Code:		9731		Co Admin:	
SIC Description:		FUNERAL HOMES		Choice of Contact:	
Approval Years:		97,98,99		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Desc:		PATHOLOGICAL WASTES			
179	4 of 10	ESE/212.0	79.8 / 1.00	Skinner & Middlebrook Ltd. 128 Lakeshore Rd.E. Mississauga ON L5G 1E4	GEN
Generator No:		ON8373977		Status:	
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:		02,03,04,07,08		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Desc:		PATHOLOGICAL WASTES			
179	5 of 10	ESE/212.0	79.8 / 1.00	Skinner & Middlebrook Ltd. 128 Lakeshore Rd.E. Mississauga ON L5G 1E4	GEN
Generator No:		ON8373977		Status:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Code: 812210 SIC Description: Funeral Homes Approval Years: 2009 PO Box No: Country:					
Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 312 Waste Class Desc: PATHOLOGICAL WASTES					
179	6 of 10	ESE/212.0	79.8 / 1.00	Skinner & Middlebrook Ltd. 128 Lakeshore Rd.E. Mississauga ON L5G 1E4	GEN
Generator No: ON8373977 SIC Code: 812210 SIC Description: Funeral Homes Approval Years: 2010 PO Box No: Country:					
Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 312 Waste Class Desc: PATHOLOGICAL WASTES					
179	7 of 10	ESE/212.0	79.8 / 1.00	Skinner & Middlebrook Ltd. 128 Lakeshore Rd.E. Mississauga ON L5G 1E4	GEN
Generator No: ON8373977 SIC Code: 812210 SIC Description: Funeral Homes Approval Years: 2011 PO Box No: Country:					
Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 312 Waste Class Desc: PATHOLOGICAL WASTES					
179	8 of 10	ESE/212.0	79.8 / 1.00	Skinner & Middlebrook Ltd 128 Lakeshore Rd.E. Mississauga ON L5G 1E4	GEN
Generator No: ON6384687 SIC Code: SIC Description: Approval Years: As of Jul 2020 PO Box No: Country: Canada					
Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 312 P Waste Class Desc: Pathological wastes					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
179	9 of 10	ESE/212.0	79.8 / 1.00	Skinner & Middlebrook Ltd 128 Lakeshore Rd.E. Mississauga ON L5G 1E4	GEN
Generator No:		ON6384687	Status: Registered		
SIC Code:			Co Admin:		
SIC Description:			Choice of Contact:		
Approval Years:		As of Nov 2021	Phone No Admin:		
PO Box No:			Contam. Facility:		
Country:		Canada	MHSW Facility:		
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Desc:		Pathological wastes			
179	10 of 10	ESE/212.0	79.8 / 1.00	Skinner & Middlebrook Ltd 128 Lakeshore Rd.E. Mississauga ON L5G 1E4	GEN
Generator No:		ON6384687	Status: Registered		
SIC Code:			Co Admin:		
SIC Description:			Choice of Contact:		
Approval Years:		As of Apr 2022	Phone No Admin:		
PO Box No:			Contam. Facility:		
Country:		Canada	MHSW Facility:		
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Desc:		PATHOLOGICAL WASTES			
180	1 of 1	ESE/213.1	79.8 / 1.00	128 Lakeshore Rd E Mississauga ON L5G 1E4	EHS
Order No:		22042900034	Nearest Intersection:		
Status:		C	Municipality:		
Report Type:		Custom Report	Client Prov/State: ON		
Report Date:		04-MAY-22	Search Radius (km): .25		
Date Received:		29-APR-22	X: -79.58276987		
Previous Site Name:			Y: 43.55484041		
Lot/Building Size:					
Additional Info Ordered:		Fire Insur. Maps and/or Site Plans			
181	1 of 1	SE/213.5	79.8 / 1.00	7 Elizabeth Street North Mississauga ON	EHS
Order No:		20110531031	Nearest Intersection:		
Status:		C	Municipality:		
Report Type:		Custom Report	Client Prov/State: ON		
Report Date:		6/7/2011	Search Radius (km): 0.25		
Date Received:		5/31/2011 1:34:57 PM	X: -79.58455		
Previous Site Name:			Y: 43.553869		
Lot/Building Size:					
Additional Info Ordered:					
182	1 of 1	SSW/214.5	79.8 / 1.00	29 PARK ST. EAST MISSISSAUGA ON	WWIS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well ID:	7296574			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Test Hole			Data Entry Status:	
Use 2nd:	Monitoring			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	05-Oct-2017 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z258527			Contractor:	7241
Tag:	A189840			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY (PORT CREDIT)			
Site Info:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2017/08/31				
Year Completed:	2017				
Depth (m):	2.4384				
Latitude:	43.5537824687829				
Longitude:	-79.5871385635945				
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1006758607			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614121.00
Code OB Desc:				North83:	4823284.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	31-Aug-2017 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006953267				
Layer:	1				
Color:	2				
General Color:	GREY				
Mat1:	11				
Most Common Material:	GRAVEL				
Mat2:	73				
Mat2 Desc:	HARD				
Mat3:	79				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat3 Desc:		PACKED			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006953269			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		34			
Most Common Material:		TILL			
Mat2:		73			
Mat2 Desc:		HARD			
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:		6.0			
Formation End Depth:		8.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006953268			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		34			
Most Common Material:		TILL			
Mat2:		73			
Mat2 Desc:		HARD			
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:		1.0			
Formation End Depth:		6.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006953277			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006953278			
Layer:		2			
Plug From:		1.0			
Plug To:		2.5			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006953279			
Layer:		3			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug From:		2.5			
Plug To:		8.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006953276			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:		DIRECT PUSH			
<u>Pipe Information</u>					
Pipe ID:		1006953266			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006953272			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		0.30000001192092896			
Casing Diameter:		1.3799999952316284			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006953273			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.0			
Screen End Depth:		8.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.6599999966621399			
<u>Water Details</u>					
Water ID:		1006953271			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006953270			
Diameter:		2.375			
Depth From:		0.0			
Depth To:		8.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Links</u>					
Bore Hole ID:	1006758607			Tag No:	A189840
Depth M:	2.4384			Contractor:	7241
Year Completed:	2017			Path:	729\7296574.pdf
Well Completed Dt:	2017/08/31			Latitude:	43.5537824687829
Audit No:	Z258527			Longitude:	-79.5871385635945
183	1 of 2	ESE/214.6	79.8 / 1.00	128 Lakeshore Road East Mississauga ON L5G 1E4	EHS
Order No:	21012800063			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	02-FEB-21			Search Radius (km):	.25
Date Received:	28-JAN-21			X:	-79.5827751
Previous Site Name:				Y:	43.5548094
Lot/Building Size:					
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans				
183	2 of 2	ESE/214.6	79.8 / 1.00	128 Lakeshore Road East Mississauga ON L5G 1E4	EHS
Order No:	21012800063			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	02-FEB-21			Search Radius (km):	.25
Date Received:	28-JAN-21			X:	-79.5827751
Previous Site Name:				Y:	43.5548094
Lot/Building Size:					
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans				
184	1 of 1	SE/215.2	79.8 / 1.00	7 Elizabeth Street North Mississauga ON L5G 2Y8	EHS
Order No:	20190822036			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	27-AUG-19			Search Radius (km):	.25
Date Received:	22-AUG-19			X:	-79.584531
Previous Site Name:				Y:	43.553856
Lot/Building Size:					
Additional Info Ordered:					
185	1 of 1	NNE/215.5	80.1 / 1.27	ON	WWIS
Well ID:	7388363			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	01-Jun-2021 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z324808			Contractor:	7693
Tag:	A224458			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info: MISSISSAUGA CITY (PORT CREDIT) Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
<u>Bore Hole Information</u>					
Bore Hole ID: 1008669506 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 18-May-2021 00:00:00 Remarks: Loc Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment: Elevation: Elevrc: Zone: 17 East83: 614245.00 North83: 4823789.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					
<u>Links</u>					
Bore Hole ID: 1008669506 Depth M: Year Completed: 2021 Well Completed Dt: 2021/05/18 Audit No: Z324808 Tag No: A224458 Contractor: 7693 Path: Latitude: 43.558309228536 Longitude: -79.5854975098664					
186	1 of 1	SSW/215.7	79.8 / 1.00	27 PARK ST E PORT CREDIT ON	WWIS
Well ID: 7278219 Construction Date: Use 1st: Monitoring Use 2nd: Final Well Status: Observation Wells Water Type: Casing Material: Audit No: Z232729 Tag: A213501 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info: MISSISSAUGA CITY (PORT CREDIT) Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 28-Dec-2016 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 7238 Form Version: 7 Owner: County: PEEL Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map):					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2016/12/02			
Year Completed:		2016			
Depth (m):		7.4676			
Latitude:		43.553688323252			
Longitude:		-79.5868064972322			
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1006322618			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614148.00
Code OB Desc:				North83:	4823274.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	02-Dec-2016 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006534294				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	02				
Most Common Material:	TOPSOIL				
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:	2.5				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006534298				
Layer:	5				
Color:					
General Color:					
Mat1:					
Most Common Material:					
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:	24.0				
Formation End Depth:	24.5				
Formation End Depth UOM:	ft				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006534297			
Layer:		4			
Color:					
General Color:					
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		15.0			
Formation End Depth:		24.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006534295			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:					
Mat2 Desc:					
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		2.5			
Formation End Depth:		10.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006534296			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		10.0			
Formation End Depth:		15.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006534305			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		1006534306			
Layer:		2			
Plug From:		1.0			
Plug To:		12.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006534307			
Layer:		3			
Plug From:		12.0			
Plug To:		24.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006534304			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006534293			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006534301			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		14.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006534302			
Layer:		1			
Slot:		10			
Screen Top Depth:		14.0			
Screen End Depth:		24.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:					
<u>Water Details</u>					
Water ID:		1006534300			
Layer:					
Kind Code:					
Kind:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006534299			
Diameter:		6.25			
Depth From:		0.0			
Depth To:		24.5			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Links</u>					
Bore Hole ID:		1006322618	Tag No:		A213501
Depth M:		7.4676	Contractor:		7238
Year Completed:		2016	Path:		727\7278219.pdf
Well Completed Dt:		2016/12/02	Latitude:		43.553688323252
Audit No:		Z232729	Longitude:		-79.5868064972322

187	1 of 1	NNW/218.9	80.5 / 1.65	ON	WWIS
Well ID:	7378964	Flowing (Y/N):			
Construction Date:		Flow Rate:			
Use 1st:		Data Entry Status:		Yes	
Use 2nd:		Data Src:			
Final Well Status:		Date Received:		29-Jan-2021 00:00:00	
Water Type:		Selected Flag:		TRUE	
Casing Material:		Abandonment Rec:			
Audit No:	Z348110	Contractor:		7644	
Tag:	A301452	Form Version:		7	
Constructn Method:		Owner:			
Elevation (m):		County:		PEEL	
Elevatn Reliabilty:		Lot:			
Depth to Bedrock:		Concession:			
Well Depth:		Concession Name:			
Overburden/Bedrock:		Easting NAD83:			
Pump Rate:		Northing NAD83:			
Static Water Level:		Zone:			
Clear/Cloudy:		UTM Reliability:			
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:					

Bore Hole Information

Bore Hole ID:		1008614907	Elevation:		
DP2BR:			Elevrc:		
Spatial Status:			Zone:		17
Code OB:			East83:		614157.00
Code OB Desc:			North83:		4823793.00
Open Hole:			Org CS:		UTM83
Cluster Kind:			UTMRC:		4
Date Completed:		18-Dec-2020 00:00:00	UTMRC Desc:		margin of error : 30 m - 100 m
Remarks:			Location Method:		wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Links</u>					
Bore Hole ID:	1008614907			Tag No:	A301452
Depth M:				Contractor:	7644
Year Completed:	2020			Path:	737\7378964.pdf
Well Completed Dt:	2020/12/18			Latitude:	43.5583587077452
Audit No:	Z348110			Longitude:	-79.5865858966422
<u>188</u>	1 of 1	WSW/220.6	78.4 / -0.49	ON	BORE
Borehole ID:	649424			Inclin FLG:	No
OGF ID:	215549799			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1959			Municipality:	
Static Water Level:	0.2			Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.554784
Total Depth m:	3.7			Longitude DD:	-79.588928
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	613975
Drill Method:	Hand auger			Northing:	4823393
Orig Ground Elev m:	79.6			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	79.1				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218526915			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.3			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Soil			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	SOIL.				
Geology Stratum ID:	218526916			Mat Consistency:	
Top Depth:	.3			Material Moisture:	
Bottom Depth:	3			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	SAND. BROWN, WATER STABLE AT 260.5 FEET.				
Geology Stratum ID:	218526917			Mat Consistency:	
Top Depth:	3			Material Moisture:	
Bottom Depth:	3.7			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Clay			Geologic Group:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3: Silt Material 4: Gsc Material Description: Stratum Description: TILL,CLAY,SILT. GREY. TILL **Note: Many records provided by the department have a truncated [Stratum Description] field.					
Geologic Period: Depositional Gen:					
Source					
Source Type: Data Survey Source Orig: Geological Survey of Canada Source Date: 1956-1972 Confidence: H Observatio: Source Name: Urban Geology Automated Information System (UGAIS) Source Details: File: TOR3.txt RecordID: 200830 NTS_Sheet: 30M12A Confiden 1: Logged by professional. Exact and complete description of material and properties.					
Source Appl: Spatial/Tabular Source Iden: 1 Scale or Res: Varies Horizontal: NAD27 Verticalda: Mean Average Sea Level					
Source List					
Source Identifier: 1 Source Type: Data Survey Source Date: 1956-1972 Scale or Resolution: Varies Source Name: Urban Geology Automated Information System (UGAIS) Source Originators: Geological Survey of Canada					
Horizontal Datum: NAD27 Vertical Datum: Mean Average Sea Level Projection Name: Universal Transverse Mercator					
189	1 of 1	E/220.8	79.8 / 1.00	ON	BORE
Borehole ID: 833853 OGF ID: 215585984 Status: Decommissioned Type: Borehole Use: Geotechnical/Geological Investigation Completion Date: 01-JUN-1959 Static Water Level: 3.0 Primary Water Use: Sec. Water Use: Total Depth m: 6.2 Depth Ref: Ground Surface Depth Elev: Drill Method: Hollow stem auger Orig Ground Elev m: 79.9 Elev Reliabil Note: DEM Ground Elev m: 80 Concession: Location D: PORT CREDIT CREEK TO LAKE ONTARIO * STORM SEWER Survey D: Comments:					
Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD: 43.555757 Longitude DD: -79.582289 UTM Zone: 17 Easting: 614509 Northing: 4823510 Location Accuracy: Accuracy: Within 20 metres					
Borehole Geology Stratum					
Geology Stratum ID: 6014646 Top Depth: 1.1 Bottom Depth: 6.2 Material Color: Grey Material 1: Till Material 2: Clay Material 3: Sand Material 4: Silt Gsc Material Description: Stratum Description: Grey, silty clay, stiff, with some sand; stiff to hard, grey, silty clay with sand and some small stones (glacial till) **Note: Many records provided by the department have a truncated [Stratum Description] field.					
Mat Consistency: Stiff Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	6014645 0 1.1 Sand Very fine sand			Mat Consistency: Material Moisture: Material Texture: Fine Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	
**Note: Many records provided by the department have a truncated [Stratum Description] field.					
190	1 of 1	E/221.2	79.8 / 1.00	F.S. Port Credit Development Limited 15 HURONTARIO ST, MISSISSAUGA, ON, L5G 3G8 ON	RSC
RSC ID: RA No: RSC Type: Curr Property Use: Ministry District: Filing Date: Date Ack: Date Returned: Restoration Type: Soil Type: Criteria: CPU Issued Sect 1686: Asmt Roll No: Prop ID No (PIN): Property Municipal Address: Mailing Address: Latitude & Longitude: UTM Coordinates: Consultant: Legal Desc: Measurement Method: Applicable Standards: RSC PDF:	36704 Commercial MISSISSAUGA 16-Nov-07 No 13464-0302 15 HURONTARIO ST, MISSISSAUGA, ON, L5G 3G8 Suite TOP FLOOR, 141 LAKESHORE RD E, MISSISSAUGA, ON, L5G 1E8 43.55643840N 79.58275560W (converted from UTM) NAD83 17-614470-4823585 Part of Lot A, Credit Indian Reserve, City of Mississauga, Regional Municipality of Peel, designated as Parts 2 and 3 on Plan 43R-23793, being the whole of PIN 13464-0302 Interpolation from a map Full Depth Site Conditions Standard, with Nonpotable Ground Water, Coarse Textured Soil, for Residential/Parkland/Institutional property use			Cert Date: Cert Prop Use No: Intended Prop Use: Qual Person Name: Stratified (Y/N): Audit (Y/N): Entire Leg Prop. (Y/N): Accuracy Estimate: Telephone: Fax: Email:	28-Sep-07 No CPU Residential Fred Serrafiero Yes 2 to 5 meters 416-7479661x227 416-7479899 fserrafiero@framgroup.com
191	1 of 1	ENE/222.1	79.8 / 1.00	ON	BORE
Borehole ID: OGF ID: Status: Type: Use: Completion Date: Static Water Level: Primary Water Use: Sec. Water Use: Total Depth m: Depth Ref: Depth Elev: Drill Method: Orig Ground Elev m: Elev Reliabil Note: DEM Ground Elev m: Concession:	640888 215541283 Borehole 2.3 Ground Surface 80.8 81.7			Inclin FLG: SP Status: Surv Elev: Piezometer: Primary Name: Municipality: Lot: Township: Latitude DD: Longitude DD: UTM Zone: Easting: Northing: Location Accuracy: Accuracy:	No Initial Entry No No 43.557324 -79.583173 17 614435 4823683 Not Applicable

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Location D: Survey D: Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218493928			Mat Consistency:	
Top Depth:	.8			Material Moisture:	Dry
Bottom Depth:	2.3			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Sand			Geologic Period:	
Material 4:	Till			Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	CLAY,SILT,SAND,TILL.GLACIAL,DRY,AGE GLACIAL. AGE GLACIAL **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	218493926			Mat Consistency:	
Top Depth:	.1			Material Moisture:	
Bottom Depth:	.5			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Gravel			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Sand			Geologic Period:	
Material 4:	Clay			Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	GRAVEL,SILT,SAND, CLAY. FLUVIO-GLACIAL,AGE GLACIAL.				
Geology Stratum ID:	218493925			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ASPHALT.				
Geology Stratum ID:	218493927			Mat Consistency:	
Top Depth:	.5			Material Moisture:	
Bottom Depth:	.8			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Sand			Geologic Period:	
Material 4:				Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	CLAY,SILT,SAND. GREY,FLUVIO-GLACIAL, AGE GLACIAL.				
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:				Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 088540 NTS_Sheet: 30M12A				
Confiden 1:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
192	1 of 1	ESE/222.4	79.8 / 1.00	ON	BORE
Borehole ID:	646203			Inclin FLG:	No
OGF ID:	215546586			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JUL-1969			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.555065
Total Depth m:	7.5			Longitude DD:	-79.582483
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614495
Drill Method:	Power auger			Northing:	4823433
Orig Ground Elev m:	79.2			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	78.8				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218514012			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ASPHALT.				
Geology Stratum ID:	218514015			Mat Consistency:	Dense
Top Depth:	2.6			Material Moisture:	
Bottom Depth:	7.5			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Gravel			Geologic Period:	
Material 4:	Clay			Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	TILL,SILT,GRAVEL, CLAY. GREY,GLACIAL,VERY DENSE, LAYERED,AGE GLACIAL.				
Geology Stratum ID:	218514016			Mat Consistency:	
Top Depth:	7.5			Material Moisture:	
Bottom Depth:	7.5			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Bedrock			Geologic Formation:	
Material 2:	Shale			Geologic Group:	
Material 3:				Geologic Period:	Ordovician
Material 4:				Depositional Gen:	marine

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Gsc Material Description:					
Stratum Description:		BEDROCK, SHALE. MARINE, AGE ORDOVICIAN. 022 010 0005004500085100 **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:	218514013			Mat Consistency:	
Top Depth:	.1			Material Moisture:	Dry
Bottom Depth:	1.5			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Sand			Geologic Period:	
Material 4:	Clay			Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:		FILL, SILT, SAND, CLAY. DRY.			
Geology Stratum ID:	218514014			Mat Consistency:	Hard
Top Depth:	1.5			Material Moisture:	
Bottom Depth:	2.6			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:		TILL, SILT, CLAY. BROWN, GLACIAL, HARD, AGE GLACIAL.			
Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR2.txt RecordID: 142250 NTS_Sheet: 30M12A				
Confiden 1:	Reliable information but incomplete.				
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
193	1 of 1	SSW/223.5	79.8 / 1.00	27 Park St E Mississauga ON L5G1L7	EHS
Order No:	20161114019			Nearest Intersection:	
Status:	C			Municipality:	Mississauga
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	18-NOV-16			Search Radius (km):	.25
Date Received:	14-NOV-16			X:	-79.587021
Previous Site Name:				Y:	43.553663
Lot/Building Size:					
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans; City Directory				
194	1 of 27	SE/223.5	79.8 / 1.00	UNKNOWN 114 LAKESHORE BLVD ST HELENE ST. MISSISSAUGA CITY ON	SPL

362 erisinfo.com | Environmental Risk Information Services Order No: 22091501030

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
				5140 YONGE ST. SUITE 200 NORTH YORK ON L5G 1E4	
Generator No:		ON1019505		Status:	
SIC Code:		6331		Co Admin:	
SIC Description:		GASOLINE SERV. ST.		Choice of Contact:	
Approval Years:		89,90		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
194	6 of 27	SE/223.5	79.8 / 1.00	PETRO CANADA INC. 30-570 114 LAKESHORE RD., EAST MISSISSAUGA C/O 5140 YONGE ST. SUITE 200 NORTH YORK ON L5G 1E4	GEN
Generator No:		ON1019505		Status:	
SIC Code:		6331		Co Admin:	
SIC Description:		GASOLINE SERV. ST.		Choice of Contact:	
Approval Years:		92,93,94,95,96,97,98		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
194	7 of 27	SE/223.5	79.8 / 1.00	Dens-Tek Dental Studio Inc. 114 Lakeshore Rd E Unit 4 Mississauga ON L5G 1E4	SCT
Established:		01-JUN-02			
Plant Size (ft²):					
Employment:					
<u>--Details--</u>					
Description:		Medical Equipment and Supplies Manufacturing			
SIC/NAICS Code:		339110			
Description:		Medical Equipment and Supplies Manufacturing			
SIC/NAICS Code:		339110			
194	8 of 27	SE/223.5	79.8 / 1.00	114 Lakeshore Road E Mississauga ON L5G 1E4	EHS
Order No:		20070226008		Nearest Intersection:	Hurontario Street & Lakeshore Rd. E
Status:		C		Municipality:	
Report Type:		CAN - Complete Report		Client Prov/State:	
Report Date:		3/6/2007		Search Radius (km):	0.25
Date Received:		2/26/2007		X:	-79.583293
Previous Site Name:				Y:	43.554343
Lot/Building Size:					
Additional Info Ordered:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
194	9 of 27	SE/223.5	79.8 / 1.00	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS 114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON L5G 1E4	DTNK

Delisted Expired Fuel Safety
Facilities

Instance No:	10071073	Expired Date:	8/23/1997
Status:	EXPIRED	Max Hazard Rank:	
Instance ID:		Facility Location:	
Instance Type:	FS Facility	Facility Type:	
Instance Creation Dt:		Fuel Type 2:	
Instance Install Dt:		Fuel Type 3:	
Item Description:		Panam Related:	
Manufacturer:		Panam Venue Nm:	
Model:		External Identifier:	
Serial No:		Item:	
ULC Standard:		Piping Steel:	
Quantity:		Piping Galvanized:	
Unit of Measure:		Tank Single Wall St:	
Overfill Prot Type:		Piping Underground:	
Creation Date:		Tank Underground:	
Next Periodic Str DT:		Source:	
TSSA Base Sched Cycle 2:			
TSSAMax Hazard Rank 1:			
TSSA Risk Based Periodic Yn:			
TSSA Volume of Directives:			
TSSA Periodic Exempt:			
TSSA Statutory Interval:			
TSSA Recd Insp Interva:			
TSSA Recd Tolerance:			
TSSA Program Area:			
TSSA Program Area 2:			
Description:			
Original Source:	EXP		
Record Date:	Up to May 2013		

194	10 of 27	SE/223.5	79.8 / 1.00	V V GAS AND WASH 114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON	DTNK

Delisted Expired Fuel Safety
Facilities

Instance No:	10102295	Expired Date:	
Status:	EXPIRED	Max Hazard Rank:	
Instance ID:	12017	Facility Location:	
Instance Type:	FS Facility	Facility Type:	
Instance Creation Dt:		Fuel Type 2:	
Instance Install Dt:		Fuel Type 3:	
Item Description:		Panam Related:	
Manufacturer:		Panam Venue Nm:	
Model:		External Identifier:	
Serial No:		Item:	
ULC Standard:		Piping Steel:	
Quantity:		Piping Galvanized:	
Unit of Measure:		Tank Single Wall St:	
Overfill Prot Type:		Piping Underground:	
Creation Date:		Tank Underground:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Next Periodic Str DT:				Source:	
TSSA Base Sched Cycle 2:					
TSSAMax Hazard Rank 1:					
TSSA Risk Based Periodic Yn:					
TSSA Volume of Directives:					
TSSA Periodic Exempt:					
TSSA Statutory Interval:					
TSSA Recd Insp Interva:					
TSSA Recd Tolerance:					
TSSA Program Area:					
TSSA Program Area 2:					
Description:		FS Propane Cylr Handling Facility			
Original Source:		EXP			
Record Date:		Up to Mar 2012			

Delisted Expired Fuel Safety Facilities

Expired Date:
Max Hazard Rank:
Facility Location:
Facility Type:
Fuel Type 2:
Fuel Type 3:
Panam Related:
Panam Venue Nm:
External Identifier:
Item:
Piping Steel:
Piping Galvanized:
Tank Single Wall St:
Piping Underground:
Tank Underground:
Source:

194	12 of 27	SE/223.5	79.8 / 1.00	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS 114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	DTNK

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Instance No:	11245025			Expired Date:	
Status:	EXPIRED			Max Hazard Rank:	NULL
Instance ID:				Facility Location:	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA
Instance Type:				Facility Type:	FS LIQUID FUEL TANK
Instance Creation Dt:	2/11/1994			Fuel Type 2:	NULL
Instance Install Dt:	2/11/1994			Fuel Type 3:	NULL
Item Description:	FS Liquid Fuel Tank			Panam Related:	NULL
Manufacturer:	NULL			Panam Venue Nm:	NULL
Model:	NULL			External Identifier:	NULL
Serial No:	NULL			Item:	
ULC Standard:	NULL			Piping Steel:	
Quantity:	1			Piping Galvanized:	
Unit of Measure:	EA			Tank Single Wall St:	
Overfill Prot Type:	NULL			Piping Underground:	
Creation Date:	7/5/2009 1:24:23 AM			Tank Underground:	
Next Periodic Str DT:	NULL			Source:	FS Liquid Fuel Tank
TSSA Base Sched Cycle 2:	NULL				
TSSAMax Hazard Rank 1:	NULL				
TSSA Risk Based Periodic Yn:	NULL				
TSSA Volume of Directives:	NULL				
TSSA Periodic Exempt:	NULL				
TSSA Statutory Interval:	NULL				
TSSA Recd Insp Interva:	NULL				
TSSA Recd Tolerance:	NULL				
TSSA Program Area:	NULL				
TSSA Program Area 2:	NULL				
Description:	NULL				
Original Source:	EXP				
Record Date:	31-JUL-2020				

194	13 of 27	SE/223.5	79.8 / 1.00	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS 114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	DTNK

**Delisted Expired Fuel Safety
Facilities**

Instance No:	11245088			Expired Date:	
Status:	EXPIRED			Max Hazard Rank:	NULL
Instance ID:				Facility Location:	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA
Instance Type:				Facility Type:	FS LIQUID FUEL TANK
Instance Creation Dt:	2/11/1994			Fuel Type 2:	NULL
Instance Install Dt:	2/11/1994			Fuel Type 3:	NULL
Item Description:	FS Liquid Fuel Tank			Panam Related:	NULL
Manufacturer:	NULL			Panam Venue Nm:	NULL
Model:	NULL			External Identifier:	NULL
Serial No:	NULL			Item:	
ULC Standard:	NULL			Piping Steel:	
Quantity:	1			Piping Galvanized:	
Unit of Measure:	EA			Tank Single Wall St:	
Overfill Prot Type:	NULL			Piping Underground:	
Creation Date:	7/5/2009 1:24:23 AM			Tank Underground:	
Next Periodic Str DT:	NULL			Source:	FS Liquid Fuel Tank
TSSA Base Sched Cycle 2:	NULL				
TSSAMax Hazard Rank 1:	NULL				
TSSA Risk Based Periodic Yn:	NULL				
TSSA Volume of Directives:	NULL				
TSSA Periodic Exempt:	NULL				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
TSSA Statutory Interval:		NULL			
TSSA Recd Insp Interva:		NULL			
TSSA Recd Tolerance:		NULL			
TSSA Program Area:		NULL			
TSSA Program Area 2:		NULL			
Description:		NULL			
Original Source:		EXP			
Record Date:		31-JUL-2020			

194	14 of 27	SE/223.5	79.8 / 1.00	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS 114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	DTNK

Delisted Expired Fuel Safety
Facilities

Instance No:	11245048	Expired Date:	
Status:	EXPIRED	Max Hazard Rank:	NULL
Instance ID:		Facility Location:	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA FS LIQUID FUEL TANK
Instance Type:		Facility Type:	
Instance Creation Dt:	2/11/1994	Fuel Type 2:	NULL
Instance Install Dt:	2/11/1994	Fuel Type 3:	NULL
Item Description:	FS Liquid Fuel Tank	Panam Related:	NULL
Manufacturer:	NULL	Panam Venue Nm:	NULL
Model:	NULL	External Identifier:	NULL
Serial No:	NULL	Item:	
ULC Standard:	NULL	Piping Steel:	
Quantity:	1	Piping Galvanized:	
Unit of Measure:	EA	Tank Single Wall St:	
Overfill Prot Type:	NULL	Piping Underground:	
Creation Date:	7/5/2009 1:24:27 AM	Tank Underground:	
Next Periodic Str DT:	NULL	Source:	FS Liquid Fuel Tank
TSSA Base Sched Cycle 2:	NULL		
TSSAMax Hazard Rank 1:	NULL		
TSSA Risk Based Periodic Yn:	NULL		
TSSA Volume of Directives:	NULL		
TSSA Periodic Exempt:	NULL		
TSSA Statutory Interval:	NULL		
TSSA Recd Insp Interva:	NULL		
TSSA Recd Tolerance:	NULL		
TSSA Program Area:	NULL		
TSSA Program Area 2:	NULL		
Description:	NULL		
Original Source:	EXP		
Record Date:	31-JUL-2020		

194	15 of 27	SE/223.5	79.8 / 1.00	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS 114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	DTNK

Delisted Expired Fuel Safety
Facilities

Instance No:	11245067	Expired Date:	
Status:	EXPIRED	Max Hazard Rank:	NULL
Instance ID:		Facility Location:	114 LAKESHORE RD E PORT CREDIT

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Instance Type:				Facility Type:	MISSISSAUGA L5G 1E4 ON CA
Instance Creation Dt:	2/11/1994			Fuel Type 2:	FS LIQUID FUEL TANK
Instance Install Dt:	2/11/1994			Fuel Type 3:	NULL
Item Description:	FS Liquid Fuel Tank			Panam Related:	NULL
Manufacturer:	NULL			Panam Venue Nm:	NULL
Model:	NULL			External Identifier:	NULL
Serial No:	NULL			Item:	
ULC Standard:	NULL			Piping Steel:	
Quantity:	1			Piping Galvanized:	
Unit of Measure:	EA			Tank Single Wall St:	
Overfill Prot Type:	NULL			Piping Underground:	
Creation Date:	7/5/2009 1:24:28 AM			Tank Underground:	
Next Periodic Str DT:	NULL			Source:	FS Liquid Fuel Tank
TSSA Base Sched Cycle 2:	NULL				
TSSAMax Hazard Rank 1:	NULL				
TSSA Risk Based Periodic Yn:	NULL				
TSSA Volume of Directives:	NULL				
TSSA Periodic Exempt:	NULL				
TSSA Statutory Interval:	NULL				
TSSA Recd Insp Interva:	NULL				
TSSA Recd Tolerance:	NULL				
TSSA Program Area:	NULL				
TSSA Program Area 2:	NULL				
Description:	NULL				
Original Source:	EXP				
Record Date:	31-JUL-2020				

194	16 of 27	SE/223.5	79.8 / 1.00	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS 114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	DTNK

Delisted Expired Fuel Safety Facilities

Instance No:	11469392	Expired Date:	
Status:	EXPIRED	Max Hazard Rank:	NULL
Instance ID:		Facility Location:	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA
Instance Type:		Facility Type:	FS LIQUID FUEL TANK
Instance Creation Dt:	10/8/1996	Fuel Type 2:	NULL
Instance Install Dt:	10/8/1996	Fuel Type 3:	NULL
Item Description:	FS Liquid Fuel Tank	Panam Related:	NULL
Manufacturer:	NULL	Panam Venue Nm:	NULL
Model:	NULL	External Identifier:	NULL
Serial No:	NULL	Item:	
ULC Standard:	NULL	Piping Steel:	
Quantity:	1	Piping Galvanized:	
Unit of Measure:	EA	Tank Single Wall St:	
Overfill Prot Type:	NULL	Piping Underground:	
Creation Date:	7/5/2009 1:25:31 AM	Tank Underground:	
Next Periodic Str DT:	NULL	Source:	FS Liquid Fuel Tank
TSSA Base Sched Cycle 2:	NULL		
TSSAMax Hazard Rank 1:	NULL		
TSSA Risk Based Periodic Yn:	NULL		
TSSA Volume of Directives:	NULL		
TSSA Periodic Exempt:	NULL		
TSSA Statutory Interval:	NULL		
TSSA Recd Insp Interva:	NULL		
TSSA Recd Tolerance:	NULL		
TSSA Program Area:	NULL		

Map Key	Number of Records	Direction/Distance (m)	Elev/Diff (m)	Site	DB
TSSA Program Area 2: Description: Original Source: Record Date:		NULL NULL EXP 31-JUL-2020			

194	17 of 27	SE/223.5	79.8 / 1.00	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS 114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	DTNK

Delisted Expired Fuel Safety Facilities

Instance No:	11469374	Expired Date:	
Status:	EXPIRED	Max Hazard Rank:	NULL
Instance ID:		Facility Location:	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA
Instance Type:		Facility Type:	FS LIQUID FUEL TANK
Instance Creation Dt:	10/8/1996	Fuel Type 2:	NULL
Instance Install Dt:	10/8/1996	Fuel Type 3:	NULL
Item Description:	FS Liquid Fuel Tank	Panam Related:	NULL
Manufacturer:	NULL	Panam Venue Nm:	NULL
Model:	NULL	External Identifier:	NULL
Serial No:	NULL	Item:	
ULC Standard:	NULL	Piping Steel:	
Quantity:	1	Piping Galvanized:	
Unit of Measure:	EA	Tank Single Wall St:	
Overfill Prot Type:	NULL	Piping Underground:	
Creation Date:	7/5/2009 1:25:34 AM	Tank Underground:	
Next Periodic Str DT:	NULL	Source:	FS Liquid Fuel Tank
TSSA Base Sched Cycle 2:	NULL		
TSSAMax Hazard Rank 1:	NULL		
TSSA Risk Based Periodic Yn:	NULL		
TSSA Volume of Directives:	NULL		
TSSA Periodic Exempt:	NULL		
TSSA Statutory Interval:	NULL		
TSSA Recd Insp Interva:	NULL		
TSSA Recd Tolerance:	NULL		
TSSA Program Area:	NULL		
TSSA Program Area 2:	NULL		
Description:	NULL		
Original Source:	EXP		
Record Date:	31-JUL-2020		

194	18 of 27	SE/223.5	79.8 / 1.00	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS 114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	DTNK

Delisted Expired Fuel Safety Facilities

Instance No:	11469403	Expired Date:	
Status:	EXPIRED	Max Hazard Rank:	NULL
Instance ID:		Facility Location:	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA
Instance Type:		Facility Type:	FS LIQUID FUEL TANK
Instance Creation Dt:	10/8/1996	Fuel Type 2:	NULL
Instance Install Dt:	10/8/1996	Fuel Type 3:	NULL

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Item Description: FS Liquid Fuel Tank Manufacturer: NULL Model: NULL Serial No: NULL ULC Standard: NULL Quantity: 1 Unit of Measure: EA Overfill Prot Type: NULL Creation Date: 7/5/2009 1:25:34 AM Next Periodic Str DT: NULL TSSA Base Sched Cycle 2: NULL TSSAMax Hazard Rank 1: NULL TSSA Risk Based Periodic Yn: NULL TSSA Volume of Directives: NULL TSSA Periodic Exempt: NULL TSSA Statutory Interval: NULL TSSA Recd Insp Interva: NULL TSSA Recd Tolerance: NULL TSSA Program Area: NULL TSSA Program Area 2: NULL Description: NULL Original Source: EXP Record Date: 31-JUL-2020 Panam Related: NULL Panam Venue Nm: NULL External Identifier: NULL Item: Piping Steel: Piping Galvanized: Tank Single Wall St: Piping Underground: Tank Underground: Source: FS Liquid Fuel Tank					

194	19 of 27	SE/223.5	79.8 / 1.00	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS 114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	DTNK

Delisted Expired Fuel Safety Facilities

Instance No: 11469383 Status: EXPIRED Instance ID:		Expired Date: Max Hazard Rank: NULL Facility Location: 114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA FS LIQUID FUEL TANK	
Instance Type: Instance Creation Dt: 10/8/1996 Instance Install Dt: 10/8/1996 Item Description: FS Liquid Fuel Tank Manufacturer: NULL Model: NULL Serial No: NULL ULC Standard: NULL Quantity: 1 Unit of Measure: EA Overfill Prot Type: NULL Creation Date: 7/5/2009 1:25:35 AM Next Periodic Str DT: NULL TSSA Base Sched Cycle 2: NULL TSSAMax Hazard Rank 1: NULL TSSA Risk Based Periodic Yn: NULL TSSA Volume of Directives: NULL TSSA Periodic Exempt: NULL TSSA Statutory Interval: NULL TSSA Recd Insp Interva: NULL TSSA Recd Tolerance: NULL TSSA Program Area: NULL TSSA Program Area 2: NULL Description: NULL Original Source: EXP Record Date: 31-JUL-2020		Facility Type: Fuel Type 2: NULL Fuel Type 3: NULL Panam Related: NULL Panam Venue Nm: NULL External Identifier: NULL Item: Piping Steel: Piping Galvanized: Tank Single Wall St: Piping Underground: Tank Underground: Source: FS Liquid Fuel Tank	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
194	20 of 27	SE/223.5	79.8 / 1.00	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS 114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	FST
Instance No: 11469403 Status: Cont Name: Instance Type: Item: Item Description: FS Liquid Fuel Tank Tank Type: Liquid Fuel Single Wall UST Install Date: 10/8/1996 Install Year: 1989 Years in Service: Model: NULL Description: Capacity: 27200 Tank Material: Fiberglass (FRP) Corrosion Protect: Fiberglass Overfill Protect: Facility Type: FS Liquid Fuel Tank Parent Facility Type: Facility Location: Device Installed Location: 114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA Manufacturer: Serial No: Ulc Standard: Quantity: Unit of Measure: Fuel Type: Gasoline Fuel Type2: NULL Fuel Type3: NULL Piping Steel: Piping Galvanized: Tanks Single Wall St: Piping Underground: No Underground: Panam Related: Panam Venue:					
<u>Liquid Fuel Tank Details</u>					
Overfill Protection: Owner Account Name: CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS Item: FS LIQUID FUEL TANK					
194	21 of 27	SE/223.5	79.8 / 1.00	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS 114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	FST
Instance No: 11469383 Status: Cont Name: Instance Type: Item: Item Description: FS Liquid Fuel Tank Tank Type: Liquid Fuel Single Wall UST Install Date: 10/8/1996 Install Year: 1989 Years in Service: Model: NULL Description: Capacity: 36300 Tank Material: Fiberglass (FRP) Corrosion Protect: Fiberglass Overfill Protect: Facility Type: FS Liquid Fuel Tank Parent Facility Type: Facility Location: Device Installed Location: 114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA Manufacturer: Serial No: Ulc Standard: Quantity: Unit of Measure: Fuel Type: Gasoline Fuel Type2: NULL Fuel Type3: NULL Piping Steel: Piping Galvanized: Tanks Single Wall St: Piping Underground: No Underground: Panam Related: Panam Venue:					
<u>Liquid Fuel Tank Details</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Overfill Protection: Owner Account Name: CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS Item: FS LIQUID FUEL TANK					
194	22 of 27	SE/223.5	79.8 / 1.00	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS 114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	FST
Instance No: 11245088 Status: Cont Name: Instance Type: Item: Item Description: FS Liquid Fuel Tank Tank Type: Liquid Fuel Single Wall UST Install Date: 2/11/1994 Install Year: NULL Years in Service: Model: NULL Description: Capacity: 27250 Tank Material: Steel Corrosion Protect: Coating Overfill Protect: Facility Type: FS Liquid Fuel Tank Parent Facility Type: Facility Location: Device Installed Location: 114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA Manufacturer: Serial No: Ulc Standard: Quantity: Unit of Measure: Fuel Type: Gasoline Fuel Type2: NULL Fuel Type3: NULL Piping Steel: Piping Galvanized: Tanks Single Wall St: Piping Underground: No Underground: Panam Related: Panam Venue:					
<u>Liquid Fuel Tank Details</u>					
Overfill Protection: Owner Account Name: CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS Item: FS LIQUID FUEL TANK					
194	23 of 27	SE/223.5	79.8 / 1.00	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS 114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	FST
Instance No: 11469392 Status: Cont Name: Instance Type: Item: Item Description: FS Liquid Fuel Tank Tank Type: Liquid Fuel Single Wall UST Install Date: 10/8/1996 Install Year: 1989 Years in Service: Model: NULL Description: Capacity: 27200 Tank Material: Fiberglass (FRP) Corrosion Protect: Fiberglass Overfill Protect: Facility Type: FS Liquid Fuel Tank Parent Facility Type: Facility Location: Device Installed Location: 114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA Manufacturer: Serial No: Ulc Standard: Quantity: Unit of Measure: Fuel Type: Gasoline Fuel Type2: NULL Fuel Type3: NULL Piping Steel: Piping Galvanized: Tanks Single Wall St: Piping Underground: No Underground: Panam Related: Panam Venue:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Liquid Fuel Tank Details Overfill Protection: Owner Account Name: Item: CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS FS LIQUID FUEL TANK					
194	24 of 27	SE/223.5	79.8 / 1.00	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS 114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	FST
Instance No:		11245025		Manufacturer:	
Status:				Serial No:	
Cont Name:				Ulc Standard:	
Instance Type:				Quantity:	
Item:				Unit of Measure:	
Item Description:		FS Liquid Fuel Tank		Fuel Type: Gasoline	
Tank Type:		Liquid Fuel Single Wall UST		Fuel Type2: NULL	
Install Date:		2/11/1994		Fuel Type3: NULL	
Install Year:		NULL		Piping Steel:	
Years in Service:				Piping Galvanized:	
Model:		NULL		Tanks Single Wall St:	
Description:				Piping Underground:	
Capacity:		36700		No Underground:	
Tank Material:		Steel		Panam Related:	
Corrosion Protect:		Coating		Panam Venue:	
Overfill Protect:					
Facility Type:		FS Liquid Fuel Tank			
Parent Facility Type:					
Facility Location:					
Device Installed Location:		114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA			
Liquid Fuel Tank Details Overfill Protection: Owner Account Name: Item: CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS FS LIQUID FUEL TANK					
194	25 of 27	SE/223.5	79.8 / 1.00	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS 114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	FST
Instance No:		11469374		Manufacturer:	
Status:				Serial No:	
Cont Name:				Ulc Standard:	
Instance Type:				Quantity:	
Item:				Unit of Measure:	
Item Description:		FS Liquid Fuel Tank		Fuel Type: Gasoline	
Tank Type:		Liquid Fuel Single Wall UST		Fuel Type2: NULL	
Install Date:		10/8/1996		Fuel Type3: NULL	
Install Year:		1989		Piping Steel:	
Years in Service:				Piping Galvanized:	
Model:		NULL		Tanks Single Wall St:	
Description:				Piping Underground:	
Capacity:		36300		No Underground:	
Tank Material:		Fiberglass (FRP)		Panam Related:	
Corrosion Protect:		Fiberglass		Panam Venue:	
Overfill Protect:					
Facility Type:		FS Liquid Fuel Tank			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Parent Facility Type: Facility Location: Device Installed Location: 114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA					
<u>Liquid Fuel Tank Details</u>					
Overfill Protection: Owner Account Name: CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS Item: FS LIQUID FUEL TANK					
194	26 of 27	SE/223.5	79.8 / 1.00	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS 114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	FST
Instance No: 11245067 Status: Cont Name: Instance Type: Item: Item Description: FS Liquid Fuel Tank Tank Type: Liquid Fuel Single Wall UST Install Date: 2/11/1994 Install Year: NULL Years in Service: Model: NULL Description: Capacity: 27250 Tank Material: Steel Corrosion Protect: Coating Overfill Protect: Facility Type: FS Liquid Fuel Tank Parent Facility Type: Facility Location: Device Installed Location: 114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA					
Manufacturer: Serial No: Ulc Standard: Quantity: Unit of Measure: Fuel Type: Gasoline Fuel Type2: NULL Fuel Type3: NULL Piping Steel: Piping Galvanized: Tanks Single Wall St: Piping Underground: No Underground: Panam Related: Panam Venue:					
<u>Liquid Fuel Tank Details</u>					
Overfill Protection: Owner Account Name: CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS Item: FS LIQUID FUEL TANK					
194	27 of 27	SE/223.5	79.8 / 1.00	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS 114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA ON	FST
Instance No: 11245048 Status: Cont Name: Instance Type: Item: Item Description: FS Liquid Fuel Tank Tank Type: Liquid Fuel Single Wall UST Install Date: 2/11/1994 Install Year: NULL Years in Service: Model: NULL Description: Capacity: 36700 Tank Material: Steel					
Manufacturer: Serial No: Ulc Standard: Quantity: Unit of Measure: Fuel Type: Gasoline Fuel Type2: NULL Fuel Type3: NULL Piping Steel: Piping Galvanized: Tanks Single Wall St: Piping Underground: No Underground: Panam Related:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Corrosion Protect:	Coating			Panam Venue:	
Overfill Protect:					
Facility Type:		FS Liquid Fuel Tank			
Parent Facility Type:					
Facility Location:					
Device Installed Location:		114 LAKESHORE RD E PORT CREDIT MISSISSAUGA L5G 1E4 ON CA			
<u>Liquid Fuel Tank Details</u>					
Overfill Protection:					
Owner Account Name:		CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS			
Item:		FS LIQUID FUEL TANK			

195	1 of 1	N/223.7	80.8 / 2.00	ON	BORE
Borehole ID:	833852			Inclin FLG:	No
OGF ID:	215585983			SP Status:	Initial Entry
Status:	Decommissioned			Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	15-DEC-1959			Municipality:	
Static Water Level:	1.5			Lot:	
Primary Water Use:				Township:	
Sec. Water Use:				Latitude DD:	43.558433
Total Depth m:	4.9			Longitude DD:	-79.586015
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614203
Drill Method:	Hollow stem auger			Northing:	4823802
Orig Ground Elev m:	84.1			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Within 20 metres
DEM Ground Elev m:	83.5				
Concession:					
Location D:		HWY 10 & CNR (AT PORT CREDIT) * RETAINING WALLS			
Survey D:					
Comments:					

Borehole Geology Stratum

Geology Stratum ID:	6014641			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.5			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Topsoil			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Gravel			Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		Topsoil with sand and gravel **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:	6014644			Mat Consistency:	Dense
Top Depth:	2.4			Material Moisture:	
Bottom Depth:	4.9			Material Texture:	Fine
Material Color:				Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Gravel			Geologic Period:	
Material 4:	Sand			Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:		Pockets of fine sand, dense, glacial till of silty clay with fine gravel **Note: Many records provided by the department have a truncated [Stratum Description] field.			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Geology Stratum ID:	6014643			Mat Consistency:	
Top Depth:	1.8			Material Moisture:	
Bottom Depth:	2.4			Material Texture:	
Material Color:	Brown-Grey			Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	Grey, brown, silty clay with sand **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	6014642			Mat Consistency:	Dense
Top Depth:	.5			Material Moisture:	
Bottom Depth:	1.8			Material Texture:	Fine
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	Medium to dense, fine sand **Note: Many records provided by the department have a truncated [Stratum Description] field.				

196	1 of 1	N/225.3	80.8 / 2.00	ON	BORE
Borehole ID:	649458			Inclin FLG:	No
OGF ID:	215549833			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	DEC-1959			Municipality:	
Static Water Level:	0.2			Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.558437
Total Depth m:	4.9			Longitude DD:	-79.585809
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614220
Drill Method:	Power auger			Northing:	4823803
Orig Ground Elev m:	84.1			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	83.9				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218527039			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.5			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Soil			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	SOIL.				
Geology Stratum ID:	218527040			Mat Consistency:	Dense
Top Depth:	.5			Material Moisture:	
Bottom Depth:	1.8			Material Texture:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material Color:		Sand	Non Geo Mat Type:		
Material 1:			Geologic Formation:		
Material 2:			Geologic Group:		
Material 3:			Geologic Period:		
Material 4:			Depositional Gen:		
Gsc Material Description:					
Stratum Description:		SAND. DENSE, WATER STABLE AT 275.5 FEET.			
Geology Stratum ID:		218527041	Mat Consistency:		Dense
Top Depth:		1.8	Material Moisture:		
Bottom Depth:		2.4	Material Texture:		
Material Color:		Grey	Non Geo Mat Type:		
Material 1:		Clay	Geologic Formation:		
Material 2:		Silt	Geologic Group:		
Material 3:		Sand	Geologic Period:		
Material 4:			Depositional Gen:		
Gsc Material Description:					
Stratum Description:		CLAY,SILT,SAND. GREY,VERY DENSE.			
Geology Stratum ID:		218527042	Mat Consistency:		Dense
Top Depth:		2.4	Material Moisture:		
Bottom Depth:		4.9	Material Texture:		
Material Color:			Non Geo Mat Type:		
Material 1:		Till	Geologic Formation:		
Material 2:		Clay	Geologic Group:		
Material 3:		Silt	Geologic Period:		
Material 4:		Gravel	Depositional Gen:		
Gsc Material Description:					
Stratum Description:		TILL,CLAY,SILT, GRAVEL. VERY DENSE. 019 011 007 0001504000060055000 **Note: Many records provided by the department have a truncated [Stratum Description] field.			
<u>Source</u>					
Source Type:		Data Survey	Source Appl:		Spatial/Tabular
Source Orig:		Geological Survey of Canada	Source Iden:		1
Source Date:		1956-1972	Scale or Res:		Varies
Confidence:		H	Horizontal:		NAD27
Observatio:			Verticalda:		Mean Average Sea Level
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Details:		File: TOR3.txt RecordID: 201170 NTS_Sheet: 30M12A			
Confiden 1:		Logged by professional. Exact and complete description of material and properties.			
<u>Source List</u>					
Source Identifier:		1	Horizontal Datum:		NAD27
Source Type:		Data Survey	Vertical Datum:		Mean Average Sea Level
Source Date:		1956-1972	Projection Name:		Universal Transverse Mercator
Scale or Resolution:		Varies			
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Originators:		Geological Survey of Canada			
197	1 of 8	E/225.5	79.8 / 1.00	F.S. Port Credit Development Limited 1 Hurontario St Mississauga ON L5G 0A3	CA
Certificate #:		2655-795KGE			
Application Year:		2007			
Issue Date:		11/20/2007			
Approval Type:		Municipal and Private Sewage Works			
Status:		Approved			
Application Type:					
Client Name:					
Client Address:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Client City: Client Postal Code: Project Description: Contaminants: Emission Control:					
197	2 of 8	E/225.5	79.8 / 1.00	1 Hurontario Street, Mississauga ON	PINC
Incident Id: 2795608 Incident No: 638900 Incident Reported Dt: Type: FS-Pipeline Incident Status Code: Pipeline Damage Reason Est Tank Status: RC Established Task No: 3433870 Spills Action Centre: 5245-8KDL95 Fuel Type: Natural Gas Fuel Occurrence Tp: Vapour Release Date of Occurrence: 8/3/2011 0:00 Occurrence Start Dt: 2011/08/03 Depth: Customer Acct Name: Incident Address: Operation Type: Commercial (e.g. restaurant, business unit, etc) Pipeline Type: Service / Riser Distribution Pipeline Regulator Type: Service Regulator (up to 60 psi intake) Summary: 1 Hurontario Street, Mississauga - Vapour Release Reported By: Dave Dunstan - Enbridge Affiliation: Industry Stakeholder (Licensee/Registration/Certificate Holder, Facility Owner, etc.) Occurrence Desc: gas leak on 2" pipe Damage Reason: Excavation practices not sufficient Notes: this is a release from service line		Pipe Material: Steel Fuel Category: Natural Gas Health Impact: No Environment Impact: No Property Damage: No Service Interrupt: No Enforce Policy: Yes Public Relation: No Pipeline System: PSIG: 2 Attribute Category: FS-Perform P-line Inc Invest Regulator Location: Outside Method Details: E-mail			
197	3 of 8	E/225.5	79.8 / 1.00	F.S. Port Credit Development Limited 1 Hurontario St Mississauga ON L5G 1E8	ECA
Approval No: 2655-795KGE Approval Date: 2007-11-20 Status: Approved Record Type: ECA Link Source: IDS SWP Area Name: Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS Business Name: F.S. Port Credit Development Limited Address: 1 Hurontario St Full Address: Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/7990-78ZMY5-14.pdf PDF Site Location:		MOE District: City: Longitude: Latitude: Geometry X: Geometry Y:			
197	4 of 8	E/225.5	79.8 / 1.00	Dolce Vita Medical Spa & Salon 1 Hurontario Street Unit 1 Mississauga ON L5G0A3	GEN
Generator No: ON6629503 SIC Code: 446199 SIC Description: ALL OTHER HEALTH AND PERSONAL CARE STORES		Status: Co Admin: Alaa Shamas Choice of Contact: CO_OFFICIAL			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Approval Years: PO Box No: Country:	2016 Canada			Phone No Admin: 9052785550 Ext. Contam. Facility: No MHSW Facility: No	
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:	312 PATHOLOGICAL WASTES				
197	5 of 8	E/225.5	79.8 / 1.00	Dolce Vita Medical Spa & Salon 1 Hurontario Street Unit 1 Mississauga ON L5G0A3	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country:	ON6629503 As of Dec 2018 Canada			Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:	
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:	312 P Pathological wastes				
197	6 of 8	E/225.5	79.8 / 1.00	Thermo Cool Mechanical 1 Hurontario Street Mississauga ON L5G 0A3	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country:	ON8515736 As of Dec 2018 Canada			Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:	
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:	212 L Aliphatic solvents and residues				
197	7 of 8	E/225.5	79.8 / 1.00	Thermo Cool Mechanical 1 Hurontario Street Mississauga ON L5G 0A3	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country:	ON8515736 As of Oct 2019 Canada			Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:	
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:	212 L Aliphatic solvents and residues				
197	8 of 8	E/225.5	79.8 / 1.00	Dolce Vita Medical Spa & Salon 1 Hurontario Street Unit 1	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mississauga ON L5G0A3					
Generator No:	ON6629503			Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:	As of Oct 2019			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:	Canada			MHSW Facility:	
Detail(s)					
Waste Class:	312 P				
Waste Class Desc:	Pathological wastes				
198	1 of 1	NNE/225.7	80.5 / 1.65	GRASS AREA WEST END OF TROY ST Mississauga ON	WWIS
Well ID:	7310446			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	17-Apr-2018 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z266938			Contractor:	6607
Tag:	A224458			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:					
PDF URL (Map):					
Additional Detail(s) (Map)					
Well Completed Date:	2018/02/23				
Year Completed:	2018				
Depth (m):	9.1				
Latitude:	43.5583989367958				
Longitude:	-79.5854706485166				
Path:					
Bore Hole Information					
Bore Hole ID:	1007036951			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614247.00
Code OB Desc:				North83:	4823799.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	23-Feb-2018 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007268448			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		1.5			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007268449			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		1.5			
Formation End Depth:		5.099999904632568			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007268450			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		5.099999904632568			
Formation End Depth:		9.100000381469727			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007268457			
Layer:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007268458			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		5.400000095367432			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1007268456			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1007268447			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1007268453			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:					
Casing Diameter:		5.099999904632568			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1007268454			
Layer:		1			
Slot:		10			
Screen Top Depth:					
Screen End Depth:					
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.400000095367432			
 <u>Water Details</u>					
Water ID:		1007268452			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1007268451			
Diameter:		17.0			
Depth From:		0.0			
Depth To:		9.100000381469727			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:	1007036951			Tag No:	A224458
Depth M:	9.1			Contractor:	6607
Year Completed:	2018			Path:	731\7310446.pdf
Well Completed Dt:	2018/02/23			Latitude:	43.5583989367958
Audit No:	Z266938			Longitude:	-79.5854706485166
199	1 of 1	SE/226.2	79.8 / 1.00	ON	BORE
Borehole ID:	641136			Inclin FLG:	No
OGF ID:	215541531			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.554087
Total Depth m:	4			Longitude DD:	-79.583497
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614415
Drill Method:	Power auger			Northing:	4823323
Orig Ground Elev m:	78.2			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	78.1				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218494905			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.3			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Gravel			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	GRAVEL.				
Geology Stratum ID:	218494906			Mat Consistency:	
Top Depth:	.3			Material Moisture:	
Bottom Depth:	.9			Material Texture:	Medium
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	alluvial

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Gsc Material Description:					
Stratum Description:		SAND-MEDIUM,CLAY. ALLUVIAL,AGE GLACIAL.			
Geology Stratum ID:	218494907			Mat Consistency:	
Top Depth:	.9			Material Moisture:	
Bottom Depth:	2.7			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:		SAND,SILT,CLAY. BROWN,ALLUVIAL,AGE GLACIAL.			
Geology Stratum ID:	218494908			Mat Consistency:	
Top Depth:	2.7			Material Moisture:	
Bottom Depth:	3.2			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:		CLAY. BROWN,ALLUVIAL,AGE GLACIAL.			
Geology Stratum ID:	218494909			Mat Consistency:	
Top Depth:	3.2			Material Moisture:	
Bottom Depth:	4			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:		CLAY. GREY,ALLUVIAL,AGE GLACIAL.			
Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 091020 NTS_Sheet: 30M12A				
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.				
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
200	1 of 1	S/230.9	79.8 / 1.00	ON	BORE
Borehole ID:	639269			Inclin FLG:	No
OGF ID:	215539666			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.553527
Total Depth m:	2.1			Longitude DD:	-79.585553
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614250
Drill Method:	Power auger			Northing:	4823258
Orig Ground Elev m:	78.9			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	78.5				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218487705			Mat Consistency:	
Top Depth:	1.2			Material Moisture:	
Bottom Depth:	1.8			Material Texture:	Medium
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM,SILT, CLAY. GREY,ALLUVIAL, AGE POST-GLACIAL.				
Geology Stratum ID:	218487703			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ASPHALT.				
Geology Stratum ID:	218487706			Mat Consistency:	
Top Depth:	1.8			Material Moisture:	
Bottom Depth:	2.1			Material Texture:	Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM. BROWN,GREY,ALLUVIAL, AGE POST-GLACIAL. 01200 **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	218487704			Mat Consistency:	
Top Depth:	.1			Material Moisture:	
Bottom Depth:	1.2			Material Texture:	Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM,SILT, CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL.				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 072320 NTS_Sheet: 30M12A				
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.				
<u>Source List</u>					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
<u>201</u>	1 of 1	E/231.7	79.8 / 1.00	ON	BORE
Borehole ID:	649444			Inclin FLG:	No
OGF ID:	215549819			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1959			Municipality:	
Static Water Level:	0.3			Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.555691
Total Depth m:	6.2			Longitude DD:	-79.582159
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614520
Drill Method:	Diamond Drill			Northing:	4823503
Orig Ground Elev m:	79.9			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	79.8				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218526997			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	1.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	SAND.				
Geology Stratum ID:	218526998			Mat Consistency:	Dense
Top Depth:	1.1			Material Moisture:	
Bottom Depth:	6.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Clay			Geologic Group:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3: Silt Material 4: Gsc Material Description: Stratum Description: TILL,CLAY,SILT. VERY DENSE, WATER STABLE AT 261.3 FEET. 012 00035065S **Note: Many records provided by the department have a truncated [Stratum Description] field. Geologic Period: Depositional Gen:					
Source Source Type: Data Survey Source Orig: Geological Survey of Canada Source Date: 1956-1972 Confidence: H Observatio: Source Name: Urban Geology Automated Information System (UGAIS) Source Details: File: TOR3.txt RecordID: 201030 NTS_Sheet: 30M12A Confiden 1: Logged by professional. Exact and complete description of material and properties. Source Appl: Spatial/Tabular Source Iden: 1 Scale or Res: Varies Horizontal: NAD27 Verticalda: Mean Average Sea Level					
Source List Source Identifier: 1 Source Type: Data Survey Source Date: 1956-1972 Scale or Resolution: Varies Source Name: Urban Geology Automated Information System (UGAIS) Source Originators: Geological Survey of Canada Horizontal Datum: NAD27 Vertical Datum: Mean Average Sea Level Projection Name: Universal Transverse Mercator					
202	1 of 1	E/232.7	79.8 / 1.00	150 LAKESHORE BLVD. EAST Mississauga ON	WWIS
Well ID: 7155591 Construction Date: Use 1st: Monitoring Use 2nd: Final Well Status: Test Hole Water Type: Casing Material: Audit No: M07281 Tag: A100950 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: MISSISSAUGA CITY (PORT CREDIT) Site Info: Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 08-Dec-2010 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 6607 Form Version: 5 Owner: County: PEEL Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/715\7155591.pdf					
Additional Detail(s) (Map) Well Completed Date: 2010/07/23 Year Completed: 2010 Depth (m): 5.7 Latitude: 43.5565952443951 Longitude: -79.5823309773926 Path: 715\7155591.pdf Bore Hole Information					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bore Hole ID:	1003431946			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614504.00
Code OB Desc:				North83:	4823603.00
Open Hole:	No			Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	23-Jul-2010 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006147374				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	06				
Most Common Material:	SILT				
Mat2:	05				
Mat2 Desc:	CLAY				
Mat3:	11				
Mat3 Desc:	GRAVEL				
Formation Top Depth:	0.0				
Formation End Depth:	3.299999952316284				
Formation End Depth UOM:	m				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006147375				
Layer:	2				
Color:	2				
General Color:	GREY				
Mat1:	06				
Most Common Material:	SILT				
Mat2:	05				
Mat2 Desc:	CLAY				
Mat3:	11				
Mat3 Desc:	GRAVEL				
Formation Top Depth:	3.299999952316284				
Formation End Depth:	5.699999809265137				
Formation End Depth UOM:	m				
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1006147377				
Layer:	1				
Plug From:	0.0				
Plug To:	0.30000001192092896				
Plug Depth UOM:	m				
 <u>Annular Space/Abandonment</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Sealing Record</u>					
Plug ID:		1006147378			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		2.0999999046325684			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006147383			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006147373			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006147379			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		2.5			
Casing Diameter:		5.099999904632568			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Casing</u>					
Casing ID:		1006147380			
Layer:		2			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		2.5			
Depth To:		5.5			
Casing Diameter:		5.099999904632568			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1006147381			
Layer:		1			
Slot:		20			
Screen Top Depth:					
Screen End Depth:					
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.099999904632568			
<u>Hole Diameter</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole ID:		1006147376			
Diameter:					
Depth From:		0.0			
Depth To:		5.5			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Bore Hole Information</u>					
Bore Hole ID:	1006147355			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614510.00
Code OB Desc:				North83:	482361.00
Open Hole:				Org CS:	UTM83
Cluster Kind:	This is a record from cluster log sheet			UTMRC:	3
Date Completed:	23-Jul-2010 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	WWR
Loc Method Desc:					
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006147359			
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:		m			
 <u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1006147358			
Method Construction Code:					
Method Construction:					
Other Method Construction:		BORING			
 <u>Pipe Information</u>					
Pipe ID:		1006147360			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1006147362			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:		1.899999976158142			
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Screen</u>					
Screen ID:		1006147361			
Layer:		1			
Slot:					
Screen Top Depth:		1.899999976158142			
Screen End Depth:		4.900000095367432			
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1006147363			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:					
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1006147357			
Diameter:					
Depth From:					
Depth To:		4.900000095367432			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Bore Hole Information</u>					
Bore Hole ID:	1006147364			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614519.00
Code OB Desc:				North83:	4823619.00
Open Hole:				Org CS:	UTM83
Cluster Kind:	This is a record from cluster log sheet			UTMRC:	3
Date Completed:	10-Jul-2010 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	WWR
Loc Method Desc:					
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		1006147368			
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006147367			
Method Construction Code:					
Method Construction:					
Other Method Construction:		BORING			
<u>Pipe Information</u>					
Pipe ID:		1006147369			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006147371			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:		2.5			
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1006147370			
Layer:		1			
Slot:					
Screen Top Depth:		2.5			
Screen End Depth:		5.5			
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1006147372			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:					
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pumping Duration HR: Pumping Duration MIN: Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1006147366			
Diameter:					
Depth From:					
Depth To:		5.5			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:	1003431946			Tag No:	A100950
Depth M:	5.7			Contractor:	6607
Year Completed:	2010			Path:	715\7155591.pdf
Well Completed Dt:	2010/07/23			Latitude:	43.5565952443951
Audit No:	M07281			Longitude:	-79.5823309773926

203	1 of 1	N/234.8	80.8 / 2.00	ON	WWIS
Well ID: 7388365 Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: Z324806 Tag: A232670 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: MISSISSAUGA CITY (PORT CREDIT) Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Yes Data Src: Date Received: 01-Jun-2021 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 7693 Form Version: 7 Owner: County: PEEL Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					

<u>Bore Hole Information</u>					
Bore Hole ID:	1008669521			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614238.00
Code OB Desc:				North83:	4823810.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	18-May-2021 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Supplier Comment:					
Links					
Bore Hole ID:	1008669521			Tag No:	A232670
Depth M:				Contractor:	7693
Year Completed:	2021			Path:	
Well Completed Dt:	2021/05/18			Latitude:	43.5584993313124
Audit No:	Z324806			Longitude:	-79.5855797304142
204	1 of 2	SSW/234.9	79.8 / 1.00	MISSISSAUGA HYDRO PCB 12 PARK ST. EAST C/O 3355 MAVIS RD. MISSISSAUGA ON L5G 1L5	GEN
Generator No:	ON0124334			Status:	
SIC Code:	0000			Co Admin:	
SIC Description:	*** NOT DEFINED ***			Choice of Contact:	
Approval Years:	90			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
204	2 of 2	SSW/234.9	79.8 / 1.00	MISSISSAUGA HYDRO PCB 00-000 12 PARK ST. EAST C/O 3355 MAVIS RD. MISSISSAUGA ON L5G 1L5	GEN
Generator No:	ON0124334			Status:	
SIC Code:	0000			Co Admin:	
SIC Description:	*** NOT DEFINED ***			Choice of Contact:	
Approval Years:	92,93,94			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
205	1 of 1	WSW/235.0	80.3 / 1.45	1142 Mona Road Mississauga ON	EHS
Order No:	20170501137			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	RSC Report (Urban)			Client Prov/State:	ON
Report Date:	05-MAY-17			Search Radius (km):	.3
Date Received:	01-MAY-17			X:	-79.589328
Previous Site Name:				Y:	43.555052
Lot/Building Size:					
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans				
206	1 of 1	N/237.1	80.8 / 2.00	GRASS AREA WEST ENF OF TROY ST Mississauga ON	WWIS
Well ID:	7310447			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	17-Apr-2018 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z266937			Contractor:	6607
Tag:	A232670			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:				Easting NAD83: Northing NAD83: Zone: UTM Reliability:	
MISSISSAUGA CITY (PORT CREDIT)					
PDF URL (Map):					
Additional Detail(s) (Map)					
Well Completed Date:		2018/02/22			
Year Completed:		2018			
Depth (m):		7.6			
Latitude:		43.5585170279148			
Longitude:		-79.5855545539391			
Path:					
Bore Hole Information					
Bore Hole ID:		1007036954		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				East83:	
Code OB Desc:				North83:	
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	
Date Completed:		22-Feb-2018 00:00:00		UTMRC Desc:	
Remarks:				Location Method:	
Loc Method Desc:		on Water Well Record		wwr	
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
Overburden and Bedrock					
Materials Interval					
Formation ID:		1007268474			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		5.099999904632568			
Formation End Depth:		7.599999904632568			
Formation End Depth UOM:		m			
Overburden and Bedrock					
Materials Interval					
Formation ID:		1007268473			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		05			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Most Common Material:					
Mat2:		CLAY	06		
Mat2 Desc:		SILT	73		
Mat3:		HARD	1.5		
Mat3 Desc:		5.099999904632568			
Formation Top Depth:		m			
Formation End Depth:					
Formation End Depth UOM:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007268472			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		1.5			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007268481			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007268482			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		4.0			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007268480			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007268471			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing ID: 1007268477					
Layer: 1					
Material: 5					
Open Hole or Material: PLASTIC					
Depth From: 0.0					
Depth To: 4.5					
Casing Diameter: 5.099999904632568					
Casing Diameter UOM: cm					
Casing Depth UOM: m					
<u>Construction Record - Screen</u>					
Screen ID: 1007268478					
Layer: 1					
Slot: 10					
Screen Top Depth: 4.5					
Screen End Depth: 7.599999904632568					
Screen Material: 5					
Screen Depth UOM: m					
Screen Diameter UOM: cm					
Screen Diameter: 6.400000095367432					
<u>Water Details</u>					
Water ID: 1007268476					
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM: m					
<u>Hole Diameter</u>					
Hole ID: 1007268475					
Diameter: 2.0999999046325684					
Depth From: 0.0					
Depth To: 7.599999904632568					
Hole Depth UOM: m					
Hole Diameter UOM: cm					
<u>Links</u>					
Bore Hole ID: 1007036954		Tag No: A232670			
Depth M: 7.6		Contractor: 6607			
Year Completed: 2018		Path: 731\7310447.pdf			
Well Completed Dt: 2018/02/22		Latitude: 43.5585170279148			
Audit No: Z266937		Longitude: -79.5855545539391			
207	1 of 3	SSW/237.5	79.8 / 1.00	21 PARK ST E PORT CREDIT ON	WWIS
Well ID: 7278218					
Construction Date:					
Use 1st: Monitoring					
Use 2nd:					
Final Well Status: Observation Wells					
Water Type:					
Casing Material:					
Audit No: Z232728					
Tag: A213503					
Constructn Method:					
Elevation (m):					
Flowing (Y/N):					
Flow Rate:					
Data Entry Status:					
Data Src:					
Date Received: 28-Dec-2016 00:00:00					
Selected Flag: TRUE					
Abandonment Rec:					
Contractor: 7238					
Form Version: 7					
Owner:					
County: PEEL					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:			Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:		
MISSISSAUGA CITY (PORT CREDIT)					
PDF URL (Map):					
Additional Detail(s) (Map)					
Well Completed Date:		2016/12/06			
Year Completed:		2016			
Depth (m):		14.9352			
Latitude:		43.5535192842979			
Longitude:		-79.5869713905599			
Path:					
Bore Hole Information					
Bore Hole ID:		1006322615		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				East83:	
Code OB Desc:				North83:	
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	
Date Completed:		06-Dec-2016 00:00:00		UTMRC Desc:	
Remarks:				Location Method:	
Loc Method Desc:		on Water Well Record		margin of error : 30 m - 100 m	
Elevrc Desc:				wwr	
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
Overburden and Bedrock					
Materials Interval					
Formation ID:		1006534277			
Layer:		1			
Color:					
General Color:					
Mat1:		02			
Most Common Material:		TOPSOIL			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		5.0			
Formation End Depth UOM:		ft			
Overburden and Bedrock					
Materials Interval					
Formation ID:		1006534278			
Laver:		2			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Color:		2			
General Color:		GREY			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:					
Mat2 Desc:					
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		5.0			
Formation End Depth:		15.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006534281			
Layer:		5			
Color:					
General Color:					
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		30.0			
Formation End Depth:		49.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006534280			
Layer:		4			
Color:					
General Color:					
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		20.0			
Formation End Depth:		30.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006534279			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		15.0			
Formation End Depth:		20.0			
Formation End Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006534290			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006534292			
Layer:		3			
Plug From:		37.0			
Plug To:		49.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006534291			
Layer:		2			
Plug From:		1.0			
Plug To:		37.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006534289			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006534276			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006534286			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		39.0			
Casing Diameter:		1.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006534287			
Layer:		1			
Slot:		10			
Screen Top Depth:		39.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen End Depth: 49.0 Screen Material: 5 Screen Depth UOM: ft Screen Diameter UOM: inch Screen Diameter:					
<u>Water Details</u>					
Water ID: 1006534285 Layer: Kind Code: Kind: Water Found Depth: Water Found Depth UOM: ft					
<u>Hole Diameter</u>					
Hole ID: 1006534283 Diameter: 4.5 Depth From: 30.0 Depth To: 35.0 Hole Depth UOM: ft Hole Diameter UOM: inch					
<u>Hole Diameter</u>					
Hole ID: 1006534282 Diameter: 6.25 Depth From: 0.0 Depth To: 30.0 Hole Depth UOM: ft Hole Diameter UOM: inch					
<u>Hole Diameter</u>					
Hole ID: 1006534284 Diameter: 3.5 Depth From: 35.0 Depth To: 49.0 Hole Depth UOM: ft Hole Diameter UOM: inch					
<u>Links</u>					
Bore Hole ID: 1006322615 Depth M: 14.9352 Year Completed: 2016 Well Completed Dt: 2016/12/06 Audit No: Z232728					
Tag No: A213503 Contractor: 7238 Path: 727\7278218.pdf Latitude: 43.5535192842979 Longitude: -79.5869713905599					
207	2 of 3	SSW/237.5	79.8 / 1.00	EDENSHAW PARK DEVELOPMENTS LIMITED 21 Park ST E Mississauga ON L5G 1L7	EASR
Approval No: R-009-9111044549 Status: REGISTERED Date: 2019-02-27 Record Type: EASR Link Source: MOFA Project Type: Water Taking - Construction Dewatering Full Address:					
MOE District: Metro Toronto Municipality: Mississauga Latitude: 43.64027778 Longitude: -79.45416667 Geometry X: Geometry Y:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Approval Type:		EASR-Water Taking - Construction Dewatering			
SWP Area Name:		Toronto			
PDF URL:					
PDF Site Location:					
207	3 of 3	SSW/237.5	79.8 / 1.00	21 Park Street East Port Credit ON	WWIS
Well ID:		7330662		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Not Used		Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:		Abandoned-Other		Date Received:	
Water Type:				11-Feb-2019 00:00:00	
Casing Material:				Selected Flag:	
Audit No:		YFL7EAMT		TRUE	
Tag:		A213503		Abandonment Rec:	
Constructn Method:				Yes	
Elevation (m):				Contractor:	
Elevatn Reliabilty:				7147	
Depth to Bedrock:				Form Version:	
Well Depth:				9	
Overburden/Bedrock:				Owner:	
Pump Rate:				County:	
Static Water Level:				PEEL	
Clear/Cloudy:				Lot:	
Municipality:		MISSISSAUGA CITY (PORT CREDIT)		Concession:	
Site Info:		MW 16-1		Concession Name:	
PDF URL (Map):				Easting NAD83:	
				Northing NAD83:	
				Zone:	
				UTM Reliability:	
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2019/01/18			
Year Completed:		2019			
Depth (m):					
Latitude:		43.5535192842979			
Longitude:		-79.5869713905599			
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:		1007353328		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				17	
Code OB Desc:				East83:	
Open Hole:				614135.00	
Cluster Kind:				North83:	
Date Completed:		18-Jan-2019 00:00:00		4823255.00	
Remarks:				Org CS:	
Loc Method Desc:		on Water Well Record		UTM83	
Elevrc Desc:				UTMRC:	
Location Source Date:				4	
Improvement Location Source:				UTMRC Desc:	
Improvement Location Method:				margin of error : 30 m - 100 m	
Source Revision Comment:				Location Method:	
Supplier Comment:				wwr	
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		1007353718			
Layer:		1			
Color:					
General Color:					
Mat1:					
Most Common Material:					
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:					
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007354045			
Layer:		1			
Plug From:		0.0			
Plug To:		14.899999618530273			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007353959			
Layer:		2			
Plug From:		2.5			
Plug To:		14.899999618530273			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007353958			
Layer:		1			
Plug From:		0.0			
Plug To:		2.5			
Plug Depth UOM:		m			
 <u>Pipe Information</u>					
Pipe ID:		1007353491			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1007353809			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		11.899999618530273			
Casing Diameter:		5.0			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Screen</u>					
Screen ID:		1007353871			
Layer:		1			
Slot:					
Screen Top Depth:		11.899999618530273			
Screen End Depth:		14.899999618530273			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.300000190734863			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007353492			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Water Details</u>					
Water ID:		1007353661			
Layer:		1			
Kind Code:		8			
Kind:		Untested			
Water Found Depth:		6.0			
Water Found Depth UOM:		m			
<u>Links</u>					
Bore Hole ID:	1007353328			Tag No:	A213503
Depth M:				Contractor:	7147
Year Completed:	2019			Path:	
Well Completed Dt:	2019/01/18			Latitude:	43.5535192842979
Audit No:	YFL7EAMT			Longitude:	-79.5869713905599
208	1 of 2	SSW/238.8	79.8 / 1.00	21 PARK ST E PORT CREDIT ON	WWIS
Well ID:	7278220			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	28-Dec-2016 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z232730			Contractor:	7238
Tag:	A213502			Form Version:	7
Constructn Method:				Owner:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:			County: PEEL Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:		
PDF URL (Map):			MISSISSAUGA CITY (PORT CREDIT)		
Additional Detail(s) (Map)					
Well Completed Date:			2016/12/02		
Year Completed:			2016		
Depth (m):			9.144		
Latitude:			43.5534913619022		
Longitude:			-79.5868977619431		
Path:					
Bore Hole Information					
Bore Hole ID:			1006322621		
DP2BR:			Elevation:		
Spatial Status:			Elevrc:		
Code OB:			Zone: 17		
Code OB Desc:			East83: 614141.00		
Open Hole:			North83: 4823252.00		
Cluster Kind:			Org CS: UTM83		
Date Completed:			UTMRC: 4		
Remarks:			UTMRC Desc: margin of error : 30 m - 100 m		
Loc Method Desc:			Location Method: wwr		
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
Overburden and Bedrock					
Materials Interval					
Formation ID:			1006534350		
Layer:			3		
Color:			2		
General Color:			GREY		
Mat1:			05		
Most Common Material:			CLAY		
Mat2:			06		
Mat2 Desc:			SILT		
Mat3:			85		
Mat3 Desc:			SOFT		
Formation Top Depth:			7.5		
Formation End Depth:			15.0		
Formation End Depth UOM:			ft		
Overburden and Bedrock					
Materials Interval					
Formation ID:			1006534352		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		5			
Color:		2			
General Color:		GREY			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		25.0			
Formation End Depth:		30.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006534348			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		02			
Most Common Material:		TOPSOIL			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		2.5			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006534351			
Layer:		4			
Color:		2			
General Color:		GREY			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		15.0			
Formation End Depth:		25.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006534349			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		2.5			
Formation End Depth:		7.5			
Formation End Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006534361			
Layer:		3			
Plug From:		8.0			
Plug To:		21.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006534359			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006534362			
Layer:		4			
Plug From:		21.0			
Plug To:		30.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006534360			
Layer:		2			
Plug From:		1.0			
Plug To:		8.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006534358			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006534347			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006534355			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		10.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Diameter: 2.0 Casing Diameter UOM: inch Casing Depth UOM: ft					
<u>Construction Record - Screen</u>					
Screen ID: 1006534356 Layer: 1 Slot: 10 Screen Top Depth: 10.0 Screen End Depth: 20.0 Screen Material: 5 Screen Depth UOM: ft Screen Diameter UOM: inch Screen Diameter:					
<u>Water Details</u>					
Water ID: 1006534354 Layer: Kind Code: Kind: Water Found Depth: Water Found Depth UOM: ft					
<u>Hole Diameter</u>					
Hole ID: 1006534353 Diameter: 6.25 Depth From: 0.0 Depth To: 30.0 Hole Depth UOM: ft Hole Diameter UOM: inch					
<u>Links</u>					
Bore Hole ID: 1006322621 Depth M: 9.144 Year Completed: 2016 Well Completed Dt: 2016/12/02 Audit No: Z232730 Tag No: A213502 Contractor: 7238 Path: 727\7278220.pdf Latitude: 43.5534913619022 Longitude: -79.5868977619431					
208	2 of 2	SSW/238.8	79.8 / 1.00	21 Park Street East Port Credit ON	WWIS
Well ID: 7330661 Construction Date: Use 1st: Not Used Use 2nd: Final Well Status: Abandoned-Other Water Type: Casing Material: Audit No: 86LCVVW2 Tag: A213502 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 11-Feb-2019 00:00:00 Selected Flag: TRUE Abandonment Rec: Yes Contractor: 7147 Form Version: 9 Owner: County: PEEL Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY (PORT CREDIT)			
Site Info:		MW 16-2			
PDF URL (Map):					
 <u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2019/01/18			
Year Completed:		2019			
Depth (m):					
Latitude:		43.5534913619022			
Longitude:		-79.5868977619431			
Path:					
 <u>Bore Hole Information</u>					
Bore Hole ID:	1007353325			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614141.00
Code OB Desc:				North83:	4823252.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	18-Jan-2019 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007353717				
Layer:	1				
Color:					
General Color:					
Mat1:					
Most Common Material:					
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:					
Formation End Depth UOM:	m				
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1007353957				
Layer:	1				
Plug From:	0.0				
Plug To:	6.099999904632568				
Plug Depth UOM:	m				
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		1007354044			
Layer:		1			
Plug From:		0.0			
Plug To:		6.099999904632568			
Plug Depth UOM:		m			
<u>Pipe Information</u>					
Pipe ID:		1007353489			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007353808			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.0999999046325684			
Casing Diameter:		5.0			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007353870			
Layer:		1			
Slot:					
Screen Top Depth:		3.0999999046325684			
Screen End Depth:		6.099999904632568			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.300000190734863			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007353490			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Links</u>					
Bore Hole ID:	1007353325			Tag No:	A213502
Depth M:				Contractor:	7147

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Year Completed:	2019			Path:	
Well Completed Dt:	2019/01/18			Latitude:	43.5534913619022
Audit No:	86LCVVW2			Longitude:	-79.5868977619431

[209](#) 1 of 1 WSW/239.3 78.4 / -0.48 ON [BORE](#)

Borehole ID:	833869	Inclin FLG:	No
OGF ID:	215586000	SP Status:	Initial Entry
Status:	Decommissioned	Surv Elev:	No
Type:	Borehole	Piezometer:	No
Use:	Geotechnical/Geological Investigation	Primary Name:	
Completion Date:	18-DEC-1959	Municipality:	
Static Water Level:	1.5	Lot:	
Primary Water Use:		Township:	
Sec. Water Use:		Latitude DD:	43.55468
Total Depth m:	3.7	Longitude DD:	-79.589111
Depth Ref:	Ground Surface	UTM Zone:	17
Depth Elev:		Easting:	613960
Drill Method:	Hollow stem auger	Northing:	4823381
Orig Ground Elev m:	79.6	Location Accuracy:	
Elev Reliabil Note:		Accuracy:	Within 10 metres
DEM Ground Elev m:	78.2		
Concession:			
Location D:	CNR AT PORT CREDIT * CREEK DIVERSION		
Survey D:			
Comments:			

Borehole Geology Stratum

Geology Stratum ID:	6014701	Mat Consistency:	
Top Depth:	.3	Material Moisture:	
Bottom Depth:	3	Material Texture:	Fine to Medium
Material Color:	Grey-Brown	Non Geo Mat Type:	
Material 1:	Sand	Geologic Formation:	
Material 2:		Geologic Group:	
Material 3:		Geologic Period:	
Material 4:		Depositional Gen:	
Gsc Material Description:			
Stratum Description:	Medium grey, brown, fine to medium sand **Note: Many records provided by the department have a truncated [Stratum Description] field.		

Geology Stratum ID:	6014700	Mat Consistency:	
Top Depth:	0	Material Moisture:	
Bottom Depth:	.3	Material Texture:	
Material Color:		Non Geo Mat Type:	
Material 1:	Topsoil	Geologic Formation:	
Material 2:		Geologic Group:	
Material 3:		Geologic Period:	
Material 4:		Depositional Gen:	
Gsc Material Description:			
Stratum Description:	Topsoil **Note: Many records provided by the department have a truncated [Stratum Description] field.		

Geology Stratum ID:	6014702	Mat Consistency:	
Top Depth:	3	Material Moisture:	
Bottom Depth:	3.7	Material Texture:	Fine
Material Color:	Grey	Non Geo Mat Type:	
Material 1:	Till	Geologic Formation:	
Material 2:	Clay	Geologic Group:	
Material 3:	Gravel	Geologic Period:	
Material 4:	Silt	Depositional Gen:	glacial
Gsc Material Description:			
Stratum Description:	Glacial till (grey, silty clay with fine gravel) **Note: Many records provided by the department have a truncated [Stratum Description] field.		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
210	1 of 1	SSE/239.9	79.8 / 1.00	ON	BORE
Borehole ID: 640909 OGF ID: 215541304 Status: Type: Borehole Use: Geotechnical/Geological Investigation Completion Date: JAN-1965 Static Water Level: Primary Water Use: Not Used Sec. Water Use: Total Depth m: 2.1 Depth Ref: Ground Surface Depth Elev: Drill Method: Power auger Orig Ground Elev m: 79.3 Elev Reliabil Note: DEM Ground Elev m: 78.7 Concession: Location D: Survey D: Comments: Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD: 43.553565 Longitude DD: -79.584995 UTM Zone: 17 Easting: 614295 Northing: 4823263 Location Accuracy: Accuracy: Not Applicable					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: 218494028 Top Depth: .2 Bottom Depth: 2.1 Material Color: Brown Material 1: Sand Material 2: Clay Material 3: Silt Material 4: Gsc Material Description: Stratum Description: SAND,CLAY,SILT. GREY,BROWN,ALLUVIAL,WET, AGE POST-GLACIAL. Mat Consistency: Material Moisture: Wet Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen: alluvial					
Geology Stratum ID: 218494027 Top Depth: 0 Bottom Depth: .2 Material Color: Material 1: Fill Material 2: Gravel Material 3: Material 4: Gsc Material Description: Stratum Description: FILL,GRAVEL. Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen: fill					
Geology Stratum ID: 218494026 Top Depth: 0 Bottom Depth: 0 Material Color: Material 1: Asphalt Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description: ASPHALT. Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	Geological Survey of Canada 1956-1972 M			Source Iden: Scale or Res: Horizontal: Verticalda:	1 Varies NAD27 Mean Average Sea Level
		Urban Geology Automated Information System (UGAIS) File: TOR1B.txt RecordID: 088750 NTS_Sheet: 30M12A Logs are approximately correct. Lack of information. Doubtful terminology.			
Source List					
Source Identifier: Source Type: Source Date: Scale or Resolution: Source Name: Source Originators:	1 Data Survey 1956-1972 Varies Urban Geology Automated Information System (UGAIS) Geological Survey of Canada			Horizontal Datum: Vertical Datum: Projection Name:	NAD27 Mean Average Sea Level Universal Transverse Mercator
211	1 of 1	N/240.8	80.8 / 2.00	HURONTARIO ST Mississauga ON	WWIS
Well ID: Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: Tag: Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:	7284674 Monitoring Observation Wells Z248219 A217853 MISSISSAUGA CITY (PORT CREDIT)			Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: Selected Flag: Abandonment Rec: Contractor: Form Version: Owner: County: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	07-Apr-2017 00:00:00 TRUE 6607 7 PEEL
PDF URL (Map):					
Additional Detail(s) (Map)					
Well Completed Date: Year Completed: Depth (m): Latitude: Longitude: Path:	2017/03/29 2017 7.6 43.558573059251 -79.5864446916209				
Bore Hole Information					
Bore Hole ID: DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed:	1006383141			Elevation: Elevrc: Zone: East83: North83: Org CS: UTMRC: UTMRC Desc:	17 614168.00 4823817.00 UTM83 4 margin of error : 30 m - 100 m

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Remarks:		Location Method:			www
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006636301			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		01			
Mat2 Desc:		FILL			
Mat3:		79			
Mat3 Desc:		PACKED			
Formation Top Depth:		0.0			
Formation End Depth:		1.5			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006636302			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		34			
Mat2 Desc:		TILL			
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:		1.5			
Formation End Depth:		3.0			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006636304			
Layer:		4			
Color:		2			
General Color:		GREY			
Mat1:		28			
Most Common Material:		SAND			
Mat2:					
Mat2 Desc:					
Mat3:		77			
Mat3 Desc:		LOOSE			
Formation Top Depth:		5.699999809265137			
Formation End Depth:		7.599999904632568			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		1006636303			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		34			
Mat2 Desc:		TILL			
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:		3.0			
Formation End Depth:		5.699999809265137			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006636311			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006636312			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		5.699999809265137			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1006636310			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1006636300			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1006636307			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.10000000149011612			
Depth To:		6.0			
Casing Diameter:		5.099999904632568			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen ID: 1006636308					
Layer: 1					
Slot: 10					
Screen Top Depth: 6.0					
Screen End Depth: 7.599999904632568					
Screen Material: 5					
Screen Depth UOM: m					
Screen Diameter UOM: cm					
Screen Diameter: 6.400000095367432					
Water Details					
Water ID: 1006636306					
Layer: 1					
Kind Code: 8					
Kind: Untested					
Water Found Depth: 5.699999809265137					
Water Found Depth UOM: m					
Hole Diameter					
Hole ID: 1006636305					
Diameter: 21.0					
Depth From: 0.0					
Depth To: 7.599999904632568					
Hole Depth UOM: m					
Hole Diameter UOM: cm					
Links					
Bore Hole ID:	1006383141			Tag No:	A217853
Depth M:	7.6			Contractor:	6607
Year Completed:	2017			Path:	
Well Completed Dt:	2017/03/29			Latitude:	43.558573059251
Audit No:	Z248219			Longitude:	-79.5864446916209
212	1 of 1	SSW/241.5	79.8 / 1.00	21 Park Street East Port Credit ON	WWIS
Well ID:	7330663			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Not Used			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	09-Apr-2019 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	ODT55IAQ			Contractor:	7147
Tag:	A223407			Form Version:	9
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:	MW 17-1				
PDF URL (Map):					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2019/01/18				
Year Completed:	2019				
Depth (m):					
Latitude:	43.5535401938583				
Longitude:	-79.5872061257248				
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1007353331			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614116.00
Code OB Desc:				North83:	4823257.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	18-Jan-2019 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007353719				
Layer:	1				
Color:					
General Color:					
Mat1:					
Most Common Material:					
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:					
Formation End Depth UOM:	m				
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1007353960				
Layer:	1				
Plug From:	0.0				
Plug To:	2.5				
Plug Depth UOM:	m				
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1007353961				
Layer:	2				
Plug From:	2.5				
Plug To:	6.699999809265137				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007354046			
Layer:		1			
Plug From:		0.0			
Plug To:		6.699999809265137			
Plug Depth UOM:		m			
<u>Pipe Information</u>					
Pipe ID:		1007353493			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007353810			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.5999999046325684			
Casing Diameter:		5.0			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007353872			
Layer:		1			
Slot:					
Screen Top Depth:		3.5999999046325684			
Screen End Depth:		6.699999809265137			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.300000190734863			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007353494			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Links</u>					
Bore Hole ID:	1007353331			Tag No:	A223407
Depth M:				Contractor:	7147
Year Completed:	2019			Path:	
Well Completed Dt:	2019/01/18			Latitude:	43.5535401938583
Audit No:	ODT55IAQ			Longitude:	-79.5872061257248
213	1 of 1	S/243.0	79.8 / 1.00	ON	BORE
Borehole ID:	639270			Inclin FLG:	No
OGF ID:	215539667			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.553394
Total Depth m:	2.7			Longitude DD:	-79.585741
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614235
Drill Method:	Power auger			Northing:	4823243
Orig Ground Elev m:	80.3			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	79.6				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218487709			Mat Consistency:	
Top Depth:	1.2			Material Moisture:	
Bottom Depth:	2.7			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND,SILT,CLAY. GREY,ALLUVIAL,AGE GLACIAL. A **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	218487707			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Stones			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL,STONES.				
Geology Stratum ID:	218487708			Mat Consistency:	
Top Depth:	.1			Material Moisture:	
Bottom Depth:	1.2			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	

420 erisinfo.com | Environmental Risk Information Services Order No: 22091501030

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bore Hole ID: DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: Remarks: Loc Method Desc: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:	1003495961			Elevation: Elevrc: Zone: East83: North83: Org CS: UTMRC: UTMRC Desc: Location Method:	17 614516.00 4823601.00 UTM83 3 margin of error : 10 - 30 m wwr

Links

Bore Hole ID: Depth M: Year Completed: Well Completed Dt: Audit No:	1003495961 2011 2011/02/14 M08435	Tag No: Contractor: Path: Latitude: Longitude:	A100950 6607 716\7161795.pdf 43.5565753993608 -79.5821828728807

215	1 of 1	NNW/243.3	80.8 / 2.00	ORIOLE AVE Mississauga ON	WWIS
Well ID:	7286063			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	08-May-2017 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z248287			Contractor:	6607
Tag:	A217831			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:					

PDF URL (Map):

Additional Detail(s) (Map)

Well Completed Date: Year Completed: Depth (m): Latitude: Longitude: Path:	2017/04/05 2017 15 43.5585504931349 -79.5868042748357

Bore Hole Information

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bore Hole ID:	1006429573			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614139.00
Code OB Desc:				North83:	4823814.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	05-Apr-2017 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006658582				
Layer:	4				
Color:	2				
General Color:	GREY				
Mat1:	17				
Most Common Material:	SHALE				
Mat2:	15				
Mat2 Desc:	LIMESTONE				
Mat3:	74				
Mat3 Desc:	LAYERED				
Formation Top Depth:	12.0				
Formation End Depth:	15.0				
Formation End Depth UOM:	m				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006658579				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	28				
Most Common Material:	SAND				
Mat2:	11				
Mat2 Desc:	GRAVEL				
Mat3:	01				
Mat3 Desc:	FILL				
Formation Top Depth:	0.0				
Formation End Depth:	1.600000023841858				
Formation End Depth UOM:	m				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006658580				
Layer:	2				
Color:	2				
General Color:	GREY				
Mat1:	06				
Most Common Material:	SILT				
Mat2:	05				
Mat2 Desc:	CLAY				
Mat3:	66				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat3 Desc:		DENSE			
Formation Top Depth:		1.600000023841858			
Formation End Depth:		6.900000095367432			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006658581			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		77			
Mat3 Desc:		LOOSE			
Formation Top Depth:		6.900000095367432			
Formation End Depth:		12.0			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006658590			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006658591			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		11.5			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1006658589			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:		DIAMOND			
 <u>Pipe Information</u>					
Pipe ID:		1006658578			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1006658586			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth From:		0.10000000149011612			
Depth To:		12.0			
Casing Diameter:		5.099999904632568			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1006658587			
Layer:		1			
Slot:		10			
Screen Top Depth:		12.0			
Screen End Depth:		15.0			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.400000095367432			
 <u>Water Details</u>					
Water ID:		1006658585			
Layer:		1			
Kind Code:		8			
Kind:		Untested			
Water Found Depth:		6.0			
Water Found Depth UOM:		m			
 <u>Hole Diameter</u>					
Hole ID:		1006658584			
Diameter:		9.600000381469727			
Depth From:		12.0			
Depth To:		15.0			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Hole Diameter</u>					
Hole ID:		1006658583			
Diameter:		21.0			
Depth From:		0.0			
Depth To:		12.0			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Links</u>					
Bore Hole ID:	1006429573			Tag No:	A217831
Depth M:	15			Contractor:	6607
Year Completed:	2017			Path:	
Well Completed Dt:	2017/04/05			Latitude:	43.5585504931349
Audit No:	Z248287			Longitude:	-79.5868042748357
216	1 of 1	NNE/243.5	80.8 / 2.00	32 TROY ST. MISSISSAUGA ON	WWIS
Well ID:	7308370			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	26-Mar-2018 00:00:00

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water Type:			Selected Flag:		TRUE
Casing Material:			Abandonment Rec:		
Audit No:	Z255645	Contractor:		6607	
Tag:	A241294	Form Version:		7	
Constructn Method:			Owner:		
Elevation (m):			County:		PEEL
Elevatn Reliabilty:			Lot:		
Depth to Bedrock:			Concession:		
Well Depth:			Concession Name:		
Overburden/Bedrock:			Easting NAD83:		
Pump Rate:			Northing NAD83:		
Static Water Level:			Zone:		
Clear/Cloudy:			UTM Reliability:		
Municipality:			MISSISSAUGA CITY (PORT CREDIT)		
Site Info:					
PDF URL (Map):			https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/730\7308370.pdf		
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:			2017/12/20		
Year Completed:			2017		
Depth (m):			10.9		
Latitude:			43.5584372033748		
Longitude:			-79.5849249802189		
Path:			730\7308370.pdf		
<u>Bore Hole Information</u>					
Bore Hole ID:			1007008214		
DP2BR:			Elevation:		
Spatial Status:			Elevrc:		
Code OB:			Zone:		
Code OB Desc:			17		
Open Hole:			East83:		
Cluster Kind:			614291.00		
Date Completed:			North83:		
20-Dec-2017 00:00:00			4823804.00		
Remarks:			Org CS:		
Loc Method Desc:			UTM83		
on Water Well Record			UTMRC:		
Elevrc Desc:			4		
Location Source Date:			UTMRC Desc:		
Improvement Location Source:			margin of error : 30 m - 100 m		
Improvement Location Method:			Location Method:		
Source Revision Comment:			wwr		
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:			1007232697		
Layer:			3		
Color:			2		
General Color:			GREY		
Mat1:			28		
Most Common Material:			SAND		
Mat2:			28		
Mat2 Desc:			SAND		
Mat3:			66		
Mat3 Desc:			DENSE		
Formation Top Depth:			6.0		
Formation End Depth:			10.899999618530273		
Formation End Depth UOM:			m		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007232696			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		05			
Mat2 Desc:		CLAY			
Mat3:		12			
Mat3 Desc:		STONES			
Formation Top Depth:		1.5			
Formation End Depth:		6.0			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007232695			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		1.5			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007232705			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		7.0			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007232704			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007232703			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pipe ID: 1007232694 Casing No: 0 Comment: Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID: 1007232700 Layer: 1 Material: 5 Open Hole or Material: PLASTIC Depth From: 0.0 Depth To: 7.900000095367432 Casing Diameter: 5.099999904632568 Casing Diameter UOM: cm Casing Depth UOM: m					
<u>Construction Record - Screen</u>					
Screen ID: 1007232701 Layer: 1 Slot: 10 Screen Top Depth: 7.900000095367432 Screen End Depth: 10.899999618530273 Screen Material: 5 Screen Depth UOM: m Screen Diameter UOM: cm Screen Diameter: 6.400000095367432					
<u>Water Details</u>					
Water ID: 1007232699 Layer: 1 Kind Code: 8 Kind: Untested Water Found Depth: 6.300000190734863 Water Found Depth UOM: m					
<u>Hole Diameter</u>					
Hole ID: 1007232698 Diameter: 21.0 Depth From: 0.0 Depth To: 10.899999618530273 Hole Depth UOM: m Hole Diameter UOM: cm					
<u>Links</u>					
Bore Hole ID: 1007008214 Depth M: 10.9 Year Completed: 2017 Well Completed Dt: 2017/12/20 Audit No: Z255645					
Tag No: A241294 Contractor: 6607 Path: 730\7308370.pdf Latitude: 43.5584372033748 Longitude: -79.5849249802189					
217	1 of 1	SSE/243.9	79.8 / 1.00	ON	BORE
Borehole ID: 646198 OGF ID: 215546581					
Inclin FLG: No SP Status: Initial Entry					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status:			Surv Elev:	No	
Type:	Borehole		Piezometer:	No	
Use:	Geotechnical/Geological Investigation		Primary Name:		
Completion Date:	MAY-1968		Municipality:		
Static Water Level:			Lot:		
Primary Water Use:	Not Used		Township:		
Sec. Water Use:			Latitude DD:	43.553477	
Total Depth m:	-999		Longitude DD:	-79.585182	
Depth Ref:	Ground Surface		UTM Zone:	17	
Depth Elev:			Easting:	614280	
Drill Method:	Power auger		Northing:	4823253	
Orig Ground Elev m:	78.4		Location Accuracy:		
Elev Reliabil Note:			Accuracy:	Not Applicable	
DEM Ground Elev m:	79.1				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218513995		Mat Consistency:	Dense	
Top Depth:	0		Material Moisture:		
Bottom Depth:			Material Texture:		
Material Color:	Brown		Non Geo Mat Type:		
Material 1:	Sand		Geologic Formation:		
Material 2:	Silt		Geologic Group:		
Material 3:	Clay		Geologic Period:		
Material 4:			Depositional Gen:	glacial	
Gsc Material Description:					
Stratum Description:	SAND,SILT,CLAY. BROWN,GREY,GLACIAL,DENSE, AGE GLACIAL. 014 00000025 **Note: Many records provided by the department have a truncated [Stratum Description] field.				
<u>Source</u>					
Source Type:	Data Survey		Source Appl:	Spatial/Tabular	
Source Orig:	Geological Survey of Canada		Source Iden:	1	
Source Date:	1956-1972		Scale or Res:	Varies	
Confidence:	M		Horizontal:	NAD27	
Observatio:			Verticalda:	Mean Average Sea Level	
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR2.txt RecordID: 142200 NTS_Sheet: 30M12A				
Confiden 1:	Reliable information but incomplete.				
<u>Source List</u>					
Source Identifier:	1		Horizontal Datum:	NAD27	
Source Type:	Data Survey		Vertical Datum:	Mean Average Sea Level	
Source Date:	1956-1972		Projection Name:	Universal Transverse Mercator	
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				

218

1 of 1

SSW/244.6

79.8 / 1.00

ON

WWIS

Well ID: 7296325
Construction Date:
Use 1st:
Use 2nd:
Final Well Status:
Water Type:

Flowing (Y/N):
Flow Rate:
Data Entry Status: Yes
Data Src:
Date Received: 03-Oct-2017 00:00:00
Selected Flag: TRUE

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Material: Audit No: C38357 Tag: A223407 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: MISSISSAUGA CITY (PORT CREDIT) Site Info: Abandonment Rec: Contractor: 7147 Form Version: 8 Owner: County: PEEL Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map):					
Additional Detail(s) (Map)					
Well Completed Date: Year Completed: Depth (m): Latitude: 43.5535321101623 Longitude: -79.5872805957956 Path:					
Bore Hole Information					
Bore Hole ID: 1006747711 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: Remarks: Loc Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment: Elevation: Elevrc: Zone: 17 East83: 614110.00 North83: 4823256.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwwr					
Links					
Bore Hole ID: 1006747711 Depth M: Year Completed: Well Completed Dt: Audit No: C38357 Tag No: A223407 Contractor: 7147 Path: Latitude: 43.5535321101623 Longitude: -79.5872805957956					
219	1 of 1	SE/244.6	79.8 / 1.00	CASPIAN CUSTOM CANVAS INC. 106 LAKESHORE RD E SUITE 104 MISSISSAUGA ON L5G 1E3	SCT
Established: 1988 Plant Size (ft²): 0 Employment: 5					
--Details--					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Description:		CANVAS AND RELATED PRODUCTS			
SIC/NAICS Code:		2394			
Description:		MANUFACTURING INDUSTRIES, NOT ELSEWHERE CLASSIFIED			
SIC/NAICS Code:		3999			
Description:		Textile Bag and Canvas Mills			
SIC/NAICS Code:		314910			
Description:		Commercial Screen Printing			
SIC/NAICS Code:		323113			
Description:		Digital Printing			
SIC/NAICS Code:		323115			
Description:		Sign Manufacturing			
SIC/NAICS Code:		339950			
Description:		All Other Miscellaneous Manufacturing			
SIC/NAICS Code:		339990			
220	1 of 1	ESE/244.6	79.7 / 0.82	ON	BORE
Borehole ID:		646202	Inclin FLG:		No
OGF ID:		215546585	SP Status:		Initial Entry
Status:			Surv Elev:		No
Type:		Borehole	Piezometer:		No
Use:		Geotechnical/Geological Investigation	Primary Name:		
Completion Date:		JUL-1967	Municipality:		
Static Water Level:			Lot:		
Primary Water Use:		Not Used	Township:		
Sec. Water Use:			Latitude DD:		43.554972
Total Depth m:		7.8	Longitude DD:		-79.582238
Depth Ref:		Ground Surface	UTM Zone:		17
Depth Elev:			Easting:		614515
Drill Method:		Power auger	Northing:		4823423
Orig Ground Elev m:		79.3	Location Accuracy:		
Elev Reliabil Note:			Accuracy:		Not Applicable
DEM Ground Elev m:		78.1			
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:		218514008	Mat Consistency:		
Top Depth:		.1	Material Moisture:		
Bottom Depth:		.5	Material Texture:		
Material Color:			Non Geo Mat Type:		
Material 1:		Fill	Geologic Formation:		
Material 2:		Sand	Geologic Group:		
Material 3:		Gravel	Geologic Period:		
Material 4:			Depositional Gen:		fill
Gsc Material Description:					
Stratum Description:		FILL,SAND,GRAVEL.			
Geology Stratum ID:		218514009	Mat Consistency:		Hard
Top Depth:		.5	Material Moisture:		
Bottom Depth:		2.6	Material Texture:		
Material Color:		Brown	Non Geo Mat Type:		
Material 1:		Till	Geologic Formation:		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	Silt Clay			Geologic Group: Geologic Period: Depositional Gen:	glacial
		TILL,SILT,CLAY. BROWN,GLACIAL,HARD, AGE GLACIAL.			
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218514007 0 .1 Asphalt			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	
		ASPHALT.			
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218514010 2.6 7.8 Grey Till Silt Sand			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Dense glacial
		TILL,SILT,SAND. GREY,GLACIAL,DENSE, AGE GLACIAL.			
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218514011 7.8 7.8 Bedrock Shale			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	 Ordovician marine
		BEDROCK,SHALE. MARINE,AGE ORDOVICIAN. 023 009 0001503700085068 **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Source					
Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	Data Survey Geological Survey of Canada 1956-1972 M Urban Geology Automated Information System (UGAIS) File: TOR2.txt RecordID: 142240 NTS_Sheet: 30M12A Reliable information but incomplete.			Source Appl: Source Iden: Scale or Res: Horizontal: Verticalda:	Spatial/Tabular 1 Varies NAD27 Mean Average Sea Level
Source List					
Source Identifier: Source Type: Source Date: Scale or Resolution: Source Name: Source Originators:	1 Data Survey 1956-1972 Varies Urban Geology Automated Information System (UGAIS) Geological Survey of Canada			Horizontal Datum: Vertical Datum: Projection Name:	NAD27 Mean Average Sea Level Universal Transverse Mercator
221	1 of 2	ENE/247.5	79.8 / 1.00	Greenspoon Specialty Contracting Ltd.; 20 Rosewood Avenue construction site<UNOFFICIAL>	SPL

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
				Mississauga ON	
Ref No:	2855-86JJTA			Discharger Report:	
Site No:				Material Group:	
Incident Dt:				Health/Env Conseq:	
Year:				Client Type:	
Incident Cause:	Tank (Underground) Leak			Sector Type:	
Incident Event:				Agency Involved:	
Contaminant Code:	41			Nearest Watercourse:	
Contaminant Name:	DIESEL FUEL AND WATER MIXTURE			Site Address:	
Contaminant Limit 1:				Site District Office:	
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:				Site Region:	
Environment Impact:	Confirmed			Site Municipality:	
Nature of Impact:	Soil Contamination			Site Lot:	
Receiving Medium:				Site Conc:	
Receiving Env:				Northing:	
MOE Response:				Easting:	
Dt MOE Arvl on Scn:				Site Geo Ref Accu:	
MOE Reported Dt:	6/18/2010			Site Map Datum:	
Dt Document Closed:				SAC Action Class:	Land Spills
Incident Reason:	Equipment/Vehicles			Source Type:	
Site Name:	construction site<UNOFFICIAL>				
Site County/District:					
Site Geo Ref Meth:					
Incident Summary:	Greenspoon Specialty: UST 500 L diesel & water to ground				
Contaminant Qty:	500 L				
221	2 of 2	ENE/247.5	79.8 / 1.00	20 Rosewood Avenue, Mississauga ON	INC
Incident No:	410004			Any Health Impact:	Unknown
Incident ID:	2561688			Any Enviro Impact:	Yes
Instance No:				Service Interrupted:	No
Status Code:	Causal Analysis Complete			Was Prop Damaged:	No
Attribute Category:	FS-Perform L1 Incident Insp			Reside App. Type:	
Context:				Commer App. Type:	
Date of Occurrence:	2010/06/18 00:00:00			Indus App. Type:	
Time of Occurrence:	09:30:00			Institut App. Type:	
Incident Created On:				Venting Type:	
Instance Creation Dt:				Vent Conn Mater:	
Instance Install Dt:				Vent Chimney Mater:	
Occur Insp Start Date:	2010/06/18 00:00:00			Pipeline Type:	
Approx Quant Rel:	unknown			Pipeline Involved:	
Tank Capacity:				Pipe Material:	
Fuels Occur Type:	Discovery of a Petroleum Product			Depth Ground Cover:	
Fuel Type Involved:	Fuel Oil			Regulator Location:	
Enforcement Policy:	NULL			Regulator Type:	
Prc Escalation Req:	NULL			Operation Pressure:	
Tank Material Type:				Liquid Prop Make:	
Tank Storage Type:				Liquid Prop Model:	
Tank Location Type:				Liquid Prop Serial No:	
Pump Flow Rate Cap:				Liquid Prop Notes:	
Task No:	2942614			Equipment Type:	
Notes:				Equipment Model:	
Drainage System:	Unknown			Serial No:	
Sub Surface Contam.:	20 to 30 feet maybe more			Cylinder Capacity:	
Aff Prop Use Water:	Unknown			Cylinder Cap Units:	
Contam. Migrated:	Unknown			Cylinder Mat Type:	
Contact Natural Env:	Yes			Near Body of Water:	No
Incident Location:	20 Rosewood Avenue, Mississauga - Discovery of Product				
Occurrence Narrative:	UST hit by backhoe				
Operation Type Involved:	Construction Site (excluding pipeline strike)				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Item: Item Description: Device Installed Location:					
222	1 of 2	SE/248.3	79.8 / 1.00	PHOTOLINE LABS LTD. 31-649 110 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E3	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country:		ON1532001 6571 CAMERA/PHOTO. SUPPLY 92,93,94,95,96,97,98	Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:		
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:		264 PHOTOPROCESSING WASTES			
222	2 of 2	SE/248.3	79.8 / 1.00	PHOTOLINE LABS LTD. 110 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E3	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country:		ON1532001 6571 CAMERA/PHOTO. SUPPLY 99,00,01	Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:		
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:		264 PHOTOPROCESSING WASTES			

Unplottable Summary

Total: 14 Unplottable sites

DB	Company Name/Site Name	Address	City	Postal
CA		Lakeshore Road East	Mississauga ON	
CA	R.M. OF PEEL	LTS.2&3,RANGE 1/ROSEWOOD AVE.	MISSISSAUGA ON	
CA	Lakeshore Road East, Helen Street, Port Street, and St. Lawrence Drive	Lakeshore Road East	Mississauga ON	
CA		Lakeshore Road East, Helen Street, Port Street, and St. Lawrence Drive	Mississauga ON	
CA	R.M. OF PEEL	LTS.2&3/RANGE 1/ROSEWOOD AVE.	MISSISSAUGA ON	
CA	R.M. OF PEEL	TROY ST./EAGLEWOOD BLVD.	MISSISSAUGA CITY ON	
CA	R.M. OF PEEL	STAVEBANK RD.	MISSISSAUGA CITY ON	
CA	WHITNEY HOMES	QUEEN ST. E. STREET A	MISSISSAUGA CITY ON	
CA	MISSISSAUGA CITY	STAVEBANK RD.	MISSISSAUGA CITY ON	
CA	MISSISSAUGA CITY	HURONTARIO STREET	MISSISSAUGA CITY ON	
CA	GOTTARDO PROPERTIES LTD. & GOTTARDO CORP	HURONTARIO ST. STREET A	MISSISSAUGA CITY ON	
ECA	The Regional Municipality of Peel	Stavebank Road	Mississauga ON	L6T 4B9
ECA	Fram Builders (Durham) Corp.	Lakeshore Road East	Mississauga ON	M9W 6V1
GEN	BELL CANADA	VARIOUS BELL CANADA MANHOLES AND ACCESS CHAMBERS WITHIN THE MOE CENTRAL REG.	(SEE SCHEDULE "B") ON	

Unplottable Report

Site: *Lakeshore Road East Mississauga ON* **Database:** *CA*

Certificate #: 2788-4SGLXJ
Application Year: 00
Issue Date: 12/29/00
Approval Type: Municipal & Private sewage
Status: Approved
Application Type: New Certificate of Approval
Client Name: Corporation of the Regional Municipality of Peel
Client Address: 10 Peel Centre Drive
Client City: Brampton
Client Postal Code: L6T 4B9
Project Description: Sanitary sewers and appurtenances to be constructed in conjunction with Project No. 00-2210 in the City of Mississauga on Lakeshore Road East.
Contaminants:
Emission Control:

Site: *R.M. OF PEEL
LTS.2&3,RANGE 1/ROSEWOOD AVE. MISSISSAUGA ON* **Database:** *CA*

Certificate #: 7-0145-98-
Application Year: 98
Issue Date: 3/24/1998
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: *Lakeshore Road East, Helen Street, Port Street, and St. Lawrence Drive
Lakeshore Road East Mississauga ON* **Database:** *CA*

Certificate #: 8104-4QGR6K
Application Year: 00
Issue Date: 11/6/00
Approval Type: Municipal & Private sewage
Status: Approved
Application Type: New Certificate of Approval
Client Name: Fram Builders (Durham) Corp.
Client Address: 135 Queen's Plate Drive
Client City: Toronto
Client Postal Code: M9W 6V1
Project Description: Construction of storm and sanitary sewers on Lakeshore Road East, Helen Street, Port Street, St. Lawrence Drive and on three Easements,
Contaminants:
Emission Control:

Site: *Lakeshore Road East, Helen Street, Port Street, and St. Lawrence Drive Mississauga ON* **Database:** *CA*

Certificate #: 6288-4QGS2N
Application Year: 00
Issue Date: 10/30/00
Approval Type: Municipal & Private water
Status: Approved
Application Type: New Certificate of Approval
Client Name: Fram Builders (Durham) Corp.
Client Address: 135 Queen's Plate Drive
Client City: Toronto
Client Postal Code: M9W 6V1
Project Description: Construction of watermain on Port street and St. Lawrence Drive.
Contaminants:
Emission Control:

Site: **R.M. OF PEEL**
LTS.2&3/RANGE 1/ROSEWOOD AVE. MISSISSAUGA ON

Database:
CA

Certificate #: 3-0240-98-
Application Year: 98
Issue Date: 3/24/1998
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **R.M. OF PEEL**
TROY ST./EAGLEWOOD BLVD. MISSISSAUGA CITY ON

Database:
CA

Certificate #: 7-0633-93-
Application Year: 93
Issue Date: 7/23/1993
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **R.M. OF PEEL**
STAVEBANK RD. MISSISSAUGA CITY ON

Database:
CA

Certificate #: 7-0935-89-
Application Year: 89
Issue Date: 6/15/1989
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:

Emission Control:

Site: WHITNEY HOMES
QUEEN ST. E. STREET A MISSISSAUGA CITY ON

Database:
CA

Certificate #: 7-1552-88-
Application Year: 88
Issue Date: 10/3/1988
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: MISSISSAUGA CITY
STAVEBANK RD. MISSISSAUGA CITY ON

Database:
CA

Certificate #: 3-1178-89-
Application Year: 89
Issue Date: 7/5/1989
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: MISSISSAUGA CITY
HURONTARIO STREET MISSISSAUGA CITY ON

Database:
CA

Certificate #: 3-1325-88-
Application Year: 88
Issue Date: 8/3/1988
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: GOTTARDO PROPERTIES LTD. & GOTTARDO CORP
HURONTARIO ST. STREET A MISSISSAUGA CITY ON

Database:
CA

Certificate #: 3-0471-88-
Application Year: 88
Issue Date: 5/5/1988
Approval Type: Municipal sewage
Status: Revised
Application Type:

Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: The Regional Municipality of Peel
Stavebank Road Mississauga ON L6T 4B9

Database:
ECA

Approval No: 9593-63BGUE
Approval Date: 2004-07-29
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-Municipal Drinking Water Systems
Project Type: Municipal Drinking Water Systems
Business Name: The Regional Municipality of Peel
Address: Stavebank Road
Full Address:
Full PDF Link:
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: Fram Builders (Durham) Corp.
Lakeshore Road East Mississauga ON M9W 6V1

Database:
ECA

Approval No: 6288-4QGS2N
Approval Date: 2000-10-30
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-Municipal and Private Water Works
Project Type: Municipal and Private Water Works
Business Name: Fram Builders (Durham) Corp.
Address: Lakeshore Road East
Full Address:
Full PDF Link:
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: BELL CANADA
VARIOUS BELL CANADA MANHOLES AND ACCESS CHAMBERS WITHIN THE MOE CENTRAL REG. (SEE
SCHEDULE "B") ON

Database:
GEN

Generator No: ONR000303
SIC Code: 517110, 517210, 517510
SIC Description: WIRED TELECOMMUNICATIONS
CARRIERS, WIRELESS
TELECOMMUNICATIONS CARRIERS
(EXCEPT SATELLITE)
Approval Years: 2013
PO Box No:
Country:

Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contam. Facility:
MHSW Facility:

Detail(s)

Waste Class: 150
Waste Class Desc: INERT INORGANIC WASTES
Waste Class: 253
Waste Class Desc: EMULSIFIED OILS

Waste Class:	221
Waste Class Desc:	LIGHT FUELS
Waste Class:	252
Waste Class Desc:	WASTE OILS & LUBRICANTS
Waste Class:	251
Waste Class Desc:	OIL SKIMMINGS & SLUDGES

Appendix: Database Descriptions

*Environmental Risk Information Services (ERIS) can search the following databases. The extent of historical information varies with each database and current information is determined by what is publicly available to ERIS at the time of update. **Note:** Databases denoted with " * " indicates that the database will no longer be updated. See the individual database description for more information.*

Abandoned Aggregate Inventory:

Provincial [AAGR](#)

The MAAP Program maintains a database of abandoned pits and quarries. Please note that the database is only referenced by lot and concession and city/town location. The database provides information regarding the location, type, size, land use, status and general comments.*

Government Publication Date: Sept 2002*

Aggregate Inventory:

Provincial [AGR](#)

The Ontario Ministry of Natural Resources maintains a database of all active pits and quarries. The database provides information regarding the registered owner/operator, location name, operation type, approval type, and maximum annual tonnage.

Government Publication Date: Up to Nov 2021

Abandoned Mine Information System:

Provincial [AMIS](#)

The Abandoned Mines Information System contains data on known abandoned and inactive mines located on both Crown and privately held lands. The information was provided by the Ministry of Northern Development and Mines (MNDM), with the following disclaimer: "the database provided has been compiled from various sources, and the Ministry of Northern Development and Mines makes no representation and takes no responsibility that such information is accurate, current or complete". Reported information includes official mine name, status, background information, mine start/end date, primary commodity, mine features, hazards and remediation.

Government Publication Date: 1800-Mar 2022

Anderson's Waste Disposal Sites:

Private [ANDR](#)

The information provided in this database was collected by examining various historical documents which aimed to characterize the likely position of former waste disposal sites from 1860 to present. The research initiative behind the creation of this database was to identify those sites that are missing from the Ontario MOE Waste Disposal Site Inventory, as well as to provide revisions and corrections to the positions and descriptions of sites currently listed in the MOE inventory. In addition to historic waste disposal facilities, the database also identifies certain auto wreckers and scrap yards that have been extrapolated from documentary sources. Please note that the data is not warranted to be complete, exhaustive or authoritative. The information was collected for research purposes only.

Government Publication Date: 1860s-Present

Aboveground Storage Tanks:

Provincial [AST](#)

Historical listing of aboveground storage tanks made available by the Department of Natural Resources and Forestry. Includes tanks used to hold water or petroleum. This dataset has been retired as of September 25, 2014 and will no longer be updated.

Government Publication Date: May 31, 2014

Automobile Wrecking & Supplies:

Private [AUWR](#)

This database provides an inventory of known locations that are involved in the scrap metal, automobile wrecking/recycling, and automobile parts & supplies industry. Information is provided on the company name, location and business type.

Government Publication Date: 1999-May 31, 2022

Borehole:

Provincial [BORE](#)

A borehole is the generalized term for any narrow shaft drilled in the ground, either vertically or horizontally. The information here includes geotechnical investigations or environmental site assessments, mineral exploration, or as a pilot hole for installing piers or underground utilities. Information is from many sources such as the Ministry of Transportation (MTO) boreholes from engineering reports and projects from the 1950 to 1990's in Southern Ontario. Boreholes from the Ontario Geological Survey (OGS) including The Urban Geology Analysis Information System (UGAIS) and the York Peel Durham Toronto (YPDT) database of the Conservation Authority Moraine Coalition. This database will include fields such as location, stratigraphy, depth, elevation, year drilled, etc. For all water well data or oil and gas well data for Ontario please refer to WWIS and OOGW.

Government Publication Date: 1875-Jul 2018

Certificates of Approval:

Provincial CA

This database contains the following types of approvals: Air & Noise, Industrial Sewage, Municipal & Private Sewage, Waste Management Systems and Renewable Energy Approvals. The MOE in Ontario states that any facility that releases emissions to the atmosphere, discharges contaminants to ground or surface water, provides potable water supplies, or stores, transports or disposes of waste, must have a Certificate of Approval before it can operate lawfully. Fields include approval number, business name, address, approval date, approval type and status. This database will no longer be updated, as CofA's have been replaced by either Environmental Activity and Sector Registry (EASR) or Environmental Compliance Approval (ECA). Please refer to those individual databases for any information after Oct.31, 2011.

Government Publication Date: 1985-Oct 30, 2011*

Dry Cleaning Facilities:

Federal CDRY

List of dry cleaning facilities made available by Environment and Climate Change Canada. Environment and Climate Change Canada's Tetrachloroethylene (Use in Dry Cleaning and Reporting Requirements) Regulations (SOR/2003-79) are intended to reduce releases of tetrachloroethylene to the environment from dry cleaning facilities.

Government Publication Date: Jan 2004-Dec 2020

Commercial Fuel Oil Tanks:

Provincial CFOT

Locations of commercial underground fuel oil tanks. This is not a comprehensive or complete inventory of commercial fuel tanks in the province; this listing is a copy of records of registered commercial underground fuel oil tanks obtained under Access to Public Information.

Note that the following types of tanks do not require registration: waste oil tanks in apartments, office buildings, residences, etc.; aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Chemical Manufacturers and Distributors:

Private CHEM

This database includes information from both a one time study conducted in 1992 and private source and is a listing of facilities that manufacture or distribute chemicals. The production of these chemical substances may involve one or more chemical reactions and/or chemical separation processes (i.e. fractionation, solvent extraction, crystallization, etc.).

Government Publication Date: 1999-Jan 31, 2020

Chemical Register:

Private CHM

This database includes a listing of locations of facilities within the Province or Territory that either manufacture and/or distributes chemicals.

Government Publication Date: 1999-May 31, 2022

Compressed Natural Gas Stations:

Private CNG

Canada has a network of public access compressed natural gas (CNG) refuelling stations. These stations dispense natural gas in compressed form at 3,000 pounds per square inch (psi), the pressure which is allowed within the current Canadian codes and standards. The majority of natural gas refuelling is located at existing retail gasoline that have a separate refuelling island for natural gas. This list of stations is made available by the Canadian Natural Gas Vehicle Alliance.

Government Publication Date: Dec 2012 -Apr 2022

Inventory of Coal Gasification Plants and Coal Tar Sites:

Provincial COAL

This inventory includes both the "Inventory of Coal Gasification Plant Waste Sites in Ontario-April 1987" and the Inventory of Industrial Sites Producing or Using Coal Tar and Related Tars in Ontario-November 1988) collected by the MOE. It identifies industrial sites that produced and continue to produce or use coal tar and other related tars. Detailed information is available and includes: facility type, size, land use, information on adjoining properties, soil condition, site operators/occupants, site description, potential environmental impacts and historic maps available. This was a one-time inventory.*

Government Publication Date: Apr 1987 and Nov 1988*

Compliance and Convictions:

Provincial CONV

This database summarizes the fines and convictions handed down by the Ontario courts beginning in 1989. Companies and individuals named here have been found guilty of environmental offenses in Ontario courts of law.

Government Publication Date: 1989-Jun 2022

Certificates of Property Use:

Provincial CPU

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include all CPU's on the registry such as (EPA s. 168.6) - Certificate of Property Use.

Government Publication Date: 1994 - Jul 31, 2022

Drill Hole Database:

Provincial

[DRL](#)

The Ontario Drill Hole Database contains information on more than 113,000 percussion, overburden, sonic and diamond drill holes from assessment files on record with the department of Mines and Minerals. Please note that limited data is available for southern Ontario, as it was the last area to be completed. The database was created when surveys submitted to the Ministry were converted in the Assessment File Research Image Database (AFRI) project. However, the degree of accuracy (coordinates) as to the exact location of drill holes is dependent upon the source document submitted to the MNDM. Levels of accuracy used to locate holes are: centering on the mining claim; a sketch of the mining claim; a 1:50,000 map; a detailed company map; or from submitted a "Report of Work".

Government Publication Date: 1886 - Sep 2020

Delisted Fuel Tanks:

Provincial

[DTNK](#)

List of fuel storage tank sites that were once found in - and have since been removed from - the list of fuel storage tanks made available by the regulatory agency under Access to Public Information.

Government Publication Date: Feb 28, 2022

Environmental Activity and Sector Registry:

Provincial

[EASR](#)

On October 31, 2011, a smarter, faster environmental approvals system came into effect in Ontario. The EASR allows businesses to register certain activities with the ministry, rather than apply for an approval. The registry is available for common systems and processes, to which preset rules of operation can be applied. The EASR is currently available for: heating systems, standby power systems and automotive refinishing. Businesses whose activities aren't subject to the EASR may apply for an ECA (Environmental Compliance Approval). Please see our ECA database.

Government Publication Date: Oct 2011- Jul 31, 2022

Environmental Registry:

Provincial

[EBR](#)

The Environmental Registry lists proposals, decisions and exceptions regarding policies, Acts, instruments, or regulations that could significantly affect the environment. Through the Registry, thirteen provincial ministries notify the public of upcoming proposals and invite their comments. For example, if a local business is requesting a permit, license, or certificate of approval to release substances into the air or water; these are notified on the registry. Data includes: Approval for discharge into the natural environment other than water (i.e. Air) - EPA s. 9, Approval for sewage works - OWRA s. 53(1), and EPA s. 27 - Approval for a waste disposal site. For information regarding Permit to Take Water (PTTW), Certificate of Property Use (CPU) and (ORD) Orders please refer to those individual databases.

Government Publication Date: 1994 - Jul 31, 2022

Environmental Compliance Approval:

Provincial

[ECA](#)

On October 31, 2011, a smarter, faster environmental approvals system came into effect in Ontario. In the past, a business had to apply for multiple approvals (known as certificates of approval) for individual processes and pieces of equipment. Today, a business either registers itself, or applies for a single approval, depending on the types of activities it conducts. Businesses whose activities aren't subject to the EASR may apply for an ECA. A single ECA addresses all of a business's emissions, discharges and wastes. Separate approvals for air, noise and waste are no longer required. This database will also include Renewable Energy Approvals. For certificates of approval prior to Nov 1st, 2011, please refer to the CA database. For all Waste Disposal Sites please refer to the WDS database.

Government Publication Date: Oct 2011- Jul 31, 2022

Environmental Effects Monitoring:

Federal

[EEM](#)

The Environmental Effects Monitoring program assesses the effects of effluent from industrial or other sources on fish, fish habitat and human usage of fisheries resources. Since 1992, pulp and paper mills have been required to conduct EEM studies under the Pulp and Paper Effluent Regulations. This database provides information on the mill name, geographical location and sub-lethal toxicity data.

Government Publication Date: 1992-2007*

ERIS Historical Searches:

Private

[EHS](#)

ERIS has compiled a database of all environmental risk reports completed since March 1999. Available fields for this database include: site location, date of report, type of report, and search radius. As per all other databases, the ERIS database can be referenced on both the map and "Statistical Profile" page.

Government Publication Date: 1999-Jul 31, 2022

Environmental Issues Inventory System:

Federal

[EIIS](#)

The Environmental Issues Inventory System was developed through the implementation of the Environmental Issues and Remediation Plan. This plan was established to determine the location and severity of contaminated sites on inhabited First Nation reserves, and where necessary, to remediate those that posed a risk to health and safety; and to prevent future environmental problems. The EIIS provides information on the reserve under investigation, inventory number, name of site, environmental issue, site action (Remediation, Site Assessment), and date investigation completed.

Government Publication Date: 1992-2001*

Emergency Management Historical Event:

Provincial

EMHE

List of locations of historical occurrences of emergency events, including those assigned to the Ministry of Natural Resources by Order-In-Council (OIC) under the Emergency Management and Civil Protection Act, as well as events where MNR provided requested emergency response assistance. Many of these events will have involved community evacuations, significant structural loss, and/or involvement of MNR emergency response staff. These events fall into one of ten (10) type categories: Dam Failure; Drought / Low Water; Erosion; Flood; Forest Fire; Soil and Bedrock Instability; Petroleum Resource Center Event, EMO Requested Assistance, Continuity of Operations Event, Other Requested Assistance. EMHE record details are reproduced by ERIIS under License with the Ontario Ministry of Natural Resources © Queen's Printer for Ontario, 2017.

Government Publication Date: Apr 30, 2022

Environmental Penalty Annual Report:

Provincial

EPAR

This database contains data from Ontario's annual environmental penalty report published by the Ministry of the Environment and Climate Change. These reports provide information on environmental penalties for land or water violations issued to companies in one of the nine industrial sectors covered by the Municipal Industrial Strategy for Abatement (MISA) regulations.

Government Publication Date: Jan 1, 2011 - Dec 31, 2021

List of Expired Fuels Safety Facilities:

Provincial

EXP

List of facilities and tanks for which there was once a fuel registration. This is not a comprehensive or complete inventory of expired tanks/tank facilities in the province; this listing is a copy of previously registered tanks and facilities obtained under Access to Public Information. Includes private fuel outlets, bulk plants, fuel oil tanks, gasoline stations, marinas, propane filling stations, liquid fuel tanks, piping systems, etc; includes tanks which have been removed from the ground.

Notes: registration was not required for private fuel underground/aboveground storage tanks prior to January 1990, nor for furnace oil tanks prior to May 1, 2002; registration is not required for waste oil tanks in apartments, office buildings, residences, etc., or aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Federal Convictions:

Federal

FCON

Environment Canada maintains a database referred to as the "Environmental Registry" that details prosecutions under the Canadian Environmental Protection Act (CEPA) and the Fisheries Act (FA). Information is provided on the company name, location, charge date, offence and penalty.

Government Publication Date: 1988-Jun 2007*

Contaminated Sites on Federal Land:

Federal

FCS

The Federal Contaminated Sites Inventory includes information on known federal contaminated sites under the custodianship of departments, agencies and consolidated Crown corporations as well as those that are being or have been investigated to determine whether they have contamination arising from past use that could pose a risk to human health or the environment. The inventory also includes non-federal contaminated sites for which the Government of Canada has accepted some or all financial responsibility. It does not include sites where contamination has been caused by, and which are under the control of, enterprise Crown corporations, private individuals, firms or other levels of government. Includes fire training sites and sites at which Per- and Polyfluoroalkyl Substances (PFAS) are a concern.

Government Publication Date: Jun 2000-Jun 2022

Fisheries & Oceans Fuel Tanks:

Federal

FOFT

Fisheries & Oceans Canada maintains an inventory of aboveground & underground fuel storage tanks located on Fisheries & Oceans property or controlled by DFO. Our inventory provides information on the site name, location, tank owner, tank operator, facility type, storage tank location, tank contents & capacity, and date of tank installation.

Government Publication Date: 1964-Sep 2019

Federal Identification Registry for Storage Tank Systems (FIRSTS):

Federal

FRST

A list of federally regulated Storage tanks from the Federal Identification Registry for Storage Tank Systems (FIRSTS). FIRSTS is Environment and Climate Change Canada's database of storage tank systems subject to the Storage Tank for Petroleum Products and Allied Petroleum Products Regulations. The main objective of the Regulations is to prevent soil and groundwater contamination from storage tank systems located on federal and aboriginal lands. Storage tank systems that do not have a valid identification number displayed in a readily visible location on or near the storage tank system may be refused product delivery.

Government Publication Date: May 31, 2018

Fuel Storage Tank:

Provincial

FST

List of registered private and retail fuel storage tanks. This is not a comprehensive or complete inventory of private and retail fuel storage tanks in the province; this listing is a copy of registered private and retail fuel storage tanks, obtained under Access to Public Information.

Notes: registration was not required for private fuel underground/aboveground storage tanks prior to January 1990, nor for furnace oil tanks prior to May 1, 2002; registration is not required for waste oil tanks in apartments, office buildings, residences, etc., or aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Fuel Storage Tank - Historic:

Provincial

FSTH

The Fuels Safety Branch of the Ontario Ministry of Consumer and Commercial Relations maintained a database of all registered private fuel storage tanks. Public records of private fuel storage tanks are only available since the registration became effective in September 1989. This information is now collected by the Technical Standards and Safety Authority.

Government Publication Date: Pre-Jan 2010*

Ontario Regulation 347 Waste Generators Summary:

Provincial

GEN

Regulation 347 of the Ontario EPA defines a waste generation site as any site, equipment and/or operation involved in the production, collection, handling and/or storage of regulated wastes. A generator of regulated waste is required to register the waste generation site and each waste produced, collected, handled, or stored at the site. This database contains the registration number, company name and address of registered generators including the types of hazardous wastes generated. It includes data on waste generating facilities such as: drycleaners, waste treatment and disposal facilities, machine shops, electric power distribution etc. This information is a summary of all years from 1986 including the most currently available data. Some records may contain, within the company name, the phrase "See & Use..." followed by a series of letters and numbers. This occurs when one company is amalgamated with or taken over by another registered company. The number listed as "See & Use", refers to the new ownership and the other identification number refers to the original ownership. This phrase serves as a link between the 2 companies until operations have been fully transferred.

Government Publication Date: 1986-Apr 30, 2022

Greenhouse Gas Emissions from Large Facilities:

Federal

GHG

List of greenhouse gas emissions from large facilities made available by Environment Canada. Greenhouse gas emissions in kilotonnes of carbon dioxide equivalents (kt CO₂ eq).

Government Publication Date: 2013-Dec 2019

TSSA Historic Incidents:

Provincial

HINC

List of historic incidences of spills and leaks of diesel, fuel oil, gasoline, natural gas, propane, and hydrogen recorded by the TSSA in their previous incident tracking system. The TSSA's Fuels Safety Program administers the Technical Standards & Safety Act 2000, providing fuel-related safety services associated with the safe transportation, storage, handling and use of fuels such as gasoline, diesel, propane, natural gas and hydrogen. Under this Act, the TSSA regulates fuel suppliers, storage facilities, transport trucks, pipelines, contractors and equipment or appliances that use fuels. Records are not verified for accuracy or completeness. This is not a comprehensive or complete inventory of historical fuel spills and leaks in the province. This listing is a copy of the data captured at one moment in time and is hence limited by the record date provided here.

Government Publication Date: 2006-June 2009*

Indian & Northern Affairs Fuel Tanks:

Federal

IAFT

The Department of Indian & Northern Affairs Canada (INAC) maintains an inventory of aboveground & underground fuel storage tanks located on both federal and crown land. Our inventory provides information on the reserve name, location, facility type, site/facility name, tank type, material & ID number, tank contents & capacity, and date of tank installation.

Government Publication Date: 1950-Aug 2003*

Fuel Oil Spills and Leaks:

Provincial

INC

Listing of spills and leaks of diesel, fuel oil, gasoline, natural gas, propane, and hydrogen reported to the Spills Action Centre (SAC). This is not a comprehensive or complete inventory of fuel-related leaks, spills, and incidents in the province; this listing is a copy of incidents reported to the SAC, obtained under Access to Public Information. Includes incidents from fuel-related hazards such as spills, fires, and explosions. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Landfill Inventory Management Ontario:

Provincial

LIMO

The Landfill Inventory Management Ontario (LIMO) database is updated every year, as the Ministry of the Environment, Conservation and Parks compiles new and updated information. Includes small and large landfills currently operating as well as those which are closed and historic. Operators of larger landfills provide landfill information for the previous operating year to the ministry for LIMO including: estimated amount of total waste received, landfill capacity, estimated total remaining landfill capacity, fill rates, engineering designs, reporting and monitoring details, size of location, service area, approved waste types, leachate of site treatment, contaminant attenuation zone and more. The small landfills include information such as site owner, site location and certificate of approval # and status.

Government Publication Date: Mar 21, 2022

Canadian Mine Locations:

Private

MINE

This information is collected from the Canadian & American Mines Handbook. The Mines database is a national database that provides over 290 listings on mines (listed as public companies) dealing primarily with precious metals and hard rocks. Listed are mines that are currently in operation, closed, suspended, or are still being developed (advanced projects). Their locations are provided as geographic coordinates (x, y and/or longitude, latitude). As of 2002, data pertaining to Canadian smelters and refineries has been appended to this database.

Government Publication Date: 1998-2009*

Mineral Occurrences:

Provincial

MNR

In the early 70's, the Ministry of Northern Development and Mines created an inventory of approximately 19,000 mineral occurrences in Ontario, in regard to metallic and industrial minerals, as well as some information on building stones and aggregate deposits. Please note that the "Horizontal Positional Accuracy" is approximately +/- 200 m. Many reference elements for each record were derived from field sketches using pace or chain/tape measurements against claim posts or topographic features in the area. The primary limiting factor for the level of positional accuracy is the scale of the source material. The testing of horizontal accuracy of the source materials was accomplished by comparing the plan metric (X and Y) coordinates of that point with the coordinates of the same point as defined from a source of higher accuracy.

Government Publication Date: 1846-Feb 2022

National Analysis of Trends in Emergencies System (NATES):

Federal

NATE

In 1974 Environment Canada established the National Analysis of Trends in Emergencies System (NATES) database, for the voluntary reporting of significant spill incidents. The data was to be used to assist in directing the work of the emergencies program. NATES ran from 1974 to 1994. Extensive information is available within this database including company names, place where the spill occurred, date of spill, cause, reason and source of spill, damage incurred, and amount, concentration, and volume of materials released.

Government Publication Date: 1974-1994*

Non-Compliance Reports:

Provincial

NCPL

The Ministry of the Environment provides information about non-compliant discharges of contaminants to air and water that exceed legal allowable limits, from regulated industrial and municipal facilities. A reported non-compliance failure may be in regard to a Control Order, Certificate of Approval, Sectoral Regulation or specific regulation/act.

Government Publication Date: Dec 31, 2020

National Defense & Canadian Forces Fuel Tanks:

Federal

NDFT

The Department of National Defense and the Canadian Forces maintains an inventory of all aboveground & underground fuel storage tanks located on DND lands. Our inventory provides information on the base name, location, tank type & capacity, tank contents, tank class, date of tank installation, date tank last used, and status of tank as of May 2001. This database will no longer be updated due to the new National Security protocols which have prohibited any release of this database.

Government Publication Date: Up to May 2001*

National Defense & Canadian Forces Spills:

Federal

NDSP

The Department of National Defense and the Canadian Forces maintains an inventory of spills to land and water. All spill sites have been classified under the "Transportation of Dangerous Goods Act - 1992". Our inventory provides information on the facility name, location, spill ID #, spill date, type of spill, as well as the quantity of substance spilled & recovered.

Government Publication Date: Mar 1999-Apr 2018

National Defence & Canadian Forces Waste Disposal Sites:

Federal

NDWD

The Department of National Defence and the Canadian Forces maintains an inventory of waste disposal sites located on DND lands. Where available, our inventory provides information on the base name, location, type of waste received, area of site, depth of site, year site opened/closed and status.

Government Publication Date: 2001-Apr 2007*

National Energy Board Pipeline Incidents:

Federal

NEBI

Locations of pipeline incidents from 2008 to present, made available by the Canada Energy Regulator (CER) - previously the National Energy Board (NEB). Includes incidents reported under the Onshore Pipeline Regulations and the Processing Plant Regulations related to pipelines under federal jurisdiction, does not include incident data related to pipelines under provincial or territorial jurisdiction.

Government Publication Date: 2008-Jun 30, 2021

National Energy Board Wells:

Federal

NEBP

The NEBW database contains information on onshore & offshore oil and gas wells that are outside provincial jurisdiction(s) and are thereby regulated by the National Energy Board. Data is provided regarding the operator, well name, well ID No./UWI, status, classification, well depth, spud and release date.

Government Publication Date: 1920-Feb 2003*

National Environmental Emergencies System (NEES):

Federal

NEES

In 2000, the Emergencies program implemented NEES, a reporting system for spills of hazardous substances. For the most part, this system only captured data from the Atlantic Provinces, some from Quebec and Ontario and a portion from British Columbia. Data for Alberta, Saskatchewan, Manitoba and the Territories was not captured. However, NEES is also a repository for previous Environment Canada spill datasets. NEES is composed of the historic datasets ' or Trends ' which dates from approximately 1974 to present. NEES Trends is a compilation of historic databases, which were merged and includes data from NATES (National Analysis of Trends in Emergencies System), ARTS (Atlantic Regional Trends System), and NEES. In 2001, the Emergencies Program determined that variations in reporting regimes and requirements between federal and provincial agencies made national spill reporting and trend analysis difficult to achieve. As a consequence, the department has focused efforts on capturing data on spills of substances which fall under its legislative authority only (CEPA and FA). As such, the NEES database will be decommissioned in December 2004.

Government Publication Date: 1974-2003***National PCB Inventory:**

Federal

NPCB

Environment Canada's National PCB inventory includes information on in-use PCB containing equipment in Canada including federal, provincial and private facilities. Federal out-of-service PCB containing equipment and PCB waste owned by the federal government or by federally regulated industries such as airlines, railway companies, broadcasting companies, telephone and telecommunications companies, pipeline companies, etc. are also listed. Although it is not Environment Canada's mandate to collect data on non-federal PCB waste, the National PCB inventory includes some information on provincial and private PCB waste and storage sites. Some addresses provided may be Head Office addresses and are not necessarily the location of where the waste is being used or stored.

Government Publication Date: 1988-2008***National Pollutant Release Inventory:**

Federal

NPRI

Environment Canada has defined the National Pollutant Release Inventory ("NPRI") as a federal government initiative designed to collect comprehensive national data regarding releases to air, water, or land, and waste transfers for recycling for more than 300 listed substances.

Government Publication Date: 1993-May 2017**Oil and Gas Wells:**

Private

OGWE

The Nickle's Energy Group (publisher of the Daily Oil Bulletin) collects information on drilling activity including operator and well statistics. The well information database includes name, location, class, status and depth. The main Nickle's database is updated on a daily basis, however, this database is updated on a monthly basis. More information is available at www.nickles.com.

Government Publication Date: 1988-Aug 31, 2022**Ontario Oil and Gas Wells:**

Provincial

OOGW

In 1998, the MNR handed over to the Ontario Oil, Gas and Salt Resources Corporation, the responsibility of maintaining a database of oil and gas wells drilled in Ontario. The OGSR Library has over 20,000+ wells in their database. Information available for all wells in the ERIS database include well owner/operator, location, permit issue date, and well cap date, license No., status, depth and the primary target (rock unit) of the well being drilled. All geology/stratigraphy table information, plus all water table information is also provide for each well record.

Government Publication Date: 1800-Jan 2021**Inventory of PCB Storage Sites:**

Provincial

OPCB

The Ontario Ministry of Environment, Waste Management Branch, maintains an inventory of PCB storage sites within the province. Ontario Regulation 11/82 (Waste Management - PCB) and Regulation 347 (Generator Waste Management) under the Ontario EPA requires the registration of inactive PCB storage equipment and/or disposal sites of PCB waste with the Ontario Ministry of Environment. This database contains information on: 1) waste quantities; 2) major and minor sites storing liquid or solid waste; and 3) a waste storage inventory.

Government Publication Date: 1987-Oct 2004; 2012-Dec 2013**Orders:**

Provincial

ORD

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include all Orders on the registry such as (EPA s. 17) - Order for remedial work, (EPA s. 18) - Order for preventative measures, (EPA s. 43) - Order for removal of waste and restoration of site, (EPA s. 44) - Order for conformity with Act for waste disposal sites, (EPA s. 136) - Order for performance of environmental measures.

Government Publication Date: 1994 - Jul 31, 2022**Canadian Pulp and Paper:**

Private

PAP

This information is part of the Pulp and Paper Canada Directory. The Directory provides a comprehensive listing of the locations of pulp and paper mills and the products that they produce.

Government Publication Date: 1999, 2002, 2004, 2005, 2009-2014**Parks Canada Fuel Storage Tanks:**

Federal

PCFT

Canadian Heritage maintains an inventory of known fuel storage tanks operated by Parks Canada, in both National Parks and at National Historic Sites. The database details information on site name, location, tank install/removal date, capacity, fuel type, facility type, tank design and owner/operator.

Government Publication Date: 1920-Jan 2005*

Pesticide Register:

Provincial PES

The Ontario Ministry of the Environment and Climate Change maintains a database of licensed operators and vendors of registered pesticides.

Government Publication Date: Oct 2011- Jul 31, 2022

Pipeline Incidents:

Provincial PINC

List of pipeline incidents (strikes, leaks, spills). This is not a comprehensive or complete inventory of pipeline incidents in the province; this listing is an historical copy of records previously obtained under Access to Public Information. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2021

Private and Retail Fuel Storage Tanks:

Provincial PRT

The Fuels Safety Branch of the Ontario Ministry of Consumer and Commercial Relations maintained a database of all registered private fuel storage tanks and licensed retail fuel outlets. This database includes an inventory of locations that have gasoline, oil, waste oil, natural gas and/or propane storage tanks on their property. The MCCR no longer collects this information. This information is now collected by the Technical Standards and Safety Authority (TSSA).

Government Publication Date: 1989-1996*

Permit to Take Water:

Provincial PTTW

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include all PTTW's on the registry such as OWRA s. 34 - Permit to take water.

Government Publication Date: 1994 - Jul 31, 2022

Ontario Regulation 347 Waste Receivers Summary:

Provincial REC

Part V of the Ontario Environmental Protection Act ("EPA") regulates the disposal of regulated waste through an operating waste management system or a waste disposal site operated or used pursuant to the terms and conditions of a Certificate of Approval or a Provisional Certificate of Approval. Regulation 347 of the Ontario EPA defines a waste receiving site as any site or facility to which waste is transferred by a waste carrier. A receiver of regulated waste is required to register the waste receiving facility. This database represents registered receivers of regulated wastes, identified by registration number, company name and address, and includes receivers of waste such as: landfills, incinerators, transfer stations, PCB storage sites, sludge farms and water pollution control plants. This information is a summary of all years from 1986 including the most currently available data.

Government Publication Date: 1986-1990, 1992-2019

Record of Site Condition:

Provincial RSC

The Record of Site Condition (RSC) is part of the Ministry of the Environment's Brownfields Environmental Site Registry. Protection from environmental cleanup orders for property owners is contingent upon documentation known as a record of site condition (RSC) being filed in the Environmental Site Registry. In order to file an RSC, the property must have been properly assessed and shown to meet the soil, sediment and groundwater standards appropriate for the use (such as residential) proposed to take place on the property. The Record of Site Condition Regulation (O. Reg. 153/04) details requirements related to site assessment and clean up.

RSCs filed after July 1, 2011 will also be included as part of the new (O.Reg. 511/09).

Government Publication Date: 1997-Sept 2001, Oct 2004-Jul 2022

Retail Fuel Storage Tanks:

Private RST

This database includes an inventory of retail fuel outlet locations (including marinas) that have on their property gasoline, oil, waste oil, natural gas and / or propane storage tanks.

Government Publication Date: 1999-May 31, 2022

Scott's Manufacturing Directory:

Private SCT

Scott's Directories is a data bank containing information on over 200,000 manufacturers across Canada. Even though Scott's listings are voluntary, it is the most comprehensive database of Canadian manufacturers available. Information concerning a company's address, plant size, and main products are included in this database.

Government Publication Date: 1992-Mar 2011*

Ontario Spills:

Provincial SPL

List of spills and incidents made available the Ministry of the Environment, Conservation and Parks. This database identifies information such as location (approximate), type and quantity of contaminant, date of spill, environmental impact, cause, nature of impact, etc. Information from 1988-2002 was part of the ORIS (Occurrence Reporting Information System). The SAC (Spills Action Centre) handles all spills reported in Ontario. Regulations for spills in Ontario are part of the MOE's Environmental Protection Act, Part X. The Ministry of the Environment, Conservation and Parks cites the coronavirus pandemic as an explanation for delays in releasing data pursuant to requests.

Government Publication Date: 1988-Sep 2020; Dec 2020-Mar 2021

Wastewater Discharger Registration Database:

Provincial

SRDS

Information under this heading is combination of the following 2 programs. The Municipal/Industrial Strategy for Abatement (MISA) division of the Ontario Ministry of Environment maintained a database of all direct dischargers of toxic pollutants within nine sectors including: Electric Power Generation; Mining; Petroleum Refining; Organic Chemicals; Inorganic Chemicals; Pulp & Paper; Metal Casting; Iron & Steel; and Quarries. All sampling information is now collected and stored within the Sample Result Data Store (SRDS).

Government Publication Date: 1990-Dec 31, 2020

Anderson's Storage Tanks:

Private

TANK

The information provided in this database was collected by examining various historical documents, which identified the location of former storage tanks, containing substances such as fuel, water, gas, oil, and other various types of miscellaneous products. Information is available in regard to business operating at tank site, tank location, permit year, permit & installation type, no. of tanks installed & configuration and tank capacity. Data contained within this database pertains only to the city of Toronto and is not warranted to be complete, exhaustive or authoritative. The information was collected for research purposes only.

Government Publication Date: 1915-1953*

Transport Canada Fuel Storage Tanks:

Federal

TCFT

List of fuel storage tanks currently or previously owned or operated by Transport Canada. This inventory also includes tanks on The Pickering Lands, which refers to 7,530 hectares (18,600 acres) of land in Pickering, Markham, and Uxbridge owned by the Government of Canada since 1972; properties on this land has been leased by the government since 1975, and falls under the Site Management Policy of Transport Canada, but is administered by Public Works and Government Services Canada. This inventory provides information on the site name, location, tank age, capacity and fuel type.

Government Publication Date: 1970 - Dec 2020

Variances for Abandonment of Underground Storage Tanks:

Provincial

VAR

Listing of variances granted for storage tank abandonment. This is not a comprehensive or complete inventory of tank abandonment variances in the province; this listing is a copy of tank abandonment variance records previously obtained under Access to Public Information. In Ontario, registered underground storage tanks must be removed within two years of disuse; if removal of a tank is not feasible, an application may be sought for a variance from this code requirement.

Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Waste Disposal Sites - MOE CA Inventory:

Provincial

WDS

The Ontario Ministry of Environment, Waste Management Branch, maintains an inventory of known open (active or inactive) and closed disposal sites in the Province of Ontario. Active sites maintain a Certificate of Approval, are approved to receive and are receiving waste. Inactive sites maintain Certificate(s) of Approval but are not receiving waste. Closed sites are not receiving waste. The data contained within this database was compiled from the MOE's Certificate of Approval database. Locations of these sites may be cross-referenced to the Anderson database described under ERIS's Private Source Database section, by the CA number. All new Environmental Compliance Approvals handed out after Oct 31, 2011 for Waste Disposal Sites will still be found in this database.

Government Publication Date: Oct 2011- Jul 31, 2022

Waste Disposal Sites - MOE 1991 Historical Approval Inventory:

Provincial

WDSH

In June 1991, the Ontario Ministry of Environment, Waste Management Branch, published the "June 1991 Waste Disposal Site Inventory", of all known active and closed waste disposal sites as of October 30th, 1990. For each "active" site as of October 31st 1990, information is provided on site location, site/CA number, waste type, site status and site classification. For each "closed" site as of October 31st 1990, information is provided on site location, site/CA number, closure date and site classification. Locations of these sites may be cross-referenced to the Anderson database described under ERIS's Private Source Database section, by the CA number.

Government Publication Date: Up to Oct 1990*

Water Well Information System:

Provincial

WWIS

This database describes locations and characteristics of water wells found within Ontario in accordance with Regulation 903. It includes such information as coordinates, construction date, well depth, primary and secondary use, pump rate, static water level, well status, etc. Also included are detailed stratigraphy information, approximate depth to bedrock and the approximate depth to the water table.

Government Publication Date: Jun 30 2022

Definitions

Database Descriptions: This section provides a detailed explanation for each database including: source, information available, time coverage, and acronyms used. They are listed in alphabetic order.

Detail Report: This is the section of the report which provides the most detail for each individual record. Records are summarized by location, starting with the project property followed by records in closest proximity.

Distance: The distance value is the distance between plotted points, not necessarily the distance between the sites' boundaries. All values are an approximation.

Direction: The direction value is the compass direction of the site in respect to the project property and/or center point of the report.

Elevation: The elevation value is taken from the location at which the records for the site address have been plotted. All values are an approximation. Source: Google Elevation API.

Executive Summary: This portion of the report is divided into 3 sections:

'Report Summary'- Displays a chart indicating how many records fall on the project property and, within the report search radii.

'Site Report Summary'-Project Property'- This section lists all the records which fall on the project property. For more details, see the 'Detail Report' section.

'Site Report Summary-Surrounding Properties'- This section summarizes all records on adjacent properties, listing them in order of proximity from the project property. For more details, see the 'Detail Report' section.

Map Key: The map key number is assigned according to closest proximity from the project property. Map Key numbers always start at #1. The project property will always have a map key of '1' if records are available. If there is a number in brackets beside the main number, this will indicate the number of records on that specific property. If there is no number in brackets, there is only one record for that property.

The symbol and colour used indicates 'elevation': the red inverted triangle will dictate 'ERIS Sites with Lower Elevation', the yellow triangle will dictate 'ERIS Sites with Higher Elevation' and the orange square will dictate 'ERIS Sites with Same Elevation.'

Unplottables: These are records that could not be mapped due to various reasons, including limited geographic information. These records may or may not be in your study area, and are included as reference.

APPENDIX G
MECP FOI Search Results



**Ministry of the Environment,
Conservation and Parks**

Corporate Management Division

**Ministère de l'Environnement, de la
Protection de la nature et des Parcs**

Division de la gestion ministérielle

March 23, 2022

Irene Hutchison
PINCHIN LTD.

Dear Irene Hutchison
RE: Request #: EPI-2022-2000000213

This letter confirms that, after conducting a thorough search of its source system applications, the ministry was not able to find any records related to your environmental property-related information request. We have applied the \$65.00 for this request from your initial payment.

If you have any questions regarding the matter, please contact the ministry at eproperty@ontario.ca.

Sincerely,

Environmental Property Information Team

Disclaimer

This search result is provided for informational purposes only and is not intended to provide specific advice or recommendations. The Ministry of the Environment, Conservation and Parks (MECP) cannot and does not guarantee that the information provided is current, accurate, complete, or free of errors. Any reliance upon this information is solely at the risk of the user.



**Ministry of the Environment,
Conservation and Parks**

Corporate Management Division

**Ministère de l'Environnement, de la
Protection de la nature et des Parcs**

Division de la gestion ministérielle

Le 23 mars 2022

Irene Hutchison
PINCHIN LTD.

Madame,
Monsieur, Irene Hutchison

Objet : N^o de demande : EPI-2022-2000000213

La présente lettre confirme que, après avoir effectué une recherche exhaustive dans ces applications de système source, le ministère n'a pu trouver aucun dossier concernant à votre demande pour des données environnementales relatives aux biens immobiliers. Nous avons imputé la somme de 65,00 \$ pour cette demande à partir de votre paiement initial.

Si vous avez des questions concernant votre demande, nous vous invitons à communiquer avec le ministère à l'adresse électronique suivante :
eproperty@ontario.ca.

Veuillez recevoir mes salutations les plus sincères,

L'équipe des données environnementales relatives aux biens immobiliers

Avertissement

Ce résultat de recherche est fourni uniquement à titre informatif et n'a aucunement pour but de donner des conseils particuliers ou des recommandations. Le ministère de l'Environnement de la Protection de la nature et des Parcs (MEPP) ne peut pas garantir que les renseignements fournis sont à jour, exacts, complets et exempts d'erreurs. L'utilisateur qui se fie à ces renseignements le fait à ses seuls risques.

Ministry of the Environment,
Conservation and Parks

Ministère de l'Environnement, de
la Protection de la nature et des
Parcs



Access and Privacy Office

12th Floor
40 St. Clair Avenue West
Toronto ON M4V 1M2
Tel: (416) 314-4075
Fax: (416) 314-4285

Bureau de l'accès à l'information et
de la protection de la vie privée

12^e étage
40, avenue St. Clair ouest
Toronto ON M4V 1M2
Tél. : (416) 314-4075
Télec.: (416) 314-4285

July 4, 2022

Irene Hutchison
Pinchin Ltd.
2360 Meadowpine Boulevard, Unit 2
Mississauga, ON L5N 6S2
ihutchison@pinchin.com

Dear Irene Hutchison:

RE: MECP Request #: A-2022-02026, Your Reference #: 306743 – Decision Letter

This letter is further to your request made pursuant to the *Freedom of Information and Protection of Privacy Act relating to 70 Park Street East, Mississauga.*

After a review of the records received from the Ministry's Halton Peel District/Area Office, the final decision has been made to provide partial access to the information as some of the information has been removed to protect privacy (Section 21 of the Act).

You may request a review of my decision by contacting the Information and Privacy Commissioner/Ontario, 2 Bloor Street East, Suite 1400, Toronto, ON M4W 1A8 (800-387-0073 or 416-326-3333). Please note that there is a \$25.00 fee and you only have 30 days from receipt of this letter to request a review.

If you have any questions regarding this matter, please contact Ann Harmsen at 613 483-2294 or Ann.Harmsen@Ontario.ca.

Yours truly,

A. Harmsen

For

Ryan Gunn
Manager (A), Access and Privacy Office

Attachment



Ministry of the Environment and Climate Change
Ministère de l'Environnement et de l'Action en matière de changement climatique

INCIDENT REPORT

Reference Number:	7557-ASXSVH	Module Type:	Spill
Status:	Closed	File Storage Number:	SI HP MS PA 100
Program:	Water - Ground & Surface	Activity:	Spills

Caller or PO Reporting/Receiving Information

First Name:	Last Name:
Name of Company:	

MAILING ADDRESS

	Postal Code:
	Canada
	Email Address:

Date Reported to MOE:			
Date of Incident:			
Incident Date Confirmation:	Actual		

Client(s)

Client Details
The Regional Municipality of Peel Mailing Address: Suite A & B - 10 Peel Centre Dr, Brampton, Ontario, Canada, L6T 4B9 Physical Address: Suite A & B - 10 Peel Centre Dr, Brampton, City, Regional Municipality of Peel, Ontario, Canada, L6T 4B9 Telephone: (905)791-7800, Extension: 7918, FAX: (905)791-1442, email: lovisottos@peelregion.ca

Site(s)

Site Details
Watermain Break - Lake Ontario<UNOFFICIAL> Address: Lot : , Part : , 70 Park St West, Mississauga, City, Regional Municipality of Peel District Office: Halton-Peel GeoReference: Map Datum: , Zone: 17, Method: , UTM Easting: 614239.09, UTM Northing: 4823458.53, UTM Location Description: ,

Incident Summary:
Region of Peel - Watermain Break - Sediment to Lake Ontario

Initial Incident Description (as reported):
Created: Chris Mutton (Spills Action Centre) - 2017/11/09 04:12:45 PM
Caller is reporting to SACcm2 that: - Notified at 13:43 of a 3/4" private-side watermain break on a construction site. - Discharge of sediment-rich water into the storm system, which discharges into Lake Ontario. - Outfall is a lagoon at the bottom of Mississauga road. - There is discolouration in the lagoon, but Lake Ontario section is clear. - They are working to isolate the watermain.
EC Copied
SWPIA HVA 6

SAC Action Class:	Watercourse Spills
Non-Standard Procedure:	No

Incident Description:
Last update: David M Keene (Halton-Peel District Office) - 2017/11/18 03:23:50 PM
Latitude:43.555335 Longitude:-79.58564 UTM Zone:17 Easting:614239.09 Northing:4823458.53
Upper Tier Municipality: REGIONAL MUNICIPALITY OF PEEL
Lower/Single Tier Municipality: CITY OF MISSISSAUGA
Township Concession and Lot: TORONTO , PORT CREDIT TOWN PLOT

Assessment Parcel Address: N/A

Assessment Roll #: N/A

Source Water Protection Details for Location

Source Protection Area: Credit Valley
Wellhead Protection Area: No ; score is
Wellhead Protection Area E (GUDI): No ; score is
Intake Protection Zone: No ; score is
Issue Contributing Area: No ; Contaminant:
Significant Groundwater Recharge Area: No ; score is
Highly Vulnerable Aquifer: Yes ; score is 6
Event Based Area: No for type:
Wellhead Protection Area Q1: No ; Stress:
Wellhead Protection Area Q2: No ; Stress:
Intake Protection Zone Q1: No

2017/11/17 @ 1253 - DK - Go to site, no ongoing issues, break appears to have been fixed. Check outfall/lagoon at the end of Mississauga Rd. S, no issues, running clear, sediment has settled. No further action required at this time, recommend close.

Incident Description Continuation:

Not Available

Incident Update:

Not Available

Was there an MOE field response?		Yes	
Site Visit (other than inspection or ERP Response):		Yes	
Inspection:			
ERP Response:			
Date of Arrival at Site:	2017/11/17	Time of Arrival at Site:	12:53
Were there samples collected / analyzed at any time?		No	
Health / Environmental Consequences at the Time of Incident			
Health / Environmental Consequences:		2 - Minor Environment	

Has a Water Body been impacted?	No
Receiving Environment:	Surface Water
Incident Event:	Leak/Break
Incident Reason:	Operator/Human Error
Source Type:	Pipeline/Components
Sector Type:	Other
Specify Other:	Water main
MOE/Other Agencies Involved:	Federal - Environment, Municipal - Works/Utilities Department, Province - MOE-District Office
Was there a discharge / emission / spill of a contaminant to the environment?	
Yes	

Contaminants Table

Contaminant Name	Description	Code	UN#	Limit	Quantity	[units]	[freq]
SEDIMENT(SUSPENDED SOLIDS/ SAND/ SILT)		43	n/a		0	L	

Environmental Compliance Reporting (ECR)

Is this an air emission (measured or modelled) or wastewater (sewage) discharge exceedance that will become part of the Environmental Compliance Report? (legislation, certificate of approval, order, or guideline)
No

Voluntary / Mandatory Abatement

Was there Non-Compliance/Non-Conformance Identified?	☐ Yes ☒ No
Voluntary / Mandatory Abatement Items	
Not Available	

Waste / EGR Information

Waste / EGR Information entries:
Not Available

Document Related Information


Cross Reference:	(doc link)	Task Link:	3334-ASXTD6 
Originating Document:		Created by:	Chris Mutton
Date Created:	2017/11/09	Date Completed:	2018/01/24
Office Receiving Incident Report:	Spills Action Centre	Incident Info Received By:	Chris Mutton
Bring Forward Date:		Bring Forward Reason:	

Signatures

Provincial Officer:

Name:	David M Keene
Badge No:	1622
Work Unit:	
District/Area Office:	Halton-Peel District Office
Date:	2017/11/18
Signature:	

Senior Environmental Officer:

Name:	Leah Noordhof
Work Unit:	
District/Area Office:	
Date:	2018/01/24
Signature:	

APPENDIX H
TSSA Search Results



345 Carlingview Drive
Toronto, Ontario M9W 6N9
Tel.: 416.734.3300
Fax: 416.231.1626
Toll Free: 1.877.682.8772
www.tssa.org

13 April 2022

Irene Hutchison
Pinchin Ltd.
Unit 2 – 2360 Meadowpine Blvd.
Mississauga, ON L5N 6S2

Subject: 23 Helene Street North, Mississauga, Ontario
Your File No.: 306743
SR No.: 3187006

Dear Madam/Sir:

We are in receipt of your correspondence wherein you requested the release of information regarding the above noted subject.

A search of TSSA public records **did not** identify/reveal/locate any documents relating to the following Program(s):

<u>Program</u>	<u>No Record</u>
Fuels Safety	☒
Boiler/Pressure Vessel	☐
Elevating & Amusement Devices	☐

Requested records relating to the following Program(s) were located:

<u>Program</u>	<u>Record</u>	<u>Documents Attached</u>
Fuels Safety	☐	☐
Boiler/Pressure Vessel**	☐	☐
Elevating & Amusement Devices	☐	☐
Other	☐	☐

**For BPV, if it has been indicated that records have been located but are not attached, it is likely that TSSA may not be the keeper of the records you are looking for, see note below.

TSSA does not make any representations or warranties with respect to the accuracy or completeness of any records released. The requestor assumes all risk in using or relying on the information provided.

Should you have any questions, please contact Public Information at publicinformationservices@tssa.org.

Yours truly,

C. Hill

Connie Hill
Public Information Services

Limitations and Notices:

TSSA Fuels Safety:

If you have environmental concerns regarding this property, you should consider hiring an environmental consultant to conduct an environmental assessment of the property in question.

- Sites that have not been licensed since 1987 may not be in TSSA records.
- Be advised, TSSA Fuels Safety Division did not register:
 - private fuel underground/ aboveground storage tanks prior to January of 1990; and
 - furnace oil tanks prior to May 1, 2002.
- Fuels Safety Division does not register
 - private waste oil tanks in apartments, office buildings, residences etc.; and
 - aboveground gas or diesel tanks.
- The *Technical Standards and Safety Act* and associated regulations do not require the registration of private fuel outlets, nor does it require that any documentation on these facilities be submitted to or reviewed or approved by TSSA. As a result, TSSA has limited information on these facilities. TSSA cautions that any information provided may be inaccurate, incomplete or out of date.

TSSA Elevating & Amusement Devices Program Notice:

- All orders and/or directions issued by the TSSA Inspector have a compliance date and the owner or designated contractor are required to comply within the specified time limit.
- All written declarations of compliance (where eligible) should be sent to TSSA. Once a declaration of compliance has been received, the outstanding order will be resolved.
- Each report shows the details and date of the inspection conducted by TSSA at the requested location.
- The Ontario Amusement Devices Regulation (O. Reg. 221/01) was adopted in 2001. Since that time, TSSA retains copies of technical dossiers of new amusement devices in Ontario (as per TSSA's retention policy). However, for rides that existed prior to the adoption of the Regulation, which were subject to a "grandfathering-in" clause, technical dossiers were not required to be filed with the TSSA. However, if the amusement ride remains in operation, as per ASTM requirements, the owner/licensee must possess an operations document for the device in question.

TSSA Boilers and Pressure Vessels (BPVs) Program Notice:

- Be advised, TSSA does not typically inspect BPVs. These inspections are usually performed by insurance companies.
- **Inspection reports are not always submitted to TSSA by insurance companies; therefore, while TSSA may have some evidence of a BPV at a location on file, there may be no inspection records pertaining to BPVs located at the address provided.
- As of July 1, 2018, BPVs in Ontario may not be operated unless the Director has issued a current certificate of inspection (COI) to the owner or operator. A COI will be issued to the owner or operator of the BPV by TSSA after TSSA has received a Record of Inspection (ROI) from the insurer/third-party inspector, the associated fees have been paid and the BPV has passed a periodic inspection.
- Please note that if the BPV in question is insured, the insurance company may have additional inspection records. Please contact the insurer directly should you wish to obtain further information.



345 Carlingview Drive
Toronto, Ontario M9W 6N9
Tel.: 416.734.3300
Fax: 416.231.1626
Toll Free: 1.877.682.8772
www.tssa.org

13 April 2022

Irene Hutchison
Pinchin Ltd.
Unit 2 – 2360 Meadowpine Blvd.
Mississauga, ON L5N 6S2

Subject: 25 Helene Street North, Mississauga, Ontario
Your File No.: 306743
SR No.: 3187010

Dear Madam/Sir:

We are in receipt of your correspondence wherein you requested the release of information regarding the above noted subject.

A search of TSSA public records **did not** identify/reveal/locate any documents relating to the following Program(s):

<u>Program</u>	<u>No Record</u>
Fuels Safety	☒
Boiler/Pressure Vessel	☐
Elevating & Amusement Devices	☐

Requested records relating to the following Program(s) were located:

<u>Program</u>	<u>Record</u>	<u>Documents Attached</u>
Fuels Safety	☐	☐
Boiler/Pressure Vessel**	☐	☐
Elevating & Amusement Devices	☐	☐
Other	☐	☐

**For BPV, if it has been indicated that records have been located but are not attached, it is likely that TSSA may not be the keeper of the records you are looking for, see note below.

TSSA does not make any representations or warranties with respect to the accuracy or completeness of any records released. The requestor assumes all risk in using or relying on the information provided.

Should you have any questions, please contact Public Information at publicinformationservices@tssa.org.

Yours truly,

C. Hill

Connie Hill
Public Information Services

Limitations and Notices:

TSSA Fuels Safety:

If you have environmental concerns regarding this property, you should consider hiring an environmental consultant to conduct an environmental assessment of the property in question.

- Sites that have not been licensed since 1987 may not be in TSSA records.
- Be advised, TSSA Fuels Safety Division did not register:
 - private fuel underground/ aboveground storage tanks prior to January of 1990; and
 - furnace oil tanks prior to May 1, 2002.
- Fuels Safety Division does not register
 - private waste oil tanks in apartments, office buildings, residences etc.; and
 - aboveground gas or diesel tanks.
- The *Technical Standards and Safety Act* and associated regulations do not require the registration of private fuel outlets, nor does it require that any documentation on these facilities be submitted to or reviewed or approved by TSSA. As a result, TSSA has limited information on these facilities. TSSA cautions that any information provided may be inaccurate, incomplete or out of date.

TSSA Elevating & Amusement Devices Program Notice:

- All orders and/or directions issued by the TSSA Inspector have a compliance date and the owner or designated contractor are required to comply within the specified time limit.
- All written declarations of compliance (where eligible) should be sent to TSSA. Once a declaration of compliance has been received, the outstanding order will be resolved.
- Each report shows the details and date of the inspection conducted by TSSA at the requested location.
- The Ontario Amusement Devices Regulation (O. Reg. 221/01) was adopted in 2001. Since that time, TSSA retains copies of technical dossiers of new amusement devices in Ontario (as per TSSA's retention policy). However, for rides that existed prior to the adoption of the Regulation, which were subject to a "grandfathering-in" clause, technical dossiers were not required to be filed with the TSSA. However, if the amusement ride remains in operation, as per ASTM requirements, the owner/licensee must possess an operations document for the device in question.

TSSA Boilers and Pressure Vessels (BPVs) Program Notice:

- Be advised, TSSA does not typically inspect BPVs. These inspections are usually performed by insurance companies.
- **Inspection reports are not always submitted to TSSA by insurance companies; therefore, while TSSA may have some evidence of a BPV at a location on file, there may be no inspection records pertaining to BPVs located at the address provided.
- As of July 1, 2018, BPVs in Ontario may not be operated unless the Director has issued a current certificate of inspection (COI) to the owner or operator. A COI will be issued to the owner or operator of the BPV by TSSA after TSSA has received a Record of Inspection (ROI) from the insurer/third-party inspector, the associated fees have been paid and the BPV has passed a periodic inspection.
- Please note that if the BPV in question is insured, the insurance company may have additional inspection records. Please contact the insurer directly should you wish to obtain further information.



345 Carlingview Drive
Toronto, Ontario M9W 6N9
Tel.: 416.734.3300
Fax: 416.231.1626
Toll Free: 1.877.682.8772
www.tssa.org

13 April 2022

Irene Hutchison
Pinchin Ltd.
Unit 2 – 2360 Meadowpine Blvd.
Mississauga, ON L5N 6S2

Subject: 27 Helene Street North, Mississauga, Ontario
Your File No.: 306743
SR No.: 3187012

Dear Madam/Sir:

We are in receipt of your correspondence wherein you requested the release of information regarding the above noted subject.

A search of TSSA public records **did not** identify/reveal/locate any documents relating to the following Program(s):

<u>Program</u>	<u>No Record</u>
Fuels Safety	☒
Boiler/Pressure Vessel	☐
Elevating & Amusement Devices	☐

Requested records relating to the following Program(s) were located:

<u>Program</u>	<u>Record</u>	<u>Documents Attached</u>
Fuels Safety	☐	☐
Boiler/Pressure Vessel**	☐	☐
Elevating & Amusement Devices	☐	☐
Other	☐	☐

**For BPV, if it has been indicated that records have been located but are not attached, it is likely that TSSA may not be the keeper of the records you are looking for, see note below.

TSSA does not make any representations or warranties with respect to the accuracy or completeness of any records released. The requestor assumes all risk in using or relying on the information provided.

Should you have any questions, please contact Public Information at publicinformationservices@tssa.org.

Yours truly,

C. Hill

Connie Hill
Public Information Services

Limitations and Notices:

TSSA Fuels Safety:

If you have environmental concerns regarding this property, you should consider hiring an environmental consultant to conduct an environmental assessment of the property in question.

- Sites that have not been licensed since 1987 may not be in TSSA records.
- Be advised, TSSA Fuels Safety Division did not register:
 - private fuel underground/ aboveground storage tanks prior to January of 1990; and
 - furnace oil tanks prior to May 1, 2002.
- Fuels Safety Division does not register
 - private waste oil tanks in apartments, office buildings, residences etc.; and
 - aboveground gas or diesel tanks.
- The *Technical Standards and Safety Act* and associated regulations do not require the registration of private fuel outlets, nor does it require that any documentation on these facilities be submitted to or reviewed or approved by TSSA. As a result, TSSA has limited information on these facilities. TSSA cautions that any information provided may be inaccurate, incomplete or out of date.

TSSA Elevating & Amusement Devices Program Notice:

- All orders and/or directions issued by the TSSA Inspector have a compliance date and the owner or designated contractor are required to comply within the specified time limit.
- All written declarations of compliance (where eligible) should be sent to TSSA. Once a declaration of compliance has been received, the outstanding order will be resolved.
- Each report shows the details and date of the inspection conducted by TSSA at the requested location.
- The Ontario Amusement Devices Regulation (O. Reg. 221/01) was adopted in 2001. Since that time, TSSA retains copies of technical dossiers of new amusement devices in Ontario (as per TSSA's retention policy). However, for rides that existed prior to the adoption of the Regulation, which were subject to a "grandfathering-in" clause, technical dossiers were not required to be filed with the TSSA. However, if the amusement ride remains in operation, as per ASTM requirements, the owner/licensee must possess an operations document for the device in question.

TSSA Boilers and Pressure Vessels (BPVs) Program Notice:

- Be advised, TSSA does not typically inspect BPVs. These inspections are usually performed by insurance companies.
- **Inspection reports are not always submitted to TSSA by insurance companies; therefore, while TSSA may have some evidence of a BPV at a location on file, there may be no inspection records pertaining to BPVs located at the address provided.
- As of July 1, 2018, BPVs in Ontario may not be operated unless the Director has issued a current certificate of inspection (COI) to the owner or operator. A COI will be issued to the owner or operator of the BPV by TSSA after TSSA has received a Record of Inspection (ROI) from the insurer/third-party inspector, the associated fees have been paid and the BPV has passed a periodic inspection.
- Please note that if the BPV in question is insured, the insurance company may have additional inspection records. Please contact the insurer directly should you wish to obtain further information.



345 Carlingview Drive
Toronto, Ontario M9W 6N9
Tel.: 416.734.3300
Fax: 416.231.1626
Toll Free: 1.877.682.8772
www.tssa.org

13 April 2022

Irene Hutchison
Pinchin Ltd.
Unit 2 – 2360 Meadowpine Blvd.
Mississauga, ON L5N 6S2

Subject: 29 Helene Street North, Mississauga, Ontario
Your File No.: 306743
SR No.: 3187024

Dear Madam/Sir:

We are in receipt of your correspondence wherein you requested the release of information regarding the above noted subject.

A search of TSSA public records **did not** identify/reveal/locate any documents relating to the following Program(s):

<u>Program</u>	<u>No Record</u>
Fuels Safety	☒
Boiler/Pressure Vessel	☐
Elevating & Amusement Devices	☐

Requested records relating to the following Program(s) were located:

<u>Program</u>	<u>Record</u>	<u>Documents Attached</u>
Fuels Safety	☐	☐
Boiler/Pressure Vessel**	☐	☐
Elevating & Amusement Devices	☐	☐
Other	☐	☐

**For BPV, if it has been indicated that records have been located but are not attached, it is likely that TSSA may not be the keeper of the records you are looking for, see note below.

TSSA does not make any representations or warranties with respect to the accuracy or completeness of any records released. The requestor assumes all risk in using or relying on the information provided.

Should you have any questions, please contact Public Information at publicinformationservices@tssa.org.

Yours truly,

C. Hill

Connie Hill
Public Information Services

Limitations and Notices:

TSSA Fuels Safety:

If you have environmental concerns regarding this property, you should consider hiring an environmental consultant to conduct an environmental assessment of the property in question.

- Sites that have not been licensed since 1987 may not be in TSSA records.
- Be advised, TSSA Fuels Safety Division did not register:
 - private fuel underground/ aboveground storage tanks prior to January of 1990; and
 - furnace oil tanks prior to May 1, 2002.
- Fuels Safety Division does not register
 - private waste oil tanks in apartments, office buildings, residences etc.; and
 - aboveground gas or diesel tanks.
- The *Technical Standards and Safety Act* and associated regulations do not require the registration of private fuel outlets, nor does it require that any documentation on these facilities be submitted to or reviewed or approved by TSSA. As a result, TSSA has limited information on these facilities. TSSA cautions that any information provided may be inaccurate, incomplete or out of date.

TSSA Elevating & Amusement Devices Program Notice:

- All orders and/or directions issued by the TSSA Inspector have a compliance date and the owner or designated contractor are required to comply within the specified time limit.
- All written declarations of compliance (where eligible) should be sent to TSSA. Once a declaration of compliance has been received, the outstanding order will be resolved.
- Each report shows the details and date of the inspection conducted by TSSA at the requested location.
- The Ontario Amusement Devices Regulation (O. Reg. 221/01) was adopted in 2001. Since that time, TSSA retains copies of technical dossiers of new amusement devices in Ontario (as per TSSA's retention policy). However, for rides that existed prior to the adoption of the Regulation, which were subject to a "grandfathering-in" clause, technical dossiers were not required to be filed with the TSSA. However, if the amusement ride remains in operation, as per ASTM requirements, the owner/licensee must possess an operations document for the device in question.

TSSA Boilers and Pressure Vessels (BPVs) Program Notice:

- Be advised, TSSA does not typically inspect BPVs. These inspections are usually performed by insurance companies.
- **Inspection reports are not always submitted to TSSA by insurance companies; therefore, while TSSA may have some evidence of a BPV at a location on file, there may be no inspection records pertaining to BPVs located at the address provided.
- As of July 1, 2018, BPVs in Ontario may not be operated unless the Director has issued a current certificate of inspection (COI) to the owner or operator. A COI will be issued to the owner or operator of the BPV by TSSA after TSSA has received a Record of Inspection (ROI) from the insurer/third-party inspector, the associated fees have been paid and the BPV has passed a periodic inspection.
- Please note that if the BPV in question is insured, the insurance company may have additional inspection records. Please contact the insurer directly should you wish to obtain further information.



345 Carlingview Drive
Toronto, Ontario M9W 6N9
Tel.: 416.734.3300
Fax: 416.231.1626
Toll Free: 1.877.682.8772
www.tssa.org

13 April 2022

Irene Hutchison
Pinchin Ltd.
Unit 2 – 2360 Meadowpine Blvd.
Mississauga, ON L5N 6S2

Subject: 31 Helene Street North, Mississauga, Ontario
Your File No.: 306743
SR No.: 3187028

Dear Madam/Sir:

We are in receipt of your correspondence wherein you requested the release of information regarding the above noted subject.

A search of TSSA public records **did not** identify/reveal/locate any documents relating to the following Program(s):

<u>Program</u>	<u>No Record</u>
Fuels Safety	☒
Boiler/Pressure Vessel	☐
Elevating & Amusement Devices	☐

Requested records relating to the following Program(s) were located:

<u>Program</u>	<u>Record</u>	<u>Documents Attached</u>
Fuels Safety	☐	☐
Boiler/Pressure Vessel**	☐	☐
Elevating & Amusement Devices	☐	☐
Other	☐	☐

**For BPV, if it has been indicated that records have been located but are not attached, it is likely that TSSA may not be the keeper of the records you are looking for, see note below.

TSSA does not make any representations or warranties with respect to the accuracy or completeness of any records released. The requestor assumes all risk in using or relying on the information provided.

Should you have any questions, please contact Public Information at publicinformationservices@tssa.org.

Yours truly,

C. Hill

Connie Hill
Public Information Services

Limitations and Notices:

TSSA Fuels Safety:

If you have environmental concerns regarding this property, you should consider hiring an environmental consultant to conduct an environmental assessment of the property in question.

- Sites that have not been licensed since 1987 may not be in TSSA records.
- Be advised, TSSA Fuels Safety Division did not register:
 - private fuel underground/ aboveground storage tanks prior to January of 1990; and
 - furnace oil tanks prior to May 1, 2002.
- Fuels Safety Division does not register
 - private waste oil tanks in apartments, office buildings, residences etc.; and
 - aboveground gas or diesel tanks.
- The *Technical Standards and Safety Act* and associated regulations do not require the registration of private fuel outlets, nor does it require that any documentation on these facilities be submitted to or reviewed or approved by TSSA. As a result, TSSA has limited information on these facilities. TSSA cautions that any information provided may be inaccurate, incomplete or out of date.

TSSA Elevating & Amusement Devices Program Notice:

- All orders and/or directions issued by the TSSA Inspector have a compliance date and the owner or designated contractor are required to comply within the specified time limit.
- All written declarations of compliance (where eligible) should be sent to TSSA. Once a declaration of compliance has been received, the outstanding order will be resolved.
- Each report shows the details and date of the inspection conducted by TSSA at the requested location.
- The Ontario Amusement Devices Regulation (O. Reg. 221/01) was adopted in 2001. Since that time, TSSA retains copies of technical dossiers of new amusement devices in Ontario (as per TSSA's retention policy). However, for rides that existed prior to the adoption of the Regulation, which were subject to a "grandfathering-in" clause, technical dossiers were not required to be filed with the TSSA. However, if the amusement ride remains in operation, as per ASTM requirements, the owner/licensee must possess an operations document for the device in question.

TSSA Boilers and Pressure Vessels (BPVs) Program Notice:

- Be advised, TSSA does not typically inspect BPVs. These inspections are usually performed by insurance companies.
- **Inspection reports are not always submitted to TSSA by insurance companies; therefore, while TSSA may have some evidence of a BPV at a location on file, there may be no inspection records pertaining to BPVs located at the address provided.
- As of July 1, 2018, BPVs in Ontario may not be operated unless the Director has issued a current certificate of inspection (COI) to the owner or operator. A COI will be issued to the owner or operator of the BPV by TSSA after TSSA has received a Record of Inspection (ROI) from the insurer/third-party inspector, the associated fees have been paid and the BPV has passed a periodic inspection.
- Please note that if the BPV in question is insured, the insurance company may have additional inspection records. Please contact the insurer directly should you wish to obtain further information.



345 Carlingview Drive
Toronto, Ontario M9W 6N9
Tel.: 416.734.3300
Fax: 416.231.1626
Toll Free: 1.877.682.8772
www.tssa.org

04 April 2022

Irene Hutchison
Pinchin Ltd.
2360 Meadowpine Boulevard, Unit 2,
Mississauga, ON L5N 6S2

Subject: 70 Park Street East, Mississauga, ON
Your File No.: 306743
SR No.: 3184294

Dear Madam/Sir:

We are in receipt of your correspondence wherein you requested the release of information regarding the above noted subject.

A search of TSSA public records **did not** identify/reveal/locate any documents relating to the following Program(s):

<u>Program</u>	<u>No Record</u>
Fuels Safety	☒
Boiler/Pressure Vessel	☐
Elevating & Amusement Devices	☐

Requested records relating to the following Program(s) were located:

<u>Program</u>	<u>Record</u>	<u>Documents Attached</u>
Fuels Safety	☐	☐
Boiler/Pressure Vessel**	☐	☐
Elevating & Amusement Devices	☐	☐
Other	☐	☐

**For BPV, if it has been indicated that records have been located but are not attached, it is likely that TSSA may not be the keeper of the records you are looking for, see note below.

TSSA does not make any representations or warranties with respect to the accuracy or completeness of any records released. The requestor assumes all risk in using or relying on the information provided.

Should you have any questions, please contact Public Information at publicinformationservices@tssa.org.

Yours truly,

Mariah Falzon
Mariah Falzon
Public Information Services

Limitations and Notices:

TSSA Fuels Safety:

If you have environmental concerns regarding this property, you should consider hiring an environmental consultant to conduct an environmental assessment of the property in question.

- Sites that have not been licensed since 1987 may not be in TSSA records.
- Be advised, TSSA Fuels Safety Division did not register:
 - private fuel underground/ aboveground storage tanks prior to January of 1990; and
 - furnace oil tanks prior to May 1, 2002.
- Fuels Safety Division does not register
 - private waste oil tanks in apartments, office buildings, residences etc.; and
 - aboveground gas or diesel tanks.
- The *Technical Standards and Safety Act* and associated regulations do not require the registration of private fuel outlets, nor does it require that any documentation on these facilities be submitted to or reviewed or approved by TSSA. As a result, TSSA has limited information on these facilities. TSSA cautions that any information provided may be inaccurate, incomplete or out of date.

TSSA Elevating & Amusement Devices Program Notice:

- All orders and/or directions issued by the TSSA Inspector have a compliance date and the owner or designated contractor are required to comply within the specified time limit.
- All written declarations of compliance (where eligible) should be sent to TSSA. Once a declaration of compliance has been received, the outstanding order will be resolved.
- Each report shows the details and date of the inspection conducted by TSSA at the requested location.
- The Ontario Amusement Devices Regulation (O. Reg. 221/01) was adopted in 2001. Since that time, TSSA retains copies of technical dossiers of new amusement devices in Ontario (as per TSSA's retention policy). However, for rides that existed prior to the adoption of the Regulation, which were subject to a "grandfathering-in" clause, technical dossiers were not required to be filed with the TSSA. However, if the amusement ride remains in operation, as per ASTM requirements, the owner/licensee must possess an operations document for the device in question.

TSSA Boilers and Pressure Vessels (BPVs) Program Notice:

- Be advised, TSSA does not typically inspect BPVs. These inspections are usually performed by insurance companies.
- **Inspection reports are not always submitted to TSSA by insurance companies; therefore, while TSSA may have some evidence of a BPV at a location on file, there may be no inspection records pertaining to BPVs located at the address provided.
- As of July 1, 2018, BPVs in Ontario may not be operated unless the Director has issued a current certificate of inspection (COI) to the owner or operator. A COI will be issued to the owner or operator of the BPV by TSSA after TSSA has received a Record of Inspection (ROI) from the insurer/third-party inspector, the associated fees have been paid and the BPV has passed a periodic inspection.
- Please note that if the BPV in question is insured, the insurance company may have additional inspection records. Please contact the insurer directly should you wish to obtain further information.

APPENDIX I
Aerial Photographs



HISTORICAL **AERIALS**

Project Property:	Phase One ESA 23 Helene St N Mississauga ON L5G 3B6
Project No:	314281
Requested By:	Pinchin Ltd.
Order No:	22091501030
Date Completed:	September 20, 2022

Decade	Year	Image Scale	Source
1920	Not Available		
1930	1931	15000	NAPL
1940	1946	15000	NAPL
1950	1950	10000	NAPL
1960	Not Available		
1970	1974	15000	NAPL
1980	1984	25000	NAPL
1990	Not Available		
2000	Not Available		
2010	2019	13000	Maxar

Aerial Maps included in this report are produced by the sources listed above and are to be used for research purposes including a phase I report. Maps are not to be resold as commercial property. No warranty of Accuracy or Liability for ERIS: The information contained in this report has been produced by ERIS Information Inc.(in the US) and ERIS Information Limited Partnership (in Canada), both doing business as 'ERIS', using aerial photos listed in above sources. The maps contained in this report does not purport to be and does not constitute a guarantee of the accuracy of the information contained herein. Although ERIS has endeavored to present you with information that is accurate, ERIS disclaims, any and all liability for any errors, omissions, or inaccuracies in such information and data, whether attributable to inadvertence, negligence or otherwise, and for any consequences arising therefrom. Liability on the part of ERIS is limited to the monetary value paid for this report.

Environmental Risk Information Services

A division of Glacier Media Inc.

1.866.517.5204 | info@erisinfo.com | erisinfo.com



0 0.125 0.25 0.5
Kilometers

Order Number: 22091501030

Year: 1931
Source: NAPL
Map Scale: 1: 10000
Comments: Best Copy Available





0 0.125 0.25 0.5
Kilometers

Order Number: 22091501030

Year: 1946
Source: NAPL
Map Scale: 1: 10000
Comments:





0 0.125 0.25 0.5
Kilometers

Order Number: 22091501030

Year: 1950
Source: NAPL
Map Scale: 1: 10000
Comments:





0 0.125 0.25 0.5
Kilometers

Order Number: 22091501030

Year: 1974
Source: NAPL
Map Scale: 1: 10000
Comments:





0 0.125 0.25 0.5
Kilometers

Order Number: 22091501030

Year: 1984
Source: NAPL
Map Scale: 1: 10000
Comments:





0 0.125 0.25 0.5
Kilometers

Order Number: 22091501030

Year: 2019
Source: Maxar
Map Scale: 1: 10000
Comments:



APPENDIX J
Maps



Property Information

Order Number:	22091501030p
Date Completed:	September 18, 2022
Project Number:	314281
Project Property:	Phase One ESA 23 Helene St N Mississauga ON L5G 3B6
Coordinates:	
Latitude:	43.55598644
Longitude:	-79.58598554
UTM Northing:	4823530.23612 Metres
UTM Easting:	614209.852693 Metres
UTM Zone:	UTM Zone 17T
Elevation:	78.85 m
Slope Direction:	S

Property Information.....	1
Topographic Information.....	2
Hydrologic Information.....	4
Geologic Information.....	5
Soil Information.....	10
Wells and Additional Sources.....	18
Report Summary.....	19
Detail Report.....	21
Radon Information.....	246
Area of Natural and Scientific Interest.....	247
Appendix.....	249
Liability Notice.....	251


The ERIS **Physical Setting Report - PSR** provides comprehensive information about the physical setting around a site and includes a complete overview of topography as well as hydrologic, geologic and soil characteristics. The location and detailed attributes of oil and gas wells, water wells, and radon are also included for review.

The compilation of both physical characteristics of a site and additional attribute data is useful in assessing the impact of migration of contaminants and subsequent impact on soils and groundwater.

Disclaimer

This Report does not provide a full environmental evaluation for the site or adjacent properties. Please see the terms and disclaimer at the end of the Report for greater detail.

Topographic Information

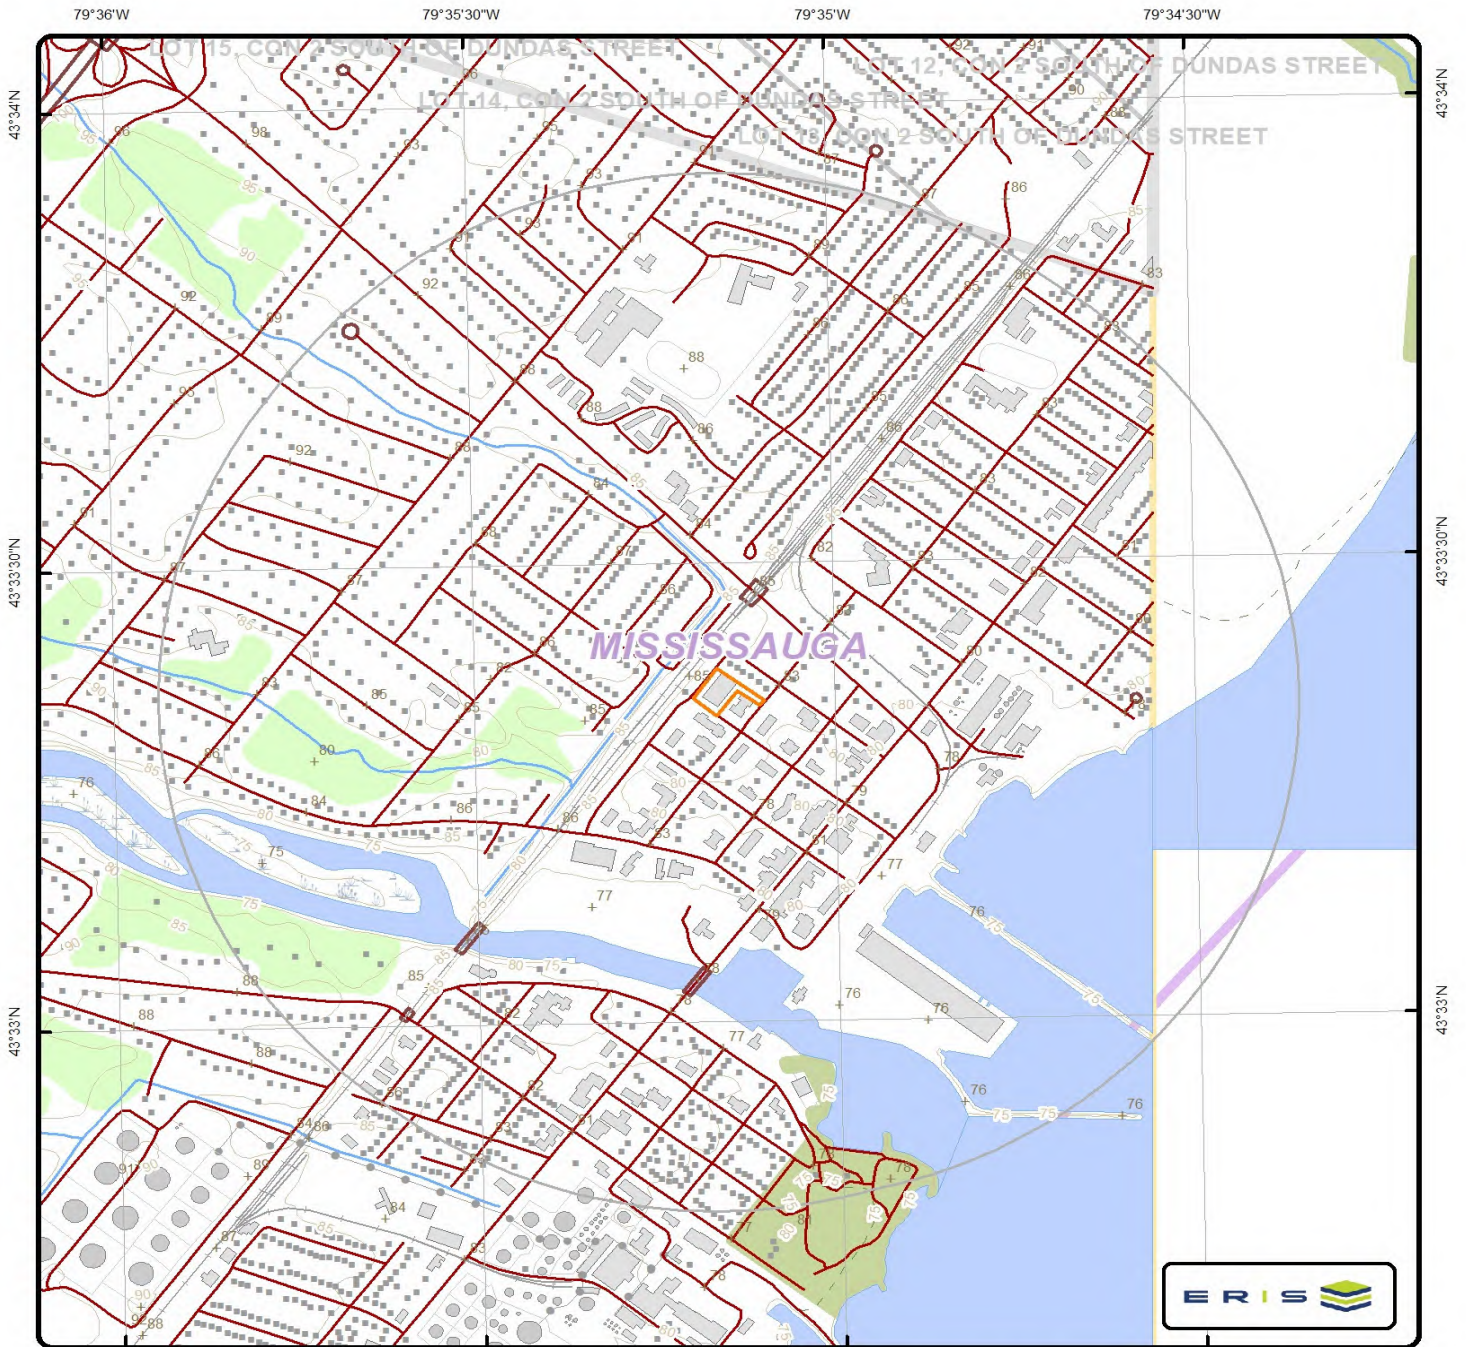

Topographic Map

Address: 23 Helene St N, Mississauga, ON

+	Spot Height (metre)	—	Transportation Structure	—	Contour Line	■	Wooded Area
■	Building Point	—	Utility Line	□	Pit or Quarry	■	Conservation Authority
⚡	Towers	—	Water Structure	■	Waterbody	■	Conservation Area
●	Utility Site Point	—	Drainage Line Feature	■	Wetlands	■	Municipal Park
—	Misc. Line	—	River or Stream	■	Concession	■	Provincial Park
—	Railroads	—	Airports	■	Lots	■	National Park
—	Roads	—	Tanks	■	Municipality	■	Nature Reserve
---	Trail	—	Building to Scale	■	Land Ownership		


Data source: Ontario Base Mapping (OBM) by Ontario Ministry of Natural Resources.

Topographic Information

The previous topographic map(s) show general topographic information in the surrounding area of the project property, using Toporama data or a provincial source when available. Below are shaded relief map(s), derived from Digital Elevation data to depict terrain in further detail.

Topographic information at project property:

Elevation: 78.85 m
Slope Direction: S

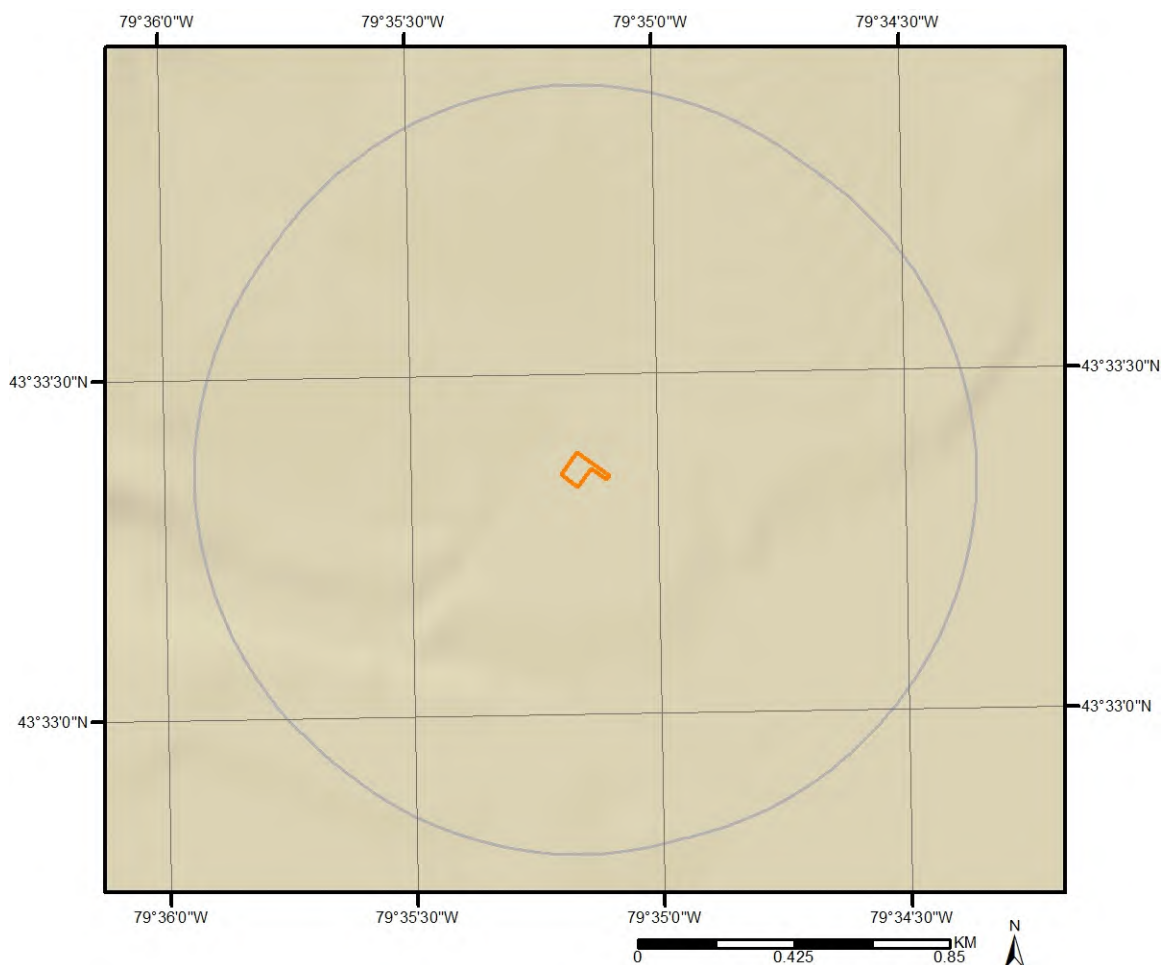

Hydrologic Information



Wetland

This map shows wetland existence. Data coverage is shown to the right. Gray indicates no data available in the area.


- Evaluated PSW
- Swamp
- Marsh
- Open Water



Geologic Information



Bedrock Geology



This map shows bedrock geologic units in the area. Please refer to the report for detailed descriptions. Data coverage is shown to the right. Gray indicates no data available in the area.



Geologic Information

Detailed bedrock geology information about each unit within the search radius is provided below.

Unit ID 20475

Unit Name:

Rock Type:

Shale, limestone, dolostone, siltstone

Strata:

Georgian Bay Formation; Blue Mountain Formation; Billings Formation;
Collingwood Member; Eastview Member

Super Eon:

Eon:

PHANEROZOIC (Present to 542.0 Ma)

Era:

PALEOZOIC (251.0 Ma to 542.0 Ma)

Period:


ORDOVICIAN (443.7 Ma to 488.3 Ma)

Epoch:

UPPER ORDOVICIAN



Province:

Tectonic Zone:

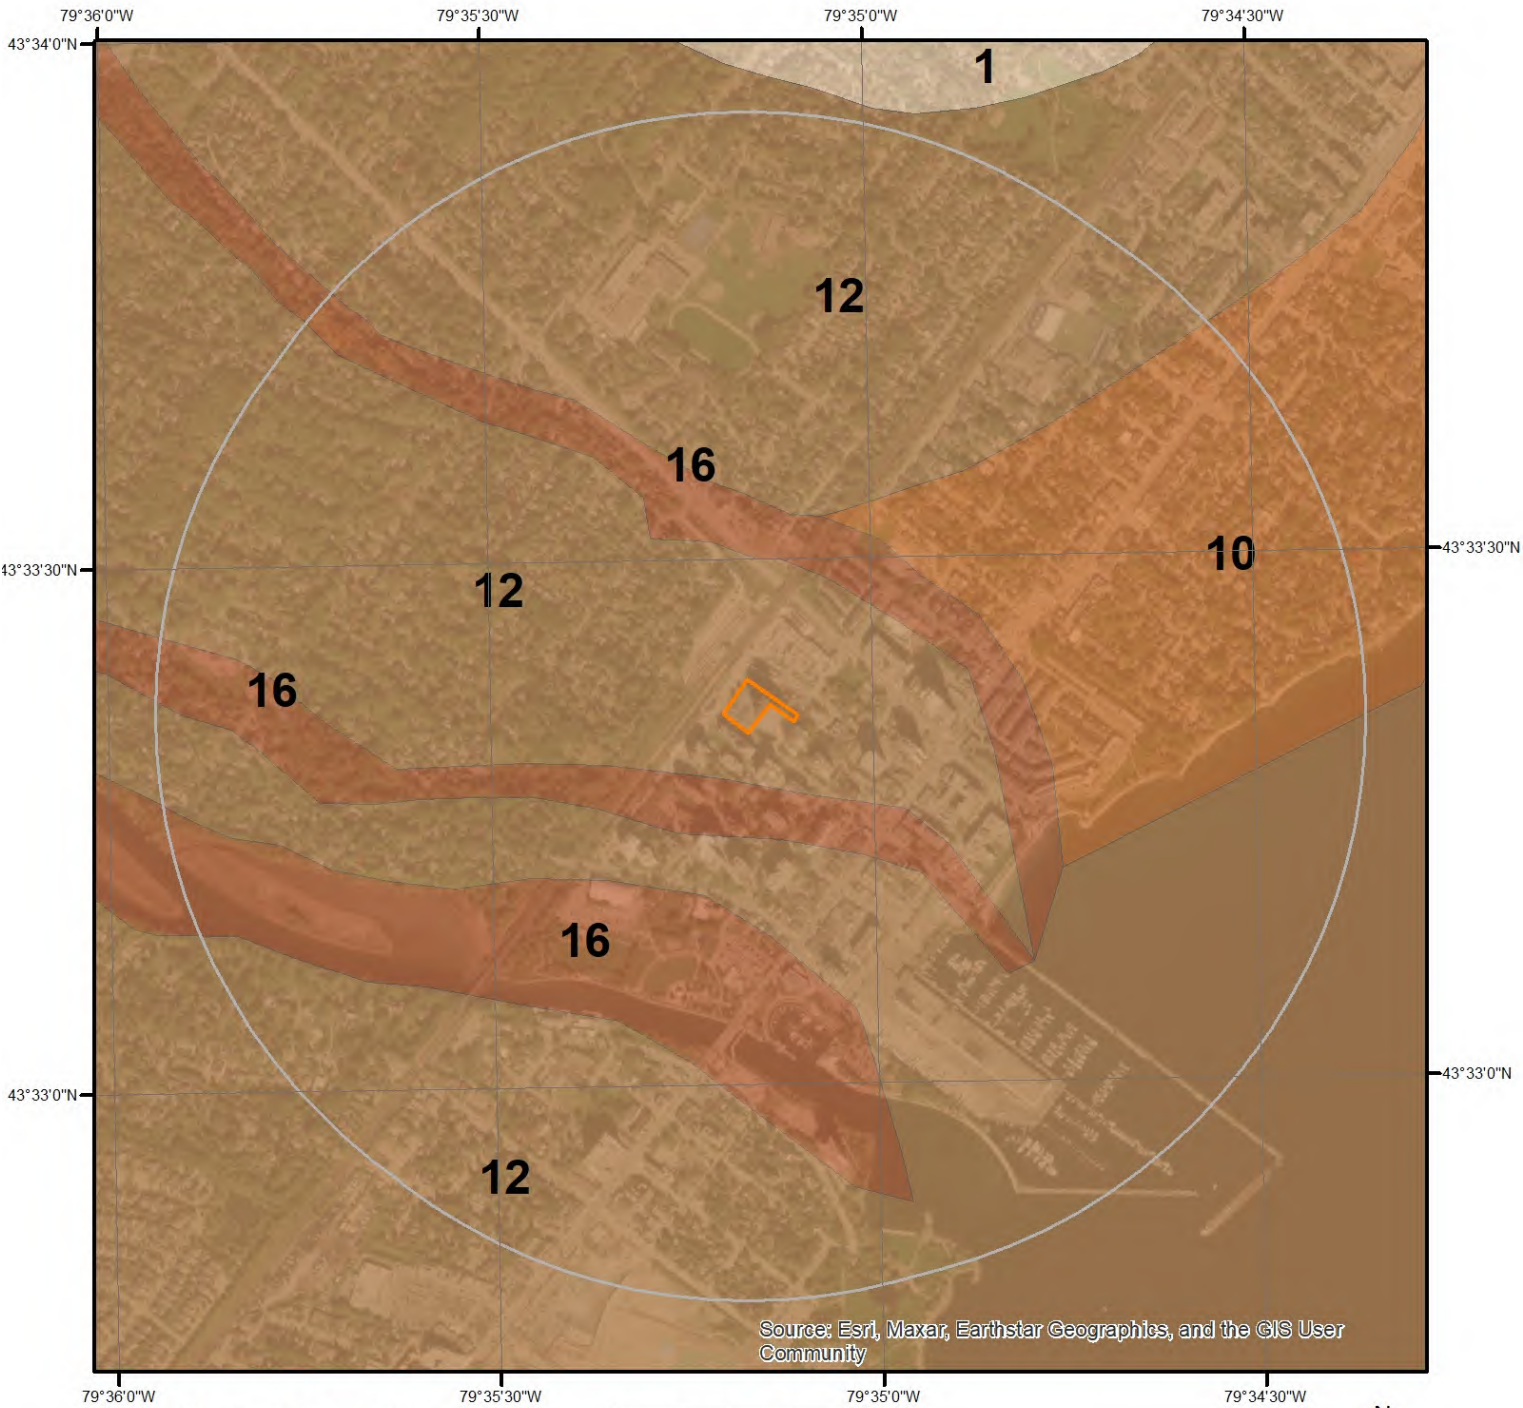

Surficial Geology

This map shows surficial geologic labels in the area. Please refer to the report for detailed descriptions. Data coverage is shown to the right. Gray indicates no data available in the area.

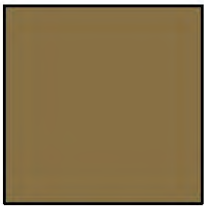

Geologic Information

Detailed surficial geology information about each unit within the search radius is provided below.

Unit ID 16

Geological Deposit:	Modern Alluvium
Deposit Age:	Recent
Primary Material:	clay, silt, sand, gravel
Secondary Material:	
Primary General:	fluvial
Primary General Modifier:	modern floodplain
Veneer:	
Episode:	Hudson
Sub Episode:	
Strata Modifier:	Surface
Provenance:	
Carbon Content:	
Formation:	
Permeability:	Variable
Material Description:	Undifferentiated Gravel, Sand, Silt, Clay, Muck

Unit ID 12

Geological Deposit:	Deltaic And Lacustrine Deposits
Deposit Age:	Late Wisconsinan
Primary Material:	sand
Secondary Material:	
Primary General:	glaciolacustrine
Primary General Modifier:	deltaic
Veneer:	
Episode:	Wisconsin
Sub Episode:	Michigan
Strata Modifier:	Surface
Provenance:	
Carbon Content:	
Formation:	
Permeability:	High
Material Description:	Predominantly Gravelly Sand And Silty Sand

Unit ID 10

Geological Deposit:	Glaciolacustrine Deposits
Deposit Age:	Late Wisconsinan
Primary Material:	clay, silt
Secondary Material:	diamicton
Primary General:	glaciolacustrine


Geologic Information

Primary General Modifier:	foreshore/basinal
Veneer:	
Episode:	Wisconsin
Sub Episode:	Michigan
Strata Modifier:	Surface
Provenance:	
Carbon Content:	
Formation:	
Permeability:	Low
Material Description:	Massive To Laminated Silt And Clay, May Contain Poorly Sorted Diamicton Layers

Soil Information



Soil Map



This map shows soil units around the target property. Please refer to the report for detailed soil descriptions.



Soil Information

Detailed soil information about each unit within the search radius is provided below.

Ontario Detailed Soil Survey (DSS3)

Polygon ID: OND024075996

Component

Component ID:	OND02407599601	Components(%):	100
Soil Name ID:	ONZUN~~~~~N	Slope Steepness(%):	Unknown or Not applicable
Component No:	1	Slope Length(m):	-9
Surface Stoniness Class:	Nonstony		

Component Rating

Field Crops Capability:	Very severe limitations preclude annual cultivation; improvements feasible.
First CLI Limitation Subclass:	Subject to occasional flooding (Inundation) from adjacent streams or waterbodies
Second CLI Limitation Subclass:	
Drainage:	Poorly
Soil Texture of A Horizon:	
Hydrological Soil Groups:	

Soil Name

Soil Name:	UNCLASSIFIED
Kind of Surface Material:	Unclassified
Soil Drainage Class:	Not applicable
Water Table Characteristics:	Unspecified period
Layer that Restricts Root Growth:	No root restricting layer
Type of Root Restricting Layer:	n/a
Parent Material 1, 2, 3:	Not Applicable; Not Applicable; Not Applicable
Mode of Deposition 1,2,3:	Not Applicable; Not Applicable; Not Applicable
Parent Material Chemical Property 1,2,3:	Not Applicable; Not Applicable; Not Applicable

Polygon ID: OND024075403

Component

Soil Information

Component ID:	OND02407540301	Components(%):	100
Soil Name ID:	ONZUN~~~~~N	Slope Steepness(%):	Unknown or Not applicable
Component No:	1	Slope Length(m):	-9
Surface Stoniness Class:	Nonstony		

Component Rating

Field Crops Capability: Very severe limitations preclude annual cultivation; improvements feasible.

First CLI Limitation Subclass: Subject to occasional flooding (Inundation) from adjacent streams or waterbodies

Second CLI Limitation Subclass:

Drainage: Poorly

Soil Texture of A Horizon:

Hydrological Soil Groups:

Soil Name

Soil Name: UNCLASSIFIED

Kind of Surface Material: Unclassified

Soil Drainage Class: Not applicable

Water Table Characteristics: Unspecified period

Layer that Restricts Root Growth: No root restricting layer

Type of Root Restricting Layer: n/a

Parent Material 1, 2, 3: Not Applicable; Not Applicable; Not Applicable

Mode of Deposition 1,2,3: Not Applicable; Not Applicable; Not Applicable

Parent Material Chemical Property 1,2,3: Not Applicable; Not Applicable; Not Applicable

Polygon ID: OND024075247

Component

Component ID:	OND02407524701	Components(%):	100
Soil Name ID:	ONFOX~~~~~A	Slope Steepness(%):	7
Component No:	1	Slope Length(m):	-9
Surface Stoniness Class:	Nonstony		

Component Rating

Soil Information

Field Crops Capability:	moderate limitations on use for crops
First CLI Limitation	Low inherent soil Fertility
Subclass:	
Second CLI Limitation	Low inherent Moisture holding capacity
Subclass:	
Drainage:	Well
Soil Texture of A Horizon:	coarse sand and loamy sand
Hydrological Soil Groups:	Soils that have a low runoff potential and high infiltration rate, as the soils typically are sands and gravel.

Soil Name

Soil Name:	FOX
Kind of Surface Material:	Mineral
Soil Drainage Class:	Well drained
Water Table	Unspecified period
Charateristics:	
Layer that Restricts Root Growth:	No root restricting layer
Type of Root Restricting Layer:	n/a
Parent Material 1, 2, 3:	Very Coarse; Not Applicable; Not Applicable
Mode of Deposition 1,2,3:	Glaciolacustrine; Not Applicable; Not Applicable
Parent Material Chemical Property 1,2,3:	Moderately / Very Strongly Calcareous; Not Applicable; Not Applicable

Soil Layer

Layer No:	1	Very Fine Sand(%):	5
Horizon:	Ap	Total Sand(%):	64
Depth(cm):	0-30	Total Silt(%):	24
pH in Calc Chloride:	7.3	Total Clay(%):	12
Saturated Hydraulic Conductivity(cm/h):	2.398	Organic Carbon(%):	1.9
Electrical Conductivity (dS/m):	0		
Layer No:	2	Very Fine Sand(%):	5
Horizon:	Bm	Total Sand(%):	64
Depth(cm):	30-45	Total Silt(%):	25
pH in Calc Chloride:	7.3	Total Clay(%):	11
Saturated Hydraulic Conductivity(cm/h):	2.173	Organic Carbon(%):	1.5
Electrical Conductivity (dS/m):	0		
Layer No:	3	Very Fine Sand(%):	4
Horizon:	Bm	Total Sand(%):	82
Depth(cm):	45-56	Total Silt(%):	9
pH in Calc Chloride:	7.4	Total Clay(%):	9

Soil Information

Saturated Hydraulic Conductivity(cm/h):	3.535	Organic Carbon(%):	0.5
Electrical Conductivity (dS/m):	0		
Layer No:	4	Very Fine Sand(%):	8
Horizon:	Ck	Total Sand(%):	89
Depth(cm):	56-100	Total Silt(%):	7
pH in Calc Chloride:	7.5	Total Clay(%):	4
Saturated Hydraulic Conductivity(cm/h):	5.404	Organic Carbon(%):	0
Electrical Conductivity (dS/m):	0		

Polygon ID: OND024075246

Component

Component ID:	OND02407524601	Components(%):	100
Soil Name ID:	ONFOX~~~~~A	Slope Steepness(%):	7
Component No:	1	Slope Length(m):	-9
Surface Stoniness Class:	Nonstony		

Component Rating

Field Crops Capability:	moderate limitations on use for crops
First CLI Limitation Subclass:	Low inherent soil Fertility
Second CLI Limitation Subclass:	Low inherent Moisture holding capacity
Drainage:	Well
Soil Texture of A Horizon:	coarse sand and loamy sand
Hydrological Soil Groups:	Soils that have a low runoff potential and high infiltration rate, as the soils typically are sands and gravel.

Soil Name

Soil Name:	FOX
Kind of Surface Material:	Mineral
Soil Drainage Class:	Well drained
Water Table Characteristics:	Unspecified period
Layer that Restricts Root Growth:	No root restricting layer
Type of Root Restricting Layer:	n/a
Parent Material 1, 2, 3:	Very Coarse; Not Applicable; Not Applicable
Mode of Deposition 1,2,3:	Glaciolacustrine; Not Applicable; Not Applicable

Soil Information

Parent Material Chemical Property 1,2,3: Moderately / Very Strongly Calcareous; Not Applicable; Not Applicable

Soil Layer

Layer No:	1	Very Fine Sand(%):	5
Horizon:	Ap	Total Sand(%):	64
Depth(cm):	0-30	Total Silt(%):	24
pH in Calc Chloride:	7.3	Total Clay(%):	12
Saturated Hydraulic Conductivity(cm/h):	2.398	Organic Carbon(%):	1.9
Electrical Conductivity (dS/m):	0		
Layer No:	2	Very Fine Sand(%):	5
Horizon:	Bm	Total Sand(%):	64
Depth(cm):	30-45	Total Silt(%):	25
pH in Calc Chloride:	7.3	Total Clay(%):	11
Saturated Hydraulic Conductivity(cm/h):	2.173	Organic Carbon(%):	1.5
Electrical Conductivity (dS/m):	0		
Layer No:	3	Very Fine Sand(%):	4
Horizon:	Bm	Total Sand(%):	82
Depth(cm):	45-56	Total Silt(%):	9
pH in Calc Chloride:	7.4	Total Clay(%):	9
Saturated Hydraulic Conductivity(cm/h):	3.535	Organic Carbon(%):	0.5
Electrical Conductivity (dS/m):	0		
Layer No:	4	Very Fine Sand(%):	8
Horizon:	Ck	Total Sand(%):	89
Depth(cm):	56-100	Total Silt(%):	7
pH in Calc Chloride:	7.5	Total Clay(%):	4
Saturated Hydraulic Conductivity(cm/h):	5.404	Organic Carbon(%):	0
Electrical Conductivity (dS/m):	0		

Polygon ID: OND024075244

Component

Component ID:	OND02407524401	Components(%):	100
Soil Name ID:	ONCGU~~~~~A	Slope Steepness(%):	3.5
Component No:	1	Slope Length(m):	-9
Surface Stoniness Class:	Slightly stony		

Soil Information

Component Rating

Field Crops Capability:	No significant limitations in use for Crops
First CLI Limitation Subclass:	
Second CLI Limitation Subclass:	
Drainage:	Imperfectly
Soil Texture of A Horizon:	clay loam
Hydrological Soil Groups:	Soils with slow infiltration rates when thoroughly wetted and these soils typically are silty-loam soils with an impeding layer or soils with moderately fine to fine texture.

Soil Name

Soil Name:	CHINGUACOUSY
Kind of Surface Material:	Mineral
Soil Drainage Class:	Imperfectly drained
Water Table Characteristics:	Unspecified period
Layer that Restricts Root Growth:	No root restricting layer
Type of Root Restricting Layer:	n/a
Parent Material 1, 2, 3:	Moderately Fine; Not Applicable; Not Applicable
Mode of Deposition 1,2,3:	Till (Morainal); Not Applicable; Not Applicable
Parent Material Chemical Property 1,2,3:	Moderately / Very Strongly Calcareous; Not Applicable; Not Applicable

Soil Layer

Layer No:	1	Very Fine Sand(%):	11
Horizon:	Ap	Total Sand(%):	21
Depth(cm):	0-27	Total Silt(%):	50
pH in Calc Chloride:	7.1	Total Clay(%):	29
Saturated Hydraulic Conductivity(cm/h):	0.368	Organic Carbon(%):	1.9
Electrical Conductivity (dS/m):	0		
Layer No:	2	Very Fine Sand(%):	8
Horizon:	Btgj	Total Sand(%):	21
Depth(cm):	27-40	Total Silt(%):	43
pH in Calc Chloride:	7.2	Total Clay(%):	36
Saturated Hydraulic Conductivity(cm/h):	0.228	Organic Carbon(%):	0.5
Electrical Conductivity (dS/m):	0		


Soil Information

Layer No:	3	Very Fine Sand(%):	7
Horizon:	Ckgj	Total Sand(%):	20
Depth(cm):	40-100	Total Silt(%):	49
pH in Calc Chloride:	7.7	Total Clay(%):	31
Saturated Hydraulic Conductivity(cm/h):	0.159	Organic Carbon(%):	0
Electrical Conductivity (dS/m):	0		

Wells and Additional Sources



Wells & Additional Sources



ERIS 

Wells and Additional Sources Summary

Federal Sources

National Energy Board Wells

Map Key	ID	Distance (m)	Direction
No records found			

Provincial Sources

Ontario Oil and Gas Wells

Map Key	ID	Distance (m)	Direction
No records found			

Provincial Groundwater Monitoring Network

Map Key	ID	Distance (m)	Direction
No records found			

Water Well Information System

Map Key	Well ID	Distance (m)	Direction
1	7321813	0.94	W
2	7341861	6.62	E
3	7341887	6.63	E
4	7380344	7.35	E
5	7341823	21.76	E
6	7243496	33.7	WNW
7	7330113	34.31	NNE
8	7341844	35.04	NE
8	7341883	35.04	NE
9	7380055	48.68	N
10	7380056	49.69	N
11	7307873	53.28	NW
12	7363632	55.12	ENE
13	7355171	56.43	NE
14	7321758	56.65	NNE
15	7363631	59.74	NE
16	7378962	66.13	W
17	7310439	69.59	WNW
18	7321737	71.67	WNW
19	7307874	90.83	N
20	7234471	91.86	ENE
21	7378960	97.72	N
22	7355170	98.76	NNE
23	7321771	99.87	NE
24	7378961	103.67	N
25	7363633	105.14	ENE
26	7321814	108.02	WSW
27	7370471	112.27	SSW
28	7363630	114.	NE
29	7321812	120.45	NE
30	7321811	126.22	NE

Wells and Additional Sources Summary

31	7290488	126.98	N
32	7371903	129.38	NE
33	7371901	129.52	NNE
34	7378959	130.11	NE
35	7306886	130.42	WNW
36	7290480	130.47	NNE
37	7306887	132.43	NNE
38	7307828	133.36	N
39	7290487	134.51	NNE
40	7290469	141.54	N
41	7371902	143.37	N
42	7288429	144.15	ESE
43	7378963	147.67	N
44	7267968	154.84	ESE
45	7378965	156.8	N
46	7104773	168.12	ENE
47	7310440	182.92	NNE
48	7296575	199.47	S
49	7380069	202.9	N
50	7296574	214.48	SSW
51	7278219	215.74	SSW
52	7378964	218.86	NNW
53	7310446	225.69	N
54	7155591	232.74	ENE
55	7310447	237.12	N
56	7330662	237.46	SSW
56	7278218	237.46	SSW
57	7330661	238.79	SSW
57	7278220	238.79	SSW
58	7284674	240.75	N
59	7330663	241.48	SSW
60	7161795	243.2	ENE
61	7286063	243.34	NNW
62	7308370	243.46	NNE
63	7296325	244.57	SSW

Private Sources

Oil and Gas Wells

Map Key	ID	Distance (m)	Direction
No records found			

Wells and Additional Sources Detail Report

Water Well Information System

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
1	W	0.00	0.94	78.85	WWIS

Well ID:	7321813	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	07-Nov-2018 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z266905	Contractor:	6607
Tag:	A232825	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

PDF URL (Map):

Well Completed Date:	2018/01/18
Year Completed:	2018
Depth (m):	15.2
Latitude:	43.5559635526998
Longitude:	-79.5865799874411
Path:	

Bore Hole ID:	1007307137	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614162.00
Code OB Desc:		North83:	4823527.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	18-Jan-2018 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr

Wells and Additional Sources Detail Report

Elevrc Desc:

Location Source Date:

Improvement Location

Source:

Improvement Location

Method:

Source Revision

Comment:

Supplier Comment:

Formation ID: 1007605510

Layer: 2

Color: 2

General Color: GREY

Mat1: 05

Most Common Material: CLAY

Mat2: 06

Mat2 Desc: SILT

Mat3: 85

Mat3 Desc: SOFT

Formation Top Depth: 1.5

Formation End Depth: 6.0

Formation End Depth

UOM: m

Formation ID: 1007605511

Layer: 3

Color: 2

General Color: GREY

Mat1: 06

Most Common Material: SILT

Mat2: 11

Mat2 Desc: GRAVEL

Mat3: 73

Mat3 Desc: HARD

Formation Top Depth: 6.0

Formation End Depth: 9.100000381469727

Formation End Depth

UOM: m

Formation ID: 1007605509

Layer: 1

Color: 6

General Color: BROWN

Mat1: 28

Most Common Material: SAND

Mat2: 11

Wells and Additional Sources Detail Report

Mat2 Desc: GRAVEL
Mat3: 85
Mat3 Desc: SOFT
Formation Top Depth: 0.0
Formation End Depth: 1.5
Formation End Depth
UOM: m

Formation ID: 1007605512
Layer: 4
Color: 2
General Color: GREY
Mat1: 15
Most Common Material: LIMESTONE
Mat2: 26
Mat2 Desc: ROCK
Mat3: 73
Mat3 Desc: HARD
Formation Top Depth: 9.100000381469727
Formation End Depth: 15.199999809265137
Formation End Depth
UOM: m

Plug ID: 1007605521
Layer: 2
Plug From: 0.30000001192092896
Plug To: 11.800000190734863
Plug Depth UOM: m

Plug ID: 1007605520
Layer: 1
Plug From: 0.0
Plug To: 0.30000001192092896
Plug Depth UOM: m

Method Construction ID: 1007605519
Method Construction
Code: 6
Method Construction: Boring
Other Method
Construction:

Pipe ID: 1007605508
Casing No: 0
Comment:

Wells and Additional Sources Detail Report

Alt Name:

Casing ID: 1007605516
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 12.100000381469727
Casing Diameter: 5.099999904632568
Casing Diameter UOM: cm
Casing Depth UOM: m

Screen ID: 1007605517
Layer: 1
Slot: 10
Screen Top Depth: 12.100000381469727
Screen End Depth: 15.199999809265137
Screen Material: 5
Screen Depth UOM: m
Screen Diameter UOM: cm
Screen Diameter: 6.400000095367432

Water ID: 1007605515
Layer:
Kind Code:
Kind:
Water Found Depth:
Water Found Depth UOM: m

Hole ID: 1007605514
Diameter: 9.600000381469727
Depth From: 9.100000381469727
Depth To: 15.199999809265137
Hole Depth UOM: m
Hole Diameter UOM: cm

Hole ID: 1007605513
Diameter: 21.0
Depth From: 0.0
Depth To: 9.100000381469727
Hole Depth UOM: m
Hole Diameter UOM: cm

Wells and Additional Sources Detail Report

Bore Hole ID:	1007307137	Tag No:	A232825
Depth M:	15.2	Contractor:	6607
Year Completed:	2018	Path:	732\7321813.pdf
Well Completed Dt:	2018/01/18	Latitude:	43.5559635526998
Audit No:	Z266905	Longitude:	-79.5865799874411

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
2	E	0.01	6.62	78.85	WWIS

Well ID:	7341861	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	16-Sep-2019 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	LBX2P5WQ	Contractor:	6607
Tag:	A264691	Form Version:	9
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:	MW 19-3		

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/734\7341861.pdf

Well Completed Date:	2019/08/22
Year Completed:	2019
Depth (m):	8.2296
Latitude:	43.556027876375
Longitude:	-79.5852289863524
Path:	734\7341861.pdf

Bore Hole ID:	1007643258	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17

Wells and Additional Sources Detail Report

Code OB:	East83:	614271.00	
Code OB Desc:	North83:	4823536.00	
Open Hole:	Org CS:	UTM83	
Cluster Kind:	UTMRC:	4	
Date Completed:	22-Aug-2019 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:	Location Method:	wwr	

Elevrc Desc:
Location Source Date:
Improvement Location
Source:
Improvement Location
Method:
Source Revision
Comment:
Supplier Comment:

Formation ID: 1007643894
Layer: 1
Color: 6
General Color: BROWN
Mat1: 34
Most Common Material: TILL
Mat2:
Mat2 Desc:
Mat3:
Mat3 Desc:
Formation Top Depth: 0.0
Formation End Depth: 15.0
Formation End Depth
UOM: ft

Formation ID: 1007643895
Layer: 2
Color: 2
General Color: GREY
Mat1: 34
Most Common Material: TILL
Mat2:
Mat2 Desc:
Mat3:
Mat3 Desc:
Formation Top Depth: 15.0
Formation End Depth: 27.0
Formation End Depth
UOM: ft

Plug ID: 1007644464

Wells and Additional Sources Detail Report

Layer: 1
Plug From: 0.0
Plug To: 1.0
Plug Depth UOM: ft

Plug ID: 1007644310
Layer: 1
Plug From:
Plug To:
Plug Depth UOM: ft

Plug ID: 1007644465
Layer: 2
Plug From: 1.0
Plug To: 16.0
Plug Depth UOM: ft

Method Construction ID: 1007643598
Method Construction Code: 6
Method Construction: Boring
Other Method Construction:

Pipe ID: 1007643462
Casing No: 0
Comment:
Alt Name:

Casing ID: 1007644028
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 17.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Screen ID: 1007644108
Layer: 1
Slot: 10

Wells and Additional Sources Detail Report

Screen Top Depth: 17.0
 Screen End Depth: 27.0
 Screen Material: 5
 Screen Depth UOM: ft
 Screen Diameter UOM: inch
 Screen Diameter: 2.5

Pump Test ID: 1007643463
 Pump Set At:
 Static Level:
 Final Level After Pumping:
 Recommended Pump
 Depth:
 Pumping Rate:
 Flowing Rate:
 Recommended Pump
 Rate:
 Levels UOM: ft
 Rate UOM: GPM
 Water State After Test
 Code:
 Water State After Test:
 Pumping Test Method:
 Pumping Duration HR:
 Pumping Duration MIN:
 Flowing:

Hole ID: 1007644210
 Diameter: 8.0
 Depth From: 0.0
 Depth To: 27.0
 Hole Depth UOM: ft
 Hole Diameter UOM: inch

Bore Hole ID:	1007643258	Tag No:	A264691
Depth M:	8.2296	Contractor:	6607
Year Completed:	2019	Path:	734\7341861.pdf
Well Completed Dt:	2019/08/22	Latitude:	43.556027876375
Audit No:	LBX2P5WQ	Longitude:	-79.5852289863524

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
3	E	0.01	6.63	78.85	WWIS

Well ID: 7341887 Flowing (Y/N):
 Construction Date: Flow Rate:

Wells and Additional Sources Detail Report

Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	16-Sep-2019 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	WBYVTTLTD	Contractor:	6607
Tag:	A264678	Form Version:	9
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliabilty:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:	MW 19-1		
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/734\7341887.pdf		

Well Completed Date:	2019/08/14
Year Completed:	2019
Depth (m):	26.5176
Latitude:	43.5559172544505
Longitude:	-79.5850211032385
Path:	734\7341887.pdf

Bore Hole ID:	1007643336	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614288.00
Code OB Desc:		North83:	4823524.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	14-Aug-2019 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Wells and Additional Sources Detail Report

Formation ID: 1007643964
Layer: 3
Color: 2
General Color: GREY
Mat1: 17
Most Common Material: SHALE
Mat2: 15
Mat2 Desc: LIMESTONE
Mat3:
Mat3 Desc:
Formation Top Depth: 27.0
Formation End Depth: 87.0
Formation End Depth
UOM: ft

Formation ID: 1007643962
Layer: 1
Color: 6
General Color: BROWN
Mat1: 34
Most Common Material: TILL
Mat2:
Mat2 Desc:
Mat3:
Mat3 Desc:
Formation Top Depth: 0.0
Formation End Depth: 15.0
Formation End Depth
UOM: ft

Formation ID: 1007643963
Layer: 2
Color: 2
General Color: GREY
Mat1: 34
Most Common Material: TILL
Mat2:
Mat2 Desc:
Mat3:
Mat3 Desc:
Formation Top Depth: 15.0
Formation End Depth: 27.0
Formation End Depth
UOM: ft

Wells and Additional Sources Detail Report

Plug ID: 1007644522
Layer: 1
Plug From: 0.0
Plug To: 1.0
Plug Depth UOM: ft

Plug ID: 1007644336
Layer: 1
Plug From:
Plug To:
Plug Depth UOM: ft

Plug ID: 1007644523
Layer: 2
Plug From: 1.0
Plug To: 82.0
Plug Depth UOM: ft

Method Construction ID: 1007643636
Method Construction Code: 6
Method Construction: Boring
Other Method Construction:

Method Construction ID: 1007643635
Method Construction Code: 2
Method Construction: Rotary (Convent.)
Other Method Construction:

Pipe ID: 1007643514
Casing No: 0
Comment:
Alt Name:

Casing ID: 1007644053
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 82.0
Casing Diameter: 2.0

Wells and Additional Sources Detail Report

Casing Diameter UOM: inch
Casing Depth UOM: ft

Screen ID: 1007644133
Layer: 1
Slot: 10
Screen Top Depth: 82.0
Screen End Depth: 87.0
Screen Material: 5
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 2.5

Pump Test ID: 1007643515
Pump Set At:
Static Level:
Final Level After Pumping:
Recommended Pump
Depth:
Pumping Rate:
Flowing Rate:
Recommended Pump
Rate:
Levels UOM: ft
Rate UOM: GPM
Water State After Test
Code:
Water State After Test:
Pumping Test Method:
Pumping Duration HR:
Pumping Duration MIN:
Flowing:

Hole ID: 1007644247
Diameter: 8.0
Depth From: 0.0
Depth To: 30.0
Hole Depth UOM: ft
Hole Diameter UOM: inch

Hole ID: 1007644248
Diameter: 4.0
Depth From: 30.0
Depth To: 87.0
Hole Depth UOM: ft

Wells and Additional Sources Detail Report

Hole Diameter UOM: inch

Bore Hole ID:	1007643336	Tag No:	A264678
Depth M:	26.5176	Contractor:	6607
Year Completed:	2019	Path:	734\7341887.pdf
Well Completed Dt:	2019/08/14	Latitude:	43.5559172544505
Audit No:	WBYVTTLTD	Longitude:	-79.5850211032385

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
4	E	0.01	7.35	78.85	WWIS

Well ID:	7380344	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:		Data Entry Status:	Yes
Use 2nd:		Data Src:	
Final Well Status:		Date Received:	17-Feb-2021 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z346438	Contractor:	7215
Tag:		Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

Bore Hole ID:	1008631301	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614285.00
Code OB Desc:		North83:	4823527.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	13-Jan-2021 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			

Wells and Additional Sources Detail Report

Improvement Location
Method:
Source Revision
Comment:
Supplier Comment:

Bore Hole ID:	1008631301	Tag No:	
Depth M:		Contractor:	7215
Year Completed:	2021	Path:	
Well Completed Dt:	2021/01/13	Latitude:	43.5559447184594
Audit No:	Z346438	Longitude:	-79.5850576025616

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
5	E	0.02	21.76	78.85	WWIS

Well ID:	7341823	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	16-Sep-2019 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	8MUQDAWX	Contractor:	6607
Tag:	A271784	Form Version:	9
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliabilty:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:	MW 19-2		

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/734\7341823.pdf

Well Completed Date: 2019/08/15
Year Completed: 2019
Depth (m): 27.432
Latitude: 43.5560515102986
Longitude: -79.5849560576027
Path: 734\7341823.pdf

Wells and Additional Sources Detail Report

Bore Hole ID:	1007643144	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614293.00
Code OB Desc:		North83:	4823539.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	15-Aug-2019 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Formation ID:	1007643796
Layer:	3
Color:	2
General Color:	GREY
Mat1:	17
Most Common Material:	SHALE
Mat2:	15
Mat2 Desc:	LIMESTONE
Mat3:	
Mat3 Desc:	
Formation Top Depth:	27.0
Formation End Depth:	90.0
Formation End Depth UOM:	ft

Formation ID:	1007643794
Layer:	1
Color:	6
General Color:	BROWN
Mat1:	34
Most Common Material:	TILL
Mat2:	
Mat2 Desc:	
Mat3:	
Mat3 Desc:	
Formation Top Depth:	0.0
Formation End Depth:	15.0
Formation End Depth UOM:	ft

Wells and Additional Sources Detail Report

Formation ID: 1007643795
Layer: 2
Color: 2
General Color: GREY
Mat1: 34
Most Common Material: TILL
Mat2:
Mat2 Desc:
Mat3:
Mat3 Desc:
Formation Top Depth: 15.0
Formation End Depth: 27.0
Formation End Depth UOM: ft

Plug ID: 1007644272
Layer: 1
Plug From:
Plug To:
Plug Depth UOM: ft

Plug ID: 1007644379
Layer: 1
Plug From: 0.0
Plug To: 1.0
Plug Depth UOM: ft

Plug ID: 1007644380
Layer: 2
Plug From: 1.0
Plug To: 85.0
Plug Depth UOM: ft

Method Construction ID: 1007643547
Method Construction Code: 6
Method Construction: Boring
Other Method Construction:

Method Construction ID: 1007643546
Method Construction Code: 2

Wells and Additional Sources Detail Report

Method Construction: Rotary (Convent.)
Other Method
Construction:

Pipe ID: 1007643386
Casing No: 0
Comment:
Alt Name:

Casing ID: 1007643994
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 85.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Screen ID: 1007644074
Layer: 1
Slot: 10
Screen Top Depth: 85.0
Screen End Depth: 90.0
Screen Material: 5
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 2.5

Pump Test ID: 1007643387
Pump Set At:
Static Level:
Final Level After Pumping:
Recommended Pump
Depth:
Pumping Rate:
Flowing Rate:
Recommended Pump
Rate:
Levels UOM: ft
Rate UOM: GPM
Water State After Test
Code:
Water State After Test:
Pumping Test Method:
Pumping Duration HR:

Wells and Additional Sources Detail Report

Pumping Duration MIN:
Flowing:

Hole ID: 1007644161
Diameter: 4.0
Depth From: 30.0
Depth To: 90.0
Hole Depth UOM: ft
Hole Diameter UOM: inch

Hole ID: 1007644160
Diameter: 8.0
Depth From: 0.0
Depth To: 30.0
Hole Depth UOM: ft
Hole Diameter UOM: inch

Bore Hole ID:	1007643144	Tag No:	A271784
Depth M:	27.432	Contractor:	6607
Year Completed:	2019	Path:	734\7341823.pdf
Well Completed Dt:	2019/08/15	Latitude:	43.5560515102986
Audit No:	8MUQDAWX	Longitude:	-79.5849560576027

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
6	WNW	0.03	33.70	78.85	WWIS

Well ID:	7243496	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	25-Jun-2015 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z203315	Contractor:	7147
Tag:	A175784	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliabilty:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	

Wells and Additional Sources Detail Report

Clear/Cloudy: UTM Reliability:
Municipality: MISSISSAUGA CITY (PORT CREDIT)
Site Info:

PDF URL (Map):

Well Completed Date: 2015/06/06
Year Completed: 2015
Depth (m): 6.1
Latitude: 43.5562098059175
Longitude: -79.5868342262533
Path:

Bore Hole ID: 1005439505 Elevation:
DP2BR: Elevrc:
Spatial Status: Zone: 17
Code OB: East83: 614141.00
Code OB Desc: North83: 4823554.00
Open Hole: Org CS: UTM83
Cluster Kind: UTMRC: 4
Date Completed: 06-Jun-2015 00:00:00 UTMRC Desc: margin of error : 30 m - 100 m
Remarks: Location Method: wwr
Elevrc Desc:
Location Source Date:
Improvement Location
Source:
Improvement Location
Method:
Source Revision
Comment:
Supplier Comment:

Formation ID: 1005616494
Layer: 3
Color: 6
General Color: BROWN
Mat1: 28
Most Common Material: SAND
Mat2: 34
Mat2 Desc: TILL
Mat3:
Mat3 Desc:
Formation Top Depth: 3.299999952316284
Formation End Depth: 6.099999904632568
Formation End Depth
UOM: m

Wells and Additional Sources Detail Report

Formation ID: 1005616492
Layer: 1
Color: 2
General Color: GREY
Mat1:
Most Common Material:
Mat2:
Mat2 Desc:
Mat3:
Mat3 Desc:
Formation Top Depth: 0.0
Formation End Depth: 0.20000000298023224
Formation End Depth UOM: m

Formation ID: 1005616493
Layer: 2
Color: 6
General Color: BROWN
Mat1:
Most Common Material:
Mat2:
Mat2 Desc:
Mat3:
Mat3 Desc:
Formation Top Depth: 0.20000000298023224
Formation End Depth: 3.299999952316284
Formation End Depth UOM: m

Plug ID: 1005616503
Layer: 3
Plug From: 2.799999952316284
Plug To: 6.099999904632568
Plug Depth UOM: m

Plug ID: 1005616501
Layer: 1
Plug From: 0.0
Plug To: 0.30000001192092896
Plug Depth UOM: m

Plug ID: 1005616502

Wells and Additional Sources Detail Report

Layer: 2
Plug From: 0.30000001192092896
Plug To: 2.799999952316284
Plug Depth UOM: m

Method Construction ID: 1005616500
Method Construction Code: 6
Method Construction: Boring
Other Method Construction:

Pipe ID: 1005616491
Casing No: 0
Comment:
Alt Name:

Casing ID: 1005616497
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 3.0999999046325684
Casing Diameter: 5.0
Casing Diameter UOM: cm
Casing Depth UOM: m

Screen ID: 1005616498
Layer: 1
Slot: .10
Screen Top Depth: 3.0999999046325684
Screen End Depth: 6.099999904632568
Screen Material: 5
Screen Depth UOM: m
Screen Diameter UOM: cm
Screen Diameter: 6.300000190734863

Water ID: 1005616496
Layer: 1
Kind Code: 8
Kind: Untested
Water Found Depth: 3.700000047683716
Water Found Depth UOM: m

Wells and Additional Sources Detail Report

Hole ID: 1005616495
 Diameter: 11.3999999618530273
 Depth From: 0.0
 Depth To: 6.099999904632568
 Hole Depth UOM: m
 Hole Diameter UOM: cm

Bore Hole ID:	1005439505	Tag No:	A175784
Depth M:	6.1	Contractor:	7147
Year Completed:	2015	Path:	724\7243496.pdf
Well Completed Dt:	2015/06/06	Latitude:	43.5562098059175
Audit No:	Z203315	Longitude:	-79.5868342262533

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
7	NNE	0.03	34.31	79.58	WWIS

Well ID:	7330113	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:		Data Entry Status:	Yes
Use 2nd:		Data Src:	
Final Well Status:		Date Received:	15-Mar-2019 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	C44114	Contractor:	7215
Tag:	A259438	Form Version:	8
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

PDF URL (Map):

Well Completed Date: 2019/02/19
 Year Completed: 2019
 Depth (m):

Wells and Additional Sources Detail Report

Latitude: 43.5565090894966
 Longitude: -79.5855520075791
 Path:

Bore Hole ID:	1007451879	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614244.00
Code OB Desc:		North83:	4823589.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	19-Feb-2019 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Bore Hole ID:	1007451879	Tag No:	A259438
Depth M:		Contractor:	7215
Year Completed:	2019	Path:	
Well Completed Dt:	2019/02/19	Latitude:	43.5565090894966
Audit No:	C44114	Longitude:	-79.5855520075791

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
8	NE	0.04	35.04	79.22	WWIS

Well ID:	7341844	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	16-Sep-2019 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	GNLFU7D8	Contractor:	6607
Tag:	A271735	Form Version:	9
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliabilty:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	

Wells and Additional Sources Detail Report

Overburden/Bedrock:	Easting NAD83:
Pump Rate:	Northing NAD83:
Static Water Level:	Zone:
Clear/Cloudy:	UTM Reliability:
Municipality:	MISSISSAUGA CITY (PORT CREDIT)
Site Info:	MW 19-4 SH
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/734\7341844.pdf

Well Completed Date:	2019/08/19
Year Completed:	2019
Depth (m):	36.576
Latitude:	43.5564259320474
Longitude:	-79.5853806219843
Path:	734\7341844.pdf

Bore Hole ID:	1007643207	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614258.00
Code OB Desc:		North83:	4823580.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	19-Aug-2019 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Formation ID:	1007643849
Layer:	1
Color:	6
General Color:	BROWN
Mat1:	34
Most Common Material:	TILL
Mat2:	
Mat2 Desc:	
Mat3:	
Mat3 Desc:	
Formation Top Depth:	0.0

Wells and Additional Sources Detail Report

Formation End Depth: 15.0
Formation End Depth
UOM: ft

Formation ID: 1007643850
Layer: 2
Color: 2
General Color: GREY
Mat1: 34
Most Common Material: TILL
Mat2:
Mat2 Desc:
Mat3:
Mat3 Desc:
Formation Top Depth: 15.0
Formation End Depth: 27.0
Formation End Depth
UOM: ft

Formation ID: 1007643851
Layer: 3
Color: 2
General Color: GREY
Mat1: 17
Most Common Material: SHALE
Mat2: 15
Mat2 Desc: LIMESTONE
Mat3:
Mat3 Desc:
Formation Top Depth: 27.0
Formation End Depth: 120.0
Formation End Depth
UOM: ft

Plug ID: 1007644293
Layer: 1
Plug From:
Plug To:
Plug Depth UOM: ft

Plug ID: 1007644427
Layer: 1
Plug From: 0.0
Plug To: 1.0
Plug Depth UOM: ft

Wells and Additional Sources Detail Report

Plug ID: 1007644428
Layer: 2
Plug From: 1.0
Plug To: 115.0
Plug Depth UOM: ft

Method Construction ID: 1007643575
Method Construction Code: 2
Method Construction: Rotary (Convent.)
Other Method Construction:

Method Construction ID: 1007643576
Method Construction Code: 6
Method Construction: Boring
Other Method Construction:

Pipe ID: 1007643428
Casing No: 0
Comment:
Alt Name:

Casing ID: 1007644013
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 115.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Screen ID: 1007644093
Layer: 1
Slot: 10
Screen Top Depth: 115.0
Screen End Depth: 120.0
Screen Material: 5
Screen Depth UOM: ft
Screen Diameter UOM: inch

Wells and Additional Sources Detail Report

Screen Diameter: 2.5

Pump Test ID: 1007643429

Pump Set At:

Static Level:

Final Level After Pumping:

Recommended Pump

Depth:

Pumping Rate:

Flowing Rate:

Recommended Pump

Rate:

Levels UOM: ft

Rate UOM: GPM

Water State After Test

Code:

Water State After Test:

Pumping Test Method:

Pumping Duration HR:

Pumping Duration MIN:

Flowing:

Hole ID: 1007644189

Diameter: 4.0

Depth From: 30.0

Depth To: 120.0

Hole Depth UOM: ft

Hole Diameter UOM: inch

Hole ID: 1007644188

Diameter: 8.0

Depth From: 0.0

Depth To: 30.0

Hole Depth UOM: ft

Hole Diameter UOM: inch

Bore Hole ID: 1007643207

Depth M: 36.576

Year Completed: 2019

Well Completed Dt: 2019/08/19

Audit No: GNLFU7D8

Tag No: A271735

Contractor: 6607

Path: 734\7341844.pdf

Latitude: 43.5564259320474

Longitude: -79.5853806219843

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
8	NE	0.04	35.04	79.22	WWIS

Wells and Additional Sources Detail Report

Well ID:	7341883	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	16-Sep-2019 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	TOJ5WP3R	Contractor:	6607
Tag:	A271753	Form Version:	9
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:	MW 19-4 DH		

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/734\7341883.pdf

Well Completed Date:	2019/08/21
Year Completed:	2019
Depth (m):	47.5488
Latitude:	43.5564259320474
Longitude:	-79.5853806219843
Path:	734\7341883.pdf

Bore Hole ID:	1007643324	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614258.00
Code OB Desc:		North83:	4823580.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	21-Aug-2019 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			

Wells and Additional Sources Detail Report

Source Revision
Comment:
Supplier Comment:

Formation ID: 1007643951
Layer: 1
Color: 6
General Color: BROWN
Mat1: 34
Most Common Material: TILL
Mat2:
Mat2 Desc:
Mat3:
Mat3 Desc:
Formation Top Depth: 0.0
Formation End Depth: 15.0
Formation End Depth UOM: ft

Formation ID: 1007643952
Layer: 2
Color: 2
General Color: GREY
Mat1: 34
Most Common Material: TILL
Mat2:
Mat2 Desc:
Mat3:
Mat3 Desc:
Formation Top Depth: 15.0
Formation End Depth: 27.0
Formation End Depth UOM: ft

Formation ID: 1007643953
Layer: 3
Color: 2
General Color: GREY
Mat1: 17
Most Common Material: SHALE
Mat2: 15
Mat2 Desc: LIMESTONE
Mat3:
Mat3 Desc:
Formation Top Depth: 27.0
Formation End Depth: 156.0

Wells and Additional Sources Detail Report

Formation End Depth ft
UOM:

Plug ID: 1007644332
Layer: 1
Plug From:
Plug To:
Plug Depth UOM: ft

Plug ID: 1007644514
Layer: 1
Plug From: 0.0
Plug To: 1.0
Plug Depth UOM: ft

Plug ID: 1007644515
Layer: 2
Plug From: 1.0
Plug To: 151.0
Plug Depth UOM: ft

Method Construction ID: 1007643627
Method Construction
Code: 3
Method Construction: Rotary (Reverse)
Other Method
Construction:

Method Construction ID: 1007643628
Method Construction
Code: 6
Method Construction: Boring
Other Method
Construction:

Method Construction ID: 1007643626
Method Construction
Code: 2
Method Construction: Rotary (Convent.)
Other Method
Construction:

Pipe ID: 1007643506
Casing No: 0

Wells and Additional Sources Detail Report

Comment:

Alt Name:

Casing ID: 1007644049
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 151.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Screen ID: 1007644129
Layer: 1
Slot: 10
Screen Top Depth: 151.0
Screen End Depth: 156.0
Screen Material: 5
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 2.5

Pump Test ID: 1007643507
Pump Set At:
Static Level:
Final Level After Pumping:
Recommended Pump
Depth:
Pumping Rate:
Flowing Rate:
Recommended Pump
Rate:
Levels UOM: ft
Rate UOM: GPM
Water State After Test
Code:
Water State After Test:
Pumping Test Method:
Pumping Duration HR:
Pumping Duration MIN:
Flowing:

Hole ID: 1007644240
Diameter: 4.0

Wells and Additional Sources Detail Report

Depth From: 30.0
 Depth To: 156.0
 Hole Depth UOM: ft
 Hole Diameter UOM: inch

Hole ID: 1007644239
 Diameter: 8.0
 Depth From: 0.0
 Depth To: 30.0
 Hole Depth UOM: ft
 Hole Diameter UOM: inch

Bore Hole ID:	1007643324	Tag No:	A271753
Depth M:	47.5488	Contractor:	6607
Year Completed:	2019	Path:	734\7341883.pdf
Well Completed Dt:	2019/08/21	Latitude:	43.5564259320474
Audit No:	TOJ5WP3R	Longitude:	-79.5853806219843

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
9	N	0.05	48.68	79.85	WWIS

Well ID:	7380055	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	29-Jan-2021 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	KTPNZ5WC	Contractor:	7360
Tag:	A295479	Form Version:	9
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

Bore Hole ID:	1008564214	Elevation:	

Wells and Additional Sources Detail Report

DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614201.00
Code OB Desc:		North83:	4823627.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	26-Jun-2020 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Formation ID:	1008564329
Layer:	3
Color:	
General Color:	
Mat1:	28
Most Common Material:	SAND
Mat2:	34
Mat2 Desc:	TILL
Mat3:	
Mat3 Desc:	
Formation Top Depth:	10.0
Formation End Depth:	20.0
Formation End Depth UOM:	ft

Formation ID:	1008564330
Layer:	4
Color:	
General Color:	
Mat1:	06
Most Common Material:	SILT
Mat2:	11
Mat2 Desc:	GRAVEL
Mat3:	
Mat3 Desc:	
Formation Top Depth:	20.0
Formation End Depth:	35.0
Formation End Depth UOM:	ft

Wells and Additional Sources Detail Report

Formation ID: 1008564328
Layer: 2
Color:
General Color:
Mat1: 28
Most Common Material: SAND
Mat2: 05
Mat2 Desc: CLAY
Mat3:
Mat3 Desc:
Formation Top Depth: 5.0
Formation End Depth: 10.0
Formation End Depth UOM: ft

Formation ID: 1008564327
Layer: 1
Color:
General Color:
Mat1: 28
Most Common Material: SAND
Mat2: 11
Mat2 Desc: GRAVEL
Mat3:
Mat3 Desc:
Formation Top Depth: 0.0
Formation End Depth: 5.0
Formation End Depth UOM: ft

Plug ID: 1008564406
Layer: 1
Plug From:
Plug To:
Plug Depth UOM: ft

Plug ID: 1008564421
Layer: 1
Plug From: 0.0
Plug To: 23.0
Plug Depth UOM: ft

Method Construction ID: 1008564278

Wells and Additional Sources Detail Report

Method Construction Code: E
Method Construction: Auger
Other Method Construction:

Pipe ID: 1008564254
Casing No: 0
Comment:
Alt Name:

Casing ID: 1008564361
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 25.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Screen ID: 1008564375
Layer: 1
Slot: 0.1
Screen Top Depth: 25.0
Screen End Depth: 35.0
Screen Material: 5
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 2.25

Pump Test ID: 1008564255
Pump Set At:
Static Level:
Final Level After Pumping:
Recommended Pump Depth:
Pumping Rate:
Flowing Rate:
Recommended Pump Rate:
Levels UOM: ft
Rate UOM: GPM
Water State After Test Code:
Water State After Test:

Wells and Additional Sources Detail Report

Pumping Test Method:
Pumping Duration HR:
Pumping Duration MIN:
Flowing:

Hole ID: 1008564391
Diameter: 6.0
Depth From: 0.0
Depth To: 35.0
Hole Depth UOM: ft
Hole Diameter UOM: inch

Bore Hole ID:	1008564214	Tag No:	A295479
Depth M:	10.668	Contractor:	7360
Year Completed:	2020	Path:	738\7380055.pdf
Well Completed Dt:	2020/06/26	Latitude:	43.5568577295378
Audit No:	KTPNZ5WC	Longitude:	-79.5860762288303

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
10	N	0.05	49.69	79.85	WWIS

Well ID:	7380056	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	29-Jan-2021 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	RXRFRGV6	Contractor:	7360
Tag:	A295480	Form Version:	9
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

Bore Hole ID:	1008564217	Elevation:	

Wells and Additional Sources Detail Report

DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614198.00
Code OB Desc:		North83:	4823628.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	26-Jun-2020 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Formation ID:	1008564333
Layer:	3
Color:	
General Color:	
Mat1:	28
Most Common Material:	SAND
Mat2:	34
Mat2 Desc:	TILL
Mat3:	
Mat3 Desc:	
Formation Top Depth:	10.0
Formation End Depth:	20.0
Formation End Depth UOM:	ft

Formation ID:	1008564332
Layer:	2
Color:	
General Color:	
Mat1:	28
Most Common Material:	SAND
Mat2:	05
Mat2 Desc:	CLAY
Mat3:	
Mat3 Desc:	
Formation Top Depth:	5.0
Formation End Depth:	10.0
Formation End Depth UOM:	ft

Wells and Additional Sources Detail Report

Formation ID: 1008564331
Layer: 1
Color:
General Color:
Mat1: 28
Most Common Material: SAND
Mat2: 11
Mat2 Desc: GRAVEL
Mat3:
Mat3 Desc:
Formation Top Depth: 0.0
Formation End Depth: 5.0
Formation End Depth UOM: ft

Plug ID: 1008564422
Layer: 1
Plug From: 0.0
Plug To: 13.0
Plug Depth UOM: ft

Plug ID: 1008564407
Layer: 1
Plug From:
Plug To:
Plug Depth UOM: ft

Method Construction ID: 1008564279
Method Construction Code: E
Method Construction: Auger
Other Method Construction:

Pipe ID: 1008564256
Casing No: 0
Comment:
Alt Name:

Casing ID: 1008564362
Layer: 1
Material: 5
Open Hole or Material: PLASTIC

Wells and Additional Sources Detail Report

Depth From: 0.0
Depth To: 15.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Screen ID: 1008564376
Layer: 1
Slot: 0.1
Screen Top Depth: 15.0
Screen End Depth: 20.0
Screen Material: 5
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 2.25

Pump Test ID: 1008564257
Pump Set At:
Static Level:
Final Level After Pumping:
Recommended Pump
Depth:
Pumping Rate:
Flowing Rate:
Recommended Pump
Rate:
Levels UOM: ft
Rate UOM: GPM
Water State After Test
Code:
Water State After Test:
Pumping Test Method:
Pumping Duration HR:
Pumping Duration MIN:
Flowing:

Hole ID: 1008564392
Diameter: 6.0
Depth From: 0.0
Depth To: 20.0
Hole Depth UOM: ft
Hole Diameter UOM: inch

Bore Hole ID: 1008564217
Depth M: 6.096

Tag No: A295480
Contractor: 7360

Wells and Additional Sources Detail Report

Year Completed:	2020	Path:	738\7380056.pdf
Well Completed Dt:	2020/06/26	Latitude:	43.5568671902916
Audit No:	RXRFRGV6	Longitude:	-79.5861131502184

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
11	NW	0.05	53.28	78.85	WWIS

Well ID:	7307873	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	15-Mar-2018 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z266884	Contractor:	6607
Tag:	A241364	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

PDF URL (Map):

Well Completed Date:	2018/01/10
Year Completed:	2018
Depth (m):	1.61544
Latitude:	43.5564891574472
Longitude:	-79.5868524583307
Path:	

Bore Hole ID:	1007003609	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614139.00
Code OB Desc:		North83:	4823585.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4

Wells and Additional Sources Detail Report

Date Completed: 10-Jan-2018 00:00:00 UTMRC Desc: margin of error : 30 m - 100 m
Remarks: Location Method: wwr
Elevrc Desc:
Location Source Date:
Improvement Location
Source:
Improvement Location
Method:
Source Revision
Comment:
Supplier Comment:

Formation ID: 1007230193
Layer: 3
Color: 2
General Color: GREY
Mat1: 06
Most Common Material: SILT
Mat2: 11
Mat2 Desc: GRAVEL
Mat3: 73
Mat3 Desc: HARD
Formation Top Depth: 4.5
Formation End Depth: 5.300000190734863
Formation End Depth
UOM: ft

Formation ID: 1007230191
Layer: 1
Color: 6
General Color: BROWN
Mat1: 28
Most Common Material: SAND
Mat2: 11
Mat2 Desc: GRAVEL
Mat3: 85
Mat3 Desc: SOFT
Formation Top Depth: 0.0
Formation End Depth: 1.5
Formation End Depth
UOM: ft

Formation ID: 1007230192
Layer: 2
Color: 2
General Color: GREY
Mat1: 05

Wells and Additional Sources Detail Report

Most Common Material: CLAY
Mat2: 28
Mat2 Desc: SAND
Mat3: 85
Mat3 Desc: SOFT
Formation Top Depth: 1.5
Formation End Depth: 4.5
Formation End Depth UOM: ft

Plug ID: 1007230200
Layer: 1
Plug From: 0.0
Plug To: 0.30000001192092896
Plug Depth UOM: ft

Plug ID: 1007230201
Layer: 2
Plug From: 0.30000001192092896
Plug To: 1.5
Plug Depth UOM: ft

Method Construction ID: 1007230199
Method Construction Code: 6
Method Construction: Boring
Other Method Construction: DIAMOND

Pipe ID: 1007230190
Casing No: 0
Comment:
Alt Name:

Casing ID: 1007230196
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 1.5
Casing Diameter: 5.099999904632568
Casing Diameter UOM: inch
Casing Depth UOM: ft

Wells and Additional Sources Detail Report

Screen ID: 1007230197
 Layer: 1
 Slot: 10
 Screen Top Depth: 1.5
 Screen End Depth: 5.300000190734863
 Screen Material: 5
 Screen Depth UOM: ft
 Screen Diameter UOM: inch
 Screen Diameter: 6.610000133514404

Water ID: 1007230195
 Layer:
 Kind Code:
 Kind:
 Water Found Depth:
 Water Found Depth UOM: ft

Hole ID: 1007230194
 Diameter: 21.0
 Depth From: 0.0
 Depth To: 5.300000190734863
 Hole Depth UOM: ft
 Hole Diameter UOM: inch

Bore Hole ID:	1007003609	Tag No:	A241364
Depth M:	1.61544	Contractor:	6607
Year Completed:	2018	Path:	730\7307873.pdf
Well Completed Dt:	2018/01/10	Latitude:	43.5564891574472
Audit No:	Z266884	Longitude:	-79.5868524583307

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
12	ENE	0.06	55.12	78.70	WWIS

Well ID:	7363632	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	07-Aug-2020 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	5NZ4J5JW	Contractor:	7609
Tag:	A283540	Form Version:	9

Wells and Additional Sources Detail Report

Constructn Method:	Owner:	
Elevation (m):	County:	PEEL
Elevatn Reliability:	Lot:	
Depth to Bedrock:	Concession:	
Well Depth:	Concession Name:	
Overburden/Bedrock:	Easting NAD83:	
Pump Rate:	Northing NAD83:	
Static Water Level:	Zone:	
Clear/Cloudy:	UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)	
Site Info:		

Bore Hole ID:	1008371677	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614314.00
Code OB Desc:		North83:	4823565.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	27-Jul-2020 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Formation ID:	1008371791
Layer:	1
Color:	6
General Color:	BROWN
Mat1:	01
Most Common Material:	FILL
Mat2:	28
Mat2 Desc:	SAND
Mat3:	77
Mat3 Desc:	LOOSE
Formation Top Depth:	0.0
Formation End Depth:	1.5199999809265137
Formation End Depth UOM:	m

Formation ID:	1008371793

Wells and Additional Sources Detail Report

Layer: 3
Color: 6
General Color: BROWN
Mat1: 28
Most Common Material: SAND
Mat2: 06
Mat2 Desc: SILT
Mat3: 11
Mat3 Desc: GRAVEL
Formation Top Depth: 3.049999952316284
Formation End Depth: 4.570000171661377
Formation End Depth UOM: m

Formation ID: 1008371792
Layer: 2
Color: 6
General Color: BROWN
Mat1: 28
Most Common Material: SAND
Mat2:
Mat2 Desc:
Mat3:
Mat3 Desc:
Formation Top Depth: 1.5199999809265137
Formation End Depth: 3.049999952316284
Formation End Depth UOM: m

Plug ID: 1008371883
Layer: 2
Plug From: 0.30000001192092896
Plug To: 1.5199999809265137
Plug Depth UOM: m

Plug ID: 1008371856
Layer: 1
Plug From:
Plug To:
Plug Depth UOM: m

Plug ID: 1008371882
Layer: 1
Plug From: 0.0

Wells and Additional Sources Detail Report

Plug To: 0.30000001192092896
Plug Depth UOM: m

Plug ID: 1008371884
Layer: 3
Plug From: 1.5199999809265137
Plug To: 4.570000171661377
Plug Depth UOM: m

Method Construction ID: 1008371757
Method Construction Code: E
Method Construction: Auger
Other Method Construction:

Pipe ID: 1008371726
Casing No: 0
Comment:
Alt Name:

Casing ID: 1008371818
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 1.5199999809265137
Casing Diameter: 5.0
Casing Diameter UOM: cm
Casing Depth UOM: m

Screen ID: 1008371828
Layer: 1
Slot: 010
Screen Top Depth: 1.5199999809265137
Screen End Depth: 4.570000171661377
Screen Material: 5
Screen Depth UOM: m
Screen Diameter UOM: cm
Screen Diameter: 6.0

Pump Test ID: 1008371727

Wells and Additional Sources Detail Report

Pump Set At:
 Static Level:
 Final Level After Pumping:
 Recommended Pump
 Depth:
 Pumping Rate:
 Flowing Rate:
 Recommended Pump
 Rate:
 Levels UOM: m
 Rate UOM: LPM
 Water State After Test
 Code:
 Water State After Test:
 Pumping Test Method:
 Pumping Duration HR:
 Pumping Duration MIN:
 Flowing:

Hole ID: 1008371841
 Diameter: 21.0
 Depth From: 0.0
 Depth To: 4.570000171661377
 Hole Depth UOM: m
 Hole Diameter UOM: cm

Bore Hole ID:	1008371677	Tag No:	A283540
Depth M:	4.57	Contractor:	7609
Year Completed:	2020	Path:	736\7363632.pdf
Well Completed Dt:	2020/07/27	Latitude:	43.5562823303872
Audit No:	5NZ4J5JW	Longitude:	-79.5846906593135

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
13	NE	0.06	56.43	79.85	WWIS

Well ID:	7355171	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Test Hole	Data Entry Status:	
Use 2nd:	Monitoring	Data Src:	
Final Well Status:	Observation Wells	Date Received:	28-Nov-2018 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z275350	Contractor:	7383
Tag:	A239126	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL

Wells and Additional Sources Detail Report

Elevatn Reliabilty:	Lot:
Depth to Bedrock:	Concession:
Well Depth:	Concession Name:
Overburden/Bedrock:	Easting NAD83:
Pump Rate:	Northing NAD83:
Static Water Level:	Zone:
Clear/Cloudy:	UTM Reliability:
Municipality:	MISSISSAUGA CITY (PORT CREDIT)
Site Info:	

PDF URL (Map):

Well Completed Date:	2018/01/13
Year Completed:	2018
Depth (m):	9.144
Latitude:	43.5565769655308
Longitude:	-79.5852161374119
Path:	

Bore Hole ID:	1008221295	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614271.00
Code OB Desc:		North83:	4823597.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	13-Jan-2018 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Formation ID:	1008268351
Layer:	2
Color:	
General Color:	
Mat1:	06
Most Common Material:	SILT
Mat2:	
Mat2 Desc:	

Wells and Additional Sources Detail Report

Mat3:

Mat3 Desc:

Formation Top Depth:

Formation End Depth:

Formation End Depth

UOM:

Formation ID: 1008268350

Layer: 1

Color:

General Color:

Mat1: 28

Most Common Material: SAND

Mat2:

Mat2 Desc:

Mat3:

Mat3 Desc:

Formation Top Depth: 0.0

Formation End Depth:

Formation End Depth

UOM:

Formation ID: 1008268353

Layer: 4

Color:

General Color:

Mat1: 17

Most Common Material: SHALE

Mat2:

Mat2 Desc:

Mat3:

Mat3 Desc:

Formation Top Depth:

Formation End Depth: 30.0

Formation End Depth ft

UOM:

Formation ID: 1008268352

Layer: 3

Color:

General Color:

Mat1: 34

Most Common Material: TILL

Mat2:

Mat2 Desc:

Mat3:

Wells and Additional Sources Detail Report

Mat3 Desc:

Formation Top Depth:

Formation End Depth:

Formation End Depth

UOM:

Plug ID: 1008268741

Layer: 3

Plug From: 19.0

Plug To: 30.0

Plug Depth UOM: ft

Plug ID: 1008268739

Layer: 1

Plug From: 0.0

Plug To: 1.0

Plug Depth UOM: ft

Plug ID: 1008268740

Layer: 2

Plug From: 1.0

Plug To: 19.0

Plug Depth UOM: ft

Method Construction ID: 1008269236

Method Construction

Code: 6

Method Construction: Boring

Other Method

Construction:

Pipe ID: 1008267822

Casing No: 0

Comment:

Alt Name:

Casing ID: 1008269425

Layer: 1

Material: 5

Open Hole or Material: PLASTIC

Depth From: 0.0

Depth To: 20.0

Casing Diameter: 2.0

Wells and Additional Sources Detail Report

Casing Diameter UOM: Inch
Casing Depth UOM: ft

Screen ID: 1008269595
Layer: 1
Slot: 10
Screen Top Depth: 20.0
Screen End Depth: 30.0
Screen Material: 5
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 2.375

Pump Test ID: 1008269861
Pump Set At:
Static Level:
Final Level After Pumping:
Recommended Pump
Depth:
Pumping Rate:
Flowing Rate:
Recommended Pump
Rate:
Levels UOM: ft
Rate UOM: GPM
Water State After Test
Code:
Water State After Test:
Pumping Test Method: 0
Pumping Duration HR:
Pumping Duration MIN:
Flowing:

Water ID: 1008269724
Layer: 1
Kind Code:
Kind:
Water Found Depth: 19.0
Water Found Depth UOM: ft

Hole ID: 1008269041
Diameter: 8.5
Depth From: 0.0
Depth To: 30.0
Hole Depth UOM: ft

Wells and Additional Sources Detail Report

Hole Diameter UOM: Inch

Bore Hole ID:	1008221295	Tag No:	A239126
Depth M:	9.144	Contractor:	7383
Year Completed:	2018	Path:	735\7355171.pdf
Well Completed Dt:	2018/01/13	Latitude:	43.5565769655308
Audit No:	Z275350	Longitude:	-79.5852161374119

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
14	NNE	0.06	56.65	79.85	WWIS

Well ID:	7321758	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	07-Nov-2018 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z266972	Contractor:	6607
Tag:	A232612	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

PDF URL (Map):

Well Completed Date: 2018/01/27
Year Completed: 2018
Depth (m): 12.192
Latitude: 43.5568073629561
Longitude: -79.5856440763172
Path:

Bore Hole ID:	1007306972	Elevation:	
DP2BR:		Elevrc:	

Wells and Additional Sources Detail Report

Spatial Status:	Zone:	17
Code OB:	East83:	614236.00
Code OB Desc:	North83:	4823622.00
Open Hole:	Org CS:	UTM83
Cluster Kind:	UTMRC:	4
Date Completed: 27-Jan-2018 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:	Location Method:	wwr
Elevrc Desc:		
Location Source Date:		
Improvement Location Source:		
Improvement Location Method:		
Source Revision		
Comment:		
Supplier Comment:		

Formation ID:	1007600788
Layer:	1
Color:	6
General Color:	BROWN
Mat1:	11
Most Common Material:	GRAVEL
Mat2:	28
Mat2 Desc:	SAND
Mat3:	01
Mat3 Desc:	FILL
Formation Top Depth:	0.0
Formation End Depth:	5.0
Formation End Depth UOM:	ft

Formation ID:	1007600789
Layer:	2
Color:	2
General Color:	GREY
Mat1:	05
Most Common Material:	CLAY
Mat2:	11
Mat2 Desc:	GRAVEL
Mat3:	34
Mat3 Desc:	TILL
Formation Top Depth:	5.0
Formation End Depth:	30.0
Formation End Depth UOM:	ft

Wells and Additional Sources Detail Report

Formation ID: 1007600790
Layer: 3
Color: 2
General Color: GREY
Mat1: 17
Most Common Material: SHALE
Mat2:
Mat2 Desc:
Mat3: 26
Mat3 Desc: ROCK
Formation Top Depth: 30.0
Formation End Depth: 40.0
Formation End Depth UOM: ft

Plug ID: 1007600798
Layer: 1
Plug From: 0.0
Plug To: 29.0
Plug Depth UOM: ft

Plug ID: 1007600799
Layer: 2
Plug From: 29.0
Plug To: 40.0
Plug Depth UOM: ft

Method Construction ID: 1007600797
Method Construction Code: 6
Method Construction: Boring
Other Method Construction:

Pipe ID: 1007600787
Casing No: 0
Comment:
Alt Name:

Casing ID: 1007600794
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0

Wells and Additional Sources Detail Report

Depth To: 30.0
Casing Diameter: 5.099999904632568
Casing Diameter UOM: inch
Casing Depth UOM: ft

Screen ID: 1007600795
Layer: 1
Slot: 10
Screen Top Depth: 30.0
Screen End Depth: 40.0
Screen Material: 5
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 6.400000095367432

Water ID: 1007600793
Layer:
Kind Code:
Kind:
Water Found Depth:
Water Found Depth UOM: ft

Hole ID: 1007600792
Diameter: 4.0
Depth From: 30.0
Depth To: 40.0
Hole Depth UOM: ft
Hole Diameter UOM: inch

Hole ID: 1007600791
Diameter: 8.0
Depth From: 0.0
Depth To: 30.0
Hole Depth UOM: ft
Hole Diameter UOM: inch

Bore Hole ID:	1007306972	Tag No:	A232612
Depth M:	12.192	Contractor:	6607
Year Completed:	2018	Path:	732\7321758.pdf
Well Completed Dt:	2018/01/27	Latitude:	43.5568073629561
Audit No:	Z266972	Longitude:	-79.5856440763172

Wells and Additional Sources Detail Report

15	NE	0.06	59.74	79.85	WWIS

Well ID:	7363631	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	07-Aug-2020 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	4XE7ZMP4	Contractor:	7609
Tag:	A283618	Form Version:	9
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliabilty:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

Bore Hole ID:	1008371674	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614264.00
Code OB Desc:		North83:	4823606.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	24-Jul-2020 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Formation ID:	1008371790
Layer:	3
Color:	6
General Color:	BROWN

Wells and Additional Sources Detail Report

Mat1: 28
Most Common Material: SAND
Mat2: 06
Mat2 Desc: SILT
Mat3: 11
Mat3 Desc: GRAVEL
Formation Top Depth: 3.049999952316284
Formation End Depth: 4.570000171661377
Formation End Depth UOM: m

Formation ID: 1008371788
Layer: 1
Color: 6
General Color: BROWN
Mat1: 01
Most Common Material: FILL
Mat2: 28
Mat2 Desc: SAND
Mat3: 77
Mat3 Desc: LOOSE
Formation Top Depth: 0.0
Formation End Depth: 1.5199999809265137
Formation End Depth UOM: m

Formation ID: 1008371789
Layer: 2
Color: 6
General Color: BROWN
Mat1: 28
Most Common Material: SAND
Mat2:
Mat2 Desc:
Mat3:
Mat3 Desc:
Formation Top Depth: 1.5199999809265137
Formation End Depth: 3.049999952316284
Formation End Depth UOM: m

Plug ID: 1008371879
Layer: 1
Plug From: 0.0
Plug To: 0.30000001192092896
Plug Depth UOM: m

Wells and Additional Sources Detail Report

Plug ID: 1008371881
Layer: 3
Plug From: 1.5199999809265137
Plug To: 4.570000171661377
Plug Depth UOM: m

Plug ID: 1008371855
Layer: 1
Plug From:
Plug To:
Plug Depth UOM: m

Plug ID: 1008371880
Layer: 2
Plug From: 0.30000001192092896
Plug To: 1.5199999809265137
Plug Depth UOM: m

Method Construction ID: 1008371756
Method Construction Code: E
Method Construction: Auger
Other Method Construction:

Pipe ID: 1008371724
Casing No: 0
Comment:
Alt Name:

Casing ID: 1008371817
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 1.5199999809265137
Casing Diameter: 5.0
Casing Diameter UOM: cm
Casing Depth UOM: m

Wells and Additional Sources Detail Report

Screen ID: 1008371827
 Layer: 1
 Slot: 010
 Screen Top Depth: 1.5199999809265137
 Screen End Depth: 4.570000171661377
 Screen Material: 5
 Screen Depth UOM: m
 Screen Diameter UOM: cm
 Screen Diameter: 6.0

Pump Test ID: 1008371725
 Pump Set At:
 Static Level:
 Final Level After Pumping:
 Recommended Pump
 Depth:
 Pumping Rate:
 Flowing Rate:
 Recommended Pump
 Rate:
 Levels UOM: m
 Rate UOM: LPM
 Water State After Test
 Code:
 Water State After Test:
 Pumping Test Method:
 Pumping Duration HR:
 Pumping Duration MIN:
 Flowing:

Hole ID: 1008371840
 Diameter: 21.0
 Depth From: 0.0
 Depth To: 4.570000171661377
 Hole Depth UOM: m
 Hole Diameter UOM: cm

Bore Hole ID:	1008371674	Tag No:	A283618
Depth M:	4.57	Contractor:	7609
Year Completed:	2020	Path:	736\7363631.pdf
Well Completed Dt:	2020/07/24	Latitude:	43.5566590509865
Audit No:	4XE7ZMP4	Longitude:	-79.585300882414

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
16	W	0.07	66.13	78.85	WWIS

Wells and Additional Sources Detail Report

Well ID:	7378962	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:		Data Entry Status:	Yes
Use 2nd:		Data Src:	
Final Well Status:		Date Received:	29-Jan-2021 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z348113	Contractor:	7644
Tag:	A312084	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliabilty:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

Bore Hole ID:	1008614901	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614095.00
Code OB Desc:		North83:	4823542.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	18-Dec-2020 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Bore Hole ID:	1008614901	Tag No:	A312084
Depth M:		Contractor:	7644
Year Completed:	2020	Path:	
Well Completed Dt:	2020/12/18	Latitude:	43.5561088255329
Audit No:	Z348113	Longitude:	-79.5874060999537

Wells and Additional Sources Detail Report

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
17	WNW	0.07	69.59	78.85	WWIS

Well ID:	7310439	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	17-Apr-2018 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z266994	Contractor:	6607
Tag:	A232662	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliabilty:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

PDF URL (Map):

Well Completed Date:	2018/02/03
Year Completed:	2018
Depth (m):	12.2
Latitude:	43.5564922174492
Longitude:	-79.5871000029076
Path:	

Bore Hole ID:	1007036930	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614119.00
Code OB Desc:		North83:	4823585.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	03-Feb-2018 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			

Wells and Additional Sources Detail Report

Improvement Location
Source:
Improvement Location
Method:
Source Revision
Comment:
Supplier Comment:

Formation ID: 1007268326
Layer: 3
Color: 6
General Color: BROWN
Mat1: 06
Most Common Material: SILT
Mat2: 17
Mat2 Desc: SHALE
Mat3: 73
Mat3 Desc: HARD
Formation Top Depth: 3.200000047683716
Formation End Depth: 7.599999904632568
Formation End Depth
UOM: m

Formation ID: 1007268324
Layer: 1
Color: 6
General Color: BROWN
Mat1: 28
Most Common Material: SAND
Mat2: 11
Mat2 Desc: GRAVEL
Mat3: 01
Mat3 Desc: FILL
Formation Top Depth: 0.0
Formation End Depth: 0.699999988079071
Formation End Depth
UOM: m

Formation ID: 1007268327
Layer: 4
Color: 7
General Color: RED
Mat1: 17
Most Common Material: SHALE
Mat2: 15
Mat2 Desc: LIMESTONE
Mat3: 26

Wells and Additional Sources Detail Report

Mat3 Desc: ROCK
Formation Top Depth: 7.599999904632568
Formation End Depth: 12.199999809265137
Formation End Depth UOM: m

Formation ID: 1007268325
Layer: 2
Color: 6
General Color: BROWN
Mat1: 28
Most Common Material: SAND
Mat2: 06
Mat2 Desc: SILT
Mat3: 85
Mat3 Desc: SOFT
Formation Top Depth: 0.699999988079071
Formation End Depth: 3.200000047683716
Formation End Depth UOM: m

Plug ID: 1007268336
Layer: 2
Plug From: 0.30000001192092896
Plug To: 7.599999904632568
Plug Depth UOM: m

Plug ID: 1007268337
Layer: 3
Plug From: 7.599999904632568
Plug To: 8.899999618530273
Plug Depth UOM: m

Plug ID: 1007268335
Layer: 1
Plug From: 0.0
Plug To: 0.30000001192092896
Plug Depth UOM: m

Method Construction ID: 1007268334
Method Construction Code: 6
Method Construction: Boring
Other Method Construction: DIAMOND

Wells and Additional Sources Detail Report

Pipe ID: 1007268323

Casing No: 0

Comment:

Alt Name:

Casing ID: 1007268331

Layer: 1

Material: 5

Open Hole or Material: PLASTIC

Depth From: 0.0

Depth To: 9.199999809265137

Casing Diameter: 5.099999904632568

Casing Diameter UOM: cm

Casing Depth UOM: m

Screen ID: 1007268332

Layer: 1

Slot: 10

Screen Top Depth: 9.199999809265137

Screen End Depth: 12.199999809265137

Screen Material: 5

Screen Depth UOM: m

Screen Diameter UOM: cm

Screen Diameter: 6.400000095367432

Water ID: 1007268330

Layer:

Kind Code:

Kind:

Water Found Depth:

Water Found Depth UOM: m

Hole ID: 1007268329

Diameter: 9.600000381469727

Depth From: 7.599999904632568

Depth To: 12.199999809265137

Hole Depth UOM: m

Hole Diameter UOM: cm

Hole ID: 1007268328

Wells and Additional Sources Detail Report

Diameter: 21.0
 Depth From: 0.0
 Depth To: 7.599999904632568
 Hole Depth UOM: m
 Hole Diameter UOM: cm

Bore Hole ID: 1007036930 Tag No: A232662
 Depth M: 12.2 Contractor: 6607
 Year Completed: 2018 Path: 731\7310439.pdf
 Well Completed Dt: 2018/02/03 Latitude: 43.5564922174492
 Audit No: Z266994 Longitude: -79.5871000029076

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
18	WNW	0.07	71.67	78.85	WWIS

Well ID: 7321737 Flowing (Y/N):
 Construction Date: Flow Rate:
 Use 1st: Monitoring Data Entry Status:
 Use 2nd: Data Src:
 Final Well Status: Observation Wells Date Received: 07-Nov-2018 00:00:00
 Water Type: Selected Flag: TRUE
 Casing Material: Abandonment Rec:
 Audit No: Z266906 Contractor: 6607
 Tag: A232817 Form Version: 7
 Constructn Method: Owner:
 Elevation (m): County: PEEL
 Elevatn Reliability: Lot:
 Depth to Bedrock: Concession:
 Well Depth: Concession Name:
 Overburden/Bedrock: Easting NAD83:
 Pump Rate: Northing NAD83:
 Static Water Level: Zone:
 Clear/Cloudy: UTM Reliability:
 Municipality: MISSISSAUGA CITY (PORT CREDIT)
 Site Info:

PDF URL (Map):

Well Completed Date: 2018/01/19
 Year Completed: 2018
 Depth (m): 15.2
 Latitude: 43.5565370718042
 Longitude: -79.5870865738659
 Path:

Wells and Additional Sources Detail Report

Bore Hole ID:	1007306909	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614120.00
Code OB Desc:		North83:	4823590.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	19-Jan-2018 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Formation ID:	1007599592
Layer:	4
Color:	2
General Color:	GREY
Mat1:	15
Most Common Material:	LIMESTONE
Mat2:	26
Mat2 Desc:	ROCK
Mat3:	73
Mat3 Desc:	HARD
Formation Top Depth:	9.100000381469727
Formation End Depth:	15.199999809265137
Formation End Depth UOM:	m

Formation ID:	1007599590
Layer:	2
Color:	2
General Color:	GREY
Mat1:	05
Most Common Material:	CLAY
Mat2:	06
Mat2 Desc:	SILT
Mat3:	85
Mat3 Desc:	SOFT
Formation Top Depth:	1.5
Formation End Depth:	6.0

Wells and Additional Sources Detail Report

Formation End Depth m
UOM:

Formation ID: 1007599589
Layer: 1
Color: 6
General Color: BROWN
Mat1: 28
Most Common Material: SAND
Mat2: 11
Mat2 Desc: GRAVEL
Mat3: 85
Mat3 Desc: SOFT
Formation Top Depth: 0.0
Formation End Depth: 1.5
Formation End Depth m
UOM:

Formation ID: 1007599591
Layer: 3
Color: 2
General Color: GREY
Mat1: 06
Most Common Material: SILT
Mat2: 11
Mat2 Desc: GRAVEL
Mat3: 73
Mat3 Desc: HARD
Formation Top Depth: 6.0
Formation End Depth: 9.1000000381469727
Formation End Depth m
UOM:

Plug ID: 1007599600
Layer: 1
Plug From: 0.0
Plug To: 0.30000001192092896
Plug Depth UOM: m

Plug ID: 1007599601
Layer: 2
Plug From: 0.30000001192092896
Plug To: 11.800000190734863
Plug Depth UOM: m

Wells and Additional Sources Detail Report

Method Construction ID: 1007599599
Method Construction Code: 6
Method Construction: Boring
Other Method Construction: DIAMOND

Pipe ID: 1007599588
Casing No: 0
Comment:
Alt Name:

Casing ID: 1007599596
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 12.100000381469727
Casing Diameter: 5.099999904632568
Casing Diameter UOM: cm
Casing Depth UOM: m

Screen ID: 1007599597
Layer: 1
Slot: 10
Screen Top Depth: 12.100000381469727
Screen End Depth: 15.199999809265137
Screen Material: 5
Screen Depth UOM: m
Screen Diameter UOM: cm
Screen Diameter: 6.400000095367432

Water ID: 1007599595
Layer:
Kind Code:
Kind:
Water Found Depth:
Water Found Depth UOM: m

Hole ID: 1007599593
Diameter: 21.0
Depth From: 0.0

Wells and Additional Sources Detail Report

Depth To: 9.100000381469727
 Hole Depth UOM: m
 Hole Diameter UOM: cm

Hole ID: 1007599594
 Diameter: 9.600000381469727
 Depth From: 9.100000381469727
 Depth To: 15.199999809265137
 Hole Depth UOM: m
 Hole Diameter UOM: cm

Bore Hole ID:	1007306909	Tag No:	A232817
Depth M:	15.2	Contractor:	6607
Year Completed:	2018	Path:	732\7321737.pdf
Well Completed Dt:	2018/01/19	Latitude:	43.5565370718042
Audit No:	Z266906	Longitude:	-79.5870865738659

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
19	N	0.09	90.83	79.85	WWIS

Well ID:	7307874	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	15-Mar-2018 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z255690	Contractor:	6607
Tag:	A241358	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

PDF URL (Map):

Wells and Additional Sources Detail Report

Well Completed Date: 2018/01/12
Year Completed: 2018
Depth (m): 5.3
Latitude: 43.557167574587
Longitude: -79.5856480304261
Path:

Bore Hole ID:	1007003612	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614235.00
Code OB Desc:		North83:	4823662.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	12-Jan-2018 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Formation ID: 1007230205
Layer: 3
Color: 2
General Color: GREY
Mat1: 06
Most Common Material: SILT
Mat2: 11
Mat2 Desc: GRAVEL
Mat3: 73
Mat3 Desc: HARD
Formation Top Depth: 4.5
Formation End Depth: 5.300000190734863
Formation End Depth UOM: m

Formation ID: 1007230203
Layer: 1
Color: 6
General Color: BROWN
Mat1: 28
Most Common Material: SAND

Wells and Additional Sources Detail Report

Mat2: 11
Mat2 Desc: GRAVEL
Mat3: 85
Mat3 Desc: SOFT
Formation Top Depth: 0.0
Formation End Depth: 1.5
Formation End Depth
UOM: m

Formation ID: 1007230204
Layer: 2
Color: 2
General Color: GREY
Mat1: 05
Most Common Material: CLAY
Mat2: 28
Mat2 Desc: SAND
Mat3: 85
Mat3 Desc: SOFT
Formation Top Depth: 1.5
Formation End Depth: 4.5
Formation End Depth
UOM: m

Plug ID: 1007230213
Layer: 2
Plug From: 0.30000001192092896
Plug To: 1.5
Plug Depth UOM: m

Plug ID: 1007230212
Layer: 1
Plug From: 0.0
Plug To: 0.30000001192092896
Plug Depth UOM: m

Method Construction ID: 1007230211
Method Construction
Code: 6
Method Construction: Boring
Other Method
Construction:

Pipe ID: 1007230202
Casing No: 0

Wells and Additional Sources Detail Report

Comment:

Alt Name:

Casing ID: 1007230208
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 1.5
Casing Diameter: 5.099999904632568
Casing Diameter UOM: cm
Casing Depth UOM: m

Screen ID: 1007230209
Layer: 1
Slot: 10
Screen Top Depth: 1.5
Screen End Depth: 5.300000190734863
Screen Material: 5
Screen Depth UOM: m
Screen Diameter UOM: cm
Screen Diameter: 6.400000095367432

Water ID: 1007230207
Layer:
Kind Code:
Kind:
Water Found Depth:
Water Found Depth UOM: m

Hole ID: 1007230206
Diameter: 21.0
Depth From: 0.0
Depth To: 5.300000190734863
Hole Depth UOM: m
Hole Diameter UOM: cm

Bore Hole ID:	1007003612	Tag No:	A241358
Depth M:	5.3	Contractor:	6607
Year Completed:	2018	Path:	730\7307874.pdf
Well Completed Dt:	2018/01/12	Latitude:	43.557167574587
Audit No:	Z255690	Longitude:	-79.5856480304261

Wells and Additional Sources Detail Report

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
20	ENE	0.09	91.86	79.83	WWIS

Well ID:	7234471	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	30-Dec-2014 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z192922	Contractor:	7295
Tag:	A168568	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:			
Site Info:			

Bore Hole ID:	1005281118	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	
Code OB Desc:		North83:	
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	9
Date Completed:	24-Oct-2014 00:00:00	UTMRC Desc:	unknown UTM
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location			
Source:			
Improvement Location			
Method:			
Source Revision			
Comment:			
Supplier Comment:			

Formation ID:	1005471807
Layer:	2

Wells and Additional Sources Detail Report

Color: 6
General Color: BROWN
Mat1: 28
Most Common Material: SAND
Mat2:
Mat2 Desc:
Mat3: 08
Mat3 Desc: FINE SAND
Formation Top Depth: 3.0
Formation End Depth: 8.0
Formation End Depth
UOM: ft

Formation ID: 1005471808
Layer: 3
Color: 2
General Color: GREY
Mat1: 34
Most Common Material: TILL
Mat2:
Mat2 Desc:
Mat3:
Mat3 Desc:
Formation Top Depth: 8.0
Formation End Depth: 22.0
Formation End Depth
UOM: ft

Formation ID: 1005471806
Layer: 1
Color: 6
General Color: BROWN
Mat1: 01
Most Common Material: FILL
Mat2:
Mat2 Desc:
Mat3: 11
Mat3 Desc: GRAVEL
Formation Top Depth: 0.0
Formation End Depth: 3.0
Formation End Depth
UOM: ft

Formation ID: 1005471809
Layer: 4
Color: 2

Wells and Additional Sources Detail Report

General Color: GREY
Mat1: 34
Most Common Material: TILL
Mat2: 17
Mat2 Desc: SHALE
Mat3:
Mat3 Desc:
Formation Top Depth: 22.0
Formation End Depth: 30.0
Formation End Depth UOM: ft

Plug ID: 1005471816
Layer: 1
Plug From: 0.0
Plug To: 24.0
Plug Depth UOM: ft

Method Construction ID: 1005471815
Method Construction Code: 6
Method Construction: Boring
Other Method Construction:

Pipe ID: 1005471805
Casing No: 0
Comment:
Alt Name:

Casing ID: 1005471812
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 25.0
Casing Diameter: 1.7999999523162842
Casing Diameter UOM: inch
Casing Depth UOM: ft

Screen ID: 1005471813
Layer: 1
Slot: 10
Screen Top Depth: 25.0

Wells and Additional Sources Detail Report

Screen End Depth: 30.0
 Screen Material: 5
 Screen Depth UOM: ft
 Screen Diameter UOM: inch
 Screen Diameter: 2.0

Water ID: 1005471811
 Layer:
 Kind Code:
 Kind:
 Water Found Depth:
 Water Found Depth UOM: ft

Hole ID: 1005471810
 Diameter:
 Depth From:
 Depth To:
 Hole Depth UOM: ft
 Hole Diameter UOM: inch

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
21	N	0.10	97.72	79.85	WWIS

Well ID:	7378960	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:		Data Entry Status:	Yes
Use 2nd:		Data Src:	
Final Well Status:		Date Received:	29-Jan-2021 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z348115	Contractor:	7644
Tag:	A312091	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

Wells and Additional Sources Detail Report

Bore Hole ID:	1008614895	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614203.00
Code OB Desc:		North83:	4823676.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	15-Dec-2020 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Bore Hole ID:	1008614895	Tag No:	A312091
Depth M:		Contractor:	7644
Year Completed:	2020	Path:	
Well Completed Dt:	2020/12/15	Latitude:	43.5572984950517
Audit No:	Z348115	Longitude:	-79.5860411586813

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
22	NNE	0.10	98.76	79.85	WWIS

Well ID:	7355170	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Test Hole	Data Entry Status:	
Use 2nd:	Monitoring	Data Src:	
Final Well Status:	Observation Wells	Date Received:	28-Nov-2018 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z275303	Contractor:	7383
Tag:	A235313	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliabilty:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	

Wells and Additional Sources Detail Report

Municipality: MISSISSAUGA CITY (PORT CREDIT)
Site Info:

PDF URL (Map):

Well Completed Date: 2018/10/20
Year Completed: 2018
Depth (m):
Latitude: 43.5571927411251
Longitude: -79.5854988702987
Path:

Bore Hole ID:	1008221292	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614247.00
Code OB Desc:		North83:	4823665.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	20-Oct-2018 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Formation ID: 1008268355
Layer: 2
Color: 2
General Color: GREY
Mat1: 05
Most Common Material: CLAY
Mat2: 06
Mat2 Desc: SILT
Mat3: 66
Mat3 Desc: DENSE
Formation Top Depth:
Formation End Depth:
Formation End Depth UOM:

Wells and Additional Sources Detail Report

Formation ID: 1008268356
Layer: 3
Color: 2
General Color: GREY
Mat1: 34
Most Common Material: TILL
Mat2: 17
Mat2 Desc: SHALE
Mat3: 66
Mat3 Desc: DENSE
Formation Top Depth:
Formation End Depth:
Formation End Depth
UOM:

Formation ID: 1008268354
Layer: 1
Color: 8
General Color: BLACK
Mat1: 27
Most Common Material: OTHER
Mat2:
Mat2 Desc:
Mat3: 73
Mat3 Desc: HARD
Formation Top Depth: 0.0
Formation End Depth:
Formation End Depth
UOM:

Plug ID: 1008268748
Layer: 1
Plug From: 0.0
Plug To: 1.0
Plug Depth UOM: ft

Plug ID: 1008268750
Layer: 3
Plug From: 24.0
Plug To: 35.0
Plug Depth UOM: ft

Plug ID: 1008268749
Layer: 2

Wells and Additional Sources Detail Report

Plug From: 1.0
Plug To: 24.0
Plug Depth UOM: ft

Method Construction ID: 1008269239
Method Construction Code: 2
Method Construction: Rotary (Convent.)
Other Method Construction:

Pipe ID: 1008267825
Casing No: 0
Comment:
Alt Name:

Casing ID: 1008269428
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 25.0
Casing Diameter: 2.0
Casing Diameter UOM: Inch
Casing Depth UOM: ft

Screen ID: 1008269598
Layer: 1
Slot: 10
Screen Top Depth: 25.0
Screen End Depth: 35.0
Screen Material: 5
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 2.375

Pump Test ID: 1008269864
Pump Set At:
Static Level:
Final Level After Pumping:
Recommended Pump Depth:
Pumping Rate:
Flowing Rate:

Wells and Additional Sources Detail Report

Recommended Pump
Rate:
Levels UOM: ft
Rate UOM: GPM
Water State After Test
Code:
Water State After Test:
Pumping Test Method: 0
Pumping Duration HR:
Pumping Duration MIN:
Flowing:

Water ID: 1008269726
Layer: 1
Kind Code: 8
Kind: Untested
Water Found Depth: 33.5
Water Found Depth UOM: ft

Hole ID: 1008269044
Diameter: 6.0
Depth From: 0.0
Depth To: 35.0
Hole Depth UOM: ft
Hole Diameter UOM: Inch

Bore Hole ID:	1008221292	Tag No:	A235313
Depth M:		Contractor:	7383
Year Completed:	2018	Path:	
Well Completed Dt:	2018/10/20	Latitude:	43.5571927411251
Audit No:	Z275303	Longitude:	-79.5854988702987

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
23	NE	0.10	99.87	79.85	WWIS

Well ID:	7321771	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	07-Nov-2018 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z266878	Contractor:	6607
Tag:	A232639	Form Version:	7
Constructn Method:		Owner:	

Wells and Additional Sources Detail Report

Elevation (m):	County:	PEEL
Elevatn Reliability:	Lot:	
Depth to Bedrock:	Concession:	
Well Depth:	Concession Name:	
Overburden/Bedrock:	Easting NAD83:	
Pump Rate:	Northing NAD83:	
Static Water Level:	Zone:	
Clear/Cloudy:	UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)	
Site Info:		

PDF URL (Map):

Well Completed Date:	2018/07/21
Year Completed:	2018
Depth (m):	7.62
Latitude:	43.5569710381831
Longitude:	-79.5850459639712
Path:	

Bore Hole ID:	1007307011	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614284.00
Code OB Desc:		North83:	4823641.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	21-Jul-2018 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Formation ID:	1007602916
Layer:	1
Color:	6
General Color:	BROWN
Mat1:	11
Most Common Material:	GRAVEL
Mat2:	28

Wells and Additional Sources Detail Report

Mat2 Desc: SAND
Mat3:
Mat3 Desc:
Formation Top Depth: 0.0
Formation End Depth: 5.0
Formation End Depth
UOM: ft

Formation ID: 1007602918
Layer: 3
Color: 2
General Color: GREY
Mat1: 28
Most Common Material: SAND
Mat2: 06
Mat2 Desc: SILT
Mat3:
Mat3 Desc:
Formation Top Depth: 15.0
Formation End Depth: 25.0
Formation End Depth
UOM: ft

Formation ID: 1007602917
Layer: 2
Color: 6
General Color: BROWN
Mat1: 28
Most Common Material: SAND
Mat2:
Mat2 Desc:
Mat3:
Mat3 Desc:
Formation Top Depth: 5.0
Formation End Depth: 15.0
Formation End Depth
UOM: ft

Plug ID: 1007602926
Layer: 2
Plug From: 24.0
Plug To: 35.0
Plug Depth UOM: ft

Plug ID: 1007602925

Wells and Additional Sources Detail Report

Layer: 1
Plug From: 0.0
Plug To: 24.0
Plug Depth UOM: ft

Method Construction ID: 1007602924
Method Construction Code: 6
Method Construction: Boring
Other Method Construction: DIAMOND

Pipe ID: 1007602915
Casing No: 0
Comment:
Alt Name:

Casing ID: 1007602921
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 25.0
Casing Diameter: 5.099999904632568
Casing Diameter UOM: inch
Casing Depth UOM: ft

Screen ID: 1007602922
Layer: 1
Slot: 10
Screen Top Depth: 25.0
Screen End Depth: 35.0
Screen Material: 5
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 6.400000095367432

Water ID: 1007602920
Layer:
Kind Code:
Kind:
Water Found Depth:
Water Found Depth UOM: ft

Wells and Additional Sources Detail Report

Hole ID: 1007602919
 Diameter: 5.5
 Depth From: 0.0
 Depth To: 35.0
 Hole Depth UOM: ft
 Hole Diameter UOM: inch

Bore Hole ID:	1007307011	Tag No:	A232639
Depth M:	7.62	Contractor:	6607
Year Completed:	2018	Path:	732\7321771.pdf
Well Completed Dt:	2018/07/21	Latitude:	43.5569710381831
Audit No:	Z266878	Longitude:	-79.5850459639712

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
24	N	0.10	103.67	79.85	WWIS

Well ID:	7378961	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:		Data Entry Status:	Yes
Use 2nd:		Data Src:	
Final Well Status:		Date Received:	29-Jan-2021 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z348114	Contractor:	7644
Tag:	A312085	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliabilty:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

Bore Hole ID:	1008614898	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614201.00
Code OB Desc:		North83:	4823682.00

Wells and Additional Sources Detail Report

Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	18-Dec-2020 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Bore Hole ID:	1008614898	Tag No:	A312085
Depth M:		Contractor:	7644
Year Completed:	2020	Path:	
Well Completed Dt:	2020/12/18	Latitude:	43.5573528100356
Audit No:	Z348114	Longitude:	-79.5860646503373

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
25	ENE	0.11	105.14	79.85	WWIS

Well ID:	7363633	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	07-Aug-2020 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	2DEKHQS6	Contractor:	7609
Tag:	A283539	Form Version:	9
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliabilty:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

Bore Hole ID:	1008371680	Elevation:	
DP2BR:		Elevrc:	

Wells and Additional Sources Detail Report

Spatial Status:	Zone:	17
Code OB:	East83:	614337.00
Code OB Desc:	North83:	4823610.00
Open Hole:	Org CS:	UTM83
Cluster Kind:	UTMRC:	4
Date Completed: 27-Jul-2020 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:	Location Method:	wwr
Elevrc Desc:		
Location Source Date:		
Improvement Location Source:		
Improvement Location Method:		
Source Revision		
Comment:		
Supplier Comment:		

Formation ID:	1008371794
Layer:	1
Color:	6
General Color:	BROWN
Mat1:	01
Most Common Material:	FILL
Mat2:	28
Mat2 Desc:	SAND
Mat3:	77
Mat3 Desc:	LOOSE
Formation Top Depth:	0.0
Formation End Depth:	1.5199999809265137
Formation End Depth UOM:	m

Formation ID:	1008371796
Layer:	3
Color:	6
General Color:	BROWN
Mat1:	28
Most Common Material:	SAND
Mat2:	06
Mat2 Desc:	SILT
Mat3:	11
Mat3 Desc:	GRAVEL
Formation Top Depth:	3.049999952316284
Formation End Depth:	5.179999828338623
Formation End Depth UOM:	m

Wells and Additional Sources Detail Report

Formation ID: 1008371795
Layer: 2
Color: 6
General Color: BROWN
Mat1: 28
Most Common Material: SAND
Mat2:
Mat2 Desc:
Mat3:
Mat3 Desc:
Formation Top Depth: 1.5199999809265137
Formation End Depth: 3.049999952316284
Formation End Depth UOM: m

Plug ID: 1008371857
Layer: 1
Plug From:
Plug To:
Plug Depth UOM: m

Plug ID: 1008371885
Layer: 1
Plug From: 0.0
Plug To: 0.30000001192092896
Plug Depth UOM: m

Plug ID: 1008371886
Layer: 2
Plug From: 0.30000001192092896
Plug To: 1.8300000429153442
Plug Depth UOM: m

Plug ID: 1008371887
Layer: 3
Plug From: 1.8300000429153442
Plug To: 5.179999828338623
Plug Depth UOM: m

Method Construction ID: 1008371758
Method Construction Code: E
Method Construction: Auger

Wells and Additional Sources Detail Report

Other Method
Construction:

Pipe ID: 1008371728
Casing No: 0
Comment:
Alt Name:

Casing ID: 1008371819
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 2.130000114440918
Casing Diameter: 5.0
Casing Diameter UOM: cm
Casing Depth UOM: m

Screen ID: 1008371829
Layer: 1
Slot: 010
Screen Top Depth: 2.130000114440918
Screen End Depth: 5.179999828338623
Screen Material: 5
Screen Depth UOM: m
Screen Diameter UOM: cm
Screen Diameter: 6.0

Pump Test ID: 1008371729
Pump Set At:
Static Level:
Final Level After Pumping:
Recommended Pump
Depth:
Pumping Rate:
Flowing Rate:
Recommended Pump
Rate:
Levels UOM: m
Rate UOM: LPM
Water State After Test
Code:
Water State After Test:
Pumping Test Method:
Pumping Duration HR:
Pumping Duration MIN:

Wells and Additional Sources Detail Report

Flowing:

Hole ID: 1008371842
 Diameter: 21.0
 Depth From: 0.0
 Depth To: 5.179999828338623
 Hole Depth UOM: m
 Hole Diameter UOM: cm

Bore Hole ID:	1008371680	Tag No:	A283539
Depth M:	5.18	Contractor:	7609
Year Completed:	2020	Path:	736\7363633.pdf
Well Completed Dt:	2020/07/27	Latitude:	43.5566838709673
Audit No:	2DEKHQS6	Longitude:	-79.5843965000502

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
26	WSW	0.11	108.02	78.85	WWIS

Well ID:	7321814	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	07-Nov-2018 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z266907	Contractor:	6607
Tag:	A232747	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

PDF URL (Map):

Well Completed Date: 2018/01/19
 Year Completed: 2018

Wells and Additional Sources Detail Report

Depth (m): 4.5
Latitude: 43.5552750532576
Longitude: -79.5876979521631
Path:

Bore Hole ID: 1007307140
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 19-Jan-2018 00:00:00
Remarks:
Elevrc Desc:
Location Source Date:
Improvement Location
Source:
Improvement Location
Method:
Source Revision
Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 17
East83: 614073.00
North83: 4823449.00
Org CS: UTM83
UTMRC: 4
UTMRC Desc: margin of error : 30 m - 100 m
Location Method: wwr

Formation ID: 1007605525
Layer: 3
Color: 6
General Color: BROWN
Mat1: 28
Most Common Material: SAND
Mat2: 06
Mat2 Desc: SILT
Mat3: 85
Mat3 Desc: SOFT
Formation Top Depth: 3.0
Formation End Depth: 4.5
Formation End Depth
UOM: m

Formation ID: 1007605524
Layer: 2
Color: 2
General Color: GREY
Mat1: 05
Most Common Material: CLAY
Mat2: 06
Mat2 Desc: SILT

Wells and Additional Sources Detail Report

Mat3: 85
Mat3 Desc: SOFT
Formation Top Depth: 1.5
Formation End Depth: 3.0
Formation End Depth UOM: m

Formation ID: 1007605523
Layer: 1
Color: 6
General Color: BROWN
Mat1: 28
Most Common Material: SAND
Mat2: 11
Mat2 Desc: GRAVEL
Mat3: 85
Mat3 Desc: SOFT
Formation Top Depth: 0.0
Formation End Depth: 1.5
Formation End Depth UOM: m

Plug ID: 1007605532
Layer: 1
Plug From: 0.0
Plug To: 0.30000001192092896
Plug Depth UOM: m

Plug ID: 1007605533
Layer: 2
Plug From: 0.30000001192092896
Plug To: 1.5
Plug Depth UOM: m

Method Construction ID: 1007605531
Method Construction Code: 6
Method Construction: Boring
Other Method Construction:

Pipe ID: 1007605522
Casing No: 0
Comment:
Alt Name:

Wells and Additional Sources Detail Report

Casing ID: 1007605528
 Layer: 1
 Material: 5
 Open Hole or Material: PLASTIC
 Depth From: 0.0
 Depth To: 1.5
 Casing Diameter: 5.099999904632568
 Casing Diameter UOM: cm
 Casing Depth UOM: m

Screen ID: 1007605529
 Layer: 1
 Slot: 10
 Screen Top Depth: 1.5
 Screen End Depth: 4.5
 Screen Material: 5
 Screen Depth UOM: m
 Screen Diameter UOM: cm
 Screen Diameter: 6.400000095367432

Water ID: 1007605527
 Layer:
 Kind Code:
 Kind:
 Water Found Depth:
 Water Found Depth UOM: m

Hole ID: 1007605526
 Diameter: 15.0
 Depth From: 0.0
 Depth To: 4.5
 Hole Depth UOM: m
 Hole Diameter UOM: cm

Bore Hole ID:	1007307140	Tag No:	A232747
Depth M:	4.5	Contractor:	6607
Year Completed:	2018	Path:	732\7321814.pdf
Well Completed Dt:	2018/01/19	Latitude:	43.5552750532576
Audit No:	Z266907	Longitude:	-79.5876979521631

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB

Wells and Additional Sources Detail Report

27	SSW	0.11	112.27	79.04	WWIS
Well ID:	7370471	Flowing (Y/N):			
Construction Date:		Flow Rate:			
Use 1st:		Data Entry Status:	Yes		
Use 2nd:		Data Src:			
Final Well Status:		Date Received:	16-Oct-2020 00:00:00		
Water Type:		Selected Flag:	TRUE		
Casing Material:		Abandonment Rec:			
Audit No:	C49171	Contractor:	6988		
Tag:	A276698	Form Version:	8		
Constructn Method:		Owner:			
Elevation (m):		County:	PEEL		
Elevatn Reliabilty:		Lot:			
Depth to Bedrock:		Concession:			
Well Depth:		Concession Name:			
Overburden/Bedrock:		Easting NAD83:			
Pump Rate:		Northing NAD83:			
Static Water Level:		Zone:			
Clear/Cloudy:		UTM Reliability:			
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:					
Bore Hole ID:	1008492719	Elevation:			
DP2BR:		Elevrc:			
Spatial Status:		Zone:	17		
Code OB:		East83:	614146.00		
Code OB Desc:		North83:	4823385.00		
Open Hole:		Org CS:	UTM83		
Cluster Kind:		UTMRC:	4		
Date Completed:	02-Jun-2020 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m		
Remarks:		Location Method:	wwr		
Elevrc Desc:					
Location Source Date:					
Improvement Location					
Source:					
Improvement Location					
Method:					
Source Revision					
Comment:					
Supplier Comment:					
Bore Hole ID:	1008492719	Tag No:	A276698		
Depth M:		Contractor:	6988		
Year Completed:	2020	Path:			
Well Completed Dt:	2020/06/02	Latitude:	43.5546877925646		
Audit No:	C49171	Longitude:	-79.5868078977923		

Wells and Additional Sources Detail Report

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
28	NE	0.11	114.00	79.85	WWIS

Well ID:	7363630	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	07-Aug-2020 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	2QGO89A5	Contractor:	7609
Tag:	A283617	Form Version:	9
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliabilty:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

Bore Hole ID:	1008371671	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614300.00
Code OB Desc:		North83:	4823647.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	24-Jul-2020 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Formation ID:	1008371787
Layer:	1

Wells and Additional Sources Detail Report

Color: 6
General Color: BROWN
Mat1: 01
Most Common Material: FILL
Mat2: 28
Mat2 Desc: SAND
Mat3: 77
Mat3 Desc: LOOSE
Formation Top Depth: 0.0
Formation End Depth: 1.5199999809265137
Formation End Depth UOM: m

Plug ID: 1008371877
Layer: 2
Plug From: 0.30000001192092896
Plug To: 1.5199999809265137
Plug Depth UOM: m

Plug ID: 1008371878
Layer: 3
Plug From: 1.5199999809265137
Plug To: 4.570000171661377
Plug Depth UOM: m

Plug ID: 1008371854
Layer: 1
Plug From:
Plug To:
Plug Depth UOM: m

Plug ID: 1008371876
Layer: 1
Plug From: 0.30000001192092896
Plug To: 0.30000001192092896
Plug Depth UOM: m

Method Construction ID: 1008371754
Method Construction Code: E
Method Construction: Auger
Other Method Construction: Augering

Wells and Additional Sources Detail Report

Method Construction ID: 1008371755
Method Construction Code: B
Method Construction: Other Method
Other Method Construction:

Pipe ID: 1008371722
Casing No: 0
Comment:
Alt Name:

Casing ID: 1008371816
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 1.5199999809265137
Casing Diameter: 5.0
Casing Diameter UOM: cm
Casing Depth UOM: m

Screen ID: 1008371826
Layer: 1
Slot: 20
Screen Top Depth: 1.5199999809265137
Screen End Depth: 4.570000171661377
Screen Material: 5
Screen Depth UOM: m
Screen Diameter UOM: cm
Screen Diameter: 6.0

Pump Test ID: 1008371723
Pump Set At:
Static Level:
Final Level After Pumping:
Recommended Pump Depth:
Pumping Rate:
Flowing Rate:
Recommended Pump Rate:
Levels UOM: m
Rate UOM: LPM
Water State After Test

Wells and Additional Sources Detail Report

Code:

Water State After Test:

Pumping Test Method:

Pumping Duration HR:

Pumping Duration MIN:

Flowing:

Hole ID: 1008371839
 Diameter: 21.0
 Depth From: 0.0
 Depth To: 4.570000171661377
 Hole Depth UOM: m
 Hole Diameter UOM: cm

Bore Hole ID:	1008371671	Tag No:	A283617
Depth M:	1.52	Contractor:	7609
Year Completed:	2020	Path:	736\7363630.pdf
Well Completed Dt:	2020/07/24	Latitude:	43.5570225953993
Audit No:	2QGO89A5	Longitude:	-79.5848466627181

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
29	NE	0.12	120.45	79.85	WWIS

Well ID:	7321812	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	0	Date Received:	07-Nov-2018 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z266902	Contractor:	6607
Tag:	A241249	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

Wells and Additional Sources Detail Report

PDF URL (Map):

Well Completed Date: 2018/01/15
Year Completed: 2018
Depth (m): 15.2
Latitude: 43.5570024471017
Longitude: -79.5846738016095
Path:

Bore Hole ID:	1007307134	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614314.00
Code OB Desc:		North83:	4823645.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	15-Jan-2018 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Formation ID: 1007605497
Layer: 4
Color: 2
General Color: GREY
Mat1: 15
Most Common Material: LIMESTONE
Mat2: 26
Mat2 Desc: ROCK
Mat3: 73
Mat3 Desc: HARD
Formation Top Depth: 9.100000381469727
Formation End Depth: 15.199999809265137
Formation End Depth UOM: m

Formation ID: 1007605494
Layer: 1
Color: 6

Wells and Additional Sources Detail Report

General Color: BROWN
Mat1: 28
Most Common Material: SAND
Mat2: 11
Mat2 Desc: GRAVEL
Mat3: 85
Mat3 Desc: SOFT
Formation Top Depth: 0.0
Formation End Depth: 1.5
Formation End Depth UOM: m

Formation ID: 1007605495
Layer: 2
Color: 2
General Color: GREY
Mat1: 05
Most Common Material: CLAY
Mat2: 06
Mat2 Desc: SILT
Mat3: 85
Mat3 Desc: SOFT
Formation Top Depth: 1.5
Formation End Depth: 6.0
Formation End Depth UOM: m

Formation ID: 1007605496
Layer: 3
Color: 2
General Color: GREY
Mat1: 06
Most Common Material: SILT
Mat2: 11
Mat2 Desc: GRAVEL
Mat3: 73
Mat3 Desc: HARD
Formation Top Depth: 6.0
Formation End Depth: 9.100000381469727
Formation End Depth UOM: m

Plug ID: 1007605507
Layer: 2
Plug From: 0.30000001192092896
Plug To: 11.800000190734863

Wells and Additional Sources Detail Report

Plug Depth UOM: m

Plug ID: 1007605506
Layer: 1
Plug From: 0.0
Plug To: 0.30000001192092896
Plug Depth UOM: m

Method Construction ID: 1007605505
Method Construction Code: 6
Method Construction: Boring
Other Method Construction:

Pipe ID: 1007605493
Casing No: 0
Comment:
Alt Name:

Casing ID: 1007605501
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 12.100000381469727
Casing Diameter: 5.099999904632568
Casing Diameter UOM: cm
Casing Depth UOM: m

Casing ID: 1007605502
Layer: 2
Material:
Open Hole or Material:
Depth From:
Depth To:
Casing Diameter:
Casing Diameter UOM: cm
Casing Depth UOM: m

Screen ID: 1007605503
Layer: 1

Wells and Additional Sources Detail Report

Slot: 10
 Screen Top Depth: 12.100000381469727
 Screen End Depth: 15.199999809265137
 Screen Material: 5
 Screen Depth UOM: m
 Screen Diameter UOM: cm
 Screen Diameter: 6.400000095367432

Water ID: 1007605500
 Layer:
 Kind Code:
 Kind:
 Water Found Depth:
 Water Found Depth UOM: m

Hole ID: 1007605499
 Diameter: 9.600000381469727
 Depth From: 9.100000381469727
 Depth To: 15.199999809265137
 Hole Depth UOM: m
 Hole Diameter UOM: cm

Hole ID: 1007605498
 Diameter: 21.0
 Depth From: 0.0
 Depth To: 9.100000381469727
 Hole Depth UOM: m
 Hole Diameter UOM: cm

Bore Hole ID:	1007307134	Tag No:	A241249
Depth M:	15.2	Contractor:	6607
Year Completed:	2018	Path:	732\7321812.pdf
Well Completed Dt:	2018/01/15	Latitude:	43.5570024471017
Audit No:	Z266902	Longitude:	-79.5846738016095

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
30	NE	0.13	126.22	79.85	WWIS

Well ID:	7321811	Flowing (Y/N):
Construction Date:		Flow Rate:
Use 1st:	Monitoring	Data Entry Status:
Use 2nd:		Data Src:

Wells and Additional Sources Detail Report

Final Well Status:	Observation Wells	Date Received:	07-Nov-2018 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z266901	Contractor:	6607
Tag:	A241299	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

PDF URL (Map):

Well Completed Date:	2018/01/14
Year Completed:	2018
Depth (m):	4.63296
Latitude:	43.557000914527
Longitude:	-79.5845500284015
Path:	

Bore Hole ID:	1007307131	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614324.00
Code OB Desc:		North83:	4823645.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	14-Jan-2018 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Formation ID: 1007605477

Wells and Additional Sources Detail Report

Layer: 1
Color: 6
General Color: BROWN
Mat1: 28
Most Common Material: SAND
Mat2: 11
Mat2 Desc: GRAVEL
Mat3: 85
Mat3 Desc: SOFT
Formation Top Depth: 0.0
Formation End Depth: 1.5
Formation End Depth
UOM: ft

Formation ID: 1007605478
Layer: 2
Color: 2
General Color: GREY
Mat1: 05
Most Common Material: CLAY
Mat2: 06
Mat2 Desc: SILT
Mat3: 28
Mat3 Desc: SAND
Formation Top Depth: 1.5
Formation End Depth: 6.0
Formation End Depth
UOM: ft

Formation ID: 1007605479
Layer: 3
Color: 2
General Color: GREY
Mat1: 06
Most Common Material: SILT
Mat2: 11
Mat2 Desc: GRAVEL
Mat3: 34
Mat3 Desc: TILL
Formation Top Depth: 6.0
Formation End Depth: 7.599999904632568
Formation End Depth
UOM: ft

Formation ID: 1007605480
Layer: 4

Wells and Additional Sources Detail Report

Color: 2
General Color: GREY
Mat1: 15
Most Common Material: LIMESTONE
Mat2:
Mat2 Desc:
Mat3:
Mat3 Desc:
Formation Top Depth: 7.599999904632568
Formation End Depth: 15.199999809265137
Formation End Depth UOM: ft

Plug ID: 1007605489
Layer: 2
Plug From: 0.30000001192092896
Plug To: 11.800000190734863
Plug Depth UOM: ft

Plug ID: 1007605488
Layer: 1
Plug From: 0.0
Plug To: 0.30000001192092896
Plug Depth UOM: ft

Method Construction ID: 1007605487
Method Construction Code: 6
Method Construction: Boring
Other Method Construction: DIAMOND

Pipe ID: 1007605476
Casing No: 0
Comment:
Alt Name:

Casing ID: 1007605484
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 12.100000381469727
Casing Diameter: 5.099999904632568

Wells and Additional Sources Detail Report

Casing Diameter UOM: inch
Casing Depth UOM: ft

Screen ID: 1007605485
Layer: 1
Slot: 10
Screen Top Depth: 12.100000381469727
Screen End Depth: 15.199999809265137
Screen Material: 5
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 6.400000095367432

Water ID: 1007605483
Layer:
Kind Code:
Kind:
Water Found Depth:
Water Found Depth UOM: ft

Hole ID: 1007605482
Diameter:
Depth From: 9.100000381469727
Depth To: 15.199999809265137
Hole Depth UOM: ft
Hole Diameter UOM: inch

Hole ID: 1007605481
Diameter: 21.0
Depth From: 0.0
Depth To: 9.100000381469727
Hole Depth UOM: ft
Hole Diameter UOM: inch

Bore Hole ID:	1007307131	Tag No:	A241299
Depth M:	4.63296	Contractor:	6607
Year Completed:	2018	Path:	732\7321811.pdf
Well Completed Dt:	2018/01/14	Latitude:	43.557000914527
Audit No:	Z266901	Longitude:	-79.5845500284015

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
31	N	0.13	126.98	79.85	WWIS

Wells and Additional Sources Detail Report

Well ID:	7290488	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	18-Jul-2017 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z248281	Contractor:	6607
Tag:	A224419	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

PDF URL (Map):

Well Completed Date:	2017/05/23
Year Completed:	2017
Depth (m):	13.5
Latitude:	43.5575094769784
Longitude:	-79.5856276508326
Path:	

Bore Hole ID:	1006630840	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614236.00
Code OB Desc:		North83:	4823700.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	23-May-2017 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			

Wells and Additional Sources Detail Report

Source Revision
Comment:
Supplier Comment:

Formation ID: 1006696712
Layer: 2
Color: 6
General Color: BROWN
Mat1: 28
Most Common Material: SAND
Mat2: 06
Mat2 Desc: SILT
Mat3: 77
Mat3 Desc: LOOSE
Formation Top Depth: 1.0
Formation End Depth: 2.0
Formation End Depth UOM: m

Formation ID: 1006696714
Layer: 4
Color: 2
General Color: GREY
Mat1: 06
Most Common Material: SILT
Mat2: 05
Mat2 Desc: CLAY
Mat3: 66
Mat3 Desc: DENSE
Formation Top Depth: 3.0
Formation End Depth: 9.100000381469727
Formation End Depth UOM: m

Formation ID: 1006696713
Layer: 3
Color: 6
General Color: BROWN
Mat1: 06
Most Common Material: SILT
Mat2: 05
Mat2 Desc: CLAY
Mat3: 66
Mat3 Desc: DENSE
Formation Top Depth: 2.0
Formation End Depth: 3.0

Wells and Additional Sources Detail Report

Formation End Depth m
UOM:

Formation ID: 1006696715
Layer: 5
Color: 2
General Color: GREY
Mat1: 17
Most Common Material: SHALE
Mat2: 15
Mat2 Desc: LIMESTONE
Mat3: 74
Mat3 Desc: LAYERED
Formation Top Depth: 9.100000381469727
Formation End Depth: 13.5
Formation End Depth m
UOM:

Formation ID: 1006696711
Layer: 1
Color: 6
General Color: BROWN
Mat1: 28
Most Common Material: SAND
Mat2: 11
Mat2 Desc: GRAVEL
Mat3: 01
Mat3 Desc: FILL
Formation Top Depth: 0.0
Formation End Depth: 1.0
Formation End Depth m
UOM:

Plug ID: 1006696723
Layer: 1
Plug From:
Plug To:
Plug Depth UOM: m

Plug ID: 1006696725
Layer: 2
Plug From: 0.30000001192092896
Plug To: 9.199999809265137
Plug Depth UOM: m

Wells and Additional Sources Detail Report

Plug ID: 1006696724
Layer: 1
Plug From: 0.0
Plug To: 0.30000001192092896
Plug Depth UOM: m

Method Construction ID: 1006696722
Method Construction Code: 6
Method Construction: Boring
Other Method Construction: DIAMOND

Pipe ID: 1006696710
Casing No: 0
Comment:
Alt Name:

Casing ID: 1006696719
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.10000000149011612
Depth To: 9.699999809265137
Casing Diameter: 5.099999904632568
Casing Diameter UOM: cm
Casing Depth UOM: m

Screen ID: 1006696720
Layer: 1
Slot: 10
Screen Top Depth: 9.699999809265137
Screen End Depth: 12.800000190734863
Screen Material: 5
Screen Depth UOM: m
Screen Diameter UOM: cm
Screen Diameter: 6.400000095367432

Water ID: 1006696718
Layer:
Kind Code:
Kind:

Wells and Additional Sources Detail Report

Water Found Depth:

Water Found Depth UOM: m

Hole ID: 1006696717
 Diameter: 9.600000381469727
 Depth From: 9.100000381469727
 Depth To: 13.5
 Hole Depth UOM: m
 Hole Diameter UOM: cm

Hole ID: 1006696716
 Diameter: 21.0
 Depth From: 0.0
 Depth To: 9.100000381469727
 Hole Depth UOM: m
 Hole Diameter UOM: cm

Bore Hole ID:	1006630840	Tag No:	A224419
Depth M:	13.5	Contractor:	6607
Year Completed:	2017	Path:	
Well Completed Dt:	2017/05/23	Latitude:	43.5575094769784
Audit No:	Z248281	Longitude:	-79.5856276508326

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
32	NE	0.13	129.38	79.85	WWIS

Well ID:	7371903	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	03-Nov-2020 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	99H24M77	Contractor:	7360
Tag:	A295536	Form Version:	9
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliabilty:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	

Wells and Additional Sources Detail Report

Clear/Cloudy:

UTM Reliability:

Municipality:

MISSISSAUGA CITY (PORT CREDIT)

Site Info:

Bore Hole ID:

1008490876

Elevation:

DP2BR:

Elevrc:

Spatial Status:

Zone:

17

Code OB:

East83:

614304.00

Code OB Desc:

North83:

4823663.00

Open Hole:

Org CS:

UTM83

Cluster Kind:

UTMRC:

4

Date Completed:

28-Apr-2020 00:00:00

UTMRC Desc:

margin of error : 30 m - 100 m

Remarks:

Location Method:

wwr

Elevrc Desc:

Location Source Date:

Improvement Location
Source:

Improvement Location
Method:

Source Revision

Comment:

Supplier Comment:

Formation ID:

1008491006

Layer:

2

Color:

2

General Color:

GREY

Mat1:

34

Most Common Material:

TILL

Mat2:

Mat2 Desc:

Mat3:

73

Mat3 Desc:

HARD

Formation Top Depth:

10.0

Formation End Depth:

30.0

Formation End Depth

ft

UOM:

Formation ID:

1008491005

Layer:

1

Color:

6

General Color:

BROWN

Mat1:

01

Most Common Material:

FILL

Mat2:

Mat2 Desc:

Mat3:

73

Wells and Additional Sources Detail Report

Mat3 Desc: HARD
Formation Top Depth: 0.0
Formation End Depth: 10.0
Formation End Depth UOM: ft

Plug ID: 1008491120
Layer: 1
Plug From: 0.0
Plug To: 18.0
Plug Depth UOM: ft

Plug ID: 1008491091
Layer: 1
Plug From:
Plug To:
Plug Depth UOM: ft

Method Construction ID: 1008490949
Method Construction Code: E
Method Construction: Auger
Other Method Construction:

Pipe ID: 1008490924
Casing No: 0
Comment:
Alt Name:

Casing ID: 1008491042
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 20.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Screen ID: 1008491057
Layer: 1
Slot: 0.1

Wells and Additional Sources Detail Report

Screen Top Depth: 20.0
 Screen End Depth: 30.0
 Screen Material: 5
 Screen Depth UOM: ft
 Screen Diameter UOM: inch
 Screen Diameter: 2.25

Pump Test ID: 1008490925
 Pump Set At:
 Static Level:
 Final Level After Pumping:
 Recommended Pump
 Depth:
 Pumping Rate:
 Flowing Rate:
 Recommended Pump
 Rate:
 Levels UOM: ft
 Rate UOM: GPM
 Water State After Test
 Code:
 Water State After Test:
 Pumping Test Method:
 Pumping Duration HR:
 Pumping Duration MIN:
 Flowing:

Hole ID: 1008491072
 Diameter: 6.0
 Depth From: 0.0
 Depth To: 30.0
 Hole Depth UOM: ft
 Hole Diameter UOM: inch

Bore Hole ID:	1008490876	Tag No:	A295536
Depth M:	9.144	Contractor:	7360
Year Completed:	2020	Path:	737\7371903.pdf
Well Completed Dt:	2020/04/28	Latitude:	43.5571660057986
Audit No:	99H24M77	Longitude:	-79.5847937820893

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
33	NNE	0.13	129.52	79.85	WWIS

Well ID: 7371901 Flowing (Y/N):
 Construction Date: Flow Rate:

Wells and Additional Sources Detail Report

Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	03-Nov-2020 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	S8J2AU54	Contractor:	7360
Tag:	A295534	Form Version:	9
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliabilty:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			
Bore Hole ID:	1008490870	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614300.00
Code OB Desc:		North83:	4823666.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	28-Apr-2020 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location			
Source:			
Improvement Location			
Method:			
Source Revision			
Comment:			
Supplier Comment:			
Formation ID:	1008491000		
Layer:	1		
Color:	6		
General Color:	BROWN		
Mat1:	01		
Most Common Material:	FILL		
Mat2:			
Mat2 Desc:			
Mat3:	73		

Wells and Additional Sources Detail Report

Mat3 Desc: HARD
Formation Top Depth: 0.0
Formation End Depth: 10.0
Formation End Depth UOM: ft

Formation ID: 1008491002
Layer: 3
Color: 2
General Color: GREY
Mat1: 26
Most Common Material: ROCK
Mat2:
Mat2 Desc:
Mat3:
Mat3 Desc:
Formation Top Depth: 30.0
Formation End Depth: 50.0
Formation End Depth UOM: ft

Formation ID: 1008491001
Layer: 2
Color: 2
General Color: GREY
Mat1: 34
Most Common Material: TILL
Mat2:
Mat2 Desc:
Mat3: 73
Mat3 Desc: HARD
Formation Top Depth: 10.0
Formation End Depth: 30.0
Formation End Depth UOM: ft

Plug ID: 1008491089
Layer: 1
Plug From:
Plug To:
Plug Depth UOM: ft

Plug ID: 1008491118
Layer: 1
Plug From: 0.0

Wells and Additional Sources Detail Report

Plug To: 38.0
Plug Depth UOM: ft

Method Construction ID: 1008490947
Method Construction Code: E
Method Construction: Auger
Other Method Construction:

Pipe ID: 1008490920
Casing No: 0
Comment:
Alt Name:

Casing ID: 1008491040
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 40.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Screen ID: 1008491055
Layer: 1
Slot: 0.1
Screen Top Depth: 40.0
Screen End Depth: 50.0
Screen Material: 5
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 2.25

Pump Test ID: 1008490921
Pump Set At:
Static Level:
Final Level After Pumping:
Recommended Pump Depth:
Pumping Rate:
Flowing Rate:
Recommended Pump Rate:

Wells and Additional Sources Detail Report

Levels UOM: ft
 Rate UOM: GPM
 Water State After Test Code:
 Water State After Test:
 Pumping Test Method:
 Pumping Duration HR:
 Pumping Duration MIN:
 Flowing:

Hole ID: 1008491070
 Diameter: 6.0
 Depth From: 0.0
 Depth To: 50.0
 Hole Depth UOM: ft
 Hole Diameter UOM: inch

Bore Hole ID:	1008490870	Tag No:	A295534
Depth M:	15.24	Contractor:	7360
Year Completed:	2020	Path:	737\7371901.pdf
Well Completed Dt:	2020/04/28	Latitude:	43.5571936231171
Audit No:	S8J2AU54	Longitude:	-79.5848426594078

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
34	NE	0.13	130.11	79.85	WWIS

Well ID:	7378959	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:		Data Entry Status:	Yes
Use 2nd:		Data Src:	
Final Well Status:		Date Received:	29-Jan-2021 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z348116	Contractor:	7644
Tag:	A312088	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliabilty:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		

Wells and Additional Sources Detail Report

Site Info:

Bore Hole ID:	1008614892	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614318.00
Code OB Desc:		North83:	4823654.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	18-Dec-2020 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Bore Hole ID:	1008614892	Tag No:	A312088
Depth M:		Contractor:	7644
Year Completed:	2020	Path:	
Well Completed Dt:	2020/12/18	Latitude:	43.5570828472105
Audit No:	Z348116	Longitude:	-79.5846223957281

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
35	WNW	0.13	130.42	79.92	WWIS

Well ID:	7306886	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	08-Mar-2018 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z255682	Contractor:	6607
Tag:	A241261	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	

Wells and Additional Sources Detail Report

Static Water Level: Zone:
Clear/Cloudy: UTM Reliability:
Municipality: MISSISSAUGA CITY (PORT CREDIT)
Site Info:

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/730\7306886.pdf

Well Completed Date: 2017/12/08
Year Completed: 2017
Depth (m): 12.5
Latitude: 43.5566992737001
Longitude: -79.5878256340761
Path: 730\7306886.pdf

Bore Hole ID: 1006995692 Elevation:
DP2BR: Elevrc:
Spatial Status: Zone: 17
Code OB: East83: 614060.00
Code OB Desc: North83: 4823607.00
Open Hole: Org CS: UTM83
Cluster Kind: UTMRC: 4
Date Completed: 08-Dec-2017 00:00:00 UTMRC Desc: margin of error : 30 m - 100 m
Remarks: Location Method: wwr
Elevrc Desc:
Location Source Date:
Improvement Location
Source:
Improvement Location
Method:
Source Revision
Comment:
Supplier Comment:

Formation ID: 1007194415
Layer: 1
Color: 6
General Color: BROWN
Mat1: 28
Most Common Material: SAND
Mat2: 11
Mat2 Desc: GRAVEL
Mat3: 85
Mat3 Desc: SOFT
Formation Top Depth: 0.0
Formation End Depth: 3.0
Formation End Depth
UOM: m

Wells and Additional Sources Detail Report

Formation ID: 1007194416
Layer: 2
Color: 2
General Color: GREY
Mat1: 06
Most Common Material: SILT
Mat2: 28
Mat2 Desc: SAND
Mat3: 11
Mat3 Desc: GRAVEL
Formation Top Depth: 3.0
Formation End Depth: 9.399999618530273
Formation End Depth UOM: m

Formation ID: 1007194417
Layer: 3
Color: 2
General Color: GREY
Mat1: 17
Most Common Material: SHALE
Mat2: 15
Mat2 Desc: LIMESTONE
Mat3:
Mat3 Desc:
Formation Top Depth: 9.399999618530273
Formation End Depth: 12.5
Formation End Depth UOM: m

Plug ID: 1007194426
Layer: 2
Plug From: 0.30000001192092896
Plug To: 9.100000381469727
Plug Depth UOM: m

Plug ID: 1007194425
Layer: 1
Plug From: 0.0
Plug To: 0.30000001192092896
Plug Depth UOM: m

Wells and Additional Sources Detail Report

Method Construction ID: 1007194424
Method Construction Code: 6
Method Construction: Boring
Other Method Construction: DIAMOND

Pipe ID: 1007194414
Casing No: 0
Comment:
Alt Name:

Casing ID: 1007194421
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 9.399999618530273
Casing Diameter: 5.099999904632568
Casing Diameter UOM: cm
Casing Depth UOM: m

Screen ID: 1007194422
Layer: 1
Slot: 10
Screen Top Depth: 9.399999618530273
Screen End Depth: 12.5
Screen Material: 5
Screen Depth UOM: m
Screen Diameter UOM: cm
Screen Diameter: 6.400000095367432

Water ID: 1007194420
Layer:
Kind Code:
Kind:
Water Found Depth:
Water Found Depth UOM: m

Hole ID: 1007194419
Diameter: 9.600000381469727
Depth From: 9.399999618530273
Depth To: 12.5

Wells and Additional Sources Detail Report

Hole Depth UOM: m
Hole Diameter UOM: cm

Hole ID: 1007194418
Diameter: 21.0
Depth From: 0.0
Depth To: 9.399999618530273
Hole Depth UOM: m
Hole Diameter UOM: cm

Bore Hole ID:	1006995692	Tag No:	A241261
Depth M:	12.5	Contractor:	6607
Year Completed:	2017	Path:	730\7306886.pdf
Well Completed Dt:	2017/12/08	Latitude:	43.5566992737001
Audit No:	Z255682	Longitude:	-79.5878256340761

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
36	NNE	0.13	130.47	79.85	WWIS

Well ID:	7290480	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	18-Jul-2017 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z248282	Contractor:	6607
Tag:	A209829	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

PDF URL (Map):

Well Completed Date: 2017/05/26

Wells and Additional Sources Detail Report

Year Completed: 2017
Depth (m): 11.9
Latitude: 43.5574704078907
Longitude: -79.5853809447429
Path:

Bore Hole ID: 1006630636
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 26-May-2017 00:00:00
Remarks:
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision
Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 17
East83: 614256.00
North83: 4823696.00
Org CS: UTM83
UTMRC: 4
UTMRC Desc: margin of error : 30 m - 100 m
Location Method: wwr

Formation ID: 1006694573
Layer: 5
Color: 2
General Color: GREY
Mat1: 17
Most Common Material: SHALE
Mat2: 15
Mat2 Desc: LIMESTONE
Mat3: 74
Mat3 Desc: LAYERED
Formation Top Depth: 9.0
Formation End Depth: 11.899999618530273
Formation End Depth UOM: m

Formation ID: 1006694569
Layer: 1
Color: 6
General Color: BROWN
Mat1: 28
Most Common Material: SAND
Mat2: 11

Wells and Additional Sources Detail Report

Mat2 Desc: GRAVEL
Mat3: 01
Mat3 Desc: FILL
Formation Top Depth: 0.0
Formation End Depth: 0.6000000238418579
Formation End Depth
UOM: m

Formation ID: 1006694571
Layer: 3
Color: 2
General Color: GREY
Mat1: 06
Most Common Material: SILT
Mat2: 05
Mat2 Desc: CLAY
Mat3: 66
Mat3 Desc: DENSE
Formation Top Depth: 3.4000000953674316
Formation End Depth: 7.599999904632568
Formation End Depth
UOM: m

Formation ID: 1006694570
Layer: 2
Color: 6
General Color: BROWN
Mat1: 06
Most Common Material: SILT
Mat2: 28
Mat2 Desc: SAND
Mat3: 66
Mat3 Desc: DENSE
Formation Top Depth: 0.6000000238418579
Formation End Depth: 3.4000000953674316
Formation End Depth
UOM: m

Formation ID: 1006694572
Layer: 4
Color: 2
General Color: GREY
Mat1: 05
Most Common Material: CLAY
Mat2: 06
Mat2 Desc: SILT

Wells and Additional Sources Detail Report

Mat3: 66
Mat3 Desc: DENSE
Formation Top Depth: 7.599999904632568
Formation End Depth: 9.0
Formation End Depth UOM: m

Plug ID: 1006694583
Layer: 2
Plug From: 0.30000001192092896
Plug To: 8.399999618530273
Plug Depth UOM: m

Plug ID: 1006694581
Layer: 1
Plug From:
Plug To:
Plug Depth UOM: m

Plug ID: 1006694582
Layer: 1
Plug From: 0.0
Plug To: 0.30000001192092896
Plug Depth UOM: m

Method Construction ID: 1006694580
Method Construction Code: 6
Method Construction: Boring
Other Method Construction:

Pipe ID: 1006694568
Casing No: 0
Comment:
Alt Name:

Casing ID: 1006694577
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.10000000149011612
Depth To: 9.0

Wells and Additional Sources Detail Report

Casing Diameter: 5.099999904632568
 Casing Diameter UOM: cm
 Casing Depth UOM: m

Screen ID: 1006694578
 Layer: 1
 Slot: 10
 Screen Top Depth: 9.0
 Screen End Depth: 11.899999618530273
 Screen Material: 5
 Screen Depth UOM: m
 Screen Diameter UOM: cm
 Screen Diameter: 6.400000095367432

Water ID: 1006694576
 Layer:
 Kind Code:
 Kind:
 Water Found Depth:
 Water Found Depth UOM: m

Hole ID: 1006694574
 Diameter: 21.0
 Depth From: 0.0
 Depth To: 9.0
 Hole Depth UOM: m
 Hole Diameter UOM: cm

Hole ID: 1006694575
 Diameter: 9.600000381469727
 Depth From: 9.0
 Depth To: 11.899999618530273
 Hole Depth UOM: m
 Hole Diameter UOM: cm

Bore Hole ID:	1006630636	Tag No:	A209829
Depth M:	11.9	Contractor:	6607
Year Completed:	2017	Path:	
Well Completed Dt:	2017/05/26	Latitude:	43.5574704078907
Audit No:	Z248282	Longitude:	-79.5853809447429

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB

Wells and Additional Sources Detail Report

37	NNE	0.13	132.43	79.85	WWIS
Well ID:	7306887	Flowing (Y/N):			
Construction Date:		Flow Rate:			
Use 1st:	Test Hole	Data Entry Status:			
Use 2nd:		Data Src:			
Final Well Status:	Observation Wells	Date Received:	08-Mar-2018 00:00:00		
Water Type:		Selected Flag:	TRUE		
Casing Material:		Abandonment Rec:			
Audit No:	Z255689	Contractor:	6607		
Tag:	A241274	Form Version:	7		
Constructn Method:		Owner:			
Elevation (m):		County:	PEEL		
Elevatn Reliabilty:		Lot:			
Depth to Bedrock:		Concession:			
Well Depth:		Concession Name:			
Overburden/Bedrock:		Easting NAD83:			
Pump Rate:		Northing NAD83:			
Static Water Level:		Zone:			
Clear/Cloudy:		UTM Reliability:			
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/730\7306887.pdf				
Well Completed Date:	2017/12/15				
Year Completed:	2017				
Depth (m):	15.2				
Latitude:	43.5573495591138				
Longitude:	-79.5850742479462				
Path:	730\7306887.pdf				
Bore Hole ID:	1006995695	Elevation:			
DP2BR:		Elevrc:			
Spatial Status:		Zone:	17		
Code OB:		East83:	614281.00		
Code OB Desc:		North83:	4823683.00		
Open Hole:		Org CS:	UTM83		
Cluster Kind:		UTMRC:	4		
Date Completed:	15-Dec-2017 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m		
Remarks:		Location Method:	wwr		
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					

Wells and Additional Sources Detail Report

Improvement Location
Method:
Source Revision
Comment:
Supplier Comment:

Formation ID: 1007194429
Layer: 2
Color: 2
General Color: GREY
Mat1: 06
Most Common Material: SILT
Mat2: 28
Mat2 Desc: SAND
Mat3: 11
Mat3 Desc: GRAVEL
Formation Top Depth: 3.0
Formation End Depth: 8.800000190734863
Formation End Depth UOM: m

Formation ID: 1007194430
Layer: 3
Color: 2
General Color: GREY
Mat1: 17
Most Common Material: SHALE
Mat2: 15
Mat2 Desc: LIMESTONE
Mat3:
Mat3 Desc:
Formation Top Depth: 8.800000190734863
Formation End Depth: 15.199999809265137
Formation End Depth UOM: m

Formation ID: 1007194428
Layer: 1
Color: 6
General Color: BROWN
Mat1: 28
Most Common Material: SAND
Mat2: 11
Mat2 Desc: GRAVEL
Mat3:
Mat3 Desc:
Formation Top Depth: 0.0

Wells and Additional Sources Detail Report

Formation End Depth: 3.0
Formation End Depth
UOM: m

Plug ID: 1007194439
Layer: 2
Plug From: 0.30000001192092896
Plug To: 8.800000190734863
Plug Depth UOM: m

Plug ID: 1007194438
Layer: 1
Plug From: 0.0
Plug To: 0.30000001192092896
Plug Depth UOM: m

Method Construction ID: 1007194437
Method Construction
Code: 6
Method Construction: Boring
Other Method
Construction: TRICONE

Pipe ID: 1007194427
Casing No: 0
Comment:
Alt Name:

Casing ID: 1007194434
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 9.100000381469727
Casing Diameter: 10.199999809265137
Casing Diameter UOM: cm
Casing Depth UOM: m

Screen ID: 1007194435
Layer: 1
Slot: 10
Screen Top Depth: 9.100000381469727
Screen End Depth: 15.199999809265137

Wells and Additional Sources Detail Report

Screen Material: 5
 Screen Depth UOM: m
 Screen Diameter UOM: cm
 Screen Diameter: 11.5

Water ID: 1007194433
 Layer:
 Kind Code:
 Kind:
 Water Found Depth:
 Water Found Depth UOM: m

Hole ID: 1007194432
 Diameter: 16.0
 Depth From: 9.100000381469727
 Depth To: 15.199999809265137
 Hole Depth UOM: m
 Hole Diameter UOM: cm

Hole ID: 1007194431
 Diameter: 25.0
 Depth From: 0.0
 Depth To: 9.100000381469727
 Hole Depth UOM: m
 Hole Diameter UOM: cm

Bore Hole ID:	1006995695	Tag No:	A241274
Depth M:	15.2	Contractor:	6607
Year Completed:	2017	Path:	730\7306887.pdf
Well Completed Dt:	2017/12/15	Latitude:	43.5573495591138
Audit No:	Z255689	Longitude:	-79.5850742479462

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
38	N	0.13	133.36	79.85	WWIS

Well ID:	7307828	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Test Hole	Data Entry Status:	
Use 2nd:	Monitoring	Data Src:	
Final Well Status:	Observation Wells	Date Received:	15-Mar-2018 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	

Wells and Additional Sources Detail Report

Audit No:	Z266924	Contractor:	6607
Tag:	A241368	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliabilty:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/730\7307828.pdf

Well Completed Date: 2018/01/18
 Year Completed: 2018
 Depth (m): 8.53
 Latitude: 43.5576161488494
 Longitude: -79.5862442070135
 Path: 730\7307828.pdf

Bore Hole ID:	1007003204	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614186.00
Code OB Desc:		North83:	4823711.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	18-Jan-2018 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Formation ID: 1007229586
 Layer: 1
 Color: 6
 General Color: BROWN

Wells and Additional Sources Detail Report

Mat1: 28
Most Common Material: SAND
Mat2: 11
Mat2 Desc: GRAVEL
Mat3: 01
Mat3 Desc: FILL
Formation Top Depth: 0.0
Formation End Depth: 1.0
Formation End Depth UOM: m

Formation ID: 1007229587
Layer: 2
Color: 6
General Color: BROWN
Mat1: 28
Most Common Material: SAND
Mat2:
Mat2 Desc:
Mat3:
Mat3 Desc:
Formation Top Depth: 1.0
Formation End Depth: 3.0
Formation End Depth UOM: m

Formation ID: 1007229588
Layer: 3
Color: 2
General Color: GREY
Mat1: 28
Most Common Material: SAND
Mat2: 12
Mat2 Desc: STONES
Mat3: 73
Mat3 Desc: HARD
Formation Top Depth: 3.0
Formation End Depth: 8.529999732971191
Formation End Depth UOM: m

Plug ID: 1007229597
Layer: 2
Plug From: 0.30000001192092896
Plug To: 4.800000190734863
Plug Depth UOM: m

Wells and Additional Sources Detail Report

Plug ID: 1007229596
Layer: 1
Plug From: 0.0
Plug To: 0.30000001192092896
Plug Depth UOM: m

Method Construction ID: 1007229595
Method Construction Code: 6
Method Construction: Boring
Other Method Construction:

Pipe ID: 1007229585
Casing No: 0
Comment:
Alt Name:

Casing ID: 1007229591
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 5.5
Casing Diameter: 5.099999904632568
Casing Diameter UOM: cm
Casing Depth UOM: m

Screen ID: 1007229592
Layer: 1
Slot: 10
Screen Top Depth: 5.5
Screen End Depth: 8.5
Screen Material: 5
Screen Depth UOM: m
Screen Diameter UOM: cm
Screen Diameter: 6.400000095367432

Water ID: 1007229590
Layer: 1
Kind Code: 8

Wells and Additional Sources Detail Report

Kind: Untested
 Water Found Depth: 2.5999999046325684
 Water Found Depth UOM: m

Hole ID: 1007229589
 Diameter: 21.0
 Depth From:
 Depth To:
 Hole Depth UOM: m
 Hole Diameter UOM: cm

Bore Hole ID:	1007003204	Tag No:	A241368
Depth M:	8.53	Contractor:	6607
Year Completed:	2018	Path:	730\7307828.pdf
Well Completed Dt:	2018/01/18	Latitude:	43.5576161488494
Audit No:	Z266924	Longitude:	-79.5862442070135

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
39	NNE	0.13	134.51	79.85	WWIS

Well ID:	7290487	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	18-Jul-2017 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z248283	Contractor:	6607
Tag:	A224322	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

PDF URL (Map):

Wells and Additional Sources Detail Report

Well Completed Date: 2017/05/24
Year Completed: 2017
Depth (m): 13.2
Latitude: 43.557229169246
Longitude: -79.5848046844955
Path:

Bore Hole ID:	1006630824	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614303.00
Code OB Desc:		North83:	4823670.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	24-May-2017 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Formation ID: 1006696661
Layer: 3
Color: 2
General Color: GREY
Mat1: 06
Most Common Material: SILT
Mat2: 05
Mat2 Desc: CLAY
Mat3: 66
Mat3 Desc: DENSE
Formation Top Depth: 2.299999952316284
Formation End Depth: 8.800000190734863
Formation End Depth UOM: m

Formation ID: 1006696660
Layer: 2
Color: 6
General Color: BROWN
Mat1: 06
Most Common Material: SILT

Wells and Additional Sources Detail Report

Mat2: 28
Mat2 Desc: SAND
Mat3: 66
Mat3 Desc: DENSE
Formation Top Depth: 0.699999988079071
Formation End Depth: 2.299999952316284
Formation End Depth UOM: m

Formation ID: 1006696659
Layer: 1
Color: 6
General Color: BROWN
Mat1: 28
Most Common Material: SAND
Mat2: 11
Mat2 Desc: GRAVEL
Mat3: 01
Mat3 Desc: FILL
Formation Top Depth: 0.0
Formation End Depth: 0.699999988079071
Formation End Depth UOM: m

Formation ID: 1006696662
Layer: 4
Color: 2
General Color: GREY
Mat1: 17
Most Common Material: SHALE
Mat2: 15
Mat2 Desc: LIMESTONE
Mat3: 74
Mat3 Desc: LAYERED
Formation Top Depth: 8.800000190734863
Formation End Depth: 13.199999809265137
Formation End Depth UOM: m

Plug ID: 1006696671
Layer: 2
Plug From: 0.30000001192092896
Plug To: 9.600000381469727
Plug Depth UOM: m

Wells and Additional Sources Detail Report

Plug ID: 1006696670
Layer: 1
Plug From: 0.0
Plug To: 0.30000001192092896
Plug Depth UOM: m

Method Construction ID: 1006696669
Method Construction Code: 6
Method Construction: Boring
Other Method Construction: DIAMOND

Pipe ID: 1006696658
Casing No: 0
Comment:
Alt Name:

Casing ID: 1006696666
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.10000000149011612
Depth To: 10.300000190734863
Casing Diameter: 5.099999904632568
Casing Diameter UOM: cm
Casing Depth UOM: m

Screen ID: 1006696667
Layer: 1
Slot: 10
Screen Top Depth: 10.300000190734863
Screen End Depth: 13.199999809265137
Screen Material: 5
Screen Depth UOM: m
Screen Diameter UOM: cm
Screen Diameter: 6.400000095367432

Water ID: 1006696665
Layer:
Kind Code:
Kind:
Water Found Depth:

Wells and Additional Sources Detail Report

Water Found Depth UOM: m

Hole ID: 1006696663
 Diameter: 21.0
 Depth From: 0.0
 Depth To: 8.800000190734863
 Hole Depth UOM: m
 Hole Diameter UOM: cm

Hole ID: 1006696664
 Diameter: 9.600000381469727
 Depth From: 8.800000190734863
 Depth To: 13.199999809265137
 Hole Depth UOM: m
 Hole Diameter UOM: cm

Bore Hole ID:	1006630824	Tag No:	A224322
Depth M:	13.2	Contractor:	6607
Year Completed:	2017	Path:	
Well Completed Dt:	2017/05/24	Latitude:	43.557229169246
Audit No:	Z248283	Longitude:	-79.5848046844955

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
40	N	0.14	141.54	79.85	WWIS

Well ID:	7290469	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Test Hole	Date Received:	18-Jul-2017 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z248389	Contractor:	6607
Tag:	A224416	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliabilty:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	

Wells and Additional Sources Detail Report

Municipality: MISSISSAUGA CITY (PORT CREDIT)
Site Info:

PDF URL (Map):

Well Completed Date: 2017/05/03
Year Completed: 2017
Depth (m): 10.1
Latitude: 43.5576348848251
Longitude: -79.5855751927829
Path:

Bore Hole ID:	1006630455	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614240.00
Code OB Desc:		North83:	4823714.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	03-May-2017 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Formation ID: 1006694200
Layer: 4
Color: 2
General Color: GREY
Mat1: 28
Most Common Material: SAND
Mat2: 06
Mat2 Desc: SILT
Mat3: 11
Mat3 Desc: GRAVEL
Formation Top Depth: 2.299999952316284
Formation End Depth: 10.100000381469727
Formation End Depth UOM: m

Wells and Additional Sources Detail Report

Formation ID: 1006694199
Layer: 3
Color: 6
General Color: BROWN
Mat1: 06
Most Common Material: SILT
Mat2: 28
Mat2 Desc: SAND
Mat3: 27
Mat3 Desc: OTHER
Formation Top Depth: 0.699999988079071
Formation End Depth: 2.299999952316284
Formation End Depth UOM: m

Formation ID: 1006694198
Layer: 2
Color: 6
General Color: BROWN
Mat1: 27
Most Common Material: OTHER
Mat2: 28
Mat2 Desc: SAND
Mat3: 77
Mat3 Desc: LOOSE
Formation Top Depth: 0.20000000298023224
Formation End Depth: 0.699999988079071
Formation End Depth UOM: m

Formation ID: 1006694197
Layer: 1
Color: 8
General Color: BLACK
Mat1: 27
Most Common Material: OTHER
Mat2: 11
Mat2 Desc: GRAVEL
Mat3: 66
Mat3 Desc: DENSE
Formation Top Depth: 0.0
Formation End Depth: 0.20000000298023224
Formation End Depth UOM: m

Plug ID: 1006694211

Wells and Additional Sources Detail Report

Layer: 3
Plug From: 6.5
Plug To: 10.399999618530273
Plug Depth UOM: m

Plug ID: 1006694212
Layer: 4
Plug From: 10.399999618530273
Plug To: 13.100000381469727
Plug Depth UOM: m

Plug ID: 1006694209
Layer: 1
Plug From: 0.0
Plug To: 0.30000001192092896
Plug Depth UOM: m

Plug ID: 1006694210
Layer: 2
Plug From: 0.30000001192092896
Plug To: 6.5
Plug Depth UOM: m

Method Construction ID: 1006694208
Method Construction Code: 6
Method Construction: Boring
Other Method Construction:

Pipe ID: 1006694196
Casing No: 0
Comment:
Alt Name:

Casing ID: 1006694205
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 6.699999809265137
Casing Diameter: 5.099999904632568

Wells and Additional Sources Detail Report

Casing Diameter UOM: cm
Casing Depth UOM: m

Screen ID: 1006694206
Layer: 1
Slot: 10
Screen Top Depth: 6.699999809265137
Screen End Depth: 9.800000190734863
Screen Material: 5
Screen Depth UOM: m
Screen Diameter UOM: cm
Screen Diameter: 6.400000095367432

Water ID: 1006694204
Layer:
Kind Code:
Kind:
Water Found Depth:
Water Found Depth UOM: m

Hole ID: 1006694202
Diameter: 21.0
Depth From: 0.0
Depth To: 10.100000381469727
Hole Depth UOM: m
Hole Diameter UOM: cm

Hole ID: 1006694203
Diameter: 10.0
Depth From: 10.100000381469727
Depth To: 13.100000381469727
Hole Depth UOM: m
Hole Diameter UOM: cm

Bore Hole ID:	1006630455	Tag No:	A224416
Depth M:	10.1	Contractor:	6607
Year Completed:	2017	Path:	
Well Completed Dt:	2017/05/03	Latitude:	43.5576348848251
Audit No:	Z248389	Longitude:	-79.5855751927829

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
41	N	0.14	143.37	79.85	WWIS

Wells and Additional Sources Detail Report

Well ID:	7371902	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	03-Nov-2020 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	L8EQ62BY	Contractor:	7360
Tag:	A295535	Form Version:	9
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

Bore Hole ID:	1008490873	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614232.00
Code OB Desc:		North83:	4823718.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	29-Apr-2020 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Formation ID:	1008491004
Layer:	2
Color:	2
General Color:	GREY
Mat1:	34

Wells and Additional Sources Detail Report

Most Common Material: TILL
Mat2: 66
Mat2 Desc: DENSE
Mat3: 73
Mat3 Desc: HARD
Formation Top Depth: 10.0
Formation End Depth: 30.0
Formation End Depth
UOM: ft

Formation ID: 1008491003
Layer: 1
Color: 6
General Color: BROWN
Mat1: 01
Most Common Material: FILL
Mat2:
Mat2 Desc:
Mat3: 85
Mat3 Desc: SOFT
Formation Top Depth: 0.0
Formation End Depth: 10.0
Formation End Depth
UOM: ft

Plug ID: 1008491090
Layer: 1
Plug From:
Plug To:
Plug Depth UOM: ft

Plug ID: 1008491119
Layer: 1
Plug From: 0.0
Plug To: 18.0
Plug Depth UOM: ft

Method Construction ID: 1008490948
Method Construction
Code: E
Method Construction: Auger
Other Method
Construction:

Pipe ID: 1008490922

Wells and Additional Sources Detail Report

Casing No: 0
Comment:
Alt Name:

Casing ID: 1008491041
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 20.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Screen ID: 1008491056
Layer: 1
Slot: 0.1
Screen Top Depth: 20.0
Screen End Depth: 30.0
Screen Material: 5
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 2.25

Pump Test ID: 1008490923
Pump Set At:
Static Level:
Final Level After Pumping:
Recommended Pump
Depth:
Pumping Rate:
Flowing Rate:
Recommended Pump
Rate:
Levels UOM: ft
Rate UOM: GPM
Water State After Test
Code:
Water State After Test:
Pumping Test Method:
Pumping Duration HR:
Pumping Duration MIN:
Flowing:

Hole ID: 1008491071

Wells and Additional Sources Detail Report

Diameter: 6.0
 Depth From: 0.0
 Depth To: 30.0
 Hole Depth UOM: ft
 Hole Diameter UOM: inch

Bore Hole ID:	1008490873	Tag No:	A295535
Depth M:	9.144	Contractor:	7360
Year Completed:	2020	Path:	737\7371902.pdf
Well Completed Dt:	2020/04/29	Latitude:	43.5576721158667
Audit No:	L8EQ62BY	Longitude:	-79.5856733701059

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
42	ESE	0.14	144.15	79.85	WWIS

Well ID:	7288429	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Test Hole	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Abandoned-Other	Date Received:	19-Jun-2017 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	Yes
Audit No:	Z230821	Contractor:	7230
Tag:	A203341	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

PDF URL (Map):

Well Completed Date:
 Year Completed:
 Depth (m):
 Latitude: 43.5550888818842
 Longitude: -79.5835672081283
 Path:

Wells and Additional Sources Detail Report

Bore Hole ID:	1006547861	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614407.00
Code OB Desc:		North83:	4823434.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Formation ID:	1006778043
Layer:	
Color:	
General Color:	
Mat1:	
Most Common Material:	
Mat2:	
Mat2 Desc:	
Mat3:	
Mat3 Desc:	
Formation Top Depth:	
Formation End Depth:	
Formation End Depth UOM:	ft

Plug ID:	1006778050
Layer:	1
Plug From:	0.0
Plug To:	6.099999904632568
Plug Depth UOM:	ft

Method Construction ID:	1006778049
Method Construction Code:	6
Method Construction:	Boring
Other Method Construction:	

Wells and Additional Sources Detail Report

Pipe ID: 1006778042
Casing No: 0
Comment:
Alt Name:

Casing ID: 1006778046
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 3.0999999046325684
Casing Diameter: 5.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Screen ID: 1006778047
Layer: 1
Slot: 10
Screen Top Depth: 3.0999999046325684
Screen End Depth: 6.099999904632568
Screen Material: 5
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 5.199999809265137

Water ID: 1006778045
Layer: 1
Kind Code: 8
Kind: Untested
Water Found Depth: 4.699999809265137
Water Found Depth UOM: ft

Hole ID: 1006778044
Diameter: 15.0
Depth From: 0.0
Depth To: 61.0
Hole Depth UOM: ft
Hole Diameter UOM: inch

Bore Hole ID: 1006547861

Tag No:

A203341

Wells and Additional Sources Detail Report

Depth M:		Contractor:	7230
Year Completed:		Path:	728\7288429.pdf
Well Completed Dt:		Latitude:	43.5550888818842
Audit No:	Z230821	Longitude:	-79.5835672081283

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
43	N	0.15	147.67	79.85	WWIS

Well ID:	7378963	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:		Data Entry Status:	Yes
Use 2nd:		Data Src:	
Final Well Status:		Date Received:	29-Jan-2021 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z348112	Contractor:	7644
Tag:	A312083	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

Bore Hole ID:	1008614904	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614198.00
Code OB Desc:		North83:	4823726.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	18-Dec-2020 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Wells and Additional Sources Detail Report

Bore Hole ID:	1008614904	Tag No:	A312083
Depth M:		Contractor:	7644
Year Completed:	2020	Path:	
Well Completed Dt:	2020/12/18	Latitude:	43.5577493337049
Audit No:	Z348112	Longitude:	-79.5860925197754

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
44	ESE	0.15	154.84	79.85	WWIS

Well ID:	7267968	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:		Data Entry Status:	Yes
Use 2nd:		Data Src:	
Final Well Status:		Date Received:	28-Jul-2016 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	C33944	Contractor:	7230
Tag:	A203341	Form Version:	8
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY		
Site Info:			

PDF URL (Map):

Well Completed Date:	2016/06/22
Year Completed:	2016
Depth (m):	
Latitude:	43.5551849837195
Longitude:	-79.5833297265704
Path:	

Bore Hole ID:	1006177173	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17

Wells and Additional Sources Detail Report

Code OB:	East83:	614426.00
Code OB Desc:	North83:	4823445.00
Open Hole:	Org CS:	UTM83
Cluster Kind:	UTMRC:	4
Date Completed: 22-Jun-2016 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:	Location Method:	wwr
Elevrc Desc:		
Location Source Date:		
Improvement Location Source:		
Improvement Location Method:		
Source Revision		
Comment:		
Supplier Comment:		

Bore Hole ID: 1006177173	Tag No: A203341
Depth M:	Contractor: 7230
Year Completed: 2016	Path:
Well Completed Dt: 2016/06/22	Latitude: 43.5551849837195
Audit No: C33944	Longitude: -79.5833297265704

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
45	N	0.16	156.80	79.85	WWIS

Well ID: 7378965	Flowing (Y/N):
Construction Date:	Flow Rate:
Use 1st:	Data Entry Status: Yes
Use 2nd:	Data Src:
Final Well Status:	Date Received: 29-Jan-2021 00:00:00
Water Type:	Selected Flag: TRUE
Casing Material:	Abandonment Rec:
Audit No: Z348111	Contractor: 7644
Tag: A312082	Form Version: 7
Constructn Method:	Owner:
Elevation (m):	County: PEEL
Elevatn Reliabilty:	Lot:
Depth to Bedrock:	Concession:
Well Depth:	Concession Name:
Overburden/Bedrock:	Easting NAD83:
Pump Rate:	Northing NAD83:
Static Water Level:	Zone:
Clear/Cloudy:	UTM Reliability:
Municipality: MISSISSAUGA CITY (PORT CREDIT)	
Site Info:	

Wells and Additional Sources Detail Report

Bore Hole ID:	1008614910	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614193.00
Code OB Desc:		North83:	4823735.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	18-Dec-2020 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Bore Hole ID:	1008614910	Tag No:	A312082
Depth M:		Contractor:	7644
Year Completed:	2020	Path:	
Well Completed Dt:	2020/12/18	Latitude:	43.55783111235
Audit No:	Z348111	Longitude:	-79.586152512588

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
46	ENE	0.17	168.12	79.85	WWIS

Well ID:	7104773	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:		Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Abandoned-Other	Date Received:	01-May-2008 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	Yes
Audit No:	Z70743	Contractor:	7082
Tag:	A057183	Form Version:	3
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliabilty:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY		

Wells and Additional Sources Detail Report

Site Info:

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/710\7104773.pdf

Well Completed Date: 2008/04/22
Year Completed: 2008
Depth (m):
Latitude: 43.5563884173103
Longitude: -79.5830786741158
Path: 710\7104773.pdf

Bore Hole ID:	1001585176	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614444.00
Code OB Desc:		North83:	4823579.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	3
Date Completed:	22-Apr-2008 00:00:00	UTMRC Desc:	margin of error : 10 - 30 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Plug ID: 1001628743
Layer: 1
Plug From: 0.0
Plug To: 7.159999847412109
Plug Depth UOM: m

Method Construction ID: 1001628747
Method Construction Code: B
Method Construction: Other Method
Other Method Construction: AUGERING

Pipe ID: 1001628740
Casing No: 0

Wells and Additional Sources Detail Report

Comment:

Alt Name:

Casing ID: 1001628745

Layer:

Material:

Open Hole or Material:

Depth From:

Depth To:

Casing Diameter:

Casing Diameter UOM: cm

Casing Depth UOM: m

Screen ID: 1001628746

Layer:

Slot:

Screen Top Depth:

Screen End Depth:

Screen Material:

Screen Depth UOM: m

Screen Diameter UOM: cm

Screen Diameter:

Water ID: 1001628744

Layer:

Kind Code:

Kind:

Water Found Depth:

Water Found Depth UOM: m

Hole ID: 1001628742

Diameter: 15.239999771118164

Depth From: 0.0

Depth To: 7.159999847412109

Hole Depth UOM: m

Hole Diameter UOM: cm

Bore Hole ID: 1001585176

Depth M:

Year Completed: 2008

Well Completed Dt: 2008/04/22

Audit No: Z70743

Tag No: A057183

Contractor: 7082

Path: 710\7104773.pdf

Latitude: 43.5563884173103

Longitude: -79.5830786741158

Wells and Additional Sources Detail Report

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
47	NNE	0.18	182.92	79.85	WWIS

Well ID:	7310440	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	17-Apr-2018 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z266809	Contractor:	6607
Tag:	A232621	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

PDF URL (Map):

Well Completed Date:	2018/02/06
Year Completed:	2018
Depth (m):	17.8
Latitude:	43.5579366455754
Longitude:	-79.5852214620033
Path:	

Bore Hole ID:	1007036933	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614268.00
Code OB Desc:		North83:	4823748.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	06-Feb-2018 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			

Wells and Additional Sources Detail Report

Location Source Date:

Improvement Location

Source:

Improvement Location

Method:

Source Revision

Comment:

Supplier Comment:

Formation ID: 1007268340
Layer: 2
Color: 6
General Color: BROWN
Mat1: 28
Most Common Material: SAND
Mat2: 06
Mat2 Desc: SILT
Mat3: 73
Mat3 Desc: HARD
Formation Top Depth: 2.799999952316284
Formation End Depth: 5.699999809265137
Formation End Depth
UOM: m

Formation ID: 1007268341
Layer: 3
Color: 2
General Color: GREY
Mat1: 28
Most Common Material: SAND
Mat2: 13
Mat2 Desc: BOULDERS
Mat3: 74
Mat3 Desc: LAYERED
Formation Top Depth: 5.699999809265137
Formation End Depth: 7.400000095367432
Formation End Depth
UOM: m

Formation ID: 1007268342
Layer: 4
Color: 7
General Color: RED
Mat1: 06
Most Common Material: SILT
Mat2: 17
Mat2 Desc: SHALE

Wells and Additional Sources Detail Report

Mat3: 73
Mat3 Desc: HARD
Formation Top Depth: 7.400000095367432
Formation End Depth: 13.699999809265137
Formation End Depth UOM: m

Formation ID: 1007268343
Layer: 5
Color: 2
General Color: GREY
Mat1: 17
Most Common Material: SHALE
Mat2: 15
Mat2 Desc: LIMESTONE
Mat3: 26
Mat3 Desc: ROCK
Formation Top Depth: 13.699999809265137
Formation End Depth: 17.799999237060547
Formation End Depth UOM: m

Formation ID: 1007268339
Layer: 1
Color: 6
General Color: BROWN
Mat1: 28
Most Common Material: SAND
Mat2: 11
Mat2 Desc: GRAVEL
Mat3: 01
Mat3 Desc: FILL
Formation Top Depth: 0.0
Formation End Depth: 2.799999952316284
Formation End Depth UOM: m

Plug ID: 1007268352
Layer: 2
Plug From: 0.30000001192092896
Plug To: 13.899999618530273
Plug Depth UOM: m

Plug ID: 1007268353
Layer: 3

Wells and Additional Sources Detail Report

Plug From: 13.899999618530273
Plug To: 14.5
Plug Depth UOM: m

Plug ID: 1007268351
Layer: 1
Plug From: 0.0
Plug To: 0.30000001192092896
Plug Depth UOM: m

Method Construction ID: 1007268350
Method Construction Code: 6
Method Construction: Boring
Other Method Construction: DIAMOND

Pipe ID: 1007268338
Casing No: 0
Comment:
Alt Name:

Casing ID: 1007268347
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 14.800000190734863
Casing Diameter: 5.099999904632568
Casing Diameter UOM: cm
Casing Depth UOM: m

Screen ID: 1007268348
Layer: 1
Slot: 10
Screen Top Depth: 14.800000190734863
Screen End Depth: 17.799999237060547
Screen Material: 5
Screen Depth UOM: m
Screen Diameter UOM: cm
Screen Diameter: 6.400000095367432

Wells and Additional Sources Detail Report

Water ID: 1007268346
 Layer:
 Kind Code:
 Kind:
 Water Found Depth:
 Water Found Depth UOM: m

Hole ID: 1007268344
 Diameter: 2.0999999046325684
 Depth From: 0.0
 Depth To: 13.699999809265137
 Hole Depth UOM: m
 Hole Diameter UOM: cm

Hole ID: 1007268345
 Diameter: 9.600000381469727
 Depth From: 13.699999809265137
 Depth To: 17.100000381469727
 Hole Depth UOM: m
 Hole Diameter UOM: cm

Bore Hole ID:	1007036933	Tag No:	A232621
Depth M:	17.8	Contractor:	6607
Year Completed:	2018	Path:	731\7310440.pdf
Well Completed Dt:	2018/02/06	Latitude:	43.5579366455754
Audit No:	Z266809	Longitude:	-79.5852214620033

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
48	S	0.20	199.47	79.85	WWIS

Well ID:	7296575	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Test Hole	Data Entry Status:	
Use 2nd:	Monitoring	Data Src:	
Final Well Status:	Monitoring and Test Hole	Date Received:	05-Oct-2017 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z258526	Contractor:	7241
Tag:	A189871	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliabilty:		Lot:	
Depth to Bedrock:		Concession:	

Wells and Additional Sources Detail Report

Well Depth:	Concession Name:
Overburden/Bedrock:	Easting NAD83:
Pump Rate:	Northing NAD83:
Static Water Level:	Zone:
Clear/Cloudy:	UTM Reliability:
Municipality:	MISSISSAUGA CITY (PORT CREDIT)
Site Info:	

PDF URL (Map):

Well Completed Date:	2017/08/30
Year Completed:	2017
Depth (m):	7.3152
Latitude:	43.5537714511117
Longitude:	-79.5862474432159
Path:	

Bore Hole ID:	1006758610	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614193.00
Code OB Desc:		North83:	4823284.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	30-Aug-2017 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Formation ID:	1006953363
Layer:	5
Color:	2
General Color:	GREY
Mat1:	17
Most Common Material:	SHALE
Mat2:	
Mat2 Desc:	
Mat3:	71
Mat3 Desc:	FRACTURED

Wells and Additional Sources Detail Report

Formation Top Depth: 18.0
Formation End Depth: 24.0
Formation End Depth
UOM: ft

Formation ID: 1006953360
Layer: 2
Color: 6
General Color: BROWN
Mat1: 34
Most Common Material: TILL
Mat2: 73
Mat2 Desc: HARD
Mat3: 66
Mat3 Desc: DENSE
Formation Top Depth: 1.0
Formation End Depth: 7.0
Formation End Depth
UOM: ft

Formation ID: 1006953361
Layer: 3
Color: 2
General Color: GREY
Mat1: 34
Most Common Material: TILL
Mat2: 73
Mat2 Desc: HARD
Mat3: 66
Mat3 Desc: DENSE
Formation Top Depth: 7.0
Formation End Depth: 13.0
Formation End Depth
UOM: ft

Formation ID: 1006953359
Layer: 1
Color: 2
General Color: GREY
Mat1: 11
Most Common Material: GRAVEL
Mat2: 09
Mat2 Desc: MEDIUM SAND
Mat3: 79
Mat3 Desc: PACKED
Formation Top Depth: 0.0

Wells and Additional Sources Detail Report

Formation End Depth: 1.0
Formation End Depth
UOM: ft

Formation ID: 1006953362
Layer: 4
Color: 2
General Color: GREY
Mat1: 17
Most Common Material: SHALE
Mat2:
Mat2 Desc:
Mat3: 92
Mat3 Desc: WEATHERED
Formation Top Depth: 13.0
Formation End Depth: 18.0
Formation End Depth
UOM: ft

Plug ID: 1006953374
Layer: 3
Plug From: 2.0
Plug To: 17.5
Plug Depth UOM: ft

Plug ID: 1006953372
Layer: 1
Plug From: 0.0
Plug To: 1.0
Plug Depth UOM: ft

Plug ID: 1006953375
Layer: 4
Plug From: 17.5
Plug To: 24.0
Plug Depth UOM: ft

Plug ID: 1006953373
Layer: 2
Plug From: 1.0
Plug To: 2.0
Plug Depth UOM: ft

Wells and Additional Sources Detail Report

Method Construction ID: 1006953371
Method Construction Code: B
Method Construction: Other Method
Other Method Construction: DIRECT PUSH

Pipe ID: 1006953358
Casing No: 0
Comment:
Alt Name:

Casing ID: 1006953367
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 19.0
Casing Diameter: 1.3799999952316284
Casing Diameter UOM: inch
Casing Depth UOM: ft

Screen ID: 1006953368
Layer: 1
Slot: 10
Screen Top Depth: 19.0
Screen End Depth: 24.0
Screen Material: 5
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 1.6599999966621399

Water ID: 1006953366
Layer:
Kind Code:
Kind:
Water Found Depth:
Water Found Depth UOM: ft

Hole ID: 1006953365
Diameter: 2.375
Depth From: 14.0

Wells and Additional Sources Detail Report

Depth To: 24.0
Hole Depth UOM: ft
Hole Diameter UOM: inch

Hole ID: 1006953364
Diameter: 2.875
Depth From: 0.0
Depth To: 14.0
Hole Depth UOM: ft
Hole Diameter UOM: inch

Bore Hole ID:	1006758610	Tag No:	A189871
Depth M:	7.3152	Contractor:	7241
Year Completed:	2017	Path:	
Well Completed Dt:	2017/08/30	Latitude:	43.5537714511117
Audit No:	Z258526	Longitude:	-79.5862474432159

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
49	N	0.20	202.90	79.85	WWIS

Well ID:	7380069	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	01-Feb-2021 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	7KGN0B7V	Contractor:	7360
Tag:	A310018	Form Version:	9
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

Bore Hole ID:	1008564516	Elevation:	
DP2BR:		Elevrc:	

Wells and Additional Sources Detail Report

Spatial Status:	Zone:	17
Code OB:	East83:	614222.00
Code OB Desc:	North83:	4823780.00
Open Hole:	Org CS:	UTM83
Cluster Kind:	UTMRC:	4
Date Completed: 22-Apr-2020 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:	Location Method:	wwr
Elevrc Desc:		
Location Source Date:		
Improvement Location Source:		
Improvement Location Method:		
Source Revision		
Comment:		
Supplier Comment:		

Formation ID:	1008564625
Layer:	1
Color:	6
General Color:	BROWN
Mat1:	01
Most Common Material:	FILL
Mat2:	
Mat2 Desc:	
Mat3:	73
Mat3 Desc:	HARD
Formation Top Depth:	0.0
Formation End Depth:	10.0
Formation End Depth UOM:	ft

Formation ID:	1008564626
Layer:	2
Color:	2
General Color:	GREY
Mat1:	34
Most Common Material:	TILL
Mat2:	
Mat2 Desc:	
Mat3:	73
Mat3 Desc:	HARD
Formation Top Depth:	10.0
Formation End Depth:	20.0
Formation End Depth UOM:	ft

Wells and Additional Sources Detail Report

Plug ID: 1008564732
Layer: 1
Plug From: 0.0
Plug To: 8.0
Plug Depth UOM: ft

Plug ID: 1008564714
Layer: 1
Plug From:
Plug To:
Plug Depth UOM: ft

Method Construction ID: 1008564583
Method Construction Code: E
Method Construction: Auger
Other Method Construction:

Pipe ID: 1008564557
Casing No: 0
Comment:
Alt Name:

Casing ID: 1008564666
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 10.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Screen ID: 1008564682
Layer: 1
Slot: 0.1
Screen Top Depth: 10.0
Screen End Depth: 20.0
Screen Material: 5
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 2.25

Wells and Additional Sources Detail Report

Pump Test ID: 1008564558
 Pump Set At:
 Static Level:
 Final Level After Pumping:
 Recommended Pump
 Depth:
 Pumping Rate:
 Flowing Rate:
 Recommended Pump
 Rate:
 Levels UOM: ft
 Rate UOM: GPM
 Water State After Test
 Code:
 Water State After Test:
 Pumping Test Method:
 Pumping Duration HR:
 Pumping Duration MIN:
 Flowing:

Hole ID: 1008564697
 Diameter: 6.0
 Depth From: 0.0
 Depth To: 20.0
 Hole Depth UOM: ft
 Hole Diameter UOM: inch

Bore Hole ID:	1008564516	Tag No:	A310018
Depth M:	6.096	Contractor:	7360
Year Completed:	2020	Path:	738\7380069.pdf
Well Completed Dt:	2020/04/22	Latitude:	43.5582317378366
Audit No:	7KGN0B7V	Longitude:	-79.5857840896598

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
50	SSW	0.21	214.48	79.85	WWIS

Well ID:	7296574	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Test Hole	Data Entry Status:	
Use 2nd:	Monitoring	Data Src:	
Final Well Status:	Monitoring and Test Hole	Date Received:	05-Oct-2017 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z258527	Contractor:	7241

Wells and Additional Sources Detail Report

Tag:	A189840	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

PDF URL (Map):

Well Completed Date:	2017/08/31
Year Completed:	2017
Depth (m):	2.4384
Latitude:	43.5537824687829
Longitude:	-79.5871385635945
Path:	

Bore Hole ID:	1006758607	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614121.00
Code OB Desc:		North83:	4823284.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	31-Aug-2017 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Formation ID:	1006953269
Layer:	3
Color:	2
General Color:	GREY
Mat1:	34

Wells and Additional Sources Detail Report

Most Common Material: TILL
Mat2: 73
Mat2 Desc: HARD
Mat3: 66
Mat3 Desc: DENSE
Formation Top Depth: 6.0
Formation End Depth: 8.0
Formation End Depth UOM: ft

Formation ID: 1006953268
Layer: 2
Color: 6
General Color: BROWN
Mat1: 34
Most Common Material: TILL
Mat2: 73
Mat2 Desc: HARD
Mat3: 66
Mat3 Desc: DENSE
Formation Top Depth: 1.0
Formation End Depth: 6.0
Formation End Depth UOM: ft

Formation ID: 1006953267
Layer: 1
Color: 2
General Color: GREY
Mat1: 11
Most Common Material: GRAVEL
Mat2: 73
Mat2 Desc: HARD
Mat3: 79
Mat3 Desc: PACKED
Formation Top Depth: 0.0
Formation End Depth: 1.0
Formation End Depth UOM: ft

Plug ID: 1006953279
Layer: 3
Plug From: 2.5
Plug To: 8.0
Plug Depth UOM: ft

Wells and Additional Sources Detail Report

Plug ID: 1006953278
Layer: 2
Plug From: 1.0
Plug To: 2.5
Plug Depth UOM: ft

Plug ID: 1006953277
Layer: 1
Plug From: 0.0
Plug To: 1.0
Plug Depth UOM: ft

Method Construction ID: 1006953276
Method Construction Code: B
Method Construction: Other Method
Other Method Construction: DIRECT PUSH

Pipe ID: 1006953266
Casing No: 0
Comment:
Alt Name:

Casing ID: 1006953272
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 0.30000001192092896
Casing Diameter: 1.3799999952316284
Casing Diameter UOM: inch
Casing Depth UOM: ft

Screen ID: 1006953273
Layer: 1
Slot: 10
Screen Top Depth: 3.0
Screen End Depth: 8.0
Screen Material: 5
Screen Depth UOM: ft
Screen Diameter UOM: inch

Wells and Additional Sources Detail Report

Screen Diameter: 1.659999966621399

Water ID: 1006953271

Layer:

Kind Code:

Kind:

Water Found Depth:

Water Found Depth UOM: ft

Hole ID: 1006953270

Diameter: 2.375

Depth From: 0.0

Depth To: 8.0

Hole Depth UOM: ft

Hole Diameter UOM: inch

Bore Hole ID: 1006758607

Depth M: 2.4384

Year Completed: 2017

Well Completed Dt: 2017/08/31

Audit No: Z258527

Tag No: A189840

Contractor: 7241

Path:

Latitude: 43.5537824687829

Longitude: -79.5871385635945

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
51	SSW	0.22	215.74	79.85	WWIS

Well ID: 7278219

Construction Date:

Use 1st: Monitoring

Use 2nd:

Final Well Status: Observation Wells

Water Type:

Casing Material:

Audit No: Z232729

Tag: A213501

Constructn Method:

Elevation (m):

Elevatn Reliabilty:

Depth to Bedrock:

Well Depth:

Overburden/Bedrock:

Pump Rate:

Static Water Level:

Clear/Cloudy:

Flowing (Y/N):

Flow Rate:

Data Entry Status:

Data Src:

Date Received: 28-Dec-2016 00:00:00

Selected Flag: TRUE

Abandonment Rec:

Contractor: 7238

Form Version: 7

Owner:

County: PEEL

Lot:

Concession:

Concession Name:

Easting NAD83:

Northing NAD83:

Zone:

UTM Reliability:

Wells and Additional Sources Detail Report

Municipality: MISSISSAUGA CITY (PORT CREDIT)
Site Info:

PDF URL (Map):

Well Completed Date: 2016/12/02
Year Completed: 2016
Depth (m): 7.4676
Latitude: 43.553688323252
Longitude: -79.5868064972322
Path:

Bore Hole ID:	1006322618	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614148.00
Code OB Desc:		North83:	4823274.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	02-Dec-2016 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Formation ID: 1006534295
Layer: 2
Color: 6
General Color: BROWN
Mat1: 05
Most Common Material: CLAY
Mat2:
Mat2 Desc:
Mat3: 85
Mat3 Desc: SOFT
Formation Top Depth: 2.5
Formation End Depth: 10.0
Formation End Depth UOM: ft

Wells and Additional Sources Detail Report

Formation ID: 1006534297
Layer: 4
Color:
General Color:
Mat1: 05
Most Common Material: CLAY
Mat2: 11
Mat2 Desc: GRAVEL
Mat3:
Mat3 Desc:
Formation Top Depth: 15.0
Formation End Depth: 24.0
Formation End Depth UOM: ft

Formation ID: 1006534298
Layer: 5
Color:
General Color:
Mat1:
Most Common Material:
Mat2:
Mat2 Desc:
Mat3:
Mat3 Desc:
Formation Top Depth: 24.0
Formation End Depth: 24.5
Formation End Depth UOM: ft

Formation ID: 1006534294
Layer: 1
Color: 6
General Color: BROWN
Mat1: 02
Most Common Material: TOPSOIL
Mat2:
Mat2 Desc:
Mat3:
Mat3 Desc:
Formation Top Depth: 0.0
Formation End Depth: 2.5
Formation End Depth UOM: ft

Formation ID: 1006534296

Wells and Additional Sources Detail Report

Layer: 3
Color: 2
General Color: GREY
Mat1: 05
Most Common Material: CLAY
Mat2: 06
Mat2 Desc: SILT
Mat3:
Mat3 Desc:
Formation Top Depth: 10.0
Formation End Depth: 15.0
Formation End Depth UOM: ft

Plug ID: 1006534305
Layer: 1
Plug From: 0.0
Plug To: 1.0
Plug Depth UOM: ft

Plug ID: 1006534306
Layer: 2
Plug From: 1.0
Plug To: 12.0
Plug Depth UOM: ft

Plug ID: 1006534307
Layer: 3
Plug From: 12.0
Plug To: 24.0
Plug Depth UOM: ft

Method Construction ID: 1006534304
Method Construction Code: 6
Method Construction: Boring
Other Method Construction:

Pipe ID: 1006534293
Casing No: 0
Comment:
Alt Name:

Wells and Additional Sources Detail Report

Casing ID: 1006534301
 Layer: 1
 Material: 5
 Open Hole or Material: PLASTIC
 Depth From: 0.0
 Depth To: 14.0
 Casing Diameter: 2.0
 Casing Diameter UOM: inch
 Casing Depth UOM: ft

Screen ID: 1006534302
 Layer: 1
 Slot: 10
 Screen Top Depth: 14.0
 Screen End Depth: 24.0
 Screen Material: 5
 Screen Depth UOM: ft
 Screen Diameter UOM: inch
 Screen Diameter:

Water ID: 1006534300
 Layer:
 Kind Code:
 Kind:
 Water Found Depth:
 Water Found Depth UOM: ft

Hole ID: 1006534299
 Diameter: 6.25
 Depth From: 0.0
 Depth To: 24.5
 Hole Depth UOM: ft
 Hole Diameter UOM: inch

Bore Hole ID:	1006322618	Tag No:	A213501
Depth M:	7.4676	Contractor:	7238
Year Completed:	2016	Path:	727\7278219.pdf
Well Completed Dt:	2016/12/02	Latitude:	43.553688323252
Audit No:	Z232729	Longitude:	-79.5868064972322

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
52	NNW	0.22	218.86	80.49	WWIS

Wells and Additional Sources Detail Report

Well ID:	7378964	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:		Data Entry Status:	Yes
Use 2nd:		Data Src:	
Final Well Status:		Date Received:	29-Jan-2021 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z348110	Contractor:	7644
Tag:	A301452	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

Bore Hole ID:	1008614907	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614157.00
Code OB Desc:		North83:	4823793.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	18-Dec-2020 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Bore Hole ID:	1008614907	Tag No:	A301452
Depth M:		Contractor:	7644
Year Completed:	2020	Path:	
Well Completed Dt:	2020/12/18	Latitude:	43.5583587077452
Audit No:	Z348110	Longitude:	-79.5865858966422

Wells and Additional Sources Detail Report

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
53	N	0.23	225.69	80.49	WWIS

Well ID:	7310446	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	17-Apr-2018 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z266938	Contractor:	6607
Tag:	A224458	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliabilty:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

PDF URL (Map):

Well Completed Date:	2018/02/23
Year Completed:	2018
Depth (m):	9.1
Latitude:	43.5583989367958
Longitude:	-79.5854706485166
Path:	

Bore Hole ID:	1007036951	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614247.00
Code OB Desc:		North83:	4823799.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	23-Feb-2018 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			

Wells and Additional Sources Detail Report

Improvement Location
Source:
Improvement Location
Method:
Source Revision
Comment:
Supplier Comment:

Formation ID: 1007268448
Layer: 1
Color: 6
General Color: BROWN
Mat1: 28
Most Common Material: SAND
Mat2: 06
Mat2 Desc: SILT
Mat3: 85
Mat3 Desc: SOFT
Formation Top Depth: 0.0
Formation End Depth: 1.5
Formation End Depth
UOM: m

Formation ID: 1007268449
Layer: 2
Color: 6
General Color: BROWN
Mat1: 05
Most Common Material: CLAY
Mat2: 06
Mat2 Desc: SILT
Mat3: 73
Mat3 Desc: HARD
Formation Top Depth: 1.5
Formation End Depth: 5.099999904632568
Formation End Depth
UOM: m

Formation ID: 1007268450
Layer: 3
Color: 2
General Color: GREY
Mat1: 28
Most Common Material: SAND
Mat2: 06
Mat2 Desc: SILT
Mat3: 73

Wells and Additional Sources Detail Report

Mat3 Desc: HARD
Formation Top Depth: 5.099999904632568
Formation End Depth: 9.100000381469727
Formation End Depth UOM: m

Plug ID: 1007268458
Layer: 2
Plug From: 0.30000001192092896
Plug To: 5.400000095367432
Plug Depth UOM: m

Plug ID: 1007268457
Layer: 1
Plug From: 0.0
Plug To: 0.30000001192092896
Plug Depth UOM: m

Method Construction ID: 1007268456
Method Construction Code: 6
Method Construction: Boring
Other Method Construction:

Pipe ID: 1007268447
Casing No: 0
Comment:
Alt Name:

Casing ID: 1007268453
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To:
Casing Diameter: 5.099999904632568
Casing Diameter UOM: cm
Casing Depth UOM: m

Screen ID: 1007268454
Layer: 1
Slot: 10

Wells and Additional Sources Detail Report

Screen Top Depth:
 Screen End Depth:
 Screen Material: 5
 Screen Depth UOM: m
 Screen Diameter UOM: cm
 Screen Diameter: 6.400000095367432

Water ID: 1007268452
 Layer:
 Kind Code:
 Kind:
 Water Found Depth:
 Water Found Depth UOM: m

Hole ID: 1007268451
 Diameter: 17.0
 Depth From: 0.0
 Depth To: 9.100000381469727
 Hole Depth UOM: m
 Hole Diameter UOM: cm

Bore Hole ID:	1007036951	Tag No:	A224458
Depth M:	9.1	Contractor:	6607
Year Completed:	2018	Path:	731\7310446.pdf
Well Completed Dt:	2018/02/23	Latitude:	43.5583989367958
Audit No:	Z266938	Longitude:	-79.5854706485166

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
54	ENE	0.23	232.74	79.85	WWIS

Well ID:	7155591	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Test Hole	Date Received:	08-Dec-2010 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	M07281	Contractor:	6607
Tag:	A100950	Form Version:	5
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	

Wells and Additional Sources Detail Report

Well Depth:	Concession Name:
Overburden/Bedrock:	Easting NAD83:
Pump Rate:	Northing NAD83:
Static Water Level:	Zone:
Clear/Cloudy:	UTM Reliability:
Municipality:	MISSISSAUGA CITY (PORT CREDIT)
Site Info:	

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/715\7155591.pdf

Well Completed Date: 2010/07/23
Year Completed: 2010
Depth (m): 5.7
Latitude: 43.5565952443951
Longitude: -79.5823309773926
Path: 715\7155591.pdf

Bore Hole ID:	1003431946	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614504.00
Code OB Desc:		North83:	4823603.00
Open Hole:	No	Org CS:	UTM83
Cluster Kind:		UTMRC:	3
Date Completed:	23-Jul-2010 00:00:00	UTMRC Desc:	margin of error : 10 - 30 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Formation ID: 1006147375
Layer: 2
Color: 2
General Color: GREY
Mat1: 06
Most Common Material: SILT
Mat2: 05
Mat2 Desc: CLAY
Mat3: 11
Mat3 Desc: GRAVEL

Wells and Additional Sources Detail Report

Formation Top Depth: 3.299999952316284
Formation End Depth: 5.699999809265137
Formation End Depth UOM: m

Formation ID: 1006147374
Layer: 1
Color: 6
General Color: BROWN
Mat1: 06
Most Common Material: SILT
Mat2: 05
Mat2 Desc: CLAY
Mat3: 11
Mat3 Desc: GRAVEL
Formation Top Depth: 0.0
Formation End Depth: 3.299999952316284
Formation End Depth UOM: m

Plug ID: 1006147378
Layer: 2
Plug From: 0.30000001192092896
Plug To: 2.0999999046325684
Plug Depth UOM: m

Plug ID: 1006147377
Layer: 1
Plug From: 0.0
Plug To: 0.30000001192092896
Plug Depth UOM: m

Method Construction ID: 1006147383
Method Construction Code: 6
Method Construction: Boring
Other Method Construction:

Pipe ID: 1006147373
Casing No: 0
Comment:
Alt Name:

Wells and Additional Sources Detail Report

Casing ID: 1006147379
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 2.5
Casing Diameter: 5.099999904632568
Casing Diameter UOM: cm
Casing Depth UOM: m

Casing ID: 1006147380
Layer: 2
Material: 5
Open Hole or Material: PLASTIC
Depth From: 2.5
Depth To: 5.5
Casing Diameter: 5.099999904632568
Casing Diameter UOM: cm
Casing Depth UOM: m

Screen ID: 1006147381
Layer: 1
Slot: 20
Screen Top Depth:
Screen End Depth:
Screen Material: 5
Screen Depth UOM: m
Screen Diameter UOM: cm
Screen Diameter: 6.099999904632568

Hole ID: 1006147376
Diameter:
Depth From: 0.0
Depth To: 5.5
Hole Depth UOM: m
Hole Diameter UOM: cm

Bore Hole ID:	1006147355	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614510.00
Code OB Desc:		North83:	482361.00
Open Hole:		Org CS:	UTM83

Wells and Additional Sources Detail Report

Cluster Kind:	This is a record from cluster log sheet	UTMRC:	3
Date Completed:	23-Jul-2010 00:00:00	UTMRC Desc:	margin of error : 10 - 30 m
Remarks:		Location Method:	WWR
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Plug ID:	1006147359
Layer:	
Plug From:	
Plug To:	
Plug Depth UOM:	m

Method Construction ID:	1006147358
Method Construction Code:	
Method Construction:	
Other Method Construction:	BORING

Pipe ID:	1006147360
Casing No:	0
Comment:	
Alt Name:	

Casing ID:	1006147362
Layer:	1
Material:	5
Open Hole or Material:	PLASTIC
Depth From:	
Depth To:	1.899999976158142
Casing Diameter:	
Casing Diameter UOM:	cm
Casing Depth UOM:	m

Screen ID:	1006147361
Layer:	1
Slot:	
Screen Top Depth:	1.899999976158142

Wells and Additional Sources Detail Report

Screen End Depth: 4.900000095367432
Screen Material:
Screen Depth UOM: m
Screen Diameter UOM: cm
Screen Diameter:

Pump Test ID: 1006147363
Pump Set At:
Static Level:
Final Level After Pumping:
Recommended Pump
Depth:
Pumping Rate:
Flowing Rate:
Recommended Pump
Rate:
Levels UOM: m
Rate UOM:
Water State After Test
Code:
Water State After Test:
Pumping Test Method:
Pumping Duration HR:
Pumping Duration MIN:
Flowing:

Hole ID: 1006147357
Diameter:
Depth From:
Depth To: 4.900000095367432
Hole Depth UOM: m
Hole Diameter UOM: cm

Bore Hole ID:	1006147364	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614519.00
Code OB Desc:		North83:	4823619.00
Open Hole:		Org CS:	UTM83
Cluster Kind:	This is a record from cluster log sheet	UTMRC:	3
Date Completed:	10-Jul-2010 00:00:00	UTMRC Desc:	margin of error : 10 - 30 m
Remarks:		Location Method:	WWR
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			

Wells and Additional Sources Detail Report

Improvement Location
Method:
Source Revision
Comment:
Supplier Comment:

Plug ID: 1006147368
Layer:
Plug From:
Plug To:
Plug Depth UOM: m

Method Construction ID: 1006147367
Method Construction
Code:
Method Construction:
Other Method
Construction: BORING

Pipe ID: 1006147369
Casing No: 0
Comment:
Alt Name:

Casing ID: 1006147371
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From:
Depth To: 2.5
Casing Diameter:
Casing Diameter UOM: cm
Casing Depth UOM: m

Screen ID: 1006147370
Layer: 1
Slot:
Screen Top Depth: 2.5
Screen End Depth: 5.5
Screen Material:
Screen Depth UOM: m
Screen Diameter UOM: cm
Screen Diameter:

Wells and Additional Sources Detail Report

Pump Test ID: 1006147372
 Pump Set At:
 Static Level:
 Final Level After Pumping:
 Recommended Pump
 Depth:
 Pumping Rate:
 Flowing Rate:
 Recommended Pump
 Rate:
 Levels UOM: m
 Rate UOM:
 Water State After Test
 Code:
 Water State After Test:
 Pumping Test Method:
 Pumping Duration HR:
 Pumping Duration MIN:
 Flowing:

Hole ID: 1006147366
 Diameter:
 Depth From:
 Depth To: 5.5
 Hole Depth UOM: m
 Hole Diameter UOM: cm

Bore Hole ID:	1003431946	Tag No:	A100950
Depth M:	5.7	Contractor:	6607
Year Completed:	2010	Path:	715\7155591.pdf
Well Completed Dt:	2010/07/23	Latitude:	43.5565952443951
Audit No:	M07281	Longitude:	-79.5823309773926

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
55	N	0.24	237.12	80.85	WWIS

Well ID:	7310447	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	17-Apr-2018 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z266937	Contractor:	6607
Tag:	A232670	Form Version:	7
Constructn Method:		Owner:	

Wells and Additional Sources Detail Report

Elevation (m):	County:	PEEL
Elevatn Reliability:	Lot:	
Depth to Bedrock:	Concession:	
Well Depth:	Concession Name:	
Overburden/Bedrock:	Easting NAD83:	
Pump Rate:	Northing NAD83:	
Static Water Level:	Zone:	
Clear/Cloudy:	UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)	
Site Info:		

PDF URL (Map):

Well Completed Date:	2018/02/22
Year Completed:	2018
Depth (m):	7.6
Latitude:	43.5585170279148
Longitude:	-79.5855545539391
Path:	

Bore Hole ID:	1007036954	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614240.00
Code OB Desc:		North83:	4823812.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	22-Feb-2018 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Formation ID:	1007268473
Layer:	2
Color:	6
General Color:	BROWN
Mat1:	05
Most Common Material:	CLAY
Mat2:	06

Wells and Additional Sources Detail Report

Mat2 Desc: SILT
Mat3: 73
Mat3 Desc: HARD
Formation Top Depth: 1.5
Formation End Depth: 5.099999904632568
Formation End Depth
UOM: m

Formation ID: 1007268472
Layer: 1
Color: 6
General Color: BROWN
Mat1: 28
Most Common Material: SAND
Mat2: 06
Mat2 Desc: SILT
Mat3: 85
Mat3 Desc: SOFT
Formation Top Depth: 0.0
Formation End Depth: 1.5
Formation End Depth
UOM: m

Formation ID: 1007268474
Layer: 3
Color: 2
General Color: GREY
Mat1: 28
Most Common Material: SAND
Mat2: 06
Mat2 Desc: SILT
Mat3: 73
Mat3 Desc: HARD
Formation Top Depth: 5.099999904632568
Formation End Depth: 7.599999904632568
Formation End Depth
UOM: m

Plug ID: 1007268482
Layer: 2
Plug From: 0.30000001192092896
Plug To: 4.0
Plug Depth UOM: m

Plug ID: 1007268481

Wells and Additional Sources Detail Report

Layer: 1
Plug From: 0.0
Plug To: 0.30000001192092896
Plug Depth UOM: m

Method Construction ID: 1007268480
Method Construction Code: 6
Method Construction: Boring
Other Method Construction:

Pipe ID: 1007268471
Casing No: 0
Comment:
Alt Name:

Casing ID: 1007268477
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 4.5
Casing Diameter: 5.099999904632568
Casing Diameter UOM: cm
Casing Depth UOM: m

Screen ID: 1007268478
Layer: 1
Slot: 10
Screen Top Depth: 4.5
Screen End Depth: 7.599999904632568
Screen Material: 5
Screen Depth UOM: m
Screen Diameter UOM: cm
Screen Diameter: 6.400000095367432

Water ID: 1007268476
Layer:
Kind Code:
Kind:
Water Found Depth:
Water Found Depth UOM: m

Wells and Additional Sources Detail Report

Hole ID: 1007268475
 Diameter: 2.0999999046325684
 Depth From: 0.0
 Depth To: 7.599999904632568
 Hole Depth UOM: m
 Hole Diameter UOM: cm

Bore Hole ID:	1007036954	Tag No:	A232670
Depth M:	7.6	Contractor:	6607
Year Completed:	2018	Path:	731\7310447.pdf
Well Completed Dt:	2018/02/22	Latitude:	43.5585170279148
Audit No:	Z266937	Longitude:	-79.5855545539391

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
56	SSW	0.24	237.46	79.85	WWIS

Well ID:	7330662	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Not Used	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Abandoned-Other	Date Received:	11-Feb-2019 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	Yes
Audit No:	YFL7EAMT	Contractor:	7147
Tag:	A213503	Form Version:	9
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliabilty:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:	MW 16-1		

PDF URL (Map):

Well Completed Date: 2019/01/18
 Year Completed: 2019
 Depth (m):

Wells and Additional Sources Detail Report

Latitude: 43.5535192842979
Longitude: -79.5869713905599
Path:

Bore Hole ID: 1007353328 Elevation:
DP2BR: Elevrc:
Spatial Status: Zone: 17
Code OB: East83: 614135.00
Code OB Desc: North83: 4823255.00
Open Hole: Org CS: UTM83
Cluster Kind: UTMRC: 4
Date Completed: 18-Jan-2019 00:00:00 UTMRC Desc: margin of error : 30 m - 100 m
Remarks: Location Method: wwr
Elevrc Desc:
Location Source Date:
Improvement Location
Source:
Improvement Location
Method:
Source Revision
Comment:
Supplier Comment:

Formation ID: 1007353718
Layer: 1
Color:
General Color:
Mat1:
Most Common Material:
Mat2:
Mat2 Desc:
Mat3:
Mat3 Desc:
Formation Top Depth: 0.0
Formation End Depth:
Formation End Depth UOM: m

Plug ID: 1007354045
Layer: 1
Plug From: 0.0
Plug To: 14.8999999618530273
Plug Depth UOM: m

Plug ID: 1007353959
Layer: 2

Wells and Additional Sources Detail Report

Plug From: 2.5
Plug To: 14.899999618530273
Plug Depth UOM: m

Plug ID: 1007353958
Layer: 1
Plug From: 0.0
Plug To: 2.5
Plug Depth UOM: m

Pipe ID: 1007353491
Casing No: 0
Comment:
Alt Name:

Casing ID: 1007353809
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 11.899999618530273
Casing Diameter: 5.0
Casing Diameter UOM: cm
Casing Depth UOM: m

Screen ID: 1007353871
Layer: 1
Slot:
Screen Top Depth: 11.899999618530273
Screen End Depth: 14.899999618530273
Screen Material: 5
Screen Depth UOM: m
Screen Diameter UOM: cm
Screen Diameter: 6.300000190734863

Pump Test ID: 1007353492
Pump Set At:
Static Level:
Final Level After Pumping:
Recommended Pump
Depth:
Pumping Rate:
Flowing Rate:

Wells and Additional Sources Detail Report

Recommended Pump
Rate:
Levels UOM: m
Rate UOM: LPM
Water State After Test
Code:
Water State After Test:
Pumping Test Method:
Pumping Duration HR:
Pumping Duration MIN:
Flowing:

Water ID: 1007353661
Layer: 1
Kind Code: 8
Kind: Untested
Water Found Depth: 6.0
Water Found Depth UOM: m

Bore Hole ID:	1007353328	Tag No:	A213503
Depth M:		Contractor:	7147
Year Completed:	2019	Path:	
Well Completed Dt:	2019/01/18	Latitude:	43.5535192842979
Audit No:	YFL7EAMT	Longitude:	-79.5869713905599

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
56	SSW	0.24	237.46	79.85	WWIS

Well ID:	7278218	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	28-Dec-2016 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z232728	Contractor:	7238
Tag:	A213503	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliabilty:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	

Wells and Additional Sources Detail Report

Municipality: MISSISSAUGA CITY (PORT CREDIT)
Site Info:

PDF URL (Map):

Well Completed Date: 2016/12/06
Year Completed: 2016
Depth (m): 14.9352
Latitude: 43.5535192842979
Longitude: -79.5869713905599
Path:

Bore Hole ID:	1006322615	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614135.00
Code OB Desc:		North83:	4823255.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	06-Dec-2016 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Formation ID: 1006534281
Layer: 5
Color:
General Color:
Mat1: 15
Most Common Material: LIMESTONE
Mat2:
Mat2 Desc:
Mat3:
Mat3 Desc:
Formation Top Depth: 30.0
Formation End Depth: 49.0
Formation End Depth UOM: ft

Wells and Additional Sources Detail Report

Formation ID: 1006534280
Layer: 4
Color:
General Color:
Mat1: 05
Most Common Material: CLAY
Mat2: 11
Mat2 Desc: GRAVEL
Mat3:
Mat3 Desc:
Formation Top Depth: 20.0
Formation End Depth: 30.0
Formation End Depth UOM: ft

Formation ID: 1006534278
Layer: 2
Color: 2
General Color: GREY
Mat1: 05
Most Common Material: CLAY
Mat2:
Mat2 Desc:
Mat3: 85
Mat3 Desc: SOFT
Formation Top Depth: 5.0
Formation End Depth: 15.0
Formation End Depth UOM: ft

Formation ID: 1006534277
Layer: 1
Color:
General Color:
Mat1: 02
Most Common Material: TOPSOIL
Mat2:
Mat2 Desc:
Mat3:
Mat3 Desc:
Formation Top Depth: 0.0
Formation End Depth: 5.0
Formation End Depth UOM: ft

Formation ID: 1006534279

Wells and Additional Sources Detail Report

Layer: 3
Color: 2
General Color: GREY
Mat1: 05
Most Common Material: CLAY
Mat2:
Mat2 Desc:
Mat3:
Mat3 Desc:
Formation Top Depth: 15.0
Formation End Depth: 20.0
Formation End Depth UOM: ft

Plug ID: 1006534290
Layer: 1
Plug From: 0.0
Plug To: 1.0
Plug Depth UOM: ft

Plug ID: 1006534291
Layer: 2
Plug From: 1.0
Plug To: 37.0
Plug Depth UOM: ft

Plug ID: 1006534292
Layer: 3
Plug From: 37.0
Plug To: 49.0
Plug Depth UOM: ft

Method Construction ID: 1006534289
Method Construction Code: 6
Method Construction: Boring
Other Method Construction:

Pipe ID: 1006534276
Casing No: 0
Comment:
Alt Name:

Wells and Additional Sources Detail Report

Casing ID: 1006534286
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 39.0
Casing Diameter: 1.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Screen ID: 1006534287
Layer: 1
Slot: 10
Screen Top Depth: 39.0
Screen End Depth: 49.0
Screen Material: 5
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter:

Water ID: 1006534285
Layer:
Kind Code:
Kind:
Water Found Depth:
Water Found Depth UOM: ft

Hole ID: 1006534284
Diameter: 3.5
Depth From: 35.0
Depth To: 49.0
Hole Depth UOM: ft
Hole Diameter UOM: inch

Hole ID: 1006534282
Diameter: 6.25
Depth From: 0.0
Depth To: 30.0
Hole Depth UOM: ft
Hole Diameter UOM: inch

Wells and Additional Sources Detail Report

Hole ID: 1006534283
 Diameter: 4.5
 Depth From: 30.0
 Depth To: 35.0
 Hole Depth UOM: ft
 Hole Diameter UOM: inch

Bore Hole ID:	1006322615	Tag No:	A213503
Depth M:	14.9352	Contractor:	7238
Year Completed:	2016	Path:	727\7278218.pdf
Well Completed Dt:	2016/12/06	Latitude:	43.5535192842979
Audit No:	Z232728	Longitude:	-79.5869713905599

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
57	SSW	0.24	238.79	79.85	WWIS

Well ID:	7330661	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Not Used	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Abandoned-Other	Date Received:	11-Feb-2019 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	Yes
Audit No:	86LCVW2	Contractor:	7147
Tag:	A213502	Form Version:	9
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:	MW 16-2		

PDF URL (Map):

Well Completed Date: 2019/01/18
 Year Completed: 2019
 Depth (m):
 Latitude: 43.5534913619022
 Longitude: -79.5868977619431

Wells and Additional Sources Detail Report

Path:

Bore Hole ID:	1007353325	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614141.00
Code OB Desc:		North83:	4823252.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	18-Jan-2019 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Formation ID:	1007353717
Layer:	1
Color:	
General Color:	
Mat1:	
Most Common Material:	
Mat2:	
Mat2 Desc:	
Mat3:	
Mat3 Desc:	
Formation Top Depth:	0.0
Formation End Depth:	
Formation End Depth UOM:	m

Plug ID:	1007353957
Layer:	1
Plug From:	0.0
Plug To:	6.099999904632568
Plug Depth UOM:	m

Plug ID:	1007354044
Layer:	1
Plug From:	0.0
Plug To:	6.099999904632568

Wells and Additional Sources Detail Report

Plug Depth UOM: m

Pipe ID: 1007353489

Casing No: 0

Comment:

Alt Name:

Casing ID: 1007353808

Layer: 1

Material: 5

Open Hole or Material: PLASTIC

Depth From: 0.0

Depth To: 3.0999999046325684

Casing Diameter: 5.0

Casing Diameter UOM: cm

Casing Depth UOM: m

Screen ID: 1007353870

Layer: 1

Slot:

Screen Top Depth: 3.0999999046325684

Screen End Depth: 6.099999904632568

Screen Material: 5

Screen Depth UOM: m

Screen Diameter UOM: cm

Screen Diameter: 6.300000190734863

Pump Test ID: 1007353490

Pump Set At:

Static Level:

Final Level After Pumping:

Recommended Pump

Depth:

Pumping Rate:

Flowing Rate:

Recommended Pump

Rate:

Levels UOM: m

Rate UOM: LPM

Water State After Test
Code:

Water State After Test:

Pumping Test Method:

Pumping Duration HR:

Pumping Duration MIN:

Wells and Additional Sources Detail Report

Flowing:

Bore Hole ID:	1007353325	Tag No:	A213502
Depth M:		Contractor:	7147
Year Completed:	2019	Path:	
Well Completed Dt:	2019/01/18	Latitude:	43.5534913619022
Audit No:	86LCVVW2	Longitude:	-79.5868977619431

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
57	SSW	0.24	238.79	79.85	WWIS

Well ID:	7278220	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	28-Dec-2016 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z232730	Contractor:	7238
Tag:	A213502	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

PDF URL (Map):

Well Completed Date:	2016/12/02
Year Completed:	2016
Depth (m):	9.144
Latitude:	43.5534913619022
Longitude:	-79.5868977619431
Path:	

Bore Hole ID:	1006322621	Elevation:	
DP2BR:		Elevrc:	

Wells and Additional Sources Detail Report

Spatial Status:	Zone:	17
Code OB:	East83:	614141.00
Code OB Desc:	North83:	4823252.00
Open Hole:	Org CS:	UTM83
Cluster Kind:	UTMRC:	4
Date Completed: 02-Dec-2016 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:	Location Method:	wwr
Elevrc Desc:		
Location Source Date:		
Improvement Location Source:		
Improvement Location Method:		
Source Revision		
Comment:		
Supplier Comment:		

Formation ID:	1006534352
Layer:	5
Color:	2
General Color:	GREY
Mat1:	05
Most Common Material:	CLAY
Mat2:	11
Mat2 Desc:	GRAVEL
Mat3:	73
Mat3 Desc:	HARD
Formation Top Depth:	25.0
Formation End Depth:	30.0
Formation End Depth UOM:	ft

Formation ID:	1006534348
Layer:	1
Color:	6
General Color:	BROWN
Mat1:	02
Most Common Material:	TOPSOIL
Mat2:	
Mat2 Desc:	
Mat3:	
Mat3 Desc:	
Formation Top Depth:	0.0
Formation End Depth:	2.5
Formation End Depth UOM:	ft

Wells and Additional Sources Detail Report

Formation ID: 1006534351
Layer: 4
Color: 2
General Color: GREY
Mat1: 05
Most Common Material: CLAY
Mat2: 11
Mat2 Desc: GRAVEL
Mat3:
Mat3 Desc:
Formation Top Depth: 15.0
Formation End Depth: 25.0
Formation End Depth UOM: ft

Formation ID: 1006534349
Layer: 2
Color: 6
General Color: BROWN
Mat1: 05
Most Common Material: CLAY
Mat2:
Mat2 Desc:
Mat3:
Mat3 Desc:
Formation Top Depth: 2.5
Formation End Depth: 7.5
Formation End Depth UOM: ft

Formation ID: 1006534350
Layer: 3
Color: 2
General Color: GREY
Mat1: 05
Most Common Material: CLAY
Mat2: 06
Mat2 Desc: SILT
Mat3: 85
Mat3 Desc: SOFT
Formation Top Depth: 7.5
Formation End Depth: 15.0
Formation End Depth UOM: ft

Plug ID: 1006534360

Wells and Additional Sources Detail Report

Layer: 2
Plug From: 1.0
Plug To: 8.0
Plug Depth UOM: ft

Plug ID: 1006534361
Layer: 3
Plug From: 8.0
Plug To: 21.0
Plug Depth UOM: ft

Plug ID: 1006534362
Layer: 4
Plug From: 21.0
Plug To: 30.0
Plug Depth UOM: ft

Plug ID: 1006534359
Layer: 1
Plug From: 0.0
Plug To: 1.0
Plug Depth UOM: ft

Method Construction ID: 1006534358
Method Construction Code: 6
Method Construction: Boring
Other Method Construction:

Pipe ID: 1006534347
Casing No: 0
Comment:
Alt Name:

Casing ID: 1006534355
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 10.0
Casing Diameter: 2.0

Wells and Additional Sources Detail Report

Casing Diameter UOM: inch
Casing Depth UOM: ft

Screen ID: 1006534356
Layer: 1
Slot: 10
Screen Top Depth: 10.0
Screen End Depth: 20.0
Screen Material: 5
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter:

Water ID: 1006534354
Layer:
Kind Code:
Kind:
Water Found Depth:
Water Found Depth UOM: ft

Hole ID: 1006534353
Diameter: 6.25
Depth From: 0.0
Depth To: 30.0
Hole Depth UOM: ft
Hole Diameter UOM: inch

Bore Hole ID:	1006322621	Tag No:	A213502
Depth M:	9.144	Contractor:	7238
Year Completed:	2016	Path:	727\7278220.pdf
Well Completed Dt:	2016/12/02	Latitude:	43.5534913619022
Audit No:	Z232730	Longitude:	-79.5868977619431

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
58	N	0.24	240.75	80.85	WWIS

Well ID:	7284674	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	07-Apr-2017 00:00:00
Water Type:		Selected Flag:	TRUE

Wells and Additional Sources Detail Report

Casing Material:		Abandonment Rec:	
Audit No:	Z248219	Contractor:	6607
Tag:	A217853	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliabilty:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

PDF URL (Map):

Well Completed Date:	2017/03/29
Year Completed:	2017
Depth (m):	7.6
Latitude:	43.558573059251
Longitude:	-79.5864446916209
Path:	

Bore Hole ID:	1006383141	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614168.00
Code OB Desc:		North83:	4823817.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	29-Mar-2017 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Formation ID:	1006636302
Layer:	2
Color:	6

Wells and Additional Sources Detail Report

General Color: BROWN
Mat1: 06
Most Common Material: SILT
Mat2: 34
Mat2 Desc: TILL
Mat3: 66
Mat3 Desc: DENSE
Formation Top Depth: 1.5
Formation End Depth: 3.0
Formation End Depth UOM: m

Formation ID: 1006636303
Layer: 3
Color: 2
General Color: GREY
Mat1: 06
Most Common Material: SILT
Mat2: 34
Mat2 Desc: TILL
Mat3: 66
Mat3 Desc: DENSE
Formation Top Depth: 3.0
Formation End Depth: 5.699999809265137
Formation End Depth UOM: m

Formation ID: 1006636304
Layer: 4
Color: 2
General Color: GREY
Mat1: 28
Most Common Material: SAND
Mat2:
Mat2 Desc:
Mat3: 77
Mat3 Desc: LOOSE
Formation Top Depth: 5.699999809265137
Formation End Depth: 7.599999904632568
Formation End Depth UOM: m

Formation ID: 1006636301
Layer: 1
Color: 6
General Color: BROWN

Wells and Additional Sources Detail Report

Mat1: 28
Most Common Material: SAND
Mat2: 01
Mat2 Desc: FILL
Mat3: 79
Mat3 Desc: PACKED
Formation Top Depth: 0.0
Formation End Depth: 1.5
Formation End Depth UOM: m

Plug ID: 1006636311
Layer: 1
Plug From: 0.0
Plug To: 0.30000001192092896
Plug Depth UOM: m

Plug ID: 1006636312
Layer: 2
Plug From: 0.30000001192092896
Plug To: 5.699999809265137
Plug Depth UOM: m

Method Construction ID: 1006636310
Method Construction Code: 6
Method Construction: Boring
Other Method Construction:

Pipe ID: 1006636300
Casing No: 0
Comment:
Alt Name:

Casing ID: 1006636307
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.10000000149011612
Depth To: 6.0
Casing Diameter: 5.099999904632568
Casing Diameter UOM: cm
Casing Depth UOM: m

Wells and Additional Sources Detail Report

Screen ID: 1006636308
 Layer: 1
 Slot: 10
 Screen Top Depth: 6.0
 Screen End Depth: 7.599999904632568
 Screen Material: 5
 Screen Depth UOM: m
 Screen Diameter UOM: cm
 Screen Diameter: 6.400000095367432

Water ID: 1006636306
 Layer: 1
 Kind Code: 8
 Kind: Untested
 Water Found Depth: 5.699999809265137
 Water Found Depth UOM: m

Hole ID: 1006636305
 Diameter: 21.0
 Depth From: 0.0
 Depth To: 7.599999904632568
 Hole Depth UOM: m
 Hole Diameter UOM: cm

Bore Hole ID:	1006383141	Tag No:	A217853
Depth M:	7.6	Contractor:	6607
Year Completed:	2017	Path:	
Well Completed Dt:	2017/03/29	Latitude:	43.558573059251
Audit No:	Z248219	Longitude:	-79.5864446916209

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
59	SSW	0.24	241.48	79.85	WWIS

Well ID:	7330663	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Not Used	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Abandoned-Other	Date Received:	09-Apr-2019 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	Yes
Audit No:	ODT55IAQ	Contractor:	7147

Wells and Additional Sources Detail Report

Tag:	A223407	Form Version:	9
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:	MW 17-1		

PDF URL (Map):

Well Completed Date:	2019/01/18
Year Completed:	2019
Depth (m):	
Latitude:	43.5535401938583
Longitude:	-79.5872061257248
Path:	

Bore Hole ID:	1007353331	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614116.00
Code OB Desc:		North83:	4823257.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	18-Jan-2019 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Formation ID:	1007353719
Layer:	1
Color:	
General Color:	
Mat1:	

Wells and Additional Sources Detail Report

Most Common Material:

Mat2:

Mat2 Desc:

Mat3:

Mat3 Desc:

Formation Top Depth: 0.0

Formation End Depth:

Formation End Depth UOM: m

Plug ID: 1007354046

Layer: 1

Plug From: 0.0

Plug To: 6.699999809265137

Plug Depth UOM: m

Plug ID: 1007353960

Layer: 1

Plug From: 0.0

Plug To: 2.5

Plug Depth UOM: m

Plug ID: 1007353961

Layer: 2

Plug From: 2.5

Plug To: 6.699999809265137

Plug Depth UOM: m

Pipe ID: 1007353493

Casing No: 0

Comment:

Alt Name:

Casing ID: 1007353810

Layer: 1

Material: 5

Open Hole or Material: PLASTIC

Depth From: 0.0

Depth To: 3.5999999046325684

Casing Diameter: 5.0

Casing Diameter UOM: cm

Casing Depth UOM: m

Wells and Additional Sources Detail Report

Screen ID: 1007353872
 Layer: 1
 Slot:
 Screen Top Depth: 3.5999999046325684
 Screen End Depth: 6.699999809265137
 Screen Material: 5
 Screen Depth UOM: m
 Screen Diameter UOM: cm
 Screen Diameter: 6.300000190734863

Pump Test ID: 1007353494
 Pump Set At:
 Static Level:
 Final Level After Pumping:
 Recommended Pump
 Depth:
 Pumping Rate:
 Flowing Rate:
 Recommended Pump
 Rate:
 Levels UOM: m
 Rate UOM: LPM
 Water State After Test
 Code:
 Water State After Test:
 Pumping Test Method:
 Pumping Duration HR:
 Pumping Duration MIN:
 Flowing:

Bore Hole ID:	1007353331	Tag No:	A223407
Depth M:		Contractor:	7147
Year Completed:	2019	Path:	
Well Completed Dt:	2019/01/18	Latitude:	43.5535401938583
Audit No:	ODT55IAQ	Longitude:	-79.5872061257248

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
60	ENE	0.24	243.20	79.85	WWIS

Well ID:	7161795	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:		Data Entry Status:	Yes
Use 2nd:		Data Src:	
Final Well Status:		Date Received:	14-Apr-2011 00:00:00
Water Type:		Selected Flag:	TRUE

Wells and Additional Sources Detail Report

Casing Material:		Abandonment Rec:	
Audit No:	M08435	Contractor:	6607
Tag:	A100950	Form Version:	5
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliabilty:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/716\7161795.pdf

Well Completed Date: 2011/02/14
 Year Completed: 2011
 Depth (m):
 Latitude: 43.5565753993608
 Longitude: -79.5821828728807
 Path: 716\7161795.pdf

Bore Hole ID:	1003495961	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614516.00
Code OB Desc:		North83:	4823601.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	3
Date Completed:	14-Feb-2011 00:00:00	UTMRC Desc:	margin of error : 10 - 30 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Bore Hole ID:	1003495961	Tag No:	A100950
Depth M:		Contractor:	6607
Year Completed:	2011	Path:	716\7161795.pdf

Wells and Additional Sources Detail Report

Well Completed Dt:	2011/02/14	Latitude:	43.5565753993608
Audit No:	M08435	Longitude:	-79.5821828728807

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
61	NNW	0.24	243.34	80.85	WWIS

Well ID:	7286063	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	08-May-2017 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z248287	Contractor:	6607
Tag:	A217831	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

PDF URL (Map):

Well Completed Date:	2017/04/05
Year Completed:	2017
Depth (m):	15
Latitude:	43.5585504931349
Longitude:	-79.5868042748357
Path:	

Bore Hole ID:	1006429573	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614139.00
Code OB Desc:		North83:	4823814.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	05-Apr-2017 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m

Wells and Additional Sources Detail Report

Remarks:

Location Method:

wwr

Elevrc Desc:

Location Source Date:

Improvement Location

Source:

Improvement Location

Method:

Source Revision

Comment:

Supplier Comment:

Formation ID: 1006658580

Layer: 2

Color: 2

General Color: GREY

Mat1: 06

Most Common Material: SILT

Mat2: 05

Mat2 Desc: CLAY

Mat3: 66

Mat3 Desc: DENSE

Formation Top Depth: 1.600000023841858

Formation End Depth: 6.900000095367432

Formation End Depth

UOM: m

Formation ID: 1006658582

Layer: 4

Color: 2

General Color: GREY

Mat1: 17

Most Common Material: SHALE

Mat2: 15

Mat2 Desc: LIMESTONE

Mat3: 74

Mat3 Desc: LAYERED

Formation Top Depth: 12.0

Formation End Depth: 15.0

Formation End Depth

UOM: m

Formation ID: 1006658581

Layer: 3

Color: 2

General Color: GREY

Mat1: 28

Most Common Material: SAND

Wells and Additional Sources Detail Report

Mat2: 11
Mat2 Desc: GRAVEL
Mat3: 77
Mat3 Desc: LOOSE
Formation Top Depth: 6.900000095367432
Formation End Depth: 12.0
Formation End Depth UOM: m

Formation ID: 1006658579
Layer: 1
Color: 6
General Color: BROWN
Mat1: 28
Most Common Material: SAND
Mat2: 11
Mat2 Desc: GRAVEL
Mat3: 01
Mat3 Desc: FILL
Formation Top Depth: 0.0
Formation End Depth: 1.600000023841858
Formation End Depth UOM: m

Plug ID: 1006658590
Layer: 1
Plug From: 0.0
Plug To: 0.30000001192092896
Plug Depth UOM: m

Plug ID: 1006658591
Layer: 2
Plug From: 0.30000001192092896
Plug To: 11.5
Plug Depth UOM: m

Method Construction ID: 1006658589
Method Construction Code: 6
Method Construction: Boring
Other Method Construction: DIAMOND

Pipe ID: 1006658578
Casing No: 0

Wells and Additional Sources Detail Report

Comment:

Alt Name:

Casing ID: 1006658586
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.10000000149011612
Depth To: 12.0
Casing Diameter: 5.099999904632568
Casing Diameter UOM: cm
Casing Depth UOM: m

Screen ID: 1006658587
Layer: 1
Slot: 10
Screen Top Depth: 12.0
Screen End Depth: 15.0
Screen Material: 5
Screen Depth UOM: m
Screen Diameter UOM: cm
Screen Diameter: 6.400000095367432

Water ID: 1006658585
Layer: 1
Kind Code: 8
Kind: Untested
Water Found Depth: 6.0
Water Found Depth UOM: m

Hole ID: 1006658584
Diameter: 9.600000381469727
Depth From: 12.0
Depth To: 15.0
Hole Depth UOM: m
Hole Diameter UOM: cm

Hole ID: 1006658583
Diameter: 21.0
Depth From: 0.0
Depth To: 12.0
Hole Depth UOM: m

Wells and Additional Sources Detail Report

Hole Diameter UOM: cm

Bore Hole ID:	1006429573	Tag No:	A217831
Depth M:	15	Contractor:	6607
Year Completed:	2017	Path:	
Well Completed Dt:	2017/04/05	Latitude:	43.5585504931349
Audit No:	Z248287	Longitude:	-79.5868042748357

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
62	NNE	0.24	243.46	80.85	WWIS

Well ID:	7308370	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	26-Mar-2018 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z255645	Contractor:	6607
Tag:	A241294	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/730\7308370.pdf

Well Completed Date:	2017/12/20
Year Completed:	2017
Depth (m):	10.9
Latitude:	43.5584372033748
Longitude:	-79.5849249802189
Path:	730\7308370.pdf

Bore Hole ID:	1007008214	Elevation:	
DP2BR:		Elevrc:	

Wells and Additional Sources Detail Report

Spatial Status:	Zone:	17
Code OB:	East83:	614291.00
Code OB Desc:	North83:	4823804.00
Open Hole:	Org CS:	UTM83
Cluster Kind:	UTMRC:	4
Date Completed: 20-Dec-2017 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:	Location Method:	wwr
Elevrc Desc:		
Location Source Date:		
Improvement Location Source:		
Improvement Location Method:		
Source Revision		
Comment:		
Supplier Comment:		

Formation ID:	1007232697
Layer:	3
Color:	2
General Color:	GREY
Mat1:	28
Most Common Material:	SAND
Mat2:	28
Mat2 Desc:	SAND
Mat3:	66
Mat3 Desc:	DENSE
Formation Top Depth:	6.0
Formation End Depth:	10.899999618530273
Formation End Depth UOM:	m

Formation ID:	1007232696
Layer:	2
Color:	6
General Color:	BROWN
Mat1:	06
Most Common Material:	SILT
Mat2:	05
Mat2 Desc:	CLAY
Mat3:	12
Mat3 Desc:	STONES
Formation Top Depth:	1.5
Formation End Depth:	6.0
Formation End Depth UOM:	m

Wells and Additional Sources Detail Report

Formation ID: 1007232695
Layer: 1
Color: 6
General Color: BROWN
Mat1: 28
Most Common Material: SAND
Mat2: 11
Mat2 Desc: GRAVEL
Mat3: 85
Mat3 Desc: SOFT
Formation Top Depth: 0.0
Formation End Depth: 1.5
Formation End Depth UOM: m

Plug ID: 1007232705
Layer: 2
Plug From: 0.30000001192092896
Plug To: 7.0
Plug Depth UOM: m

Plug ID: 1007232704
Layer: 1
Plug From: 0.0
Plug To: 0.30000001192092896
Plug Depth UOM: m

Method Construction ID: 1007232703
Method Construction Code: 6
Method Construction: Boring
Other Method Construction:

Pipe ID: 1007232694
Casing No: 0
Comment:
Alt Name:

Casing ID: 1007232700
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0

Wells and Additional Sources Detail Report

Depth To: 7.900000095367432
 Casing Diameter: 5.099999904632568
 Casing Diameter UOM: cm
 Casing Depth UOM: m

Screen ID: 1007232701
 Layer: 1
 Slot: 10
 Screen Top Depth: 7.900000095367432
 Screen End Depth: 10.899999618530273
 Screen Material: 5
 Screen Depth UOM: m
 Screen Diameter UOM: cm
 Screen Diameter: 6.400000095367432

Water ID: 1007232699
 Layer: 1
 Kind Code: 8
 Kind: Untested
 Water Found Depth: 6.300000190734863
 Water Found Depth UOM: m

Hole ID: 1007232698
 Diameter: 21.0
 Depth From: 0.0
 Depth To: 10.899999618530273
 Hole Depth UOM: m
 Hole Diameter UOM: cm

Bore Hole ID:	1007008214	Tag No:	A241294
Depth M:	10.9	Contractor:	6607
Year Completed:	2017	Path:	730\7308370.pdf
Well Completed Dt:	2017/12/20	Latitude:	43.5584372033748
Audit No:	Z255645	Longitude:	-79.5849249802189

Map Key	Direction	Distance (km)	Distance (m)	Elevation (m)	DB
63	SSW	0.24	244.57	79.85	WWIS

Well ID:	7296325	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:		Data Entry Status:	Yes
Use 2nd:		Data Src:	

Wells and Additional Sources Detail Report

Final Well Status:		Date Received:	03-Oct-2017 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	C38357	Contractor:	7147
Tag:	A223407	Form Version:	8
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

PDF URL (Map):

Well Completed Date:
Year Completed:
Depth (m):
Latitude: 43.5535321101623
Longitude: -79.5872805957956
Path:

Bore Hole ID:	1006747711	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614110.00
Code OB Desc:		North83:	4823256.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision			
Comment:			
Supplier Comment:			

Bore Hole ID:	1006747711	Tag No:	A223407

Wells and Additional Sources Detail Report

Depth M:		Contractor:	7147
Year Completed:		Path:	
Well Completed Dt:		Latitude:	43.5535321101623
Audit No:	C38357	Longitude:	-79.5872805957956

Radon Information

Detailed radon information for the project property is provided below.

Radon Zone Information

ID:	144851	Radon Rank:	MOD

Health Canada Radon Information

Health Region:	3553
Health Region Name:	Peel Regional Health Unit
Province or Territory:	ON
Number Homes in Survey:	89
% Below 200 Bq/m3:	100
% Above 200 Bq/m3:	0
200 to 600 Bq/m3:	0
% Above 600 Bq/m3:	0

Area of Natural and Scientific Interest Information



Area of Natural & Scientific Interest (ANSI)

 ANSI Area



Source: ANSI (ANSI) March 2017, Ontario Ministry of Natural Resources

Area of Natural and Scientific Interest Information

Detailed ANSI information is provided below.

ANSI ID: 1200808662

ANSI Name:	Credit River Coastal Marsh
Type:	ANSI, Life Science
Significance:	Regional
Area (sqm):	624028.915
Comments:	Information not available at insertion stage.

ANSI ID: 1200808658

ANSI Name:	Lorne Park Prairie
Type:	ANSI, Life Science
Significance:	Regional
Area (sqm):	197376.451
Comments:	Information not available at insertion stage.

Federal Sources

Bedrock Geology of Canada

The Geological Map of Canada is scaled at 1:5,000,000. This map is created by Geological Survey of Canada and published by Natural Resources Canada.

BEDROCK GEOLOGY

Health Canada Radon Information

This source is the results from the Cross-Canada Survey of Radon Concentrations in Homes, a two-year study conducted by Health Canada's National Radon Program. The aims of this study were to obtain an estimate of the proportion of the Canadian population living in homes with radon gas levels above the guideline of 200 Bq/m³, to identify previously unknown areas where radon gas exposure may constitute a health risk, and to build, over time, a map of indoor radon gas exposure levels across Canada.

RADON

National Energy Board Wells

The NEBW database contains information on onshore & offshore oil and gas wells that are outside provincial jurisdiction(s) and are thereby regulated by the National Energy Board. Data is provided regarding the operator, well name, well ID No./UWI, status, classification, well depth, spud and release date.

NEBP

Soil Landscapes of Canada (SLC)

Major characteristics of soil and land such as surface form, slope, water table depth, permafrost and lakes.

SLC

Surficial Geology of Canada

This map contains information on surficial materials and associated landforms left by the retreat of the last glaciers and non glacial environments. It is based on compilation of existing maps. This data was authored by the Geological Survey of Canada and published by Natural Resources Canada.

SURFICIAL GEOLOGY

Toporama

Toporama covers the entire area of Canada's landmass and provides topographic, geo-referenced, and symbolic information in a raster format at 1:50,000 scale. This is a digital topographic reference product made available by Natural Resources Canada (NRCan).

TOPORAMA

Provincial Sources

Area of Natural and Scientific Interest

Areas of Natural and Scientific Interest (ANSIs) are lands and waters with features that are important for natural heritage protection, appreciation, scientific study or education. This dataset is made available by Ontario Ministry of Natural Resources.

ANSI

Bedrock Geology of Ontario

The Bedrock Geology layer shows the distribution of bedrock units underlying Ontario at a 1:250,000 scale. The geology of the province consists of Precambrian rocks of the Canadian Shield and Phanerozoic sedimentary rocks that overlie the Canadian Shield. This layer was compiled by the Precambrian Geoscience Section of Ontario Geological Survey.

BEDROCK GEOLOGY

Ontario Detailed Soil Survey (DSS3)

Soil surveys have been published for most of the agricultural areas, and many surrounding areas, across Canada. Data from these surveys comprise the most detailed soil inventory information in the National Soil DataBase. Data is made available by Agriculture and Agri-Food Canada

SOIL SURVEY

Ontario Oil and Gas Wells

In 1998, the MNR handed over to the Ontario Oil, Gas and Salt Resources Corporation, the responsibility of maintaining a database of oil and gas wells drilled in Ontario. The OGSR Library has over 20,000+ wells in their database. Information available for all wells in the ERIS database include well owner/operator, location, permit issue date, and well cap date, license No., status, depth and the primary target (rock unit) of the well being drilled. All geology/stratigraphy table information, plus all water table information is also provide for each well record.

OOGW

Provincial Groundwater Monitoring Network

GROUNDWATER

Appendix

Groundwater level and chemistry data from monitoring wells that are part of the Provincial Groundwater Monitoring Network (PGMN) Program. Precipitation data (rain) is also available for some sites. This data is provided by 'Ontario Ministry of Environment and Climate Change.

Surficial Geology of Ontario

SURFICIAL GEOLOGY

The Surficial Geology dataset contains a layer depicting the distribution and characteristics of surficial deposits across southern Ontario. This data set is authored by the Ontario Geological Survey.

Topographic Map of Ontario

TOPOGRAPHIC MAP

The Ontario Basic Mapping program provides a relationship between topographic information and the provincial geographical referencing grid, thereby forming the foundation for a comprehensive provincial geographical referencing system. This data is made available by the Ontario Ministry of Natural Resources and Forestry. This is ERIS self-designed topographic map template at 1:10,000.

Water Well Information System

WWIS

This database describes locations and characteristics of water wells found within Ontario in accordance with Regulation 903. It includes such information as coordinates, construction date, well depth, primary and secondary use, pump rate, static water level, well status, etc. Also included are detailed stratigraphy information, approximate depth to bedrock and the approximate depth to the water table.

Wetlands of Ontario

WETLAND

The Ministry of Natural Resources and Forestry has made available a database of wetlands in Ontario. Certain attributes identify wetlands that have been evaluated with the Ontario Wetland Evaluation System (OWES), and of those which ones have been designated as Provincially Significant Wetlands (PSW).

Private Sources

Oil and Gas Wells

OGWE

The Nickle's Energy Group (publisher of the Daily Oil Bulletin) collects information on drilling activity including operator and well statistics. The well information database includes name, location, class, status and depth. The main Nickle's database is updated on a daily basis, however, this database is updated on a monthly basis. More information is available at www.nickles.com.

Radon Zone Information

RADON

The Radon Potential Map is developed by Radon Environmental Management Corporation. Its objective was to illustrate the relative variation of radon risk across the country, and in 2011 it published its first geologic Radon Potential Map of Canada.

Liability Notice

Reliance on information in Report: The Physical Setting Report (PSR) DOES NOT replace a full Phase I Environmental Site Assessment but is solely intended to be used as a review of environmental databases and physical characteristics for the site or adjacent properties.


License for use of information in Report: No page of this report can be used without this cover page, this notice and the project property identifier. The information in Report(s) may not be modified or re-sold.

Your Liability for misuse: Using this Service and/or its reports in a manner contrary to this Notice or your agreement will be in breach of copyright and contract and ERIS may obtain damages for such mis-use, including damages caused to third parties, and gives ERIS the right to terminate your account, rescind your license to any previous reports and to bar you from future use of the Service.

No warranty of Accuracy or Liability for ERIS: The information contained in this report has been produced by ERIS Information Limited Partnership ("ERIS") using various sources of information, including information provided by Federal and State government departments. The report applies only to the address and up to the date specified on the cover of this report, and any alterations or deviation from this description will require a new report. This report and the data contained herein does not purport to be and does not constitute a guarantee of the accuracy of the information contained herein and does not constitute a legal opinion nor medical advice. Although ERIS has endeavored to present you with information that is accurate, ERIS Information Limited Partnership disclaims, any and all liability for any errors, omissions, or inaccuracies in such information and data, whether attributable to inadvertence, negligence or otherwise, and for any consequences arising therefrom. Liability on the part of ERIS is limited to the monetary value paid for this report.

Trademark and Copyright: You may not use the ERIS trademarks or attribute any work to ERIS other than as outlined above. This Service and Report(s) are protected by copyright owned by ERIS Information Limited Partnership. Copyright in data used in the Service or Report(s) (the "Data") is owned by ERIS or its licensors. The Service, Report(s) and Data may not be copied or reproduced in whole or in any substantial part without prior written consent of ERIS.

79°36'W 79°35'30"W 79°35'W 79°34'30"W 79°34'W 79°33'30"W

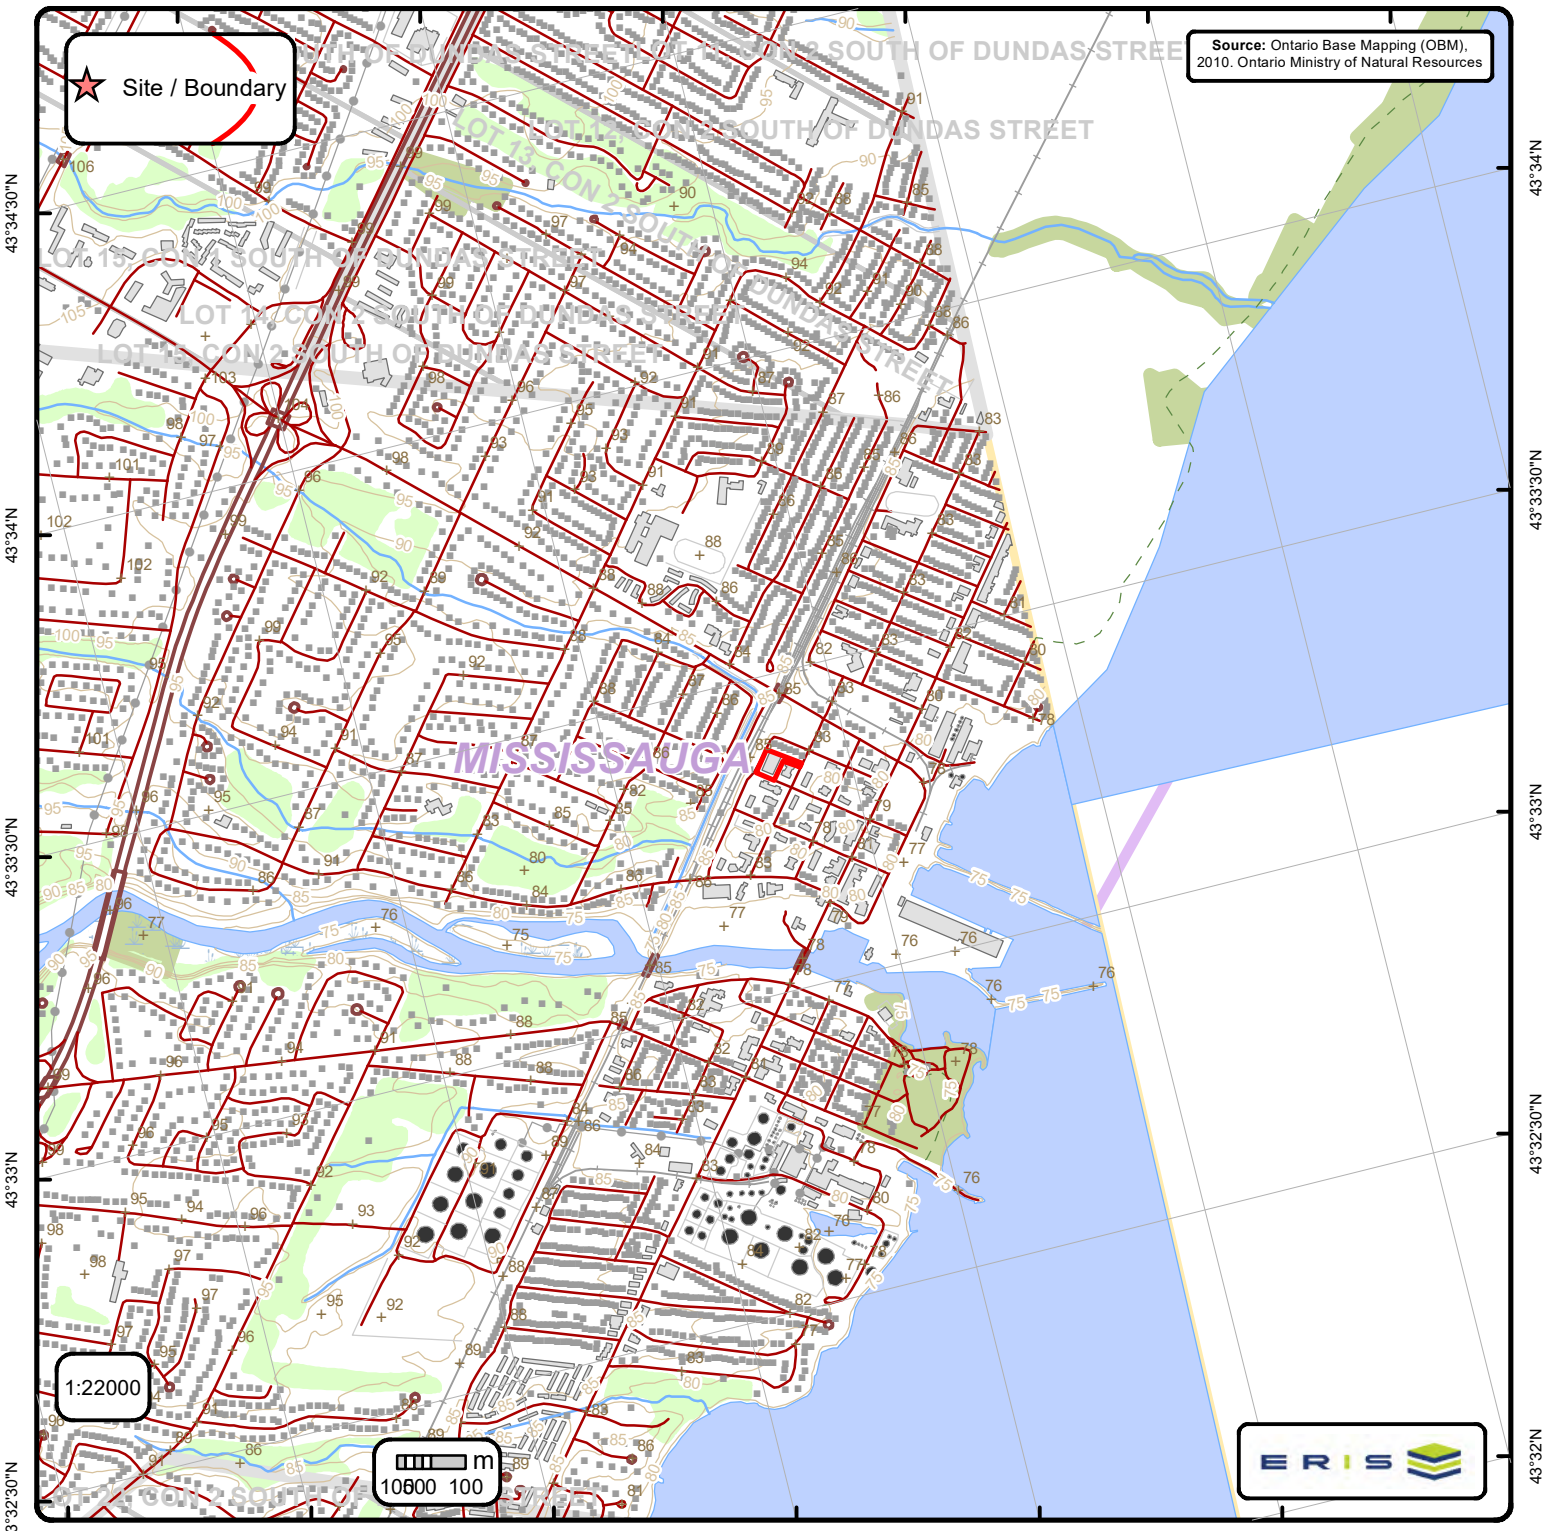

Ontario Base Mapping (OBM) Data Order No. 22091501030

Spot Height (metre)	Transportation Structure	Contour Line	Wooded Area
Building Point	Utility Line	Pit or Quarry	Conservation Authority
Towers	Water Structure	Waterbody	Conservation Area
Utility Site Point	Drainage Line Feature	Wetlands	Municipal Park
Misc. Line	River or Stream	Concession	Provincial Park
Railroads	Airports	Lots	National Park
Roads	Tanks	Municipality	Nature Reserve
Trail	Building to Scale	Land Ownership	