



**REPORT ON
PHASE ONE ENVIRONMENTAL SITE ASSESSMENT
50 HIGH STREET EAST
MISSISSAUGA, ONTARIO**

**REPORT NO.: 6857-25-EA
REPORT DATE: NOVEMBER 14, 2025**

**PREPARED FOR
1001107627 ONTARIO INC.**

**110 KONRAD CRESCENT, UNIT 16, MARKHAM, ONTARIO L3R 9X2
TEL.: 905-940-8509 FAX: 905-940-8192**

Table of Contents

1.0	Executive Summary	1
2.0	Introduction	2
2.1.	Objective	2
2.2.	RSC Property Information.....	2
3.0	Scope of Investigation.....	4
3.1.	Scope of Work	4
3.2.	Methodology and Limitations	4
4.0	Records Review	5
4.1.	General	5
4.1.1.	Phase One Study Area Determination	5
4.1.2.	First Developed Use Determination	5
4.1.3.	Fire Insurance Plans.....	5
4.1.4.	Chain of Title.....	5
4.1.5.	City Directory	5
4.1.6.	Environmental Reports and Other Reports	6
4.2.	Environmental Source Information	6
4.2.1.	Ministry of the Environment, Conservation and Parks (MECP) Inventory Records	6
4.2.2.	Environmental Risk Information Service (ERIS)	6
4.2.3.	Government and Regulatory Agency Records.....	7
4.3.	Physical Setting Sources	8
4.3.1.	Aerial Photographs	8
4.3.2.	Topography, Hydrology, and Geology	8
4.3.3.	Fill Materials.....	9
4.3.4.	Water Bodies, Areas of Natural Significance & Ground Water Information	9
4.3.5.	Well Records	9
4.4.	Site Operating Records	9
5.0	Interviews	10
6.0	Site Reconnaissance	11
6.1.	General Requirements.....	11
6.2.	Specific Observations at RSC Property	11
6.2.1.	General Site Layout and Operations	11
6.2.2.	Utilities Services	12
6.2.3.	Potable Water Supply	12
6.2.4.	Wells	12
6.2.5.	Waste Generation and Management	12

6.2.6.	Materials Handling and Storage	13
6.2.7.	Storage Tanks.....	13
6.2.8.	Odours and Air Emissions	13
6.2.9.	Spills, Stains and Stained Materials	13
6.2.10.	Below-ground Structures	13
6.2.11.	Interior Observations	14
6.2.12.	Exterior Observations	14
6.2.13.	Potentially Contaminating Activity Observed on RSC Property	15
6.2.14.	Special Attention Items	15
6.3.	Adjacent and Neighbouring Properties Observations	16
6.3.1.	Potentially Contaminating Activity Observed in Study Area	17
6.3.2.	Enhanced Investigation Property	17
6.4.	Written Description of Investigation	17
7.0	Review and Evaluation of Information	18
7.1.	Current and Past Uses	18
7.2.	Potentially Contaminating Activities.....	18
7.3.	Areas of Potential Environmental Concern	19
7.4.	Uncertainty or Absence of Information	19
7.5.	Exemptions	19
8.0	Conclusions.....	20
9.0	References	21
10.0	General Statement of Limitation	23

TABLES (included in the report text)

Table 2.2-1:	Summary of RSC Property information
Table 4.2.2-1:	Summary of Potential Environmental Concerns Identified from ERIS Report
Table 4.3.1-1:	Summary of Review of Aerial Photographs
Table 6.1-1:	Site Reconnaissance General Notes
Table 6.3-1:	Observations of Areas Adjacent to RSC Property
Table 6.3-2:	Observations of Neighbouring Properties
Table 7.1-1:	Current and Past Uses of the RSC Property (not applicable)
Table 7.2-1:	Potentially Contaminating Activities Within the Phase One Study Area

APPENDICES

Appendix A	Figure 1: Regional Topography and Site Location
	Figure 2: Phase One Conceptual Site Model – PCA Locations and Land Usage
	Figure 3: Phase One Conceptual Site Model – APEC Locations
Appendix B	ERIS Report
Appendix C	Freedom of Information
Appendix D	TSSA Correspondence
Appendix E	Aerial Photographs
Appendix F	Site Visit Photographs

1.0 EXECUTIVE SUMMARY

Toronto Inspection Ltd. was authorized by 1001107627 Ontario Inc. to conduct a Phase One Environmental Site Assessment (Phase One ESA) for a property located at 50 High Street East in Mississauga, Ontario (hereinafter referred to as the 'Site' or the 'RSC Property'). For the purpose of this report, High Street East is assumed to orient in an east-west direction. The Phase One ESA was conducted in general accordance with Ontario Regulation 153/04, Records of Site Condition – Part XV.1 of the Environmental Protection Act, (O. Reg. 153/04 as amended). It is understood that this Phase One ESA was conducted for due diligence purposes in support of a Site Plan Approval.

The objective of the Phase One ESA was to determine if there is evidence of actual or potential contamination as a result of the current and/or historical activities on-site or the surrounding properties that could result an adverse environmental impact on the RSC Property.

The RSC Property consists of a rectangular shaped area located on the north side of High Street East, approximately 45m west of Elizabeth Street North in Mississauga, Ontario. The total area of the RSC Property is approximately 0.1022 hectares. The RSC Property was considered to have been first developed with a two-storey residential building with a partial basement circa 1960 (the "Subject Building") and has remained unchanged to the present day.

Based on the topographic map, Natural Resources of Canada – The Atlas of Canada – Toporama, local groundwater flow direction is inferred to be in a southeasterly direction towards Lake Ontario, located approximately 350m southeast of the RSC Property.

As indicated on the topographic map, the average elevation of the RSC Property is 80m above mean sea level. The mapped contours for the RSC Property and surrounding areas indicate a downward slope in a southeasterly direction towards Lake Ontario. Surface drainage is expected to infiltrate into the landscaped areas or into the catch basins along High Street East.

The surficial geology consisted of modern alluvial deposits derived from clay, silt, sand, gravel, may contain organic remains. The bedrock geology identified within the RSC Property and Study Area consisted of shale, limestone, dolostone, siltstone, of Georgian Bay Formation, Blue Mountain Formation, Billings Formation, Collingwood Member, and Eastview Member. The top of the bedrock at the RSC Property is estimated to be encountered at a depth of 73 masl (ORMGP, 2018).

In summary, the historical and current activities occurring both on-site and off-site, as identified at the time of this Phase One ESA, do not represent a significant potential environmental concern which may adversely impact the subsurface conditions of the RSC Property. It is *Toronto Inspection Ltd.*'s opinion that a Phase Two ESA is not required, based on a review of the available documents and information at the time of writing the Phase One ESA report.

2.0 INTRODUCTION

Toronto Inspection Ltd. was authorized by 1001107627 Ontario Inc. to conduct a Phase One Environmental Site Assessment (Phase One ESA) for a property located at 50 High Street East in Mississauga, Ontario (hereinafter referred to as the 'Site' or the 'RSC Property'). For the purpose of this report, High Street East is assumed to orient in an east-west direction. The Phase One ESA was conducted in general accordance with Ontario Regulation 153/04, Records of Site Condition – Part XV.1 of the Environmental Protection Act, (O. Reg. 153/04 as amended). It is understood that this Phase One ESA was conducted for due diligence purposes in support of a Site Plan Approval.

2.1. Objective

The Phase One ESA was conducted to determine if there is evidence of actual or potential contamination at the Site and if the activities of surrounding properties pose an environmental concern to the Site, for the purpose of satisfying the Phase One ESA general objectives as listed in O.Reg. 153/04 as amended:

- To develop a preliminary determination of the likelihood that one or more contaminants have affected any land or water on, in or under the RSC Property.
- To determine the need for a Phase Two ESA.
- To provide a basis for carrying out any Phase Two ESA if required.
- To provide adequate preliminary information about environmental conditions in the land or water on, in or under the RSC Property for the conduct of a risk assessment following completion of a Phase Two Environmental Site Assessment.

2.2. RSC Property Information

Site Description: The RSC Property consists of a rectangular shaped area located on the north side of High Street East, approximately 45m west of Elizabeth Street North in Mississauga, Ontario. The RSC Property is described as follows:

Table 2.2-1: Summary of RSC Property information

General Information	Description
Addresses	50 High Street East, Mississauga, Ontario
Property Identification Number (PIN)	Ownership and Legal Description to be Provided by Lawyer if RSC is required.
Legal Description	
Current Ownership	
Current land use	Residential
Current zoning	Residential
Proposed land use	Residential
Property coordinates (UTM)	Zone 17, 614,275 m E, 4,823,352 m N
Approximate area of Site	0.1022 hectares

The layout of the RSC Property is shown on Image 1, below.



RSC Property located at 50 High Street East, Mississauga, Ontario
Source: City of Mississauga Interactive Map (2024)

Site Contact Information: Mr. Tim Neeb, the client, provided authorization for *Toronto Inspection Ltd.* to conduct this Phase One ESA. The client's contact information is provided below:

Contact: Tim Neeb
Tel: 416-561-0555
Email: tim@mahoganymanagement.com

3.0 SCOPE OF INVESTIGATION

3.1. Scope of Work

The scope of work of this Phase One ESA consisted of:

- A review of reasonably accessible records pertaining to the current and/or past uses of the Site and properties within the Phase One Study Area.
- An inspection of the Site and accessible areas surrounding the Site to identify evidence of potential environmental concerns at the Site and within the Phase One Study Area.
- Interview(s) with person(s) having knowledge of on-site activities and operations.
- Preparation of this report to document the findings of the Phase One ESA report.

3.2. Methodology and Limitations

Methodology

This Phase One ESA was conducted in general accordance with O.Reg. 153/04 as amended.

Based on the general land use, topographical and hydrogeological conditions of the Site and surrounding areas, a search distance of 250m from the Site was determined to be sufficient as the Phase One Study Area. For details refer to Section 4.1.1. *Phase One Study Area Determination*.

Information from various sources were searched and reviewed as part of the Phase One ESA work program. The source information was searched in general accordance with Schedule D of O. Reg. 153/04 as amended. A detail list of records reviewed is included in Section 9 – References. Copies of select source documents are included in the Appendices as references.

The Site is not defined as an Enhanced Investigation Property. Therefore, site operating records that are applicable or specific for an industrial property, a commercial garage, a bulk liquid dispensing facility, or a dry-cleaning equipment operator were not included in this Phase One ESA.

The Phase One ESA site visit was conducted by Mr. Albert Lee-Wah, BES, of *Toronto Inspection Ltd.* on February 7, 2025. The site visit included a walkthrough of the Site in all accessible areas to document site observations and photograph details pertinent to the Phase One ESA requirements.

Limiting Conditions of Phase One ESA

All accessible areas of the Site were inspected for evidence of potential environmental concern with the exception of the roof. The inspection of the adjacent properties was conducted from vantage points at the Site and other publicly accessible areas.

4.0 RECORDS REVIEW

A records search was conducted to determine if area(s) of actual and potential environmental concern exist on the Site and within the Phase One Study Area. Details of the findings are provided in the following sections.

4.1. General

4.1.1. Phase One Study Area Determination

As indicated from the records review, there were no large historical or recent industrial facilities within 1 km of the RSC Property, which include: active or closed waste disposal sites, historical coal gasification plant waste sites, or historical industrial sites which produced or used coal tar and related tars. In addition, the RSC Property was located in an area consisting mainly of residential land usage.

Based on the general land usage indicated above, as well as the topographical and hydrogeological conditions of the RSC Property and surrounding areas, the Phase One ESA Study Area was established to comprise the RSC Property as well as properties located, in whole or in part, within 250m of the RSC Property boundaries. The Regional Topography and the Site Location are shown on Figure 1, Appendix A.

4.1.2. First Developed Use Determination

The RSC Property was considered to have been first developed circa 1960 for residential purposes.

4.1.3. Fire Insurance Plans

A search for Fire Insurance Plans (FIPs) for the RSC Property and Study Area was conducted at Toronto Reference Library. However, no FIPs were available for review for the RSC Property or for the Study Area.

4.1.4. Chain of Title

A chronological chain of title for the RSC Property was not provided to Toronto Inspection Ltd. for review. This is considered unlikely to significantly affect this investigation given that information from other source documents satisfies the objective of the records review. In case of filing a Record of Site Condition, it is mandatory that a chain of title be obtained.

4.1.5. City Directory

Volumes of the Halton Peel Regions ON. Criss-Cross Directory, Might's Suburban Metro Toronto Criss-Cross Directory and Metro Satellite Cities Directory for the years 1969 to 2001, were available for review at the Toronto Reference Library. A review of the city directory listings indicated predominant residential and commercial land usage within the Phase I Study Area during the years searched. Based on the city directory records, no listings for the RSC Property and adjacent/neighbouring listings which represent a source of potential environmental concern for the RSC Property were identified.

4.1.6. Environmental Reports and Other Reports

No environmental reports or other reports were provided to *Toronto Inspection Ltd.* for review.

4.2. Environmental Source Information

4.2.1. Ministry of the Environment, Conservation and Parks (MECP) Inventory Records

The following documents were reviewed:

- MOE (now the MECP) Inventory of Coal Gasification Plant Waste Sites in Ontario, April 1987.
- MOE Inventory of Industrial Sites Producing or Using Coal Tar and Related Tars in Ontario, November 1998.
- MOE Waste Disposal Site Inventory, June 1991.
- MOE Inventory of PCB Storage Sites, January 1992.

A review of the above-listed documents indicated that no active or closed waste disposal sites, historical coal gasification plant waste sites, or historical industrial sites which produced or used coal tar and related tars, were located within 1km of the Site.

4.2.2. Environmental Risk Information Service (ERIS)

Toronto Inspection Ltd. ordered a report from ERIS Ltd. for the RSC Property and Phase One Study Area. The ERIS Report includes the search results of federal, provincial, and private source databases that are listed in paragraph 7 of subsection 3 (2) in Schedule D of O. Reg. 153/04 as amended. Based on a review of the ERIS report, the following records which represent a potential environmental concern that have potential to contribute to an area of potential environmental concern (APEC) are summarized below:

Table 4.2.2-1: Summary of Potential Environmental Concerns Identified in ERIS Report

Address / Orientation	Listing Information
110 Lakeshore Road East <u>Approximately 77m southeast of the Site</u>	- The property was previously occupied by Photoline Labs Ltd., a photography studio, and was listed as a registered waste generator of photoprocessing wastes for the years 1992 to 2001.
114 Lakeshore Road East <u>Approximately 87m southwest of the Site</u>	- The property was previously occupied by Conshore Motors Ltd., an auto repair shop, with three gasoline underground storage tanks (USTs) with capacities of 36,300L, 36,700L and 27,250L installed in 1989. - The property was previously occupied by V V Gas and Wash, a gas station and car wash, with USTs with a total capacity of 12,7800L. - Petro Canada Inc., a gas station, was listed as a registered waste generator of petroleum distillates for the years 1986 to 1998.
80 High Street East <u>Approximately 34m northwest of the Site</u>	- The property has been occupied by Bell Canada, a telecommunications company, with a fuel oil tank with a capacity of 5,000L installed in 2014. - Bell Canada was listed as a registered waste generator of various wastes including, PCBs, oil skimmings & sludges and light fuels for the years 2014 to 2022.
103 Lakeshore Road East <u>Approximately 150m south of the Site</u>	- The property was previously occupied by Seaway Cleaners, a dry cleaner, and was listed as a registered waste generator of halogenated solvents for the years 1986 to 2000.

Address / Orientation	Listing Information
111 Lakeshore Road East <u>Approximately 151m south of the Site</u>	- The property was previously occupied by Seaway Cleaners, a dry cleaner, and was listed as a registered waste generator of halogenated solvents for the years 1999 to 2001. - The property was previously occupied by Rosalnaaz Investments Inc., a dry cleaner, and was listed as a registered waste generator of halogenated solvents for the years 2002 to 2005. - The property was previously occupied by 2088466 Ontario Limited, a dry cleaner, and was listed as a registered waste generator of various wastes including oil skimmings & sludges, petroleum distillates and halogenated solvents for the years 2006 to 2018.

According to ERIS report, a number of listings were defined as “unplottable”. Those records could not be mapped due to various reasons, such as limited geographic information, and may or may not have been present within the search radius and were inserted in the ERIS report for reference purposes only. Unless there was information within a specific listing that could be used to infer its location, the “unplottable” listings were not considered to be relevant to the RSC Property due to uncertainty.

A copy of the ERIS report is included as Appendix B.

4.2.3. Government and Regulatory Agency Records

MECP FOI

A request was submitted on February 7, 2025, to the MECP Freedom of Information (FOI) and Privacy Office by *Toronto Inspection Ltd.* for records pertaining to the RSC Property. A response from the MECP was received on June 17, 2025, informing that no records were located responsive to the request. Both the FOI request and MECP response letter are in Appendix C.

TSSA

Technical Standards & Safety Authority (TSSA) was contacted and requested to check their records for any fuel storage tanks that may have been present at the RSC Property and the adjacent properties. An email correspondence (attached in Appendix D) from a TSSA representative, has identified no fuel storage tanks records for the RSC Property or for neighboring properties adjacent to the Site.

MNRF

Based on information provided on the Ministry of Natural Resources and Forestry (MNRF) on-line application “Make A Map: Natural Heritage Areas”, the RSC Property is not located within or adjacent to an area of natural and scientific interest (ANSI), a provincially significant wetland or a woodland area.

CITY OF MISSISSAUGA

According to the City of Mississauga Zoning By-law, the RSC Property is within a zoning area defined as Residential (RA1-6), and the remaining areas are composed mainly residential and commercial zones. The land use within the Study Area is shown on Figure No.2, Appendix A.

4.3. Physical Setting Sources

4.3.1. Aerial Photographs

Aerial photographs from 1954 to 2024 were available on the City of Mississauga Interactive Map and City of Toronto Archives. The available aerial photographs were reviewed to provide a chronological timeline of developmental changes at the RSC Property and within the Study Area. The aerial photographs are enclosed in Appendix E.

Table 4.3.1-1 Summary of Review of Aerial Photographs

Year	Notable Changes or Environmental Issues
1954	- The RSC Property appeared to be an undeveloped parcel of land. - The Study Area appeared to be developed with residential dwellings and commercial buildings along Lawrence Avenue East to the southeast. High Street East and Elizabeth Street North were already developed.
1960	- The RSC Property appeared to be developed with a residential apartment building on the southeast portion of the Site, similar to the currently existing building. - No significant changes were observed for the Study Area.
1966, 1975, 1980, 1989, 2000	- No significant changes were observed for the RSC Property. - New residential apartment buildings were developing in the surrounding properties of the RSC Property.
2009	- No significant changes were observed for the RSC Property. - New commercial buildings were developing farther southeast of the RSC Property. No other significant changes were observed for the Study Area.
2017, 2024	- No significant changes were observed for the RSC Property or the Study Area.

4.3.2. Topography, Hydrology, and Geology

Topography and Regional Drainage

Based on the topographic map, Natural Resources of Canada – The Atlas of Canada – Toporama, local groundwater flow direction is inferred to be in a southeasterly direction towards the Lake Ontario, located approximately 350m southeast of the RSC Property.

As indicated on the topographic map, the average elevation of the RSC Property is 80m above mean sea level. The mapped contours for the RSC Property and surrounding areas indicate a downward slope in a southeasterly direction towards Lake Ontario. Surface drainage is expected to infiltrate into the landscaped areas or into the catch basins along High Street East. It should be noted that local groundwater flow direction can only be determined through on-going monitoring of groundwater levels, and that groundwater flow at the Site may be influenced by underground utility corridors or structures.

Physiography and Geology of the Phase One Study Area

According to the Ontario Geophysical Survey “OGS Earth” application, the Phase One Study Area is situated within the physiographic region of Iroquois Plain, which generally consisted of Sand Plains. The surficial geology consisted of modern alluvial deposits derived from clay, silt, sand, gravel, may contain organic remains. The bedrock geology within the Site consists of shale, limestone, dolostone, siltstone of the Georgian Bay Formation; Blue Mountain Formation; Billings Formation; Collingwood member; and Eastview Member. The top of the bedrock at the RSC Property is estimated to be encountered at a depth of 73 masl (ORMGP, 2018).

4.3.3. Fill Materials

Based on the historical aerial photographs, topographic maps and site reconnaissance, no evidence of importation of fill material into the RSC Property was identified. However, it is possible that some fill material may have been imported to the RSC Property at the time of development.

4.3.4. Water Bodies, Areas of Natural Significance & Ground Water Information

The RSC Property is located within the Credit River Watershed, and the Credit River is located approximately 400m west of the RSC Property.

Based on information provided on the Ministry of Natural Resources and Forestry (MNRF) on-line application “Make A Map: Natural Heritage Areas”, the RSC Property is not located within or adjacent to an area of natural and scientific interest (ANSI), a woodland area or within a provincially significant wetland.

Based on the Source Protection Information Atlas mapping website, the RSC Property is not located within a wellhead protection area, an intake protection zone, or a significant groundwater recharge area; or a highly vulnerable aquifer.

4.3.5. Well Records

Based on a search of the Water Well Information System by ERIS, there was no wells identified on the RSC Property and 63 wells identified within the Study Area. The wells were mainly described as monitoring and test holes and observation wells. The stratigraphy of the wells generally consisted of till, silt and clay. Based on the purpose of installation and the orientation of the wells to the property, the wells within the Study Area do not pose a potential environmental concern for the RSC Property.

4.4. Site Operating Records

The Site is not defined as an Enhanced Investigation Property. Therefore, Site Operating Records that are applicable or specific for an industrial property, a commercial garage, a bulk liquid dispensing facility, or a dry-cleaning equipment operator were not included in this Phase One ESA.

5.0 INTERVIEWS

During the site reconnaissance on February 7, 2025, an in-person interview was conducted with Ms. Jane Seale, the property manager. A questionnaire interview was also completed by Ms. Jane Seale, the property manager, on February 12, 2025. Relevant information concerning the Site obtained from the interviews were included into this Phase One ESA report.

6.0 SITE RECONNAISSANCE

6.1. General Requirements

The RSC Property and neighbouring properties were visited on February 7, 2025, by Mr. Albert Lee-Wah, BES, of *Toronto Inspection Ltd.* General information pertaining to the site visit is present as follows:

Table 6.1-1 : Site Reconnaissance General Notes

Date, Time, and Length of Time of Investigation	Weather Conditions	Is Facility in Operation at Time of Investigation (applicable to Enhanced Investigation Property)	Names and Qualifications of Persons Conducting the Investigation
February 7, 2025 11:00am – 11:30 am	Sunny Temperature: -5°C	Not applicable	Albert Lee-Wah, BES

Photographs taken during the site visits are included in Appendix F.

6.2. Specific Observations at RSC Property

6.2.1. General Site Layout and Operations

Topographic, Geologic, and Hydrogeologic Conditions

At the time of the site reconnaissance, an asphalt paved driveway was observed on the east portion of the Site leading to a parking lot on the north portion of the RSC Property and a concrete paved sidewalk was observed on the south portion of the RSC Property. The remaining areas of the property were covered with vegetation, i.e., grass. The RSC Property was observed to have a relatively flat terrain in relation to the adjacent and neighbouring properties with a gentle slope towards the south. Surface drainage is anticipated to follow towards catch basins located along High Street East and precipitation from runoff is expected to partially infiltrate into the ground.

The topographic features and surface gradient are expected to influence shallow groundwater flow at the RSC Property and within adjacent/neighbouring lands. In addition, groundwater flow at the RSC Property may be influenced by underground utility corridors or structures.

General Description of Structures

At the time of the site reconnaissance, the RSC property was occupied by a two-storey residential building with partial basement (the “Subject Building”). The Subject Building was inferred to have been constructed circa 1960 with partial brick veneer walls and a flat roof. The main entrance to the Subject Building was observed on the south elevation. The RSC Property was bounded by retaining walls on the north and east boundaries of the RSC Property.

Property Use

Residential.

Products Manufactured

Not applicable.

Vehicle and Equipment Maintenance Areas

Not applicable.

6.2.2. Utilities Services

Standard residential connections present existing east side of building.

6.2.3. Potable Water Supply

Drinking water supply was municipally provided by the City of Mississauga.

6.2.4. Wells***Water Wells***

None observed.

Monitoring or Observation Wells

None observed.

6.2.5. Waste Generation and Management***Solid and Liquid Waste Management***

Not applicable.

Sewage Disposal

Municipal.

Wastewater

Not applicable.

Liquid Discharge Points

Not applicable.

By-Products and Wastes

Not applicable.

6.2.6. Materials Handling and Storage

Hazardous Materials

Not applicable.

Unidentified Substances

Not applicable.

Raw Materials Handling and Storage

Not applicable.

Storage Containers

Not applicable.

6.2.7. Storage Tanks

Aboveground Storage Tanks (ASTs)

None identified.

Underground Storage Tanks (USTs)

No vents or pipes indicating the presence of a UST were found in visible areas of the RSC Property during the site reconnaissance. It should be noted that the presence of USTs cannot be confirmed or refuted based on visual inspections or review of historical documents available to *Toronto Inspection Ltd.* at the time of this Phase One ESA.

6.2.8. Odours and Air Emissions

None identified.

6.2.9. Spills, Stains and Stained Materials

No evidence of spills, staining or stained material was observed in the visible areas of the RSC Property during the site reconnaissance.

6.2.10. Below-ground Structures

Oil and Water Separators

Not applicable.

6.2.11. Interior Observations

At the time of the site reconnaissance, the Subject Building consisted of a two-storey residential building with a finished semi-basement. The Subject Building contained eleven (11) apartment units (3 units on the lower level, 4 units on the first floor and 4 units on the second floor). The apartment units generally comprised of a bedroom, bathroom, kitchen and living room. The interior finishes of the apartment units generally consisted of painted drywall walls, plaster ceilings and hardwood flooring with partial tile flooring within the kitchen and bathroom areas. A laundry room and a mechanical room were observed on the northeast corner within the semi-basement.

Stairwells were observed on the north and south elevations of the Subject Building to access all the floors. The interior finishes of the common areas within Subject Building generally consisted of painted drywall walls and ceilings and carpet flooring. The interior of the Subject Building was generally illuminated by incandescent and LED lighting.

6.2.12. Exterior Observations

Pits and Lagoons

Not applicable.

Stressed Vegetation

None identified.

Fill and Debris

No fill material or debris piles were observed on the RSC Property at the time of the site reconnaissance. Fill material may have been imported to the RSC Property at the time of development.

Watercourses, Ditches, or Standing Water

No watercourses, ditches or standing water were observed on the RSC Property at the time of the site reconnaissance.

Roads, Parking Facilities, and Rights-of-Way

The RSC Property was accessible via High Street East, adjacent to the south. Parking areas were available on the north portion of the property.

Railway Lines or Spurs

At the time of the site reconnaissance, no evidence of current or former railway lines or spurs was identified on the RSC Property.

6.2.13. Potentially Contaminating Activity Observed on RSC Property

No potentially contaminating activities associated with the current and/or historical use of the Site were identified during the site visit.

6.2.14. Special Attention Items

Polychlorinated Biphenyls (PCBs)

Polychlorinated Biphenyls were first commercially used as an insulating/cooling fluid in 1929 in North America. In general, PCBs are found in transformers, light ballasts, and other electrical equipment that contain insulating fluids that were manufactured between 1929 and 1977. The use of PCBs in electrical equipment was banned in 1997.

Given the age of development, circa 1960, PCB-containing ballasts may be present within the Subject Building.

Asbestos-Containing Materials (ACMs)

Asbestos had been used in building construction as fire retardant and insulation materials. Although the use of asbestos in building material was halted in the late-1970s, asbestos can still be found in a variety of construction materials such as: pipe and pipe elbow insulation; vinyl floor tiles; suspended ceiling tiles; insulation around boilers; stucco ceiling materials; drywall compound.

Given the age of development, circa 1960, ACMs may be present within the Subject Building.

Lead

Old paints are known to contain lead, which is defined as one of the Designated Substances under the Ontario Occupational Health and Safety Act – Section 30. Lead was used in oil-based paints as a drying agent and pigmentation. The use of lead-based paints was phased out in 1976. The potential for exposure to lead-based paints and the dust associated with the deterioration or removal of lead-based paint can pose a health risk to humans, especially to children.

Given the age of development, circa 1960, lead-based paints or lead-containing construction materials may be present within the Subject Building.

Given the age of development of the RSC Property, there may be designated substances on the RSC Property. Therefore, a designated substance survey is recommended prior to commencement of renovation and/or demolition work of the on-Site buildings. If the on-Site buildings are not to be renovated and/or demolished, an asbestos survey is required according to Ontario Regulation 278/05.

Ozone-Depleting Materials (ODM)

Refrigerators and a rooftop unit were present within the Subject Building. These units may contain ozone depleting substances and must be serviced by licensed technicians.

Urea Foam Formaldehyde Insulation (UFFI)

No evidence of UFFI was observed on the RSC Property at the time of the site reconnaissance.

Noise and Vibration

Excessive noise or vibration was not anticipated at the RSC Property.

6.3. Adjacent and Neighbouring Properties Observations

Occupants and/or land usage of the adjacent and neighbouring properties at the time of the site reconnaissance include the following:

Adjacent Properties

The adjacent property uses (excluding municipal rights-of-way) observed at the time of the site reconnaissance are summarized in Table 6.3-1.

Table 6.3-1: Observations of Areas Adjacent to RSC Property

Address / Orientation	Owner / Occupant	Observations
North of the Site 55 Park Street East	Residential	The adjacent property to the north was occupied by a residential building. No obvious evidence of potential environmental concern was observed.
East of Site 12 Helene Street North	Residential	The adjacent property to the east was occupied by a residential building. No obvious evidence of potential environmental concern was observed.
South of Site (Across High Street East) 7 Elizabeth Street North	Residential	Beyond High Street East, the adjacent property to the south was occupied by a residential building. No obvious evidence of potential environmental concern was observed.
West of Site 15 Elizabeth Street North	Residential	The adjacent property to the west was occupied by a residential building. No obvious evidence of potential environmental concern was observed.

Neighbouring Properties

The neighbouring property uses (excluding rights-of-way) observed at the time of the site reconnaissance are summarized in Table 6.3-2.

Table 6.3-2: Observations of Neighbouring Properties

Location	Land Use	Observations
North	Residential	Neighboring properties to the north consisted of residential buildings. No obvious evidence of potential environmental concern was observed.
East	Residential and Commercial	Neighboring properties to the east of the RSC Property consisted of residential buildings and a telecommunications company. No obvious evidence of potential environmental concern was observed.
South	Residential and Commercial	Neighboring properties to the south consisted of commercial and residential buildings. No obvious evidence of potential environmental concern was observed.
West	Residential, Commercial and Community Use	Neighboring properties to the west consisted of mixed-use areas. No obvious evidence of potential environmental concern was observed.

The land usage in the Study Area is shown as Figure No.2, Appendix A.

6.3.1. Potentially Contaminating Activity Observed in Study Area

No potentially contaminating activities associated with the current and/or historical use of the properties within the Study Area were identified during the site visit.

6.3.2. Enhanced Investigation Property

The RSC Property is not currently being used or has ever been used for industrial purposes, or as a garage, a bulk liquid dispensing facility including a gasoline outlet, or a facility where dry cleaning equipment operated; therefore, the Site is not considered an enhanced investigation property.

6.4. Written Description of Investigation

Investigations of the RSC Property and Phase One Study Area were carried out in general accordance with Schedule D of O. Reg. 153/04. Written description detailing each investigation is provided in Section 6.2 *Specific Observations at RSC Property* and Section 6.3 *Adjacent and Neighbouring Properties Observations*. Findings that are relevant to identified PCAs on the Site and within the Study Area are provided in Sections 6.2.13 and 6.3.1.

7.0 REVIEW AND EVALUATION OF INFORMATION

7.1. Current and Past Uses

The RSC Property was considered to have been first developed with a two-storey residential building with a partial basement circa 1960 (the “Subject Building”) and has remained unchanged to the present day. A Chain of Title dating to the Crown patent is required prior submission of Record of Site Condition.

7.2. Potentially Contaminating Activities

Based on the findings from records review, site reconnaissance and interviews, the Phase One ESA has revealed the following PCAs within the Site and the Phase One Study Area that may represent a potential to adversely impact the subsurface soil and/or groundwater at the Site:

Table 7.2-1: Potentially Contaminating Activities Within the Phase One Study Area

Location	Potential Environmental Concerns	Potentially Contaminating Activity (Table 2, Schedule D of O.Reg. 153/04)	Potential to Impact Site
50 High Street East <u>Site</u>	Potential use of de-icing salts in the paved areas and walkways.	NA ¹ – Use of De-icing Salts	Yes
110 Lakeshore Road East <u>Approximately 77m southeast of the Site</u>	The property was previously occupied by Photoline Labs Ltd., a photography studio, and was listed as a registered waste generator of photoprocessing wastes for the years 1992 to 2001.	PCA #32 – Ink Manufacturing, Processing and Bulk Storage	No
114 Lakeshore Road East <u>Approximately 94m southeast of the Site</u>	The property was previously occupied by Conshore Motors Ltd., an auto repair shop, with three gasoline underground storage tanks (USTs) with capacities of 36,300L, 36,700L and 27,250L installed in 1989. The property was previously occupied by V V Gas and Wash, a gas station and car wash, with USTs with a total capacity of 12,7800L. Petro Canada Inc., a gas station, was listed as a registered waste generator of petroleum distillates for the years 1986 to 1998.	PCA #10 - Commercial Autobody Shops PCA #28 - Gasoline and Associated Products Storage in Fixed Tanks	No
80 High Street East <u>Approximately 123m northeast of the Site</u>	The property is occupied by Bell Canada, a telecommunications company, with a fuel oil tank with a capacity of 5,000L installed in 2014. Bell Canada was listed as a registered waste generator of various wastes including, PCBs, oil skimmings & sludges and light fuels for the years 2014 to 2022.	PCA #28 - Gasoline and Associated Products Storage in Fixed Tanks NA ² – Waste Generator	No
103 Lakeshore Road East <u>Approximately 150m south of the Site</u>	The property was previously occupied by Seaway Cleaners, a dry cleaner, and was listed as a registered waste generator of halogenated solvents for the years 1986 to 2000.	PCA#37 - Operation of Dry Cleaning Equipment (where chemicals are used)	No

Location	Potential Environmental Concerns	Potentially Contaminating Activity (Table 2, Schedule D of O.Reg. 153/04)	Potential to Impact Site
111 Lakeshore Road East <u>Approximately 151m south of the Site</u>	The property was previously occupied by Seaway Cleaners, a dry cleaner, and was listed as a registered waste generator of halogenated solvents for the years 1999 to 2001. The property was previously occupied by Rosalnaaz Investments Inc., a dry cleaner, and was listed as a registered waste generator of halogenated solvents for the years 2002 to 2005. The property was previously occupied by 2088466 Ontario Limited, a dry cleaner, and was listed as a registered waste generator of various wastes including oil skimmings & sludges, petroleum distillates and halogenated solvents for the years 2006 to 2018.	PCA#37 - Operation of Dry Cleaning Equipment (where chemicals are used)	No

The PCAs identified above are presented on Figure No. 2, Appendix A.

7.3. Areas of Potential Environmental Concern

One (1) APEC was identified at the RSC Property based on the findings of this Phase One ESA as shown on Figure No. 3, Appendix A.

7.4. Uncertainty or Absence of Information

There is no known data gap identified that significantly affects the findings of this Phase One ESA.

7.5. Exemptions

For safety of vehicular or pedestrian traffic under conditions of snow or ice (or both), de-icing salts may have been applied within the paved areas during the winter months. As such, salt-related parameters (Electrical Conductivity, Sodium Adsorption Ratio, Sodium and Chloride) are not considered potential contaminants of concern at the Site, as per Section 49.1 of O. Reg. 153/04 (as amended).


8.0 CONCLUSIONS

In summary, the historical and current activities occurring both on-site and off-site, as identified at the time of this Phase One ESA, do not represent a significant potential environmental concern which may adversely impact the subsurface conditions of the RSC Property. It is *Toronto Inspection Ltd.*'s opinion that a Phase Two ESA is not required, based on a review of the available documents and information at the time of writing the Phase One ESA report.

Yours sincerely,
Toronto Inspection Ltd.



Natalie Chan, BES, EPt
 Environmental Scientist

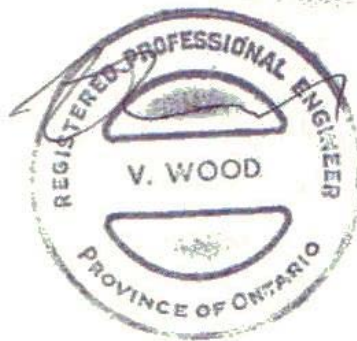


Victor Wood, MEng, PEng, QP_{ESA}
 Principal Engineer

9.0 REFERENCES

Aerial Photographs

- City of Mississauga Interactive Map for the years: 1954, 1966, 1975, 1980, 1989, 2000, 2009, 2017 and 2023.
- City of Toronto Archives for the year: 1960.

City Directories

- Halton Peel Regions ON. Criss-Cross Directory, Might's Suburban Metro Toronto Criss-Cross Directory and Metro Satellite Cities Directory from Toronto Reference Library for the years 1969 to 2001.

City of Mississauga Interactive Map

- <https://ext.maps.mississauga.ca/Html5Viewer/index.html?viewer=eMaps.HTML5>

Federal and Provincial and Additional Private Database Records

- Environmental Risk Information Service (ERIS) Ltd. database, for locations within 250m of the Site

Geological Maps

- *Quaternary Geology of Ontario*, Ontario Geophysical Survey (OGS)Earth website (<https://www.mndm.gov.on.ca/en/mines-and-minerals/applications/ogsearth>), Ministry of Northern Development and Mines
- *Bedrock Geology of Ontario*, (OGS) Earth website, (<https://www.mndm.gov.on.ca/en/mines-and-minerals/applications/ogsearth>), Ministry of Northern Development and Mines
- *The Physiography of Southern Ontario*, (OGS)Earth website, (<https://www.mndm.gov.on.ca/en/mines-and-minerals/applications/ogsearth>), Ministry of Northern Development and Mines

Government Inventory and Database Records

- *Inventory of Coal Gasification Plant Waste Sites in Ontario*, Ministry of the Environment (MOE) Waste Management Branch, July 1987, records search within approximately 1 km of the Site
- *Inventory of Industrial Sites Producing or Using Coal Tar and Related Tars in Ontario*, MOE, November 1988, records search within approximately 1 km of the Site
- *Waste Disposal Site Inventory*, MOE Waste Management Branch, June 1991, active and closed facilities within approximately 1 km of the Site

Historical County Atlas

- 1859 Historical County Map of the Peel County.

Interview

- In-person was conducted with Ms. Jane Seale, the property manager, on February 7, 2025.
- A questionnaire was completed by Ms. Jane Seale, the property manager, on February 12, 2025.

Natural Heritage and Areas of Natural Significance

- Ministry of Natural Resources and Forestry (MNRF), Natural Heritage Areas Interactive map website
(http://www.gisapplication.lrc.gov.on.ca/mamnh/Index.html?site=MNR_NHLUPS_NaturalHeritage&viewer=NaturalHeritage&locale=en-US)

Regulation

- O. Reg. 153/04: Record of Site Condition – Part XV.1 of the Act.

Requests for File Information

- MECP Freedom of Information Office regarding environmental concerns, violations, complaints, etc.
- Technical Standards and Safety Authority (TSSA) for information pertaining to fuel storage tanks.

Source Protection Information Atlas

- Regional Municipality of Durham
(<https://www.lioapplications.lrc.gov.on.ca/SourceWaterProtection/index.html?viewer=SourceWaterProtection.SWPViewer&locale=en-CA>)

Topographic Maps

- Topographic map: The Atlas of Canada – Toporama website
(<http://atlas.gc.ca/toporama/en/index.html>), Natural Resources Canada
- Environmental Risk Information Service (ERIS) Ltd. database

10.0 GENERAL STATEMENT OF LIMITATION

This Phase One Environmental Site Assessment was conducted in general compliance with currently acceptable practices for environmental site investigations, and specific client requests, as applicable to this property. It is based on documents and oral information supplied to *Toronto Inspection Ltd.* There is no warranty expressed or implied or representations by *Toronto Inspection Ltd.* that this investigation uncovered all potential environmental risks or liabilities associated with the subject site.

This report was prepared by *Toronto Inspection Ltd.* for the account of 1001107627 Ontario Inc. The material in this report reflects *Toronto Inspection Ltd.*'s judgement in light of the information available to them at the time of preparation. Any use which a Third Party makes of this report, or any reliance on decisions to be made based on it, is the responsibility of these Third Parties. *Toronto Inspection Ltd.* accepts no responsibility for damages, if any, suffered by any Third Party as a result of decisions made or actions based on this report.


Toronto Inspection Ltd. did not provide any service to investigate or detect the presence of moisture, mould or other biological contaminants in or around any structure, or any service that was designed or intended to prevent or lower the risk of the occurrence of the amplification of the same. Mould is ubiquitous to the environment with mould amplification occurring when building materials are impacted by moisture. Site conditions are outside of *Toronto Inspection Ltd.*'s control, and mould amplification will likely occur, or continue to occur, in the presence of moisture. As such, *Toronto Inspection Ltd.* cannot and shall not be held responsible for the occurrence or recurrence of mould amplification.

Any legal actions arising directly or indirectly from this work and/or *Toronto Inspection Ltd.*'s performance of the services shall be filed no longer than two years from the date of *Toronto Inspection Ltd.*'s substantial completion of the services. *Toronto Inspection Ltd.* shall not be responsible to the client for lost revenues, loss of profits, cost of content, claims of customers, or other special indirect, consequential, or punitive damages.

To the fullest extent permitted by law, the client's maximum aggregate recovery against *Toronto Inspection Ltd.*, its directors, employees, sub-contractors and representatives, for any and all claims by 1001107627 Ontario Inc. for all causes including, but not limited to, claims of breach of contract, breach of warranty and/or negligence, shall be limited to the amount of professional fees paid by the client.

This report is to be read in its entirety, each section is an integral part of the report, and no sections are to be used separately.

Appendix A	Figure No. 1: Regional Topography and Site Location
	Figure No. 2: Phase One Conceptual Site Model - PCA Locations and Land Use
	Figure No. 3: Phase One Conceptual Site Model - APEC Locations

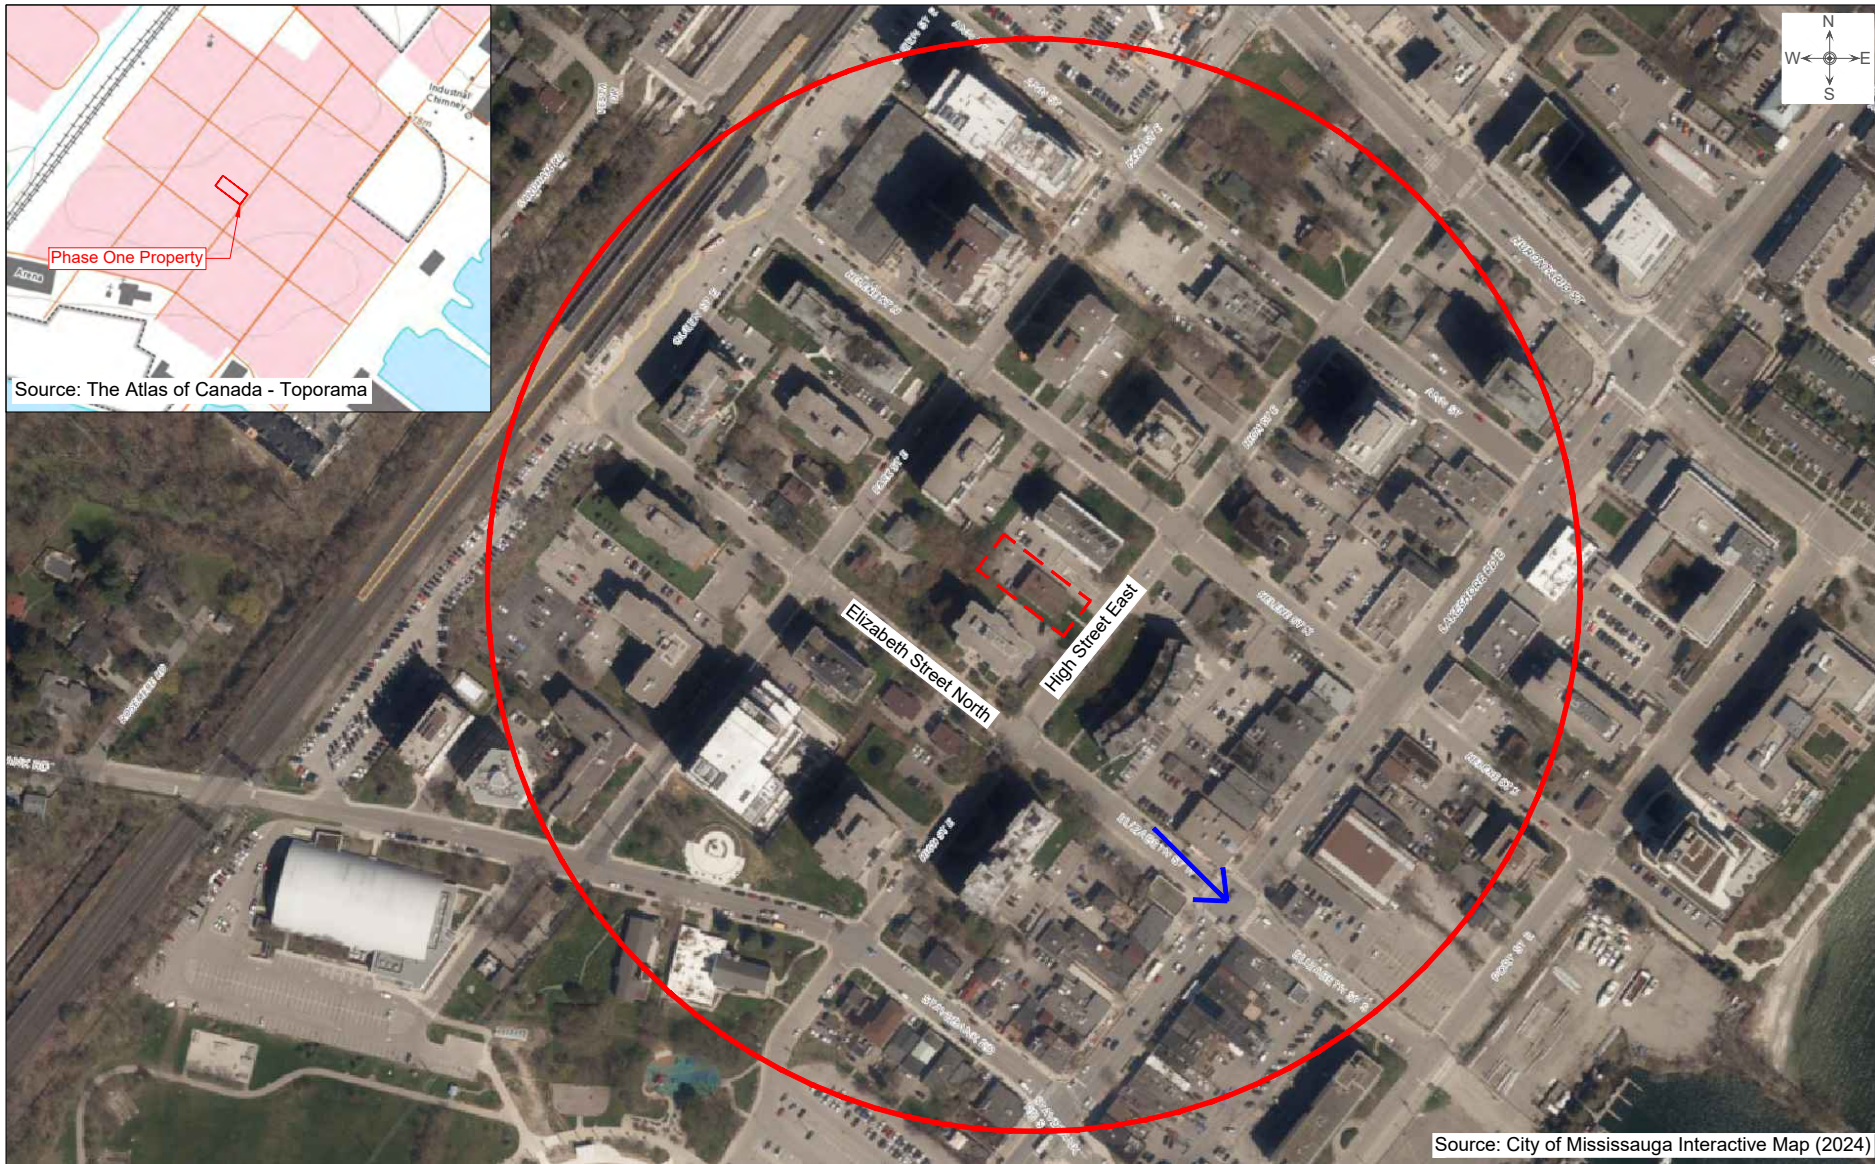

LEGEND:

--- RSC Property Boundary

○ Study Area (250m)

↘ Inferred Groundwater Flow Direction

Scale (m)
0 50 100

TorontoInspection
GEO-ENVIRONMENTAL CONSULTANTS

110 Konrad Crescent,
Unit 16
Markham, Ontario
L3R 9X2

Tel: 905-940 8509

Fax: 905-940 8192

Email : TIL@torontoinspection.com


TITLE: Regional Topography and Site Location

LOCATION: 50 High Street East, Mississauga, Ontario

PROJECT NO. 6857-25-EA

DATE : November 2025

FIGURE NO. 1

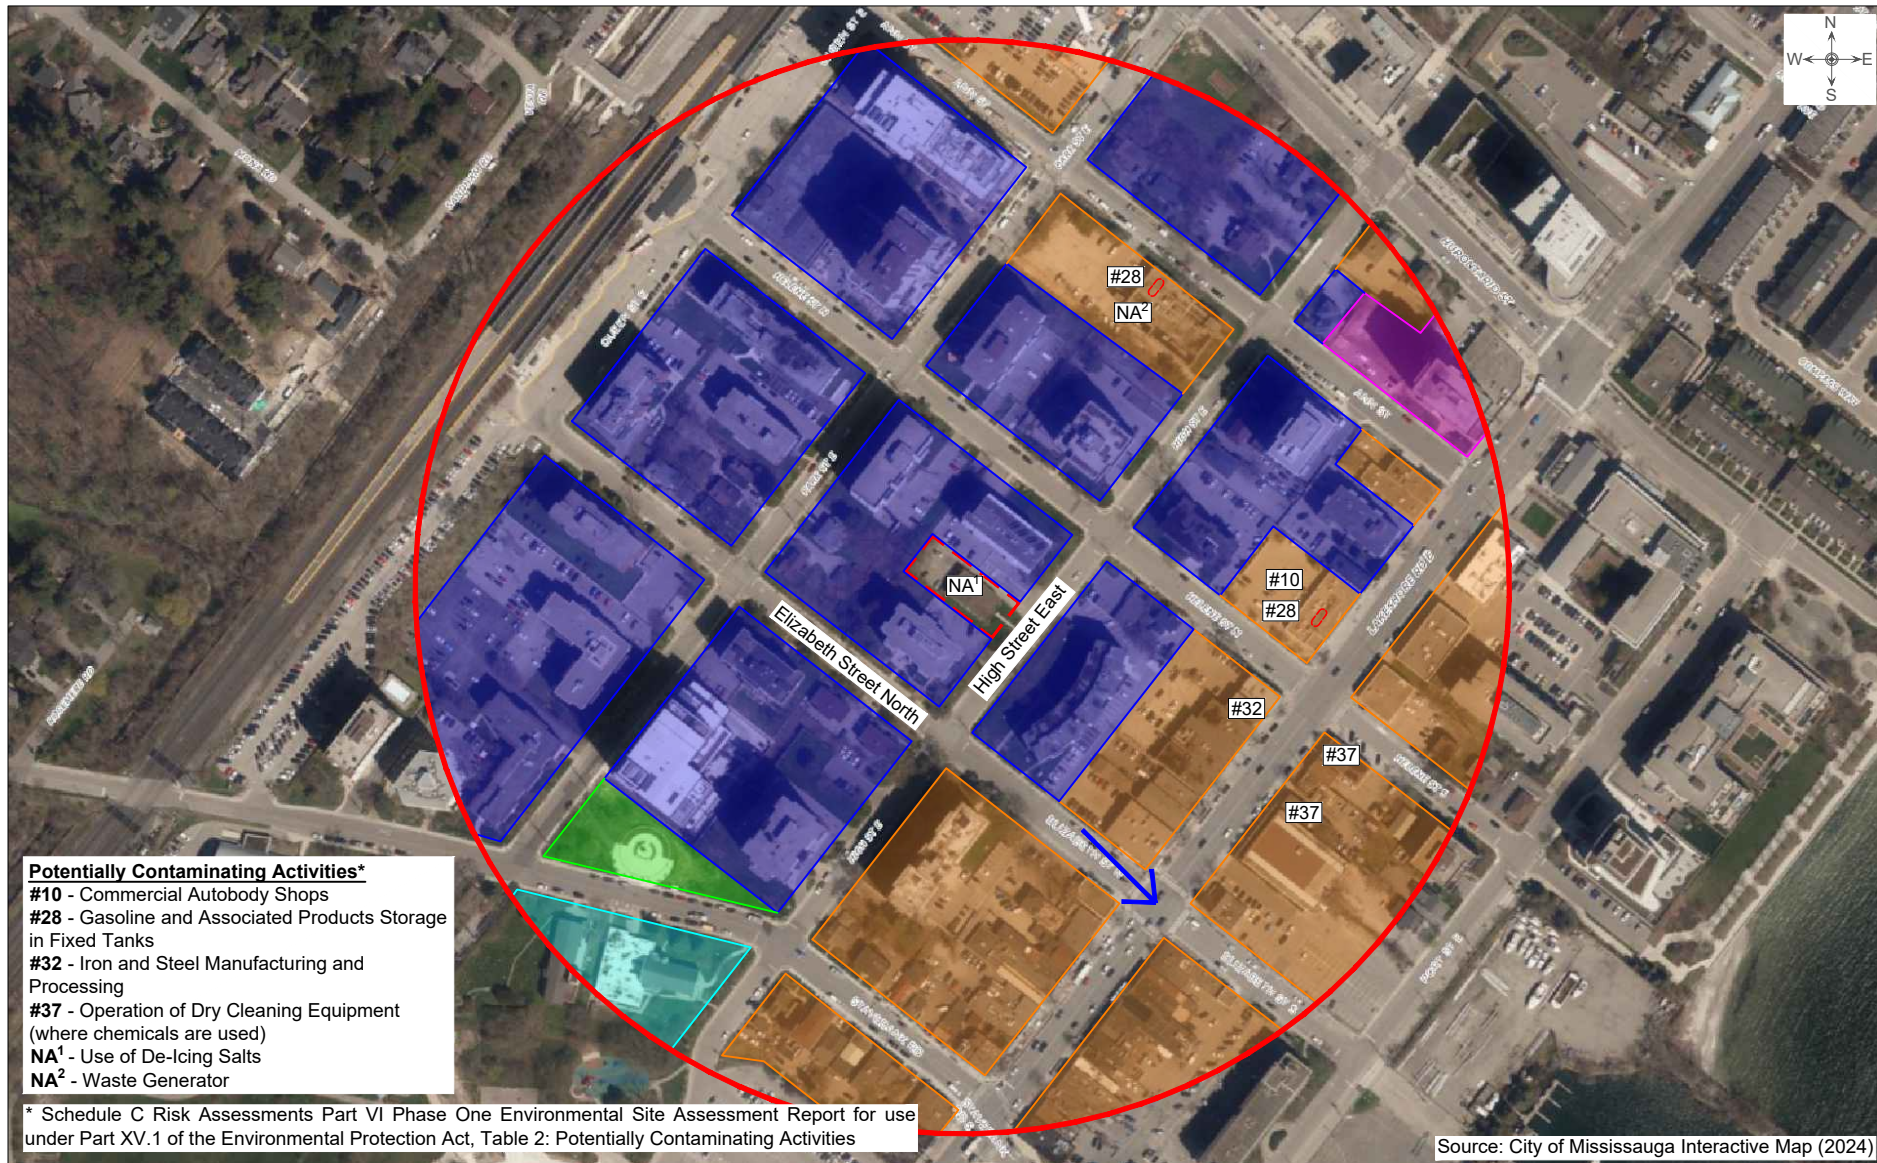

LEGEND:

	RSC Property Boundary		Residential		Commercial		Mixed-Use		Inferred Groundwater Flow Direction
	Study Area (250m)		Park		Institutional		Underground Storage Tank		Scale (m)

TorontoInspection
GEO-ENVIRONMENTAL CONSULTANTS

110 Konrad Crescent,
Unit 16
Markham, Ontario
L3R 9X2

Tel: 905-940 8509

Fax: 905-940 8192

Email: TIL@torontoinspection.com


TITLE: Phase One Conceptual Site Model - PCA and Land Use

LOCATION: 50 High Street East, Mississauga, Ontario

PROJECT NO. 6857-25-EA

DATE: November 2025

FIGURE NO. 2

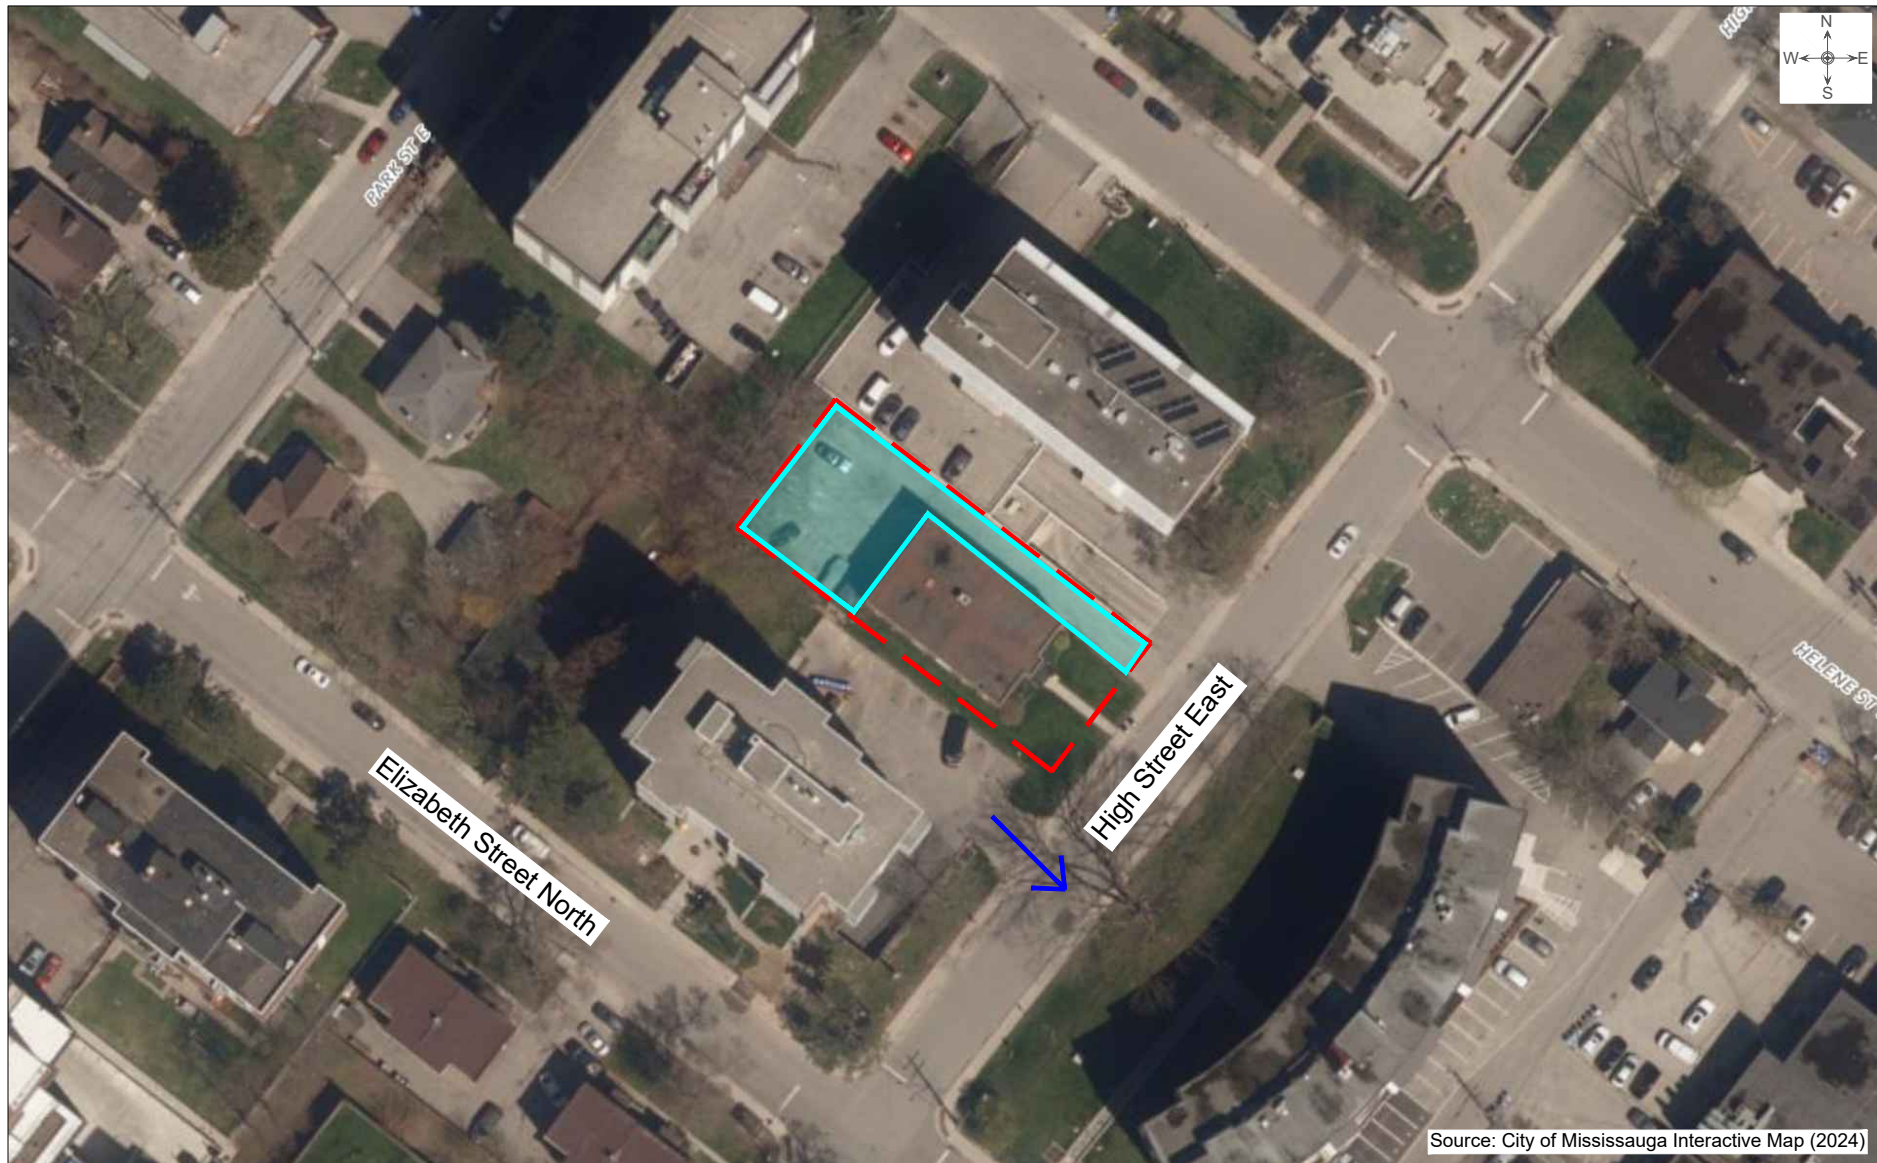

LEGEND:




RSC Property Boundary



Inferred Groundwater
Flow Direction



APEC-1



TorontoInspection
GEO-ENVIRONMENTAL CONSULTANTS

110 Konrad Crescent,
Unit 16
Markham, Ontario
L3R 9X2

Tel: 905-940 8509

Fax: 905-940 8192

Email : TIL@torontoinspection.com

TITLE:

Phase One Conceptual Site Model - APEC Locations

LOCATION:

50 High Street East, Mississauga, Ontario

PROJECT NO.

6857-25-EA

DATE :

November 2025

FIGURE NO.

3

Appendix B ERIS Report



DATABASE REPORT

Project Property:	<i>50 High Street, Mississauga 50 High Street Mississauga ON L5G 1K1</i>
Project No:	<i>6857</i>
Report Type:	<i>Standard Report</i>
Order No:	<i>25020500477</i>
Requested by:	<i>Toronto Inspection Ltd.</i>
Date Completed:	<i>February 5, 2025</i>

Environmental Risk Information Services

A division of Glacier Media Inc.

1.866.517.5204 | info@erisinfo.com | erisinfo.com

Table of Contents

Table of Contents.....	2
Executive Summary.....	3
Executive Summary: Report Summary.....	4
Executive Summary: Site Report Summary - Project Property.....	7
Executive Summary: Site Report Summary - Surrounding Properties.....	8
Executive Summary: Summary By Data Source.....	37
Map.....	73
Aerial.....	74
Topographic Map.....	75
Detail Report.....	76
Unplottable Summary.....	455
Unplottable Report.....	458
Appendix: Database Descriptions.....	491
Definitions.....	501

Notice: IMPORTANT LIMITATIONS and YOUR LIABILITY

Reliance on information in Report: This report DOES NOT replace a full Phase I Environmental Site Assessment but is solely intended to be used as a database review of environmental records.

License for use of information in Report: No page of this report can be used without this cover page, this notice and the project property identifier. The information in Report(s) may not be modified or re-sold.

Your Liability for misuse: Using this Service and/or its reports in a manner contrary to this Notice or your agreement will be in breach of copyright and contract and ERIS may obtain damages for such mis-use, including damages caused to third parties, and gives ERIS the right to terminate your account, rescind your license to any previous reports and to bar you from future use of the Service.

No warranty of Accuracy or Liability for ERIS: The information contained in this report has been produced by ERIS Information Limited Partnership ("ERIS") using various sources of information, including information provided by Federal and Provincial government departments. The report applies only to the address and up to the date specified on the cover of this report, and any alterations or deviation from this description will require a new report. This report and the data contained herein does not purport to be and does not constitute a guarantee of the accuracy of the information contained herein and does not constitute a legal opinion nor medical advice. Although ERIS has endeavored to present you with information that is accurate, ERIS disclaims, any and all liability for any errors, omissions, or inaccuracies in such information and data, whether attributable to inadvertence, negligence or otherwise, and for any consequences arising therefrom. Liability on the part of ERIS is limited to the monetary value paid for this report.

Trademark and Copyright: You may not use the ERIS trademarks or attribute any work to ERIS other than as outlined above. This Service and Report (s) are protected by copyright owned by ERIS Information Limited Partnership. Copyright in data used in the Service or Report(s) (the "Data") is owned by ERIS or its licensors. The Service, Report(s) and Data may not be copied or reproduced in whole or in any substantial part without prior written consent of ERIS.

Executive Summary

Property Information:

Project Property: 50 High Street, Mississauga
50 High Street Mississauga ON L5G 1K1

Project No: 6857

Coordinates:

Latitude: 43.5543745
Longitude: -79.585213
UTM Northing: 4,823,352.40
UTM Easting: 614,275.42
UTM Zone: 17T

Elevation: 262 FT
79.85 M

Order Information:

Order No: 25020500477
Date Requested: February 5, 2025
Requested by: Toronto Inspection Ltd.
Report Type: Standard Report

Historical/Products:

ERIS Xplorer [ERIS Xplorer](#)

Executive Summary: Report Summary

<i>Database</i>	<i>Name</i>	<i>Searched</i>	<i>Project Property</i>	<i>Within 0.25 km</i>	<i>Total</i>
AAGR	Abandoned Aggregate Inventory	Y	0	0	0
AGR	Aggregate Inventory	Y	0	0	0
AMIS	Abandoned Mine Information System	Y	0	0	0
ANDR	Anderson's Waste Disposal Sites	Y	0	0	0
AST	Aboveground Storage Tanks	Y	0	0	0
AUWR	Automobile Wrecking & Supplies	Y	0	0	0
BORE	Borehole	Y	0	62	62
CA	Certificates of Approval	Y	0	6	6
CDRY	Dry Cleaning Facilities	Y	0	2	2
CFOT	Commercial Fuel Oil Tanks	Y	0	2	2
CHEM	Chemical Manufacturers and Distributors	Y	0	0	0
CHM	Chemical Register	Y	0	0	0
CNG	Compressed Natural Gas Stations	Y	0	0	0
COAL	Inventory of Coal Gasification Plants and Coal Tar Sites	Y	0	0	0
CONV	Compliance and Convictions	Y	0	0	0
CPU	Certificates of Property Use	Y	0	0	0
DRL	Drill Hole Database	Y	0	0	0
DTNK	Delisted Fuel Tanks	Y	0	4	4
EASR	Environmental Activity and Sector Registry	Y	0	2	2
EBR	Environmental Registry	Y	0	0	0
ECA	Environmental Compliance Approval	Y	0	3	3
EEM	Environmental Effects Monitoring	Y	0	0	0
EHS	ERIS Historical Searches	Y	1	46	47
EIIS	Environmental Issues Inventory System	Y	0	0	0
EMHE	Emergency Management Historical Event	Y	0	0	0
EPAR	Environmental Penalty Annual Report	Y	0	0	0
EXP	List of Expired Fuels Safety Facilities	Y	0	8	8
FCON	Federal Convictions	Y	0	0	0
FCS	Contaminated Sites on Federal Land	Y	0	0	0
FOFT	Fisheries & Oceans Fuel Tanks	Y	0	0	0
FRST	Federal Identification Registry for Storage Tank Systems (FIRSTS)	Y	0	0	0
FST	Fuel Storage Tank	Y	0	0	0
FSTH	Fuel Storage Tank - Historic	Y	0	0	0
GEN	Ontario Regulation 347 Waste Generators Summary	Y	0	89	89
GHG	Greenhouse Gas Emissions from Large Facilities	Y	0	0	0
HINC	TSSA Historic Incidents	Y	0	0	0
IAFT	Indian & Northern Affairs Fuel Tanks	Y	0	0	0

Database	Name	Searched	Project Property	Within 0.25 km	Total
INC	Fuel Oil Spills and Leaks	Y	0	4	4
LIMO	Landfill Inventory Management Ontario	Y	0	0	0
MINE	Canadian Mine Locations	Y	0	0	0
MNR	Mineral Occurrences	Y	0	0	0
NATE	National Analysis of Trends in Emergencies System (NATES)	Y	0	0	0
NCPL	Non-Compliance Reports	Y	0	0	0
NDFT	National Defense & Canadian Forces Fuel Tanks	Y	0	0	0
NDSP	National Defense & Canadian Forces Spills	Y	0	0	0
NDWD	National Defence & Canadian Forces Waste Disposal Sites	Y	0	0	0
NEBI	National Energy Board Pipeline Incidents	Y	0	0	0
NEBP	National Energy Board Wells	Y	0	0	0
NEES	National Environmental Emergencies System (NEES)	Y	0	0	0
NPCB	National PCB Inventory	Y	0	0	0
NPR2	National Pollutant Release Inventory	Y	0	0	0
NPRI	National Pollutant Release Inventory - Historic	Y	0	0	0
OGWE	Oil and Gas Wells	Y	0	0	0
OOGW	Ontario Oil and Gas Wells	Y	0	0	0
OPCB	Inventory of PCB Storage Sites	Y	0	0	0
ORD	Orders	Y	0	0	0
PAP	Canadian Pulp and Paper	Y	0	1	1
PCFT	Parks Canada Fuel Storage Tanks	Y	0	0	0
PES	Pesticide Register	Y	0	15	15
PFAS	Ontario PFAS Spills	Y	0	0	0
PFCH	NPRI Reporters - PFAS Substances	Y	0	0	0
PFHA	Potential PFAS Handlers from NPRI	Y	0	0	0
PINC	Pipeline Incidents	Y	0	3	3
PPHA	Potential PFAS Handlers from EASR	Y	0	0	0
PRT	Private and Retail Fuel Storage Tanks	Y	0	2	2
PTTW	Permit to Take Water	Y	0	1	1
REC	Ontario Regulation 347 Waste Receivers Summary	Y	0	0	0
RSC	Record of Site Condition	Y	0	12	12
RST	Retail Fuel Storage Tanks	Y	0	2	2
SCT	Scott's Manufacturing Directory	Y	0	20	20
SPL	Ontario Spills	Y	0	21	21
SRDS	Wastewater Discharger Registration Database	Y	0	0	0
TANK	Anderson's Storage Tanks	Y	0	0	0
TCFT	Transport Canada Fuel Storage Tanks	Y	0	0	0
VAR	Variances for Abandonment of Underground Storage Tanks	Y	0	0	0
WDS	Waste Disposal Sites - MOE CA Inventory	Y	0	0	0
WDSH	Waste Disposal Sites - MOE 1991 Historical Approval Inventory	Y	0	0	0
WWIS	Water Well Information System	Y	0	63	63

<i>Database</i>	<i>Name</i>	<i>Searched</i>	<i>Project Property</i>	<i>Within 0.25 km</i>	<i>Total</i>
		Total:	1	368	369

Executive Summary: Site Report Summary - Project Property

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev diff (m)	Page Number
1	EHS		50 High Street Mississauga ON	-/0.0	0.00	76

Executive Summary: Site Report Summary - Surrounding Properties

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
<u>2</u>	BORE		ON	SSE/40.6	0.00	<u>76</u>
<u>3</u>	BORE		ON	ESE/43.8	0.00	<u>77</u>
<u>4</u>	EHS		12 Helene St N Mississauga ON L5G	ENE/49.6	0.00	<u>79</u>
<u>5</u>	BORE		ON	E/50.3	0.00	<u>79</u>
<u>6</u>	BORE		ON	ENE/57.8	0.00	<u>80</u>
<u>7</u>	BORE		ON	SW/58.4	0.00	<u>82</u>
<u>8</u>	CA	Kanco-55 Park Ltd.	55 Park St E Mississauga ON	NW/64.7	0.00	<u>83</u>
<u>8</u>	EHS		55 Park Street East Mississauga ON	NW/64.7	0.00	<u>84</u>
<u>8</u>	INC		55 PARK STREET EAST, MISSISSAUGA ON	NW/64.7	0.00	<u>84</u>
<u>8</u>	INC		55 PARK STREET EAST, MISSISSAUGA ON	NW/64.7	0.00	<u>85</u>
<u>8</u>	INC		55 PARK STREET EAST, MISSISSAUGA ON	NW/64.7	0.00	<u>86</u>
<u>8</u>	ECA	Kanco-55 Park Ltd.	55 Park St E Mississauga ON L4V 1R9	NW/64.7	0.00	<u>86</u>

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
<u>8</u>	EHS		55 Park Street East Mississauga ON L5G 1L9	NW/64.7	0.00	<u>87</u>
<u>9</u>	BORE		ON	WSW/67.6	0.00	<u>87</u>
<u>10</u>	BORE		ON	N/76.2	0.00	<u>88</u>
<u>11</u>	EHS		7 Elizabeth Street North Mississauga ON	SE/79.7	0.00	<u>90</u>
<u>11</u>	EHS		7 Elizabeth Street North Mississauga ON L5G 2Y8	SE/79.7	0.00	<u>90</u>
<u>12</u>	BORE		ON	E/79.8	0.00	<u>91</u>
<u>13</u>	BORE		ON	W/81.4	0.00	<u>92</u>
<u>14</u>	BORE		ON	NW/84.0	-0.18	<u>94</u>
<u>15</u>	BORE		ON	W/87.2	0.00	<u>95</u>
<u>16</u>	BORE		ON	ENE/91.2	0.00	<u>97</u>
<u>17</u>	BORE		ON	SSE/91.6	0.00	<u>99</u>
<u>18</u>	PES	VERSACE LAWN CARE	66 HIGH STREET EAST, #202 MISSISSAUGA ON L5G 1K2	NE/91.6	0.00	<u>100</u>
<u>18</u>	PES	VERSACE LAWN CARE	66 HIGH STREET EAST, #202 MISSISSAUGA ON L5G1K2	NE/91.6	0.00	<u>101</u>

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
<u>18</u>	PES	VERSACE LAWN CARE	66 HIGH STREET EAST, #202 MISSISSAUGA ON L5G1K2	NE/91.6	0.00	<u>101</u>
<u>19</u>	BORE		ON	SSW/98.1	0.00	<u>101</u>
<u>20</u>	BORE		ON	S/99.7	0.00	<u>103</u>
<u>21</u>	EHS		20 Elizabeth Street North Mississauga ON L5G 2Z1	WSW/101.5	0.00	<u>104</u>
<u>22</u>	SPL	Regional Municipality of Peel	Elizabeth St. and Park St. Mississauga ON	W/103.3	0.00	<u>104</u>
<u>23</u>	WWIS		29 PARK ST. EAST MISSISSAUGA ON <i>Well ID: 7296575</i>	WSW/107.1	0.00	<u>105</u>
<u>24</u>	BORE		ON	NW/107.2	-1.00	<u>109</u>
<u>25</u>	BORE		ON	N/111.6	0.00	<u>110</u>
<u>26</u>	SPL	PUC	7 HELENE ST. PORT CREDIT MISSISSAUGA CITY ON	E/112.2	0.00	<u>112</u>
<u>27</u>	BORE		ON	SSW/117.0	0.00	<u>112</u>
<u>28</u>	RSC	EDENSHAW ELIZABETH DEVELOPMENTS LIMITED	46 Park ST E Mississauga ON	WNW/117.6	-1.00	<u>114</u>
<u>29</u>	BORE		ON	S/119.6	0.00	<u>114</u>
<u>30</u>	RSC	EDENSHAW ELIZABETH DEVELOPMENTS LIMITED	44 Park ST E Mississauga ON	WNW/120.4	-0.85	<u>115</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
31	RSC	EDENSHAW ELIZABETH DEVELOPMENTS LIMITED	42 Park ST E Mississauga ON	WNW/121.8	-0.48	116
32	WWIS		94 Lakeshore Road East Mississauga ON Well ID: 7344847	SE/123.5	0.00	116
33	BORE		ON	NW/124.7	-1.00	119
34	BORE		ON	NW/126.1	-1.00	121
35	WWIS		94 Lakeshore Rd East Mississauga ON Well ID: 7344848	SE/126.4	0.00	122
36	BORE		ON	W/127.5	-0.10	125
37	BORE		ON	ENE/127.6	0.00	127
38	BORE		ON	W/129.3	0.00	128
39	GEN	HOOPER'S PHARMACY 19-650	100 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E3	SE/130.4	0.00	130
39	GEN	HOOPER'S PHARMACY	100 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E3	SE/130.4	0.00	130
40	SPL	FRAM GROUP (CANADA) INC	69 High St. E Mississauga ON	ENE/132.2	0.00	131
41	SCT	CASPIAN CUSTOM CANVAS INC.	106 LAKESHORE RD E SUITE 104 MISSISSAUGA ON L5G 1E3	ESE/132.7	0.00	132
42	WWIS		ON	W/133.5	-0.44	132

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
			Well ID: 7370471			
43	BORE		ON	S/135.0	0.00	133
44	BORE		ON	SSE/135.8	0.00	134
45	GEN	PHOTOLINE LABS LTD. 31-649	110 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E3	ESE/140.5	0.00	135
45	GEN	PHOTOLINE LABS LTD.	110 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E3	ESE/140.5	0.00	136
46	EHS		94-100 Lakeshore Road East Mississauga ON L5G 1E3	SE/140.9	0.00	136
47	BORE		ON	SSW/141.2	0.00	136
48	SCT	THE DUDSON GROUP (USA) INC.	92 LAKESHORE RD E MISSISSAUGA ON L5G 4S2	SE/141.7	0.00	137
48	SCT	The Dudson USA Inc.	92 Lakeshore Rd E Floor 2 Mississauga ON L5G 4S2	SE/141.7	0.00	138
48	SCT	Dudson USA Inc.	92 Lakeshore Rd E Floor 2 Mississauga ON L5G 4S2	SE/141.7	0.00	138
48	PAP	Zirco Ltd.	92 Lakeshore Rd E Mississauga ON L5G 4S2	SE/141.7	0.00	138
48	SCT	RCOM graphics and design	92 Lakeshore Rd E Suite 202 Mississauga ON L5G 4S2	SE/141.7	0.00	138
49	BORE		ON	E/142.3	0.00	139
50	BORE		ON	SSE/142.6	0.00	140

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
51	EHS		28 Helene St N Mississauga ON L5G 3B7	NW/147.0	-1.00	142
51	GEN	IMH Pool VI-A LP	28 Helene St North Port Credit ON L5G 3B7	NW/147.0	-1.00	142
51	EHS		28 Helene Street North Mississauga ON L5G 3B7	NW/147.0	-1.00	143
51	EHS		28 Helene Street North Mississauga ON L5G 3B7	NW/147.0	-1.00	143
52	RSC	EDENSHAW ELIZABETH DEVELOPMENTS LIMITED	23 Elizabeth ST N Mississauga ON	WNW/147.3	-1.00	143
53	EHS		30 HIGH STREET EAST MISSISSAUGA ON L5G 1J8	SW/148.3	0.00	144
54	EHS		30 High Street East Mississauga ON L5G 1J8	SW/148.7	0.00	144
55	WWIS		27 PARK ST E PORT CREDIT ON <i>Well ID: 7278219</i>	WSW/149.6	0.00	144
56	WWIS		94 Lakeshore Rd East Mississauga ON <i>Well ID: 7344849</i>	SE/151.5	0.00	148
57	CFOT	BELL CANADA	80 HIGH ST E MISSISSAUGA ON	NE/151.8	0.00	151
57	GEN	Bell	80 High St Mississauga ON L5G 1K2	NE/151.8	0.00	151
57	GEN	Bell	80 High St Port Credit ON L5G 1K4	NE/151.8	0.00	152
57	GEN	Bell	80 High St Mississauga ON L5G 1K2	NE/151.8	0.00	152

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
57	GEN	Bell	80 High St Port Credit ON L5G 1K4	NE/151.8	0.00	153
57	SPL		80 High Street East Mississauga ON	NE/151.8	0.00	153
57	SPL	Bell Canada	80 High Street Mississauga ON	NE/151.8	0.00	154
57	GEN	Bell	80 High St Port Credit ON L5G 1K4	NE/151.8	0.00	155
57	GEN	Bell	80 High St Port Credit ON L5G 1K4	NE/151.8	0.00	156
57	GEN	Bell	80 High St Port Credit ON L5G 1K4	NE/151.8	0.00	156
58	SPL	UNKNOWN	114 LAKESHORE BLVD ST HELENE ST. MISSISSAUGA CITY ON	E/152.0	0.00	159
58	PRT	V V GAS AND WASH	114 LAKESHORE RD PORT CREDIT MISSISSAUGA ON	E/152.0	0.00	160
58	PRT	V V GAS AND WASH	114 LAKESHORE RD PORT CREDIT MISSISSAUGA ON	E/152.0	0.00	160
58	GEN	PETRO CANADA INC.	114 LAKESHORE ROAD E PORT CREDIT ON L5G 1E4	E/152.0	0.00	160
58	GEN	PETRO CANADA INC.	114 LAKESHORE RD., EAST MISSISSAUGA C/O 5140 YONGE ST. SUITE 200 NORTH YORK ON L5G 1E4	E/152.0	0.00	160
58	GEN	PETRO CANADA INC. 30-570	114 LAKESHORE RD., EAST MISSISSAUGA C/O 5140 YONGE ST. SUITE 200 NORTH YORK ON L5G 1E4	E/152.0	0.00	161

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>58</u>	SCT	Dens-Tek Dental Studio Inc.	114 Lakeshore Rd E Unit 4 Mississauga ON L5G 1E4	E/152.0	0.00	<u>161</u>
<u>58</u>	EHS		114 Lakeshore Road E Mississauga ON L5G 1E4	E/152.0	0.00	<u>161</u>
<u>58</u>	DTNK	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON L5G 1E4	E/152.0	0.00	<u>162</u>
<u>58</u>	DTNK	V V GAS AND WASH	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON	E/152.0	0.00	<u>162</u>
<u>58</u>	DTNK	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON	E/152.0	0.00	<u>163</u>
<u>58</u>	SPL		114 Lakeshore Road East, Mississauga MISSISSAUGA ON	E/152.0	0.00	<u>163</u>
<u>58</u>	EXP	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON	E/152.0	0.00	<u>164</u>
<u>58</u>	EXP	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON	E/152.0	0.00	<u>165</u>
<u>58</u>	EXP	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON	E/152.0	0.00	<u>165</u>
<u>58</u>	EXP	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON	E/152.0	0.00	<u>165</u>
<u>58</u>	EXP	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON	E/152.0	0.00	<u>165</u>
<u>58</u>	EXP	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON	E/152.0	0.00	<u>166</u>
<u>58</u>	EXP	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON	E/152.0	0.00	<u>166</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>58</u>	EXP	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON	E/152.0	0.00	<u>166</u>
<u>59</u>	BORE		ON	SW/152.8	0.00	<u>166</u>
<u>60</u>	EHS		23 Elizabeth Street North Mississauga ON L5G 2Z4	WNW/154.3	-1.00	<u>168</u>
<u>61</u>	WWIS		8 ANN ST ON Well ID: 7288429	ENE/154.8	0.00	<u>168</u>
<u>62</u>	BORE		ON	WSW/155.7	0.00	<u>170</u>
<u>63</u>	EHS		80 High Street E Mississauga ON L5G 1K4	NE/155.7	0.00	<u>172</u>
<u>64</u>	EHS		88 Lakeshore Rd. E Mississauga ON L5G 1E1	SSE/157.3	0.00	<u>172</u>
<u>64</u>	GEN	Hooper's Pharmacy	88 Lakeshore Road East Mississauga ON L5G 1E1	SSE/157.3	0.00	<u>172</u>
<u>64</u>	GEN	Robert Clark Drugs Ltd	88 Lakeshore Rd E Mississauga ON L5G1E1	SSE/157.3	0.00	<u>173</u>
<u>65</u>	EHS		220 220 ON L5G 1K2	NNE/163.4	0.00	<u>173</u>
<u>66</u>	BORE		ON	NW/163.5	-1.00	<u>173</u>
<u>67</u>	EHS		28 Elizabeth Street North Mississauga ON L5G 2Z6	W/164.7	-0.75	<u>175</u>
<u>67</u>	SPL	Compten Management Inc.	28 Elizabeth Street North Mississauga ON	W/164.7	-0.75	<u>175</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>68</u>	EHS		27 Park St E Mississauga ON L5G1L7	WSW/166.1	0.00	<u>176</u>
<u>69</u>	BORE		ON	ESE/166.7	0.00	<u>176</u>
<u>70</u>	SCT	Richard's Fine Chocolates Inc.	25 Helene St N Mississauga ON L5G 3B6	NNW/167.2	-1.00	<u>178</u>
<u>71</u>	SPL	Enbridge Gas Distribution Inc.	26 Park Street Mississauga ON	W/167.4	0.00	<u>178</u>
<u>71</u>	PINC	ENBRIDGE GAS INC	26 PARK ST E,,MISSISSAUGA,ON,L5G 1L6,CA ON	W/167.4	0.00	<u>179</u>
<u>71</u>	EHS		26 Park Street East Mississauga ON L5G 1L6	W/167.4	0.00	<u>179</u>
<u>72</u>	WWIS		21 PARK ST E PORT CREDIT ON Well ID: 7278220	WSW/167.8	0.00	<u>180</u>
<u>72</u>	WWIS		21 Park Street East Port Credit ON Well ID: 7330661	WSW/167.8	0.00	<u>183</u>
<u>73</u>	EHS		From Front Street northeast to Elmwood Ave S Mississauga ON L5G	ESE/168.2	0.00	<u>186</u>
<u>74</u>	WWIS		29 PARK ST. EAST MISSISSAUGA ON Well ID: 7296574	WSW/168.9	0.00	<u>186</u>
<u>75</u>	RSC	Scott Insley	8 ANN ST ON MISSISSAUGA ON	ENE/169.5	0.00	<u>189</u>
<u>76</u>	SPL	Enbridge Gas Distribution Inc.	8 Ann St. Mississauga Mississauga ON	ENE/169.6	0.00	<u>189</u>
<u>76</u>	PINC	PIPELINE HIT - 2"	8 ANN ST,,MISSISSAUGA,ON,L5G 3E6, CA ON	ENE/169.6	0.00	<u>190</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
77	SPL		26 Elizabeth St N, Mississauga MISSISSAUGA ON	W/169.7	-0.75	191
78	RSC	Home Alone Property Management Services Limited	10 ANN ST ON MISSISSAUGA ON	ENE/170.1	0.00	192
78	RSC	F.S. 6810 DEVELOPMENT INC.	10 ANN STREET ON Mississauga ON	ENE/170.1	0.00	192
79	WWIS		21 PARK ST E PORT CREDIT ON <i>Well ID: 7278218</i>	WSW/170.9	0.00	193
79	EASR	EDENSHAW PARK DEVELOPMENTS LIMITED	21 Park ST E Mississauga ON L5G 1L7	WSW/170.9	0.00	197
79	WWIS		21 Park Street East Port Credit ON <i>Well ID: 7330662</i>	WSW/170.9	0.00	197
80	SPL	ONTARIO HYDRO	ELIZABETH AND LAKESHORE MISSISSAUGA TRANSFORMER MISSISSAUGA CITY ON	SE/172.0	0.00	199
81	WWIS		78 PARK ST. E MISSISSAUGA ON <i>Well ID: 7341887</i>	N/172.1	-1.00	200
82	EHS		70 Park St E Mississauga ON L5G 1M5	NNW/174.8	-1.00	204
83	WWIS		78 PARK ST. E Mississauga ON <i>Well ID: 7380344</i>	N/174.9	-1.00	204
84	BORE		ON	WNW/174.9	-1.00	206
85	GEN	SEAWAY CLEANERS	103 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E2	ESE/176.6	0.00	207
85	GEN	SEAWAY CLEANERS	103 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E2	ESE/176.6	0.00	208

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>85</u>	GEN	SEAWAY CLEANERS 34-063	103 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E2	ESE/176.6	0.00	<u>208</u>
<u>85</u>	GEN	SEAWAY CLE(OUT OF BUSINESS)	103 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E2	ESE/176.6	0.00	<u>208</u>
<u>85</u>	EHS		103 Lakeshore Road East Port Credit ON L5G 1E2	ESE/176.6	0.00	<u>209</u>
<u>85</u>	GEN	2539762 ONTARIO LTD. KEVIN LaROSE TEAM	103 LAKESHORE ROAD EAST MISSISSAUGA ON	ESE/176.6	0.00	<u>209</u>
<u>85</u>	GEN	2539762 ONTARIO LTD. KEVIN LaROSE TEAM	103 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E2	ESE/176.6	0.00	<u>209</u>
<u>85</u>	GEN	2539762 ONTARIO LTD. KEVIN LaROSE TEAM	103 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E2	ESE/176.6	0.00	<u>210</u>
<u>86</u>	WWIS		ON Well ID: 7267968	ENE/176.8	0.00	<u>210</u>
<u>87</u>	WWIS		LAKESHORE 91/99 Mississauga ON Well ID: 7148420	ESE/177.2	0.00	<u>211</u>
<u>88</u>	EHS		107-113 Lakeshore Road East Mississauga/Port Credit ON L5G 1E2	ESE/178.4	0.00	<u>214</u>
<u>89</u>	WWIS		103 LAKESHORE RD E MISSISSAUGA ON Well ID: 7183814	ESE/179.3	0.00	<u>214</u>
<u>90</u>	RSC	Scott Insley	6 ANN ST ON MISSISSAUGA ON	ENE/179.7	0.00	<u>217</u>
<u>91</u>	BORE		ON	NE/180.4	0.00	<u>218</u>
<u>92</u>	GEN	MISSISSAUGA HYDRO (PCB)	15 STAVEBANK ROAD C/O 3240 MAVIS ROAD MISSISSUAGA ON L5G 2T3	SSW/180.5	0.00	<u>220</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>92</u>	GEN	MISSISSAUGA HYDRO (PCB) 00-000	15 STAVEBANK ROAD C/O 3240 MAVIS ROAD MISSISSAUGA ON L5G 2T3	SSW/180.5	0.00	<u>220</u>
<u>93</u>	PES	LOBLAWS SUPERMARKETS LTD. #164-0	99 LAKESHORE ROAD PORT CREDIT ON M4T 2S5	ESE/181.7	0.00	<u>220</u>
<u>93</u>	PES	815957 ONTARIO LIMITED BRIAN'S NO FRILLS	99 LAKESHORE ROAD PORT CREDIT ON M9R 1Y5	ESE/181.7	0.00	<u>220</u>
<u>93</u>	SPL	TRANSPORT TRUCK	99 LAKE SHORE DR. E. MOTOR VEHICLE (OPERATING FLUID) MISSISSAUGA CITY ON	ESE/181.7	0.00	<u>221</u>
<u>93</u>	PES	1382019 ONTARIO LTD/MURPHY'S NO FRILLS	99 LAKESHORE RD E PORT CREDIT ON L5G1E2	ESE/181.7	0.00	<u>222</u>
<u>93</u>	GEN	Loblaw Properties Limited	99 Lakeshore Rd. West Mississauga ON L5G 1E2	ESE/181.7	0.00	<u>222</u>
<u>93</u>	PES	LOBLAWS INC. O/A NO FRILLS #1353	99 LAKESHORE RD E MISSISSAUGA ON L5G 1E2	ESE/181.7	0.00	<u>222</u>
<u>93</u>	PES	LOBLAWS INC. O/A NO FRILLS #1353	99 LAKESHORE RD E MISSISSAUGA ON L5G 1E2	ESE/181.7	0.00	<u>223</u>
<u>93</u>	EHS		99 Lakeshore Road East Mississauga ON L5G 1E2	ESE/181.7	0.00	<u>223</u>
<u>93</u>	PES	2307036 ONTARIO LTD	99 LAKESHORE RD. E. MISSISSAUGA ON L5G 1E2	ESE/181.7	0.00	<u>223</u>
<u>93</u>	PES	2307036 ONTARIO LTD	99 LAKESHORE RD. E. MISSISSAUGA ON L5G1E2	ESE/181.7	0.00	<u>224</u>
<u>93</u>	PES	1382019 ONTARIO LTD/MURPHY'S NO FRILLS	99 LAKESHORE RD E PORT CREDIT ON L5G1E2	ESE/181.7	0.00	<u>224</u>
<u>93</u>	PES	1052900 ONTARIO INC./ROB'S NO FRILLS	99 LAKESHORE ROAD EAST PORT CREDIT ON L5G1E2	ESE/181.7	0.00	<u>224</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>93</u>	PES	LOBLAWS INC. O/A RUSTY'S NO FRILLS #102	99 LAKESHORE RD E MISSISSAUGA ON L5G1E2	ESE/181.7	0.00	<u>225</u>
<u>94</u>	EHS		28 Elizabeth St N Mississauga ON L5G 2Z6	WNW/182.1	-1.00	<u>225</u>
<u>95</u>	WWIS		22 ANN ST. MISSISSAUGA ON Well ID: 7341861	N/183.7	-1.00	<u>225</u>
<u>96</u>	SPL	FRAM GROUP (CANADA) INC	Ann and High St Mississauga ON	ENE/183.8	0.00	<u>228</u>
<u>97</u>	WWIS		21 Park Street East Port Credit ON Well ID: 7330663	WSW/185.8	0.00	<u>229</u>
<u>98</u>	BORE		ON	NNE/185.8	0.00	<u>232</u>
<u>99</u>	EHS		8 Ann St, 6 Ann St, 10 Ann St. Mississauga ON	ENE/187.3	0.00	<u>233</u>
<u>100</u>	WWIS		78 PARK ST. E MISSISSAUGA ON Well ID: 7341823	N/187.4	-1.00	<u>233</u>
<u>101</u>	GEN	SEAWAY CLEANERS	111 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E2	ESE/188.4	0.00	<u>237</u>
<u>101</u>	GEN	ROSALNAAZ INVESTMENTS INC.	111 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E2	ESE/188.4	0.00	<u>237</u>
<u>101</u>	GEN	2088466 Ontario Limited	111 lakeshore rd E Mississauga ON	ESE/188.4	0.00	<u>238</u>
<u>101</u>	GEN	2088466 Ontario Limited	111 lakeshore rd E Mississauga ON L5G 1E2	ESE/188.4	0.00	<u>238</u>
<u>101</u>	GEN	2088466 Ontario Limited	111 lakeshore rd E Mississauga ON	ESE/188.4	0.00	<u>239</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>101</u>	GEN	2088466 Ontario Limited	111 lakeshore rd E Mississauga ON	ESE/188.4	0.00	<u>240</u>
<u>101</u>	GEN	2088466 Ontario Limited	111 lakeshore rd E Mississauga ON L5G 1E2	ESE/188.4	0.00	<u>240</u>
<u>101</u>	GEN	2088466 Ontario Limited	111 lakeshore rd E Mississauga ON L5G 1E2	ESE/188.4	0.00	<u>241</u>
<u>101</u>	GEN	2088466 Ontario Limited	111 lakeshore rd E Mississauga ON L5G 1E2	ESE/188.4	0.00	<u>241</u>
<u>101</u>	GEN	2088466 Ontario Limited	111 lakeshore rd E Mississauga ON L5G 1E2	ESE/188.4	0.00	<u>242</u>
<u>101</u>	CDRY	Seaway Cleaners	111 Lakeshore Rd E Mississauga ON L5G1E2	ESE/188.4	0.00	<u>242</u>
<u>101</u>	GEN	2088466 Ontario Limited	111 lakeshore rd E Mississauga ON L5G 1E2	ESE/188.4	0.00	<u>242</u>
<u>101</u>	GEN	2088466 Ontario Limited	111 lakeshore rd E Mississauga ON L5G 1E2	ESE/188.4	0.00	<u>243</u>
<u>102</u>	EHS		23 Helene St N Mississauga ON L5G 3B6	NNW/189.6	-1.00	<u>245</u>
<u>103</u>	BORE		ON	WNW/189.9	-1.00	<u>245</u>
<u>104</u>	WWIS		Park Street & Hurontario Street Mississauga ON Well ID: 7398227	NE/190.0	0.00	<u>247</u>
<u>104</u>	WWIS		Park Street & Hurontario Street Mississauga ON Well ID: 7398228	NE/190.0	0.00	<u>250</u>
<u>105</u>	WWIS		99 LAKESHORE RD PORT CREDIT ON Well ID: 7211007	SE/190.5	0.00	<u>253</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
106	WWIS		78 Park St E Mississauga ON Well ID: 7390272	N/191.2	-1.00	256
107	WWIS		ON Well ID: 7296325	WSW/191.5	0.00	258
108	SPL		13 Stavebank Road NORTH Mississauga ON	S/191.6	0.00	259
109	WWIS		103 LAKESHORE RD E Mississauga ON Well ID: 7187902	ESE/191.8	0.00	260
110	BORE		ON	SW/193.0	0.00	263
111	BORE		ON	WNW/195.9	-1.00	264
112	BORE		ON	SSW/197.6	0.00	265
113	BORE		ON	NW/197.9	-1.00	267
114	GEN	MISSISSAUGA HYDRO PCB	12 PARK ST. EAST C/O 3355 MAVIS RD. MISSISSAUGA ON L5G 1L5	WSW/199.0	0.00	268
114	GEN	MISSISSAUGA HYDRO PCB 00-000	12 PARK ST. EAST C/O 3355 MAVIS RD. MISSISSAUGA ON L5G 1L5	WSW/199.0	0.00	269
115	RSC	10 WEST GO GP INC. AS GENERAL PARTNER BY AND ON BEHALF OF 10 WEST GO LP	17 ANN STREET ON Mississauga ON	NE/199.8	0.00	269
116	SCT	Sungalia G Dr	115 Lakeshore Rd E Mississauga ON L5G 1E5	ESE/200.4	0.00	269
116	SCT	Waterside Dental	115 Lakeshore Rd E Mississauga ON L5G 1E5	ESE/200.4	0.00	270

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>116</u>	EHS		115 Lakeshore Road East Mississauga ON L5G 1E5	ESE/200.4	0.00	<u>270</u>
<u>117</u>	BORE		ON	ENE/200.7	0.00	<u>270</u>
<u>118</u>	WWIS		15 STAVEBANK ROAD SOUTH MISSISSAUGA ON Well ID: 7046642	SSE/201.4	0.00	<u>272</u>
<u>119</u>	BORE		ON	ESE/201.6	0.00	<u>274</u>
<u>120</u>	SCT	Doyle Botterell Sailmakers	117 Lakeshore Rd E Suite 336 Mississauga ON L5G 4T6	ESE/201.8	0.00	<u>277</u>
<u>120</u>	SCT	Westacott Organs	117 Lakeshore Rd E Suite 343 Mississauga ON L5G 4T6	ESE/201.8	0.00	<u>277</u>
<u>120</u>	SCT	Canadian Wiping Cloth Company	126-117 Lakeshore Road East Mississauga ON L5G 4T6	ESE/201.8	0.00	<u>277</u>
<u>120</u>	SCT	Axis Communications Inc.	117 Lakeshore Rd E Mississauga ON L5G 1E5	ESE/201.8	0.00	<u>277</u>
<u>120</u>	GEN	industrial piping & plumbing ltd	117 lakeshore rd east #359 mississauga ON	ESE/201.8	0.00	<u>278</u>
<u>121</u>	WWIS		20 STAVEBANK DR MISSISSAUGA ON Well ID: 7168027	SSW/202.3	0.00	<u>278</u>
<u>122</u>	GEN	SKINNER & MIDDLEBROOK LTD.	128 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E4	E/202.4	0.00	<u>281</u>
<u>122</u>	GEN	SKINNER & MIDDLEBROOK LTD. 44-252	128 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E4	E/202.4	0.00	<u>281</u>
<u>122</u>	GEN	SKINNER & MIDDLEBROOK LTD	128 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E4	E/202.4	0.00	<u>281</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>122</u>	GEN	Skinner & Middlebrook Ltd.	128 Lakeshore Rd.E. Mississauga ON L5G 1E4	E/202.4	0.00	<u>282</u>
<u>122</u>	GEN	Skinner & Middlebrook Ltd.	128 Lakeshore Rd.E. Mississauga ON L5G 1E4	E/202.4	0.00	<u>282</u>
<u>122</u>	GEN	Skinner & Middlebrook Ltd.	128 Lakeshore Rd.E. Mississauga ON L5G 1E4	E/202.4	0.00	<u>283</u>
<u>122</u>	GEN	Skinner & Middlebrook Ltd.	128 Lakeshore Rd.E. Mississauga ON L5G 1E4	E/202.4	0.00	<u>283</u>
<u>122</u>	GEN	Skinner & Middlebrook Ltd	128 Lakeshore Rd.E. Mississauga ON L5G 1E4	E/202.4	0.00	<u>283</u>
<u>122</u>	GEN	Skinner & Middlebrook Ltd	128 Lakeshore Rd.E. Mississauga ON L5G 1E4	E/202.4	0.00	<u>284</u>
<u>122</u>	GEN	Skinner & Middlebrook Ltd	128 Lakeshore Rd.E. Mississauga ON L5G 1E4	E/202.4	0.00	<u>284</u>
<u>123</u>	EHS		128 Lakeshore Road East Mississauga ON L5G 1E4	E/202.8	0.00	<u>285</u>
<u>124</u>	RSC	10 WEST GO GP INC. AS GENERAL PARTNER BY AND ON BEHALF OF 10 WEST GO LP	84 HIGH STREET EAST ON Mississauga ON	NE/202.8	0.00	<u>286</u>
<u>125</u>	WWIS		103 LAKESHORE ROAD EAST Mississauga ON Well ID: 7157715	ESE/203.3	0.00	<u>286</u>
<u>126</u>	CA	1227942 Ontario Limited	121 Lakeshore Road East Mississauga ON	E/203.3	0.00	<u>289</u>
<u>126</u>	CA	1227942 Ontario Limited	121 Lakeshore Road East Mississauga ON	E/203.3	0.00	<u>289</u>
<u>126</u>	ECA	1227942 Ontario Limited	121 Lakeshore Rd E Mississauga ON L5G 1E5	E/203.3	0.00	<u>290</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>126</u>	ECA	1227942 Ontario Limited	121 Lakeshore Rd E Mississauga ON L5G 1E5	E/203.3	0.00	<u>290</u>
<u>127</u>	EHS		24 Ann St Mississauga ON L5G 3G1	N/203.6	-1.00	<u>290</u>
<u>128</u>	EHS		128 Lakeshore Rd E Mississauga ON L5G 1E4	E/204.0	0.00	<u>290</u>
<u>129</u>	EHS		89 High Street East Mississauga ON L5G 3E7	ENE/205.6	0.00	<u>291</u>
<u>130</u>	RSC	10 WEST GO GP INC. AS GENERAL PARTNER BY AND ON BEHALF OF 10 WEST GO LP	19 ANN STREET ON Mississauga ON	NNE/206.1	0.00	<u>291</u>
<u>131</u>	SCT	SICOTEL LTD.	81 LAKESHORE RD E MISSISSAUGA ON L5G 1C9	SSE/206.8	0.00	<u>291</u>
<u>131</u>	PES	MELL-BURN LAWN CARE SERVICE	81 LAKESHORE RD.E. BOX 45035 MISSISSAUGA ON L5G4S7	SSE/206.8	0.00	<u>292</u>
<u>132</u>	BORE		ON	SE/207.2	0.00	<u>292</u>
<u>133</u>	WWIS		PORT CREDIT GO STATION PORT CREDIT ON Well ID: 7321813	NW/208.2	-1.00	<u>293</u>
<u>134</u>	WWIS		LAKE SHORE 91/99 ON Well ID: 7148419	ESE/208.8	0.00	<u>297</u>
<u>135</u>	BORE		ON	NW/209.4	-1.00	<u>300</u>
<u>136</u>	WWIS		103 LAKESHORE ROAD EAST Mississauga ON Well ID: 7157717	ESE/209.6	0.00	<u>301</u>
<u>137</u>	WWIS		113 LAKESHORE BLVD. 107 Mississauga ON Well ID: 7109074	ESE/209.7	0.00	<u>303</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>138</u>	WWIS		103 LAKESHORE RD E Mississauga ON Well ID: 7187901	ESE/210.2	0.00	<u>307</u>
<u>139</u>	WWIS		103 LAKESHORE RD E MISSISSAUGA ON Well ID: 7183549	ESE/210.2	0.00	<u>310</u>
<u>140</u>	WWIS		Park Street & Hurontario Street Mississauga ON Well ID: 7398231	NNE/210.5	-0.08	<u>313</u>
<u>141</u>	BORE		ON	N/211.3	-1.00	<u>317</u>
<u>142</u>	WWIS		Park Street & Hurontario Street Mississauga ON Well ID: 7398226	NNE/211.4	0.00	<u>318</u>
<u>143</u>	EHS		83 Lakeshore Rd E Mississauga ON L5G1C9	SE/212.8	0.00	<u>321</u>
<u>144</u>	GEN	Enersource Hydro Mississauga	5 Ann Street Mississauga ON L5G 3E8	ENE/214.6	0.00	<u>321</u>
<u>145</u>	EHS		n/a Mississauga ON	NNW/214.9	-1.00	<u>321</u>
<u>146</u>	SCT	Custom CD Corporation	50 Lakeshore Rd E Suite 200 Mississauga ON L5G 1E1	S/215.1	0.00	<u>322</u>
<u>147</u>	WWIS		113 LAKESHORE RD. E. #107 Mississauga ON Well ID: 7133398	ESE/215.1	0.00	<u>322</u>
<u>148</u>	WWIS		103 LAKESHORE ROAD EAST Mississauga ON Well ID: 7157716	ESE/215.3	0.00	<u>325</u>
<u>149</u>	WWIS		103 LAKESHORE RD E Mississauga ON Well ID: 7187903	ESE/216.0	0.00	<u>328</u>
<u>150</u>	WWIS		103 LAKESHORE RD E MISSISSAUGA ON Well ID: 7183548	ESE/216.0	0.00	<u>332</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>151</u>	WWIS		30 Queen St East Mississauga ON Well ID: 7363632	NNE/216.1	-1.05	<u>335</u>
<u>152</u>	BORE		ON	NNW/216.1	-1.00	<u>338</u>
<u>153</u>	WWIS		30 QUEEN ST E Mississauga ON Well ID: 7234471	NW/216.9	-1.00	<u>340</u>
<u>153</u>	GEN	Metrolinx	30 Queen Street East Mississauga ON L5H 1L4	NW/216.9	-1.00	<u>342</u>
<u>153</u>	GEN	Metrolinx	30 Queen Street East Mississauga ON L5H 1L4	NW/216.9	-1.00	<u>343</u>
<u>153</u>	GEN	Metrolinx	30 Queen Street East Mississauga ON L5H 1L4	NW/216.9	-1.00	<u>343</u>
<u>153</u>	GEN	Metrolinx	30 Queen Street East Mississauga ON L5H 1L4	NW/216.9	-1.00	<u>344</u>
<u>153</u>	GEN	Metrolinx	30 Queen Street East Mississauga ON L5G 3B7	NW/216.9	-1.00	<u>344</u>
<u>153</u>	GEN	Metrolinx	30 Queen St E Mississauga ON L5G 3B7	NW/216.9	-1.00	<u>345</u>
<u>153</u>	GEN	Metrolinx	30 Queen Street East Mississauga ON L5H 1L4	NW/216.9	-1.00	<u>346</u>
<u>153</u>	PTTW	Salini Impregilo Civil Works Inc.	30 Queen Street East Mississauga, ON Canada ON	NW/216.9	-1.00	<u>346</u>
<u>153</u>	GEN	Metrolinx	30 Queen Street East Mississauga ON L5H 1L4	NW/216.9	-1.00	<u>347</u>
<u>153</u>	EASR	Salini Impregilo Civil Works Inc.	30 Queen ST E Mississauga ON L5R 4G7	NW/216.9	-1.00	<u>347</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>153</u>	GEN	Mobilinx	30 Queen Street East Mississauga ON L5G 4N6	NW/216.9	-1.00	<u>347</u>
<u>153</u>	GEN	Metrolinx	30 Queen Street East Mississauga ON L5H 1L4	NW/216.9	-1.00	<u>348</u>
<u>153</u>	GEN	Mobilinx	30 Queen Street East Mississauga ON L5G 4N6	NW/216.9	-1.00	<u>350</u>
<u>153</u>	SPL	Metrolinx	30 Queen Street East Mississauga, ON MISSISSAUGA ON	NW/216.9	-1.00	<u>351</u>
<u>154</u>	BORE		ON	NNE/218.5	-0.17	<u>352</u>
<u>155</u>	BORE		ON	ENE/219.0	0.00	<u>354</u>
<u>156</u>	WWIS		STAVEBANK RD PORT CREDIT ON Well ID: 4909856	S/219.4	0.00	<u>355</u>
<u>157</u>	WWIS		10 STAREBANK MISSISSAUGA ON Well ID: 4909501	SSW/219.5	0.00	<u>357</u>
<u>158</u>	EHS		42 PORT ST E. & 91-93, 99 LAKESHORE RD E., PORT CREDIT Mississauga ON L5G 1E2	SE/219.5	0.00	<u>360</u>
<u>159</u>	WWIS		20 STAVEBANK DR MISSISSAUGA ON Well ID: 7168029	SSW/220.9	0.00	<u>361</u>
<u>160</u>	GEN	PAT IACOVETTA CLEANERS (HUTONE)	14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	SSW/221.7	0.00	<u>363</u>
<u>160</u>	GEN	PAT IACOVETTA CLEANERS (HUTONE)	14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	SSW/221.7	0.00	<u>363</u>
<u>160</u>	GEN	PAT IACOVETTA CLEANERS (HUTONE) 30-096	14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	SSW/221.7	0.00	<u>364</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>160</u>	GEN	PAT (OUT OF BUS)	14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	SSW/221.7	0.00	<u>364</u>
<u>160</u>	GEN	HUTONE CLEANERS	14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	SSW/221.7	0.00	<u>364</u>
<u>160</u>	GEN	HUTONE CLEANERS	14 STAVEBANK ROAD NORTH MISSISSAUGA ON	SSW/221.7	0.00	<u>365</u>
<u>160</u>	GEN	HUTONE CLEANERS	14 STAVEBANK ROAD NORTH MISSISSAUGA ON	SSW/221.7	0.00	<u>365</u>
<u>160</u>	GEN	HUTONE CLEANERS	14 STAVEBANK ROAD NORTH MISSISSAUGA ON	SSW/221.7	0.00	<u>366</u>
<u>160</u>	GEN	HUTONE CLEANERS	14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	SSW/221.7	0.00	<u>366</u>
<u>160</u>	GEN	HUTONE CLEANERS	14 STAVEBANK ROAD NORTH MISSISSAUGA ON	SSW/221.7	0.00	<u>367</u>
<u>160</u>	GEN	HUTONE CLEANERS	14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	SSW/221.7	0.00	<u>367</u>
<u>160</u>	GEN	HUTONE CLEANERS	14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	SSW/221.7	0.00	<u>367</u>
<u>160</u>	GEN	HUTONE CLEANERS	14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	SSW/221.7	0.00	<u>368</u>
<u>160</u>	GEN	HUTONE CLEANERS	14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	SSW/221.7	0.00	<u>368</u>
<u>160</u>	CDRY	Hutone Cleaners - Mississauga	14 Stavebank Rd Mississauga ON L5G2T4	SSW/221.7	0.00	<u>369</u>
<u>160</u>	GEN	HUTONE CLEANERS	14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	SSW/221.7	0.00	<u>370</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>160</u>	GEN	HUTONE CLEANERS	14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	SSW/221.7	0.00	<u>370</u>
<u>161</u>	EHS		84 & 90 High Street East Mississauga ON L5G 1K4	NE/222.2	0.00	<u>373</u>
<u>162</u>	SPL		Mary Fix Creek, north of the Port Credit Go Station MISSISSAUGA ON	NW/223.3	-1.00	<u>373</u>
<u>163</u>	BORE		ON	SW/223.6	0.00	<u>374</u>
<u>164</u>	BORE		ON	NNE/223.9	-1.15	<u>375</u>
<u>165</u>	WWIS		PORT CREDIT GO STATION PORT CREDIT ON Well ID: 7321814	WNW/224.3	-1.00	<u>377</u>
<u>166</u>	SCT	DISTANT HORIZON MARINE	6 ELIZABETH ST S MISSISSAUGA ON L5G 2Y5	SE/225.4	-0.13	<u>380</u>
<u>167</u>	SPL	The Corporation of the City of Mississauga	12 Stavbank Road Mississauga ON	SSW/225.6	0.00	<u>380</u>
<u>167</u>	SPL		12 Stavebank Road Mississauga ON L5G 2T4	SSW/225.6	0.00	<u>381</u>
<u>167</u>	RST	CREDIT VILLAGE MARINA	12 STAVEBANK RD MISSISSAUGA ON L5G 2T4	SSW/225.6	0.00	<u>382</u>
<u>167</u>	RST	CREDIT VILLAGE MARINA	12 STAVEBANK RD MISSISSAUGA ON L5G2T4	SSW/225.6	0.00	<u>382</u>
<u>167</u>	SPL	Credit Village Marina-Port Credit Harbour	12 Stavebank Road Mississauga ON	SSW/225.6	0.00	<u>382</u>
<u>168</u>	EHS		Ann Street and High Street East Mississauga ON L5G	NE/225.7	0.00	<u>383</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>169</u>	BORE		ON	NW/226.3	-1.00	<u>383</u>
<u>170</u>	WWIS		LAKE SHORE 91/99 Mississauga ON Well ID: 7148418	SE/226.5	0.00	<u>384</u>
<u>171</u>	EHS		High St. E., Ann St. Mississauga ON L5G	NE/226.8	0.00	<u>387</u>
<u>172</u>	BORE		ON	ENE/227.9	0.00	<u>387</u>
<u>173</u>	WWIS		26 ANN ST. MISSISSAUGA ON Well ID: 7341844	N/228.3	-1.00	<u>389</u>
<u>173</u>	WWIS		26 ANN ST. MISSISSAUGA ON Well ID: 7341883	N/228.3	-1.00	<u>392</u>
<u>174</u>	BORE		ON	WSW/228.4	0.00	<u>396</u>
<u>175</u>	EHS		129 Lakeshore Road East Mississauga ON L5G 1E5	E/229.7	0.00	<u>397</u>
<u>176</u>	WWIS		91 Park Street East Mississauga ON Well ID: 7408553	NE/231.2	0.00	<u>397</u>
<u>177</u>	BORE		ON	ENE/233.5	0.00	<u>400</u>
<u>178</u>	WWIS		99 LAKESHORE RD PORT CREDIT ON Well ID: 7211009	ESE/233.9	-0.22	<u>401</u>
<u>179</u>	WWIS		Park Street & Hurontario Street Mississauga ON Well ID: 7398230	NE/234.3	0.00	<u>404</u>
<u>180</u>	WWIS		Park Street & Hurontario Street Mississauga ON Well ID: 7398199	NNE/234.8	0.00	<u>407</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
181	PINC		90 High Street East, Mississauga ON	NE/235.2	0.00	410
181	EHS		90 High St E Mississauga ON L5G1K4	NE/235.2	0.00	411
181	RSC	10 WEST GO GP INC. AS GENERAL PARTNER BY AND ON BEHALF OF 10 WEST GO LP	90 HIGH STREET EAST ON Mississauga ON	NE/235.2	0.00	411
182	BORE		ON	ESE/236.8	0.00	412
183	WWIS		91 Park Street East Mississauga ON Well ID: 7408550	NNE/238.0	0.00	413
184	WWIS		ON Well ID: 7330113	N/238.7	-0.65	416
185	EHS		91 Park St E Mississauga ON L5G4W1	NE/239.1	0.00	416
186	EHS		88 Park Street East Mississauga ON L5G 2Z6	NNE/239.2	-0.89	417
187	BORE		ON	NW/239.9	-1.00	417
188	WWIS		91 Park Street East Mississauga ON Well ID: 7408551	NNE/241.2	0.00	418
189	GEN	VALLEY CLEANERS	53 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1C9	SSE/241.2	-0.11	420
189	GEN	VALLEY CLEANERS 40-068	53 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1C9	SSE/241.2	-0.11	421
190	WWIS		Park Street & Hurontario Street Mississauga ON Well ID: 7398198	NNE/241.5	0.00	421

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
190	WWIS		Park Street & Hurontario Street Mississauga ON Well ID: 7398229	NNE/241.5	0.00	424
191	BORE		ON	NW/242.0	-1.00	427
192	BORE		ON	WNW/242.2	-1.00	428
193	WWIS		PORT CREDIT GO STATION PORT CREDIT ON Well ID: 7243496	NW/242.3	-1.00	429
194	BORE		ON	WNW/242.6	-0.37	432
195	CA	R.M. OF PEEL	STAVEBANK RD./LAKESHORE RD. MISSISSAUGA CITY ON	S/243.7	-0.50	433
195	CA	R.M. OF PEEL	STAVEBANK RD.S./LAKESHORE RD.W MISSISSAUGA CITY ON	S/243.7	-0.50	433
195	CA	R.M. OF PEEL	STAVEBANK RD./LAKESHORE RD. MISSISSAUGA CITY ON	S/243.7	-0.50	433
196	EHS		91 Park St E Mississauga ON L5G4W1	NNE/243.9	0.00	434
197	WWIS		91 Park Street East Mississauga ON Well ID: 7408552	NNE/244.3	0.00	434
198	WWIS		20 STAVEBANK DR MISSISSAUGA ON Well ID: 7168028	SSW/244.5	0.00	436
199	GEN	Edwards lakeside Veterinary Clinic	46 Port Street East Mississauga ON L5G 1C1	ESE/244.6	-0.84	438
199	GEN	Edwards lakeside Veterinary Clinic	46 Port Street East Mississauga ON L5G 1C1	ESE/244.6	-0.84	439

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>199</u>	GEN	Edwards lakeside Veterinary Clinic	46 Port Street East Mississauga ON L5G 1C1	ESE/244.6	-0.84	<u>439</u>
<u>199</u>	GEN	Edwards lakeside Veterinary Clinic	46 Port Street East Mississauga ON L5G 1C1	ESE/244.6	-0.84	<u>440</u>
<u>199</u>	GEN	Edwards lakeside Veterinary Clinic	46 Port Street East Mississauga ON L5G 1C1	ESE/244.6	-0.84	<u>440</u>
<u>199</u>	GEN	Edwards lakeside Veterinary Clinic	46 Port Street East Mississauga ON L5G 1C1	ESE/244.6	-0.84	<u>440</u>
<u>200</u>	WWIS		port credit go station Mississauga ON Well ID: 7355171	N/244.6	-0.28	<u>442</u>
<u>201</u>	SPL	Souvlaki Hut	51 Lakeshore Rd E Mississauga ON NA	SSE/244.9	-0.48	<u>446</u>
<u>202</u>	PES	BBF'S INC.	47 LAKESHORE RD E MISSISSAUGA ON L5G1C9	SSE/245.3	-0.49	<u>447</u>
<u>203</u>	SCT	ENGINEERED MANAGEMENT SYSTEMS	34 Lakeshore Rd E Mississauga ON L5G 1C8	SSW/245.9	-0.52	<u>447</u>
<u>203</u>	SCT	Engineered Management Systems Inc.	34 Lakeshore Rd E Mississauga ON L5G 1C8	SSW/245.9	-0.52	<u>448</u>
<u>203</u>	GEN	Credit Valley Investments Limited	34 Lakeshore Road East Mississauga ON L5G 1C8	SSW/245.9	-0.52	<u>448</u>
<u>204</u>	EHS		LSW Stage 5 Toronto ON	NNW/246.6	-1.00	<u>448</u>
<u>205</u>	INC		9 HELENE STREET SOUTH, MISSISSAUGA ON	ESE/247.2	-0.50	<u>448</u>
<u>206</u>	DTNK	Credit Valley Investments Ltd.	34-48 Lakeshore Rd. E., Mississauga MISSISSAUGA ON L5G 1C8	S/247.7	-0.48	<u>449</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
206	CFOT	CREDIT VALLEY NVESTMENTS LTD	34-48 LAKESHORE ROAD EAST MISSISSAUGA ON	S/247.7	-0.48	450
207	BORE		ON	NNW/248.0	-0.62	450
208	EHS		39 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1C9	S/248.1	-0.50	451
209	SCT	EXCALIBUR INT'L CONSULTANTS	10 Hurontario St Mississauga ON L5G 3G7	ENE/248.3	0.00	452
209	SCT	Excalibur International Consultants Ltd.	10 Hurontario St Mississauga ON L5G 3G7	ENE/248.3	0.00	452
210	BORE		ON	ENE/249.3	-0.19	452

Executive Summary: Summary By Data Source

BORE - Borehole

A search of the BORE database, dated 1875-Jul 2018 has found that there are 62 BORE site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON	SSE	40.61	<u>2</u>
	ON	ESE	43.83	<u>3</u>
	ON	E	50.29	<u>5</u>
	ON	ENE	57.83	<u>6</u>
	ON	SW	58.38	<u>7</u>
	ON	WSW	67.61	<u>9</u>
	ON	N	76.19	<u>10</u>
	ON	E	79.85	<u>12</u>
	ON	W	81.36	<u>13</u>
	ON	W	87.19	<u>15</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON	ENE	91.23	<u>16</u>
	ON	SSE	91.63	<u>17</u>
	ON	SSW	98.06	<u>19</u>
	ON	S	99.72	<u>20</u>
	ON	N	111.57	<u>25</u>
	ON	SSW	116.97	<u>27</u>
	ON	S	119.61	<u>29</u>
	ON	ENE	127.64	<u>37</u>
	ON	W	129.28	<u>38</u>
	ON	S	134.98	<u>43</u>
	ON	SSE	135.82	<u>44</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON	SSW	141.15	<u>47</u>
	ON	E	142.26	<u>49</u>
	ON	SSE	142.56	<u>50</u>
	ON	SW	152.78	<u>59</u>
	ON	WSW	155.66	<u>62</u>
	ON	ESE	166.74	<u>69</u>
	ON	NE	180.40	<u>91</u>
	ON	NNE	185.85	<u>98</u>
	ON	SW	192.98	<u>110</u>
	ON	SSW	197.58	<u>112</u>
	ON	ENE	200.72	<u>117</u>
	ON	ESE	201.60	<u>119</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON	SE	207.24	<u>132</u>
	ON	ENE	219.01	<u>155</u>
	ON	SW	223.65	<u>163</u>
	ON	ENE	227.87	<u>172</u>
	ON	WSW	228.39	<u>174</u>
	ON	ENE	233.50	<u>177</u>
	ON	ESE	236.82	<u>182</u>
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON	NW	83.96	<u>14</u>
	ON	NW	107.16	<u>24</u>
	ON	NW	124.69	<u>33</u>
	ON	NW	126.10	<u>34</u>

ON	W	127.48	<u>36</u>
ON	NW	163.49	<u>66</u>
ON	WNW	174.87	<u>84</u>
ON	WNW	189.92	<u>103</u>
ON	WNW	195.91	<u>111</u>
ON	NW	197.85	<u>113</u>
ON	NW	209.38	<u>135</u>
ON	N	211.33	<u>141</u>
ON	NNW	216.10	<u>152</u>
ON	NNE	218.53	<u>154</u>
ON	NNE	223.91	<u>164</u>
ON	NW	226.32	<u>169</u>

ON	NW	239.86	187
ON	NW	241.98	191
ON	WNW	242.23	192
ON	WNW	242.65	194
ON	NNW	248.00	207
ON	ENE	249.33	210

CA - Certificates of Approval

A search of the CA database, dated 1985-Oct 30, 2011* has found that there are 6 CA site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Kanco-55 Park Ltd.	55 Park St E Mississauga ON	NW	64.74	8
1227942 Ontario Limited	121 Lakeshore Road East Mississauga ON	E	203.32	126
1227942 Ontario Limited	121 Lakeshore Road East Mississauga ON	E	203.32	126
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
R.M. OF PEEL	STAVEBANK RD./LAKESHORE RD. MISSISSAUGA CITY ON	S	243.69	195

R.M. OF PEEL	STAVEBANK RD.S./LAKESHORE RD. W MISSISSAUGA CITY ON	S	243.69	195
R.M. OF PEEL	STAVEBANK RD./LAKESHORE RD. MISSISSAUGA CITY ON	S	243.69	195

CDRY - Dry Cleaning Facilities

A search of the CDRY database, dated Jan 2004-Dec 2022 has found that there are 2 CDRY site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Seaway Cleaners	111 Lakeshore Rd E Mississauga ON L5G1E2	ESE	188.39	101
Hutone Cleaners - Mississauga	14 Stavebank Rd Mississauga ON L5G2T4	SSW	221.73	160

CFOT - Commercial Fuel Oil Tanks

A search of the CFOT database, dated Oct 2023 has found that there are 2 CFOT site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
BELL CANADA	80 HIGH ST E MISSISSAUGA ON	NE	151.78	57

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
CREDIT VALLEY NVESTMENTS LTD	34-48 LAKESHORE ROAD EAST MISSISSAUGA ON	S	247.71	206

DTNK - Delisted Fuel Tanks

A search of the DTNK database, dated Oct 2023 has found that there are 4 DTNK site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON L5G 1E4	E	152.00	58

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON	E	152.00	58
V V GAS AND WASH	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON	E	152.00	58

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Credit Valley Investments Ltd.	34-48 Lakeshore Rd. E., Mississauga MISSISSAUGA ON L5G 1C8	S	247.71	206

EASR - Environmental Activity and Sector Registry

A search of the EASR database, dated Oct 2011-Oct 31, 2024 has found that there are 2 EASR site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
EDENSHAW PARK DEVELOPMENTS LIMITED	21 Park ST E Mississauga ON L5G 1L7	WSW	170.89	79

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Salini Impregilo Civil Works Inc.	30 Queen ST E Mississauga ON L5R 4G7	NW	216.89	153

ECA - Environmental Compliance Approval

A search of the ECA database, dated Oct 2011-Oct 31, 2024 has found that there are 3 ECA site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Kanco-55 Park Ltd.	55 Park St E Mississauga ON L4V 1R9	NW	64.74	8
1227942 Ontario Limited	121 Lakeshore Rd E Mississauga ON L5G 1E5	E	203.32	126

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
1227942 Ontario Limited	121 Lakeshore Rd E Mississauga ON L5G 1E5	E	203.32	126

EHS - ERIS Historical Searches

A search of the EHS database, dated 1999-Aug 31, 2024 has found that there are 47 EHS site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	50 High Street Mississauga ON	-	0.00	1
	12 Helene St N Mississauga ON L5G	ENE	49.59	4
	55 Park Street East Mississauga ON L5G 1L9	NW	64.74	8
	55 Park Street East Mississauga ON	NW	64.74	8
	7 Elizabeth Street North Mississauga ON L5G 2Y8	SE	79.70	11
	7 Elizabeth Street North Mississauga ON	SE	79.70	11
	20 Elizabeth Street North Mississauga ON L5G 2Z1	WSW	101.52	21
	94-100 Lakeshore Road East Mississauga ON L5G 1E3	SE	140.94	46
	30 HIGH STREET EAST MISSISSAUGA ON L5G 1J8	SW	148.29	53

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	30 High Street East Mississauga ON L5G 1J8	SW	148.74	<u>54</u>
	114 Lakeshore Road E Mississauga ON L5G 1E4	E	152.00	<u>58</u>
	80 High Street E Mississauga ON L5G 1K4	NE	155.70	<u>63</u>
	88 Lakeshore Rd. E Mississauga ON L5G 1E1	SSE	157.25	<u>64</u>
	220 220 ON L5G 1K2	NNE	163.42	<u>65</u>
	27 Park St E Mississauga ON L5G1L7	WSW	166.07	<u>68</u>
	26 Park Street East Mississauga ON L5G 1L6	W	167.40	<u>71</u>
	From Front Street northeast to Elmwood Ave S Mississauga ON L5G	ESE	168.21	<u>73</u>
	103 Lakeshore Road East Port Credit ON L5G 1E2	ESE	176.63	<u>85</u>
	107-113 Lakeshore Road East Mississauga/Port Credit ON L5G 1E2	ESE	178.41	<u>88</u>
	99 Lakeshore Road East Mississauga ON L5G 1E2	ESE	181.70	<u>93</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	8 Ann St, 6 Ann St, 10 Ann St. Mississauga ON	ENE	187.29	<u>99</u>
	115 Lakeshore Road East Mississauga ON L5G 1E5	ESE	200.42	<u>116</u>
	128 Lakeshore Road East Mississauga ON L5G 1E4	E	202.78	<u>123</u>
	128 Lakeshore Rd E Mississauga ON L5G 1E4	E	204.04	<u>128</u>
	89 High Street East Mississauga ON L5G 3E7	ENE	205.61	<u>129</u>
	83 Lakeshore Rd E Mississauga ON L5G1C9	SE	212.82	<u>143</u>
	42 PORT ST E. & 91-93, 99 LAKESHORE RD E., PORT CREDIT Mississauga ON L5G 1E2	SE	219.55	<u>158</u>
	84 & 90 High Street East Mississauga ON L5G 1K4	NE	222.21	<u>161</u>
	Ann Street and High Street East Mississauga ON L5G	NE	225.74	<u>168</u>
	High St. E., Ann St. Mississauga ON L5G	NE	226.83	<u>171</u>
	129 Lakeshore Road East Mississauga ON L5G 1E5	E	229.70	<u>175</u>
	90 High St E Mississauga ON L5G1K4	NE	235.19	<u>181</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	91 Park St E Mississauga ON L5G4W1	NE	239.06	<u>185</u>
	91 Park St E Mississauga ON L5G4W1	NNE	243.89	<u>196</u>
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	28 Helene St N Mississauga ON L5G 3B7	NW	146.96	<u>51</u>
	28 Helene Street North Mississauga ON L5G 3B7	NW	146.96	<u>51</u>
	28 Helene Street North Mississauga ON L5G 3B7	NW	146.96	<u>51</u>
	23 Elizabeth Street North Mississauga ON L5G 2Z4	WNW	154.33	<u>60</u>
	28 Elizabeth Street North Mississauga ON L5G 2Z6	W	164.72	<u>67</u>
	70 Park St E Mississauga ON L5G 1M5	NNW	174.81	<u>82</u>
	28 Elizabeth St N Mississauga ON L5G 2Z6	WNW	182.05	<u>94</u>
	23 Helene St N Mississauga ON L5G 3B6	NNW	189.61	<u>102</u>
	24 Ann St Mississauga ON L5G 3G1	N	203.59	<u>127</u>

n/a Mississauga ON	NNW	214.94	145
88 Park Street East Mississauga ON L5G 2Z6	NNE	239.16	186
LSW Stage 5 Toronto ON	NNW	246.61	204
39 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1C9	S	248.12	208

EXP - List of Expired Fuels Safety Facilities

A search of the EXP database, dated Oct 2023 has found that there are 8 EXP site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON	E	152.00	58
CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON	E	152.00	58
CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON	E	152.00	58
CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON	E	152.00	58
CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON	E	152.00	58
CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON	E	152.00	58

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON	E	152.00	58
CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS	114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON	E	152.00	58

GEN - Ontario Regulation 347 Waste Generators Summary

A search of the GEN database, dated 1986-Nov 30, 2022 has found that there are 89 GEN site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
HOOPER'S PHARMACY 19-650	100 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E3	SE	130.35	39
HOOPER'S PHARMACY	100 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E3	SE	130.35	39
PHOTOLINE LABS LTD. 31-649	110 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E3	ESE	140.46	45
PHOTOLINE LABS LTD.	110 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E3	ESE	140.46	45
Bell	80 High St Mississauga ON L5G 1K2	NE	151.78	57
Bell	80 High St Port Credit ON L5G 1K4	NE	151.78	57
Bell	80 High St Mississauga ON L5G 1K2	NE	151.78	57
Bell	80 High St Port Credit ON L5G 1K4	NE	151.78	57

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Bell	80 High St Port Credit ON L5G 1K4	NE	151.78	<u>57</u>
Bell	80 High St Port Credit ON L5G 1K4	NE	151.78	<u>57</u>
Bell	80 High St Port Credit ON L5G 1K4	NE	151.78	<u>57</u>
PETRO CANADA INC.	114 LAKESHORE ROAD E PORT CREDIT ON L5G 1E4	E	152.00	<u>58</u>
PETRO CANADA INC.	114 LAKESHORE RD., EAST MISSISSAUGA C/O 5140 YONGE ST. SUITE 200 NORTH YORK ON L5G 1E4	E	152.00	<u>58</u>
PETRO CANADA INC. 30-570	114 LAKESHORE RD., EAST MISSISSAUGA C/O 5140 YONGE ST. SUITE 200 NORTH YORK ON L5G 1E4	E	152.00	<u>58</u>
Hooper's Pharmacy	88 Lakeshore Road East Mississauga ON L5G 1E1	SSE	157.25	<u>64</u>
Robert Clark Drugs Ltd	88 Lakeshore Rd E Mississauga ON L5G1E1	SSE	157.25	<u>64</u>
SEAWAY CLEANERS	103 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E2	ESE	176.63	<u>85</u>
SEAWAY CLEANERS	103 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E2	ESE	176.63	<u>85</u>
SEAWAY CLEANERS 34-063	103 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E2	ESE	176.63	<u>85</u>
SEAWAY CLE(OUT OF BUSINESS)	103 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E2	ESE	176.63	<u>85</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
2539762 ONTARIO LTD. KEVIN LaROSE TEAM	103 LAKESHORE ROAD EAST MISSISSAUGA ON	ESE	176.63	<u>85</u>
2539762 ONTARIO LTD. KEVIN LaROSE TEAM	103 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E2	ESE	176.63	<u>85</u>
2539762 ONTARIO LTD. KEVIN LaROSE TEAM	103 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E2	ESE	176.63	<u>85</u>
MISSISSAUGA HYDRO (PCB)	15 STAVEBANK ROAD C/O 3240 MAVIS ROAD MISSISSAUGA ON L5G 2T3	SSW	180.45	<u>92</u>
MISSISSAUGA HYDRO (PCB) 00- 000	15 STAVEBANK ROAD C/O 3240 MAVIS ROAD MISSISSAUGA ON L5G 2T3	SSW	180.45	<u>92</u>
Loblaw Properties Limited	99 Lakeshore Rd. West Mississauga ON L5G 1E2	ESE	181.70	<u>93</u>
SEAWAY CLEANERS	111 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E2	ESE	188.39	<u>101</u>
ROSALNAAZ INVESTMENTS INC.	111 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E2	ESE	188.39	<u>101</u>
2088466 Ontario Limited	111 lakeshore rd E Mississauga ON	ESE	188.39	<u>101</u>
2088466 Ontario Limited	111 lakeshore rd E Mississauga ON L5G 1E2	ESE	188.39	<u>101</u>
2088466 Ontario Limited	111 lakeshore rd E Mississauga ON	ESE	188.39	<u>101</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
2088466 Ontario Limited	111 lakeshore rd E Mississauga ON	ESE	188.39	<u>101</u>
2088466 Ontario Limited	111 lakeshore rd E Mississauga ON L5G 1E2	ESE	188.39	<u>101</u>
2088466 Ontario Limited	111 lakeshore rd E Mississauga ON L5G 1E2	ESE	188.39	<u>101</u>
2088466 Ontario Limited	111 lakeshore rd E Mississauga ON L5G 1E2	ESE	188.39	<u>101</u>
2088466 Ontario Limited	111 lakeshore rd E Mississauga ON L5G 1E2	ESE	188.39	<u>101</u>
2088466 Ontario Limited	111 lakeshore rd E Mississauga ON L5G 1E2	ESE	188.39	<u>101</u>
2088466 Ontario Limited	111 lakeshore rd E Mississauga ON L5G 1E2	ESE	188.39	<u>101</u>
MISSISSAUGA HYDRO PCB	12 PARK ST. EAST C/O 3355 MAVIS RD. MISSISSAUGA ON L5G 1L5	WSW	199.01	<u>114</u>
MISSISSAUGA HYDRO PCB 00-000	12 PARK ST. EAST C/O 3355 MAVIS RD. MISSISSAUGA ON L5G 1L5	WSW	199.01	<u>114</u>
industrial piping & plumbing ltd	117 lakeshore rd east #359 misissauga ON	ESE	201.77	<u>120</u>
SKINNER & MIDDLEBROOK LTD.	128 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E4	E	202.38	<u>122</u>
SKINNER & MIDDLEBROOK LTD. 44-252	128 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E4	E	202.38	<u>122</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
SKINNER & MIDDLEBROOK LTD	128 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E4	E	202.38	<u>122</u>
Skinner & Middlebrook Ltd.	128 Lakeshore Rd.E. Mississauga ON L5G 1E4	E	202.38	<u>122</u>
Skinner & Middlebrook Ltd.	128 Lakeshore Rd.E. Mississauga ON L5G 1E4	E	202.38	<u>122</u>
Skinner & Middlebrook Ltd.	128 Lakeshore Rd.E. Mississauga ON L5G 1E4	E	202.38	<u>122</u>
Skinner & Middlebrook Ltd.	128 Lakeshore Rd.E. Mississauga ON L5G 1E4	E	202.38	<u>122</u>
Skinner & Middlebrook Ltd	128 Lakeshore Rd.E. Mississauga ON L5G 1E4	E	202.38	<u>122</u>
Skinner & Middlebrook Ltd	128 Lakeshore Rd.E. Mississauga ON L5G 1E4	E	202.38	<u>122</u>
Skinner & Middlebrook Ltd	128 Lakeshore Rd.E. Mississauga ON L5G 1E4	E	202.38	<u>122</u>
Enersource Hydro Mississauga	5 Ann Street Mississauga ON L5G 3E8	ENE	214.64	<u>144</u>
PAT IACOVETTA CLEANERS (HUTONE)	14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	SSW	221.73	<u>160</u>
PAT IACOVETTA CLEANERS (HUTONE)	14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	SSW	221.73	<u>160</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
PAT IACOVETTA CLEANERS (HUTONE) 30-096	14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	SSW	221.73	<u>160</u>
PAT (OUT OF BUS)	14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	SSW	221.73	<u>160</u>
HUTONE CLEANERS	14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	SSW	221.73	<u>160</u>
HUTONE CLEANERS	14 STAVEBANK ROAD NORTH MISSISSAUGA ON	SSW	221.73	<u>160</u>
HUTONE CLEANERS	14 STAVEBANK ROAD NORTH MISSISSAUGA ON	SSW	221.73	<u>160</u>
HUTONE CLEANERS	14 STAVEBANK ROAD NORTH MISSISSAUGA ON	SSW	221.73	<u>160</u>
HUTONE CLEANERS	14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	SSW	221.73	<u>160</u>
HUTONE CLEANERS	14 STAVEBANK ROAD NORTH MISSISSAUGA ON	SSW	221.73	<u>160</u>
HUTONE CLEANERS	14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	SSW	221.73	<u>160</u>
HUTONE CLEANERS	14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	SSW	221.73	<u>160</u>
HUTONE CLEANERS	14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	SSW	221.73	<u>160</u>
HUTONE CLEANERS	14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	SSW	221.73	<u>160</u>
HUTONE CLEANERS	14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	SSW	221.73	<u>160</u>
HUTONE CLEANERS	14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	SSW	221.73	<u>160</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
HUTONE CLEANERS	14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	SSW	221.73	160
HUTONE CLEANERS	14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	SSW	221.73	160
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
IMH Pool VI-A LP	28 Helene St North Port Credit ON L5G 3B7	NW	146.96	51
Metrolinx	30 Queen Street East Mississauga ON L5H 1L4	NW	216.89	153
Metrolinx	30 Queen Street East Mississauga ON L5H 1L4	NW	216.89	153
Metrolinx	30 Queen Street East Mississauga ON L5H 1L4	NW	216.89	153
Metrolinx	30 Queen Street East Mississauga ON L5H 1L4	NW	216.89	153
Metrolinx	30 Queen Street East Mississauga ON L5G 3B7	NW	216.89	153
Metrolinx	30 Queen St E Mississauga ON L5G 3B7	NW	216.89	153
Metrolinx	30 Queen Street East Mississauga ON L5H 1L4	NW	216.89	153
Metrolinx	30 Queen Street East Mississauga ON L5H 1L4	NW	216.89	153

Mobilinx	30 Queen Street East Mississauga ON L5G 4N6	NW	216.89	<u>153</u>
Metrolinx	30 Queen Street East Mississauga ON L5H 1L4	NW	216.89	<u>153</u>
Mobilinx	30 Queen Street East Mississauga ON L5G 4N6	NW	216.89	<u>153</u>
VALLEY CLEANERS	53 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1C9	SSE	241.23	<u>189</u>
VALLEY CLEANERS 40-068	53 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1C9	SSE	241.23	<u>189</u>
Edwards lakeside Veterinary Clinic	46 Port Street East Mississauga ON L5G 1C1	ESE	244.55	<u>199</u>
Edwards lakeside Veterinary Clinic	46 Port Street East Mississauga ON L5G 1C1	ESE	244.55	<u>199</u>
Edwards lakeside Veterinary Clinic	46 Port Street East Mississauga ON L5G 1C1	ESE	244.55	<u>199</u>
Edwards lakeside Veterinary Clinic	46 Port Street East Mississauga ON L5G 1C1	ESE	244.55	<u>199</u>
Edwards lakeside Veterinary Clinic	46 Port Street East Mississauga ON L5G 1C1	ESE	244.55	<u>199</u>
Edwards lakeside Veterinary Clinic	46 Port Street East Mississauga ON L5G 1C1	ESE	244.55	<u>199</u>
Edwards lakeside Veterinary Clinic	46 Port Street East Mississauga ON L5G 1C1	ESE	244.55	<u>199</u>
Credit Valley Investments Limited	34 Lakeshore Road East Mississauga ON L5G 1C8	SSW	245.93	<u>203</u>

INC - Fuel Oil Spills and Leaks

A search of the INC database, dated 31 Oct, 2023 has found that there are 4 INC site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	55 PARK STREET EAST, MISSISSAUGA ON	NW	64.74	<u>8</u>
	55 PARK STREET EAST, MISSISSAUGA ON	NW	64.74	<u>8</u>
	55 PARK STREET EAST, MISSISSAUGA ON	NW	64.74	<u>8</u>

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	9 HELENE STREET SOUTH, MISSISSAUGA ON	ESE	247.21	<u>205</u>

PAP - Canadian Pulp and Paper

A search of the PAP database, dated 1999, 2002, 2004, 2005, 2009-2014 has found that there are 1 PAP site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Zirco Ltd.	92 Lakeshore Rd E Mississauga ON L5G 4S2	SE	141.66	<u>48</u>

PES - Pesticide Register

A search of the PES database, dated Oct 2011-Oct 31, 2024 has found that there are 15 PES site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
VERSACE LAWN CARE	66 HIGH STREET EAST, #202 MISSISSAUGA ON L5G1K2	NE	91.63	<u>18</u>
VERSACE LAWN CARE	66 HIGH STREET EAST, #202 MISSISSAUGA ON L5G 1K2	NE	91.63	<u>18</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
VERSACE LAWN CARE	66 HIGH STREET EAST, #202 MISSISSAUGA ON L5G1K2	NE	91.63	<u>18</u>
LOBLAWS INC. O/A RUSTY'S NO FRILLS #102	99 LAKESHORE RD E MISSISSAUGA ON L5G1E2	ESE	181.70	<u>93</u>
1052900 ONTARIO INC./ROB'S NO FRILLS	99 LAKESHORE ROAD EAST PORT CREDIT ON L5G1E2	ESE	181.70	<u>93</u>
LOBLAWS SUPERMARKETS LTD. #164-0	99 LAKESHORE ROAD PORT CREDIT ON M4T 2S5	ESE	181.70	<u>93</u>
815957 ONTARIO LIMITED BRIAN'S NO FRILLS	99 LAKESHORE ROAD PORT CREDIT ON M9R 1Y5	ESE	181.70	<u>93</u>
1382019 ONTARIO LTD/MURPHY'S NO FRILLS	99 LAKESHORE RD E PORT CREDIT ON L5G1E2	ESE	181.70	<u>93</u>
LOBLAWS INC. O/A NO FRILLS #1353	99 LAKESHORE RD E MISSISSAUGA ON L5G 1E2	ESE	181.70	<u>93</u>
LOBLAWS INC. O/A NO FRILLS #1353	99 LAKESHORE RD E MISSISSAUGA ON L5G 1E2	ESE	181.70	<u>93</u>
2307036 ONTARIO LTD	99 LAKESHORE RD. E. MISSISSAUGA ON L5G 1E2	ESE	181.70	<u>93</u>
2307036 ONTARIO LTD	99 LAKESHORE RD. E. MISSISSAUGA ON L5G1E2	ESE	181.70	<u>93</u>
1382019 ONTARIO LTD/MURPHY'S NO FRILLS	99 LAKESHORE RD E PORT CREDIT ON L5G1E2	ESE	181.70	<u>93</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
MELL-BURN LAWN CARE SERVICE	81 LAKESHORE RD.E. BOX 45035 MISSISSAUGA ON L5G4S7	SSE	206.82	131

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
BBF'S INC.	47 LAKESHORE RD E MISSISSAUGA ON L5G1C9	SSE	245.26	202

PINC - Pipeline Incidents

A search of the PINC database, dated Feb 28, 2021 has found that there are 3 PINC site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
ENBRIDGE GAS INC	26 PARK ST E,,MISSISSAUGA,ON, L5G 1L6,CA ON	W	167.40	71
PIPELINE HIT - 2"	8 ANN ST.,MISSISSAUGA,ON,L5G 3E6,CA ON	ENE	169.57	76
	90 High Street East, Mississauga ON	NE	235.19	181

PRT - Private and Retail Fuel Storage Tanks

A search of the PRT database, dated 1989-1996* has found that there are 2 PRT site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
V V GAS AND WASH	114 LAKESHORE RD PORT CREDIT MISSISSAUGA ON	E	152.00	58
V V GAS AND WASH	114 LAKESHORE RD PORT CREDIT MISSISSAUGA ON	E	152.00	58

PTTW - Permit to Take Water

A search of the PTTW database, dated 1994 - Nov 30, 2024 has found that there are 1 PTTW site(s) within approximately 0.25

kilometers of the project property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Salini Impregilo Civil Works Inc.	30 Queen Street East Mississauga, ON Canada ON	NW	216.89	153

RSC - Record of Site Condition

A search of the RSC database, dated 1997-Sept 2001, Oct 2004-Dec 2024 has found that there are 12 RSC site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Scott Insley	8 ANN ST ON MISSISSAUGA ON	ENE	169.49	75
Home Alone Property Management Services Limited	10 ANN ST ON MISSISSAUGA ON	ENE	170.10	78
F.S. 6810 DEVELOPMENT INC.	10 ANN STREET ON Mississauga ON	ENE	170.10	78
Scott Insley	6 ANN ST ON MISSISSAUGA ON	ENE	179.72	90
10 WEST GO GP INC. AS GENERAL PARTNER BY AND ON BEHALF OF 10 WEST GO LP	17 ANN STREET ON Mississauga ON	NE	199.80	115
10 WEST GO GP INC. AS GENERAL PARTNER BY AND ON BEHALF OF 10 WEST GO LP	84 HIGH STREET EAST ON Mississauga ON	NE	202.84	124
10 WEST GO GP INC. AS GENERAL PARTNER BY AND ON BEHALF OF 10 WEST GO LP	19 ANN STREET ON Mississauga ON	NNE	206.09	130
10 WEST GO GP INC. AS GENERAL PARTNER BY AND ON BEHALF OF 10 WEST GO LP	90 HIGH STREET EAST ON Mississauga ON	NE	235.19	181

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
EDENSHAW ELIZABETH DEVELOPMENTS LIMITED	46 Park ST E Mississauga ON	WNW	117.64	28
EDENSHAW ELIZABETH DEVELOPMENTS LIMITED	44 Park ST E Mississauga ON	WNW	120.39	30
EDENSHAW ELIZABETH DEVELOPMENTS LIMITED	42 Park ST E Mississauga ON	WNW	121.80	31
EDENSHAW ELIZABETH DEVELOPMENTS LIMITED	23 Elizabeth ST N Mississauga ON	WNW	147.35	52

RST - Retail Fuel Storage Tanks

A search of the RST database, dated 1999-Apr 30, 2024 has found that there are 2 RST site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
CREDIT VILLAGE MARINA	12 STAVEBANK RD MISSISSAUGA ON L5G2T4	SSW	225.61	167
CREDIT VILLAGE MARINA	12 STAVEBANK RD MISSISSAUGA ON L5G 2T4	SSW	225.61	167

SCT - Scott's Manufacturing Directory

A search of the SCT database, dated 1992-Mar 2011* has found that there are 20 SCT site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
CASPIAN CUSTOM CANVAS INC.	106 LAKESHORE RD E SUITE 104 MISSISSAUGA ON L5G 1E3	ESE	132.73	41
RCOM graphics and design	92 Lakeshore Rd E Suite 202 Mississauga ON L5G 4S2	SE	141.66	48
Dudson USA Inc.	92 Lakeshore Rd E Floor 2 Mississauga ON L5G 4S2	SE	141.66	48

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
The Dudson USA Inc.	92 Lakeshore Rd E Floor 2 Mississauga ON L5G 4S2	SE	141.66	<u>48</u>
THE DUDSON GROUP (USA) INC.	92 LAKESHORE RD E MISSISSAUGA ON L5G 4S2	SE	141.66	<u>48</u>
Dens-Tek Dental Studio Inc.	114 Lakeshore Rd E Unit 4 Mississauga ON L5G 1E4	E	152.00	<u>58</u>
Waterside Dental	115 Lakeshore Rd E Mississauga ON L5G 1E5	ESE	200.42	<u>116</u>
Sungalia G Dr	115 Lakeshore Rd E Mississauga ON L5G 1E5	ESE	200.42	<u>116</u>
Axis Communications Inc.	117 Lakeshore Rd E Mississauga ON L5G 1E5	ESE	201.77	<u>120</u>
Canadian Wiping Cloth Company	126-117 Lakeshore Road East Mississauga ON L5G 4T6	ESE	201.77	<u>120</u>
Westacott Organs	117 Lakeshore Rd E Suite 343 Mississauga ON L5G 4T6	ESE	201.77	<u>120</u>
Doyle Botterell Sailmakers	117 Lakeshore Rd E Suite 336 Mississauga ON L5G 4T6	ESE	201.77	<u>120</u>
SICOTEL LTD.	81 LAKESHORE RD E MISSISSAUGA ON L5G 1C9	SSE	206.82	<u>131</u>
Custom CD Corporation	50 Lakeshore Rd E Suite 200 Mississauga ON L5G 1E1	S	215.12	<u>146</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Excalibur International Consultants Ltd.	10 Hurontario St Mississauga ON L5G 3G7	ENE	248.27	209
EXCALIBUR INT'L CONSULTANTS	10 Hurontario St Mississauga ON L5G 3G7	ENE	248.27	209
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Richard's Fine Chocolates Inc.	25 Helene St N Mississauga ON L5G 3B6	NNW	167.18	70
DISTANT HORIZON MARINE	6 ELIZABETH ST S MISSISSAUGA ON L5G 2Y5	SE	225.40	166
Engineered Management Systems Inc.	34 Lakeshore Rd E Mississauga ON L5G 1C8	SSW	245.93	203
ENGINEERED MANAGEMENT SYSTEMS	34 Lakeshore Rd E Mississauga ON L5G 1C8	SSW	245.93	203

SPL - Ontario Spills

A search of the SPL database, dated 1988-Jun 2024; Aug 2024; Oct 2024 has found that there are 21 SPL site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Regional Municipality of Peel	Elizabeth St. and Park St. Mississauga ON	W	103.29	22
PUC	7 HELENE ST. PORT CREDIT MISSISSAUGA CITY ON	E	112.24	26
FRAM GROUP (CANADA) INC	69 High St. E Mississauga ON	ENE	132.21	40
Bell Canada	80 High Street Mississauga ON	NE	151.78	57

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	80 High Street East Mississauga ON	NE	151.78	<u>57</u>
	114 Lakeshore Road East, Mississauga MISSISSAUGA ON	E	152.00	<u>58</u>
UNKNOWN	114 LAKESHORE BLVD ST HELENE ST. MISSISSAUGA CITY ON	E	152.00	<u>58</u>
Enbridge Gas Distribution Inc.	26 Park Street Mississauga ON	W	167.40	<u>71</u>
Enbridge Gas Distribution Inc.	8 Ann St. Mississauga Mississauga ON	ENE	169.57	<u>76</u>
ONTARIO HYDRO	ELIZABETH AND LAKESHORE MISSISSAUGA TRANSFORMER MISSISSAUGA CITY ON	SE	171.99	<u>80</u>
TRANSPORT TRUCK	99 LAKE SHORE DR. E. MOTOR VEHICLE (OPERATING FLUID) MISSISSAUGA CITY ON	ESE	181.70	<u>93</u>
FRAM GROUP (CANADA) INC	Ann and High St Mississauga ON	ENE	183.75	<u>96</u>
	13 Stavebank Road NORTH Mississauga ON	S	191.58	<u>108</u>
Credit Village Marina-Port Credit Harbour	12 Stavebank Road Mississauga ON	SSW	225.61	<u>167</u>
	12 Stavebank Road Mississauga ON L5G 2T4	SSW	225.61	<u>167</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
The Corporation of the City of Mississauga	12 Stavbank Road Mississauga ON	SSW	225.61	167
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Compten Management Inc.	28 Elizabeth Street North Mississauga ON	W	164.72	67
	26 Elizabeth St N, Mississauga MISSISSAUGA ON	W	169.68	77
Metrolinx	30 Queen Street East Mississauga, ON MISSISSAUGA ON	NW	216.89	153
	Mary Fix Creek, north of the Port Credit Go Station MISSISSAUGA ON	NW	223.26	162
Souvlaki Hut	51 Lakeshore Rd E Mississauga ON NA	SSE	244.94	201

WWIS - Water Well Information System

A search of the WWIS database, dated Dec 31 2023 has found that there are 63 WWIS site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	29 PARK ST. EAST MISSISSAUGA ON	WSW	107.10	23
	Well ID: 7296575			
	94 Lakeshore Road East Mississauga ON	SE	123.47	32
	Well ID: 7344847			
	94 Lakeshore Rd East Mississauga ON	SE	126.41	35
	Well ID: 7344848			
	27 PARK ST E PORT CREDIT ON	WSW	149.60	55

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	Well ID: 7278219			
	94 Lakeshore Rd East Mississauga ON	SE	151.50	56
	Well ID: 7344849			
	8 ANN ST ON	ENE	154.83	61
	Well ID: 7288429			
	21 PARK ST E PORT CREDIT ON	WSW	167.77	72
	Well ID: 7278220			
	21 Park Street East Port Credit ON	WSW	167.77	72
	Well ID: 7330661			
	29 PARK ST. EAST MISSISSAUGA ON	WSW	168.89	74
	Well ID: 7296574			
	21 PARK ST E PORT CREDIT ON	WSW	170.89	79
	Well ID: 7278218			
	21 Park Street East Port Credit ON	WSW	170.89	79
	Well ID: 7330662			
	ON	ENE	176.78	86
	Well ID: 7267968			
	LAKESHORE 91/99 Mississauga ON	ESE	177.20	87
	Well ID: 7148420			
	103 LAKESHORE RD E MISSISSAUGA ON	ESE	179.32	89
	Well ID: 7183814			
	21 Park Street East Port Credit ON	WSW	185.78	97
	Well ID: 7330663			

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	Park Street & Hurontario Street Mississauga ON <i>Well ID: 7398227</i>	NE	190.00	<u>104</u>
	Park Street & Hurontario Street Mississauga ON <i>Well ID: 7398228</i>	NE	190.00	<u>104</u>
	99 LAKESHORE RD PORT CREDIT ON <i>Well ID: 7211007</i>	SE	190.53	<u>105</u>
	ON <i>Well ID: 7296325</i>	WSW	191.45	<u>107</u>
	103 LAKESHORE RD E Mississauga ON <i>Well ID: 7187902</i>	ESE	191.81	<u>109</u>
	15 STAVEBANK ROAD SOUTH MISSISSAUGA ON <i>Well ID: 7046642</i>	SSE	201.43	<u>118</u>
	20 STAVEBANK DR MISSISSAUGA ON <i>Well ID: 7168027</i>	SSW	202.27	<u>121</u>
	103 LAKESHORE ROAD EAST Mississauga ON <i>Well ID: 7157715</i>	ESE	203.26	<u>125</u>
	LAKE SHORE 91/99 ON <i>Well ID: 7148419</i>	ESE	208.79	<u>134</u>
	103 LAKESHORE ROAD EAST Mississauga ON <i>Well ID: 7157717</i>	ESE	209.63	<u>136</u>
	113 LAKESHORE BLVD. 107 Mississauga ON <i>Well ID: 7109074</i>	ESE	209.67	<u>137</u>
	103 LAKESHORE RD E Mississauga ON	ESE	210.16	<u>138</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	Well ID: 7187901			
	103 LAKESHORE RD E MISSISSAUGA ON	ESE	210.19	139
	Well ID: 7183549			
	Park Street & Hurontario Street Mississauga ON	NNE	211.40	142
	Well ID: 7398226			
	113 LAKESHORE RD. E. #107 Mississauga ON	ESE	215.14	147
	Well ID: 7133398			
	103 LAKESHORE ROAD EAST Mississauga ON	ESE	215.26	148
	Well ID: 7157716			
	103 LAKESHORE RD E Mississauga ON	ESE	215.99	149
	Well ID: 7187903			
	103 LAKESHORE RD E MISSISSAUGA ON	ESE	216.00	150
	Well ID: 7183548			
	STAVEBANK RD PORT CREDIT ON	S	219.41	156
	Well ID: 4909856			
	10 STAREBANK MISSISSAUGA ON	SSW	219.51	157
	Well ID: 4909501			
	20 STAVEBANK DR MISSISSAUGA ON	SSW	220.87	159
	Well ID: 7168029			
	LAKE SHORE 91/99 Mississauga ON	SE	226.51	170
	Well ID: 7148418			
	91 Park Street East Mississauga ON	NE	231.22	176
	Well ID: 7408553			

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	Park Street & Hurontario Street Mississauga ON <i>Well ID: 7398230</i>	NE	234.34	<u>179</u>
	Park Street & Hurontario Street Mississauga ON <i>Well ID: 7398199</i>	NNE	234.84	<u>180</u>
	91 Park Street East Mississauga ON <i>Well ID: 7408550</i>	NNE	237.98	<u>183</u>
	91 Park Street East Mississauga ON <i>Well ID: 7408551</i>	NNE	241.18	<u>188</u>
	Park Street & Hurontario Street Mississauga ON <i>Well ID: 7398198</i>	NNE	241.53	<u>190</u>
	Park Street & Hurontario Street Mississauga ON <i>Well ID: 7398229</i>	NNE	241.53	<u>190</u>
	91 Park Street East Mississauga ON <i>Well ID: 7408552</i>	NNE	244.34	<u>197</u>
	20 STAVEBANK DR MISSISSAUGA ON <i>Well ID: 7168028</i>	SSW	244.52	<u>198</u>
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON <i>Well ID: 7370471</i>	W	133.46	<u>42</u>
	78 PARK ST. E MISSISSAUGA ON <i>Well ID: 7341887</i>	N	172.06	<u>81</u>
	78 PARK ST. E Mississauga ON <i>Well ID: 7380344</i>	N	174.87	<u>83</u>

22 ANN ST. MISSISSAUGA ON Well ID: 7341861	N	183.66	<u>95</u>
78 PARK ST. E MISSISSAUGA ON Well ID: 7341823	N	187.43	<u>100</u>
78 Park St E Mississauga ON Well ID: 7390272	N	191.24	<u>106</u>
PORT CREDIT GO STATION PORT CREDIT ON Well ID: 7321813	NW	208.21	<u>133</u>
Park Street & Hurontario Street Mississauga ON Well ID: 7398231	NNE	210.51	<u>140</u>
30 Queen St East Mississauga ON Well ID: 7363632	NNE	216.08	<u>151</u>
30 QUEEN ST E Mississauga ON Well ID: 7234471	NW	216.89	<u>153</u>
PORT CREDIT GO STATION PORT CREDIT ON Well ID: 7321814	WNW	224.29	<u>165</u>
26 ANN ST. MISSISSAUGA ON Well ID: 7341844	N	228.27	<u>173</u>
26 ANN ST. MISSISSAUGA ON Well ID: 7341883	N	228.27	<u>173</u>
99 LAKESHORE RD PORT CREDIT ON Well ID: 7211009	ESE	233.92	<u>178</u>
ON Well ID: 7330113	N	238.68	<u>184</u>
PORT CREDIT GO STATION PORT CREDIT ON	NW	242.31	<u>193</u>

Well ID: 7243496


port credit go station
Mississauga ON

N

244.64

[200](#)

Well ID: 7355171

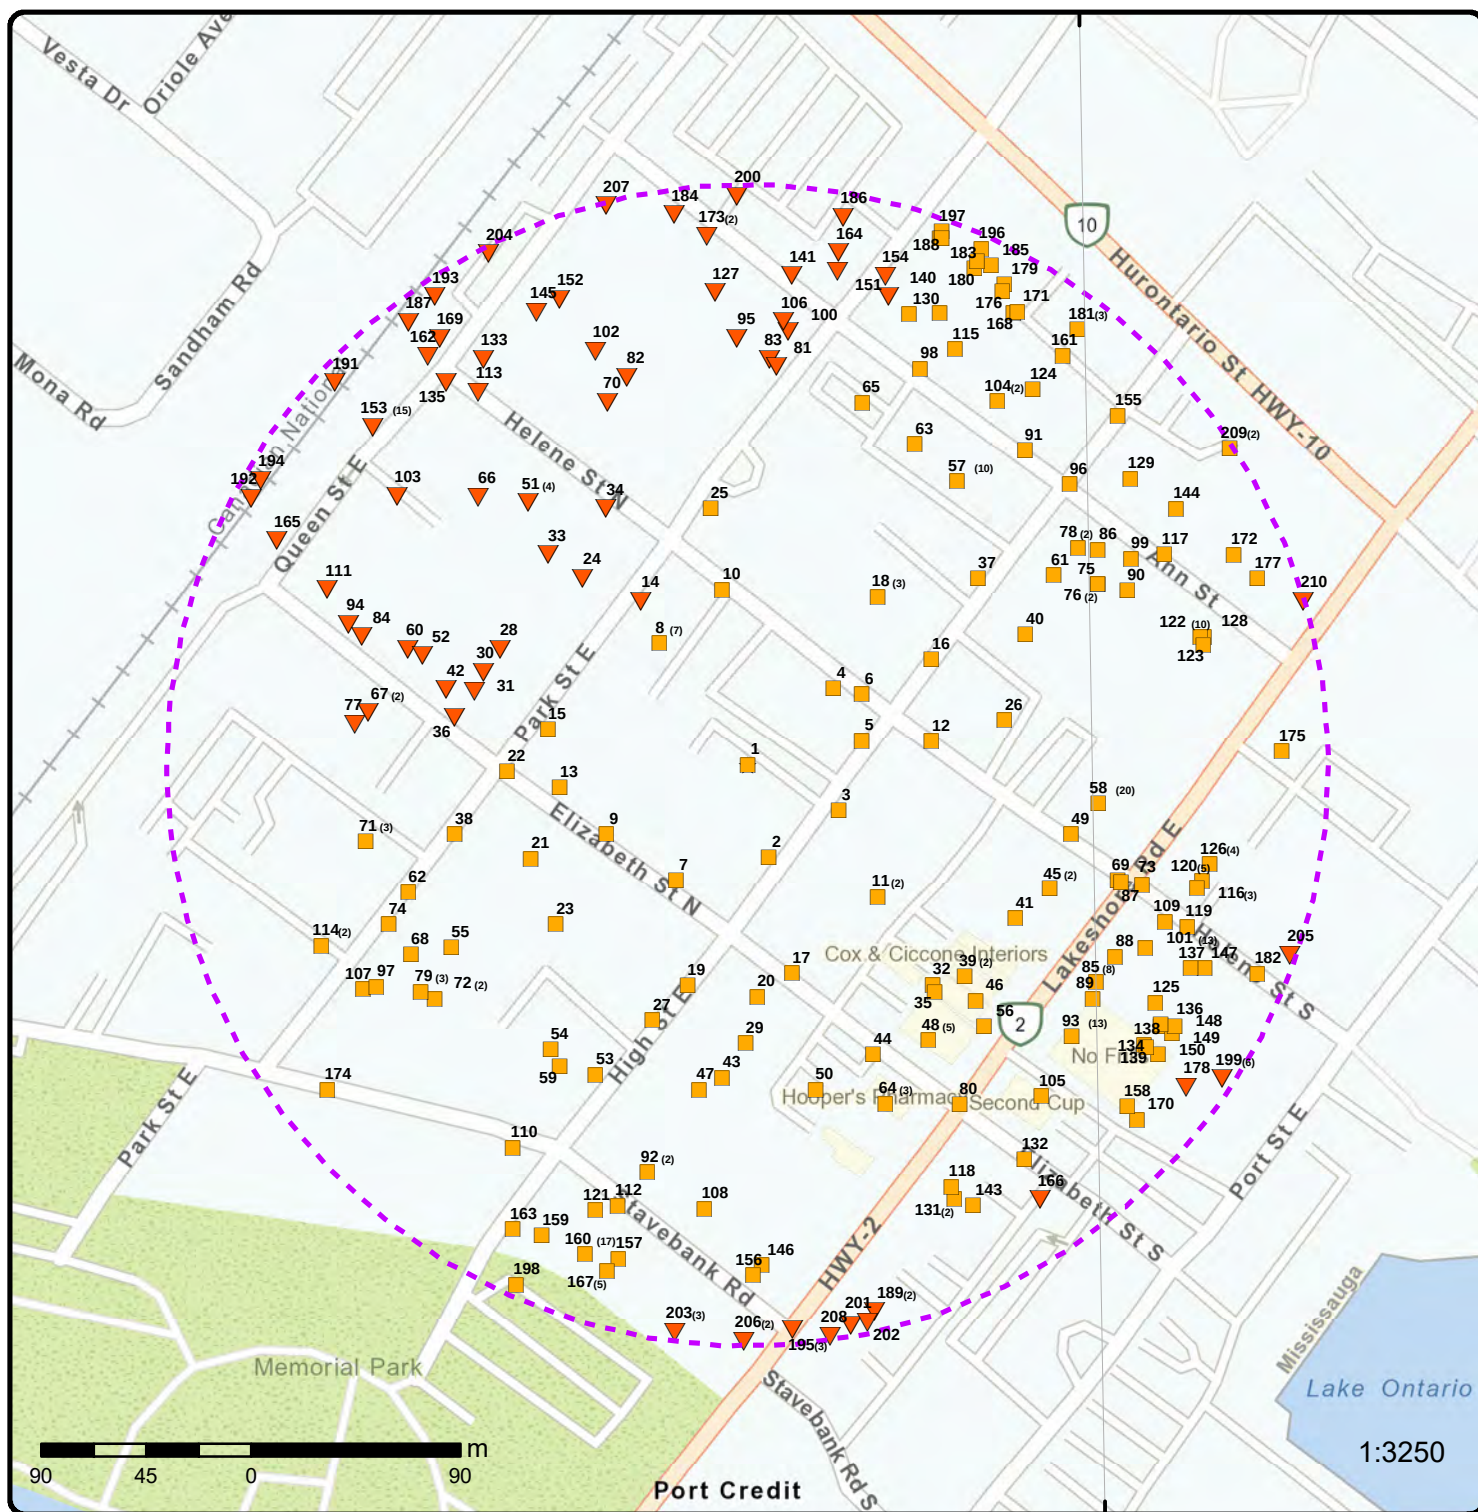

Map: 0.25 Kilometer Radius

Order Number: 25020500477

Address: 50 High Street, Mississauga, ON



★ Project Property	Freeways; Highways	Beach	Shopping & Sports Area
Buffer Outline	Traffic Circle; Ramp	Airport	University/College
Eris Sites with Higher Elevation	Major Arterial; Minor Arterial	Industrial Area	Cemetery; Golf Course
Eris Sites with Same Elevation	Local Road	Military Base	Parkt (National)
Eris Sites with Lower Elevation	Service Road; Traffic Circle; Ramp	Aircraft Roads	Park (City/County)
Eris Sites with Unknown Elevation	Rail	Native Reservation	
		Hospital	



1:10000

Sources: Esri, Maxar, Earthstar Geographics, and the GIS User Community

Aerial Year: 2022

Order Number: 25020500477

Address: 50 High Street, Mississauga, ON



Source: ESRI World Imagery

© ERIS Information Limited Partnership

79°36'W


79°34'30"W

43°34'30"N

43°34'30"N

43°33'N

43°33'N

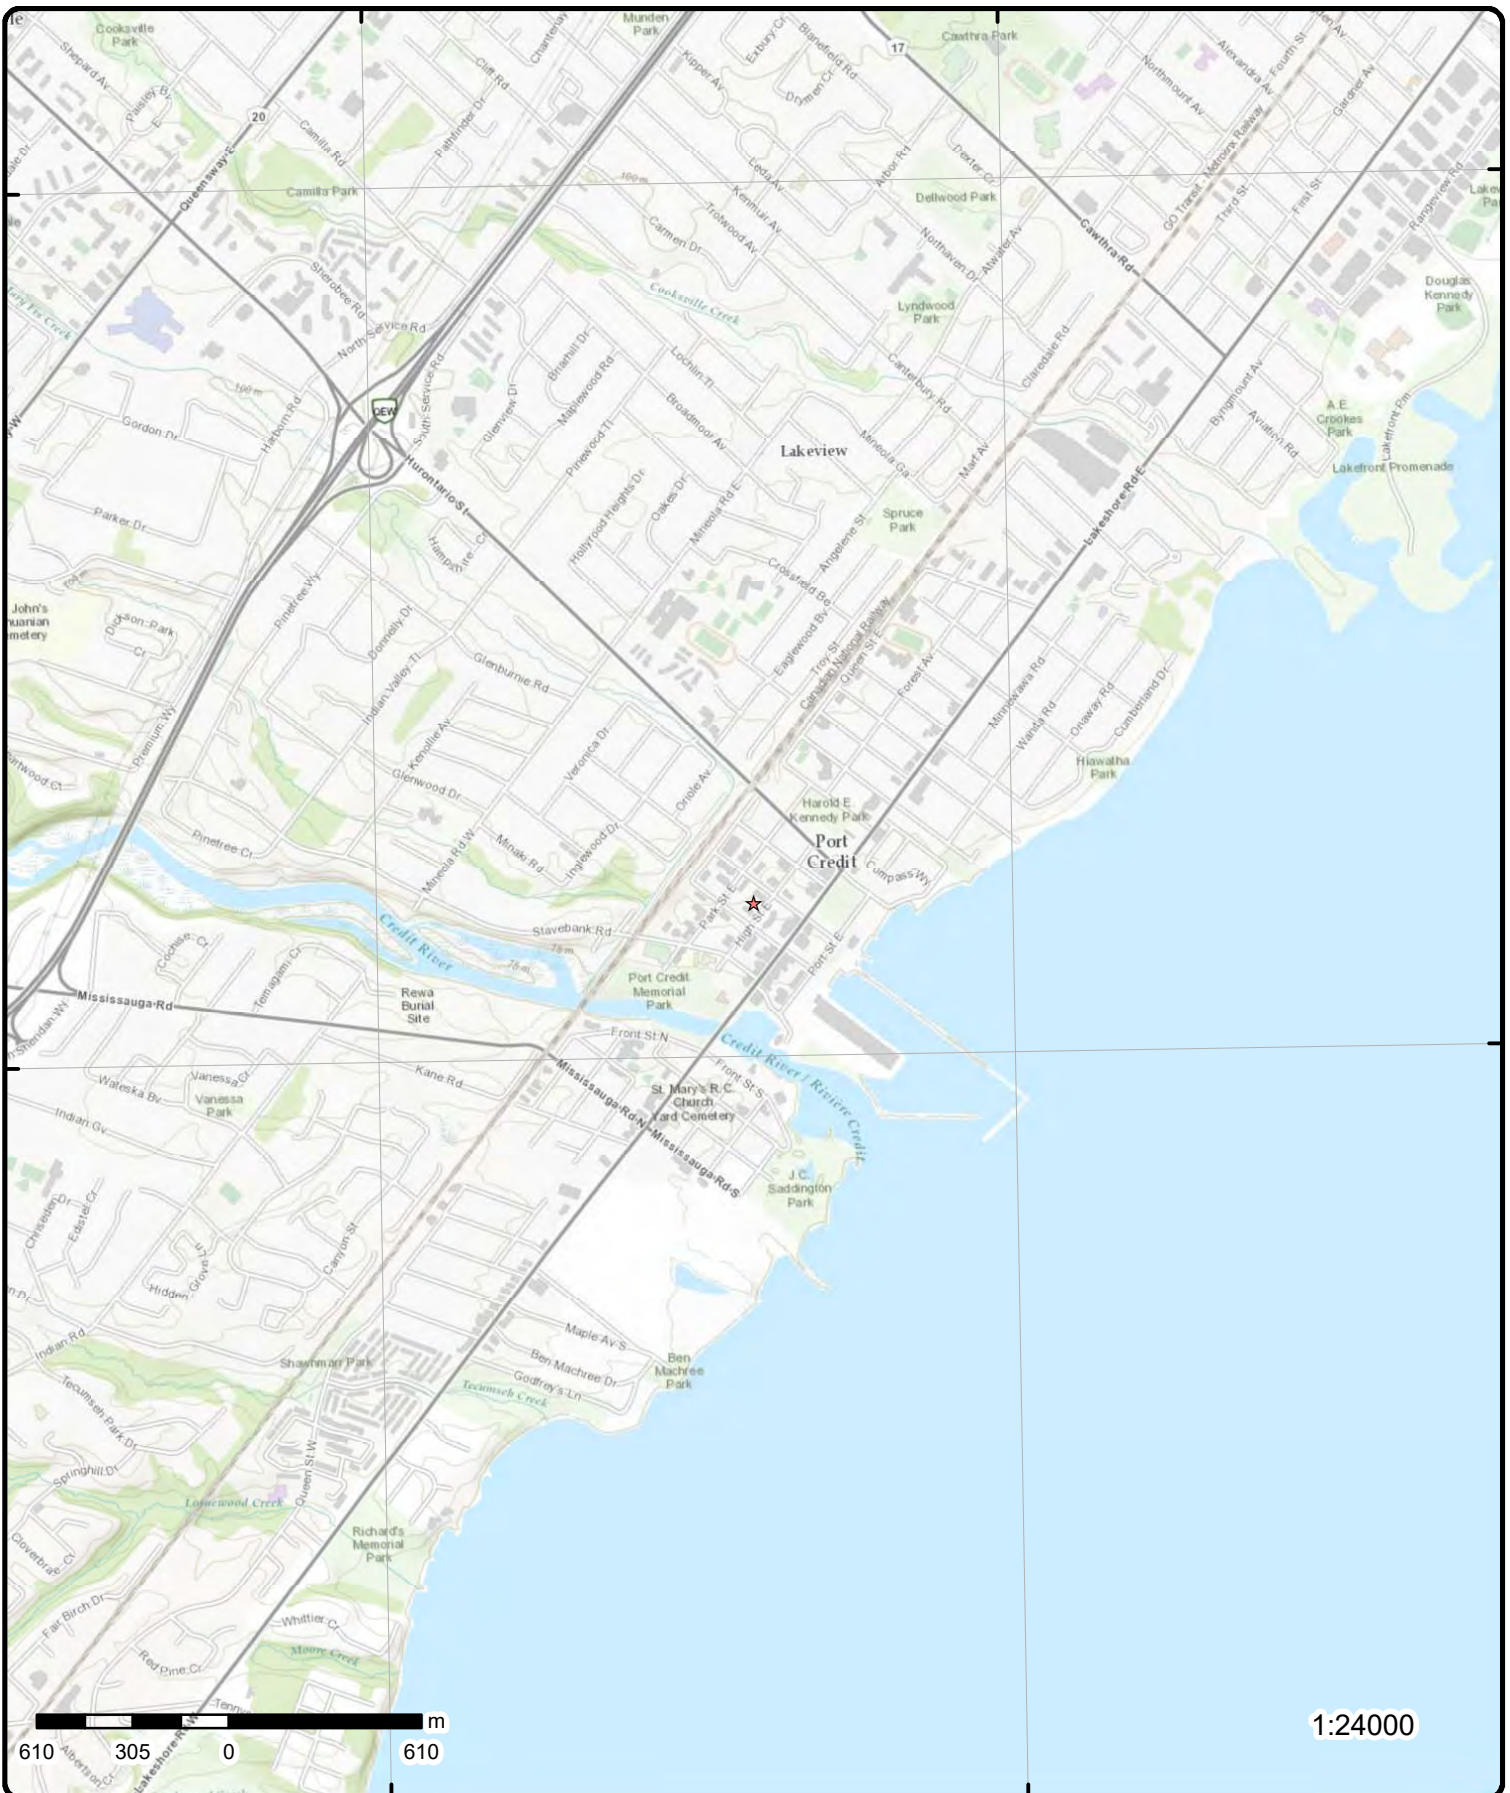

Topographic Map

Address: 50 High Street, ON

Source: ESRI World Topographic Map

Order Number: 25020500477



© ERIS Information Limited Partnership

Detail Report

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
1	1 of 1	-/0.0	79.8 / 0.00	50 High Street Mississauga ON	EHS
Order No: 20130726007				Nearest Intersection:	
Status: C				Municipality:	
Report Type: Custom Report				Client Prov/State: ON	
Report Date: 01-AUG-13				Search Radius (km): .25	
Date Received: 26-JUL-13				X: -79.585158	
Previous Site Name:				Y: 43.554303	
Lot/Building Size:					
Additional Info Ordered:					
2	1 of 1	SSE/40.6	79.8 / 0.00	ON	BORE
Borehole ID: 639276				Inclin FLG: No	
OGF ID: 215539673				SP Status: Initial Entry	
Status:				Surv Elev: No	
Type: Borehole				Piezometer: No	
Use: Geotechnical/Geological Investigation				Primary Name:	
Completion Date: JAN-1965				Municipality:	
Static Water Level:				Lot:	
Primary Water Use: Not Used				Township:	
Sec. Water Use:				Latitude DD: 43.554017	
Total Depth m: 1.5				Longitude DD: -79.585108	
Depth Ref: Ground Surface				UTM Zone: 17	
Depth Elev:				Easting: 614285	
Drill Method: Power auger				Northing: 4823313	
Orig Ground Elev m: 76.6				Location Accuracy:	
Elev Reliabil Note:				Accuracy: Not Applicable	
DEM Ground Elev m: 77.5					
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: 218487733				Mat Consistency:	
Top Depth: 1.5				Material Moisture:	
Bottom Depth: 1.5				Material Texture:	
Material Color: Brown				Non Geo Mat Type:	
Material 1: Till				Geologic Formation:	
Material 2: Sand				Geologic Group:	
Material 3: Silt				Geologic Period:	
Material 4: Clay				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		TILL,SAND,SILT,CLAY.BROWN,GLACIAL,AGE GLACIAL. POST-GLACIAL **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID: 218487732				Mat Consistency:	
Top Depth: .3				Material Moisture:	
Bottom Depth: 1.5				Material Texture:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material Color:	Black			Non Geo Mat Type:	
Material 1:	Organic			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:	Clay			Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ORGANIC,SAND,SILT, CLAY. BLACK,AGE POST-GLACIAL.				
Geology Stratum ID:	218487730			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	0			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ASPHALT.				
Geology Stratum ID:	218487731			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.3			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL,GRAVEL.				
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 072390 NTS_Sheet: 30M12A				
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.				
<u>Source List</u>					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
<u>3</u>	1 of 1	ESE/43.8	79.8 / 0.00	ON	BORE
Borehole ID:	639275			Inclin FLG:	No
OGF ID:	215539672			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.554192
Total Depth m:	1.5			Longitude DD:	-79.584732

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth Ref:		Ground Surface		UTM Zone:	17
Depth Elev:				Easting:	614315
Drill Method:		Power auger		Northing:	4823333
Orig Ground Elev m:		76.5		Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:		77.5			
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218487729			Mat Consistency:	
Top Depth:	1.1			Material Moisture:	
Bottom Depth:	1.5			Material Texture:	Medium
Material Color:				Non Geo Mat Type:	
Material 1:	Silt			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Sand			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SILT,CLAY,SAND MEDIUM. ALLUVIAL,AGE POST-GLACIAL.				
Geology Stratum ID:	218487727			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.1			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL,GRAVEL. BROWN.				
Geology Stratum ID:	218487728			Mat Consistency:	
Top Depth:	.1			Material Moisture:	
Bottom Depth:	1.1			Material Texture:	Coarse
Material Color:	Black			Non Geo Mat Type:	
Material 1:	Organic			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ORGANIC-MEDIUM TO COARSE,SAND. BLACK,AGE POST-GLACIAL.				
Geology Stratum ID:	218487726			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	0			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ASPHALT.				
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Details:		File: TOR1B.txt RecordID: 072380 NTS_Sheet: 30M12A			
Confiden 1:		Logs are approximately correct. Lack of information. Doubtful terminology.			
Source List					
Source Identifier:		1	Horizontal Datum:		NAD27
Source Type:		Data Survey	Vertical Datum:		Mean Average Sea Level
Source Date:		1956-1972	Projection Name:		Universal Transverse Mercator
Scale or Resolution:		Varies			
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Originators:		Geological Survey of Canada			
4	1 of 1	ENE/49.6	79.8 / 0.00	12 Helene St N Mississauga ON L5G	EHS
Order No:		20120124021		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Standard Report		Client Prov/State: ON	
Report Date:		2/2/2012 2:39:53 PM		Search Radius (km): 0.25	
Date Received:		1/24/2012 2:38:53 PM		X: -79.584748	
Previous Site Name:				Y: 43.554666	
Lot/Building Size:					
Additional Info Ordered:					
5	1 of 1	E/50.3	79.8 / 0.00	ON	BORE
Borehole ID:		639274		Inclin FLG: No	
OGF ID:		215539671		SP Status: Initial Entry	
Status:				Surv Elev: No	
Type:		Borehole		Piezometer: No	
Use:		Geotechnical/Geological Investigation		Primary Name:	
Completion Date:		JAN-1965		Municipality:	
Static Water Level:				Lot:	
Primary Water Use:		Not Used		Township:	
Sec. Water Use:				Latitude DD: 43.554461	
Total Depth m:		.9		Longitude DD: -79.584602	
Depth Ref:		Ground Surface		UTM Zone: 17	
Depth Elev:				Easting: 614325	
Drill Method:		Power auger		Northing: 4823363	
Orig Ground Elev m:		76.5		Location Accuracy:	
Elev Reliabil Note:				Accuracy: Not Applicable	
DEM Ground Elev m:		77.4			
Concession:					
Location D:					
Survey D:					
Comments:					
Borehole Geology Stratum					
Geology Stratum ID:		218487723		Mat Consistency:	
Top Depth:		0		Material Moisture:	
Bottom Depth:		.2		Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:		Water-bearing		Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		WATER.			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218487725 .8 .9 Grey Silt Sand Clay SILT,SAND,CLAY. GREY,ALLUVIAL,FIRM, AGE POST-GLACIAL. CLAY. BR			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Firm alluvial
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218487724 .2 .8 Black Organic ORGANIC. BLACK,AGE POST-GLACIAL.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	
Source					
Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	Data Survey Geological Survey of Canada 1956-1972 M Urban Geology Automated Information System (UGAIS) File: TOR1B.txt RecordID: 072370 NTS_Sheet: 30M12A Logs are approximately correct. Lack of information. Doubtful terminology.			Source Appl: Source Iden: Scale or Res: Horizontal: Verticalda:	Spatial/Tabular 1 Varies NAD27 Mean Average Sea Level
Source List					
Source Identifier: Source Type: Source Date: Scale or Resolution: Source Name: Source Originators:	1 Data Survey 1956-1972 Varies Urban Geology Automated Information System (UGAIS) Geological Survey of Canada			Horizontal Datum: Vertical Datum: Projection Name:	NAD27 Mean Average Sea Level Universal Transverse Mercator
6	1 of 1	ENE/57.8	79.8 / 0.00	ON	BORE
Borehole ID: OGF ID: Status: Type: Use: Completion Date: Static Water Level: Primary Water Use: Sec. Water Use: Total Depth m: Depth Ref: Depth Elev: Drill Method: Orig Ground Elev m: Elev Reliabil Note: DEM Ground Elev m: Concession:	641138 215541533 Borehole Geotechnical/Geological Investigation JAN-1965 Not Used 2.4 Ground Surface Power auger 77.3 77.6			Inclin FLG: SP Status: Surv Elev: Piezometer: Primary Name: Municipality: Lot: Township: Latitude DD: Longitude DD: UTM Zone: Easting: Northing: Location Accuracy: Accuracy:	No Initial Entry No No 43.554641 -79.584598 17 614325 4823383 Not Applicable

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Location D: Survey D: Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218494915			Mat Consistency:	
Top Depth:	.1			Material Moisture:	
Bottom Depth:	.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL, GRAVEL.				
Geology Stratum ID:	218494914			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ASPHALT.				
Geology Stratum ID:	218494916			Mat Consistency:	
Top Depth:	.2			Material Moisture:	
Bottom Depth:	1.5			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND, SILT, CLAY. BROWN, ALLUVIAL, AGE POST-GLACIAL.				
Geology Stratum ID:	218494917			Mat Consistency:	
Top Depth:	1.5			Material Moisture:	
Bottom Depth:	2.4			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND, SILT, CLAY. BROWN, ALLUVIAL, AGE POST-GLACIAL. . SAND-M **Note: Many records provided by the department have a truncated [Stratum Description] field.				
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 091040 NTS_Sheet: 30M12A				
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
<u>7</u>	1 of 1	SW/58.4	79.8 / 0.00	ON	BORE
Borehole ID:	640910			Inclin FLG:	No
OGF ID:	215541305			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.553933
Total Depth m:	2.1			Longitude DD:	-79.585605
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614245
Drill Method:	Power auger			Northing:	4823303
Orig Ground Elev m:	76.8			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	77.5				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218494033			Mat Consistency:	
Top Depth:	1.2			Material Moisture:	
Bottom Depth:	1.5			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:	Organic			Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND,SILT,CLAY, ORGANIC. ALLUVIAL,AGE POST-GLACIAL.				
Geology Stratum ID:	218494029			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	0			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ASPHALT.				
Geology Stratum ID:	218494031			Mat Consistency:	
Top Depth:	.2			Material Moisture:	
Bottom Depth:	.4			Material Texture:	
Material Color:	Yellow			Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:	Clay			Depositional Gen:	fill

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Gsc Material Description:					
Stratum Description:		FILL,SAND,SILT,CLAY.YELLOW.			
Geology Stratum ID:	218494032			Mat Consistency:	
Top Depth:	.4			Material Moisture:	Wet
Bottom Depth:	1.2			Material Texture:	
Material Color:	Black			Non Geo Mat Type:	
Material 1:	Organic			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:	Clay			Depositional Gen:	organic
Gsc Material Description:					
Stratum Description:		ORGANIC,SAND,SILT, CLAY. BLACK,WET.			
Geology Stratum ID:	218494034			Mat Consistency:	Firm
Top Depth:	1.5			Material Moisture:	
Bottom Depth:	2.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:		CLAY,SAND,SILT. ALLUVIAL,FIRM, AGE POST-GLACIAL.			
Geology Stratum ID:	218494030			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:		FILL,GRAVEL.			
Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 088760 NTS_Sheet: 30M12A				
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.				
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
8	1 of 7	NW/64.7	79.8 / 0.00	Kanco-55 Park Ltd. 55 Park St E Mississauga ON	CA
Certificate #:	8999-7PKSRW				
Application Year:	2009				
Issue Date:	2/27/2009				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Approval Type: Status: Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:		Air Approved			
<u>8</u>	2 of 7	NW/64.7	79.8 / 0.00	55 Park Street East Mississauga ON	EHS
Order No: Status: Report Type: Report Date: Date Received: Previous Site Name: Lot/Building Size: Additional Info Ordered:		20110531030 C Custom Report 6/7/2011 5/31/2011 1:34:06 PM		Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): X: Y:	ON 0.25 -79.585866 43.554916
<u>8</u>	3 of 7	NW/64.7	79.8 / 0.00	55 PARK STREET EAST, MISSISSAUGA ON	INC
Incident No: Incident ID: Instance No: Status Code: Incident Status: Incident Severity: Task No: Attribute Category: Context: Date of Occurrence: Time of Occurrence: Occr Insp Start Dt: Incident Creat On: Instance Creat Dt: Instance Install Dt: Approx Quant Rel: Tank Capacity: Fuels Occur Type: Occur Type Rpt: Occur Category: Fuel Type Involved: Fuel Type Reported: Enforcement Policy: Prc Escalation Req: Item: Item Description: Device Installed Location: Venting Type: Vent Conn Mater: Vent Chimney Mater: Pipeline Type: Pipeline Involved: Pipe Material: Regulator Location: Regulator Type: Liquid Prop Make:		1351280 4837033 FS-Perform L1 Incident Insp 2014/03/10 00:00:00 03:35:00 2014/03/10 00:00:00 Fire Natural Gas NULL NULL		Any Health Impact: Any Enviro Impact: Service Intrap: Was Prop Damaged: Reside App. Type: Commer App. Type: Indus App. Type: Institut App. Type: Depth Ground Cover: Operation Pressure: Equipment Type: Equipment Model: Serial No: Cylinder Capacity: Cylinder Cap Units: Cylinder Mat Type: Pump Flow Rate Cap: Contam. Migrated: Near Body of Water: Drainage System: Sub Surface Contam: Tank Material Type: Tank Storage Type: Tank Location Type:	No No Yes Yes

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Liquid Prop Model: Liquid Prop Serial No: Liquid Prop Notes: Inventory Address: 55 PARK STREET EAST, MISSISSAUGA - FIRE Invent Postal Code: Notes: Contact Natural Env: Aff Prop Use Water: Occurrence Narrative: CO produced by boiler with poor maintenance Operation Type Involved: Multi-unit Residential					
8	4 of 7	NW/64.7	79.8 / 0.00	55 PARK STREET EAST, MISSISSAUGA ON	INC
Incident No: 1351280 Incident ID: Instance No: Status Code: Incident Status: Incident Severity: Task No: 4900638 Attribute Category: FS-Perform L1 Incident Insp Context: Date of Occurrence: 2014/03/10 00:00:00 Time of Occurrence: 03:35:00 Occr Insp Start Dt: 2014/03/10 00:00:00 Incident Creat On: Instance Creat Dt: Instance Install Dt: Approx Quant Rel: Tank Capacity: Fuels Occur Type: Fire Occur Type Rpt: Occur Category: Fuel Type Involved: Natural Gas Fuel Type Reported: Enforcement Policy: NULL Prc Escalation Req: NULL Item: Item Description: Device Installed Location: Venting Type: Vent Conn Mater: Vent Chimney Mater: Pipeline Type: Pipeline Involved: Pipe Material: Regulator Location: Regulator Type: Liquid Prop Make: Liquid Prop Model: Liquid Prop Serial No: Liquid Prop Notes: Inventory Address: 55 PARK STREET EAST, MISSISSAUGA - FIRE Invent Postal Code: Notes: Contact Natural Env: Aff Prop Use Water: Occurrence Narrative: CO produced by boiler with poor maintenance Operation Type Involved: Multi-unit Residential					
Any Health Impact: No Any Enviro Impact: No Service Intrp: Yes Was Prop Damaged: Yes Reside App. Type: Commer App. Type: Indus App. Type: Institut App. Type: Depth Ground Cover: Operation Pressure: Equipment Type: Equipment Model: Serial No: Cylinder Capacity: Cylinder Cap Units: Cylinder Mat Type: Pump Flow Rate Cap: Contam. Migrated: Near Body of Water: Drainage System: Sub Surface Contam: Tank Material Type: Tank Storage Type: Tank Location Type:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
8	5 of 7	NW/64.7	79.8 / 0.00	55 PARK STREET EAST, MISSISSAUGA ON	INC
Incident No: 2019776 Incident ID: Instance No: Status Code: Incident Status: Incident Severity: Task No: 6621149 Attribute Category: FS-Perform L1 Incident Insp Context: Date of Occurrence: 2017/02/04 00:00:00 Time of Occurrence: 21:37:00 Occr Insp Start Dt: 2017/02/06 00:00:00 Incident Creat On: Instance Creat Dt: Instance Install Dt: Approx Quant Rel: Tank Capacity: Fuels Occur Type: CO Release Occur Type Rpt: Occur Category: Fuel Type Involved: Natural Gas Fuel Type Reported: Enforcement Policy: NULL Prc Escalation Req: NULL Item: Item Description: Device Installed Location: Venting Type: Vent Conn Mater: Vent Chimney Mater: Pipeline Type: Pipeline Involved: Pipe Material: Regulator Location: Regulator Type: Liquid Prop Make: Liquid Prop Model: Liquid Prop Serial No: Liquid Prop Notes: Inventory Address: 55 PARK STREET EAST, MISSISSAUGA - CO RELEASE Invent Postal Code: Notes: Contact Natural Env: Aff Prop Use Water: Occurrence Narrative: Operation Type Involved: 98 ppm at boiler Multi-unit Residential Any Health Impact: No Any Enviro Impact: No Service Intrap: Yes Was Prop Damaged: No Reside App. Type: Commer App. Type: Indus App. Type: Institut App. Type: Depth Ground Cover: Operation Pressure: Equipment Type: Equipment Model: Serial No: Cylinder Capacity: Cylinder Cap Units: Cylinder Mat Type: Pump Flow Rate Cap: Contam. Migrated: Near Body of Water: Drainage System: Sub Surface Contam: Tank Material Type: Tank Storage Type: Tank Location Type:					
8	6 of 7	NW/64.7	79.8 / 0.00	Kanco-55 Park Ltd. 55 Park St E Mississauga ON L4V 1R9	ECA
Approval No: 8999-7PKSRW Approval Date: 2009-02-27 Status: Approved Record Type: ECA Link Source: IDS SWP Area Name: Credit Valley Approval Type: ECA-AIR Project Type: AIR Business Name: Kanco-55 Park Ltd. Address: 55 Park St E MOE District: Halton-Peel City: Longitude: -79.58555 Latitude: 43.554775 Geometry X: Geometry Y:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Full Address: Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/3718-7NWSDQ-14.pdf PDF Site Location:					
8	7 of 7	NW/64.7	79.8 / 0.00	55 Park Street East Mississauga ON L5G 1L9	EHS
Order No: 20190822037 Status: C Report Type: Standard Report Report Date: 27-AUG-19 Date Received: 22-AUG-19 Previous Site Name: Lot/Building Size: Additional Info Ordered:		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.585619 Y: 43.55483			
9	1 of 1	WSW/67.6	79.8 / 0.00	ON	BORE
Borehole ID: 640911 OGF ID: 215541306 Status: Type: Borehole Use: Geotechnical/Geological Investigation Completion Date: JAN-1965 Static Water Level: Primary Water Use: Not Used Sec. Water Use: Total Depth m: 2.4 Depth Ref: Ground Surface Depth Elev: Drill Method: Power auger Orig Ground Elev m: 77 Elev Reliabil Note: DEM Ground Elev m: 77.9 Concession: Location D: Survey D: Comments:		Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD: 43.554118 Longitude DD: -79.585972 UTM Zone: 17 Easting: 614215 Northing: 4823323 Location Accuracy: Accuracy: Not Applicable			
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: 218494035 Top Depth: 0 Bottom Depth: .1 Material Color: Material 1: Asphalt Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description: ASPHALT.		Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:			
Geology Stratum ID: 218494036 Top Depth: .1 Bottom Depth: .2 Material Color: Material 1: Fill Material 2: Gravel Material 3: Material 4:		Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen: fill			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Gsc Material Description:					
Stratum Description:		FILL,GRAVEL.			
Geology Stratum ID:	218494038			Mat Consistency:	
Top Depth:	.9			Material Moisture:	Wet
Bottom Depth:	1.8			Material Texture:	Medium
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:	Organic			Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:		SAND-MEDIUM,CLAY, SILT,ORGANIC. GREY,ALLUVIAL,WET, AGE POST-GLACIAL.			
Geology Stratum ID:	218494039			Mat Consistency:	Firm
Top Depth:	1.8			Material Moisture:	
Bottom Depth:	2.4			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:		CLAY,SAND,SILT. ALLUVIAL,FIRM, AGE POST-GLACIAL.			
Geology Stratum ID:	218494037			Mat Consistency:	
Top Depth:	.2			Material Moisture:	
Bottom Depth:	.9			Material Texture:	Medium
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:	Organic			Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:		SAND-MEDIUM,SILT, CLAY,ORGANIC. GREY,ALLUVIAL, AGE POST-GLACIAL.			
Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 088770 NTS_Sheet: 30M12A				
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.				
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
10	1 of 1	N/76.2	79.8 / 0.00	ON	BORE
Borehole ID:	641139			Inclin FLG:	No
OGF ID:	215541534			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Use: Completion Date: Static Water Level: Primary Water Use: Sec. Water Use: Total Depth m: Depth Ref: Depth Elev: Drill Method: Orig Ground Elev m: Elev Reliabil Note: DEM Ground Elev m: Concession: Location D: Survey D: Comments:	Geotechnical/Geological Investigation JAN-1965 Not Used 2.7 Ground Surface Power auger 80.2 80.2 80.2			Primary Name: Municipality: Lot: Township: Latitude DD: Longitude DD: UTM Zone: Easting: Northing: Location Accuracy: Accuracy:	43.555055 -79.585331 17 614265 4823428 Not Applicable
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218494918 0 0 Asphalt			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218494920 .2 .3 Grey Sand Silt Clay			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Medium alluvial
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218494921 .3 1.2 Brown Silt Sand Clay			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	alluvial
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218494919 0 .2 Fill Gravel			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	fill
Geology Stratum ID: Top Depth:	218494922 1.2			Mat Consistency: Material Moisture:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bottom Depth:2.1 Material Color:Brown Material 1:Sand Material 2:Silt Material 3:Clay Material 4: Gsc Material Description: Stratum Description:SAND-MEDIUM,SILT, CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL. Material Texture:Medium Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:alluvial Geology Stratum ID:218494923 Top Depth:2.1 Bottom Depth:2.7 Material Color:Brown Material 1:Sand Material 2:Silt Material 3: Material 4: Gsc Material Description: Stratum Description:SAND-MEDIUM,SILT. BROWN,ALLUVIAL, AGE POST-GLACIAL. Mat Consistency: Material Moisture: Material Texture:Medium Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:alluvial					
Source Source Type:Data Survey Source Orig:Geological Survey of Canada Source Date:1956-1972 Confidence:M Observatio: Source Name:Urban Geology Automated Information System (UGAIS) Source Details:File: TOR1B.txt RecordID: 091050 NTS_Sheet: 30M12A Confiden 1:Logs are approximately correct. Lack of information. Doubtful terminology. Source Appl:Spatial/Tabular Source Iden:1 Scale or Res:Varies Horizontal:NAD27 Verticalda:Mean Average Sea Level					
Source List Source Identifier:1 Source Type:Data Survey Source Date:1956-1972 Scale or Resolution:Varies Source Name:Urban Geology Automated Information System (UGAIS) Source Originators:Geological Survey of Canada Horizontal Datum:NAD27 Vertical Datum:Mean Average Sea Level Projection Name:Universal Transverse Mercator					
11	1 of 2	SE/79.7	79.8 / 0.00	7 Elizabeth Street North Mississauga ON	EHS
Order No:20110531031 Status:C Report Type:Custom Report Report Date:6/7/2011 Date Received:5/31/2011 1:34:57 PM Previous Site Name: Lot/Building Size: Additional Info Ordered: Nearest Intersection: Municipality: Client Prov/State:ON Search Radius (km):0.25 X:-79.58455 Y:43.553869					
11	2 of 2	SE/79.7	79.8 / 0.00	7 Elizabeth Street North Mississauga ON L5G 2Y8	EHS
Order No:20190822036 Status:C Report Type:Standard Report Report Date:27-AUG-19 Date Received:22-AUG-19 Previous Site Name: Lot/Building Size: Nearest Intersection: Municipality: Client Prov/State:ON Search Radius (km):.25 X:-79.584531 Y:43.553856					

Source

Source Type: Data Survey
Source Orig: Geological Survey of Canada
Source Date: 1956-1972
Confidence: M
Observatio:
Source Name: Urban Geology Automated Information System (UGAIS)
Source Details: File: TOR1B.txt RecordID: 091050 NTS_Sheet: 30M12A
Confiden 1: Logs are approximately correct. Lack of information. Doubtful terminology.

Source Appl: Spatial/Tabular
Source Iden: 1
Scale or Res: Varies
Horizontal: NAD27
Verticalda: Mean Average Sea Level

Source List

Source Identifier: 1
Source Type: Data Survey
Source Date: 1956-1972
Scale or Resolution: Varies
Source Name: Urban Geology Automated Information System (UGAIS)
Source Originators: Geological Survey of Canada

Horizontal Datum: NAD27
Vertical Datum: Mean Average Sea Level
Projection Name: Universal Transverse Mercator

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Additional Info Ordered:					
12	1 of 1	E/79.8	79.8 / 0.00	ON	BORE
Borehole ID:		641137	Inclin FLG:		No
OGF ID:		215541532	SP Status:		Initial Entry
Status:			Surv Elev:		No
Type:		Borehole	Piezometer:		No
Use:		Geotechnical/Geological Investigation	Primary Name:		
Completion Date:		JAN-1965	Municipality:		
Static Water Level:			Lot:		
Primary Water Use:		Not Used	Township:		
Sec. Water Use:			Latitude DD:		43.554456
Total Depth m:		2.4	Longitude DD:		-79.584231
Depth Ref:		Ground Surface	UTM Zone:		17
Depth Elev:			Easting:		614355
Drill Method:		Power auger	Northing:		4823363
Orig Ground Elev m:		77.1	Location Accuracy:		
Elev Reliabil Note:			Accuracy:		Not Applicable
DEM Ground Elev m:		77.5			
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:		218494910	Mat Consistency:		
Top Depth:		0	Material Moisture:		
Bottom Depth:		.3	Material Texture:		
Material Color:			Non Geo Mat Type:		
Material 1:		Gravel	Geologic Formation:		
Material 2:			Geologic Group:		
Material 3:			Geologic Period:		
Material 4:			Depositional Gen:		alluvial
Gsc Material Description:					
Stratum Description:		GRAVEL. ALLUVIAL,AGE POST-GLACIAL.			
Geology Stratum ID:		218494911	Mat Consistency:		
Top Depth:		.3	Material Moisture:		
Bottom Depth:		.8	Material Texture:		
Material Color:		Brown	Non Geo Mat Type:		
Material 1:		Sand	Geologic Formation:		
Material 2:		Silt	Geologic Group:		
Material 3:		Clay	Geologic Period:		
Material 4:			Depositional Gen:		alluvial
Gsc Material Description:					
Stratum Description:		SAND,SILT,CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL.			
Geology Stratum ID:		218494912	Mat Consistency:		
Top Depth:		.8	Material Moisture:		
Bottom Depth:		1.8	Material Texture:		Medium
Material Color:			Non Geo Mat Type:		
Material 1:		Sand	Geologic Formation:		
Material 2:		Clay	Geologic Group:		
Material 3:			Geologic Period:		
Material 4:			Depositional Gen:		alluvial
Gsc Material Description:					
Stratum Description:		SAND-MEDIUM,CLAY. ALLUVIAL,AGE POST-GLACIAL.			
Geology Stratum ID:		218494913	Mat Consistency:		
Top Depth:		1.8	Material Moisture:		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	2.4 Sand Silt SAND-MEDIUM,SILT. ALLUVIAL,AGE POST-GLACIAL.			Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Medium alluvial
<u>Source</u>					
Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	Data Survey Geological Survey of Canada 1956-1972 M Urban Geology Automated Information System (UGAIS) File: TOR1B.txt RecordID: 091030 NTS_Sheet: 30M12A Logs are approximately correct. Lack of information. Doubtful terminology.			Source Appl: Source Iden: Scale or Res: Horizontal: Verticalda:	Spatial/Tabular 1 Varies NAD27 Mean Average Sea Level
<u>Source List</u>					
Source Identifier: Source Type: Source Date: Scale or Resolution: Source Name: Source Originators:	1 Data Survey 1956-1972 Varies Urban Geology Automated Information System (UGAIS) Geological Survey of Canada			Horizontal Datum: Vertical Datum: Projection Name:	NAD27 Mean Average Sea Level Universal Transverse Mercator
<u>13</u>	1 of 1	W/81.4	79.8 / 0.00	ON	BORE
Borehole ID: OGF ID: Status: Type: Use: Completion Date: Static Water Level: Primary Water Use: Sec. Water Use: Total Depth m: Depth Ref: Depth Elev: Drill Method: Orig Ground Elev m: Elev Reliabil Note: DEM Ground Elev m: Concession: Location D: Survey D: Comments:	640912 215541307 Borehole Geotechnical/Geological Investigation JAN-1965 Not Used 2.1 Ground Surface Power auger 77.4 79.1			Inclin FLG: SP Status: Surv Elev: Piezometer: Primary Name: Municipality: Lot: Township: Latitude DD: Longitude DD: UTM Zone: Easting: Northing: Location Accuracy: Accuracy:	No Initial Entry No No 43.554301 -79.586215 17 614195 4823343 Not Applicable
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3:	218494040 0 .1 Fill Gravel			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 4: Gsc Material Description: Stratum Description:		FILL, GRAVEL.		Depositional Gen:	fill
Geology Stratum ID:	218494041			Mat Consistency:	
Top Depth:	.1			Material Moisture:	
Bottom Depth:	.5			Material Texture:	Medium
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description: Stratum Description:		SAND-MEDIUM, CLAY, SILT.			
Geology Stratum ID:	218494042			Mat Consistency:	
Top Depth:	.5			Material Moisture:	Wet
Bottom Depth:	1.5			Material Texture:	Medium
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description: Stratum Description:		SAND-MEDIUM, SILT, CLAY. GREY, ALLUVIAL, WET, AGE POST-GLACIAL.			
Geology Stratum ID:	218494043			Mat Consistency:	
Top Depth:	1.5			Material Moisture:	
Bottom Depth:	1.8			Material Texture:	
Material Color:	Black			Non Geo Mat Type:	
Material 1:	Muck			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description: Stratum Description:		MUCK. BLACK, ALLUVIAL, AGE POST-GLACIAL.			
Geology Stratum ID:	218494044			Mat Consistency:	Firm
Top Depth:	1.8			Material Moisture:	
Bottom Depth:	2.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description: Stratum Description:		CLAY, SAND, SILT. ALLUVIAL, FIRM, AGE POST-GLACIAL. PO **Note: Many records provided by the department have a truncated [Stratum Description] field.			

Source

Source Type:	Data Survey	Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada	Source Iden:	1
Source Date:	1956-1972	Scale or Res:	Varies
Confidence:	M	Horizontal:	NAD27
Observatio:		Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)		
Source Details:	File: TOR1B.txt RecordID: 088780 NTS_Sheet: 30M12A		
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.		

Source List

Source Identifier:	1	Horizontal Datum:	NAD27
Source Type:	Data Survey	Vertical Datum:	Mean Average Sea Level

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Date:		1956-1972		Projection Name:	Universal Transverse Mercator
Scale or Resolution:		Varies			
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Originators:		Geological Survey of Canada			
14	1 of 1	NW/84.0	79.7 / -0.18	ON	BORE
Borehole ID:		640920		Inclin FLG:	No
OGF ID:		215541315		SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:		Borehole		Piezometer:	No
Use:		Geotechnical/Geological Investigation		Primary Name:	
Completion Date:		JAN-1965		Municipality:	
Static Water Level:				Lot:	
Primary Water Use:		Not Used		Township:	
Sec. Water Use:				Latitude DD:	43.555015
Total Depth m:		2.7		Longitude DD:	-79.585765
Depth Ref:		Ground Surface		UTM Zone:	17
Depth Elev:				Easting:	614230
Drill Method:		Power auger		Northing:	4823423
Orig Ground Elev m:		81.7		Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:		81.2			
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:		218494073		Mat Consistency:	
Top Depth:		0		Material Moisture:	
Bottom Depth:		.1		Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:		Asphalt		Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		ASPHALT.			
Geology Stratum ID:		218494074		Mat Consistency:	
Top Depth:		.1		Material Moisture:	
Bottom Depth:		.3		Material Texture:	
Material Color:		Brown		Non Geo Mat Type:	
Material 1:		Fill		Geologic Formation:	
Material 2:		Gravel		Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:		FILL,GRAVEL. BROWN.			
Geology Stratum ID:		218494076		Mat Consistency:	
Top Depth:		.6		Material Moisture:	
Bottom Depth:		1.1		Material Texture:	Medium
Material Color:		Brown		Non Geo Mat Type:	
Material 1:		Sand		Geologic Formation:	
Material 2:		Clay		Geologic Group:	
Material 3:		Silt		Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:		SAND-MEDIUM,CLAY, SILT. BROWN,ALLUVIAL, AGE POST-GLACIAL.			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Geology Stratum ID:	218494075			Mat Consistency:	
Top Depth:	.3			Material Moisture:	
Bottom Depth:	.6			Material Texture:	Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM,SILT, CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL.				
Geology Stratum ID:	218494077			Mat Consistency:	
Top Depth:	1.1			Material Moisture:	
Bottom Depth:	2.7			Material Texture:	Medium
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM,CLAY, SILT. GREY,ALLUVIAL, AGE POST-GLACIAL.				
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 088860 NTS_Sheet: 30M12A				
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.				
<u>Source List</u>					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
15	1 of 1	W/87.2	79.8 / 0.00	ON	BORE
Borehole ID:	640921			Inclin FLG:	No
OGF ID:	215541316			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.554526
Total Depth m:	2.7			Longitude DD:	-79.586272
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614190
Drill Method:	Power auger			Northing:	4823368
Orig Ground Elev m:	80.3			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	80.1				
Concession:					
Location D:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Survey D: Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218494078			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ASPHALT.				
Geology Stratum ID:	218494079			Mat Consistency:	
Top Depth:	.1			Material Moisture:	
Bottom Depth:	.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL,GRAVEL.				
Geology Stratum ID:	218494082			Mat Consistency:	
Top Depth:	1.5			Material Moisture:	
Bottom Depth:	2.1			Material Texture:	Medium
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM,SILT, CLAY. GREY,ALLUVIAL, AGE POST-GLACIAL.				
Geology Stratum ID:	218494080			Mat Consistency:	
Top Depth:	.2			Material Moisture:	
Bottom Depth:	.3			Material Texture:	Medium
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM,SILT, CLAY. ALLUVIAL,AGE POST-GLACIAL.				
Geology Stratum ID:	218494081			Mat Consistency:	
Top Depth:	.3			Material Moisture:	
Bottom Depth:	1.5			Material Texture:	Medium
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM,SILT, CLAY. GREY,ALLUVIAL, AGE POST-GLACIAL.				
Geology Stratum ID:	218494083			Mat Consistency:	
Top Depth:	2.1			Material Moisture:	
Bottom Depth:	2.7			Material Texture:	Coarse
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	Clay Silt			Geologic Group: Geologic Period: Depositional Gen:alluvial	
SAND-MEDIUM TO COARSE,CLAY,SILT. GREY,ALLUVIAL, AGE POST-GLACIAL.					
Source					
Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	Data Survey Geological Survey of Canada 1956-1972 M			Source Appl: Source Iden: Scale or Res: Horizontal: Verticalda: Urban Geology Automated Information System (UGAIS) File: TOR1B.txt RecordID: 088870 NTS_Sheet: 30M12A Logs are approximately correct. Lack of information. Doubtful terminology.	Spatial/Tabular 1 Varies NAD27 Mean Average Sea Level
Source List					
Source Identifier: Source Type: Source Date: Scale or Resolution: Source Name: Source Originators:	1 Data Survey 1956-1972 Varies Urban Geology Automated Information System (UGAIS) Geological Survey of Canada			Horizontal Datum: Vertical Datum: Projection Name:	NAD27 Mean Average Sea Level Universal Transverse Mercator
16	1 of 1	ENE/91.2	79.8 / 0.00	ON	BORE
Borehole ID: OGF ID: Status: Type: Use: Completion Date: Static Water Level: Primary Water Use: Sec. Water Use: Total Depth m: Depth Ref: Depth Elev: Drill Method: Orig Ground Elev m: Elev Reliabil Note: DEM Ground Elev m: Concession: Location D: Survey D: Comments:	640926 215541321 Borehole Geotechnical/Geological Investigation JAN-1965 Not Used 2.7 Ground Surface Power auger 77.1 77.6 			Inclin FLG: SP Status: Surv Elev: Piezometer: Primary Name: Municipality: Lot: Township: Latitude DD: Longitude DD: UTM Zone: Easting: Northing: Location Accuracy: Accuracy:	No Initial Entry No No 43.554771 -79.584224 17 614355 4823398 Not Applicable
Borehole Geology Stratum					
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218494106 .2 .3 Fill Gravel Granuls			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	 fill
FILL,GRAVEL,CINDERS.					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Geology Stratum ID:	218494108			Mat Consistency:	
Top Depth:	.5			Material Moisture:	
Bottom Depth:	.9			Material Texture:	
Material Color:	Yellow			Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:	Clay			Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL,SAND,SILT,CLAY.YELLOW.				
Geology Stratum ID:	218494111			Mat Consistency:	
Top Depth:	2.4			Material Moisture:	
Bottom Depth:	2.7			Material Texture:	
Material Color:	Black			Non Geo Mat Type:	
Material 1:	Silt			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	SILT,SAND,CLAY. BLACK,LAYERED, AGE POST-GLACIAL.				
Geology Stratum ID:	218494105			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL,GRAVEL.				
Geology Stratum ID:	218494109			Mat Consistency:	
Top Depth:	.9			Material Moisture:	
Bottom Depth:	1.8			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Granuls			Geologic Group:	
Material 3:	Sand			Geologic Period:	
Material 4:	Silt			Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL,CINDERS,SAND, SILT.				
Geology Stratum ID:	218494110			Mat Consistency:	
Top Depth:	1.8			Material Moisture:	
Bottom Depth:	2.4			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Organic			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:	Clay			Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ORGANIC,SAND,SILT, CLAY. AGE POST-GLACIAL.				
Geology Stratum ID:	218494107			Mat Consistency:	
Top Depth:	.3			Material Moisture:	
Bottom Depth:	.5			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:	Clay			Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL,SAND,SILT,CLAY.BROWN.				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Source Type: Data Survey Source Orig: Geological Survey of Canada Source Date: 1956-1972 Confidence: M Observatio: Source Name: Urban Geology Automated Information System (UGAIS) Source Details: File: TOR1B.txt RecordID: 088920 NTS_Sheet: 30M12A Confiden 1: Logs are approximately correct. Lack of information. Doubtful terminology. Source Appl: Spatial/Tabular Source Iden: 1 Scale or Res: Varies Horizontal: NAD27 Verticalda: Mean Average Sea Level					
Source List Source Identifier: 1 Source Type: Data Survey Source Date: 1956-1972 Scale or Resolution: Varies Source Name: Urban Geology Automated Information System (UGAIS) Source Originators: Geological Survey of Canada Horizontal Datum: NAD27 Vertical Datum: Mean Average Sea Level Projection Name: Universal Transverse Mercator					
17	1 of 1	SSE/91.6	79.8 / 0.00	ON	BORE
Borehole ID: 640909 OGF ID: 215541304 Status: Type: Borehole Use: Geotechnical/Geological Investigation Completion Date: JAN-1965 Static Water Level: Primary Water Use: Not Used Sec. Water Use: Total Depth m: 2.1 Depth Ref: Ground Surface Depth Elev: Drill Method: Power auger Orig Ground Elev m: 79.3 Elev Reliabil Note: DEM Ground Elev m: 78.7 Concession: Location D: Survey D: Comments: Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD: 43.553565 Longitude DD: -79.584995 UTM Zone: 17 Easting: 614295 Northing: 4823263 Location Accuracy: Accuracy: Not Applicable					
Borehole Geology Stratum Geology Stratum ID: 218494028 Top Depth: .2 Bottom Depth: 2.1 Material Color: Brown Material 1: Sand Material 2: Clay Material 3: Silt Material 4: Gsc Material Description: Stratum Description: SAND,CLAY,SILT. GREY,BROWN,ALLUVIAL,WET, AGE POST-GLACIAL. Mat Consistency: Material Moisture: Wet Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen: alluvial					
Geology Stratum ID: 218494027 Top Depth: 0 Bottom Depth: .2 Material Color: Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
18	2 of 3	NE/91.6	79.8 / 0.00	VERSACE LAWN CARE 66 HIGH STREET EAST, #202 MISSISSAUGA ON L5G1K2	PES
Detail Licence No: Licence No: 04313 Status: Approval Date: Report Source: Legacy Licenses (Excluding TS) Licence Type: Operator Licence Type Code: 02 Licence Class: 01 Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:		Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: 416 Oper Phone No: 2690458 Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:			
18	3 of 3	NE/91.6	79.8 / 0.00	VERSACE LAWN CARE 66 HIGH STREET EAST, #202 MISSISSAUGA ON L5G1K2	PES
Detail Licence No: Licence No: 04313 Status: Approval Date: Report Source: Legacy Licenses (Excluding TS) Licence Type: Operator Licence Type Code: 01 Licence Class: 06 Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:		Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: 416 Oper Phone No: 2690458 Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:			
19	1 of 1	SSW/98.1	79.8 / 0.00	ON	BORE
Borehole ID: 639269 OGF ID: 215539666 Status: Type: Borehole Use: Geotechnical/Geological Investigation Completion Date: JAN-1965 Static Water Level: Primary Water Use: Not Used Sec. Water Use: Total Depth m: 2.1 Depth Ref: Ground Surface Depth Elev: Drill Method: Power auger		Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD: 43.553527 Longitude DD: -79.585553 UTM Zone: 17 Easting: 614250 Northing: 4823258			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Orig Ground Elev m: Elev Reliabil Note: DEM Ground Elev m: Concession: Location D: Survey D: Comments:	78.9 78.5			Location Accuracy: Accuracy:	Not Applicable
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218487705 1.2 1.8 Grey Sand Silt Clay			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	 Medium alluvial
	SAND-MEDIUM,SILT, CLAY. GREY,ALLUVIAL, AGE POST-GLACIAL.				
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218487703 0 .1 Asphalt			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	
	ASPHALT.				
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218487706 1.8 2.1 Brown Sand			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	 Medium alluvial
	SAND-MEDIUM. BROWN,GREY,ALLUVIAL, AGE POST-GLACIAL. 01200 **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218487704 .1 1.2 Brown Sand Silt Clay			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	 Medium alluvial
	SAND-MEDIUM,SILT, CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL.				
<u>Source</u>					
Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details:	Data Survey Geological Survey of Canada 1956-1972 M			Source Appl: Source Iden: Scale or Res: Horizontal: Verticalda:	Spatial/Tabular 1 Varies NAD27 Mean Average Sea Level
	Urban Geology Automated Information System (UGAIS) File: TOR1B.txt RecordID: 072320 NTS Sheet: 30M12A				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Confiden 1:		Logs are approximately correct. Lack of information. Doubtful terminology.			
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
20	1 of 1	S/99.7	79.8 / 0.00	ON	BORE
Borehole ID:	646198			Inclin FLG:	No
OGF ID:	215546581			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	MAY-1968			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.553477
Total Depth m:	-999			Longitude DD:	-79.585182
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614280
Drill Method:	Power auger			Northing:	4823253
Orig Ground Elev m:	78.4			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	79.1				
Concession:					
Location D:					
Survey D:					
Comments:					
Borehole Geology Stratum					
Geology Stratum ID:	218513995			Mat Consistency:	Dense
Top Depth:	0			Material Moisture:	
Bottom Depth:				Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	SAND,SILT,CLAY. BROWN,GREY,GLACIAL,DENSE, AGE GLACIAL. 014 00000025 **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR2.txt RecordID: 142200 NTS_Sheet: 30M12A				
Confiden 1:	Reliable information but incomplete.				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Identifier: 1 Source Type: Data Survey Source Date: 1956-1972 Scale or Resolution: Varies Source Name: Urban Geology Automated Information System (UGAIS) Source Originators: Geological Survey of Canada					
Horizontal Datum: NAD27 Vertical Datum: Mean Average Sea Level Projection Name: Universal Transverse Mercator					
21	1 of 1	WSW/101.5	79.8 / 0.00	20 Elizabeth Street North Mississauga ON L5G 2Z1	EHS
Order No: 22042800151 Status: C Report Type: Standard Report Report Date: 03-MAY-22 Date Received: 28-APR-22 Previous Site Name: Lot/Building Size: Additional Info Ordered: City Directory					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.5863741 Y: 43.5540249					
22	1 of 1	W/103.3	79.8 / 0.00	Regional Municipality of Peel Elizabeth St. and Park St. Mississauga ON	SPL
Ref No: 5502-9EN45T Year: Incident Dt: 2013/12/22 Dt MOE Arvl on Scn: MOE Reported Dt: 2013/12/22 Dt Document Closed: Site No: MOE Response: No Field Response Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Elizabeth St. and Park St.<UNOFFICIAL> Site Address: Elizabeth St. and Park St. Site Region: Site Municipality: Mississauga Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Regional Municipality of Peel Client Type: Source Type: Incident Cause: Leak/Break Incident Preceding Spill: Incident Reason: Equipment Failure Incident Summary: Region of Peel: Potable water to SS, Credit River, L. Ont. Environment Impact: Not Anticipated Health Env Consequence: Nature of Impact: Surface Water Pollution Contaminant Qty: 0 other - see incident description Contaminant Qty 1: 0 Contaminant Unit: other - see incident description Contaminant Code: 99 Contaminant Name: WATER Contaminant Limit 1: Contam Limit Freq 1:					
Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant UN No 1: Receiving Medium: Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type:Water Supply SAC Action Class:Watercourse Spills Call Report Locatn Geodata: Time Reported: System Facility Address:					
23	1 of 1	WSW/107.1	79.8 / 0.00	29 PARK ST. EAST MISSISSAUGA ON	WWIS
Well ID:7296575 Construction Date: Use 1st:Test Hole Use 2nd:Monitoring Final Well Status:Monitoring and Test Hole Water Type: Casing Material: Audit No:Z258526 Tag:A189871 Constructn Method: Elevation (m): Elevatn Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality:MISSISSAUGA CITY (PORT CREDIT) Site Info:		Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received:10/05/2017 Selected Flag:TRUE Abandonment Rec: Contractor:7241 Form Version:7 Owner: County:PEEL Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/729\7296575.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:08/30/2017 Year Completed:2017 Depth (m):7.3152 Latitude:43.5537714511117 Longitude:-79.5862474432159 X:-79.58624729271284 Y:43.55377144880585 Path:729\7296575.pdf					
<u>Bore Hole Information</u>					
Bore Hole ID:1006758610 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed:08/30/2017 Remarks: Location Method Desc:on Water Well Record Elevrc Desc: Location Source Date:		Elevation: Elevrc: Zone:17 East83:614193.00 North83:4823284.00 Org CS:UTM83 UTMRC:4 UTMRC Desc:margin of error : 30 m - 100 m Location Method:wwr			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1006953363			
Layer:		5			
Color:		2			
General Color:		GREY			
Material 1:		17			
Material 1 Desc:		SHALE			
Material 2:					
Material 2 Desc:					
Material 3:		71			
Material 3 Desc:		FRACTURED			
Formation Top Depth:		18.0			
Formation End Depth:		24.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1006953361			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		34			
Material 1 Desc:		TILL			
Material 2:		73			
Material 2 Desc:		HARD			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		7.0			
Formation End Depth:		13.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1006953359			
Layer:		1			
Color:		2			
General Color:		GREY			
Material 1:		11			
Material 1 Desc:		GRAVEL			
Material 2:		09			
Material 2 Desc:		MEDIUM SAND			
Material 3:		79			
Material 3 Desc:		PACKED			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1006953360			
Layer:		2			
Color:		6			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
General Color:		BROWN			
Material 1:		34			
Material 1 Desc:		TILL			
Material 2:		73			
Material 2 Desc:		HARD			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		1.0			
Formation End Depth:		7.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1006953362			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		17			
Material 1 Desc:		SHALE			
Material 2:					
Material 2 Desc:					
Material 3:		92			
Material 3 Desc:		WEATHERED			
Formation Top Depth:		13.0			
Formation End Depth:		18.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1006953372			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1006953375			
Layer:		4			
Plug From:		17.5			
Plug To:		24.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1006953373			
Layer:		2			
Plug From:		1.0			
Plug To:		2.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1006953374			
Layer:		3			
Plug From:		2.0			
Plug To:		17.5			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006953371			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:		DIRECT PUSH			
<u>Pipe Information</u>					
Pipe ID:		1006953358			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006953367			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		19.0			
Casing Diameter:		1.3799999952316284			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006953368			
Layer:		1			
Slot:		10			
Screen Top Depth:		19.0			
Screen End Depth:		24.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.659999966621399			
<u>Water Details</u>					
Water ID:		1006953366			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006953364			
Diameter:		2.875			
Depth From:		0.0			
Depth To:		14.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Hole Diameter</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole ID: Diameter: Depth From: Depth To: Hole Depth UOM: Hole Diameter UOM: 1006953365 2.375 14.0 24.0 ft inch					
24	1 of 1	NW/107.2	78.8 / -1.00	ON	BORE
Borehole ID: OGF ID: Status: Type: Use: Completion Date: Static Water Level: Primary Water Use: Sec. Water Use: Total Depth m: Depth Ref: Depth Elev: Drill Method: Orig Ground Elev m: Elev Reliabil Note: DEM Ground Elev m: Concession: Location D: Survey D: Comments: 646199 215546582 Borehole Geotechnical/Geological Investigation JUN-1968 0.6 Not Used 6.4 Ground Surface Power auger 82.3 81.9 Inclin FLG: SP Status: Surv Elev: Piezometer: Primary Name: Municipality: Lot: Township: Latitude DD: Longitude DD: UTM Zone: Easting: Northing: Location Accuracy: Accuracy: No Initial Entry No No 43.555109 -79.586073 17 614205 4823433 Not Applicable					
Borehole Geology Stratum Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description: 218513996 0 .2 Soil SOIL. Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description: 218513997 .2 4.1 Brown Silt Sand Clay SILT,SAND,CLAY. BROWN,GREY,GLACIAL,DENSE, LAYERED,AGE GLACIAL. Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen: Dense glacial					
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: 218513998 4.1 4.9 Grey Clay Silt Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen: Stiff lacustrine					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Gsc Material Description:					
Stratum Description:		CLAY,SILT. GREY,LACUSTRINE,STIFF,LAYERED,AGE GLACIAL, WATER STABLE AT 267.9 FEET.			
Geology Stratum ID:	218513999			Mat Consistency:	Hard
Top Depth:	4.9			Material Moisture:	
Bottom Depth:	6.4			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:	Shale			Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:		TILL,CLAY,SILT,SHALEGLACIAL,HARD,AGE GLACIAL. 018 018032038 010 000050390 **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR2.txt RecordID: 142210 NTS_Sheet: 30M12A				
Confiden 1:	Reliable information but incomplete.				
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
25	1 of 1	N/111.6	79.8 / 0.00	ON	BORE
Borehole ID:	639272			Inclin FLG:	No
OGF ID:	215539669			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.555371
Total Depth m:	2.7			Longitude DD:	-79.585386
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614260
Drill Method:	Power auger			Northing:	4823463
Orig Ground Elev m:	81.4			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	80.7				
Concession:					
Location D:					
Survey D:					
Comments:					
Borehole Geology Stratum					
Geology Stratum ID:	218487715			Mat Consistency:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Top Depth:	0			Material Moisture:	
Bottom Depth:	.3			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:		FILL, GRAVEL. GREY.			
Geology Stratum ID:	218487717			Mat Consistency:	
Top Depth:	1.2			Material Moisture:	Moist
Bottom Depth:	2.7			Material Texture:	Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:		SAND-MEDIUM, CLAY, SILT. BROWN, ALLUVIAL, MOIST, AGE POST-GLACIAL. LUVIAL			**Note: Many records provided by the department have a truncated [Stratum Description] field.
Geology Stratum ID:	218487716			Mat Consistency:	
Top Depth:	.3			Material Moisture:	
Bottom Depth:	1.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:		SAND, CLAY, SILT. ALLUVIAL, AGE POST-GLACIAL.			
Geology Stratum ID:	218487714			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	0			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		ASPHALT.			
Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Details:		File: TOR1B.txt RecordID: 072350 NTS_Sheet: 30M12A			
Confiden 1:		Logs are approximately correct. Lack of information. Doubtful terminology.			
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Originators:		Geological Survey of Canada			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
26	1 of 1	E/112.2	79.8 / 0.00	PUC 7 HELENE ST. PORT CREDIT MISSISSAUGA CITY ON	SPL
Ref No: 12986 Year: Incident Dt: 12/21/1988 Dt MOE Arvl on Scn: MOE Reported Dt: 12/21/1988 Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Site Address: Site Region: Site Municipality: MISSISSAUGA CITY Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: OTHER CONTAINER LEAK Incident Preceding Spill: Incident Reason: OTHER Incident Summary: Environment Impact: Health Env Consequence: Nature of Impact: Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: LAND Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address: Municipality No: 21102 Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:					
27	1 of 1	SSW/117.0	79.8 / 0.00	ON	BORE
Borehole ID: 639270 OGF ID: 215539667 Status: Type: Borehole Use: Geotechnical/Geological Investigation Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.553394
Total Depth m:	2.7			Longitude DD:	-79.585741
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614235
Drill Method:	Power auger			Northing:	4823243
Orig Ground Elev m:	80.3			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	79.6				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218487709			Mat Consistency:	
Top Depth:	1.2			Material Moisture:	
Bottom Depth:	2.7			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND,SILT,CLAY. GREY,ALLUVIAL,AGE GLACIAL. A **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	218487707			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Stones			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL,STONES.				
Geology Stratum ID:	218487708			Mat Consistency:	
Top Depth:	.1			Material Moisture:	
Bottom Depth:	1.2			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND,SILT. BROWN,ALLUVIAL, AGE POST-GLACIAL.				
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 072330 NTS_Sheet: 30M12A				
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
28	1 of 1	WNW/117.6	78.8 / -1.00	EDENSHAW ELIZABETH DEVELOPMENTS LIMITED 46 Park ST E Mississauga ON	RSC
RSC No:	B-402-8223895421			X:	-79.58611111105918
RA No:				Y:	43.554722221192385
Status:	Active			Latitude:	43.55472222
Filing Date:				Longitude:	-79.58611111
Date Ack:				UTM Coordinates:	
Date Returned:				Latitude Longitude:	
Approval Date:	July 26, 2023			Accuracy Estimate:	
Cert Date:				Measurement Method:	
Cert Prop Use No:				Mailing Address:	
Curr Property Use:				Telephone:	
Intended Prop Use:				Fax:	
Restoration Type:				Email:	
Soil Type:				Postal Code:	L5G 1M1
Criteria:				Ministry District:	
Stratified (Y/N):				MOE District:	Halton-Peel
Audit (Y/N):				SWP Area Name:	Credit Valley
Entire Leg Prop. (Y/N):				Qual Person Name:	Matthew Bielaski
CPU Issu Sect 1686:				Consultant:	
Business Name:	EDENSHAW ELIZABETH DEVELOPMENTS LIMITED				
Address:	46 Park ST E				
Legal Desc:					
Site Pin:	13463-0001(LT), 13463-0002(LT), 13463-0003(LT), 13463-0092(LT)				
Asmt Roll No:					
Project Type:	RSC based on Phase One ESA				
Approval Type:	RSC-RSC based on Phase One ESA				
Applicable Standards:					
PDF Link:	https://www.accessenvironment.ene.gov.on.ca/AEWeb/ae/ViewDocument.action?documentRefID=3034813				
29	1 of 1	S/119.6	79.8 / 0.00	ON	BORE
Borehole ID:	646197			Inclin FLG:	No
OGF ID:	215546580			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	MAY-1968			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.553298
Total Depth m:	9.4			Longitude DD:	-79.585248
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614275
Drill Method:	Power auger			Northing:	4823233
Orig Ground Elev m:	81.7			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	80.4				
Concession:					
Location D:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Survey D: Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218513993			Mat Consistency:	Dense
Top Depth:	0			Material Moisture:	
Bottom Depth:	9.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Silt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	SILT. GLACIAL,DENSE,AGE GLACIAL.				
Geology Stratum ID:	218513994			Mat Consistency:	Hard
Top Depth:	9.1			Material Moisture:	
Bottom Depth:	9.4			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Shale			Geologic Period:	
Material 4:				Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	TILL,CLAY,SHALE. GREY,GLACIAL,HARD,AGE GLACIAL. 010 **Note: Many records provided by the department have a truncated [Stratum Description] field.				
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR2.txt RecordID: 142190 NTS_Sheet: 30M12A				
Confiden 1:	Reliable information but incomplete.				
<u>Source List</u>					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
30	1 of 1	WNW/120.4	79.0 / -0.85	EDENSHAW ELIZABETH DEVELOPMENTS LIMITED 44 Park ST E Mississauga ON	RSC
RSC No:	B-402-8223895421			X:	-79.58638888900965
RA No:				Y:	43.554722221192385
Status:	Active			Latitude:	43.55472222
Filing Date:				Longitude:	-79.58638889
Date Ack:				UTM Coordinates:	
Date Returned:				Latitude Longitude:	
Approval Date:	July 26, 2023			Accuracy Estimate:	
Cert Date:				Measurement Method:	
Cert Prop Use No:				Mailing Address:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Curr Property Use: Intended Prop Use: Restoration Type: Soil Type: Criteria: Stratified (Y/N): Audit (Y/N): Entire Leg Prop. (Y/N): CPU Issu Sect 1686: Business Name: Address: Legal Desc: Site Pin: Asmt Roll No: Project Type: Approval Type: Applicable Standards: PDF Link: Telephone: Fax: Email: Postal Code: Ministry District: MOE District: SWP Area Name: Qual Person Name: Consultant: L5G 1M1 Halton-Peel Credit Valley Matthew Bielaski EDENSHAW ELIZABETH DEVELOPMENTS LIMITED 44 Park ST E 13463-0001(LT), 13463-0002(LT), 13463-0003(LT), 13463-0092(LT) RSC based on Phase One ESA RSC-RSC based on Phase One ESA https://www.accessenvironment.ene.gov.on.ca/AEWeb/ae/ViewDocument.action?documentRefID=3034813					
31	1 of 1	WNW/121.8	79.4 / -0.48	EDENSHAW ELIZABETH DEVELOPMENTS LIMITED 42 Park ST E Mississauga ON	RSC
RSC No: RA No: Status: Filing Date: Date Ack: Date Returned: Approval Date: Cert Date: Cert Prop Use No: Curr Property Use: Intended Prop Use: Restoration Type: Soil Type: Criteria: Stratified (Y/N): Audit (Y/N): Entire Leg Prop. (Y/N): CPU Issu Sect 1686: Business Name: Address: Legal Desc: Site Pin: Asmt Roll No: Project Type: Approval Type: Applicable Standards: PDF Link: B-402-8223895421 Active July 26, 2023 EDENSHAW ELIZABETH DEVELOPMENTS LIMITED 42 Park ST E 13463-0001(LT), 13463-0002(LT), 13463-0003(LT), 13463-0092(LT) RSC based on Phase One ESA RSC-RSC based on Phase One ESA https://www.accessenvironment.ene.gov.on.ca/AEWeb/ae/ViewDocument.action?documentRefID=3034813 X: Y: Latitude: Longitude: UTM Coordinates: Latitude Longitude: Accuracy Estimate: Measurement Method: Mailing Address: Telephone: Fax: Email: Postal Code: Ministry District: MOE District: SWP Area Name: Qual Person Name: Consultant: -79.58666666666667 43.554444443583854 43.55444444 -79.58666667 L5G 1M1 Halton-Peel Credit Valley Matthew Bielaski 					
32	1 of 1	SE/123.5	79.8 / 0.00	94 Lakeshore Road East Mississauga ON	WWIS
Well ID: Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: 7344847 Monitoring Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: Selected Flag: Abandonment Rec: 10/09/2019 TRUE 					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Audit No:	Z319207			Contractor:	7241
Tag:	A252201			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY (PORT CREDIT)			
Site Info:					

Additional Detail(s) (Map)

Bore Hole ID:	1007683879	Tag No:	A252201
Depth M:	3.9624	Contractor:	7241
Year Completed:	2019	Latitude:	43.5535125979535
Well Completed Dt:	08/20/2019	Longitude:	-79.5842479040807
Audit No:	Z319207	Y:	43.553512595709805
Path:		X:	-79.58424775404234

Bore Hole Information

Bore Hole ID:	1007683879	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614355.00
Code OB Desc:		North83:	4823258.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	08/20/2019	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock

Materials Interval

Formation ID:	1007873286
Layer:	2
Color:	2
General Color:	GREY
Material 1:	06
Material 1 Desc:	SILT
Material 2:	05
Material 2 Desc:	CLAY
Material 3:	91
Material 3 Desc:	WATER-BEARING
Formation Top Depth:	8.0
Formation End Depth:	13.0
Formation End Depth UOM:	ft

Overburden and Bedrock

Materials Interval

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		1007873285			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		8.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007874383			
Layer:		3			
Plug From:		0.0			
Plug To:		6.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007874381			
Layer:		1			
Plug From:		2.5			
Plug To:		13.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007874382			
Layer:		2			
Plug From:		2.0			
Plug To:		2.5			
Plug Depth UOM:		ft			
 <u>Pipe Information</u>					
Pipe ID:		1007871839			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1007876129			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		3.0			
Depth To:		3.0			
Casing Diameter:		1.25			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen ID:		1007876589			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.0			
Screen End Depth:		13.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.5			
 <u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007877227			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
 <u>Hole Diameter</u>					
Hole ID:		1007875026			
Diameter:		3.0			
Depth From:		6.0			
Depth To:		13.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
 <u>Hole Diameter</u>					
Hole ID:		1007875027			
Diameter:		6.0			
Depth From:		0.0			
Depth To:		6.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
33	1 of 1	NW/124.7	78.8 / -1.00	ON	BORE
Borehole ID:	646200			Inclin FLG:	No
OGF ID:	215546583			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JUN-1968			Municipality:	
Static Water Level:	0.6			Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.555202
Total Depth m:	6.3			Longitude DD:	-79.586256

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614190
Drill Method:	Power auger			Northing:	4823443
Orig Ground Elev m:	81.1			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	82.1				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218514003			Mat Consistency:	Hard
Top Depth:	3.2			Material Moisture:	
Bottom Depth:	6.3			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:	Shale			Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	TILL,CLAY,SILT,SHALEGREY,GLACIAL,HARD,AGE GLACIAL. 019 033 017 00005 **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	218514001			Mat Consistency:	Dense
Top Depth:	.2			Material Moisture:	
Bottom Depth:	2.6			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Silt			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	SILT,SAND. BROWN,GREY,GLACIAL,DENSE, AGE GLACIAL.				
Geology Stratum ID:	218514002			Mat Consistency:	Stiff
Top Depth:	2.6			Material Moisture:	
Bottom Depth:	3.2			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	lacustrine
Gsc Material Description:					
Stratum Description:	CLAY,SILT. GREY,LACUSTRINE,STIFF, AGE GLACIAL, WATER STABLE AT 264.0 FEET.				
Geology Stratum ID:	218514000			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Soil			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	SOIL.				
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Details:		File: TOR2.txt RecordID: 142220 NTS_Sheet: 30M12A			
Confiden 1:		Reliable information but incomplete.			
Source List					
Source Identifier:		1	Horizontal Datum:		NAD27
Source Type:		Data Survey	Vertical Datum:		Mean Average Sea Level
Source Date:		1956-1972	Projection Name:		Universal Transverse Mercator
Scale or Resolution:		Varies			
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Originators:		Geological Survey of Canada			
34	1 of 1	NW/126.1	78.8 / -1.00	ON	BORE
Borehole ID:		641140	Inclin FLG:		No
OGF ID:		215541535	SP Status:		Initial Entry
Status:			Surv Elev:		No
Type:		Borehole	Piezometer:		No
Use:		Geotechnical/Geological Investigation	Primary Name:		
Completion Date:		JAN-1965	Municipality:		
Static Water Level:			Lot:		
Primary Water Use:		Not Used	Township:		
Sec. Water Use:			Latitude DD:		43.555378
Total Depth m:		2.7	Longitude DD:		-79.585943
Depth Ref:		Ground Surface	UTM Zone:		17
Depth Elev:			Easting:		614215
Drill Method:		Power auger	Northing:		4823463
Orig Ground Elev m:		81.7	Location Accuracy:		
Elev Reliabil Note:			Accuracy:		Not Applicable
DEM Ground Elev m:		81.3			
Concession:					
Location D:					
Survey D:					
Comments:					
Borehole Geology Stratum					
Geology Stratum ID:		218494927	Mat Consistency:		
Top Depth:		.4	Material Moisture:		
Bottom Depth:		1.2	Material Texture:		Medium
Material Color:			Non Geo Mat Type:		
Material 1:		Sand	Geologic Formation:		
Material 2:		Silt	Geologic Group:		
Material 3:		Clay	Geologic Period:		
Material 4:			Depositional Gen:		alluvial
Gsc Material Description:					
Stratum Description:		SAND-MEDIUM,SILT, CLAY. ALLUVIAL,AGE POST-GLACIAL.			
Geology Stratum ID:		218494924	Mat Consistency:		
Top Depth:		0	Material Moisture:		
Bottom Depth:		.1	Material Texture:		
Material Color:			Non Geo Mat Type:		
Material 1:		Asphalt	Geologic Formation:		
Material 2:			Geologic Group:		
Material 3:			Geologic Period:		
Material 4:			Depositional Gen:		
Gsc Material Description:					
Stratum Description:		ASPHALT.			
Geology Stratum ID:		218494925	Mat Consistency:		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	.1 .1 Fill Gravel FILL, GRAVEL.			Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	 fill
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218494926 .1 .4 Brown Sand Silt Clay SAND-MEDIUM, SILT, CLAY. BROWN, ALLUVIAL, AGE POST-GLACIAL.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	 Medium alluvial
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218494928 1.2 2.7 Grey Sand Silt SAND-MEDIUM, SILT. GREY, ALLUVIAL, AGE POST-GLACIAL. SAND- **Note: Many records provided by the department have a truncated [Stratum Description] field.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	 Medium alluvial
Source					
Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	Data Survey Geological Survey of Canada 1956-1972 M Urban Geology Automated Information System (UGAIS) File: TOR1B.txt RecordID: 091060 NTS_Sheet: 30M12A Logs are approximately correct. Lack of information. Doubtful terminology.			Source Appl: Source Iden: Scale or Res: Horizontal: Verticalda:	Spatial/Tabular 1 Varies NAD27 Mean Average Sea Level
Source List					
Source Identifier: Source Type: Source Date: Scale or Resolution: Source Name: Source Originators:	1 Data Survey 1956-1972 Varies Urban Geology Automated Information System (UGAIS) Geological Survey of Canada			Horizontal Datum: Vertical Datum: Projection Name:	NAD27 Mean Average Sea Level Universal Transverse Mercator
35	1 of 1	SE/126.4	79.8 / 0.00	94 Lakeshore Rd East Mississauga ON	WWIS
Well ID: Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material:	7344848 Monitoring Observation Wells 			Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: Selected Flag: Abandonment Rec:	 10/09/2019 TRUE

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Audit No:	Z313564			Contractor:	7241
Tag:	A277142			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY (PORT CREDIT)			
Site Info:					

Additional Detail(s) (Map)

Bore Hole ID:	1007683882	Tag No:	A277142
Depth M:	3.9624	Contractor:	7241
Year Completed:	2019	Latitude:	43.5534854402792
Well Completed Dt:	08/20/2019	Longitude:	-79.5842361597699
Audit No:	Z313564	Y:	43.553485437700346
Path:		X:	-79.58423601037278

Bore Hole Information

Bore Hole ID:	1007683882	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614356.00
Code OB Desc:		North83:	4823255.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	08/20/2019	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock

Materials Interval

Formation ID:	1007873287
Layer:	1
Color:	6
General Color:	BROWN
Material 1:	06
Material 1 Desc:	SILT
Material 2:	28
Material 2 Desc:	SAND
Material 3:	
Material 3 Desc:	
Formation Top Depth:	0.0
Formation End Depth:	8.0
Formation End Depth UOM:	ft

Overburden and Bedrock

Materials Interval

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		1007873288			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:		91			
Material 3 Desc:		WATER-BEARING			
Formation Top Depth:		8.0			
Formation End Depth:		13.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007874386			
Layer:		3			
Plug From:		0.0			
Plug To:		6.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007874384			
Layer:		1			
Plug From:		2.5			
Plug To:		13.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007874385			
Layer:		2			
Plug From:		2.0			
Plug To:		2.5			
Plug Depth UOM:		ft			
 <u>Pipe Information</u>					
Pipe ID:		1007871840			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1007876130			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		3.0			
Depth To:		3.0			
Casing Diameter:		1.25			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen ID:		1007876590			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.0			
Screen End Depth:		13.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.5			
 <u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007877228			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
 <u>Hole Diameter</u>					
Hole ID:		1007875029			
Diameter:		6.0			
Depth From:		0.0			
Depth To:		6.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
 <u>Hole Diameter</u>					
Hole ID:		1007875028			
Diameter:		3.0			
Depth From:		6.0			
Depth To:		13.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
36	1 of 1	W/127.5	79.7 / -0.10	ON	BORE
Borehole ID:	640913			Inclin FLG:	No
OGF ID:	215541308			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.554578
Total Depth m:	-999			Longitude DD:	-79.586766

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth Ref:		Ground Surface		UTM Zone:	17
Depth Elev:				Easting:	614150
Drill Method:		Power auger		Northing:	4823373
Orig Ground Elev m:		80.5		Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:		80.6			
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:		218494047		Mat Consistency:	
Top Depth:		.1		Material Moisture:	
Bottom Depth:		1.2		Material Texture:	Medium
Material Color:		Brown		Non Geo Mat Type:	
Material 1:		Sand		Geologic Formation:	
Material 2:		Silt		Geologic Group:	
Material 3:		Clay		Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:		SAND-MEDIUM,SILT, CLAY. BROWN,ALLUVIAL,LAYERED, AGE POST-GLACIAL.			
Geology Stratum ID:		218494046		Mat Consistency:	
Top Depth:		0		Material Moisture:	
Bottom Depth:		.1		Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:		Fill		Geologic Formation:	
Material 2:		Gravel		Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:		FILL,GRAVEL.			
Geology Stratum ID:		218494048		Mat Consistency:	
Top Depth:		1.2		Material Moisture:	Wet
Bottom Depth:				Material Texture:	Medium
Material Color:		Brown		Non Geo Mat Type:	
Material 1:		Sand		Geologic Formation:	
Material 2:		Clay		Geologic Group:	
Material 3:		Silt		Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:		SAND-MEDIUM,CLAY, SILT. BROWN,ALLUVIAL,WET, AGE POST-GLACIAL.			
Geology Stratum ID:		218494045		Mat Consistency:	
Top Depth:		0		Material Moisture:	
Bottom Depth:		0		Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:		Asphalt		Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		ASPHALT.			
<u>Source</u>					
Source Type:		Data Survey		Source Appl:	Spatial/Tabular
Source Orig:		Geological Survey of Canada		Source Iden:	1
Source Date:		1956-1972		Scale or Res:	Varies
Confidence:		M		Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Details:		File: TOR1B.txt RecordID: 088790 NTS_Sheet: 30M12A			
Confiden 1:		Logs are approximately correct. Lack of information. Doubtful terminology.			
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				

37	1 of 1	ENE/127.6	79.8 / 0.00	ON	BORE
Borehole ID:	640925			Inclin FLG:	No
OGF ID:	215541320			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.555083
Total Depth m:	1.2			Longitude DD:	-79.583969
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614375
Drill Method:	Power auger			Northing:	4823433
Orig Ground Elev m:	78.3			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	78.3				
Concession:					
Location D:					
Survey D:					
Comments:					

Borehole Geology Stratum

Geology Stratum ID:	218494104		Mat Consistency:	
Top Depth:	.6		Material Moisture:	
Bottom Depth:	1.2		Material Texture:	
Material Color:			Non Geo Mat Type:	
Material 1:	Silt		Geologic Formation:	
Material 2:	Sand		Geologic Group:	
Material 3:	Clay		Geologic Period:	
Material 4:			Depositional Gen:	alluvial
Gsc Material Description:				
Stratum Description:	SILT(45),SAND(37), CLAY(18). ALLUVIAL,AGE POST-GLACIAL. L.			
Geology Stratum ID:	218494103		Mat Consistency:	
Top Depth:	.2		Material Moisture:	
Bottom Depth:	.6		Material Texture:	
Material Color:	Brown		Non Geo Mat Type:	
Material 1:	Clay		Geologic Formation:	
Material 2:	Silt		Geologic Group:	
Material 3:	Sand		Geologic Period:	
Material 4:			Depositional Gen:	alluvial
Gsc Material Description:				
Stratum Description:	CLAY,SILT,SAND. BROWN,ALLUVIAL, AGE POST-GLACIAL.			
Geology Stratum ID:	218494101		Mat Consistency:	
Top Depth:	0		Material Moisture:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	0 Asphalt 218494102 0 .2 Fill Gravel Fill Gravel FILL, GRAVEL.			Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen: Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	
Source					
Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	Data Survey Geological Survey of Canada 1956-1972 M Urban Geology Automated Information System (UGAIS) File: TOR1B.txt RecordID: 088910 NTS_Sheet: 30M12A Logs are approximately correct. Lack of information. Doubtful terminology.			Source Appl: Source Iden: Scale or Res: Horizontal: Verticalda:	Spatial/Tabular 1 Varies NAD27 Mean Average Sea Level
Source List					
Source Identifier: Source Type: Source Date: Scale or Resolution: Source Name: Source Originators:	1 Data Survey 1956-1972 Varies Urban Geology Automated Information System (UGAIS) Geological Survey of Canada			Horizontal Datum: Vertical Datum: Projection Name:	NAD27 Mean Average Sea Level Universal Transverse Mercator
38	1 of 1	W/129.3	79.8 / 0.00	ON	BORE
Borehole ID: OGF ID: Status: Type: Use: Completion Date: Static Water Level: Primary Water Use: Sec. Water Use: Total Depth m: Depth Ref: Depth Elev: Drill Method: Orig Ground Elev m: Elev Reliabil Note: DEM Ground Elev m: Concession: Location D: Survey D: Comments:	640922 215541317 Borehole Geotechnical/Geological Investigation JAN-1965 Not Used 2.7 Ground Surface Power auger 78.3 78.1			Inclin FLG: SP Status: Surv Elev: Piezometer: Primary Name: Municipality: Lot: Township: Latitude DD: Longitude DD: UTM Zone: Easting: Northing: Location Accuracy: Accuracy:	No Initial Entry No No 43.554128 -79.586777 17 614150 4823323 Not Applicable

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218494086			Mat Consistency:	
Top Depth:	.3			Material Moisture:	
Bottom Depth:	1.2			Material Texture:	Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:	Silt			Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL-MEDIUM,SAND, CLAY,SILT. BROWN.				
Geology Stratum ID:	218494087			Mat Consistency:	
Top Depth:	1.2			Material Moisture:	Wet
Bottom Depth:	1.8			Material Texture:	Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:	Silt			Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL-MEDIUM,SAND, CLAY,SILT. BROWN,WET.				
Geology Stratum ID:	218494085			Mat Consistency:	
Top Depth:	.1			Material Moisture:	
Bottom Depth:	.3			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL,GRAVEL.				
Geology Stratum ID:	218494088			Mat Consistency:	
Top Depth:	1.8			Material Moisture:	
Bottom Depth:	2.6			Material Texture:	
Material Color:	Black			Non Geo Mat Type:	
Material 1:	Organic			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Sand			Geologic Period:	
Material 4:	Silt			Depositional Gen:	organic
Gsc Material Description:					
Stratum Description:	ORGANIC,CLAY,SAND, SILT. BLACK.				
Geology Stratum ID:	218494084			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ASPHALT.				
Geology Stratum ID:	218494089			Mat Consistency:	Firm
Top Depth:	2.6			Material Moisture:	
Bottom Depth:	2.7			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Silt			Geologic Period:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:		SAND,CLAY,SILT. BROWN,ALLUVIAL,FIRM, AGE POST-GLACIAL. D- **Note: Many records provided by the department have a truncated [Stratum Description] field.			
<u>Source</u>					
Source Type:		Data Survey	Source Appl:		Spatial/Tabular
Source Orig:		Geological Survey of Canada	Source Iden:		1
Source Date:		1956-1972	Scale or Res:		Varies
Confidence:		M	Horizontal:		NAD27
Observatio:			Verticalda:		Mean Average Sea Level
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Details:		File: TOR1B.txt RecordID: 088880 NTS_Sheet: 30M12A			
Confiden 1:		Logs are approximately correct. Lack of information. Doubtful terminology.			
<u>Source List</u>					
Source Identifier:		1	Horizontal Datum:		NAD27
Source Type:		Data Survey	Vertical Datum:		Mean Average Sea Level
Source Date:		1956-1972	Projection Name:		Universal Transverse Mercator
Scale or Resolution:		Varies			
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Originators:		Geological Survey of Canada			
39	1 of 2	SE/130.4	79.8 / 0.00	HOOPER'S PHARMACY 19-650 100 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E3	GEN
<u>Generator Info</u>					
Generator No:		ON1537800	Choice of Contact:		
Approval Years:		92,93,94,95,96,97,98	Contaminated Fac:		
Status:			MHSW Facility:		
PO Box No:			SIC Code:		6031
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		PHARMACIES			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Description:		PHARMACIES			
<u>Waste Detail(s)</u>					
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			

40	1 of 1	ENE/132.2	79.8 / 0.00	FRAM GROUP (CANADA) INC 69 High St. E Mississauga ON	SPL
Ref No:		3448-AMNA27		Municipality No:	
Year:				Nature of Damage:	
Incident Dt:		5/24/2017		Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:		5/24/2017		Impact to Health:	
Dt Document Closed:				Agency Involved:	
Site No:				2 - Minor Environment	
MOE Response:					
Site County/District:		Regional Municipality of Peel			
Site Geo Ref Meth:					
Site District Office:		Halton-Peel			
Nearest Watercourse:					
Site Name:		Concrete waste to CB's<UNOFFICIAL>			
Site Address:		69 High St. E			
Site Region:		Central			
Site Municipality:		Mississauga			
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Entity Operating Name:					
Client Name:		FRAM GROUP (CANADA) INC			
Client Type:		Corporation			
Source Type:		Other			
Incident Cause:					
Incident Preceding Spill:		Operator/Human error			
Incident Reason:		Deliberate Act			
Incident Summary:		Mississauga: concrete, drill bits and wash water to CB's			
Environment Impact:					
Health Env Consequence:					
Nature of Impact:					
Contaminant Qty:		1 n/a			
Contaminant Qty 1:		1			
Contaminant Unit:		n/a			
Contaminant Code:		27			
Contaminant Name:		CONCRETE			
Contaminant Limit 1:					
Contam Limit Freq 1:					
Contaminant UN No 1:		n/a			
Receiving Medium:		Land			
Activity Preceding Spill:					
Property 2nd Watershed:					
Property Tertiary Watershed:					
Sector Type:		Other			
SAC Action Class:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Call Report Locatn Geodata: Time Reported: System Facility Address:					
41	1 of 1	ESE/132.7	79.8 / 0.00	CASPIAN CUSTOM CANVAS INC. 106 LAKESHORE RD E SUITE 104 MISSISSAUGA ON L5G 1E3	SCT
Established: 1988 Plant Size (ft²): 0 Employment: 5					
--Details--					
Description:		CANVAS AND RELATED PRODUCTS			
SIC/NAICS Code:		2394			
Description:		MANUFACTURING INDUSTRIES, NOT ELSEWHERE CLASSIFIED			
SIC/NAICS Code:		3999			
Description:		Textile Bag and Canvas Mills			
SIC/NAICS Code:		314910			
Description:		Commercial Screen Printing			
SIC/NAICS Code:		323113			
Description:		Digital Printing			
SIC/NAICS Code:		323115			
Description:		Sign Manufacturing			
SIC/NAICS Code:		339950			
Description:		All Other Miscellaneous Manufacturing			
SIC/NAICS Code:		339990			
42	1 of 1	W/133.5	79.4 / -0.44	ON	WWIS
Well ID: 7370471 Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: C49171 Tag: A276698 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: MISSISSAUGA CITY (PORT CREDIT) Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Yes Data Src: Date Received: 10/16/2020 Selected Flag: TRUE Abandonment Rec: Contractor: 6988 Form Version: 8 Owner: County: PEEL Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
Additional Detail(s) (Map)					
Bore Hole ID:		1008492719		Tag No: A276698	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth M:				Contractor:	6988
Year Completed:	2020			Latitude:	43.5546877925646
Well Completed Dt:	06/02/2020			Longitude:	-79.5868078977923
Audit No:	C49171			Y:	43.55468779054327
Path:				X:	-79.58680774776633
 <u>Bore Hole Information</u>					
Bore Hole ID:	1008492719			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614146.00
Code OB Desc:				North83:	4823385.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	06/02/2020			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
43	1 of 1	S/135.0	79.8 / 0.00	ON	BORE
Borehole ID:	646192			Inclin FLG:	No
OGF ID:	215546575			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	MAY-1968			Municipality:	
Static Water Level:	1.2			Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.553165
Total Depth m:	12.2			Longitude DD:	-79.585375
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614265
Drill Method:	Power auger			Northing:	4823218
Orig Ground Elev m:	81.9			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	80.8				
Concession:					
Location D:					
Survey D:					
Comments:					
 <u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218513978			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Soil			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	SOIL.				
Geology Stratum ID:	218513979			Mat Consistency:	Dense

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	.2 9.4 Brown Silt Sand Clay SILT,SAND,CLAY. BROWN,GREY,GLACIAL,DENSE, LAYERED,AGE GLACIAL.			Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	 glacial
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218513980 9.4 12.2 Grey Till Clay TILL,CLAY. GREY,GLACIAL,VERY HARD, AGE GLACIAL, WATER STABLE AT 264.8 FEET. 015018024 0 **Note: Many records provided by the department have a truncated [Stratum Description] field.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Hard glacial
Source					
Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	Data Survey Geological Survey of Canada 1956-1972 M Urban Geology Automated Information System (UGAIS) File: TOR2.txt RecordID: 142140 NTS_Sheet: 30M12A Reliable information but incomplete.			Source Appl: Source Iden: Scale or Res: Horizontal: Verticalda:	Spatial/Tabular 1 Varies NAD27 Mean Average Sea Level
Source List					
Source Identifier: Source Type: Source Date: Scale or Resolution: Source Name: Source Originators:	1 Data Survey 1956-1972 Varies Urban Geology Automated Information System (UGAIS) Geological Survey of Canada			Horizontal Datum: Vertical Datum: Projection Name:	NAD27 Mean Average Sea Level Universal Transverse Mercator
44	1 of 1	SSE/135.8	79.8 / 0.00	ON	BORE
Borehole ID: OGF ID: Status: Type: Use: Completion Date: Static Water Level: Primary Water Use: Sec. Water Use: Total Depth m: Depth Ref: Depth Elev: Drill Method: Orig Ground Elev m: Elev Reliabil Note: DEM Ground Elev m: Concession: Location D:	640908 215541303 Borehole Geotechnical/Geological Investigation JAN-1965 Not Used 2.1 Ground Surface Power auger 80.7 80.6			Inclin FLG: SP Status: Surv Elev: Piezometer: Primary Name: Municipality: Lot: Township: Latitude DD: Longitude DD: UTM Zone: Easting: Northing: Location Accuracy: Accuracy:	No Initial Entry No No 43.553245 -79.584569 17 614330 4823228 Not Applicable

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Survey D: Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218494025			Mat Consistency:	
Top Depth:	.1			Material Moisture:	
Bottom Depth:	2.1			Material Texture:	Medium
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM,SILT, CLAY. GREY,ALLUVIAL, AGE POST-GLACIAL. ,STONES.				
Geology Stratum ID:	218494024			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ASPHALT.				
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 088740 NTS_Sheet: 30M12A				
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.				
<u>Source List</u>					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
45	1 of 2	ESE/140.5	79.8 / 0.00	PHOTOLINE LABS LTD. 31-649 110 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E3	GEN
<u>Generator Info</u>					
Generator No:	ON1532001			Choice of Contact:	
Approval Years:	92,93,94,95,96,97,98			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	6571
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	CAMERA/PHOTO. SUPPLY				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
45	2 of 2	ESE/140.5	79.8 / 0.00	PHOTOLINE LABS LTD. 110 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E3	GEN
<u>Generator Info</u>					
Generator No:	ON1532001			Choice of Contact:	
Approval Years:	99,00,01			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	6571
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	CAMERA/PHOTO. SUPPLY				
<u>Waste Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
46	1 of 1	SE/140.9	79.8 / 0.00	94-100 Lakeshore Road East Mississauga ON L5G 1E3	EHS
Order No:	20190710124			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	12-JUL-19			Search Radius (km):	.25
Date Received:	10-JUL-19			X:	-79.584021
Previous Site Name:				Y:	43.553448
Lot/Building Size:					
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans; Title Searches; City Directory; Aerial Photos				
47	1 of 1	SSW/141.2	79.8 / 0.00	ON	BORE
Borehole ID:	646191			Inclin FLG:	No
OGF ID:	215546574			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	MAY-1968			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.553121
Total Depth m:	9.8			Longitude DD:	-79.5855
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614255
Drill Method:	Power auger			Northing:	4823213
Orig Ground Elev m:	81.7			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	80.9				
Concession:					
Location D:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Survey D: Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218513977			Mat Consistency:	Hard
Top Depth:	9.1			Material Moisture:	
Bottom Depth:	9.8			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Shale			Geologic Period:	
Material 4:				Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	TILL,CLAY,SHALE. GREY,GLACIAL,HARD,AGE GLACIAL. 010 00000044AL.				
Geology Stratum ID:	218513976			Mat Consistency:	Dense
Top Depth:	0			Material Moisture:	
Bottom Depth:	9.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Silt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	SILT. GLACIAL,DENSE,AGE GLACIAL.				
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR2.txt RecordID: 142130 NTS_Sheet: 30M12A				
Confiden 1:	Reliable information but incomplete.				
<u>Source List</u>					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
48	1 of 5	SE/141.7	79.8 / 0.00	THE DUDSON GROUP (USA) INC. 92 LAKESHORE RD E MISSISSAUGA ON L5G 4S2	SCT
Established:	0000				
Plant Size (ft²):	0				
Employment:	1				
<u>--Details--</u>					
Description:	Service Establishment Machinery, Equipment and Supplies Wholesaler-Distributors				
SIC/NAICS Code:	417920				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
48	2 of 5	SE/141.7	79.8 / 0.00	The Dudson USA Inc. 92 Lakeshore Rd E Floor 2 Mississauga ON L5G 4S2	SCT
Established: 1800 Plant Size (ft²): 1800 Employment: 1					
--Details-- Description: Service Establishment Machinery, Equipment and Supplies Wholesaler-Distributors SIC/NAICS Code: 417920					
48	3 of 5	SE/141.7	79.8 / 0.00	Dudson USA Inc. 92 Lakeshore Rd E Floor 2 Mississauga ON L5G 4S2	SCT
Established: 1800 Plant Size (ft²): 1800 Employment: 4					
--Details-- Description: Service Establishment Machinery, Equipment and Supplies Wholesaler-Distributors SIC/NAICS Code: 417920					
48	4 of 5	SE/141.7	79.8 / 0.00	Zirco Ltd. 92 Lakeshore Rd E Mississauga ON L5G 4S2	PAP
Company ID: 283084077 Status: Inactive Type: Operation: Status Desc: Effluent Pollution Control: Company Name: Division: Company Mailing Address: Mailing Address: 92 Lakeshore Rd E, Mississauga ON L5G 4S2 Mill Mailing Address: Mill Notes: History: Company History:					
Year: 2009 Description: Website:					
48	5 of 5	SE/141.7	79.8 / 0.00	RCOM graphics and design 92 Lakeshore Rd E Suite 202 Mississauga ON L5G 4S2	SCT
Established: 01-JAN-89 Plant Size (ft²): Employment:					
--Details-- Description: Other Publishers SIC/NAICS Code: 511190 Description: Graphic Design Services SIC/NAICS Code: 541430					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Description:		Graphic Design Services			
SIC/NAICS Code:		541430			
Description:		Document Preparation Services			
SIC/NAICS Code:		561410			
Description:		Computer Systems Design and Related Services			
SIC/NAICS Code:		541510			
Description:		Digital Printing			
SIC/NAICS Code:		323115			
Description:		Other Printing			
SIC/NAICS Code:		323119			

49

1 of 1

E/142.3

79.8 / 0.00

ON

BORE

Borehole ID:

641136

OGF ID:

215541531

Status:

Type:

Borehole

Use:

Geotechnical/Geological Investigation

Completion Date:

JAN-1965

Static Water Level:

Primary Water Use:

Not Used

Sec. Water Use:

Total Depth m:

4

Depth Ref:

Ground Surface

Depth Elev:

Drill Method:

Power auger

Orig Ground Elev m:

78.2

Elev Reliabil Note:

DEM Ground Elev m:

78.1

Concession:

Location D:

Survey D:

Comments:

Inclin FLG:

No

SP Status:

Initial Entry

Surv Elev:

No

Piezometer:

No

Primary Name:

Municipality:

Lot:

Township:

Latitude DD:

43.554087

Longitude DD:

-79.583497

UTM Zone:

17

Easting:

614415

Northing:

4823323

Location Accuracy:

Accuracy:

Not Applicable

Borehole Geology Stratum

Geology Stratum ID:

218494905

Top Depth:

0

Bottom Depth:

.3

Material Color:

Material 1:

Gravel

Material 2:

Material 3:

Material 4:

Gsc Material Description:

Stratum Description:

GRAVEL.

Geology Stratum ID:

218494906

Top Depth:

.3

Bottom Depth:

.9

Material Color:

Material 1:

Sand

Material 2:

Clay

Material 3:

Material 4:

Gsc Material Description:

Stratum Description:

SAND-MEDIUM,CLAY. ALLUVIAL,AGE GLACIAL.

Mat Consistency:

Material Moisture:

Material Texture:

Non Geo Mat Type:

Geologic Formation:

Geologic Group:

Geologic Period:

Depositional Gen:

Mat Consistency:

Material Moisture:

Material Texture:

Medium

Non Geo Mat Type:

Geologic Formation:

Geologic Group:

Geologic Period:

Depositional Gen:

alluvial

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218494907 .9 2.7 Brown Sand Silt Clay SAND,SILT,CLAY. BROWN,ALLUVIAL,AGE GLACIAL.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	alluvial
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218494908 2.7 3.2 Brown Clay CLAY. BROWN,ALLUVIAL,AGE GLACIAL.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	alluvial
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218494909 3.2 4 Grey Clay CLAY. GREY,ALLUVIAL,AGE GLACIAL.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	alluvial
Source					
Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	Data Survey Geological Survey of Canada 1956-1972 M Urban Geology Automated Information System (UGAIS) File: TOR1B.txt RecordID: 091020 NTS_Sheet: 30M12A Logs are approximately correct. Lack of information. Doubtful terminology.			Source Appl: Source Iden: Scale or Res: Horizontal: Verticalda:	Spatial/Tabular 1 Varies NAD27 Mean Average Sea Level
Source List					
Source Identifier: Source Type: Source Date: Scale or Resolution: Source Name: Source Originators:	1 Data Survey 1956-1972 Varies Urban Geology Automated Information System (UGAIS) Geological Survey of Canada			Horizontal Datum: Vertical Datum: Projection Name:	NAD27 Mean Average Sea Level Universal Transverse Mercator
50	1 of 1	SSE/142.6	79.8 / 0.00	ON	BORE
Borehole ID: OGF ID: Status: Type: Use: Completion Date: Static Water Level:	651629 215551981 Borehole Geotechnical/Geological Investigation JUN-1968			Inclin FLG: SP Status: Surv Elev: Piezometer: Primary Name: Municipality: Lot:	No Initial Entry No No

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.553114
Total Depth m:	5.9			Longitude DD:	-79.584881
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614305
Drill Method:	Power auger			Northing:	4823213
Orig Ground Elev m:	77.1			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	80.7				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218533649			Mat Consistency:	Dense
Top Depth:	3.5			Material Moisture:	
Bottom Depth:	5.9			Material Texture:	Medium
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Sand			Geologic Period:	Quaternary
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	TILL,SILT-MEDIUM, SAND. GREY,VERY DENSE, AGE QUATERNARY. 022 010 012 **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	218533646			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Soil			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	SOIL.				
Geology Stratum ID:	218533648			Mat Consistency:	Hard
Top Depth:	1.4			Material Moisture:	
Bottom Depth:	3.5			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	Quaternary
Material 4:	Gravel			Depositional Gen:	
Gsc Material Description:					
Stratum Description:	TILL,SILT,CLAY, GRAVEL. BROWN,HARD,AGE QUATERNARY.				
Geology Stratum ID:	218533647			Mat Consistency:	
Top Depth:	.2			Material Moisture:	
Bottom Depth:	1.4			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:	Organic			Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL,SAND,SILT, ORGANIC.				
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	Geological Survey of Canada 1956-1972 H			Source Iden: Scale or Res: Horizontal: Verticalda:	1 Varies NAD27 Mean Average Sea Level
Urban Geology Automated Information System (UGAIS) File: TOR3.txt RecordID: 222900 NTS_Sheet: 30M12A Logged by professional. Exact and complete description of material and properties.					
Source List					
Source Identifier: Source Type: Source Date: Scale or Resolution: Source Name: Source Originators:	1 Data Survey 1956-1972 Varies Urban Geology Automated Information System (UGAIS) Geological Survey of Canada			Horizontal Datum: Vertical Datum: Projection Name:	NAD27 Mean Average Sea Level Universal Transverse Mercator
51	1 of 4	NW/147.0	78.8 / -1.00	28 Helene St N Mississauga ON L5G 3B7	EHS
Order No: Status: Report Type: Report Date: Date Received: Previous Site Name: Lot/Building Size: Additional Info Ordered:	20080326002 C Custom Report 4/3/2008 3/26/2008 			Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): X: Y:	 ON 0.25 -79.586315 43.555375
51	2 of 4	NW/147.0	78.8 / -1.00	IMH Pool VI-A LP 28 Helene St North Port Credit ON L5G 3B7	GEN
Generator Info					
Generator No: Approval Years: Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description:	ON5013248 As of Dec 2018 Registered Canada 			Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:	
Waste Detail(s)					
Waste Class: Waste Class Name:	145 T Wastes from the use of pigments, coatings and paints				
2018 Generator Info					
Gen No: ID: Contaminated Fac: MHSW Facility: NAICS Code1: NAICS Code2: NAICS Code3: Gen Name:	ON5013248 19993 N N 531111 IMH Pool VI-A LP			Choice of Contact: Phone No Official: Phone No Admin: County Ont: County Out: District:	CO_OFFICIAL 647-966-8403 Ext. PEEL (R. M.) 305

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Gen Div: Gen Op Name: Starlight Group Property Holdings Inc Gen Op Div: Site Adrs1: 28 Helene St North Site Bldg: Site Pobox: Province In: ONTARIO Site Adrs2: Site City: Port Credit Province Out: Site Postal Code: L5G 3B7 Site Country: Canada Co Official: Candace Jagarnauth Co Admin:					
<u>2018 Generator Manifest</u>					
ID: 43825 Generator No: ON5013248 Receiver Type: 035 Waste Char: T Waste Code: 145		Sum Received Qty: 19.0 Waste Class Name: PAINT/PIGMENT/COATING RESIDUES Count Manifests: 1 District: 305			
<u>51</u>	3 of 4	NW/147.0	78.8 / -1.00	28 Helene Street North Mississauga ON L5G 3B7	EHS
Order No: 20190822021 Status: C Report Type: Standard Report Report Date: 27-AUG-19 Date Received: 22-AUG-19 Previous Site Name: Lot/Building Size: Additional Info Ordered:		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.586357 Y: 43.555403			
<u>51</u>	4 of 4	NW/147.0	78.8 / -1.00	28 Helene Street North Mississauga ON L5G 3B7	EHS
Order No: 23101000826 Status: C Report Type: Standard Report Report Date: 13-OCT-23 Date Received: 10-OCT-23 Previous Site Name: Lot/Building Size: Additional Info Ordered:		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.5859694 Y: 43.5552843			
<u>52</u>	1 of 1	WNW/147.3	78.8 / -1.00	EDENSHAW ELIZABETH DEVELOPMENTS LIMITED 23 Elizabeth ST N Mississauga ON	RSC
RSC No: B-402-8223895421 RA No: Status: Active Filing Date: Date Ack: Date Returned: Approval Date: July 26, 2023 Cert Date: Cert Prop Use No:		X: -79.58694444401227 Y: 43.554722221192385 Latitude: 43.55472222 Longitude: -79.58694444 UTM Coordinates: Latitude Longitude: Accuracy Estimate: Measurement Method: Mailing Address:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Curr Property Use: Intended Prop Use: Restoration Type: Soil Type: Criteria: Stratified (Y/N): Audit (Y/N): Entire Leg Prop. (Y/N): CPU Issu Sect 1686: Business Name: Address: Legal Desc: Site Pin: Asmt Roll No: Project Type: Approval Type: Applicable Standards: PDF Link: Telephone: Fax: Email: Postal Code: Ministry District: MOE District: SWP Area Name: Qual Person Name: Consultant: L5G 2Z4 Halton-Peel Credit Valley Matthew Bielaski EDENSHAW ELIZABETH DEVELOPMENTS LIMITED 23 Elizabeth ST N 13463-0001(LT), 13463-0002(LT), 13463-0003(LT), 13463-0092(LT) RSC based on Phase One ESA RSC-RSC based on Phase One ESA https://www.accessenvironment.ene.gov.on.ca/AEWeb/ae/ViewDocument.action?documentRefID=3034813					
53	1 of 1	SW/148.3	79.8 / 0.00	30 HIGH STREET EAST MISSISSAUGA ON L5G 1J8	EHS
Order No: Status: Report Type: Report Date: Date Received: Previous Site Name: Lot/Building Size: Additional Info Ordered: 20090615002 C Standard Report 6/23/2009 6/15/2009 Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): X: Y: STAVEBANK ROAD NORTH & HIGH ST. EAST ON 0.25 -79.586214 43.553311					
54	1 of 1	SW/148.7	79.8 / 0.00	30 High Street East Mississauga ON L5G 1J8	EHS
Order No: Status: Report Type: Report Date: Date Received: Previous Site Name: Lot/Building Size: Additional Info Ordered: 23012400112 C Standard Report 27-JAN-23 24-JAN-23 Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): X: Y: ON .25 -79.5862868 43.5532868					
55	1 of 1	WSW/149.6	79.8 / 0.00	27 PARK ST E PORT CREDIT ON	WWIS
Well ID: Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: Tag: Constructn Method: Elevation (m): Elevatn Reliability: Depth to Bedrock: 7278219 Monitoring Observation Wells Z232729 A213501 Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: Selected Flag: Abandonment Rec: Contractor: Form Version: Owner: County: Lot: Concession: 12/28/2016 TRUE 7238 7 PEEL					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:			Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:		
MISSISSAUGA CITY (PORT CREDIT)					
PDF URL (Map):			https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/727\7278219.pdf		
Additional Detail(s) (Map)					
Well Completed Date:			12/02/2016		
Year Completed:			2016		
Depth (m):			7.4676		
Latitude:			43.553688323252		
Longitude:			-79.5868064972322		
X:			-79.58680634738118		
Y:			43.55368832083869		
Path:			727\7278219.pdf		
Bore Hole Information					
Bore Hole ID:			1006322618		
DP2BR:			Elevation:		
Spatial Status:			Elevrc:		
Code OB:			Zone:		
Code OB Desc:			17		
Open Hole:			East83:		
Cluster Kind:			614148.00		
Date Completed:			North83:		
12/02/2016			4823274.00		
Remarks:			Org CS:		
Location Method Desc:			UTM83		
on Water Well Record			UTMRC:		
Elevrc Desc:			4		
Location Source Date:			UTMRC Desc:		
Improvement Location Source:			margin of error : 30 m - 100 m		
Improvement Location Method:			Location Method:		
Source Revision Comment:			wwr		
Supplier Comment:					
Overburden and Bedrock					
Materials Interval					
Formation ID:			1006534297		
Layer:			4		
Color:					
General Color:					
Material 1:			05		
Material 1 Desc:			CLAY		
Material 2:			11		
Material 2 Desc:			GRAVEL		
Material 3:					
Material 3 Desc:					
Formation Top Depth:			15.0		
Formation End Depth:			24.0		
Formation End Depth UOM:			ft		
Overburden and Bedrock					
Materials Interval					
Formation ID:			1006534295		
Laver:			2		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Color:		6			
General Color:		BROWN			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:					
Material 2 Desc:					
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		2.5			
Formation End Depth:		10.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1006534296			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		10.0			
Formation End Depth:		15.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1006534298			
Layer:		5			
Color:					
General Color:					
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		24.0			
Formation End Depth:		24.5			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1006534294			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		02			
Material 1 Desc:		TOPSOIL			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		2.5			
Formation End Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006534306			
Layer:		2			
Plug From:		1.0			
Plug To:		12.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006534307			
Layer:		3			
Plug From:		12.0			
Plug To:		24.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006534305			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006534304			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006534293			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006534301			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		14.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006534302			
Layer:		1			
Slot:		10			
Screen Top Depth:		14.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen End Depth: 24.0 Screen Material: 5 Screen Depth UOM: ft Screen Diameter UOM: inch Screen Diameter:					
<u>Water Details</u>					
Water ID: 1006534300 Layer: Kind Code: Kind: Water Found Depth: Water Found Depth UOM: ft					
<u>Hole Diameter</u>					
Hole ID: 1006534299 Diameter: 6.25 Depth From: 0.0 Depth To: 24.5 Hole Depth UOM: ft Hole Diameter UOM: inch					
56	1 of 1	SE/151.5	79.8 / 0.00	94 Lakeshore Rd East Mississauga ON	WWIS
Well ID: 7344849 Construction Date: Use 1st: Monitoring Use 2nd: Final Well Status: Observation Wells Water Type: Casing Material: Audit No: Z313468 Tag: A277143 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: MISSISSAUGA CITY (PORT CREDIT) Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 10/09/2019 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: PEEL Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID: 1007683885 Depth M: 3.9624 Year Completed: 2019 Well Completed Dt: 08/20/2019 Audit No: Z313468 Path:					
Tag No: A277143 Contractor: 7241 Latitude: 43.5533471990091 Longitude: -79.5839794132457 Y: 43.5533471963 X: -79.58397926297529					
<u>Bore Hole Information</u>					
Bore Hole ID: 1007683885 DP2BR: Spatial Status:					
Elevation: Elevrc: Zone: 17					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Code OB:				East83:	614377.00
Code OB Desc:				North83:	4823240.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	08/20/2019			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007873289			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		8.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007873290			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:		91			
Material 3 Desc:		WATER-BEARING			
Formation Top Depth:		8.0			
Formation End Depth:		13.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007874387			
Layer:		1			
Plug From:		2.5			
Plug To:		13.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007874388			
Layer:		2			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug From:		2.0			
Plug To:		2.5			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007874389			
Layer:		3			
Plug From:		0.0			
Plug To:		6.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007875544			
Method Construction Code:					
Method Construction:					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007871841			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007876131			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		3.0			
Depth To:		3.0			
Casing Diameter:		1.25			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007876591			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.0			
Screen End Depth:		13.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.5			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007877229			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Flowing Rate: Recommended Pump Rate: Levels UOM: ft Rate UOM: GPM Water State After Test Code: Water State After Test: Pumping Test Method: 0 Pumping Duration HR: Pumping Duration MIN: Flowing:					
<u>Hole Diameter</u>					
Hole ID: 1007875030 Diameter: 3.0 Depth From: 6.0 Depth To: 13.0 Hole Depth UOM: ft Hole Diameter UOM: Inch					
<u>Hole Diameter</u>					
Hole ID: 1007875031 Diameter: 6.0 Depth From: 0.0 Depth To: 6.0 Hole Depth UOM: ft Hole Diameter UOM: Inch					
57	1 of 10	NE/151.8	79.8 / 0.00	BELL CANADA 80 HIGH ST E MISSISSAUGA ON	CFOT
Inventory No: 64643253 Inventory Status: Active Installation Year: 2014 Capacity: 5000 Capacity Unit: Tank Type: Manufacturer: Model: Description: Veeder-Root Leak Detection System. Brine interstitial monitoring					
Tank Material: Fiberglass (FRP) Corrosion Protect: Fiberglass Overfill Protection: Inventory Context: FS Fuel Oil Tank Inventory Item: FS FUEL OIL TANK					
57	2 of 10	NE/151.8	79.8 / 0.00	Bell 80 High St Mississauga ON L5G 1K2	GEN
<u>Generator Info</u>					
Generator No: ON8534293 Approval Years: 2015 Status: PO Box No: Country: Canada Co Admin: Julie Labelle Phone No Admin: 5148700688 Ext. SIC Description: WIRELESS TELECOMMUNICATIONS CARRIERS (EXCEPT SATELLITE), 517510, OTHER TELECOMMUNICATIONS					
Choice of Contact: CO_ADMIN Contaminated Fac: No MHSW Facility: No SIC Code: 517210, 517510, 517910					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
57	3 of 10	NE/151.8	79.8 / 0.00	Bell 80 High St Port Credit ON L5G 1K4	GEN
<u>Generator Info</u>					
Generator No:	ON9607199			Choice of Contact:	CO_ADMIN
Approval Years:	2016			Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	517210, 517510, 517910
Country:	Canada				
Co Admin:	Chlo�� Lamothe-Luneau				
Phone No Admin:	514-391-1021 Ext.				
SIC Description:	WIRELESS TELECOMMUNICATIONS CARRIERS (EXCEPT SATELLITE), 517510, OTHER TELECOMMUNICATIONS				
<u>Waste Detail(s)</u>					
Waste Class:		243			
Waste Class Name:		PCBS			
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
57	4 of 10	NE/151.8	79.8 / 0.00	Bell 80 High St Mississauga ON L5G 1K2	GEN
<u>Generator Info</u>					
Generator No:	ON8534293			Choice of Contact:	CO_ADMIN
Approval Years:	2014			Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	517210, 517510, 517910
Country:	Canada				
Co Admin:	Julie Labelle				
Phone No Admin:	5148700688 Ext.				
SIC Description:	WIRELESS TELECOMMUNICATIONS CARRIERS (EXCEPT SATELLITE), 517510, OTHER TELECOMMUNICATIONS				
<u>Waste Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
57	5 of 10	NE/151.8	79.8 / 0.00	Bell 80 High St Port Credit ON L5G 1K4	GEN
<u>Generator Info</u>					
Generator No:		ON9607199		Choice of Contact:	
Approval Years:		As of Dec 2018		Contaminated Fac:	
Status:		Registered		MHSW Facility:	
PO Box No:				SIC Code:	
Country:		Canada			
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		251 L			
Waste Class Name:		Waste oils/sludges (petroleum based)			
<u>Waste Detail(s)</u>					
Waste Class:		121 C			
Waste Class Name:		Alkaline slutions - containing heavy metals			
<u>Waste Detail(s)</u>					
Waste Class:		221 L			
Waste Class Name:		Light fuels			
<u>Waste Detail(s)</u>					
Waste Class:		243 D			
Waste Class Name:		PCB			
57	6 of 10	NE/151.8	79.8 / 0.00	80 High Street East Mississauga ON	SPL
Ref No:		6026-AP7STY		Municipality No:	
Year:				Nature of Damage:	
Incident Dt:		7/12/2017		Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:		7/12/2017		Impact to Health:	
Dt Document Closed:		7/19/2017		Agency Involved:	
Site No:		NA		2 - Minor Environment	
MOE Response:		No			
Site County/District:		Regional Municipality of Peel			
Site Geo Ref Meth:					
Site District Office:		Halton-Peel			
Nearest Watercourse:					
Site Name:		Sanitary sewer blockage<UNOFFICIAL>			
Site Address:		80 High Street East			
Site Region:		Central			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Municipality: Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: Incident Preceding Spill: Incident Reason: Incident Summary: Environment Impact: Health Env Consequence: Nature of Impact: Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address:		Mississauga 4823475.24 614406.87 Sewer (Private or Municipal) Overflow/Surcharge Blockage DWMD: Rgn of Peel sanitary sewer blockage surcharge to prvt property. 1 n/a 1 n/a 44 SEWAGE,RAW UNCHLORINATED n/a Land Municipal Sewage Land Spills			

57	7 of 10	NE/151.8	79.8 / 0.00	Bell Canada 80 High Street Mississauga ON	SPL
Ref No: Year: Incident Dt: Dt MOE Arvl on Scn: MOE Reported Dt: Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Site Address: Site Region: Site Municipality: Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name:		7617-B5LNZS 2018/10/16 2018/10/16 2018/11/27 NA No Regional Municipality of Peel Halton-Peel Commerical Area<UNOFFICIAL> 80 High Street Central Mississauga 4823475.22 614406.87 Bell Canada	Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:	2 - Minor Environment	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Client Type: Source Type: Incident Cause: Incident Preceding Spill: Incident Reason: Incident Summary: Environment Impact: Health Env Consequence: Nature of Impact: Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address:		Corporation Tank - Above Ground Overflow/Surcharge Equipment Failure Bell: 5L diesel spill to ground, cntd. 5 L 5 L 13 DIESEL FUEL 1202 Land Miscellaneous Communal Land Spills			

[57](#)

8 of 10

NE/151.8

79.8 / 0.00

Bell
80 High St
Port Credit ON L5G 1K4

GEN

Generator Info

Generator No: ON9607199
Approval Years: As of Jul 2020
Status: Registered
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description:

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code:

Waste Detail(s)

Waste Class: 121 C
Waste Class Name: Alkaline slutions - containing heavy metals

Waste Detail(s)

Waste Class: 251 L
Waste Class Name: Waste oils/sludges (petroleum based)

Waste Detail(s)

Waste Class: 243 D
Waste Class Name: PCB

Waste Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		221 L			
Waste Class Name:		Light fuels			

57	9 of 10	NE/151.8	79.8 / 0.00	Bell 80 High St Port Credit ON L5G 1K4	GEN

Generator Info

Generator No:	ON9607199	Choice of Contact:
Approval Years:	As of Nov 2021	Contaminated Fac:
Status:	Registered	MHSW Facility:
PO Box No:		SIC Code:
Country:	Canada	
Co Admin:		
Phone No Admin:		
SIC Description:		

Waste Detail(s)

Waste Class:	243 D
Waste Class Name:	PCB

Waste Detail(s)

Waste Class:	251 L
Waste Class Name:	Waste oils/sludges (petroleum based)

Waste Detail(s)

Waste Class:	221 L
Waste Class Name:	Light fuels

Waste Detail(s)

Waste Class:	121 C
Waste Class Name:	Alkaline slutions - containing heavy metals

57	10 of 10	NE/151.8	79.8 / 0.00	Bell 80 High St Port Credit ON L5G 1K4	GEN

Generator Info

Generator No:	ON9607199	Choice of Contact:
Approval Years:	As of Oct 2022	Contaminated Fac:
Status:	Registered	MHSW Facility:
PO Box No:		SIC Code:
Country:	Canada	
Co Admin:		
Phone No Admin:		
SIC Description:		

Waste Detail(s)

Waste Class:	121 C

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		251 L			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
<u>Waste Detail(s)</u>					
Waste Class:		221 L			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		243 D			
Waste Class Name:		PCBS			
<u>2017 Generator Info</u>					
Gen No:	ON9607199			Choice of Contact:	CO_ADMIN
ID:	37532			Phone No Official:	5148706540 Ext.
Contaminated Fac:	N			Phone No Admin:	514-391-1021 Ext.
MHSW Facility:	N			County Ont:	PEEL (R. M.)
NAICS Code1:	517210			County Out:	
NAICS Code2:	517510			District:	305
NAICS Code3:	517910				
Gen Name:	Bell				
Gen Div:					
Gen Op Name:	Bell Canada				
Gen Op Div:					
Site Adrs1:	80 High St				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Port Credit				
Province Out:					
Site Postal Code:	L5G 1K4				
Site Country:	Canada				
Co Official:	Martin Girard				
Co Admin:	Chlo�� Lamothe-Luneau				
<u>2018 Generator Info</u>					
Gen No:	ON9607199			Choice of Contact:	CO_ADMIN
ID:	38270			Phone No Official:	5148706540 Ext.
Contaminated Fac:	N			Phone No Admin:	514-391-1021 Ext.
MHSW Facility:	N			County Ont:	PEEL (R. M.)
NAICS Code1:	517210			County Out:	
NAICS Code2:	517510			District:	305
NAICS Code3:	517910				
Gen Name:	Bell				
Gen Div:					
Gen Op Name:	Bell Canada				
Gen Op Div:					
Site Adrs1:	80 High St				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Port Credit				
Province Out:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Postal Code:		L5G 1K4			
Site Country:		Canada			
Co Official:		Stephanie Berger			
Co Admin:		Chlo�� Lamothe-Luneau			
<u>2018 Generator Manifest</u>					
ID:	66864			Sum Received Qty:	631.0
Generator No:	ON9607199			Waste Class Name:	LIGHT FUELS
Receiver Type:	035			Count Manifests:	1
Waste Char:	L			District:	305
Waste Code:	221				
<u>2019 Generator Info</u>					
Gen No:	ON9607199			Choice of Contact:	CO_ADMIN
ID:	38840			Phone No Official:	5148706540 Ext.
Contaminated Fac:	N			Phone No Admin:	514-391-1021 Ext.
MHSW Facility:	N			County Ont:	PEEL (R. M.)
NAICS Code1:	517210			County Out:	
NAICS Code2:	517510			District:	305
NAICS Code3:	517910				
Gen Name:	Bell				
Gen Div:					
Gen Op Name:	Bell Canada				
Gen Op Div:					
Site Adrs1:	80 High St				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Port Credit				
Province Out:					
Site Postal Code:	L5G 1K4				
Site Country:	Canada				
Co Official:	Stephanie Berger				
Co Admin:	Chlo�� Lamothe-Luneau				
<u>2020 Generator Info</u>					
Gen No:	ON9607199			Choice of Contact:	CO_ADMIN
ID:	38598			Phone No Official:	514-870-6424 Ext.
Contaminated Fac:	N			Phone No Admin:	514-391-1021 Ext.
MHSW Facility:	N			County Ont:	PEEL (R. M.)
NAICS Code1:	517210			County Out:	
NAICS Code2:	517510			District:	305
NAICS Code3:	517910				
Gen Name:	Bell				
Gen Div:					
Gen Op Name:	Bell Canada				
Gen Op Div:					
Site Adrs1:	80 High St				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Port Credit				
Province Out:					
Site Postal Code:	L5G 1K4				
Site Country:	Canada				
Co Official:	Mylene Champagne				
Co Admin:	Chlo�� Lamothe-Luneau				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>2021 Generator Info</u>					
Gen No:	ON9607199			Choice of Contact:	CO_ADMIN
ID:	39643			Phone No Official:	514-870-6424 Ext.
Contaminated Fac:	N			Phone No Admin:	514-391-1021 Ext.
MHSW Facility:	N			County Ont:	PEEL (R. M.)
NAICS Code1:	517210			County Out:	
NAICS Code2:	517510			District:	305
NAICS Code3:	517910				
Gen Name:	Bell				
Gen Div:					
Gen Op Name:	Bell Canada				
Gen Op Div:					
Site Adrs1:	80 High St				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Port Credit				
Province Out:					
Site Postal Code:	L5G 1K4				
Site Country:	Canada				
Co Official:	Mylene Champagne				
Co Admin:	Chlo�� Lamothe-Luneau				
<u>58</u>	1 of 20	E/152.0	79.8 / 0.00	UNKNOWN 114 LAKESHORE BLVD ST HELENE ST. MISSISSAUGA CITY ON	SPL
Ref No:	14059			Municipality No:	21102
Year:				Nature of Damage:	
Incident Dt:	1/24/1989			Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:	1/24/1989			Impact to Health:	
Dt Document Closed:				Agency Involved:	
Site No:					
MOE Response:					
Site County/District:					
Site Geo Ref Meth:					
Site District Office:					
Nearest Watercourse:					
Site Name:					
Site Address:					
Site Region:					
Site Municipality:	MISSISSAUGA CITY				
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Entity Operating Name:					
Client Name:					
Client Type:					
Source Type:					
Incident Cause:	WASTEWATER DISCHARGE TO WATERCOURSE				
Incident Preceding Spill:					
Incident Reason:	UNKNOWN				
Incident Summary:					
Environment Impact:					
Health Env Consequence:					
Nature of Impact:					
Contaminant Qty:					
Contaminant Qty 1:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant Unit: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: WATER Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address:					
58	2 of 20	E/152.0	79.8 / 0.00	V V GAS AND WASH 114 LAKESHORE RD PORT CREDIT MISSISSAUGA ON	PRT
Location ID: 27634 Type: retail Expiry Date: 1995-02-28 Capacity (L): 127800 Licence #: 0076413129					
58	3 of 20	E/152.0	79.8 / 0.00	V V GAS AND WASH 114 LAKESHORE RD PORT CREDIT MISSISSAUGA ON	PRT
Location ID: 27634 Type: retail Expiry Date: 1995-08-31 Capacity (L): 0 Licence #: 0076427921					
58	4 of 20	E/152.0	79.8 / 0.00	PETRO CANADA INC. 114 LAKESHORE ROAD E PORT CREDIT ON L5G 1E4	GEN
Generator Info Generator No: ON0031018 Approval Years: 86,87,88,89,90,92,93,94 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: *** NOT DEFINED ***					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 0000					
58	5 of 20	E/152.0	79.8 / 0.00	PETRO CANADA INC. 114 LAKESHORE RD., EAST MISSISSAUGA C/O 5140 YONGE ST. SUITE 200 NORTH YORK ON L5G 1E4	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON1019505			Choice of Contact:	
Approval Years:	89,90			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	6331
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		GASOLINE SERV. ST.			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
58	6 of 20	E/152.0	79.8 / 0.00	PETRO CANADA INC. 30-570 114 LAKESHORE RD., EAST MISSISSAUGA C/O 5140 YONGE ST. SUITE 200 NORTH YORK ON L5G 1E4	GEN
<u>Generator Info</u>					
Generator No:	ON1019505			Choice of Contact:	
Approval Years:	92,93,94,95,96,97,98			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	6331
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		GASOLINE SERV. ST.			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
58	7 of 20	E/152.0	79.8 / 0.00	Dens-Tek Dental Studio Inc. 114 Lakeshore Rd E Unit 4 Mississauga ON L5G 1E4	SCT
Established:		01-JUN-02			
Plant Size (ft²):					
Employment:					
<u>--Details--</u>					
Description:		Medical Equipment and Supplies Manufacturing			
SIC/NAICS Code:		339110			
Description:		Medical Equipment and Supplies Manufacturing			
SIC/NAICS Code:		339110			
58	8 of 20	E/152.0	79.8 / 0.00	114 Lakeshore Road E Mississauga ON L5G 1E4	EHS
Order No:	20070226008			Nearest Intersection:	Hurontario Street & Lakeshore Rd. E
Status:	C			Municipality:	
Report Type:	CAN - Complete Report			Client Prov/State:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Report Date:	3/6/2007			Search Radius (km): 0.25	
Date Received:	2/26/2007			X: -79.583293	
Previous Site Name:				Y: 43.554343	
Lot/Building Size:					
Additional Info Ordered:					

<u>58</u>	9 of 20	E/152.0	79.8 / 0.00	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS 114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON L5G 1E4	DTNK

Delisted Expired Fuel Safety Facilities

Instance No:	10071073	Expired Date:	8/23/1997
Status:	EXPIRED	Max Hazard Rank:	
Instance ID:		Facility Location:	
Instance Type:	FS Facility	Facility Type:	
Instance Creation Dt:		Fuel Type 2:	
Instance Install Dt:		Fuel Type 3:	
Item Description:		Panam Related:	
Manufacturer:		Panam Venue Nm:	
Model:		External Identifier:	
Serial No:		Item:	
ULC Standard:		Piping Steel:	
Quantity:		Piping Galvanized:	
Unit of Measure:		Tank Single Wall St:	
Overfill Prot Type:		Piping Underground:	
Creation Date:		Tank Underground:	
Next Periodic Str DT:		Source:	
TSSA Base Sched Cycle 2:			
TSSAMax Hazard Rank 1:			
TSSA Risk Based Periodic Yn:			
TSSA Volume of Directives:			
TSSA Periodic Exempt:			
TSSA Statutory Interval:			
TSSA Recd Insp Interva:			
TSSA Recd Tolerance:			
TSSA Program Area:			
TSSA Program Area 2:			
Description:			
Original Source:	EXP		
Record Date:	Up to May 2013		

<u>58</u>	10 of 20	E/152.0	79.8 / 0.00	V V GAS AND WASH 114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON	DTNK

Delisted Expired Fuel Safety Facilities

Instance No:	10102295	Expired Date:	
Status:	EXPIRED	Max Hazard Rank:	
Instance ID:	12017	Facility Location:	
Instance Type:	FS Facility	Facility Type:	
Instance Creation Dt:		Fuel Type 2:	
Instance Install Dt:		Fuel Type 3:	
Item Description:		Panam Related:	
Manufacturer:		Panam Venue Nm:	
Model:		External Identifier:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Serial No: ULC Standard: Quantity: Unit of Measure: Overfill Prot Type: Creation Date: Next Periodic Str DT: TSSA Base Sched Cycle 2: TSSAMax Hazard Rank 1: TSSA Risk Based Periodic Yn: TSSA Volume of Directives: TSSA Periodic Exempt: TSSA Statutory Interval: TSSA Recd Insp Interva: TSSA Recd Tolerance: TSSA Program Area: TSSA Program Area 2:				Item: Piping Steel: Piping Galvanized: Tank Single Wall St: Piping Underground: Tank Underground: Source:	
Description:		FS Propane Cylr Handling Facility			
Original Source:		EXP			
Record Date:		Up to Mar 2012			

Delisted Expired Fuel Safety Facilities

58	12 of 20	E/152.0	79.8 / 0.00	114 Lakeshore Road East, Mississauga MISSISSAUGA ON	SPL

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Model: Description: Previous Fuel Type: Gasoline					
58	14 of 20	E/152.0	79.8 / 0.00	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS 114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON	EXP
Inventory No: 11245025 Inventory Status: EXPIRED Installation Year: NULL Capacity: 36700 Capacity Unit: Tank Type: Manufacturer: Model: Description: Previous Fuel Type: Gasoline		Tank Material: Steel Corrosion Protect: Coating Overfill Protection: Inventory Context: FS Liquid Fuel Tank Inventory Item: FS LIQUID FUEL TANK			
58	15 of 20	E/152.0	79.8 / 0.00	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS 114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON	EXP
Inventory No: 11245067 Inventory Status: EXPIRED Installation Year: NULL Capacity: 27250 Capacity Unit: Tank Type: Manufacturer: Model: Description: Previous Fuel Type: Gasoline		Tank Material: Steel Corrosion Protect: Coating Overfill Protection: Inventory Context: FS Liquid Fuel Tank Inventory Item: FS LIQUID FUEL TANK			
58	16 of 20	E/152.0	79.8 / 0.00	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS 114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON	EXP
Inventory No: 11245088 Inventory Status: EXPIRED Installation Year: NULL Capacity: 27250 Capacity Unit: Tank Type: Manufacturer: Model: Description: Previous Fuel Type: Gasoline		Tank Material: Steel Corrosion Protect: Coating Overfill Protection: Inventory Context: FS Liquid Fuel Tank Inventory Item: FS LIQUID FUEL TANK			
58	17 of 20	E/152.0	79.8 / 0.00	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS 114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON	EXP
Inventory No: 11469383 Inventory Status: EXPIRED		Tank Material: Fiberglass (FRP) Corrosion Protect: Fiberglass			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Installation Year: 1989 Capacity: 36300 Capacity Unit: Tank Type: Manufacturer: Model: Description: Previous Fuel Type: Gasoline Overfill Protection: Inventory Context: FS Liquid Fuel Tank Inventory Item: FS LIQUID FUEL TANK					
58	18 of 20	E/152.0	79.8 / 0.00	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS 114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON	EXP
Inventory No: 11245048 Inventory Status: EXPIRED Installation Year: NULL Capacity: 36700 Capacity Unit: Tank Type: Manufacturer: Model: Description: Previous Fuel Type: Gasoline Tank Material: Steel Corrosion Protect: Coating Overfill Protection: Inventory Context: FS Liquid Fuel Tank Inventory Item: FS LIQUID FUEL TANK					
58	19 of 20	E/152.0	79.8 / 0.00	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS 114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON	EXP
Inventory No: 11469392 Inventory Status: EXPIRED Installation Year: 1989 Capacity: 27200 Capacity Unit: Tank Type: Manufacturer: Model: Description: Previous Fuel Type: Gasoline Tank Material: Fiberglass (FRP) Corrosion Protect: Fiberglass Overfill Protection: Inventory Context: FS Liquid Fuel Tank Inventory Item: FS LIQUID FUEL TANK					
58	20 of 20	E/152.0	79.8 / 0.00	CONSHORE MOTORS LTD ATTN SHANAZ KHAMIS 114 LAKESHORE RD E PORT CREDIT MISSISSAUGA ON	EXP
Inventory No: 11469403 Inventory Status: EXPIRED Installation Year: 1989 Capacity: 27200 Capacity Unit: Tank Type: Manufacturer: Model: Description: Previous Fuel Type: Gasoline Tank Material: Fiberglass (FRP) Corrosion Protect: Fiberglass Overfill Protection: Inventory Context: FS Liquid Fuel Tank Inventory Item: FS LIQUID FUEL TANK					
59	1 of 1	SW/152.8	79.8 / 0.00	ON	BORE

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Borehole ID:	646196			Inclin FLG:	No
OGF ID:	215546579			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	FEB-1965			Municipality:	
Static Water Level:	0.9			Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.55322
Total Depth m:	9.4			Longitude DD:	-79.586241
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614195
Drill Method:	Power auger			Northing:	4823223
Orig Ground Elev m:	28.8			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	81				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218513992			Mat Consistency:	Hard
Top Depth:	7.3			Material Moisture:	
Bottom Depth:	9.4			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	TILL,CLAY. GREY,GLACIAL,HARD,AGE GLACIAL.00000056000900200024004600007 **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	218513991			Mat Consistency:	Compact
Top Depth:	2.7			Material Moisture:	
Bottom Depth:	7.3			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Silt			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	beach
Gsc Material Description:					
Stratum Description:	SILT,SAND. GREY,BEACH,COMPACT, AGE POST-GLACIAL, WATER STABLE AT 91.4 FEET.				
Geology Stratum ID:	218513990			Mat Consistency:	Dense
Top Depth:	0			Material Moisture:	
Bottom Depth:	2.7			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Soil			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	SOIL,SAND,SILT. BROWN,DENSE.				
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Details:		File: TOR2.txt RecordID: 142180 NTS_Sheet: 30M12E			
Confiden 1:		Reliable information but incomplete.			
Source List					
Source Identifier:		1	Horizontal Datum:		NAD27
Source Type:		Data Survey	Vertical Datum:		Mean Average Sea Level
Source Date:		1956-1972	Projection Name:		Universal Transverse Mercator
Scale or Resolution:		Varies			
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Originators:		Geological Survey of Canada			
60	1 of 1	WNW/154.3	78.8 / -1.00	23 Elizabeth Street North Mississauga ON L5G 2Z4	EHS
Order No:		20200501130	Nearest Intersection:		
Status:		C	Municipality:		
Report Type:		Standard Report	Client Prov/State:		ON
Report Date:		04-MAY-20	Search Radius (km):		.25
Date Received:		01-MAY-20	X:		-79.5870105
Previous Site Name:			Y:		43.5548451
Lot/Building Size:					
Additional Info Ordered:		Fire Insur. Maps and/or Site Plans			
61	1 of 1	ENE/154.8	79.8 / 0.00	8 ANN ST ON	WWIS
Well ID:		7288429	Flowing (Y/N):		
Construction Date:			Flow Rate:		
Use 1st:		Test Hole	Data Entry Status:		
Use 2nd:			Data Src:		
Final Well Status:		Abandoned-Other	Date Received:		06/19/2017
Water Type:			Selected Flag:		TRUE
Casing Material:			Abandonment Rec:		Yes
Audit No:		Z230821	Contractor:		7230
Tag:		A203341	Form Version:		7
Constructn Method:			Owner:		
Elevation (m):			County:		PEEL
Elevatn Reliabilty:			Lot:		
Depth to Bedrock:			Concession:		
Well Depth:			Concession Name:		
Overburden/Bedrock:			Easting NAD83:		
Pump Rate:			Northing NAD83:		
Static Water Level:			Zone:		
Clear/Cloudy:			UTM Reliability:		
Municipality:		MISSISSAUGA CITY (PORT CREDIT)			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/728\7288429.pdf			
Additional Detail(s) (Map)					
Well Completed Date:					
Year Completed:					
Depth (m):					
Latitude:		43.5550888818842			
Longitude:		-79.5835672081283			
X:		-79.5835670584087			
Y:		43.555088879839076			
Path:		728\7288429.pdf			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Bore Hole Information</u>					
Bore Hole ID:	1006547861			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614407.00
Code OB Desc:				North83:	4823434.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:				UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006778043				
Layer:					
Color:					
General Color:					
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:	ft				
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1006778050				
Layer:	1				
Plug From:	0.0				
Plug To:	6.099999904632568				
Plug Depth UOM:	ft				
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:	1006778049				
Method Construction Code:	6				
Method Construction:	Boring				
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:	1006778042				
Casing No:	0				
Comment:					
Alt Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:		1006778046			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.0999999046325684			
Casing Diameter:		5.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006778047			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.0999999046325684			
Screen End Depth:		6.099999904632568			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		5.199999809265137			
<u>Water Details</u>					
Water ID:		1006778045			
Layer:		1			
Kind Code:		8			
Kind:		Untested			
Water Found Depth:		4.699999809265137			
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006778044			
Diameter:		15.0			
Depth From:		0.0			
Depth To:		61.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			

<u>62</u>	1 of 1	WSW/155.7	79.8 / 0.00	ON	BORE
Borehole ID:	640923			Inclin FLG:	No
OGF ID:	215541318			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.553906
Total Depth m:	2.7			Longitude DD:	-79.587029
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614130
Drill Method:	Power auger			Northing:	4823298
Orig Ground Elev m:	78.2			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	78.1				
Concession:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Location D: Survey D: Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218494094			Mat Consistency:	
Top Depth:	2.4			Material Moisture:	
Bottom Depth:	2.6			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	CLAY,SAND,SILT. LACUSTRINE,AGE POST-GLACIAL.				
Geology Stratum ID:	218494091			Mat Consistency:	
Top Depth:	.1			Material Moisture:	
Bottom Depth:	.3			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL,GRAVEL.				
Geology Stratum ID:	218494090			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ASPHALT.				
Geology Stratum ID:	218494092			Mat Consistency:	
Top Depth:	.3			Material Moisture:	Wet
Bottom Depth:	1.8			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND,SILT,CLAY. BROWN,ALLUVIAL,WET, AGE POST-GLACIAL.				
Geology Stratum ID:	218494095			Mat Consistency:	Firm
Top Depth:	2.6			Material Moisture:	
Bottom Depth:	2.7			Material Texture:	Fine
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-FINE,CLAY,SILT.GREY,ALLUVIAL,FIRM, AGE POST-GLACIAL.				
Geology Stratum ID:	218494093			Mat Consistency:	
Top Depth:	1.8			Material Moisture:	
Bottom Depth:	2.4			Material Texture:	Coarse
Material Color:	Grey			Non Geo Mat Type:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	Sand Clay Silt			Geologic Formation: Geologic Group: Geologic Period: Depositional Gen: alluvial SAND-MEDIUM TO COARSE,CLAY,SILT. GREY,ALLUVIAL, AGE POST-GLACIAL.	
Source					
Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	Data Survey Geological Survey of Canada 1956-1972 M			Source Appl: Source Iden: Scale or Res: Horizontal: Verticalda:	Spatial/Tabular 1 Varies NAD27 Mean Average Sea Level
	Urban Geology Automated Information System (UGAIS) File: TOR1B.txt RecordID: 088890 NTS_Sheet: 30M12A Logs are approximately correct. Lack of information. Doubtful terminology.				
Source List					
Source Identifier: Source Type: Source Date: Scale or Resolution: Source Name: Source Originators:	1 Data Survey 1956-1972 Varies Urban Geology Automated Information System (UGAIS) Geological Survey of Canada			Horizontal Datum: Vertical Datum: Projection Name:	NAD27 Mean Average Sea Level Universal Transverse Mercator
63	1 of 1	NE/155.7	79.8 / 0.00	80 High Street E Mississauga ON L5G 1K4	EHS
Order No: Status: Report Type: Report Date: Date Received: Previous Site Name: Lot/Building Size: Additional Info Ordered:	22033100164 C RSC Report (Urban) 08-APR-22 31-MAR-22 Fire Insur. Maps and/or Site Plans; City Directory; Aerial Photos			Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): X: Y:	 ON .3 -79.58429309 43.55560629
64	1 of 3	SSE/157.3	79.8 / 0.00	88 Lakeshore Rd. E Mississauga ON L5G 1E1	EHS
Order No: Status: Report Type: Report Date: Date Received: Previous Site Name: Lot/Building Size: Additional Info Ordered:	20011120012 C Complete Report 11/28/01 11/20/01 Fire Insur. Maps and/or Site Plans and/or Inspection Reports; Aerials Photos and/or Topographical Maps			Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): X: Y:	see attached legal desc. Peel ON 0.25 -79.58436 43.553088
64	2 of 3	SSE/157.3	79.8 / 0.00	Hooper's Pharmacy 88 Lakeshore Road East Mississauga ON L5G 1E1	GEN
Generator Info					
Generator No:	ON4472068			Choice of Contact:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Approval Years: 2010 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: Pharmacies and Drug Stores Waste Detail(s) Waste Class: 261 Waste Class Name: PHARMACEUTICALS					
Contaminated Fac: MHSW Facility: SIC Code: 446110					
64	3 of 3	SSE/157.3	79.8 / 0.00	Robert Clark Drugs Ltd 88 Lakeshore Rd E Mississauga ON L5G1E1	GEN
Generator Info Generator No: ON7887200 Approval Years: As of Oct 2022 Status: Registered PO Box No: Country: Canada Co Admin: Phone No Admin: SIC Description:					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:					
Waste Detail(s) Waste Class: 312 P Waste Class Name: PATHOLOGICAL WASTES					
Waste Detail(s) Waste Class: 261 A Waste Class Name: PHARMACEUTICALS					
65	1 of 1	NNE/163.4	79.8 / 0.00	220 220 ON L5G 1K2	EHS
Order No: 22110700762 Status: C Report Type: Standard Report Report Date: 10-NOV-22 Date Received: 07-NOV-22 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.5845695 Y: 43.5557693					
66	1 of 1	NW/163.5	78.8 / -1.00	ON	BORE
Borehole ID: 646201 OGF ID: 215546584 Status: Type: Borehole Use: Geotechnical/Geological Investigation					
Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Completion Date:	JUN-1968			Municipality:	
Static Water Level:	0.5			Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.555431
Total Depth m:	6.1			Longitude DD:	-79.586622
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614160
Drill Method:	Power auger			Northing:	4823468
Orig Ground Elev m:	81.9			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	82.2				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218514005			Mat Consistency:	Dense
Top Depth:	.2			Material Moisture:	
Bottom Depth:	4.4			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Silt			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	SILT,SAND,CLAY. BROWN,GREY,GLACIAL,DENSE, LAYERED,AGE GLACIAL.				
Geology Stratum ID:	218514006			Mat Consistency:	Hard
Top Depth:	4.4			Material Moisture:	
Bottom Depth:	6.1			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	TILL,CLAY,SILT. GREY,GLACIAL,HARD,AGE GLACIAL,WATER STABLE AT 267.3 FEET. 018 012 **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	218514004			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Soil			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	SOIL.				
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR2.txt RecordID: 142230 NTS_Sheet: 30M12A				
Confiden 1:	Reliable information but incomplete.				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
67	1 of 2	W/164.7	79.1 / -0.75	28 Elizabeth Street North Mississauga ON L5G 2Z6	EHS
Order No:	20051130005			Nearest Intersection:	Park Street East
Status:	C			Municipality:	
Report Type:	Site Report			Client Prov/State:	ON
Report Date:	12/1/2005			Search Radius (km):	0.25
Date Received:	11/30/2005			X:	-79.6753
Previous Site Name:				Y:	43.554739
Lot/Building Size:					
Additional Info Ordered:					
67	2 of 2	W/164.7	79.1 / -0.75	Compten Management Inc. 28 Elizabeth Street North Mississauga ON	SPL
Ref No:	7523-B46RN2			Municipality No:	
Year:				Nature of Damage:	
Incident Dt:	2018/08/30			Discharger Report:	
Dt MOE Arvl on Scn:	2018/09/05			Material Group:	
MOE Reported Dt:	2018/08/31			Impact to Health:	2 - Minor Environment
Dt Document Closed:				Agency Involved:	
Site No:	NA				
MOE Response:	Yes				
Site County/District:	Regional Municipality of Peel				
Site Geo Ref Meth:					
Site District Office:	Halton-Peel				
Nearest Watercourse:					
Site Name:	Apartment building - back of the building<UNOFFICIAL>				
Site Address:	28 Elizabeth Street North				
Site Region:	Central				
Site Municipality:	Mississauga				
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:	4823385				
Easting:	614121				
Entity Operating Name:					
Client Name:	Compten Management Inc.				
Client Type:	Corporation				
Source Type:	Other				
Incident Cause:					
Incident Preceding Spill:	Overflow/Surcharge				
Incident Reason:	Operator/Human Error				
Incident Summary:	28 Elizabeth: ~ 5 L of diesel to asphalt, cntd, clnup ongn				
Environment Impact:					
Health Env Consequence:					
Nature of Impact:					
Contaminant Qty:	5 L				
Contaminant Qty 1:	5				
Contaminant Unit:	L				
Contaminant Code:	13				
Contaminant Name:	DIESEL FUEL				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: 1202 Receiving Medium: Land Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Miscellaneous Communal SAC Action Class: Land Spills Call Report Locatn Geodata: Time Reported: System Facility Address:					
68	1 of 1	WSW/166.1	79.8 / 0.00	27 Park St E Mississauga ON L5G1L7	EHS
Order No: 20161114019 Status: C Report Type: Standard Report Report Date: 18-NOV-16 Date Received: 14-NOV-16 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans; City Directory					
Nearest Intersection: Municipality: Mississauga Client Prov/State: ON Search Radius (km): .25 X: -79.587021 Y: 43.553663					
69	1 of 1	ESE/166.7	79.8 / 0.00	ON	BORE
Borehole ID: 641135 OGF ID: 215541530 Status: Type: Borehole Use: Geotechnical/Geological Investigation Completion Date: JAN-1965 Static Water Level: Primary Water Use: Not Used Sec. Water Use: Total Depth m: 4.3 Depth Ref: Ground Surface Depth Elev: Drill Method: Power auger Orig Ground Elev m: 78.6 Elev Reliabil Note: DEM Ground Elev m: 78.9 Concession: Location D: Survey D: Comments:					
Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD: 43.553904 Longitude DD: -79.583253 UTM Zone: 17 Easting: 614435 Northing: 4823303 Location Accuracy: Accuracy: Not Applicable					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: 218494899 Top Depth: .3 Bottom Depth: 1.5 Material Color: Brown Material 1: Sand Material 2: Clay Material 3: Material 4: Gsc Material Description: Stratum Description: SAND,CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL.					
Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen: alluvial					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Geology Stratum ID:	218494901			Mat Consistency:	
Top Depth:	1.8			Material Moisture:	
Bottom Depth:	3.2			Material Texture:	Coarse
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM TO COARSE,CLAY. ALLUVIAL,AGE POST-GLACIAL.				
Geology Stratum ID:	218494902			Mat Consistency:	
Top Depth:	3.2			Material Moisture:	
Bottom Depth:	3.4			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND,SILT,CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL.				
Geology Stratum ID:	218494903			Mat Consistency:	
Top Depth:	3.4			Material Moisture:	
Bottom Depth:	4			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:	Gravel			Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND,SILT,CLAY, GRAVEL. BROWN,ALLUVIAL, AGE POST-GLACIAL.				
Geology Stratum ID:	218494898			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.3			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Muck			Geologic Formation:	
Material 2:	Soil			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	MUCK,SOIL. GREY,AGE POST-GLACIAL.				
Geology Stratum ID:	218494900			Mat Consistency:	
Top Depth:	1.5			Material Moisture:	
Bottom Depth:	1.8			Material Texture:	Coarse
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM TO COARSE,SILT. ALLUVIAL,AGE POST-GLACIAL.				
Geology Stratum ID:	218494904			Mat Consistency:	Hard
Top Depth:	4			Material Moisture:	
Bottom Depth:	4.3			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:	Stones			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	CLAY,STONES. GREY,ALLUVIAL,HARD, AGE POST-GLACIAL.				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 091010 NTS_Sheet: 30M12A				
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.				
<u>Source List</u>					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
70	1 of 1	NNW/167.2	78.8 / -1.00	Richard's Fine Chocolates Inc. 25 Helene St N Mississauga ON L5G 3B6	SCT
Established:	8/1/1996				
Plant Size (ft²):					
Employment:					
<u>--Details--</u>					
Description:	Confectionery Manufacturing from Purchased Chocolate				
SIC/NAICS Code:	311330				
71	1 of 3	W/167.4	79.8 / 0.00	Enbridge Gas Distribution Inc. 26 Park Street Mississauga ON	SPL
Ref No:	2741-BG4W3L				
Year:					
Incident Dt:	9/17/2019				
Dt MOE Arvl on Scn:					
MOE Reported Dt:	9/17/2019				
Dt Document Closed:	9/28/2019				
Site No:	NA				
MOE Response:	No				
Site County/District:	Regional Municipality of Peel				
Site Geo Ref Meth:					
Site District Office:	Halton-Peel				
Nearest Watercourse:					
Site Name:	Residential<UNOFFICIAL>				
Site Address:	26 Park Street				
Site Region:	Central				
Site Municipality:	Mississauga				
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Entity Operating Name:					
Client Name:	Enbridge Gas Distribution Inc.				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Client Type: Corporation Source Type: Pipeline/Components Incident Cause: Leak/Break Incident Preceding Spill: Operator/Human Error Incident Reason: TSSA FSB: 2" steel IP service natural gas strike to atm. Incident Summary: Environment Impact: Health Env Consequence: Nature of Impact: Contaminant Qty: 0 other - see incident description Contaminant Qty 1: 0 Contaminant Unit: other - see incident description Contaminant Code: 35 Contaminant Name: NATURAL GAS (METHANE) Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: 1075 Receiving Medium: Air Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Miscellaneous Industrial SAC Action Class: TSSA - Fuel Safety Branch - Hydrocarbon Fuel Release/Spill Call Report Locatn Geodata: Time Reported: System Facility Address:					
71	2 of 3	W/167.4	79.8 / 0.00	ENBRIDGE GAS INC 26 PARK ST E,,MISSISSAUGA,ON,L5G 1L6,CA ON	PINC
Incident Id: Incident No: 2685652 Incident Reported Dt: 9/18/2019 Type: FS-Pipeline Incident Status Code: Tank Status: Pipeline Damage Reason Est Task No: Spills Action Centre: Fuel Type: Fuel Occurrence Tp: Date of Occurrence: Occurrence Start Dt: Depth: Customer Acct Name: ENBRIDGE GAS INC Incident Address: 26 PARK ST E,,MISSISSAUGA,ON,L5G 1L6,CA Operation Type: Pipeline Type: Regulator Type: Summary: Reported By: Affiliation: Occurrence Desc: Damage Reason: Notes:					
Pipe Material: Fuel Category: Health Impact: Environment Impact: Property Damage: Service Interrupt: Enforce Policy: Public Relation: Pipeline System: PSIG: Attribute Category: Regulator Location: Method Details:					
71	3 of 3	W/167.4	79.8 / 0.00	26 Park Street East Mississauga ON L5G 1L6	EHS
Order No: 20323000054 Status: C Report Type: Standard Report					
Nearest Intersection: Municipality: Client Prov/State: ON					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Report Date: 05-JAN-21 Date Received: 30-DEC-20 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans					
Search Radius (km): .25 X: -79.5872519 Y: 43.5541054					
72	1 of 2	WSW/167.8	79.8 / 0.00	21 PARK ST E PORT CREDIT ON	WWIS
Well ID: 7278220 Construction Date: Use 1st: Monitoring Use 2nd: Final Well Status: Observation Wells Water Type: Casing Material: Audit No: Z232730 Tag: A213502 Constructn Method: Elevation (m): Elevatn Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: MISSISSAUGA CITY (PORT CREDIT) Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 12/28/2016 Selected Flag: TRUE Abandonment Rec: Contractor: 7238 Form Version: 7 Owner: County: PEEL Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/727/7278220.pdf					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 12/02/2016 Year Completed: 2016 Depth (m): 9.144 Latitude: 43.5534913619022 Longitude: -79.5868977619431 X: -79.58689761171077 Y: 43.553491359657954 Path: 727/7278220.pdf					
<u>Bore Hole Information</u>					
Bore Hole ID: 1006322621 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 12/02/2016 Remarks: Location Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
Elevation: Elevrc: Zone: 17 East83: 614141.00 North83: 4823252.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006534352			
Layer:		5			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		25.0			
Formation End Depth:		30.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006534350			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		7.5			
Formation End Depth:		15.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006534349			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		2.5			
Formation End Depth:		7.5			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006534348			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		02			
Material 1 Desc:		TOPSOIL			
Material 2:					
Material 2 Desc:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		2.5			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006534351			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		15.0			
Formation End Depth:		25.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006534361			
Layer:		3			
Plug From:		8.0			
Plug To:		21.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006534362			
Layer:		4			
Plug From:		21.0			
Plug To:		30.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006534359			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006534360			
Layer:		2			
Plug From:		1.0			
Plug To:		8.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well</u>					
<u>Use</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Method Construction ID: 1006534358 Method Construction Code: 6 Method Construction: Boring Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID: 1006534347 Casing No: 0 Comment: Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID: 1006534355 Layer: 1 Material: 5 Open Hole or Material: PLASTIC Depth From: 0.0 Depth To: 10.0 Casing Diameter: 2.0 Casing Diameter UOM: inch Casing Depth UOM: ft					
<u>Construction Record - Screen</u>					
Screen ID: 1006534356 Layer: 1 Slot: 10 Screen Top Depth: 10.0 Screen End Depth: 20.0 Screen Material: 5 Screen Depth UOM: ft Screen Diameter UOM: inch Screen Diameter:					
<u>Water Details</u>					
Water ID: 1006534354 Layer: Kind Code: Kind: Water Found Depth: Water Found Depth UOM: ft					
<u>Hole Diameter</u>					
Hole ID: 1006534353 Diameter: 6.25 Depth From: 0.0 Depth To: 30.0 Hole Depth UOM: ft Hole Diameter UOM: inch					
72	2 of 2	WSW/167.8	79.8 / 0.00	21 Park Street East Port Credit ON	WWIS
Well ID: 7330661 Construction Date: Use 1st: Not Used Flowing (Y/N): Flow Rate: Data Entry Status:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Use 2nd:				Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	02/11/2019
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	86LCVWW2			Contractor:	7147
Tag:	A213502			Form Version:	9
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY (PORT CREDIT)			
Site Info:		MW 16-2			
 <u>Additional Detail(s) (Map)</u>					
Bore Hole ID:	1007353325			Tag No:	A213502
Depth M:				Contractor:	7147
Year Completed:	2019			Latitude:	43.5534913619022
Well Completed Dt:	01/18/2019			Longitude:	-79.5868977619431
Audit No:	86LCVWW2			Y:	43.553491359657954
Path:				X:	-79.58689761171077
 <u>Bore Hole Information</u>					
Bore Hole ID:	1007353325			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614141.00
Code OB Desc:				North83:	4823252.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	01/18/2019			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007353717				
Layer:	1				
Color:					
General Color:					
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:					
Formation End Depth UOM:	m				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007353957			
Layer:		1			
Plug From:		0.0			
Plug To:		6.099999904632568			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007354044			
Layer:		1			
Plug From:		0.0			
Plug To:		6.099999904632568			
Plug Depth UOM:		m			
<u>Pipe Information</u>					
Pipe ID:		1007353489			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007353808			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.0999999046325684			
Casing Diameter:		5.0			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007353870			
Layer:		1			
Slot:					
Screen Top Depth:		3.0999999046325684			
Screen End Depth:		6.099999904632568			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.300000190734863			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007353490			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
73	1 of 1	ESE/168.2	79.8 / 0.00	From Front Street northeast to Elmwood Ave S Mississauga ON L5G	EHS
Order No:		20310900227		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Custom Report		Client Prov/State: ON	
Report Date:		12-NOV-20		Search Radius (km): .25	
Date Received:		09-NOV-20		X: -79.58323684	
Previous Site Name:				Y: 43.55389734	
Lot/Building Size:					
Additional Info Ordered:		Fire Insur. Maps and/or Site Plans; City Directory; Aerial Photos			
74	1 of 1	WSW/168.9	79.8 / 0.00	29 PARK ST. EAST MISSISSAUGA ON	WWIS
Well ID:		7296574		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Test Hole		Data Entry Status:	
Use 2nd:		Monitoring		Data Src:	
Final Well Status:		Monitoring and Test Hole		Date Received: 10/05/2017	
Water Type:				Selected Flag: TRUE	
Casing Material:				Abandonment Rec:	
Audit No:		Z258527		Contractor: 7241	
Tag:		A189840		Form Version: 7	
Constructn Method:				Owner:	
Elevation (m):				County: PEEL	
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY (PORT CREDIT)			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/729\7296574.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		08/31/2017			
Year Completed:		2017			
Depth (m):		2.4384			
Latitude:		43.5537824687829			
Longitude:		-79.5871385635945			
X:		-79.58713841400358			
Y:		43.55378246629581			
Path:		729\7296574.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1006758607		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone: 17	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Code OB:				East83:	614121.00
Code OB Desc:				North83:	4823284.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	08/31/2017			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006953268			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		34			
Material 1 Desc:		TILL			
Material 2:		73			
Material 2 Desc:		HARD			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		1.0			
Formation End Depth:		6.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006953269			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		34			
Material 1 Desc:		TILL			
Material 2:		73			
Material 2 Desc:		HARD			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		6.0			
Formation End Depth:		8.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006953267			
Layer:		1			
Color:		2			
General Color:		GREY			
Material 1:		11			
Material 1 Desc:		GRAVEL			
Material 2:		73			
Material 2 Desc:		HARD			
Material 3:		79			
Material 3 Desc:		PACKED			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006953279			
Layer:		3			
Plug From:		2.5			
Plug To:		8.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006953278			
Layer:		2			
Plug From:		1.0			
Plug To:		2.5			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006953277			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006953276			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:		DIRECT PUSH			
<u>Pipe Information</u>					
Pipe ID:		1006953266			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006953272			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		0.30000001192092896			
Casing Diameter:		1.3799999952316284			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006953273			
Layer:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Slot: 10 Screen Top Depth: 3.0 Screen End Depth: 8.0 Screen Material: 5 Screen Depth UOM: ft Screen Diameter UOM: inch Screen Diameter: 1.659999966621399					
<u>Water Details</u>					
Water ID: 1006953271 Layer: Kind Code: Kind: Water Found Depth: Water Found Depth UOM: ft					
<u>Hole Diameter</u>					
Hole ID: 1006953270 Diameter: 2.375 Depth From: 0.0 Depth To: 8.0 Hole Depth UOM: ft Hole Diameter UOM: inch					
75	1 of 1	ENE/169.5	79.8 / 0.00	Scott Insley 8 ANN ST ON MISSISSAUGA ON	RSC
RSC No: 112315 RA No: Status: FILED Filing Date: Date Ack: Date Returned: Approval Date: June 21, 2011 Cert Date: Cert Prop Use No: Curr Property Use: Intended Prop Use: Restoration Type: Soil Type: Criteria: Stratified (Y/N): Audit (Y/N): Entire Leg Prop. (Y/N): CPU Issu Sect 1686: Business Name: Scott Insley Address: 8 ANN ST ON Legal Desc: Site Pin: 13463-0073(LT) Asmt Roll No: Project Type: PRE2011 Approval Type: RSC based on Phase One ESA Applicable Standards: PDF Link: https://www.accessenvironment.ene.gov.on.ca/AEWeb/ae/ViewDocument.action?documentRefID=112315					
X: -79.58339582914543 Y: 43.55500572064588 Latitude: 43.55500572 Longitude: -79.58339583 UTM Coordinates: Latitude Longitude: Accuracy Estimate: Measurement Method: Mailing Address: Telephone: Fax: Email: Postal Code: L5G 3E6 Ministry District: MOE District: Halton-Peel SWP Area Name: Credit Valley Qual Person Name: Russ Pagulayan Consultant:					
76	1 of 2	ENE/169.6	79.8 / 0.00	Enbridge Gas Distribution Inc. 8 Ann St. Mississauga Mississauga ON	SPL

190 erisinfo.com | Environmental Risk Information Services Order No: 25020500477

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Fuel Occurrence Tp: Date of Occurrence: Occurrence Start Dt: Depth: Customer Acct Name: Incident Address: Operation Type: Pipeline Type: Regulator Type: Summary: Reported By: Affiliation: Occurrence Desc: Damage Reason: Notes:					
PSIG: Attribute Category: Regulator Location: Method Details:					
PIPELINE HIT - 2" 8 ANN ST,,MISSISSAUGA,ON,L5G 3E6,CA					
77	1 of 1	W/169.7	79.1 / -0.75	26 Elizabeth St N, Mississauga MISSISSAUGA ON	SPL
Ref No: 1-2GJ8DB Year: Incident Dt: 1/18/2023 10:31:56 AM Dt MOE Arvl on Scn: MOE Reported Dt: 1/18/2023 3:23:56 PM Dt Document Closed: 1/26/2023 4:42:26 PM Site No: MOE Response: Desktop Response Site County/District: Site Geo Ref Meth: Site District Office: Halton-Peel District Office Nearest Watercourse: Credit River Site Name: Site Address: 26 Elizabeth St N, Mississauga Site Region: REGIONAL MUNICIPALITY OF PEEL Site Municipality: MISSISSAUGA Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: PEEL REGION Client Type: Government, Municipal Source Type: Pipeline/Components Incident Cause: Incident Preceding Spill: Leak/Break Incident Reason: Unknown Incident Summary: RoP- Watermain Break into Credit River Environment Impact: 1 Minor Impact Health Env Consequence: Nature of Impact: Contaminant Qty: 0 other - see notes Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: SEDIMENT Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Surface Water Activity Preceding Spill: Property 2nd Watershed: 029 Lake Ontario Property Tertiary Watershed: 029A West Lake Ontario Shoreline					
Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: 0 No Impact Agency Involved:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address:		WATER SUPPLY AND IRRIGATION SYSTEMS {"integration_ids":["PR00001685104"],"wkts":["POINT (-79.5858551000 43.5537951000)","creation_date":"2023-01-18"]}			
78	1 of 2	ENE/170.1	79.8 / 0.00	Home Alone Property Management Services Limited 10 ANN ST ON MISSISSAUGA ON	RSC
RSC No: RA No: Status: Filing Date: Date Ack: Date Returned: Approval Date: Cert Date: Cert Prop Use No: Curr Property Use: Intended Prop Use: Restoration Type: Soil Type: Criteria: Stratified (Y/N): Audit (Y/N): Entire Leg Prop. (Y/N): CPU Issu Sect 1686: Business Name: Address: Legal Desc: Site Pin: Asmt Roll No: Project Type: Approval Type: Applicable Standards: PDF Link:		112316 FILED June 21, 2011	X: Y: Latitude: Longitude: UTM Coordinates: Latitude Longitude: Accuracy Estimate: Measurement Method: Mailing Address: Telephone: Fax: Email: Postal Code: Ministry District: MOE District: SWP Area Name: Qual Person Name: Consultant:		
				-79.58351559164078 43.55517828196214 43.55517828 -79.58351559 L5G 3E6 Halton-Peel Credit Valley Russ Pagulayan	
		Home Alone Property Management Services Limited			
		10 ANN ST ON			
		13463-0038 (LT)			
		PRE2011			
		RSC based on Phase One ESA			
		https://www.accessenvironment.ene.gov.on.ca/AEWeb/ae/ViewDocument.action?documentRefID=112316			
78	2 of 2	ENE/170.1	79.8 / 0.00	F.S. 6810 DEVELOPMENT INC. 10 ANN STREET ON Mississauga ON	RSC
RSC No: RA No: Status: Filing Date: Date Ack: Date Returned: Approval Date: Cert Date: Cert Prop Use No: Curr Property Use: Intended Prop Use: Restoration Type: Soil Type: Criteria: Stratified (Y/N): Audit (Y/N): Entire Leg Prop. (Y/N):		223748 FILED September 5, 2017	X: Y: Latitude: Longitude: UTM Coordinates: Latitude Longitude: Accuracy Estimate: Measurement Method: Mailing Address: Telephone: Fax: Email: Postal Code: Ministry District: MOE District: SWP Area Name: Qual Person Name:		
				-79.5834819739879 43.555165259626186 43.55516526 -79.58348197 L5G 2E6 Halton-Peel Credit Valley SAMUEL OYEDOKUN	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
CPU Issu Sect 1686:					
Business Name:		F.S. 6810 DEVELOPMENT INC.		Consultant:	
Address:		10 ANN STREET ON			
Legal Desc:					
Site Pin:		13463-0188 (LT)			
Asmt Roll No:					
Project Type:		POST2011			
Approval Type:		RSC based on Phase One and Two ESAs			
Applicable Standards:					
PDF Link:		https://www.accessenvironment.ene.gov.on.ca/AEWeb/ae/ViewDocument.action?documentRefID=223748			

79	1 of 3	WSW/170.9	79.8 / 0.00	21 PARK ST E PORT CREDIT ON	WWIS
Well ID:	7278218			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	12/28/2016
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z232728			Contractor:	7238
Tag:	A213503			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/727\7278218.pdf				

Additional Detail(s) (Map)

Well Completed Date:	12/06/2016
Year Completed:	2016
Depth (m):	14.9352
Latitude:	43.5535192842979
Longitude:	-79.5869713905599
X:	-79.58697124119884
Y:	43.55351928133369
Path:	727\7278218.pdf

Bore Hole Information

Bore Hole ID:	1006322615	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614135.00
Code OB Desc:		North83:	4823255.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	12/06/2016	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	www
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Improvement Location Method: Source Revision Comment: Supplier Comment:					
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1006534280			
Layer:		4			
Color:					
General Color:					
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		20.0			
Formation End Depth:		30.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1006534279			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		15.0			
Formation End Depth:		20.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1006534278			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:					
Material 2 Desc:					
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		5.0			
Formation End Depth:		15.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1006534281			
Layer:		5			
Color:					
General Color:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		30.0			
Formation End Depth:		49.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006534277			
Layer:		1			
Color:					
General Color:					
Material 1:		02			
Material 1 Desc:		TOPSOIL			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		5.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006534290			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006534292			
Layer:		3			
Plug From:		37.0			
Plug To:		49.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006534291			
Layer:		2			
Plug From:		1.0			
Plug To:		37.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006534289			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Pipe Information</u>					
Pipe ID:		1006534276			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006534286			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		39.0			
Casing Diameter:		1.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006534287			
Layer:		1			
Slot:		10			
Screen Top Depth:		39.0			
Screen End Depth:		49.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:					
<u>Water Details</u>					
Water ID:		1006534285			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006534282			
Diameter:		6.25			
Depth From:		0.0			
Depth To:		30.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Hole Diameter</u>					
Hole ID:		1006534284			
Diameter:		3.5			
Depth From:		35.0			
Depth To:		49.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Hole Diameter</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole ID: Diameter: Depth From: Depth To: Hole Depth UOM: Hole Diameter UOM:		1006534283 4.5 30.0 35.0 ft inch			
79	2 of 3	WSW/170.9	79.8 / 0.00	EDENSHAW PARK DEVELOPMENTS LIMITED 21 Park ST E Mississauga ON L5G 1L7	EASR
Approval No: Status: Date: Record Type: Link Source: Project Type: Full Address: Approval Type: SWP Area Name: PDF NAICS Code: PDF URL: PDF Site Location:		R-009-9111044549 REGISTERED 2019-02-27 EASR MOFA Water Taking - Construction Dewatering EASR-Water Taking - Construction Dewatering Toronto		MOE District: Municipality: Latitude: Longitude: Geometry X: Geometry Y:	Metro Toronto Mississauga 43.64027778 -79.45416667
79	3 of 3	WSW/170.9	79.8 / 0.00	21 Park Street East Port Credit ON	WWIS
Well ID: Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: Tag: Constructn Method: Elevation (m): Elevatn Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:		7330662 Not Used Abandoned-Other YFL7EAMT A213503 MISSISSAUGA CITY (PORT CREDIT) MW 16-1		Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: Selected Flag: Abandonment Rec: Contractor: Form Version: Owner: County: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	02/11/2019 TRUE Yes 7147 9 PEEL
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID: Depth M: Year Completed: Well Completed Dt: Audit No: Path:		1007353328 2019 01/18/2019 YFL7EAMT		Tag No: Contractor: Latitude: Longitude: Y: X:	A213503 7147 43.5535192842979 -79.5869713905599 43.55351928133369 -79.58697124119884
<u>Bore Hole Information</u>					
Bore Hole ID: DP2BR: Spatial Status:		1007353328		Elevation: Elevrc: Zone:	17

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Code OB:				East83:	614135.00
Code OB Desc:				North83:	4823255.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	01/18/2019			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007353718			
Layer:		1			
Color:					
General Color:					
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:					
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007353959			
Layer:		2			
Plug From:		2.5			
Plug To:		14.899999618530273			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007354045			
Layer:		1			
Plug From:		0.0			
Plug To:		14.899999618530273			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007353958			
Layer:		1			
Plug From:		0.0			
Plug To:		2.5			
Plug Depth UOM:		m			
<u>Pipe Information</u>					
Pipe ID:		1007353491			
Casing No:		0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Comment: Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007353809			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		11.899999618530273			
Casing Diameter:		5.0			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007353871			
Layer:		1			
Slot:					
Screen Top Depth:		11.899999618530273			
Screen End Depth:		14.899999618530273			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.300000190734863			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007353492			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Water Details</u>					
Water ID:		1007353661			
Layer:		1			
Kind Code:		8			
Kind:		Untested			
Water Found Depth:		6.0			
Water Found Depth UOM:		m			

80

1 of 1

SE/172.0

79.8 / 0.00

ONTARIO HYDRO
 ELIZABETH AND LAKESHORE MISSISSAUGA
 TRANSFORMER
 MISSISSAUGA CITY ON

SPL

Ref No: 9390

Municipality No: 21102

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Year: Incident Dt: 9/15/1988 Dt MOE Arvl on Scn: MOE Reported Dt: 9/15/1988 Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Site Address: Site Region: Site Municipality: MISSISSAUGA CITY Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: VALVE/FITTING LEAK OR FAILURE Incident Preceding Spill: Incident Reason: UNKNOWN Incident Summary: MISSISSAUGA HYDRO OVERHEAD TRANSFORMER LEAKING OIL. Environment Impact: Health Env Consequence: Nature of Impact: Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: LAND Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address: Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:					
81	1 of 1	N/172.1	78.8 / -1.00	78 PARK ST. E MISSISSAUGA ON	WWIS
Well ID: 7341887 Construction Date: Use 1st: Monitoring Use 2nd: Final Well Status: Observation Wells Water Type: Casing Material: Audit No: WBYVTTLTD Tag: A264678 Constructn Method: Elevation (m): Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 09/16/2019 Selected Flag: TRUE Abandonment Rec: Contractor: 6607 Form Version: 9 Owner: County: PEEL					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:			Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability: MISSISSAUGA CITY (PORT CREDIT) MW 19-1		
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/734\7341887.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		08/14/2019			
Year Completed:		2019			
Depth (m):		26.5176			
Latitude:		43.5559172544505			
Longitude:		-79.5850211032385			
X:		-79.58502095331264			
Y:		43.55591725138108			
Path:		734\7341887.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1007643336		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				East83:	
Code OB Desc:				North83:	
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	
Date Completed:		08/14/2019		UTMRC Desc:	
Remarks:				Location Method:	
Location Method Desc:		on Water Well Record		margin of error : 30 m - 100 m	
Elevrc Desc:				wwr	
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007643964			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		17			
Material 1 Desc:		SHALE			
Material 2:		15			
Material 2 Desc:		LIMESTONE			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		27.0			
Formation End Depth:		87.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		1007643962			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		34			
Material 1 Desc:		TILL			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		15.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007643963			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		34			
Material 1 Desc:		TILL			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		15.0			
Formation End Depth:		27.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007644523			
Layer:		2			
Plug From:		1.0			
Plug To:		82.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007644522			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007644336			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
 <u>Method of Construction & Well</u> <u>Use</u>					
Method Construction ID:		1007643636			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007643635			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007643514			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007644053			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		82.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007644133			
Layer:		1			
Slot:		10			
Screen Top Depth:		82.0			
Screen End Depth:		87.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.5			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007643515			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1007644248			
Diameter:		4.0			
Depth From:		30.0			
Depth To:		87.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Hole Diameter</u>					
Hole ID:		1007644247			
Diameter:		8.0			
Depth From:		0.0			
Depth To:		30.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>82</u>	1 of 1	NNW/174.8	78.8 / -1.00	70 Park St E Mississauga ON L5G 1M5	EHS
Order No:	22030800679			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Custom Report			Client Prov/State:	ON
Report Date:	11-MAR-22			Search Radius (km):	.25
Date Received:	08-MAR-22			X:	-79.58582111
Previous Site Name:				Y:	43.55588489
Lot/Building Size:					
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans				
<u>83</u>	1 of 1	N/174.9	78.8 / -1.00	78 PARK ST. E Mississauga ON	WWIS
Well ID:	7380344			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	02/17/2021
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	Z346438			Contractor:	7215
Tag:				Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/738\7380344.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	01/13/2021				
Year Completed:	2021				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth (m):					
Latitude:		43.5559447184594			
Longitude:		-79.5850576025616			
X:		-79.5850574527469			
Y:		43.55594471557274			
Path:		738\7380344.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1008631301		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone: 17	
Code OB:				East83: 614285.00	
Code OB Desc:				North83: 4823527.00	
Open Hole:				Org CS: UTM83	
Cluster Kind:				UTMRC: 4	
Date Completed:		01/13/2021		UTMRC Desc: margin of error : 30 m - 100 m	
Remarks:				Location Method: wwr	
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1009798343			
Layer:		1			
Plug From:		0.0			
Plug To:		85.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1009798344			
Layer:		1			
Plug From:		0.0			
Plug To:		85.0			
Plug Depth UOM:		ft			
<u>Pipe Information</u>					
Pipe ID:		1009676489			
Casing No:		0			
Comment:					
Alt Name:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1009800450			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:		No			
<u>Water Details</u>					
Water ID:		1009800101			
Layer:		1			
Kind Code:		8			
Kind:		Untested			
Water Found Depth:		24.0			
Water Found Depth UOM:		ft			

84	1 of 1	WNW/174.9	78.8 / -1.00	ON	BORE
Borehole ID:	640914			Inclin FLG:	No
OGF ID:	215541309			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.554899
Total Depth m:	2.7			Longitude DD:	-79.587254
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614110
Drill Method:	Power auger			Northing:	4823408
Orig Ground Elev m:	82.7			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	82.7				
Concession:					
Location D:					
Survey D:					
Comments:					

Borehole Geology Stratum

Geology Stratum ID:	218494049	Mat Consistency:	
Top Depth:	0	Material Moisture:	
Bottom Depth:	0	Material Texture:	
Material Color:		Non Geo Mat Type:	
Material 1:	Asphalt	Geologic Formation:	
Material 2:		Geologic Group:	
Material 3:		Geologic Period:	
Material 4:		Depositional Gen:	
Gsc Material Description:			
Stratum Description:	ASPHALT.		
Geology Stratum ID:	218494051	Mat Consistency:	
Top Depth:	.2	Material Moisture:	
Bottom Depth:	1.2	Material Texture:	
Material Color:	Grey	Non Geo Mat Type:	
Material 1:	Sand	Geologic Formation:	
Material 2:	Clay	Geologic Group:	
Material 3:	Silt	Geologic Period:	
Material 4:		Depositional Gen:	alluvial

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Gsc Material Description:					
Stratum Description:		SAND,CLAY,SILT. GREY,ALLUVIAL, AGE POST-GLACIAL.			
Geology Stratum ID:	218494053			Mat Consistency:	
Top Depth:	2.1			Material Moisture:	Moist
Bottom Depth:	2.7			Material Texture:	Medium
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:		SAND-MEDIUM,SILT, CLAY. GREY,ALLUVIAL,MOIST, AGE POST-GLACIAL.			
Geology Stratum ID:	218494052			Mat Consistency:	
Top Depth:	1.2			Material Moisture:	
Bottom Depth:	2.1			Material Texture:	Medium
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:		SAND-MEDIUM,CLAY, SILT. GREY,ALLUVIAL, AGE POST-GLACIAL.			
Geology Stratum ID:	218494050			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.2			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:		FILL,GRAVEL. GREY.			
Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 088800 NTS_Sheet: 30M12A				
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.				
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				

85

1 of 8

ESE/176.6

79.8 / 0.00

SEAWAY CLEANERS
103 LAKESHORE ROAD EAST
MISSISSAUGA ON L5G 1E2

GEN

Generator Info

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON0379300 Approval Years: 86,87,88,89,90 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: POWER LAUND./CLEANERS Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 9721					
<u>Waste Detail(s)</u>					
Waste Class: 241 Waste Class Name: HALOGENATED SOLVENTS					
85	2 of 8	ESE/176.6	79.8 / 0.00	SEAWAY CLEANERS 103 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E2	GEN
<u>Generator Info</u>					
Generator No: ON0379300 Approval Years: 92,93,97,98 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: POWER LAUND./CLEANER Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 9721					
<u>Waste Detail(s)</u>					
Waste Class: 241 Waste Class Name: HALOGENATED SOLVENTS					
85	3 of 8	ESE/176.6	79.8 / 0.00	SEAWAY CLEANERS 34-063 103 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E2	GEN
<u>Generator Info</u>					
Generator No: ON0379300 Approval Years: 94,95,96 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: POWER LAUND./CLEANER Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 9721					
<u>Waste Detail(s)</u>					
Waste Class: 241 Waste Class Name: HALOGENATED SOLVENTS					
85	4 of 8	ESE/176.6	79.8 / 0.00	SEAWAY CLE(OUT OF BUSINESS) 103 LAKESHORE ROAD EAST	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
MISSISSAUGA ON L5G 1E2					
<u>Generator Info</u>					
Generator No:	ON0379300			Choice of Contact:	
Approval Years:	99,00			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	9721
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	POWER LAUND./CLEANERS				
<u>Waste Detail(s)</u>					
Waste Class:	241				
Waste Class Name:	HALOGENATED SOLVENTS				
85	5 of 8	ESE/176.6	79.8 / 0.00	103 Lakeshore Road East Port Credit ON L5G 1E2	EHS
Order No:	20080915008			Nearest Intersection:	Lakeshore Road East & Elizabeth Street South
Status:	C			Municipality:	Peel Region, Mississauga
Report Type:	Standard Report			Client Prov/State:	NS
Report Date:	9/23/2008			Search Radius (km):	0.25
Date Received:	9/15/2008			X:	-79.583203
Previous Site Name:				Y:	43.553391
Lot/Building Size:					
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans; City Directory				
85	6 of 8	ESE/176.6	79.8 / 0.00	2539762 ONTARIO LTD. KEVIN LaROSE TEAM 103 LAKESHORE ROAD EAST MISSISSAUGA ON	GEN
<u>Generator Info</u>					
Generator No:	ON3013277			Choice of Contact:	
Approval Years:	2013			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	541990
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	ALL OTHER PROFESSIONAL, SCIENTIFIC AND TECHNICAL SERVICES				
<u>Waste Detail(s)</u>					
Waste Class:	150				
Waste Class Name:	INERT INORGANIC WASTES				
85	7 of 8	ESE/176.6	79.8 / 0.00	2539762 ONTARIO LTD. KEVIN LaROSE TEAM 103 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E2	GEN
<u>Generator Info</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON3013277 Approval Years: 2015 Status: PO Box No: Country: Canada Co Admin: Phone No Admin: SIC Description: ALL OTHER PROFESSIONAL, SCIENTIFIC AND TECHNICAL SERVICES Choice of Contact: CO_OFFICIAL Contaminated Fac: No MHSW Facility: No SIC Code: 541990					
<u>Waste Detail(s)</u>					
Waste Class: 150 Waste Class Name: INERT INORGANIC WASTES					
85	8 of 8	ESE/176.6	79.8 / 0.00	2539762 ONTARIO LTD. KEVIN LaROSE TEAM 103 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E2	GEN
<u>Generator Info</u>					
Generator No: ON3013277 Approval Years: 2014 Status: PO Box No: Country: Canada Co Admin: Phone No Admin: SIC Description: ALL OTHER PROFESSIONAL, SCIENTIFIC AND TECHNICAL SERVICES Choice of Contact: CO_OFFICIAL Contaminated Fac: No MHSW Facility: No SIC Code: 541990					
<u>Waste Detail(s)</u>					
Waste Class: 150 Waste Class Name: INERT INORGANIC WASTES					
86	1 of 1	ENE/176.8	79.8 / 0.00	ON	WWIS
Well ID: 7267968 Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: C33944 Tag: A203341 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: MISSISSAUGA CITY Site Info: Flowing (Y/N): Flow Rate: Data Entry Status: Yes Data Src: Date Received: 07/28/2016 Selected Flag: TRUE Abandonment Rec: Contractor: 7230 Form Version: 8 Owner: County: PEEL Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
<u>Additional Detail(s) (Map)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bore Hole ID:	1006177173			Tag No:	A203341
Depth M:				Contractor:	7230
Year Completed:	2016			Latitude:	43.5551849837195
Well Completed Dt:	06/22/2016			Longitude:	-79.5833297265704
Audit No:	C33944			Y:	43.555184981346294
Path:				X:	-79.58332957715237
<u>Bore Hole Information</u>					
Bore Hole ID:	1006177173			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614426.00
Code OB Desc:				North83:	4823445.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	06/22/2016			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
87	1 of 1	ESE/177.2	79.8 / 0.00	LAKESHORE 91/99 Mississauga ON	WWIS
Well ID:	7148420			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	07/16/2010
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z116136			Contractor:	7241
Tag:	A099961			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/714\7148420.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	06/10/2010				
Year Completed:	2010				
Depth (m):	3.3528				
Latitude:	43.5538858593597				
Longitude:	-79.5831249400268				
X:	-79.58312479019317				
Y:	43.55388585672162				
Path:	714\7148420.pdf				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Bore Hole Information</u>					
Bore Hole ID:	1003169223			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614445.00
Code OB Desc:				North83:	4823301.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	06/10/2010			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1003209372				
Layer:	2				
Color:	6				
General Color:	BROWN				
Material 1:	06				
Material 1 Desc:	SILT				
Material 2:	28				
Material 2 Desc:	SAND				
Material 3:					
Material 3 Desc:					
Formation Top Depth:	8.0				
Formation End Depth:	11.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1003209371				
Layer:	1				
Color:	6				
General Color:	BROWN				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:	8.0				
Formation End Depth UOM:	ft				
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1003209376				
Layer:	3				
Plug From:	1.0				
Plug To:	4.0				
Plug Depth UOM:	ft				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003209377			
Layer:		4			
Plug From:		4.0			
Plug To:		11.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003209374			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003209383			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1003209370			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003209379			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		6.0			
Casing Diameter:		1.25			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1003209380			
Layer:		1			
Slot:		10			
Screen Top Depth:		6.0			
Screen End Depth:		11.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.5			
<u>Water Details</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water ID: 1003209378 Layer: Kind Code: Kind: Water Found Depth: Water Found Depth UOM: ft					
Hole Diameter					
Hole ID: 1003209373 Diameter: Depth From: Depth To: Hole Depth UOM: ft Hole Diameter UOM: inch					
88	1 of 1	ESE/178.4	79.8 / 0.00	107-113 Lakeshore Road East Mississauga/Port Credit ON L5G 1E2	EHS
Order No: 20080619003 Status: C Report Type: Custom Report Report Date: 6/27/2008 Date Received: 6/19/2008 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps And /or Site Plans					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): 0.25 X: -79.583079 Y: 43.553524					
89	1 of 1	ESE/179.3	79.8 / 0.00	103 LAKESHORE RD E MISSISSAUGA ON	WWIS
Well ID: 7183814 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: 0 Final Well Status: Test Hole Water Type: Casing Material: Audit No: Z151073 Tag: A113461 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: MISSISSAUGA CITY (PORT CREDIT) Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 07/06/2012 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: PEEL Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/718\7183814.pdf					
Additional Detail(s) (Map)					
Well Completed Date: 05/30/2012 Year Completed: 2012 Depth (m): 1.4 Latitude: 43.5534480091977 Longitude: -79.5833951839228 X: -79.58339503392587					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Y:		43.55344800626825			
Path:		718\7183814.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	1004195958			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614424.00
Code OB Desc:				North83:	4823252.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	05/30/2012			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1004349948				
Layer:	3				
Color:	2				
General Color:	GREY				
Material 1:	06				
Material 1 Desc:	SILT				
Material 2:	08				
Material 2 Desc:	FINE SAND				
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	1.0				
Formation End Depth:	1.399999976158142				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1004349946				
Layer:	1				
Color:	1				
General Color:	WHITE				
Material 1:	27				
Material 1 Desc:	OTHER				
Material 2:					
Material 2 Desc:					
Material 3:	73				
Material 3 Desc:	HARD				
Formation Top Depth:	0.0				
Formation End Depth:	0.20000000298023224				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1004349947				
Layer:	2				
Color:	6				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.20000000298023224			
Formation End Depth:		1.0			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004349957			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004349958			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		0.800000011920929			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004349956			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004349959			
Layer:		3			
Plug From:		0.800000011920929			
Plug To:		1.399999976158142			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1004349955			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:		DIRECT PUSH			
 <u>Pipe Information</u>					
Pipe ID:		1004349945			
Casing No:		0			
Comment:					
Alt Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:		1004349951			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		0.699999988079071			
Casing Diameter:		3.450000047683716			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1004349952			
Layer:		1			
Slot:		10			
Screen Top Depth:		0.699999988079071			
Screen End Depth:		1.399999976158142			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.050000190734863			
<u>Water Details</u>					
Water ID:		1004349950			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1004349949			
Diameter:		6.0			
Depth From:		0.0			
Depth To:		1.399999976158142			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>90</u>	1 of 1	ENE/179.7	79.8 / 0.00	Scott Insley 6 ANN ST ON MISSISSAUGA ON	RSC
RSC No:	112310			X:	-79.5831491347004
RA No:				Y:	43.55496664700741
Status:	FILED			Latitude:	43.55496665
Filing Date:				Longitude:	-79.58314913
Date Ack:				UTM Coordinates:	
Date Returned:				Latitude Longitude:	
Approval Date:	June 21, 2011			Accuracy Estimate:	
Cert Date:				Measurement Method:	
Cert Prop Use No:				Mailing Address:	
Curr Property Use:				Telephone:	
Intended Prop Use:				Fax:	
Restoration Type:				Email:	
Soil Type:				Postal Code:	L5G 3E6
Criteria:				Ministry District:	
Stratified (Y/N):				MOE District:	Halton-Peel

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Audit (Y/N): Entire Leg Prop. (Y/N): CPU Issu Sect 1686: Business Name: Address: Legal Desc: Site Pin: Asmt Roll No: Project Type: Approval Type: Applicable Standards: PDF Link:			Scott Insley 6 ANN ST ON 13463-0072(LT) PRE2011 RSC based on Phase One ESA https://www.accessenvironment.ene.gov.on.ca/AEWeb/ae/ViewDocument.action?documentRefID=112310	SWP Area Name: Qual Person Name: Consultant:	Credit Valley Russ Pagulayan

91	1 of 1	NE/180.4	79.8 / 0.00	ON	BORE
Borehole ID: OGF ID: Status: Type: Use: Completion Date: Static Water Level: Primary Water Use: Sec. Water Use: Total Depth m: Depth Ref: Depth Elev: Drill Method: Orig Ground Elev m: Elev Reliabil Note: DEM Ground Elev m: Concession: Location D: Survey D: Comments:			640928 215541323 Borehole Geotechnical/Geological Investigation JAN-1965 Not Used -999 Ground Surface Power auger 80.6 80.3 	Inclin FLG: SP Status: Surv Elev: Piezometer: Primary Name: Municipality: Lot: Township: Latitude DD: Longitude DD: UTM Zone: Easting: Northing: Location Accuracy: Accuracy:	No Initial Entry No No 43.555575 -79.583709 17 614395 4823488 Not Applicable
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:			218494116 0 .1 Asphalt ASPHALT.	Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:			218494118 .3 .8 Brown Soil Sand Silt Clay SOIL,SAND-MEDIUM, SILT,CLAY. BROWN.	Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Medium
Geology Stratum ID: Top Depth:			218494120 1.2	Mat Consistency: Material Moisture:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bottom Depth:	1.5			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:		CLAY,SAND,SILT.	ALLUVIAL,AGE POST-GLACIAL.		
Geology Stratum ID:	218494121			Mat Consistency:	
Top Depth:	1.5			Material Moisture:	
Bottom Depth:				Material Texture:	Medium
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:		SAND-MEDIUM.	ALLUVIAL,AGE POST-GLACIAL.		
Geology Stratum ID:	218494117			Mat Consistency:	
Top Depth:	.1			Material Moisture:	
Bottom Depth:	.3			Material Texture:	Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:	Clay			Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:		FILL-MEDIUM,SAND,	SILT,CLAY. BROWN.		
Geology Stratum ID:	218494119			Mat Consistency:	
Top Depth:	.8			Material Moisture:	
Bottom Depth:	1.2			Material Texture:	Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:		SAND-MEDIUM,CLAY.	BROWN,ALLUVIAL, AGE POST-GLACIAL.		
Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Details:		File: TOR1B.txt RecordID: 088940 NTS_Sheet: 30M12A			
Confiden 1:		Logs are approximately correct. Lack of information. Doubtful terminology.			
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Originators:		Geological Survey of Canada			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
92	1 of 2	SSW/180.5	79.8 / 0.00	MISSISSAUGA HYDRO (PCB) 15 STAVEBANK ROAD C/O 3240 MAVIS ROAD MISSISSUAGA ON L5G 2T3	GEN
Generator Info					
Generator No:	ON0124371			Choice of Contact:	
Approval Years:	90			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	0000
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	*** NOT DEFINED ***				
92	2 of 2	SSW/180.5	79.8 / 0.00	MISSISSAUGA HYDRO (PCB) 00-000 15 STAVEBANK ROAD C/O 3240 MAVIS ROAD MISSISSUAGA ON L5G 2T3	GEN
Generator Info					
Generator No:	ON0124371			Choice of Contact:	
Approval Years:	92,93,94			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	0000
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	*** NOT DEFINED ***				
93	1 of 13	ESE/181.7	79.8 / 0.00	LOBLAWS SUPERMARKETS LTD. #164-0 99 LAKESHORE ROAD PORT CREDIT ON M4T 2S5	PES
Detail Licence No:				Operator Box:	
Licence No:				Operator Class:	
Status:				Operator No:	
Approval Date:				Operator Type:	
Report Source:				Oper Area Code:	
Licence Type:	Vendor			Oper Phone No:	
Licence Type Code:				Operator Ext:	
Licence Class:				Operator Lot:	
Licence Control:				Oper Concession:	
Latitude:				Operator Region:	
Longitude:				Operator District:	
Lot:				Operator County:	
Concession:				Op Municipality:	
Region:				Post Office Box:	
District:				MOE District:	
County:				SWP Area Name:	
Trade Name:					
PDF URL:					
93	2 of 13	ESE/181.7	79.8 / 0.00	815957 ONTARIO LIMITED BRIAN'S NO FRILLS 99 LAKESHORE ROAD PORT CREDIT ON M9R 1Y5	PES
Detail Licence No:				Operator Box:	
Licence No:				Operator Class:	

221 erisinfo.com | Environmental Risk Information Services Order No: 25020500477

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address:					
93	4 of 13	ESE/181.7	79.8 / 0.00	1382019 ONTARIO LTD/MURPHY'S NO FRILLS 99 LAKESHORE RD E PORT CREDIT ON L5G1E2	PES
Detail Licence No: 23-01-09148-0 Licence No: 09148 Status: Approval Date: Report Source: Legacy Licenses (Excluding TS) Licence Type: Limited Vendor Licence Type Code: 23 Licence Class: 01 Licence Control: 0 Latitude: Longitude: Lot: Concession: Region: 3 District: County: Trade Name: PDF URL:					
Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: 905 Oper Phone No: 9672585 Operator Ext: Operator Lot: Oper Concession: Operator Region: 3 Operator District: Operator County: 49 Op Municipality: Post Office Box: MOE District: SWP Area Name:					
93	5 of 13	ESE/181.7	79.8 / 0.00	Loblaws Properties Limited 99 Lakeshore Rd. West Mississauga ON L5G 1E2	GEN
<u>Generator Info</u>					
Generator No: ON3809725 Approval Years: 04 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: Supermarkets and Other Grocery (except Convenience) Stores					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 445110					
93	6 of 13	ESE/181.7	79.8 / 0.00	LOBLAWS INC. O/A NO FRILLS #1353 99 LAKESHORE RD E MISSISSAUGA ON L5G 1E2	PES
Detail Licence No: Licence No: Status: Approval Date: Report Source: Licence Type: Limited Vendor Licence Type Code: 23 Licence Class: Licence Control:					
Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: Oper Phone No: Operator Ext: Operator Lot: Oper Concession:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:					
Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:					
93	7 of 13	ESE/181.7	79.8 / 0.00	LOBLAWS INC. O/A NO FRILLS #1353 99 LAKESHORE RD E MISSISSAUGA ON L5G 1E2	PES
Detail Licence No: Licence No: Status: Approval Date: Report Source: Licence Type: Vendor Licence Type Code: Licence Class: Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:					
Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: Oper Phone No: Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:					
93	8 of 13	ESE/181.7	79.8 / 0.00	99 Lakeshore Road East Mississauga ON L5G 1E2	EHS
Order No: 20100126023 Status: C Report Type: Custom Report Report Date: 2/2/2010 Date Received: 1/26/2010 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): 0.25 X: -79.583534 Y: 43.553364					
93	9 of 13	ESE/181.7	79.8 / 0.00	2307036 ONTARIO LTD 99 LAKESHORE RD. E. MISSISSAUGA ON L5G 1E2	PES
Detail Licence No: Licence No: Status: Approval Date: Report Source: Licence Type: Vendor Licence Type Code: Licence Class: Licence Control: Latitude: Longitude:					
Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: Oper Phone No: Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Lot: Concession: Region: District: County: Trade Name: PDF URL:					
Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:					
93	10 of 13	ESE/181.7	79.8 / 0.00	2307036 ONTARIO LTD 99 LAKESHORE RD. E. MISSISSAUGA ON L5G1E2	PES
Detail Licence No: Licence No: 15971 Status: Approval Date: Report Source: Legacy Licenses (Excluding TS) Licence Type: Limited Vendor Licence Type Code: 23 Licence Class: 01 Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:					
Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: 905 Oper Phone No: 2788283 Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:					
93	11 of 13	ESE/181.7	79.8 / 0.00	1382019 ONTARIO LTD/MURPHY'S NO FRILLS 99 LAKESHORE RD E PORT CREDIT ON L5G1E2	PES
Detail Licence No: Licence No: 09148 Status: Approval Date: Report Source: Legacy Licenses (Excluding TS) Licence Type: Retail Vendor Class 03 Licence Type Code: 21 Licence Class: 03 Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:					
Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: 905 Oper Phone No: 9672585 Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:					
93	12 of 13	ESE/181.7	79.8 / 0.00	1052900 ONTARIO INC./ROB'S NO FRILLS 99 LAKESHORE ROAD EAST PORT CREDIT ON L5G1E2	PES
Detail Licence No: Licence No: 09283 Status: Approval Date: Report Source: Licence Type: Licence Type Code: Licence Class: Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:					
Operator Box: Operator Class:					

225 erisinfo.com | Environmental Risk Information Services Order No: 25020500477

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	LBX2P5WQ			Contractor:	6607
Tag:	A264691			Form Version:	9
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY (PORT CREDIT)			
Site Info:		MW 19-3			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/734\7341861.pdf			

Well Completed Date: 08/22/2019
Year Completed: 2019
Depth (m): 8.2296
Latitude: 43.556027876375
Longitude: -79.5852289863524
X: -79.58522883596989
Y: 43.55602787366288
Path: 734\7341861.pdf

Bore Hole ID:	1007643258	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614271.00
Code OB Desc:		North83:	4823536.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	08/22/2019	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Formation ID:	1007643894
Layer:	1
Color:	6
General Color:	BROWN
Material 1:	34
Material 1 Desc:	TILL
Material 2:	
Material 2 Desc:	
Material 3:	
Material 3 Desc:	
Formation Top Depth:	0.0
Formation End Depth:	15.0

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007643895			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		34			
Material 1 Desc:		TILL			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		15.0			
Formation End Depth:		27.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007644465			
Layer:		2			
Plug From:		1.0			
Plug To:		16.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007644464			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007644310			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007643598			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007643462			
Casing No:		0			
Comment:					
Alt Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:		1007644028			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		17.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007644108			
Layer:		1			
Slot:		10			
Screen Top Depth:		17.0			
Screen End Depth:		27.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.5			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007643463			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007644210			
Diameter:		8.0			
Depth From:		0.0			
Depth To:		27.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>96</u>	1 of 1	ENE/183.8	79.8 / 0.00	FRAM GROUP (CANADA) INC Ann and High St Mississauga ON	SPL
Ref No:	0641-ARZQ9U			Municipality No:	
Year:				Nature of Damage:	
Incident Dt:	2017/10/10			Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:	2017/10/10			Impact to Health:	2 - Minor Environment

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Dt Document Closed:		Agency Involved:			
Site No:		NA			
MOE Response:		No			
Site County/District:		Regional Municipality of Peel			
Site Geo Ref Meth:					
Site District Office:		Halton-Peel			
Nearest Watercourse:		Lake Ontario			
Site Name:		spill<UNOFFICIAL>			
Site Address:		Ann and High St			
Site Region:		Central			
Site Municipality:		Mississauga			
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:		4823474			
Easting:		614413			
Entity Operating Name:					
Client Name:		FRAM GROUP (CANADA) INC			
Client Type:		Corporation			
Source Type:		Truck - Transport/Hauling			
Incident Cause:					
Incident Preceding Spill:		Leak/Break			
Incident Reason:		Operator/Human Error			
Incident Summary:		Fran Group discharge of cement washout of trucks			
Environment Impact:					
Health Env Consequence:					
Nature of Impact:					
Contaminant Qty:		20 L			
Contaminant Qty 1:		20			
Contaminant Unit:		L			
Contaminant Code:		28			
Contaminant Name:		WASHWATER (N.O.S.)			
Contaminant Limit 1:					
Contam Limit Freq 1:					
Contaminant UN No 1:		n/a			
Receiving Medium:		Surface Water			
Activity Preceding Spill:					
Property 2nd Watershed:					
Property Tertiary Watershed:					
Sector Type:		Miscellaneous Industrial			
SAC Action Class:		Land Spills			
Call Report Locatn Geodata:					
Time Reported:					
System Facility Address:					

97	1 of 1	WSW/185.8	79.8 / 0.00	21 Park Street East Port Credit ON	WWIS
Well ID:	7330663			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Not Used			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	04/09/2019
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	ODT55IAQ			Contractor:	7147
Tag:	A223407			Form Version:	9
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY (PORT CREDIT)			
Site Info:		MW 17-1			
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID:	1007353331			Tag No:	A223407
Depth M:				Contractor:	7147
Year Completed:	2019			Latitude:	43.5535401938583
Well Completed Dt:	01/18/2019			Longitude:	-79.5872061257248
Audit No:	ODT55IAQ			Y:	43.55354019134066
Path:				X:	-79.5872059762959
<u>Bore Hole Information</u>					
Bore Hole ID:	1007353331			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614116.00
Code OB Desc:				North83:	4823257.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	01/18/2019			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007353719				
Layer:	1				
Color:					
General Color:					
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:					
Formation End Depth UOM:	m				
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1007354046				
Layer:	1				
Plug From:	0.0				
Plug To:	6.699999809265137				
Plug Depth UOM:	m				
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		1007353960			
Layer:		1			
Plug From:		0.0			
Plug To:		2.5			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007353961			
Layer:		2			
Plug From:		2.5			
Plug To:		6.699999809265137			
Plug Depth UOM:		m			
<u>Pipe Information</u>					
Pipe ID:		1007353493			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007353810			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.5999999046325684			
Casing Diameter:		5.0			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007353872			
Layer:		1			
Slot:					
Screen Top Depth:		3.5999999046325684			
Screen End Depth:		6.699999809265137			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.300000190734863			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007353494			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pumping Test Method: Pumping Duration HR: Pumping Duration MIN: Flowing:					
98	1 of 1	NNE/185.8	79.8 / 0.00	ON	BORE
Borehole ID:		640929	Inclin FLG:		No
OGF ID:		215541324	SP Status:		Initial Entry
Status:			Surv Elev:		No
Type:		Borehole	Piezometer:		No
Use:		Geotechnical/Geological Investigation	Primary Name:		
Completion Date:		JAN-1965	Municipality:		
Static Water Level:			Lot:		
Primary Water Use:		Not Used	Township:		
Sec. Water Use:			Latitude DD:		43.555897
Total Depth m:		2.1	Longitude DD:		-79.584259
Depth Ref:		Ground Surface	UTM Zone:		17
Depth Elev:			Easting:		614350
Drill Method:		Power auger	Northing:		4823523
Orig Ground Elev m:		81.7	Location Accuracy:		
Elev Reliabil Note:			Accuracy:		Not Applicable
DEM Ground Elev m:		81.4			
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:		218494122	Mat Consistency:		
Top Depth:		0	Material Moisture:		
Bottom Depth:		.1	Material Texture:		
Material Color:			Non Geo Mat Type:		
Material 1:		Asphalt	Geologic Formation:		
Material 2:		Stones	Geologic Group:		
Material 3:			Geologic Period:		
Material 4:			Depositional Gen:		
Gsc Material Description:					
Stratum Description:		ASPHALT,STONES.			
Geology Stratum ID:		218494126	Mat Consistency:		
Top Depth:		.7	Material Moisture:		
Bottom Depth:		2.1	Material Texture:		
Material Color:			Non Geo Mat Type:		
Material 1:		Silt	Geologic Formation:		
Material 2:		Clay	Geologic Group:		
Material 3:		Sand	Geologic Period:		
Material 4:			Depositional Gen:		alluvial
Gsc Material Description:					
Stratum Description:		SILT,CLAY,SAND. ALLUVIAL,AGE POST-GLACIAL. SAND-M **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:		218494123	Mat Consistency:		
Top Depth:		.1	Material Moisture:		
Bottom Depth:		.2	Material Texture:		
Material Color:			Non Geo Mat Type:		
Material 1:		Fill	Geologic Formation:		
Material 2:		Gravel	Geologic Group:		
Material 3:			Geologic Period:		
Material 4:			Depositional Gen:		fill
Gsc Material Description:					
Stratum Description:		FILL,GRAVEL.			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Geology Stratum ID:	218494124			Mat Consistency:	
Top Depth:	.2			Material Moisture:	
Bottom Depth:	.4			Material Texture:	Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM,SILT, CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL.				
Geology Stratum ID:	218494125			Mat Consistency:	
Top Depth:	.4			Material Moisture:	
Bottom Depth:	.7			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	CLAY,SAND,SILT. ALLUVIAL,AGE POST-GLACIAL.				
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 088950 NTS_Sheet: 30M12A				
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.				
<u>Source List</u>					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
99	1 of 1	ENE/187.3	79.8 / 0.00	8 Ann St, 6 Ann St, 10 Ann St. Mississauga ON	EHS
Order No:	20110516026			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	5/18/2011			Search Radius (km):	0.25
Date Received:	5/16/2011 3:36:21 PM			X:	-79.583198
Previous Site Name:				Y:	43.555214
Lot/Building Size:					
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans				
100	1 of 1	N/187.4	78.8 / -1.00	78 PARK ST. E MISSISSAUGA ON	WWIS
Well ID:	7341823			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Final Well Status:	Observation Wells			Date Received:	09/16/2019
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	8MUQDAWX			Contractor:	6607
Tag:	A271784			Form Version:	9
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:	MW 19-2				
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/734\7341823.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	08/15/2019				
Year Completed:	2019				
Depth (m):	27.432				
Latitude:	43.5560515102986				
Longitude:	-79.5849560576027				
X:	-79.58495590810843				
Y:	43.5560515072503				
Path:	734\7341823.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1007643144			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614293.00
Code OB Desc:				North83:	4823539.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	08/15/2019			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007643794				
Layer:	1				
Color:	6				
General Color:	BROWN				
Material 1:	34				
Material 1 Desc:	TILL				
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:	0.0				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth:		15.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007643795			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		34			
Material 1 Desc:		TILL			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		15.0			
Formation End Depth:		27.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007643796			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		17			
Material 1 Desc:		SHALE			
Material 2:		15			
Material 2 Desc:		LIMESTONE			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		27.0			
Formation End Depth:		90.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007644272			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007644379			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007644380			
Layer:		2			
Plug From:		1.0			
Plug To:		85.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007643546			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007643547			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007643386			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007643994			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		85.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007644074			
Layer:		1			
Slot:		10			
Screen Top Depth:		85.0			
Screen End Depth:		90.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.5			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007643387			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Rate UOM: GPM Water State After Test Code: Water State After Test: Pumping Test Method: Pumping Duration HR: Pumping Duration MIN: Flowing:					
<u>Hole Diameter</u>					
Hole ID: 1007644161 Diameter: 4.0 Depth From: 30.0 Depth To: 90.0 Hole Depth UOM: ft Hole Diameter UOM: inch					
<u>Hole Diameter</u>					
Hole ID: 1007644160 Diameter: 8.0 Depth From: 0.0 Depth To: 30.0 Hole Depth UOM: ft Hole Diameter UOM: inch					
101	1 of 13	ESE/188.4	79.8 / 0.00	SEAWAY CLEANERS 111 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E2	GEN
<u>Generator Info</u>					
Generator No: ON0379301 Approval Years: 99,00,01 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: POWER LAUND./CLEANERS					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 9721					
<u>Waste Detail(s)</u>					
Waste Class: 241 Waste Class Name: HALOGENATED SOLVENTS					
101	2 of 13	ESE/188.4	79.8 / 0.00	ROSALNAAZ INVESTMENTS INC. 111 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E2	GEN
<u>Generator Info</u>					
Generator No: ON0379301 Approval Years: 02,03,04,05 Status: PO Box No: Country: Co Admin:					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 812320					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Phone No Admin: SIC Description: Dry Cleaning & Laundry Serv. (exc. Coin-Op.)					
<u>Waste Detail(s)</u>					
Waste Class: 241 Waste Class Name: HALOGENATED SOLVENTS					
101	3 of 13	ESE/188.4	79.8 / 0.00	2088466 Ontario Limited 111 lakeshore rd E Mississauga ON	GEN
<u>Generator Info</u>					
Generator No: ON4799677 Approval Years: 2013 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: DRY CLEANING AND LAUNDRY SERVICES (EXCEPT COIN-OPERATED)					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 812320					
<u>Waste Detail(s)</u>					
Waste Class: 251 Waste Class Name: OIL SKIMMINGS & SLUDGES					
<u>Waste Detail(s)</u>					
Waste Class: 262 Waste Class Name: DETERGENTS/SOAPS					
<u>Waste Detail(s)</u>					
Waste Class: 213 Waste Class Name: PETROLEUM DISTILLATES					
101	4 of 13	ESE/188.4	79.8 / 0.00	2088466 Ontario Limited 111 lakeshore rd E Mississauga ON L5G 1E2	GEN
<u>Generator Info</u>					
Generator No: ON4799677 Approval Years: 06,07,08 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: Dry Cleaning and Laundry Services (except Coin-Ope					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 812320					
<u>Waste Detail(s)</u>					
Waste Class: 213					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
<u>Waste Detail(s)</u>					
Waste Class:		262			
Waste Class Name:		DETERGENTS/SOAPS			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			

<u>101</u>	5 of 13	ESE/188.4	79.8 / 0.00	2088466 Ontario Limited 111 lakeshore rd E Mississauga ON	GEN

Generator Info

Generator No:	ON4799677	Choice of Contact:	
Approval Years:	2009	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	812320
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	Dry Cleaning and Laundry Services (except Coin-Operated)		

Waste Detail(s)

Waste Class:	213
Waste Class Name:	PETROLEUM DISTILLATES

Waste Detail(s)

Waste Class:	251
Waste Class Name:	OIL SKIMMINGS & SLUDGES

Waste Detail(s)

Waste Class:	262
Waste Class Name:	DETERGENTS/SOAPS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
101	6 of 13	ESE/188.4	79.8 / 0.00	2088466 Ontario Limited 111 lakeshore rd E Mississauga ON	GEN
<u>Generator Info</u>					
Generator No:	ON4799677			Choice of Contact:	
Approval Years:	2012			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	812320
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		Dry Cleaning and Laundry Services (except Coin-Operated)			
<u>Waste Detail(s)</u>					
Waste Class:	262				
Waste Class Name:	DETERGENTS/SOAPS				
<u>Waste Detail(s)</u>					
Waste Class:	251				
Waste Class Name:	OIL SKIMMINGS & SLUDGES				
<u>Waste Detail(s)</u>					
Waste Class:	213				
Waste Class Name:	PETROLEUM DISTILLATES				

101	7 of 13	ESE/188.4	79.8 / 0.00	2088466 Ontario Limited 111 lakeshore rd E Mississauga ON L5G 1E2	GEN
<u>Generator Info</u>					
Generator No:	ON4799677			Choice of Contact:	CO_OFFICIAL
Approval Years:	2015			Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	812320
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:		DRY CLEANING AND LAUNDRY SERVICES (EXCEPT COIN-OPERATED)			
<u>Waste Detail(s)</u>					
Waste Class:	262				
Waste Class Name:	DETERGENTS/SOAPS				
<u>Waste Detail(s)</u>					
Waste Class:	213				
Waste Class Name:	PETROLEUM DISTILLATES				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
101	8 of 13	ESE/188.4	79.8 / 0.00	2088466 Ontario Limited 111 lakeshore rd E Mississauga ON L5G 1E2	GEN
<u>Generator Info</u>					
Generator No:		ON4799677	Choice of Contact:		CO_OFFICIAL
Approval Years:		2016	Contaminated Fac:		No
Status:			MHSW Facility:		No
PO Box No:			SIC Code:		812320
Country:		Canada			
Co Admin:					
Phone No Admin:					
SIC Description:		DRY CLEANING AND LAUNDRY SERVICES (EXCEPT COIN-OPERATED)			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
<u>Waste Detail(s)</u>					
Waste Class:		262			
Waste Class Name:		DETERGENTS/SOAPS			
101	9 of 13	ESE/188.4	79.8 / 0.00	2088466 Ontario Limited 111 lakeshore rd E Mississauga ON L5G 1E2	GEN
<u>Generator Info</u>					
Generator No:		ON4799677	Choice of Contact:		CO_OFFICIAL
Approval Years:		2014	Contaminated Fac:		No
Status:			MHSW Facility:		No
PO Box No:			SIC Code:		812320
Country:		Canada			
Co Admin:					
Phone No Admin:					
SIC Description:		DRY CLEANING AND LAUNDRY SERVICES (EXCEPT COIN-OPERATED)			
<u>Waste Detail(s)</u>					
Waste Class:		262			
Waste Class Name:		DETERGENTS/SOAPS			
<u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: 213 Waste Class Name: PETROLEUM DISTILLATES Waste Detail(s) Waste Class: 251 Waste Class Name: OIL SKIMMINGS & SLUDGES					
101	10 of 13	ESE/188.4	79.8 / 0.00	2088466 Ontario Limited 111 lakeshore rd E Mississauga ON L5G 1E2	GEN
Generator Info Generator No: ON4799677 Approval Years: As of Dec 2018 Status: Registered PO Box No: Country: Canada Co Admin: Phone No Admin: SIC Description: Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:					
Waste Detail(s) Waste Class: 213 I Waste Class Name: Petroleum distillates Waste Detail(s) Waste Class: 213 L Waste Class Name: Petroleum distillates					
101	11 of 13	ESE/188.4	79.8 / 0.00	Seaway Cleaners 111 Lakeshore Rd E Mississauga ON L5G1E2	CDRY
Legal Name of Company: Region: Type of Reporter: Waste Quantity by Year Reporting Year: 2004 Quantity of PERC (kg): 234 Total Waste Water (kg): 0 Total Waste Water (L): - Total Residue (kg): 0 Total Residue (L): 162 Total Mix (kg): 0 Total Mix (L): - Request for Confidentiality: No Reason For Confidentiality: N/A					
101	12 of 13	ESE/188.4	79.8 / 0.00	2088466 Ontario Limited 111 lakeshore rd E Mississauga ON L5G 1E2	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON4799677			Choice of Contact:	
Approval Years:	As of Jul 2020			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:	213 L				
Waste Class Name:	Petroleum distillates				
<u>Waste Detail(s)</u>					
Waste Class:	213 I				
Waste Class Name:	Petroleum distillates				
101	13 of 13	ESE/188.4	79.8 / 0.00	2088466 Ontario Limited 111 lakeshore rd E Mississauga ON L5G 1E2	GEN
<u>Generator Info</u>					
Generator No:	ON4799677			Choice of Contact:	
Approval Years:	As of Jan 2021			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:	213 L				
Waste Class Name:	Petroleum distillates				
<u>Waste Detail(s)</u>					
Waste Class:	213 I				
Waste Class Name:	Petroleum distillates				
<u>2017 Generator Info</u>					
Gen No:	ON4799677			Choice of Contact:	CO_OFFICIAL
ID:	19056			Phone No Official:	9052743116 Ext.
Contaminated Fac:	N			Phone No Admin:	
MHSW Facility:	N			County Ont:	PEEL (R. M.)
NAICS Code1:	812320			County Out:	
NAICS Code2:				District:	305
NAICS Code3:					
Gen Name:	2088466 Ontario Limited				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Gen Div:					
Gen Op Name:		seaway cleaner			
Gen Op Div:					
Site Adrs1:		111 lakeshore rd E			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Mississauga			
Province Out:					
Site Postal Code:		L5G 1E2			
Site Country:		Canada			
Co Official:		Tak-Jong Yoo			
Co Admin:					
<u>2017 Generator Manifest</u>					
ID: 42890					
Generator No:		ON4799677		Sum Received Qty: 114.0	
Receiver Type:		035		Waste Class Name: PETROLEUM DISTILLATES	
Waste Char:		L		Count Manifests: 1	
Waste Code:		213		District: 305	
<u>2018 Generator Info</u>					
Gen No:		ON4799677		Choice of Contact: CO_OFFICIAL	
ID:		19135		Phone No Official: 9052743116 Ext.	
Contaminated Fac:		N		Phone No Admin:	
MHSW Facility:		N		County Ont: PEEL (R. M.)	
NAICS Code1:		812320		County Out:	
NAICS Code2:				District: 305	
NAICS Code3:					
Gen Name:		2088466 Ontario Limited			
Gen Div:					
Gen Op Name:		seaway cleaner			
Gen Op Div:					
Site Adrs1:		111 lakeshore rd E			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Mississauga			
Province Out:					
Site Postal Code:		L5G 1E2			
Site Country:		Canada			
Co Official:		Tak-Jong Yoo			
Co Admin:					
<u>2019 Generator Info</u>					
Gen No:		ON4799677		Choice of Contact: CO_OFFICIAL	
ID:		19120		Phone No Official: 9052743116 Ext.	
Contaminated Fac:		N		Phone No Admin:	
MHSW Facility:		N		County Ont: PEEL (R. M.)	
NAICS Code1:		812320		County Out:	
NAICS Code2:				District: 305	
NAICS Code3:					
Gen Name:		2088466 Ontario Limited			
Gen Div:					
Gen Op Name:		seaway cleaner			
Gen Op Div:					
Site Adrs1:		111 lakeshore rd E			
Site Bldg:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Pobox: Province In: ONTARIO Site Adrs2: Site City: Mississauga Province Out: Site Postal Code: L5G 1E2 Site Country: Canada Co Official: Tak-Jong Yoo Co Admin:					
<u>2020 Generator Info</u>					
Gen No: ON4799677 ID: 18819 Contaminated Fac: N MHSW Facility: N NAICS Code1: 812320 NAICS Code2: NAICS Code3: Gen Name: 2088466 Ontario Limited Gen Div: Gen Op Name: seaway cleaner Gen Op Div: Site Adrs1: 111 lakeshore rd E Site Bldg: Site Pobox: Province In: ONTARIO Site Adrs2: Site City: Mississauga Province Out: Site Postal Code: L5G 1E2 Site Country: Canada Co Official: Tak-Jong Yoo Co Admin:					
Choice of Contact: CO_OFFICIAL Phone No Official: 9052743116 Ext. Phone No Admin: County Ont: PEEL (R. M.) County Out: District: 305					
<u>2020 Generator Manifest</u>					
ID: 39077 Generator No: ON4799677 Receiver Type: 035 Waste Char: L Waste Code: 213 Sum Received Qty: 110.0 Waste Class Name: PETROLEUM DISTILLATES Count Manifests: 1 District: 305					
<u>102</u>	1 of 1	NNW/189.6	78.8 / -1.00	23 Helene St N Mississauga ON L5G 3B6	EHS
Order No: 22091501030 Status: C Report Type: Custom Report Report Date: 20-SEP-22 Date Received: 15-SEP-22 Previous Site Name: Lot/Building Size: Additional Info Ordered: City Directory Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.58598554 Y: 43.55598644					
<u>103</u>	1 of 1	WNW/189.9	78.8 / -1.00	ON	BORE
Borehole ID: 640918 OGF ID: 215541313 Status: Type: Borehole Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Use: Completion Date: Static Water Level: Primary Water Use: Sec. Water Use: Total Depth m: Depth Ref: Depth Elev: Drill Method: Orig Ground Elev m: Elev Reliabil Note: DEM Ground Elev m: Concession: Location D: Survey D: Comments:	Geotechnical/Geological Investigation JAN-1965 Not Used 2.1 Ground Surface Power auger 86.9 83.3			Primary Name: Municipality: Lot: Township: Latitude DD: Longitude DD: UTM Zone: Easting: Northing: Location Accuracy: Accuracy:	43.555437 -79.587055 17 614125 4823468 Not Applicable
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218494069 .1 .3 Brown Fill Gravel Gsc Material Description: FILL, GRAVEL. BROWN.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	fill
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218494070 .3 2.1 Brown Sand Silt Clay Gsc Material Description: SAND, SILT, CLAY. BROWN, ALLUVIAL, AGE POST-GLACIAL. SAND			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	alluvial **Note: Many records provided by the department have a truncated [Stratum Description] field.
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218494068 0 .1 Asphalt ASPHALT.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	
<u>Source</u>					
Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	Data Survey Geological Survey of Canada 1956-1972 M Urban Geology Automated Information System (UGAIS) File: TOR1B.txt RecordID: 088840 NTS_Sheet: 30M12A Logs are approximately correct. Lack of information. Doubtful terminology.			Source Appl: Source Iden: Scale or Res: Horizontal: Verticalda:	Spatial/Tabular 1 Varies NAD27 Mean Average Sea Level

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
104	1 of 2	NE/190.0	79.8 / 0.00	Park Street & Hurontario Street Mississauga ON	WWIS
Well ID:	7398227			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	09/16/2021
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	NVQY737Z			Contractor:	7472
Tag:	A333817			Form Version:	9
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/739\7398227.pdf				
Additional Detail(s) (Map)					
Well Completed Date:	07/08/2021				
Year Completed:	2021				
Depth (m):	15.24				
Latitude:	43.5557676715868				
Longitude:	-79.5838484416766				
X:	-79.58384829202882				
Y:	43.55576766967177				
Path:	739\7398227.pdf				
Bore Hole Information					
Bore Hole ID:	1008786626			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614383.00
Code OB Desc:				North83:	4823509.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	07/08/2021			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Revision Comment: Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008787012			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		79			
Material 3 Desc:		PACKED			
Formation Top Depth:		4.0			
Formation End Depth:		25.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008787013			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		17			
Material 1 Desc:		SHALE			
Material 2:					
Material 2 Desc:					
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		25.0			
Formation End Depth:		50.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008787011			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		01			
Material 1 Desc:		FILL			
Material 2:					
Material 2 Desc:					
Material 3:		77			
Material 3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		4.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008787346			
Layer:		2			
Plug From:		39.0			
Plug To:		50.0			
Plug Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008787345			
Layer:		1			
Plug From:		0.0			
Plug To:		39.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008787264			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1008786828			
Method Construction Code:		E			
Method Construction:		Auger			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1008786749			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1008787105			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		40.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1008787155			
Layer:		1			
Slot:		10			
Screen Top Depth:		40.0			
Screen End Depth:		50.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.5			
<u>Results of Well Yield Testing</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pumping Test Method Desc: Pump Test ID: 1008786750 Pump Set At: Static Level: Final Level After Pumping: Recommended Pump Depth: Pumping Rate: Flowing Rate: Recommended Pump Rate: Levels UOM: ft Rate UOM: GPM Water State After Test Code: Water State After Test: Pumping Test Method: Pumping Duration HR: Pumping Duration MIN: Flowing:					
Hole Diameter					
Hole ID: 1008787207 Diameter: 7.5 Depth From: 0.0 Depth To: 50.0 Hole Depth UOM: ft Hole Diameter UOM: inch					
104	2 of 2	NE/190.0	79.8 / 0.00	Park Street & Hurontario Street Mississauga ON	WWIS
Well ID: 7398228 Construction Date: Use 1st: Monitoring Use 2nd: Final Well Status: Observation Wells Water Type: Casing Material: Audit No: ZVNHUGCW Tag: A333802 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: MISSISSAUGA CITY (PORT CREDIT) Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 09/16/2021 Selected Flag: TRUE Abandonment Rec: Contractor: 7472 Form Version: 9 Owner: County: PEEL Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/739\7398228.pdf					
Additional Detail(s) (Map)					
Well Completed Date: 07/08/2021 Year Completed: 2021 Depth (m): 6.096 Latitude: 43.5557676715868 Longitude: -79.5838484416766 X: -79.58384829202882 Y: 43.55576766967177 Path: 739\7398228.pdf					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Bore Hole Information</u>					
Bore Hole ID:	1008786629			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614383.00
Code OB Desc:				North83:	4823509.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	07/08/2021			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1008787015				
Layer:	2				
Color:	2				
General Color:	GREY				
Material 1:	05				
Material 1 Desc:	CLAY				
Material 2:	06				
Material 2 Desc:	SILT				
Material 3:	79				
Material 3 Desc:	PACKED				
Formation Top Depth:	4.0				
Formation End Depth:	20.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1008787014				
Layer:	1				
Color:	6				
General Color:	BROWN				
Material 1:	01				
Material 1 Desc:	FILL				
Material 2:					
Material 2 Desc:					
Material 3:	77				
Material 3 Desc:	LOOSE				
Formation Top Depth:	0.0				
Formation End Depth:	4.0				
Formation End Depth UOM:	ft				
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1008787265				
Layer:	1				
Plug From:					
Plug To:					
Plug Depth UOM:	ft				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008787348			
Layer:		2			
Plug From:		9.0			
Plug To:		20.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008787347			
Layer:		1			
Plug From:		0.0			
Plug To:		9.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1008786829			
Method Construction Code:		E			
Method Construction:		Auger			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1008786751			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1008787106			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		10.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1008787156			
Layer:		1			
Slot:		10			
Screen Top Depth:		10.0			
Screen End Depth:		20.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.5			
<u>Results of Well Yield Testing</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pumping Test Method Desc:					
Pump Test ID:		1008786752			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
Hole Diameter					
Hole ID:		1008787208			
Diameter:		7.5			
Depth From:		0.0			
Depth To:		20.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			

105	1 of 1	SE/190.5	79.8 / 0.00	99 LAKESHORE RD PORT CREDIT ON	WWIS
Well ID:	7211007			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	11/08/2013
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z179108			Contractor:	7472
Tag:	A155432			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/721\7211007.pdf				

Additional Detail(s) (Map)					
Well Completed Date:	05/06/2013				
Year Completed:	2013				
Depth (m):	12.1				
Latitude:	43.5530733218835				
Longitude:	-79.5836763244266				
X:	-79.58367617421393				
Y:	43.55307331932834				
Path:	721\7211007.pdf				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Bore Hole Information</u>					
Bore Hole ID:	1004629409			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614402.00
Code OB Desc:				North83:	4823210.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	05/06/2013			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1004889436				
Layer:	2				
Color:	2				
General Color:	GREY				
Material 1:	17				
Material 1 Desc:	SHALE				
Material 2:	05				
Material 2 Desc:	CLAY				
Material 3:	73				
Material 3 Desc:	HARD				
Formation Top Depth:	6.0				
Formation End Depth:	12.100000381469727				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1004889435				
Layer:	1				
Color:	6				
General Color:	BROWN				
Material 1:	08				
Material 1 Desc:	FINE SAND				
Material 2:	66				
Material 2 Desc:	DENSE				
Material 3:					
Material 3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:	6.0				
Formation End Depth UOM:	m				
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1004889443				
Layer:	1				
Plug From:	0.0				
Plug To:	8.5				
Plug Depth UOM:	m				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004889444			
Layer:		2			
Plug From:		8.5			
Plug To:		12.100000381469727			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1004889442			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1004889434			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1004889439			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		9.100000381469727			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1004889440			
Layer:		1			
Slot:		10			
Screen Top Depth:		9.100000381469727			
Screen End Depth:		12.100000381469727			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.400000095367432			
<u>Water Details</u>					
Water ID:		1004889438			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole ID:		1004889437			
Diameter:		21.0			
Depth From:		0.0			
Depth To:		12.100000381469727			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
106	1 of 1	N/191.2	78.8 / -1.00	78 Park St E Mississauga ON	WWIS
Well ID:		7390272		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Test Hole		Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:		Abandoned-Other		Date Received:	
Water Type:				06/18/2021	
Casing Material:				Selected Flag:	
Audit No:		Z346504		TRUE	
Tag:				Abandonment Rec:	
Constructn Method:				Yes	
Elevation (m):				Contractor:	
Elevatn Reliability:				7215	
Depth to Bedrock:				Form Version:	
Well Depth:				7	
Overburden/Bedrock:				Owner:	
Pump Rate:				County:	
Static Water Level:				PEEL	
Clear/Cloudy:				Lot:	
Municipality:		MISSISSAUGA CITY (PORT CREDIT)		Concession:	
Site Info:				Concession Name:	
				Easting NAD83:	
				Northing NAD83:	
				Zone:	
				UTM Reliability:	
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/739\7390272.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		04/19/2021			
Year Completed:		2021			
Depth (m):					
Latitude:		43.556087822575			
Longitude:		-79.5849799691683			
X:		-79.58497981945385			
Y:		43.556087820546765			
Path:		739\7390272.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1008700557		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				17	
Code OB Desc:				East83:	
Open Hole:				614291.00	
Cluster Kind:				North83:	
Date Completed:		04/19/2021		4823543.00	
Remarks:				Org CS:	
Location Method Desc:		on Water Well Record		UTM83	
Elevrc Desc:				UTMRC:	
Location Source Date:				4	
Improvement Location Source:				UTMRC Desc:	
Improvement Location Method:				margin of error : 30 m - 100 m	
Source Revision Comment:				Location Method:	
Supplier Comment:				wwr	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1009907855			
Layer:		1			
Plug From:		0.0			
Plug To:		90.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1009907856			
Layer:		1			
Plug From:		0.0			
Plug To:		90.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1009908613			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1009766216			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1009908928			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		80.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1009909115			
Layer:		1			
Slot:		10			
Screen Top Depth:		80.0			
Screen End Depth:		90.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		Inch			
Screen Diameter:		2.0			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pump Test ID: 1009909616 Pump Set At: Static Level: Final Level After Pumping: Recommended Pump Depth: Pumping Rate: Flowing Rate: Recommended Pump Rate: Levels UOM: ft Rate UOM: GPM Water State After Test Code: Water State After Test: Pumping Test Method: 0 Pumping Duration HR: Pumping Duration MIN: Flowing:					
<u>Water Details</u>					
Water ID: 1009909345 Layer: 1 Kind Code: 8 Kind: Untested Water Found Depth: 20.0 Water Found Depth UOM: ft					
107	1 of 1	WSW/191.5	79.8 / 0.00	ON	WWIS
Well ID: 7296325 Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: C38357 Tag: A223407 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: MISSISSAUGA CITY (PORT CREDIT) Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Yes Data Src: Date Received: 10/03/2017 Selected Flag: TRUE Abandonment Rec: Contractor: 7147 Form Version: 8 Owner: County: PEEL Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID: 1006747711 Depth M: Year Completed: Well Completed Dt: Audit No: C38357 Path:					
Tag No: A223407 Contractor: 7147 Latitude: 43.5535321101623 Longitude: -79.5872805957956 Y: 43.55353210742255 X: -79.58728044571166					
<u>Bore Hole Information</u>					
Bore Hole ID: 1006747711 Elevation:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: Remarks: Location Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
Elevrc: Zone: 17 East83: 614110.00 North83: 4823256.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					
108	1 of 1	S/191.6	79.8 / 0.00	13 Stavebank Road NORTH Mississauga ON	SPL
Ref No: 1061-8MANGF Year: Incident Dt: 10/3/2011 Dt MOE Arvl on Scn: MOE Reported Dt: 10/3/2011 Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Private residence<UNOFFICIAL> Site Address: 13 Stavebank Road NORTH Site Region: Site Municipality: Mississauga Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: Discharge Or Bypass To A Watercourse Incident Preceding Spill: Incident Reason: Negligence (Apparent) - Caused by lack of diligence Incident Summary: Private residence pumped flooded basement to CB on street. Environment Impact: Confirmed Health Env Consequence: Nature of Impact: Soil Contamination; Surface Water Pollution Contaminant Qty: Contaminant Qty 1: Contaminant Unit: other - see incident description Contaminant Code: 44 Contaminant Name: SEWAGE,RAW UNCHLORINATED Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Other					
Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SAC Action Class:		Watercourse Spills			
Call Report Locatn Geodata:					
Time Reported:					
System Facility Address:					
109	1 of 1	ESE/191.8	79.8 / 0.00	103 LAKESHORE RD E Mississauga ON	WWIS
Well ID:		7187902		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring and Test Hole		Data Entry Status:	
Use 2nd:		0		Data Src:	
Final Well Status:		Test Hole		Date Received: 09/24/2012	
Water Type:				Selected Flag: TRUE	
Casing Material:				Abandonment Rec:	
Audit No:		Z156841		Contractor: 7241	
Tag:		A137099		Form Version: 7	
Constructn Method:				Owner:	
Elevation (m):				County: PEEL	
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY (PORT CREDIT)			
Site Info:		WKQ-005210			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/718\7187902.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		08/17/2012			
Year Completed:		2012			
Depth (m):		4.572			
Latitude:		43.5537403018852			
Longitude:		-79.5830045484876			
X:		-79.58300439802993			
Y:		43.55374029927089			
Path:		718\7187902.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1004163420		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone: 17	
Code OB:				East83: 614455.00	
Code OB Desc:				North83: 4823285.00	
Open Hole:				Org CS: UTM83	
Cluster Kind:				UTMRC: 4	
Date Completed:		08/17/2012		UTMRC Desc: margin of error : 30 m - 100 m	
Remarks:				Location Method: wwr	
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004442192			
Layer:		3			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		6.0			
Formation End Depth:		8.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004442191			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		34			
Material 1 Desc:		TILL			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		4.0			
Formation End Depth:		6.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004442190			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		01			
Material 1 Desc:		FILL			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		4.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004442193			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		91			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3 Desc:		WATER-BEARING			
Formation Top Depth:		8.0			
Formation End Depth:		15.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004442203			
Layer:		3			
Plug From:		1.0			
Plug To:		0.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004442202			
Layer:		2			
Plug From:		4.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004442201			
Layer:		1			
Plug From:		15.0			
Plug To:		4.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1004442200			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1004442189			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1004442196			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		5.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen ID:		1004442197			
Layer:		1			
Slot:		10			
Screen Top Depth:		5.0			
Screen End Depth:		15.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.25			
 <u>Water Details</u>					
Water ID:		1004442195			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
 <u>Hole Diameter</u>					
Hole ID:		1004442194			
Diameter:		4.25			
Depth From:		0.0			
Depth To:		15.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
110	1 of 1	SW/193.0	79.8 / 0.00	ON	BORE
Borehole ID:	640868			Inclin FLG:	No
OGF ID:	215541263			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.552909
Total Depth m:	2.7			Longitude DD:	-79.586496
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614175
Drill Method:	Power auger			Northing:	4823188
Orig Ground Elev m:	82.8			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	82.2				
Concession:					
Location D:					
Survey D:					
Comments:					
 <u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218493858			Mat Consistency:	
Top Depth:	.2			Material Moisture:	
Bottom Depth:	1.5			Material Texture:	Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 4: Gsc Material Description: Stratum Description:				Depositional Gen:	alluvial
SAND-MEDIUM,SILT, CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL.					
Geology Stratum ID:	218493857			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:		FILL,GRAVEL.			
Geology Stratum ID:	218493859			Mat Consistency:	
Top Depth:	1.5			Material Moisture:	
Bottom Depth:	2.7			Material Texture:	Medium
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:		SAND-MEDIUM,SILT, CLAY. GREY,ALLUVIAL, AGE POST-GLACIAL. VIAL, **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 088340 NTS_Sheet: 30M12A				
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.				
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
111	1 of 1	WNW/195.9	78.8 / -1.00	ON	BORE
Borehole ID:	640919			Inclin FLG:	No
OGF ID:	215541314			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.555081
Total Depth m:	2.1			Longitude DD:	-79.587435
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614095
Drill Method:	Power auger			Northing:	4823428

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Orig Ground Elev m: Elev Reliabil Note: DEM Ground Elev m: Concession: Location D: Survey D: Comments:	83.4 83.5			Location Accuracy: Accuracy:	Not Applicable
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218494071 0 .1 Asphalt			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218494072 .1 2.1 Brown Silt Sand Clay			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Medium alluvial
SILT,SAND-MEDIUM, CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL. -GLACIAL **Note: Many records provided by the department have a truncated [Stratum Description] field.					
<u>Source</u>					
Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	Data Survey Geological Survey of Canada 1956-1972 M Urban Geology Automated Information System (UGAIS) File: TOR1B.txt RecordID: 088850 NTS_Sheet: 30M12A Logs are approximately correct. Lack of information. Doubtful terminology.			Source Appl: Source Iden: Scale or Res: Horizontal: Verticalda:	Spatial/Tabular 1 Varies NAD27 Mean Average Sea Level
<u>Source List</u>					
Source Identifier: Source Type: Source Date: Scale or Resolution: Source Name: Source Originators:	1 Data Survey 1956-1972 Varies Urban Geology Automated Information System (UGAIS) Geological Survey of Canada			Horizontal Datum: Vertical Datum: Projection Name:	NAD27 Mean Average Sea Level Universal Transverse Mercator
112	1 of 1	SSW/197.6	79.8 / 0.00	ON	BORE
Borehole ID: OGF ID: Status: Type: Use: Completion Date:	640871 215541266 Borehole Geotechnical/Geological Investigation JAN-1965			Inclin FLG: SP Status: Surv Elev: Piezometer: Primary Name: Municipality:	No Initial Entry No No

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Static Water Level:					
Primary Water Use:	Not Used			Lot:	
Sec. Water Use:				Township:	
Total Depth m:	1.8			Latitude DD:	43.552677
Depth Ref:	Ground Surface			Longitude DD:	-79.585944
Depth Elev:				UTM Zone:	17
Drill Method:	Power auger			Easting:	614220
Orig Ground Elev m:	81.3			Northing:	4823163
Elev Reliabil Note:				Location Accuracy:	
DEM Ground Elev m:	81.2			Accuracy:	Not Applicable
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218493868			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ASPHALT.				
Geology Stratum ID:	218493869			Mat Consistency:	
Top Depth:	.2			Material Moisture:	
Bottom Depth:	.3			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL, GRAVEL.				
Geology Stratum ID:	218493870			Mat Consistency:	
Top Depth:	.3			Material Moisture:	
Bottom Depth:	1.8			Material Texture:	Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM, SILT, CLAY. BROWN, ALLUVIAL, AGE POST-GLACIAL. D-M				**Note: Many records provided by the department have a truncated [Stratum Description] field.
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 088370 NTS_Sheet: 30M12A				
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.				
<u>Source List</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
113	1 of 1	NW/197.9	78.8 / -1.00	ON	BORE
Borehole ID:	640917			Inclin FLG:	No
OGF ID:	215541312			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.555836
Total Depth m:	2.1			Longitude DD:	-79.586613
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614160
Drill Method:	Power auger			Northing:	4823513
Orig Ground Elev m:	82			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	81.9				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218494065			Mat Consistency:	
Top Depth:	.3			Material Moisture:	
Bottom Depth:	.9			Material Texture:	Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM,CLAY, SILT. BROWN,ALLUVIAL, AGE POST-GLACIAL.				
Geology Stratum ID:	218494064			Mat Consistency:	
Top Depth:	.2			Material Moisture:	
Bottom Depth:	.3			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND,SILT,CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL.				
Geology Stratum ID:	218494066			Mat Consistency:	
Top Depth:	.9			Material Moisture:	
Bottom Depth:	1.5			Material Texture:	Medium
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Gsc Material Description:					
Stratum Description:		SAND-MEDIUM,SILT, CLAY. ALLUVIAL,AGE POST-GLACIAL.			
Geology Stratum ID:	218494062			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		ASPHALT.			
Geology Stratum ID:	218494063			Mat Consistency:	
Top Depth:	.1			Material Moisture:	
Bottom Depth:	.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:	Sand			Geologic Period:	
Material 4:	Silt			Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:		FILL,GRAVEL,SAND, SILT.			
Geology Stratum ID:	218494067			Mat Consistency:	
Top Depth:	1.5			Material Moisture:	
Bottom Depth:	2.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:		SAND,SILT,CLAY. ALLUVIAL,AGE POST-GLACIAL.			
Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 088830 NTS_Sheet: 30M12A				
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.				
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
114	1 of 2	WSW/199.0	79.8 / 0.00	MISSISSAUGA HYDRO PCB 12 PARK ST. EAST C/O 3355 MAVIS RD. MISSISSAUGA ON L5G 1L5	GEN

Generator Info

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON0124334 Approval Years: 90 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: *** NOT DEFINED ***					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 0000					
114	2 of 2	WSW/199.0	79.8 / 0.00	MISSISSAUGA HYDRO PCB 00-000 12 PARK ST. EAST C/O 3355 MAVIS RD. MISSISSAUGA ON L5G 1L5	GEN
Generator Info					
Generator No: ON0124334 Approval Years: 92,93,94 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: *** NOT DEFINED ***					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 0000					
115	1 of 1	NE/199.8	79.8 / 0.00	10 WEST GO GP INC. AS GENERAL PARTNER BY AND ON BEHALF OF 10 WEST GO LP 17 ANN STREET ON Mississauga ON	RSC
RSC No: 235951 RA No: Status: FILED Filing Date: Date Ack: Date Returned: Approval Date: January 18, 2023 Cert Date: Cert Prop Use No: Curr Property Use: Intended Prop Use: Restoration Type: Soil Type: Criteria: Stratified (Y/N): Audit (Y/N): Entire Leg Prop. (Y/N): CPU Issu Sect 1686: Business Name: 10 WEST GO GP INC. AS GENERAL PARTNER BY AND ON BEHALF OF 10 WEST GO LP Address: 17 ANN STREET ON Legal Desc: Site Pin: 13463-0015 (LT), 13463-0016 (LT), 13463-0034 (LT), 13463-0035 (LT) Asmt Roll No: Project Type: POST2011 Approval Type: RSC based on Phase One and Two ESAs Applicable Standards: PDF Link: https://www.accessenvironment.ene.gov.on.ca/AEWeb/ae/ViewDocument.action?documentRefID=235951					
X: -79.5836954891579 Y: 43.55595486133799 Latitude: 43.55595486 Longitude: -79.58369549 UTM Coordinates: Latitude Longitude: Accuracy Estimate: Measurement Method: Mailing Address: Telephone: Fax: Email: Postal Code: L5G 3E9 Ministry District: MOE District: Halton-Peel SWP Area Name: Credit Valley Qual Person Name: SAMUEL LEE					
116	1 of 3	ESE/200.4	79.8 / 0.00	Sungalia G Dr 115 Lakeshore Rd E	SCT

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mississauga ON L5G 1E5					
Established: Plant Size (ft²): Employment:					
116	2 of 3	ESE/200.4	79.8 / 0.00	Waterside Dental 115 Lakeshore Rd E Mississauga ON L5G 1E5	SCT
Established: Plant Size (ft²): Employment:		01-MAY-91			
--Details--					
Description:		Offices of Dentists			
SIC/NAICS Code:		621210			
116	3 of 3	ESE/200.4	79.8 / 0.00	115 Lakeshore Road East Mississauga ON L5G 1E5	EHS
Order No:		20190927220	Nearest Intersection:		
Status:		C	Municipality:		Mississauga
Report Type:		Custom Report	Client Prov/State:		ON
Report Date:		02-OCT-19	Search Radius (km):		.05
Date Received:		27-SEP-19	X:		-79.582754
Previous Site Name:			Y:		43.553868
Lot/Building Size:		766 sq m			
Additional Info Ordered:		City Directory			
117	1 of 1	ENE/200.7	79.8 / 0.00	ON	BORE
Borehole ID:		640927	Inclin FLG:		No
OGF ID:		215541322	SP Status:		Initial Entry
Status:			Surv Elev:		No
Type:		Borehole	Piezometer:		No
Use:		Geotechnical/Geological Investigation	Primary Name:		
Completion Date:		JAN-1965	Municipality:		
Static Water Level:			Lot:		
Primary Water Use:		Not Used	Township:		
Sec. Water Use:			Latitude DD:		43.555161
Total Depth m:		1.5	Longitude DD:		-79.582976
Depth Ref:		Ground Surface	UTM Zone:		17
Depth Elev:			Easting:		614455
Drill Method:		Power auger	Northing:		4823443
Orig Ground Elev m:		80.2	Location Accuracy:		
Elev Reliabil Note:			Accuracy:		Not Applicable
DEM Ground Elev m:		79.9			
Concession:					
Location D:					
Survey D:					
Comments:					
Borehole Geology Stratum					
Geology Stratum ID:		218494113	Mat Consistency:		
Top Depth:		.1	Material Moisture:		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	.2 Fill Gravel			Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	fill
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218494115 .4 1.5 Brown Sand Clay			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Medium alluvial
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218494112 0 .1 Asphalt			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218494114 .2 .4 Brown Sand Silt Clay			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Medium alluvial
Source					
Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	Data Survey Geological Survey of Canada 1956-1972 M			Source Appl: Source Iden: Scale or Res: Horizontal: Verticalda:	Spatial/Tabular 1 Varies NAD27 Mean Average Sea Level
Source Name: Source Details: Confiden 1:	Urban Geology Automated Information System (UGAIS) File: TOR1B.txt RecordID: 088930 NTS_Sheet: 30M12A Logs are approximately correct. Lack of information. Doubtful terminology.				
Source List					
Source Identifier: Source Type: Source Date: Scale or Resolution: Source Name: Source Originators:	1 Data Survey 1956-1972 Varies Urban Geology Automated Information System (UGAIS) Geological Survey of Canada			Horizontal Datum: Vertical Datum: Projection Name:	NAD27 Mean Average Sea Level Universal Transverse Mercator

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
118	1 of 1	SSE/201.4	79.8 / 0.00	15 STAVEBANK ROAD SOUTH MISSISSAUGA ON	WWIS
Well ID: 7046642 Construction Date: Use 1st: Use 2nd: Final Well Status: Observation Wells Water Type: Casing Material: Audit No: Z74027 Tag: A061569 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: MISSISSAUGA CITY Site Info: Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 07/17/2007 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 3 Owner: County: PEEL Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7046642.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		06/26/2007			
Year Completed:		2007			
Depth (m):		5.79			
Latitude:		43.5527282443794			
Longitude:		-79.584167228533			
X:		-79.58416707913632			
Y:		43.552728241570996			
Path:		704\7046642.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		23046642		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone: 17	
Code OB:				East83: 614363.00	
Code OB Desc:				North83: 4823171.00	
Open Hole:				Org CS: UTM83	
Cluster Kind:				UTMRC: 3	
Date Completed:		06/26/2007		UTMRC Desc: margin of error : 10 - 30 m	
Remarks:				Location Method: wwr	
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		30146642			
Layer:		1			
Color:		6			
General Color:		BROWN			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 1:		01			
Material 1 Desc:		FILL			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		2.130000114440918			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		30246642			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		08			
Material 3 Desc:		FINE SAND			
Formation Top Depth:		2.130000114440918			
Formation End Depth:		3.3499999046325684			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		30346642			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		05			
Material 3 Desc:		CLAY			
Formation Top Depth:		3.3499999046325684			
Formation End Depth:		5.789999961853027			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		44001319			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		2.440000057220459			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		44001318			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		44001317			
Layer:		3			
Plug From:		2.440000057220459			
Plug To:		5.789999961853027			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		25946642			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		29046642			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		42146642			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		2.740000009536743			
Casing Diameter:		3.809999942779541			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		43146642			
Layer:		1			
Slot:		10			
Screen Top Depth:		2.740000009536743			
Screen End Depth:		5.789999961853027			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:					
<u>Hole Diameter</u>					
Hole ID:		46000809			
Diameter:		8.890000343322754			
Depth From:		0.0			
Depth To:		5.789999961853027			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
119	1 of 1	ESE/201.6	79.8 / 0.00	ON	BORE
Borehole ID:	640934		Inclin FLG:	No	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
OGF ID:	215541329			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.553719
Total Depth m:	2.7			Longitude DD:	-79.582886
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614465
Drill Method:	Power auger			Northing:	4823283
Orig Ground Elev m:	78.3			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	78.5				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218494147			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	0			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ASPHALT.				
Geology Stratum ID:	218494151			Mat Consistency:	
Top Depth:	.3			Material Moisture:	
Bottom Depth:	.6			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND,SILT,CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL.				
Geology Stratum ID:	218494153			Mat Consistency:	
Top Depth:	1.2			Material Moisture:	
Bottom Depth:	2.4			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Silt			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SILT,SAND,CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL.				
Geology Stratum ID:	218494148			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL,GRAVEL.				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Geology Stratum ID:	218494152			Mat Consistency:	
Top Depth:	.6			Material Moisture:	
Bottom Depth:	1.2			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Silt			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SILT,SAND,CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL.				
Geology Stratum ID:	218494150			Mat Consistency:	
Top Depth:	.2			Material Moisture:	
Bottom Depth:	.3			Material Texture:	
Material Color:	Black			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND,SILT,CLAY. BLACK,ALLUVIAL, AGE POST-GLACIAL.				
Geology Stratum ID:	218494149			Mat Consistency:	
Top Depth:	.1			Material Moisture:	
Bottom Depth:	.2			Material Texture:	Medium
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM,SILT, CLAY. ALLUVIAL,AGE POST-GLACIAL.				
Geology Stratum ID:	218494154			Mat Consistency:	
Top Depth:	2.4			Material Moisture:	
Bottom Depth:	2.7			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Sand			Geologic Period:	
Material 4:	Clay			Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	TILL,SILT,SAND,CLAY.GREY,GLACIAL,AGE GLACIAL.				
Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 089000 NTS_Sheet: 30M12A				
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.				
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
120	1 of 5	ESE/201.8	79.8 / 0.00	Doyle Botterell Sailmakers 117 Lakeshore Rd E Suite 336 Mississauga ON L5G 4T6	SCT
Established:		1991			
Plant Size (ft²):		5			
Employment:					
--Details--					
Description:		Textile Bag and Canvas Mills			
SIC/NAICS Code:		314910			
120	2 of 5	ESE/201.8	79.8 / 0.00	Westacott Organs 117 Lakeshore Rd E Suite 343 Mississauga ON L5G 4T6	SCT
Established:		1989			
Plant Size (ft²):					
Employment:					
--Details--					
Description:		All Other Miscellaneous Manufacturing			
SIC/NAICS Code:		339990			
120	3 of 5	ESE/201.8	79.8 / 0.00	Canadian Wiping Cloth Company 126-117 Lakeshore Road East Mississauga ON L5G 4T6	SCT
Established:		8/1/1994			
Plant Size (ft²):		5000			
Employment:					
--Details--					
Description:		All Other Textile Product Mills			
SIC/NAICS Code:		314990			
120	4 of 5	ESE/201.8	79.8 / 0.00	Axis Communications Inc. 117 Lakeshore Rd E Mississauga ON L5G 1E5	SCT
Established:		01-DEC-84			
Plant Size (ft²):					
Employment:					
--Details--					
Description:		Electrical Contractors and Other Wiring Installation Contractors			
SIC/NAICS Code:		238210			
Description:		Electronic Components, Navigational and Communications Equipment and Supplies Wholesaler-Distributors			
SIC/NAICS Code:		417320			
Description:		Software Publishers			
SIC/NAICS Code:		511210			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
120	5 of 5	ESE/201.8	79.8 / 0.00	industrial piping & plumbing ltd 117 lakeshore rd east #359 misissauga ON	GEN
<u>Generator Info</u>					
Generator No:	ON5400386			Choice of Contact:	
Approval Years:	2009			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	238220
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		Plumbing Heating and Air-Conditioning Contractors			
<u>Waste Detail(s)</u>					
Waste Class:	252				
Waste Class Name:	WASTE OILS & LUBRICANTS				

121	1 of 1	SSW/202.3	79.8 / 0.00	20 STAVEBANK DR MISSISSAUGA ON	WWIS
Well ID:	7168027			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	09/01/2011
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z136782			Contractor:	7241
Tag:	A114327			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:	X				
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/716\7168027.pdf				

Additional Detail(s) (Map)

Well Completed Date: 07/24/2011
 Year Completed: 2011
 Depth (m): 6.096
 Latitude: 43.5526616679352
 Longitude: -79.5860629304479
 X: -79.58606277980817
 Y: 43.552661665726355
 Path: 716\7168027.pdf

Bore Hole Information

Bore Hole ID: 1003558156 Elevation:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614210.00
Code OB Desc:				North83:	4823161.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	07/24/2011			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003917680			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		91			
Material 3 Desc:		WATER-BEARING			
Formation Top Depth:		8.0			
Formation End Depth:		20.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003917679			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		8.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1003917688			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		1003917690			
Layer:		3			
Plug From:		8.0			
Plug To:		20.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003917689			
Layer:		2			
Plug From:		1.0			
Plug To:		8.0			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1003917687			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1003917678			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1003917683			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		10.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1003917684			
Layer:		1			
Slot:		10			
Screen Top Depth:		10.0			
Screen End Depth:		20.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.25			
 <u>Water Details</u>					
Water ID:		1003917682			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1003917681			
Diameter:		6.0			
Depth From:		0.0			
Depth To:		20.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
122	1 of 10	E/202.4	79.8 / 0.00	SKINNER & MIDDLEBROOK LTD. 128 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E4	GEN
<u>Generator Info</u>					
Generator No:	ONF025200			Choice of Contact:	
Approval Years:	88,89,90,00,01,03,04			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	9731
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	FUNERAL HOMES				
<u>Waste Detail(s)</u>					
Waste Class:	312				
Waste Class Name:	PATHOLOGICAL WASTES				
122	2 of 10	E/202.4	79.8 / 0.00	SKINNER & MIDDLEBROOK LTD. 44-252 128 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E4	GEN
<u>Generator Info</u>					
Generator No:	ONF025200			Choice of Contact:	
Approval Years:	92,93,94,95,96			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	9731
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	FUNERAL HOMES				
<u>Waste Detail(s)</u>					
Waste Class:	312				
Waste Class Name:	PATHOLOGICAL WASTES				
122	3 of 10	E/202.4	79.8 / 0.00	SKINNER & MIDDLEBROOK LTD 128 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1E4	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ONF025200			Choice of Contact:	
Approval Years:	97,98,99			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	9731
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		FUNERAL HOMES			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
122	4 of 10	E/202.4	79.8 / 0.00	Skinner & Middlebrook Ltd. 128 Lakeshore Rd.E. Mississauga ON L5G 1E4	GEN
<u>Generator Info</u>					
Generator No:	ON8373977			Choice of Contact:	
Approval Years:	02,03,04,07,08			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
122	5 of 10	E/202.4	79.8 / 0.00	Skinner & Middlebrook Ltd. 128 Lakeshore Rd.E. Mississauga ON L5G 1E4	GEN
<u>Generator Info</u>					
Generator No:	ON8373977			Choice of Contact:	
Approval Years:	2009			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	812210
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		Funeral Homes			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
122	6 of 10	E/202.4	79.8 / 0.00	Skinner & Middlebrook Ltd. 128 Lakeshore Rd.E. Mississauga ON L5G 1E4	GEN

Generator Info

Generator No:	ON8373977	Choice of Contact:	
Approval Years:	2010	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	812210
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	Funeral Homes		

Waste Detail(s)

Waste Class:	312
Waste Class Name:	PATHOLOGICAL WASTES

122	7 of 10	E/202.4	79.8 / 0.00	Skinner & Middlebrook Ltd. 128 Lakeshore Rd.E. Mississauga ON L5G 1E4	GEN

Generator Info

Generator No:	ON8373977	Choice of Contact:	
Approval Years:	2011	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	812210
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	Funeral Homes		

Waste Detail(s)

Waste Class:	312
Waste Class Name:	PATHOLOGICAL WASTES

122	8 of 10	E/202.4	79.8 / 0.00	Skinner & Middlebrook Ltd 128 Lakeshore Rd.E. Mississauga ON L5G 1E4	GEN

Generator Info

Generator No:	ON6384687	Choice of Contact:	
Approval Years:	As of Jul 2020	Contaminated Fac:	
Status:	Registered	MHSW Facility:	
PO Box No:		SIC Code:	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Name:		312 P Pathological wastes			

122	9 of 10	E/202.4	79.8 / 0.00	Skinner & Middlebrook Ltd 128 Lakeshore Rd.E. Mississauga ON L5G 1E4	GEN

Generator Info

Generator No:	ON6384687	Choice of Contact:
Approval Years:	As of Nov 2021	Contaminated Fac:
Status:	Registered	MHSW Facility:
PO Box No:		SIC Code:
Country:	Canada	
Co Admin:		
Phone No Admin:		
SIC Description:		

Waste Detail(s)

Waste Class:	312 P
Waste Class Name:	Pathological wastes

122	10 of 10	E/202.4	79.8 / 0.00	Skinner & Middlebrook Ltd 128 Lakeshore Rd.E. Mississauga ON L5G 1E4	GEN

Generator Info

Generator No:	ON6384687	Choice of Contact:
Approval Years:	As of Oct 2022	Contaminated Fac:
Status:	Registered	MHSW Facility:
PO Box No:		SIC Code:
Country:	Canada	
Co Admin:		
Phone No Admin:		
SIC Description:		

Waste Detail(s)

Waste Class:	312 P
Waste Class Name:	PATHOLOGICAL WASTES

2019 Generator Info

Gen No:	ON6384687	Choice of Contact:	CO_OFFICIAL
ID:	25634	Phone No Official:	19052785546 Ext.
Contaminated Fac:	N	Phone No Admin:	
MHSW Facility:	N	County Ont:	PEEL (R. M.)
NAICS Code1:	812210	County Out:	
NAICS Code2:		District:	305
NAICS Code3:			
Gen Name:	Skinner & Middlebrook Ltd		
Gen Div:			
Gen Op Name:	Skinner & Middlebrook Ltd		
Gen Op Div:			
Site Adrs1:	128 Lakeshore Rd.E.		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Bldg: Site Pobox: Province In: ONTARIO Site Adrs2: Site City: Mississauga Province Out: Site Postal Code: L5G 1E4 Site Country: Canada Co Official: Jeannine Marmen Co Admin:					
2020 Generator Info					
Gen No:	ON6384687			Choice of Contact:	CO_OFFICIAL
ID:	25354			Phone No Official:	19052785546 Ext.
Contaminated Fac:	N			Phone No Admin:	
MHSW Facility:	N			County Ont:	PEEL (R. M.)
NAICS Code1:	812210			County Out:	
NAICS Code2:				District:	305
NAICS Code3:					
Gen Name:	Skinner & Middlebrook Ltd				
Gen Div:					
Gen Op Name:	Skinner & Middlebrook Ltd				
Gen Op Div:					
Site Adrs1:	128 Lakeshore Rd.E.				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Mississauga				
Province Out:					
Site Postal Code:	L5G 1E4				
Site Country:	Canada				
Co Official:	Jeannine Marmen				
Co Admin:					
2021 Generator Info					
Gen No:	ON6384687			Choice of Contact:	CO_OFFICIAL
ID:	25798			Phone No Official:	19052785546 Ext.
Contaminated Fac:	N			Phone No Admin:	
MHSW Facility:	N			County Ont:	PEEL (R. M.)
NAICS Code1:	812210			County Out:	
NAICS Code2:				District:	305
NAICS Code3:					
Gen Name:	Skinner & Middlebrook Ltd				
Gen Div:					
Gen Op Name:	Skinner & Middlebrook Ltd				
Gen Op Div:					
Site Adrs1:	128 Lakeshore Rd.E.				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Mississauga				
Province Out:					
Site Postal Code:	L5G 1E4				
Site Country:	Canada				
Co Official:	Jeannine Marmen				
Co Admin:					
123	1 of 1	E/202.8	79.8 / 0.00	128 Lakeshore Road East Mississauga ON L5G 1E4	EHS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Order No: 21012800063 Status: C Report Type: Standard Report Report Date: 02-FEB-21 Date Received: 28-JAN-21 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.5827751 Y: 43.5548094					
124	1 of 1	NE/202.8	79.8 / 0.00	10 WEST GO GP INC. AS GENERAL PARTNER BY AND ON BEHALF OF 10 WEST GO LP 84 HIGH STREET EAST ON Mississauga ON	RSC
RSC No: 235951 RA No: Status: FILED Filing Date: Date Ack: Date Returned: Approval Date: January 18, 2023 Cert Date: Cert Prop Use No: Curr Property Use: Intended Prop Use: Restoration Type: Soil Type: Criteria: Stratified (Y/N): Audit (Y/N): Entire Leg Prop. (Y/N): CPU Issu Sect 1686: Business Name: 10 WEST GO GP INC. AS GENERAL PARTNER BY AND ON BEHALF OF 10 WEST GO LP Address: 84 HIGH STREET EAST ON Legal Desc: Site Pin: 13463-0015 (LT), 13463-0016 (LT), 13463-0034 (LT), 13463-0035 (LT) Asmt Roll No: Project Type: POST2011 Approval Type: RSC based on Phase One and Two ESAs Applicable Standards: PDF Link: https://www.accessenvironment.ene.gov.on.ca/AEWeb/ae/ViewDocument.action?documentRefID=235951					
X: -79.5836954891579 Y: 43.55595486133799 Latitude: 43.55595486 Longitude: -79.58369549 UTM Coordinates: Latitude Longitude: Accuracy Estimate: Measurement Method: Mailing Address: Telephone: Fax: Email: Postal Code: L5G 1K4 Ministry District: MOE District: Halton-Peel SWP Area Name: Credit Valley Qual Person Name: SAMUEL LEE					
Consultant:					
125	1 of 1	ESE/203.3	79.8 / 0.00	103 LAKESHORE ROAD EAST Mississauga ON	WWIS
Well ID: 7157715 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: 0 Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z126422 Tag: A094139 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 01/14/2011 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: PEEL Lot: Concession: Concession Name: Easting NAD83: Northing NAD83:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY (PORT CREDIT)			
Site Info:		WKQ-003329 A0-A02			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/715\7157715.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		12/03/2010			
Year Completed:		2010			
Depth (m):		1.8288			
Latitude:		43.5534258645534			
Longitude:		-79.5830614379881			
X:		-79.58306128834643			
Y:		43.55342586250811			
Path:		715\7157715.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1003456013		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614451.00
Code OB Desc:				North83:	4823250.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:		12/03/2010		UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003774014			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		3.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003774015			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 1 Desc:		SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		3.0			
Formation End Depth:		6.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003774025			
Layer:		2			
Plug From:		2.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003774024			
Layer:		1			
Plug From:		6.0			
Plug To:		2.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003774026			
Layer:		3			
Plug From:		1.0			
Plug To:		0.0			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1003774022			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:		DIRECT PUSH			
 <u>Pipe Information</u>					
Pipe ID:		1003774013			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1003774018			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		2.0			
Depth To:		0.0			
Casing Diameter:		1.25			
Casing Diameter UOM:		inch			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1003774019			
Layer:		1			
Slot:		10			
Screen Top Depth:		6.0			
Screen End Depth:		2.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.5			
<u>Water Details</u>					
Water ID:		1003774017			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1003774016			
Diameter:		3.25			
Depth From:		0.0			
Depth To:		6.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
126	1 of 4	E/203.3	79.8 / 0.00	1227942 Ontario Limited 121 Lakeshore Road East Mississauga ON	CA
Certificate #:		2713-64DQ9V			
Application Year:		2004			
Issue Date:		9/22/2004			
Approval Type:		Waste Management Systems			
Status:		Approved			
Application Type:					
Client Name:					
Client Address:					
Client City:					
Client Postal Code:					
Project Description:					
Contaminants:					
Emission Control:					
126	2 of 4	E/203.3	79.8 / 0.00	1227942 Ontario Limited 121 Lakeshore Road East Mississauga ON	CA
Certificate #:		5387-6CHQHB			
Application Year:		2005			
Issue Date:		5/20/2005			
Approval Type:		Waste Management Systems			
Status:		Approved			
Application Type:					
Client Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:					
126	3 of 4	E/203.3	79.8 / 0.00	1227942 Ontario Limited 121 Lakeshore Rd E Mississauga ON L5G 1E5	ECA
Approval No: 2713-64DQ9V Approval Date: 2004-09-22 Status: Approved Record Type: ECA Link Source: IDS SWP Area Name: Approval Type: ECA-WASTE MANAGEMENT SYSTEMS Project Type: WASTE MANAGEMENT SYSTEMS Business Name: 1227942 Ontario Limited Address: 121 Lakeshore Rd E Full Address: Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/8621-645RJM-14.pdf PDF Site Location:		MOE District: City: Longitude: Latitude: Geometry X: Geometry Y:			
126	4 of 4	E/203.3	79.8 / 0.00	1227942 Ontario Limited 121 Lakeshore Rd E Mississauga ON L5G 1E5	ECA
Approval No: 5387-6CHQHB Approval Date: 2005-05-20 Status: Approved Record Type: ECA Link Source: IDS SWP Area Name: Approval Type: ECA-WASTE MANAGEMENT SYSTEMS Project Type: WASTE MANAGEMENT SYSTEMS Business Name: 1227942 Ontario Limited Address: 121 Lakeshore Rd E Full Address: Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/2168-6BURF4-14.pdf PDF Site Location:		MOE District: City: Longitude: Latitude: Geometry X: Geometry Y:			
127	1 of 1	N/203.6	78.8 / -1.00	24 Ann St Mississauga ON L5G 3G1	EHS
Order No: 20180426226 Status: C Report Type: Standard Report Report Date: 04-MAY-18 Date Received: 26-APR-18 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans; City Directory; Aerial Photos		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.585342 Y: 43.556205			
128	1 of 1	E/204.0	79.8 / 0.00	128 Lakeshore Rd E Mississauga ON L5G 1E4	EHS
Order No: 22042900034		Nearest Intersection:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status: C Report Type: Custom Report Report Date: 04-MAY-22 Date Received: 29-APR-22 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans					
Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.58276987 Y: 43.55484041					
129	1 of 1	ENE/205.6	79.8 / 0.00	89 High Street East Mississauga ON L5G 3E7	EHS
Order No: 24041000158 Status: C Report Type: Standard Report Report Date: 15-APR-24 Date Received: 10-APR-24 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.5831482 Y: 43.5554568					
130	1 of 1	NNE/206.1	79.8 / 0.00	10 WEST GO GP INC. AS GENERAL PARTNER BY AND ON BEHALF OF 10 WEST GO LP 19 ANN STREET ON Mississauga ON	RSC
RSC No: 235951 RA No: Status: FILED Filing Date: Date Ack: Date Returned: Approval Date: January 18, 2023 Cert Date: Cert Prop Use No: Curr Property Use: Intended Prop Use: Restoration Type: Soil Type: Criteria: Stratified (Y/N): Audit (Y/N): Entire Leg Prop. (Y/N): CPU Issu Sect 1686: Business Name: 10 WEST GO GP INC. AS GENERAL PARTNER BY AND ON BEHALF OF 10 WEST GO LP Address: 19 ANN STREET ON Legal Desc: Site Pin: 13463-0015 (LT), 13463-0016 (LT), 13463-0034 (LT), 13463-0035 (LT) Asmt Roll No: Project Type: POST2011 Approval Type: RSC based on Phase One and Two ESAs Applicable Standards: PDF Link: https://www.accessenvironment.ene.gov.on.ca/AEWeb/ae/ViewDocument.action?documentRefID=235951					
X: -79.5836954891579 Y: 43.55595486133799 Latitude: 43.55595486 Longitude: -79.58369549 UTM Coordinates: Latitude Longitude: Accuracy Estimate: Measurement Method: Mailing Address: Telephone: Fax: Email: Postal Code: L5G 3E9 Ministry District: MOE District: Halton-Peel SWP Area Name: Credit Valley Qual Person Name: SAMUEL LEE					
131	1 of 2	SSE/206.8	79.8 / 0.00	SICOTEL LTD. 81 LAKESHORE RD E MISSISSAUGA ON L5G 1C9	SCT
Established: 1985 Plant Size (ft²): 1500 Employment: 3					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB	
--Details--						
Description:		COMPUTERS & COMPUTER PERIPHERAL EQUIPMENT & SOFTWARE				
SIC/NAICS Code:		5045				
131	2 of 2	SSE/206.8	79.8 / 0.00	MELL-BURN LAWN CARE SERVICE 81 LAKESHORE RD.E. BOX 45035 MISSISSAUGA ON L5G4S7	PES	
Detail Licence No:				Operator Box:		
Licence No:	03678			Operator Class:		
Status:				Operator No:		
Approval Date:				Operator Type:		
Report Source:	Legacy Licenses (Excluding TS)			Oper Area Code:	905	
Licence Type:	Operator			Oper Phone No:	8917539	
Licence Type Code:	01			Operator Ext:		
Licence Class:	06			Operator Lot:		
Licence Control:				Oper Concession:		
Latitude:				Operator Region:		
Longitude:				Operator District:		
Lot:				Operator County:		
Concession:				Op Municipality:		
Region:				Post Office Box:		
District:				MOE District:		
County:				SWP Area Name:		
Trade Name:						
PDF URL:						
132	1 of 1	SE/207.2	79.8 / 0.00	ON	BORE	
Borehole ID:		640873			Inclin FLG:	No
OGF ID:		215541268			SP Status:	Initial Entry
Status:					Surv Elev:	No
Type:		Borehole			Piezometer:	No
Use:		Geotechnical/Geological Investigation			Primary Name:	
Completion Date:		JAN-1965			Municipality:	
Static Water Level:					Lot:	
Primary Water Use:		Not Used			Township:	
Sec. Water Use:					Latitude DD:	43.55283
Total Depth m:		1.5			Longitude DD:	-79.583774
Depth Ref:		Ground Surface			UTM Zone:	17
Depth Elev:					Easting:	614395
Drill Method:		Power auger			Northing:	4823183
Orig Ground Elev m:		80.4			Location Accuracy:	
Elev Reliabil Note:					Accuracy:	Not Applicable
DEM Ground Elev m:		80.1				
Concession:						
Location D:						
Survey D:						
Comments:						
<u>Borehole Geology Stratum</u>						
Geology Stratum ID:		218493878			Mat Consistency:	
Top Depth:		.6			Material Moisture:	Wet
Bottom Depth:		1.5			Material Texture:	
Material Color:		Brown			Non Geo Mat Type:	
Material 1:		Sand			Geologic Formation:	
Material 2:		Clay			Geologic Group:	
Material 3:		Silt			Geologic Period:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description: SAND,CLAY,SILT. BROWN,ALLUVIAL,WET, AGE POST-GLACIAL. T, CL **Note: Many records provided by the department have a truncated [Stratum Description] field.					
Geology Stratum ID:		218493876	Mat Consistency:		
Top Depth:		.1	Material Moisture:		
Bottom Depth:		.2	Material Texture:		
Material Color:			Non Geo Mat Type:		
Material 1:		Fill	Geologic Formation:		
Material 2:		Gravel	Geologic Group:		
Material 3:			Geologic Period:		
Material 4:			Depositional Gen: fill		
Gsc Material Description:					
Stratum Description: FILL,GRAVEL.					
Geology Stratum ID:		218493877	Mat Consistency:		
Top Depth:		.2	Material Moisture:		
Bottom Depth:		.6	Material Texture:		
Material Color:		Brown	Non Geo Mat Type:		
Material 1:		Sand	Geologic Formation:		
Material 2:		Silt	Geologic Group:		
Material 3:		Clay	Geologic Period:		
Material 4:			Depositional Gen: alluvial		
Gsc Material Description:					
Stratum Description: SAND,SILT,CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL.					
Geology Stratum ID:		218493875	Mat Consistency:		
Top Depth:		0	Material Moisture:		
Bottom Depth:		.1	Material Texture:		
Material Color:			Non Geo Mat Type:		
Material 1:		Asphalt	Geologic Formation:		
Material 2:			Geologic Group:		
Material 3:			Geologic Period:		
Material 4:			Depositional Gen:		
Gsc Material Description:					
Stratum Description: ASPHALT.					
<u>Source</u>					
Source Type:		Data Survey	Source Appl:		Spatial/Tabular
Source Orig:		Geological Survey of Canada	Source Iden:		1
Source Date:		1956-1972	Scale or Res:		Varies
Confidence:		M	Horizontal:		NAD27
Observatio:			Verticalda:		Mean Average Sea Level
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Details:		File: TOR1B.txt RecordID: 088390 NTS_Sheet: 30M12A			
Confiden 1:		Logs are approximately correct. Lack of information. Doubtful terminology.			
<u>Source List</u>					
Source Identifier:		1	Horizontal Datum:		NAD27
Source Type:		Data Survey	Vertical Datum:		Mean Average Sea Level
Source Date:		1956-1972	Projection Name:		Universal Transverse Mercator
Scale or Resolution:		Varies			
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Originators:		Geological Survey of Canada			
133	1 of 1	NW/208.2	78.8 / -1.00	PORT CREDIT GO STATION PORT CREDIT ON	WWIS
Well ID:		7321813	Flowing (Y/N):		
Construction Date:			Flow Rate:		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	11/07/2018
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z266905			Contractor:	6607
Tag:	A232825			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/732\7321813.pdf				

Additional Detail(s) (Map)

Well Completed Date: 01/18/2018
Year Completed: 2018
Depth (m): 15.2
Latitude: 43.5559635526998
Longitude: -79.5865799874411
X: -79.58657983705416
Y: 43.555963550679024
Path: 732\7321813.pdf

Bore Hole Information

Bore Hole ID:	1007307137	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614162.00
Code OB Desc:		North83:	4823527.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	01/18/2018	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock

Materials Interval

Formation ID: 1007605510
Layer: 2
Color: 2
General Color: GREY
Material 1: 05
Material 1 Desc: CLAY
Material 2: 06
Material 2 Desc: SILT
Material 3: 85

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3 Desc:		SOFT			
Formation Top Depth:		1.5			
Formation End Depth:		6.0			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007605512			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:		26			
Material 2 Desc:		ROCK			
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		9.100000381469727			
Formation End Depth:		15.199999809265137			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007605509			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		1.5			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007605511			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		6.0			
Formation End Depth:		9.100000381469727			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007605520			
Layer:		1			
Plug From:		0.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007605521			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		11.8000000190734863			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1007605519			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1007605508			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1007605516			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		12.100000381469727			
Casing Diameter:		5.099999904632568			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1007605517			
Layer:		1			
Slot:		10			
Screen Top Depth:		12.100000381469727			
Screen End Depth:		15.199999809265137			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.400000095367432			
 <u>Water Details</u>					
Water ID:		1007605515			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1007605513			
Diameter:		21.0			
Depth From:		0.0			
Depth To:		9.100000381469727			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1007605514			
Diameter:		9.600000381469727			
Depth From:		9.100000381469727			
Depth To:		15.199999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
134	1 of 1	ESE/208.8	79.8 / 0.00	LAKE SHORE 91/99 ON	WWIS
Well ID:	7148419			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	0			Date Received:	07/16/2010
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z114391			Contractor:	7241
Tag:	A099909			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/714\7148419.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	06/10/2010				
Year Completed:	2010				
Depth (m):	4.572				
Latitude:	43.5532646053679				
Longitude:	-79.5831271176111				
X:	-79.58312696776339				
Y:	43.553264602836386				
Path:	714\7148419.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1003169221			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614446.00
Code OB Desc:				North83:	4823232.00

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	06/10/2010			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003209357			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:					
Material 2 Desc:					
Material 3:		77			
Material 3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		8.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003209358			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		77			
Material 3 Desc:		LOOSE			
Formation Top Depth:		8.0			
Formation End Depth:		15.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1003209360			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1003209361			
Layer:		2			
Plug From:		1.0			
Plug To:		4.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003209362			
Layer:		3			
Plug From:		4.0			
Plug To:		15.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003209368			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1003209356			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003209364			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		5.0			
Casing Diameter:		1.5			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1003209365			
Layer:		1			
Slot:		10			
Screen Top Depth:		5.0			
Screen End Depth:		15.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.75			
<u>Water Details</u>					
Water ID:		1003209363			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole ID: 1003209359 Diameter: 10.920000076293945 Depth From: 0.0 Depth To: 15.0 Hole Depth UOM: ft Hole Diameter UOM: inch					
135	1 of 1	NW/209.4	78.8 / -1.00	ON	BORE
Borehole ID: 833907 OGF ID: 215586038 Status: Decommissioned Type: Borehole Use: Geotechnical/Geological Investigation Completion Date: 03-FEB-1977 Static Water Level: 0.8 Primary Water Use: Sec. Water Use: Total Depth m: 6.1 Depth Ref: Ground Surface Depth Elev: Drill Method: Hollow stem auger Orig Ground Elev m: 82.3 Elev Reliabil Note: DEM Ground Elev m: 82.1 Concession: Location D: PORT CREDIT GO STATION * PLATFORM SHELTER Survey D: Comments:					
Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD: 43.555876 Longitude DD: -79.58678 UTM Zone: 17 Easting: 614146 Northing: 4823517 Location Accuracy: Accuracy: Within 10 metres					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: 6014840 Top Depth: .6 Bottom Depth: 2.9 Material Color: Brown Material 1: Sand Material 2: Silt Material 3: Material 4: Gsc Material Description: Stratum Description: Silty fine sand, compact, (brown) **Note: Many records provided by the department have a truncated [Stratum Description] field.					
Mat Consistency: Compact Material Moisture: Material Texture: Fine Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					
Geology Stratum ID: 6014839 Top Depth: 0 Bottom Depth: .6 Material Color: Material 1: Sand Material 2: Gravel Material 3: Material 4: Gsc Material Description: Stratum Description: Concrete pavement, sand and gravel fill **Note: Many records provided by the department have a truncated [Stratum Description] field.					
Mat Consistency: Very Stiff Material Moisture: Material Texture: Non Geo Mat Type: Fill-Misc Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					
Geology Stratum ID: 6014841 Top Depth: 2.9 Bottom Depth: 6.1 Material Color: Grey Material 1: Till Material 2: Silt					
Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3:	Sand			Geologic Period:	
Material 4:	Gravel			Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:		(Grey), heterogeneous mixture of clayey silt, sand and gravel, (glacial till), very stiff to hard **Note: Many records provided by the department have a truncated [Stratum Description] field.			

136	1 of 1	ESE/209.6	79.8 / 0.00	103 LAKESHORE ROAD EAST Mississauga ON	WWIS
Well ID:	7157717			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	01/14/2011
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z126421			Contractor:	7241
Tag:	A093952			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:	WKQ-003329 A0-A02				
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/715\7157717.pdf				

Additional Detail(s) (Map)

Well Completed Date:	12/03/2010
Year Completed:	2010
Depth (m):	3.6576
Latitude:	43.5533445446009
Longitude:	-79.5830385833061
X:	-79.5830384334234
Y:	43.55334454262262
Path:	715\7157717.pdf

Bore Hole Information

Bore Hole ID:	1003456090	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614453.00
Code OB Desc:		North83:	4823241.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	3
Date Completed:	12/03/2010	UTMRC Desc:	margin of error : 10 - 30 m
Remarks:		Location Method:	www
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1003774141			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		0.0			
Formation End Depth:		6.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1003774142			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		6.0			
Formation End Depth:		12.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003774153			
Layer:		3			
Plug From:		1.0			
Plug To:		0.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003774151			
Layer:		1			
Plug From:		0.0			
Plug To:		3.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003774152			
Layer:		2			
Plug From:		3.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Use</u>					
Method Construction ID:		1003774149			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:		DIRECT PUSH			
<u>Pipe Information</u>					
Pipe ID:		1003774140			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003774145			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		4.0			
Casing Diameter:		0.75			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1003774146			
Layer:		1			
Slot:		10			
Screen Top Depth:		4.0			
Screen End Depth:		12.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.0			
<u>Water Details</u>					
Water ID:		1003774144			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1003774143			
Diameter:		3.25			
Depth From:		0.0			
Depth To:		12.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
137	1 of 1	ESE/209.7	79.8 / 0.00	113 LAKESHORE BLVD. 107 Mississauga ON	WWIS
Well ID:	7109074			Flowing (Y/N):	
Construction Date:				Flow Rate:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	0			Date Received:	07/31/2008
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z81860			Contractor:	7241
Tag:	A075601			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/710\7109074.pdf			
Additional Detail(s) (Map)					
Well Completed Date:	07/10/2008				
Year Completed:	2008				
Depth (m):	4.88				
Latitude:	43.5535585850256				
Longitude:	-79.5828726247807				
X:	-79.58287247509854				
Y:	43.5535585822681				
Path:	710\7109074.pdf				
Bore Hole Information					
Bore Hole ID:	1001703970			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614466.00
Code OB Desc:				North83:	4823265.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	07/10/2008			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
Overburden and Bedrock					
Materials Interval					
Formation ID:	1001760965				
Layer:	2				
Color:	6				
General Color:	BROWN				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:	06				
Material 2 Desc:	SILT				
Material 3:	77				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3 Desc:		LOOSE			
Formation Top Depth:		1.2200000286102295			
Formation End Depth:		3.0999999046325684			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1001760966			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		91			
Material 3 Desc:		WATER-BEARING			
Formation Top Depth:		3.0999999046325684			
Formation End Depth:		4.880000114440918			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1001760964			
Layer:		1			
Color:		8			
General Color:		BLACK			
Material 1:		27			
Material 1 Desc:		OTHER			
Material 2:		01			
Material 2 Desc:		FILL			
Material 3:		77			
Material 3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		1.2200000286102295			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1001760967			
Layer:		4			
Color:					
General Color:					
Material 1:					
Material 1 Desc:					
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		4.880000114440918			
Formation End Depth:					
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1001760970			
Layer:		2			
Plug From:		0.30000001192092896			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug To:		1.5			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1001760969			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1001760971			
Layer:		3			
Plug From:		1.5			
Plug To:		4.880000114440918			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1001760976			
Method Construction Code:		H			
Method Construction:		Geoprobe			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1001760963			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1001760973			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.8300000429153442			
Casing Diameter:		3.809999942779541			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1001760974			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.8300000429153442			
Screen End Depth:		4.880000114440918			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		3.809999942779541			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Water Details</u>					
Water ID:		1001760972			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:	m				
<u>Hole Diameter</u>					
Hole ID:		1001760968			
Diameter:					
Depth From:					
Depth To:					
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
138	1 of 1	ESE/210.2	79.8 / 0.00	103 LAKESHORE RD E Mississauga ON	WWIS
Well ID:	7187901			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Test Hole			Date Received:	09/24/2012
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z156840			Contractor:	7241
Tag:	A137100			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:	WKQ-005210				
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/718\7187901.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	08/17/2012				
Year Completed:	2012				
Depth (m):	4.572				
Latitude:	43.5533355431432				
Longitude:	-79.5830387942478				
X:	-79.58303864452822				
Y:	43.55333554071013				
Path:	718\7187901.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1004163417			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614453.00
Code OB Desc:				North83:	4823240.00

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	08/17/2012			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004442177			
Layer:		3			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		6.0			
Formation End Depth:		8.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004442175			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		01			
Material 1 Desc:		FILL			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		4.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004442176			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		34			
Material 1 Desc:		TILL			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		4.0			
Formation End Depth:		6.0			
Formation End Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004442178			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		91			
Material 3 Desc:		WATER-BEARING			
Formation Top Depth:		8.0			
Formation End Depth:		15.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004442186			
Layer:		1			
Plug From:		15.0			
Plug To:		4.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004442187			
Layer:		2			
Plug From:		4.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004442188			
Layer:		3			
Plug From:		1.0			
Plug To:		0.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1004442185			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1004442174			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing ID:		1004442181			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		5.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1004442182			
Layer:		1			
Slot:		10			
Screen Top Depth:		5.0			
Screen End Depth:		15.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.25			
 <u>Water Details</u>					
Water ID:		1004442180			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
 <u>Hole Diameter</u>					
Hole ID:		1004442179			
Diameter:		4.25			
Depth From:		0.0			
Depth To:		15.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
139	1 of 1	ESE/210.2	79.8 / 0.00	103 LAKESHORE RD E MISSISSAUGA ON	WWIS
Well ID:	7183549			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	07/06/2012
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z151075			Contractor:	7241
Tag:	A125621			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Municipality:		MISSISSAUGA CITY (PORT CREDIT)			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/718\7183549.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		05/30/2012			
Year Completed:		2012			
Depth (m):		4.5			
Latitude:		43.5532554505013			
Longitude:		-79.5831149519928			
X:		-79.5831148018842			
Y:		43.55325544856816			
Path:		718\7183549.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1003962314	Elevation:		
DP2BR:			Elevrc:		
Spatial Status:			Zone:		17
Code OB:			East83:		614447.00
Code OB Desc:			North83:		4823231.00
Open Hole:			Org CS:		UTM83
Cluster Kind:			UTMRC:		4
Date Completed:		05/30/2012	UTMRC Desc:		margin of error : 30 m - 100 m
Remarks:			Location Method:		wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004340837			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		1.0			
Formation End Depth:		3.0			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004340836			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 2 Desc:		GRAVEL			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004340838			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		08			
Material 2 Desc:		FINE SAND			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		3.0			
Formation End Depth:		4.5			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004340847			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.2000000476837158			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004340848			
Layer:		3			
Plug From:		1.2000000476837158			
Plug To:		4.5			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004340846			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1004340845			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:		DIRECT PUSH			
 <u>Pipe Information</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pipe ID:		1004340835			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1004340841			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.5			
Casing Diameter:		4.019999980926514			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1004340842			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.5			
Screen End Depth:		4.5			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.820000171661377			
 <u>Water Details</u>					
Water ID:		1004340840			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
 <u>Hole Diameter</u>					
Hole ID:		1004340839			
Diameter:		10.8999999618530273			
Depth From:		0.0			
Depth To:		4.5			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
140	1 of 1	NNE/210.5	79.8 / -0.08	Park Street & Hurontario Street Mississauga ON	WWIS
Well ID:	7398231			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	09/16/2021
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	W43J8N89			Contractor:	7472
Tag:	A333808			Form Version:	9
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliability:				Lot:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:			Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:		
MISSISSAUGA CITY (PORT CREDIT)					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/739\7398231.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		07/08/2021			
Year Completed:		2021			
Depth (m):		12.192			
Latitude:		43.556179942586			
Longitude:		-79.5844206798404			
X:		-79.5844205303245			
Y:		43.55617994083386			
Path:		739\7398231.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1008786638		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				East83:	
Code OB Desc:				North83:	
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	
Date Completed:		07/08/2021		UTMRC Desc:	
Remarks:				Location Method:	
Location Method Desc:		on Water Well Record		margin of error : 30 m - 100 m	
Elevrc Desc:				wwr	
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008787023			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		79			
Material 3 Desc:		PACKED			
Formation Top Depth:		4.0			
Formation End Depth:		25.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008787022			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		01			
Material 1 Desc:		FILL			
Material 2:					
Material 2 Desc:					
Material 3:		77			
Material 3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		4.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1008787024			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		17			
Material 1 Desc:		SHALE			
Material 2:					
Material 2 Desc:					
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		25.0			
Formation End Depth:		40.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1008787353			
Layer:		1			
Plug From:		0.0			
Plug To:		29.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1008787354			
Layer:		2			
Plug From:		29.0			
Plug To:		40.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1008787268			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1008786832			
Method Construction Code:		E			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Method Construction:		Auger			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1008786757			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1008787109			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		30.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1008787159			
Layer:		1			
Slot:		10			
Screen Top Depth:		30.0			
Screen End Depth:		40.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.5			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1008786758			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1008787211			
Diameter:		7.5			
Depth From:		0.0			
Depth To:		40.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
141	1 of 1	N/211.3	78.8 / -1.00	ON	BORE
Borehole ID: 640930 OGF ID: 215541325 Status: Type: Borehole Use: Geotechnical/Geological Investigation Completion Date: JAN-1965 Static Water Level: Primary Water Use: Not Used Sec. Water Use: Total Depth m: 2.1 Depth Ref: Ground Surface Depth Elev: Drill Method: Power auger Orig Ground Elev m: 82.9 Elev Reliabil Note: DEM Ground Elev m: 82.6 Concession: Location D: Survey D: Comments: Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD: 43.556266 Longitude DD: -79.584931 UTM Zone: 17 Easting: 614295 Northing: 4823563 Location Accuracy: Accuracy: Not Applicable					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: 218494130 Top Depth: .5 Bottom Depth: 2.1 Material Color: Material 1: Sand Material 2: Silt Material 3: Clay Material 4: Gsc Material Description: Stratum Description: SAND-MEDIUM,SILT, CLAY. ALLUVIAL,AGE POST-GLACIAL. GE **Note: Many records provided by the department have a truncated [Stratum Description] field. Mat Consistency: Material Moisture: Material Texture: Medium Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen: alluvial					
Geology Stratum ID: 218494127 Top Depth: 0 Bottom Depth: 0 Material Color: Material 1: Asphalt Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description: ASPHALT. Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					
Geology Stratum ID: 218494128 Top Depth: 0 Bottom Depth: .2 Material Color: Material 1: Fill Material 2: Gravel Material 3: Material 4: Gsc Material Description: Stratum Description: FILL,GRAVEL. Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen: fill					
Geology Stratum ID: 218494129 Top Depth: .2 Bottom Depth: .5 Mat Consistency: Material Moisture: Material Texture: Medium					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material Color: Brown Material 1: Soil Material 2: Sand Material 3: Silt Material 4: Clay Gsc Material Description: Stratum Description: SOIL,SAND-MEDIUM, SILT,CLAY. BROWN.					
Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					
Source					
Source Type: Data Survey Source Orig: Geological Survey of Canada Source Date: 1956-1972 Confidence: M Observatio: Source Name: Urban Geology Automated Information System (UGAIS) Source Details: File: TOR1B.txt RecordID: 088960 NTS_Sheet: 30M12A Confiden 1: Logs are approximately correct. Lack of information. Doubtful terminology.					
Source Appl: Spatial/Tabular Source Iden: 1 Scale or Res: Varies Horizontal: NAD27 Verticalda: Mean Average Sea Level					
Source List					
Source Identifier: 1 Source Type: Data Survey Source Date: 1956-1972 Scale or Resolution: Varies Source Name: Urban Geology Automated Information System (UGAIS) Source Originators: Geological Survey of Canada					
Horizontal Datum: NAD27 Vertical Datum: Mean Average Sea Level Projection Name: Universal Transverse Mercator					
142	1 of 1	NNE/211.4	79.8 / 0.00	Park Street & Hurontario Street Mississauga ON	WWIS
Well ID: 7398226 Construction Date: Use 1st: Monitoring Use 2nd: Final Well Status: Observation Wells Water Type: Casing Material: Audit No: HZS9NOI9 Tag: A333814 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: MISSISSAUGA CITY (PORT CREDIT) Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 09/16/2021 Selected Flag: TRUE Abandonment Rec: Contractor: 7472 Form Version: 9 Owner: County: PEEL Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/739\7398226.pdf					
Additional Detail(s) (Map)					
Well Completed Date: 07/08/2021 Year Completed: 2021 Depth (m): 7.62 Latitude: 43.5561135599888 Longitude: -79.5841498581082 X: -79.5841497081213					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Y:		43.55611355749411			
Path:		739\7398226.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	1008786623			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614358.00
Code OB Desc:				North83:	4823547.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	07/08/2021			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1008787009				
Layer:	1				
Color:	6				
General Color:	BROWN				
Material 1:	01				
Material 1 Desc:	FILL				
Material 2:					
Material 2 Desc:					
Material 3:	77				
Material 3 Desc:	LOOSE				
Formation Top Depth:	0.0				
Formation End Depth:	4.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1008787010				
Layer:	2				
Color:	2				
General Color:	GREY				
Material 1:	05				
Material 1 Desc:	CLAY				
Material 2:	06				
Material 2 Desc:	SILT				
Material 3:	79				
Material 3 Desc:	PACKED				
Formation Top Depth:	4.0				
Formation End Depth:	25.0				
Formation End Depth UOM:	ft				
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1008787343				
Layer:	1				
Plug From:	0.0				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug To:		14.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008787344			
Layer:		2			
Plug From:		14.0			
Plug To:		25.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008787263			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1008786827			
Method Construction Code:		E			
Method Construction:		Auger			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1008786747			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1008787104			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		15.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1008787154			
Layer:		1			
Slot:		10			
Screen Top Depth:		15.0			
Screen End Depth:		25.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.5			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1008786748			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1008787206			
Diameter:		7.5			
Depth From:		0.0			
Depth To:		25.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>143</u>	1 of 1	SE/212.8	79.8 / 0.00	83 Lakeshore Rd E Mississauga ON L5G1C9	EHS
Order No:	20131205070			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	16-DEC-13			Search Radius (km):	.25
Date Received:	05-DEC-13			X:	-79.584051
Previous Site Name:				Y:	43.552655
Lot/Building Size:					
Additional Info Ordered:					
<u>144</u>	1 of 1	ENE/214.6	79.8 / 0.00	Enersource Hydro Mississauga 5 Ann Street Mississauga ON L5G 3E8	GEN
<u>Generator Info</u>					
Generator No:	ON4489026			Choice of Contact:	
Approval Years:	2011			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	221122
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>145</u>	1 of 1	NNW/214.9	78.8 / -1.00	n/a Mississauga ON	EHS
Order No:	20180312162			Nearest Intersection:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status: C Report Type: Custom Report Report Date: 04-APR-18 Date Received: 12-MAR-18 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans; City Directory; Aerial Photos					
Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.586293 Y: 43.556143					

146	1 of 1	S/215.1	79.8 / 0.00	Custom CD Corporation 50 Lakeshore Rd E Suite 200 Mississauga ON L5G 1E1	SCT
Established: 01-JUN-90 Plant Size (ft²): 3500 Employment:					
--Details--					
Description:		Service Establishment Machinery, Equipment and Supplies Wholesaler-Distributors			
SIC/NAICS Code:		417920			
Description:		Sound Recording Studios			
SIC/NAICS Code:		512240			
Description:		Administrative Management and General Management Consulting Services			
SIC/NAICS Code:		541611			
Description:		Computer Systems Design and Related Services			
SIC/NAICS Code:		541510			
Description:		Other Business Support Services			
SIC/NAICS Code:		561490			
Description:		Computer, Computer Peripheral and Pre-Packaged Software Wholesaler-Distributors			
SIC/NAICS Code:		417310			
Description:		Other Management Consulting Services			
SIC/NAICS Code:		541619			
Description:		Sound Recording Wholesalers			
SIC/NAICS Code:		414440			
Description:		Record Production			
SIC/NAICS Code:		512210			
Description:		Computer Systems Design and Related Services			
SIC/NAICS Code:		541510			
Description:		All Other Services Related to Advertising			
SIC/NAICS Code:		541899			
Description:		Music Publishers			
SIC/NAICS Code:		512230			

147	1 of 1	ESE/215.1	79.8 / 0.00	113 LAKESHORE RD. E. #107 Mississauga ON	WWIS
Well ID: 7133398 Construction Date: Use 1st: Monitoring Use 2nd: Final Well Status: Observation Wells					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 11/05/2009					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water Type:			Selected Flag:		TRUE
Casing Material:			Abandonment Rec:		
Audit No:	Z095900			Contractor:	6032
Tag:	A083930			Form Version:	7
Constructn Method:			Owner:		
Elevation (m):			County:		PEEL
Elevatn Reliabilty:			Lot:		
Depth to Bedrock:			Concession:		
Well Depth:			Concession Name:		
Overburden/Bedrock:			Easting NAD83:		
Pump Rate:			Northing NAD83:		
Static Water Level:			Zone:		
Clear/Cloudy:			UTM Reliability:		
Municipality:			MISSISSAUGA CITY (PORT CREDIT)		
Site Info:					
PDF URL (Map):			https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7133398.pdf		
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:			09/25/2009		
Year Completed:			2009		
Depth (m):			4.572		
Latitude:			43.5535576643845		
Longitude:			-79.5827983651416		
X:			-79.58279821499099		
Y:			43.5535576616992		
Path:			713\7133398.pdf		
<u>Bore Hole Information</u>					
Bore Hole ID:			1002796577		
DP2BR:			Elevation:		
Spatial Status:			Elevrc:		
Code OB:			Zone:		
Code OB Desc:			East83:		
Open Hole:			North83:		
Cluster Kind:			Org CS:		
Date Completed:			UTMRC:		
Remarks:			UTMRC Desc:		
Location Method Desc:			Location Method:		
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:			1002996477		
Layer:			2		
Color:			6		
General Color:			BROWN		
Material 1:			06		
Material 1 Desc:			SILT		
Material 2:			28		
Material 2 Desc:			SAND		
Material 3:			77		
Material 3 Desc:			LOOSE		
Formation Top Depth:			0.30000001192092896		
Formation End Depth:			8.0		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1002996476			
Layer:		1			
Color:		8			
General Color:		BLACK			
Material 1:		27			
Material 1 Desc:		OTHER			
Material 2:					
Material 2 Desc:					
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		0.0			
Formation End Depth:		0.30000001192092896			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1002996478			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		12			
Material 2 Desc:		STONES			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		8.0			
Formation End Depth:		15.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002996481			
Layer:		2			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002996480			
Layer:		1			
Plug From:		1.0			
Plug To:		3.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1002996486			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Pipe Information</u>					
Pipe ID:			1002996475		
Casing No:			0		
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:			1002996483		
Layer:					
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:					
Casing Diameter UOM:			inch		
Casing Depth UOM:			ft		
<u>Construction Record - Screen</u>					
Screen ID:			1002996484		
Layer:			1		
Slot:			10		
Screen Top Depth:			4.0		
Screen End Depth:			14.0		
Screen Material:			5		
Screen Depth UOM:			ft		
Screen Diameter UOM:			inch		
Screen Diameter:			2.0		
<u>Water Details</u>					
Water ID:			1002996482		
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:			ft		
<u>Hole Diameter</u>					
Hole ID:			1002996479		
Diameter:					
Depth From:					
Depth To:					
Hole Depth UOM:			ft		
Hole Diameter UOM:			inch		

148	1 of 1	ESE/215.3	79.8 / 0.00	103 LAKESHORE ROAD EAST Mississauga ON	WWIS
Well ID:	7157716			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	01/14/2011
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z126423			Contractor:	7241
Tag:	A094140			Form Version:	7

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:			Owner: County: PEEL Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:		
			MISSISSAUGA CITY (PORT CREDIT) WKQ-003329 A0-A02		
PDF URL (Map):			https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/715\7157716.pdf		
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:			12/03/2010		
Year Completed:			2010		
Depth (m):			5.4864		
Latitude:			43.5533346226137		
Longitude:			-79.5829645348772		
X:			-79.58296438531897		
Y:			43.55333462078887		
Path:			715\7157716.pdf		
<u>Bore Hole Information</u>					
Bore Hole ID:			1003456088		
DP2BR:			Elevation:		
Spatial Status:			Elevrc:		
Code OB:			Zone:		
Code OB Desc:			East83:		
Open Hole:			North83:		
Cluster Kind:			Org CS:		
Date Completed:			UTMRC:		
Remarks:			UTMRC Desc:		
Location Method Desc:			Location Method:		
Elevrc Desc:			17		
Location Source Date:			614459.00		
Improvement Location Source:			4823240.00		
Improvement Location Method:			UTM83		
Source Revision Comment:			3		
Supplier Comment:			margin of error : 10 - 30 m		
			wwr		
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:			1003774050		
Layer:			2		
Color:			6		
General Color:			BROWN		
Material 1:			28		
Material 1 Desc:			SAND		
Material 2:			11		
Material 2 Desc:			GRAVEL		
Material 3:			85		
Material 3 Desc:			SOFT		
Formation Top Depth:			2.0		
Formation End Depth:			16.0		
Formation End Depth UOM:			ft		
<u>Overburden and Bedrock</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Materials Interval</u>					
Formation ID:		1003774051			
Layer:		3			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:					
Material 2 Desc:					
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		16.0			
Formation End Depth:		18.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003774049			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		2.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1003774060			
Layer:		1			
Plug From:		0.0			
Plug To:		7.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1003774061			
Layer:		2			
Plug From:		7.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1003774062			
Layer:		3			
Plug From:		1.0			
Plug To:		0.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well</u>					
<u>Use</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Method Construction ID: 1003774058 Method Construction Code: B Method Construction: Other Method Other Method Construction: DIRECT PUSH					
<u>Pipe Information</u>					
Pipe ID: 1003774048 Casing No: 0 Comment: Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID: 1003774054 Layer: 1 Material: 5 Open Hole or Material: PLASTIC Depth From: 0.0 Depth To: 8.0 Casing Diameter: 0.75 Casing Diameter UOM: inch Casing Depth UOM: ft					
<u>Construction Record - Screen</u>					
Screen ID: 1003774055 Layer: 1 Slot: 10 Screen Top Depth: 8.0 Screen End Depth: 18.0 Screen Material: 5 Screen Depth UOM: ft Screen Diameter UOM: inch Screen Diameter: 1.0					
<u>Water Details</u>					
Water ID: 1003774053 Layer: Kind Code: Kind: Water Found Depth: Water Found Depth UOM: ft					
<u>Hole Diameter</u>					
Hole ID: 1003774052 Diameter: 3.25 Depth From: 0.0 Depth To: 18.0 Hole Depth UOM: ft Hole Diameter UOM: inch					
149	1 of 1	ESE/216.0	79.8 / 0.00	103 LAKESHORE RD E Mississauga ON	WWIS
Well ID: 7187903 Construction Date: Use 1st: Monitoring and Test Hole Flowing (Y/N): Flow Rate: Data Entry Status:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Use 2nd:	0			Data Src:	
Final Well Status:	Observation Wells			Date Received:	09/24/2012
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z156839			Contractor:	7241
Tag:	A137098			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:	WKQ-005210				
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/718\7187903.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	08/17/2012				
Year Completed:	2012				
Depth (m):	4.572				
Latitude:	43.553307771666				
Longitude:	-79.5829775442907				
X:	-79.58297739382083				
Y:	43.5533077693398				
Path:	718\7187903.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1004163423			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614458.00
Code OB Desc:				North83:	4823237.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	08/17/2012			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1004442208				
Layer:	4				
Color:	2				
General Color:	GREY				
Material 1:	06				
Material 1 Desc:	SILT				
Material 2:	28				
Material 2 Desc:	SAND				
Material 3:	91				
Material 3 Desc:	WATER-BEARING				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation Top Depth:		8.0			
Formation End Depth:		15.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004442205			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		01			
Material 1 Desc:		FILL			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		4.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004442207			
Layer:		3			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		6.0			
Formation End Depth:		8.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004442206			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		34			
Material 1 Desc:		TILL			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		4.0			
Formation End Depth:		6.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004442216			
Layer:		1			
Plug From:		15.0			
Plug To:		4.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004442218			
Layer:		3			
Plug From:		1.0			
Plug To:		0.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004442217			
Layer:		2			
Plug From:		4.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1004442215			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1004442204			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1004442211			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		5.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1004442212			
Layer:		1			
Slot:		10			
Screen Top Depth:		5.0			
Screen End Depth:		15.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.25			
<u>Water Details</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water ID:		1004442210			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1004442209			
Diameter:		4.25			
Depth From:		0.0			
Depth To:		15.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
150	1 of 1	ESE/216.0	79.8 / 0.00	103 LAKESHORE RD E MISSISSAUGA ON	WWIS
Well ID:	7183548			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	07/06/2012
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z151074			Contractor:	7241
Tag:	A125614			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/718\7183548.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	05/30/2012				
Year Completed:	2012				
Depth (m):	4.5				
Latitude:	43.5532276790652				
Longitude:	-79.5830537020799				
X:	-79.5830535520751				
Y:	43.55322767650989				
Path:	718\7183548.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1003962303			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614452.00
Code OB Desc:				North83:	4823228.00
Open Hole:				Org CS:	UTM83

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Cluster Kind:				UTMRC:	4
Date Completed:	05/30/2012	UTMRC Desc:			margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1004340780				
Layer:	1				
Color:	6				
General Color:	BROWN				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:	11				
Material 2 Desc:	GRAVEL				
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	0.0				
Formation End Depth:	1.0				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1004340782				
Layer:	3				
Color:	2				
General Color:	GREY				
Material 1:	06				
Material 1 Desc:	SILT				
Material 2:	08				
Material 2 Desc:	FINE SAND				
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	3.0				
Formation End Depth:	4.5				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1004340781				
Layer:	2				
Color:	6				
General Color:	BROWN				
Material 1:	06				
Material 1 Desc:	SILT				
Material 2:	28				
Material 2 Desc:	SAND				
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	1.0				
Formation End Depth:	3.0				
Formation End Depth UOM:	m				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004340788			
Layer:		1			
Plug From:		0.0			
Plug To:		3.0999999046325684			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006113218			
Layer:		3			
Plug From:		1.2000000476837158			
Plug To:		4.5			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006113217			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.2100000381469727			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1004340787			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1004340779			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1004340785			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.5			
Casing Diameter:		4.019999980926514			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1004340786			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.5			
Screen End Depth:		4.5			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.820000171661377			
<u>Water Details</u>					
Water ID:		1004340784			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1004340783			
Diameter:		10.899999618530273			
Depth From:		0.0			
Depth To:		4.5			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
151	1 of 1	NNE/216.1	78.8 / -1.05	30 Queen St East Mississauga ON	WWIS
Well ID:		7363632		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring		Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:		Observation Wells		Date Received: 08/07/2020	
Water Type:				Selected Flag: TRUE	
Casing Material:				Abandonment Rec:	
Audit No:		5NZ4J5JW		Contractor: 7609	
Tag:		A283540		Form Version: 9	
Constructn Method:				Owner:	
Elevation (m):				County: PEEL	
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY (PORT CREDIT)			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/736\7363632.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		07/27/2020			
Year Completed:		2020			
Depth (m):		4.57			
Latitude:		43.5562823303872			
Longitude:		-79.5846906593135			
X:		-79.58469050900673			
Y:		43.55628232739904			
Path:		736\7363632.pdf			
<u>Bore Hole Information</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bore Hole ID:	1008371677			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614314.00
Code OB Desc:				North83:	4823565.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	07/27/2020			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1008371793				
Layer:	3				
Color:	6				
General Color:	BROWN				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:	06				
Material 2 Desc:	SILT				
Material 3:	11				
Material 3 Desc:	GRAVEL				
Formation Top Depth:	3.049999952316284				
Formation End Depth:	4.570000171661377				
Formation End Depth UOM:	m				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1008371791				
Layer:	1				
Color:	6				
General Color:	BROWN				
Material 1:	01				
Material 1 Desc:	FILL				
Material 2:	28				
Material 2 Desc:	SAND				
Material 3:	77				
Material 3 Desc:	LOOSE				
Formation Top Depth:	0.0				
Formation End Depth:	1.5199999809265137				
Formation End Depth UOM:	m				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1008371792				
Layer:	2				
Color:	6				
General Color:	BROWN				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:					
Material 2 Desc:					
Material 3:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3 Desc:					
Formation Top Depth:		1.5199999809265137			
Formation End Depth:		3.049999952316284			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008371883			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		1.5199999809265137			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008371884			
Layer:		3			
Plug From:		1.5199999809265137			
Plug To:		4.570000171661377			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008371856			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008371882			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1008371757			
Method Construction Code:		E			
Method Construction:		Auger			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1008371726			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1008371818			
Layer:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.5199999809265137			
Casing Diameter:		5.0			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1008371828			
Layer:		1			
Slot:		010			
Screen Top Depth:		1.5199999809265137			
Screen End Depth:		4.570000171661377			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.0			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1008371727			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1008371841			
Diameter:		21.0			
Depth From:		0.0			
Depth To:		4.570000171661377			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
152	1 of 1	NNW/216.1	78.8 / -1.00	ON	BORE
Borehole ID:		640916		Inclin FLG:	
OGF ID:		215541311		SP Status:	
Status:				Surv Elev:	
Type:		Borehole		Piezometer:	
Use:		Geotechnical/Geological Investigation		Primary Name:	
Completion Date:		JAN-1965		Municipality:	
Static Water Level:				Lot:	
Primary Water Use:		Not Used		Township:	
Sec. Water Use:				Latitude DD:	
Total Depth m:		1.2		Longitude DD:	
				43.556191	
				-79.586171	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614195
Drill Method:	Power auger			Northing:	4823553
Orig Ground Elev m:	82.9			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	82.5				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218494061			Mat Consistency:	
Top Depth:	.3			Material Moisture:	
Bottom Depth:	1.2			Material Texture:	Medium
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM,SILT, CLAY. ALLUVIAL,AGE POST-GLACIAL. T,CLAY.				
Geology Stratum ID:	218494060			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.3			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:	Gravel			Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL,SAND,SILT, GRAVEL.				
Geology Stratum ID:	218494059			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	0			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ASPHALT.				
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 088820 NTS_Sheet: 30M12A				
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.				
<u>Source List</u>					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Originators:		Geological Survey of Canada			
153	1 of 15	NW/216.9	78.8 / -1.00	30 QUEEN ST E Mississauga ON	WWIS
Well ID:		7234471	Flowing (Y/N):		
Construction Date:			Flow Rate:		
Use 1st:		Monitoring	Data Entry Status:		
Use 2nd:			Data Src:		
Final Well Status:		Observation Wells	Date Received:		12/30/2014
Water Type:			Selected Flag:		TRUE
Casing Material:			Abandonment Rec:		
Audit No:		Z192922	Contractor:		7295
Tag:		A168568	Form Version:		7
Constructn Method:			Owner:		
Elevation (m):			County:		
Elevatn Reliabilty:			Lot:		
Depth to Bedrock:			Concession:		
Well Depth:			Concession Name:		
Overburden/Bedrock:			Easting NAD83:		
Pump Rate:			Northing NAD83:		
Static Water Level:			Zone:		
Clear/Cloudy:			UTM Reliability:		
Municipality:					
Site Info:					
<u>Bore Hole Information</u>					
Bore Hole ID:		1005281118	Elevation:		
DP2BR:			Elevrc:		
Spatial Status:			Zone:		17
Code OB:			East83:		
Code OB Desc:			North83:		
Open Hole:			Org CS:		UTM83
Cluster Kind:			UTMRC:		9
Date Completed:		10/24/2014	UTMRC Desc:		unknown UTM
Remarks:			Location Method:		wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1005471809			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		34			
Material 1 Desc:		TILL			
Material 2:		17			
Material 2 Desc:		SHALE			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		22.0			
Formation End Depth:		30.0			
Formation End Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005471808			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		34			
Material 1 Desc:		TILL			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		8.0			
Formation End Depth:		22.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005471807			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:					
Material 2 Desc:					
Material 3:		08			
Material 3 Desc:		FINE SAND			
Formation Top Depth:		3.0			
Formation End Depth:		8.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005471806			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		01			
Material 1 Desc:		FILL			
Material 2:					
Material 2 Desc:					
Material 3:		11			
Material 3 Desc:		GRAVEL			
Formation Top Depth:		0.0			
Formation End Depth:		3.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005471816			
Layer:		1			
Plug From:		0.0			
Plug To:		24.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Method Construction ID: 1005471815 Method Construction Code: 6 Method Construction: Boring Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID: 1005471805 Casing No: 0 Comment: Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID: 1005471812 Layer: 1 Material: 5 Open Hole or Material: PLASTIC Depth From: 0.0 Depth To: 25.0 Casing Diameter: 1.7999999523162842 Casing Diameter UOM: inch Casing Depth UOM: ft					
<u>Construction Record - Screen</u>					
Screen ID: 1005471813 Layer: 1 Slot: 10 Screen Top Depth: 25.0 Screen End Depth: 30.0 Screen Material: 5 Screen Depth UOM: ft Screen Diameter UOM: inch Screen Diameter: 2.0					
<u>Water Details</u>					
Water ID: 1005471811 Layer: Kind Code: Kind: Water Found Depth: Water Found Depth UOM: ft					
<u>Hole Diameter</u>					
Hole ID: 1005471810 Diameter: Depth From: Depth To: Hole Depth UOM: ft Hole Diameter UOM: inch					
153	2 of 15	NW/216.9	78.8 / -1.00	Metrolinx 30 Queen Street East Mississauga ON L5H 1L4	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON5182768			Choice of Contact:	CO_ADMIN
Approval Years:	2016			Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	482114
Country:	Canada				
Co Admin:	Cathy Lumsden				
Phone No Admin:	416-202-5167 Ext.				
SIC Description:	482114				
<u>Waste Detail(s)</u>					
Waste Class:	146				
Waste Class Name:	OTHER SPECIFIED INORGANICS				
153	3 of 15	NW/216.9	78.8 / -1.00	Metrolinx 30 Queen Street East Mississauga ON L5H 1L4	GEN
<u>Generator Info</u>					
Generator No:	ON5182768			Choice of Contact:	CO_ADMIN
Approval Years:	2015			Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	482114
Country:	Canada				
Co Admin:	Cathy Lumsden				
Phone No Admin:	905-803-8008 Ext.2607				
SIC Description:	482114				
<u>Waste Detail(s)</u>					
Waste Class:	146				
Waste Class Name:	OTHER SPECIFIED INORGANICS				
153	4 of 15	NW/216.9	78.8 / -1.00	Metrolinx 30 Queen Street East Mississauga ON L5H 1L4	GEN
<u>Generator Info</u>					
Generator No:	ON5182768			Choice of Contact:	CO_OFFICIAL
Approval Years:	2014			Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	482114
Country:	Canada				
Co Admin:	Emily Cosburn				
Phone No Admin:	(416) 869-3600 Ext.5209				
SIC Description:	482114				
<u>Waste Detail(s)</u>					
Waste Class:	146				
Waste Class Name:	OTHER SPECIFIED INORGANICS				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
153	5 of 15	NW/216.9	78.8 / -1.00	Metrolinx 30 Queen Street East Mississauga ON L5H 1L4	GEN

Generator Info

Generator No:	ON5182768	Choice of Contact:
Approval Years:	As of Dec 2018	Contaminated Fac:
Status:	Registered	MHSW Facility:
PO Box No:		SIC Code:
Country:	Canada	
Co Admin:		
Phone No Admin:		
SIC Description:		

Waste Detail(s)

Waste Class:	146 L
Waste Class Name:	Other specified inorganic sludges, slurries or solids

153	6 of 15	NW/216.9	78.8 / -1.00	Metrolinx 30 Queen Street East Mississauga ON L5G 3B7	GEN

Generator Info

Generator No:	ON2615101	Choice of Contact:
Approval Years:	As of Dec 2018	Contaminated Fac:
Status:	Registered	MHSW Facility:
PO Box No:		SIC Code:
Country:	Canada	
Co Admin:		
Phone No Admin:		
SIC Description:		

Waste Detail(s)

Waste Class:	146 L
Waste Class Name:	Other specified inorganic sludges, slurries or solids

2017 Generator Info

Gen No:	ON2615101	Choice of Contact:	CO_ADMIN
ID:	10473	Phone No Official:	6472315789 Ext.
Contaminated Fac:	N	Phone No Admin:	5198402257 Ext.
MHSW Facility:	N	County Ont:	PEEL (R. M.)
NAICS Code1:	485110	County Out:	
NAICS Code2:		District:	305
NAICS Code3:			
Gen Name:	Metrolinx		
Gen Div:			
Gen Op Name:	Metrolinx		
Gen Op Div:			
Site Adrs1:	30 Queen Street East		
Site Bldg:			
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	Mississauga		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Province Out: Site Postal Code: L5G 3B7 Site Country: Canada Co Official: Javier Mena Diep Co Admin: Jennifer Mule					
<u>2018 Generator Info</u>					
Gen No: ON2615101 ID: 10227 Contaminated Fac: N MHSW Facility: N NAICS Code1: 485110 NAICS Code2: NAICS Code3: Gen Name: Metrolinx Gen Div: Gen Op Name: Metrolinx Gen Op Div: Site Adrs1: 30 Queen Street East Site Bldg: Site Pobox: Province In: ONTARIO Site Adrs2: Site City: Mississauga Province Out: Site Postal Code: L5G 3B7 Site Country: Canada Co Official: Javier Mena Diep Co Admin: Jennifer Mule					
Choice of Contact: CO_ADMIN Phone No Official: 6472315789 Ext. Phone No Admin: 5198402257 Ext. County Ont: PEEL (R. M.) County Out: District: 305					

153

7 of 15

NW/216.9

78.8 / -1.00

Metrolinx
30 Queen St E
Mississauga ON L5G 3B7

GEN

Generator Info

Generator No: ON7891479
Approval Years: As of Oct 2019
Status: Registered
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description:

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code:

Waste Detail(s)

Waste Class: 251 U
Waste Class Name: Waste oils/sludges (petroleum based)

Waste Detail(s)

Waste Class: 251 L
Waste Class Name: Waste oils/sludges (petroleum based)

Waste Detail(s)

Waste Class: 221 L
Waste Class Name: Light fuels

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>2019 Generator Info</u>					
Gen No:	ON7891479			Choice of Contact:	CO_ADMIN
ID:	31770			Phone No Official:	416-996-8048 Ext.
Contaminated Fac:	N			Phone No Admin:	416-5240789 Ext.
MHSW Facility:	N			County Ont:	PEEL (R. M.)
NAICS Code1:	482112			County Out:	
NAICS Code2:	482113			District:	305
NAICS Code3:	482114				
Gen Name:	Metrolinx				
Gen Div:	Capital Projects Group				
Gen Op Name:	Metrolinx				
Gen Op Div:	AFP Early Works				
Site Adrs1:	30 Queen St E				
Site Bldg:	Port Credit GO Station				
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Mississauga				
Province Out:					
Site Postal Code:	L5G 3B7				
Site Country:	Canada				
Co Official:	Elysia Targa				
Co Admin:	Lana Kabialka				
<u>2019 Generator Manifest</u>					
ID:	58245			Sum Received Qty:	18650.0
Generator No:	ON7891479			Waste Class Name:	OIL SKIMMINGS & SLUDGES
Receiver Type:	035			Count Manifests:	4
Waste Char:	L			District:	301
Waste Code:	251				
153	8 of 15	NW/216.9	78.8 / -1.00	Metrolinx 30 Queen Street East Mississauga ON L5H 1L4	GEN
<u>Generator Info</u>					
Generator No:	ON5182768			Choice of Contact:	
Approval Years:	As of Jul 2020			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:	146 L				
Waste Class Name:	Other specified inorganic sludges, slurries or solids				
153	9 of 15	NW/216.9	78.8 / -1.00	Salini Impregilo Civil Works Inc. 30 Queen Street East Mississauga, ON Canada ON	PTTW
EBR Registry No:	019-3001			Decision Posted:	May 21, 2021
Ministry Ref No:	7721-BW3NJF			Exception Posted:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Notice Type: Instrument Notice Stage: Decision Notice Date: Proposal Date: January 21, 2021 Year: 2021 Instrument Type: Permit to take water Off Instrument Name: Permit to Take Water (OWRA s. 34) Posted By: Ministry of the Environment, Conservation and Parks Company Name: Site Address: 30 Queen Street East Mississauga, ON Canada Location Other: Proponent Name: Salini Impregilo Civil Works Inc. Proponent Address: Salini Impregilo Civil Works Inc. 110 Matheson Boulevard West Suite 400 Mississauga, ON L5R 4G7 Canada Comment Period: January 21, 2021 - February 20, 2021 (30 days) Closed URL: https://ero.ontario.ca/notice/019-3001 Summary: Site Location Details:					
153	10 of 15	NW/216.9	78.8 / -1.00	Metrolinx 30 Queen Street East Mississauga ON L5H 1L4	GEN
Generator Info					
Generator No: ON5182768 Approval Years: As of Nov 2021 Status: Registered PO Box No: Country: Canada Co Admin: Phone No Admin: SIC Description:					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:					
Waste Detail(s)					
Waste Class: 146 L Waste Class Name: Other specified inorganic sludges, slurries or solids					
153	11 of 15	NW/216.9	78.8 / -1.00	Salini Impregilo Civil Works Inc. 30 Queen ST E Mississauga ON L5R 4G7	EASR
Approval No: R-009-7113160571 Status: REGISTERED Date: 2021-04-30 Record Type: EASR Link Source: MOFA Project Type: Water Taking - Construction Dewatering Full Address: Approval Type: EASR-Water Taking - Construction Dewatering SWP Area Name: Credit Valley PDF NAICS Code: PDF URL: PDF Site Location:					
MOE District: Halton-Peel Municipality: Mississauga Latitude: 43.55527778 Longitude: -79.5875 Geometry X: -8859639.9735 Geometry Y: 5396876.357299998					
153	12 of 15	NW/216.9	78.8 / -1.00	Mobilinx 30 Queen Street East	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mississauga ON L5G 4N6					
<u>Generator Info</u>					
Generator No:	ON3332947			Choice of Contact:	
Approval Years:	As of Nov 2021			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:	221 L				
Waste Class Name:	Light fuels				
153	13 of 15	NW/216.9	78.8 / -1.00	Metrolinx 30 Queen Street East Mississauga ON L5H 1L4	GEN
<u>Generator Info</u>					
Generator No:	ON5182768			Choice of Contact:	
Approval Years:	As of Oct 2022			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:	146 L				
Waste Class Name:	OTHER SPECIFIED INORGANICS				
<u>2017 Generator Info</u>					
Gen No:	ON5182768			Choice of Contact:	CO_ADMIN
ID:	20556			Phone No Official:	(416) 869-3600 Ext.5209
Contaminated Fac:	N			Phone No Admin:	416-202-5167 Ext.
MHSW Facility:	N			County Ont:	PEEL (R. M.)
NAICS Code1:	482114			County Out:	
NAICS Code2:				District:	305
NAICS Code3:					
Gen Name:	Metrolinx				
Gen Div:					
Gen Op Name:	GO Transit				
Gen Op Div:	Station Operations West				
Site Adrs1:	30 Queen Street East				
Site Bldg:	Port Credit GO Station				
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Mississauga				
Province Out:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Postal Code:		L5H 1L4			
Site Country:		Canada			
Co Official:		Emily Cosburn			
Co Admin:		Cathy Lumsden			
<u>2018 Generator Info</u>					
Gen No:	ON5182768			Choice of Contact:	CO_ADMIN
ID:	20677			Phone No Official:	(416) 869-3600 Ext.5209
Contaminated Fac:	N			Phone No Admin:	416-202-1899 Ext.
MHSW Facility:	N			County Ont:	PEEL (R. M.)
NAICS Code1:	482114			County Out:	
NAICS Code2:				District:	305
NAICS Code3:					
Gen Name:	Metrolinx				
Gen Div:					
Gen Op Name:	GO Transit				
Gen Op Div:	Station Operations West				
Site Adrs1:	30 Queen Street East				
Site Bldg:	Port Credit GO Station				
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Mississauga				
Province Out:					
Site Postal Code:	L5H 1L4				
Site Country:	Canada				
Co Official:	Emily Cosburn				
Co Admin:	Marlene Labog				
<u>2019 Generator Info</u>					
Gen No:	ON5182768			Choice of Contact:	CO_ADMIN
ID:	20712			Phone No Official:	(416) 869-3600 Ext.5209
Contaminated Fac:	N			Phone No Admin:	416-202-1899 Ext.
MHSW Facility:	N			County Ont:	PEEL (R. M.)
NAICS Code1:	482114			County Out:	
NAICS Code2:				District:	305
NAICS Code3:					
Gen Name:	Metrolinx				
Gen Div:					
Gen Op Name:	GO Transit				
Gen Op Div:	Station Operations West				
Site Adrs1:	30 Queen Street East				
Site Bldg:	Port Credit GO Station				
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Mississauga				
Province Out:					
Site Postal Code:	L5H 1L4				
Site Country:	Canada				
Co Official:	Emily Cosburn				
Co Admin:	Marlene Labog				
<u>2020 Generator Info</u>					
Gen No:	ON5182768			Choice of Contact:	CO_ADMIN
ID:	20460			Phone No Official:	6472899741 Ext.5209
Contaminated Fac:	N			Phone No Admin:	416-202-5167 Ext.
MHSW Facility:	N			County Ont:	PEEL (R. M.)
NAICS Code1:	482114			County Out:	
NAICS Code2:				District:	305

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
NAICS Code3: Gen Name:Metrolinx Gen Div: Gen Op Name:GO Transit Gen Op Div:Station Operations West Site Adrs1:30 Queen Street East Site Bldg:Port Credit GO Station Site Pobox: Province In:ONTARIO Site Adrs2: Site City:Mississauga Province Out: Site Postal Code:L5H 1L4 Site Country:Canada Co Official:Catherine Catherine Lumsden Co Admin:Cathy Lumsden					
2021 Generator Info Gen No:ON5182768 ID:20623 Contaminated Fac:N MHSW Facility:N NAICS Code1:482114 NAICS Code2: NAICS Code3: Gen Name:Metrolinx Gen Div: Gen Op Name:GO Transit Gen Op Div:Station Operations West Site Adrs1:30 Queen Street East Site Bldg:Port Credit GO Station Site Pobox: Province In:ONTARIO Site Adrs2: Site City:Mississauga Province Out: Site Postal Code:L5H 1L4 Site Country:Canada Co Official:Catherine Catherine Lumsden Co Admin:Cathy Lumsden Choice of Contact:CO_ADMIN Phone No Official:6472899741 Ext.5209 Phone No Admin:416-202-5167 Ext. County Ont:PEEL (R. M.) County Out: District:305					
153	14 of 15	NW/216.9	78.8 / -1.00	Mobilinx 30 Queen Street East Mississauga ON L5G 4N6	GEN
Generator Info Generator No:ON3332947 Approval Years:As of Oct 2022 Status:Registered PO Box No: Country:Canada Co Admin: Phone No Admin: SIC Description: Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:					
Waste Detail(s) Waste Class:221 L Waste Class Name:LIGHT FUELS					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		146 L			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>2021 Generator Info</u>					
Gen No:	ON3332947			Choice of Contact:	CO_OFFICIAL
ID:	12569			Phone No Official:	416-220-8104 Ext.
Contaminated Fac:	N			Phone No Admin:	416-220-7459 Ext.
MHSW Facility:	N			County Ont:	PEEL (R. M.)
NAICS Code1:	237990			County Out:	
NAICS Code2:				District:	305
NAICS Code3:					
Gen Name:	Mobilinx				
Gen Div:					
Gen Op Name:	Mobilinx				
Gen Op Div:					
Site Adrs1:	30 Queen Street East				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Mississauga				
Province Out:					
Site Postal Code:	L5G 4N6				
Site Country:	Canada				
Co Official:	Fiona Wilson				
Co Admin:	Michael Woo				
<u>2021 Generator Manifest</u>					
ID:	32503			Sum Received Qty:	12000.0
Generator No:	ON3332947			Waste Class Name:	LIGHT FUELS
Receiver Type:	035			Count Manifests:	1
Waste Char:	L			District:	306
Waste Code:	221				
153	15 of 15	NW/216.9	78.8 / -1.00	Metrolinx 30 Queen Street East Mississauga, ON MISSISSAUGA ON	SPL
Ref No:	1-4QQAIP			Municipality No:	
Year:				Nature of Damage:	
Incident Dt:	Mar 03,2024 08:54:19 PM			Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:	Mar 03,2024 09:42:19 PM			Impact to Health:	
Dt Document Closed:	Mar 06,2024 02:50:32 PM			Agency Involved:	
Site No:					
MOE Response:	Desktop Response				
Site County/District:					
Site Geo Ref Meth:					
Site District Office:	Halton-Peel District Office				
Nearest Watercourse:					
Site Name:	Metrolinx				
Site Address:	30 Queen Street East Mississauga, ON				
Site Region:	REGIONAL MUNICIPALITY OF PEEL				
Site Municipality:	MISSISSAUGA				
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Map Datum: Northings: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: Incident Preceding Spill: Incident Reason: Incident Summary: Metrolinx: 5-10L coolant to ground; clng Environment Impact: Health Env Consequence: Low Nature of Impact: Contaminant Qty: 10 litre (L) Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: COOLANT (N.O.S.) Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Land Activity Preceding Spill: Property 2nd Watershed: Lake Ontario and Niagara Peninsula Property Tertiary Watershed: 02HB-Credit - 16 Mile Sector Type: SAC Action Class: Call Report Locatn Geodata: {"integration_ids":["PR00001938818"],"wks":["POINT (-79.5851013000 43.5567695000)","creation_date":"2024-03-03"} Time Reported: System Facility Address: 97 FRONT ST W, UNIT 438, TORONTO, ON M5J 1E7					

154	1 of 1	NNE/218.5	79.7 / -0.17	ON	BORE
Borehole ID: 639273 OGF ID: 215539670 Status: Type: Borehole Use: Geotechnical/Geological Investigation Completion Date: JAN-1965 Static Water Level: Primary Water Use: Not Used Sec. Water Use: Total Depth m: 1.2 Depth Ref: Ground Surface Depth Elev: Drill Method: Power auger Orig Ground Elev m: 82.8 Elev Reliabil Note: DEM Ground Elev m: 82.5 Concession: Location D: Survey D: Comments:					
Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD: 43.556259 Longitude DD: -79.584436 UTM Zone: 17 Easting: 614335 Northings: 4823563 Location Accuracy: Accuracy: Not Applicable					
Borehole Geology Stratum					
Geology Stratum ID: 218487720 Top Depth: .3 Bottom Depth: .5 Material Color: Brown					
Mat Consistency: Material Moisture: Material Texture: Medium Non Geo Mat Type:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 1:	Fill			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:	Clay			Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:		FILL,SAND-MEDIUM, SILT,CLAY. BROWN.			
Geology Stratum ID:	218487722			Mat Consistency:	
Top Depth:	.6			Material Moisture:	Wet
Bottom Depth:	1.2			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:		SAND,SILT,CLAY. BROWN,ALLUVIAL,WET. GLACIAL.			
Geology Stratum ID:	218487718			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	0			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		ASPHALT.			
Geology Stratum ID:	218487719			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.3			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:		FILL,GRAVEL.			
Geology Stratum ID:	218487721			Mat Consistency:	
Top Depth:	.5			Material Moisture:	
Bottom Depth:	.6			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Soil			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:	Clay			Depositional Gen:	
Gsc Material Description:					
Stratum Description:		SOIL,SAND,SILT,CLAY.BROWN.			
Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Details:		File: TOR1B.txt RecordID: 072360 NTS_Sheet: 30M12A			
Confiden 1:		Logs are approximately correct. Lack of information. Doubtful terminology.			

Source List

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
155	1 of 1	ENE/219.0	79.8 / 0.00	ON	BORE
Borehole ID:	640924			Inclin FLG:	No
OGF ID:	215541319			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.555704
Total Depth m:	1.2			Longitude DD:	-79.583211
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614435
Drill Method:	Power auger			Northing:	4823503
Orig Ground Elev m:	190			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	80.5				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218494099			Mat Consistency:	
Top Depth:	.4			Material Moisture:	
Bottom Depth:	.6			Material Texture:	Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND-MEDIUM,SILT, CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL.				
Geology Stratum ID:	218494096			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ASPHALT.				
Geology Stratum ID:	218494097			Mat Consistency:	
Top Depth:	.1			Material Moisture:	
Bottom Depth:	.2			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Stratum Description:		FILL,GRAVEL. BROWN.			
Geology Stratum ID:	218494100			Mat Consistency:	
Top Depth:	.6			Material Moisture:	
Bottom Depth:	1.2			Material Texture:	Medium
Material Color:	Yellow			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:		SAND-MEDIUM. YELLOW,ALLUVIAL, AGE POST-GLACIAL. SAND- **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:	218494098			Mat Consistency:	
Top Depth:	.2			Material Moisture:	
Bottom Depth:	.4			Material Texture:	Medium
Material Color:	Yellow			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:		SAND-MEDIUM. YELLOW,ALLUVIAL, AGE POST-GLACIAL.			
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 088900 NTS_Sheet: 30M12A				
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.				
<u>Source List</u>					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
156	1 of 1	S/219.4	79.8 / 0.00	STAVEBANK RD PORT CREDIT ON	WWIS
Well ID:	4909856			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Not Used			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	07/29/2005
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	Z29080			Contractor:	7219
Tag:	A027048			Form Version:	3
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY (PORT CREDIT)			
Site Info:					
PDF URL (Map):				https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/490\4909856.pdf	
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		06/23/2005			
Year Completed:		2005			
Depth (m):					
Latitude:		43.5523992443778			
Longitude:		-79.5852297050978			
X:		-79.58522955494118			
Y:		43.55239924147197			
Path:		490\4909856.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		11323589		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614277.80
Code OB Desc:				North83:	4823133.00
Open Hole:				Org CS:	G83a
Cluster Kind:				UTMRC:	4
Date Completed:		06/23/2005		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933273855			
Layer:		1			
Plug From:		0.0			
Plug To:		3.9619998931884766			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		964909856			
Method Construction Code:					
Method Construction:					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11338444			
Casing No:		1			
Comment:					
Alt Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:		930866643			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:					
Casing Diameter:		5.079999923706055			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		11350597			
Pump Set At:					
Static Level:		1.218999981880188			
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		11543468			
Diameter:		5.079999923706055			
Depth From:		0.0			
Depth To:		3.9619998931884766			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
157	1 of 1	SSW/219.5	79.8 / 0.00	10 STAREBANK MISSISSAUGA ON	WWIS
Well ID:	4909501			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	1
Final Well Status:	Observation Wells			Date Received:	07/21/2004
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z14488			Contractor:	6607
Tag:	A011790			Form Version:	3
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Municipality:		MISSISSAUGA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/490\4909501.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		06/14/2004			
Year Completed:		2004			
Depth (m):		6			
Latitude:		43.5524711061095			
Longitude:		-79.5859435866319			
X:		-79.5859434368808			
Y:		43.55247110358789			
Path:		490\4909501.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		11177129	Elevation:		
DP2BR:			Elevrc:		
Spatial Status:			Zone:		17
Code OB:			East83:		614220.00
Code OB Desc:			North83:		4823140.00
Open Hole:			Org CS:		UTM83
Cluster Kind:			UTMRC:		3
Date Completed:		06/14/2004	UTMRC Desc:		margin of error : 10 - 30 m
Remarks:			Location Method:		wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		932981839			
Layer:		4			
Color:					
General Color:					
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		3.5			
Formation End Depth:		6.0			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		932981836			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 2 Desc:		GRAVEL			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.30000001192092896			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		932981837			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.30000001192092896			
Formation End Depth:		3.5			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		932981838			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		3.5			
Formation End Depth:		3.5			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		933259162			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		4.5			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		933259161			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
 <u>Method of Construction & Well</u> <u>Use</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Method Construction ID: Method Construction Code: Method Construction: Other Method Construction:		964909501	6	Boring	
<u>Pipe Information</u>					
Pipe ID: Casing No: Comment: Alt Name:		11185648	1		
<u>Construction Record - Casing</u>					
Casing ID: Layer: Material: Open Hole or Material: Depth From: Depth To: Casing Diameter: Casing Diameter UOM: Casing Depth UOM:		930849433	1	5	PLASTIC
			0.0	4.5	
			5.0	cm	
			m		
<u>Construction Record - Screen</u>					
Screen ID: Layer: Slot: Screen Top Depth: Screen End Depth: Screen Material: Screen Depth UOM: Screen Diameter UOM: Screen Diameter:		933410171	1	10	4.5
			6.0	5	
			m	cm	
			6.400000095367432		
<u>Water Details</u>					
Water ID: Layer: Kind Code: Kind: Water Found Depth: Water Found Depth UOM:		934054873	1	1	FRESH
			4.0	m	
<u>Hole Diameter</u>					
Hole ID: Diameter: Depth From: Depth To: Hole Depth UOM: Hole Diameter UOM:		11311167	21.0	0.0	6.0
			m	cm	
158	1 of 1	SE/219.5	79.8 / 0.00	42 PORT ST E. & 91-93, 99 LAKESHORE RD E., PORT CREDIT Mississauga ON L5G 1E2	EHS
Order No: Status: Report Type:		22090200426	C	Custom Report	
		Nearest Intersection: Municipality: Client Prov/State:			
		ON			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Report Date:	12-SEP-22			Search Radius (km):	.25
Date Received:	02-SEP-22			X:	-79.58322338
Previous Site Name:				Y:	43.5530281
Lot/Building Size:					
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans; Aerial Photos				

159	1 of 1	SSW/220.9	79.8 / 0.00	20 STAVEBANK DR MISSISSAUGA ON	WWIS
Well ID:	7168029			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	09/01/2011
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z136784			Contractor:	7241
Tag:	A114323			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:	X				
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/716\7168029.pdf				

Additional Detail(s) (Map)

Well Completed Date:	07/24/2011
Year Completed:	2011
Depth (m):	
Latitude:	43.5525661724227
Longitude:	-79.5863499034812
X:	-79.58634975283096
Y:	43.55256616957749
Path:	716\7168029.pdf

Bore Hole Information

Bore Hole ID:	1003558160	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614187.00
Code OB Desc:		North83:	4823150.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	3
Date Completed:	07/24/2011	UTMRC Desc:	margin of error : 10 - 30 m
Remarks:		Location Method:	www
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003917726			
Layer:		2			
Plug From:		1.0			
Plug To:		8.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003917727			
Layer:		3			
Plug From:		8.0			
Plug To:		20.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003917725			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003917724			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1003917716			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003917720			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		10.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1003917721			
Layer:		1			
Slot:		10			
Screen Top Depth:		10.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen End Depth: 20.0 Screen Material: 5 Screen Depth UOM: ft Screen Diameter UOM: inch Screen Diameter: 2.25					
<u>Water Details</u>					
Water ID: 1003917719 Layer: Kind Code: Kind: Water Found Depth: Water Found Depth UOM: ft					
<u>Hole Diameter</u>					
Hole ID: 1003917718 Diameter: 6.0 Depth From: 0.0 Depth To: 20.0 Hole Depth UOM: ft Hole Diameter UOM: inch					

160	1 of 17	SSW/221.7	79.8 / 0.00	PAT IACOVETTA CLEANERS (HUTONE) 14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	GEN

Generator Info

Generator No:	ON0446500	Choice of Contact:	
Approval Years:	86,87,88,89,90	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	9721
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	POWER LAUND./CLEANERS		

Waste Detail(s)

Waste Class:	241
Waste Class Name:	HALOGENATED SOLVENTS

160	2 of 17	SSW/221.7	79.8 / 0.00	PAT IACOVETTA CLEANERS (HUTONE) 14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	GEN

Generator Info

Generator No:	ON0446500	Choice of Contact:	
Approval Years:	92,93,97,98,99,00	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	9721
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	POWER LAUND./CLEANER		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
160	3 of 17	SSW/221.7	79.8 / 0.00	PAT IACOVETTA CLEANERS (HUTONE) 30-096 14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	GEN
<u>Generator Info</u>					
Generator No:		ON0446500		Choice of Contact:	
Approval Years:		94,95,96		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	
Country:				9721	
Co Admin:					
Phone No Admin:					
SIC Description:		POWER LAUND./CLEANER			
<u>Waste Detail(s)</u>					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
160	4 of 17	SSW/221.7	79.8 / 0.00	PAT (OUT OF BUS) 14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	GEN
<u>Generator Info</u>					
Generator No:		ON0446500		Choice of Contact:	
Approval Years:		01		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	
Country:				9721	
Co Admin:					
Phone No Admin:					
SIC Description:		POWER LAUND./CLEANERS			
<u>Waste Detail(s)</u>					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
160	5 of 17	SSW/221.7	79.8 / 0.00	HUTONE CLEANERS 14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	GEN
<u>Generator Info</u>					
Generator No:		ON0446500		Choice of Contact:	
Approval Years:		02,03,04,05,06,07,08		Contaminated Fac:	
Status:				MHSW Facility:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PO Box No:		SIC Code:		812320	
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		Dry Cleaning & Laundry Serv. (exc. Coin-Op.)			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
160	6 of 17	SSW/221.7	79.8 / 0.00	HUTONE CLEANERS 14 STAVEBANK ROAD NORTH MISSISSAUGA ON	GEN
<u>Generator Info</u>					
Generator No:		ON0446500		Choice of Contact:	
Approval Years:		2009		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	
Country:				812320	
Co Admin:					
Phone No Admin:					
SIC Description:		Dry Cleaning and Laundry Services (except Coin-Operated)			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
160	7 of 17	SSW/221.7	79.8 / 0.00	HUTONE CLEANERS 14 STAVEBANK ROAD NORTH MISSISSAUGA ON	GEN
<u>Generator Info</u>					
Generator No:		ON0446500		Choice of Contact:	
Approval Years:		2010		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	
Country:				812320	
Co Admin:					
Phone No Admin:					
SIC Description:		Dry Cleaning and Laundry Services (except Coin-Operated)			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
160	8 of 17	SSW/221.7	79.8 / 0.00	HUTONE CLEANERS 14 STAVEBANK ROAD NORTH MISSISSAUGA ON	GEN
<u>Generator Info</u>					
Generator No:	ON0446500			Choice of Contact:	
Approval Years:	2011			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	812320
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		Dry Cleaning and Laundry Services (except Coin-Operated)			
<u>Waste Detail(s)</u>					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
160	9 of 17	SSW/221.7	79.8 / 0.00	HUTONE CLEANERS 14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	GEN
<u>Generator Info</u>					
Generator No:	ON0446500			Choice of Contact:	
Approval Years:	2012			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	812320
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		Dry Cleaning and Laundry Services (except Coin-Operated)			
<u>Waste Detail(s)</u>					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
<u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
160	10 of 17	SSW/221.7	79.8 / 0.00	HUTONE CLEANERS 14 STAVEBANK ROAD NORTH MISSISSAUGA ON	GEN
Generator Info					
Generator No:		ON0446500		Choice of Contact:	
Approval Years:		2013		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code: 812320	
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		DRY CLEANING AND LAUNDRY SERVICES (EXCEPT COIN-OPERATED)			
Waste Detail(s)					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Detail(s)					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
160	11 of 17	SSW/221.7	79.8 / 0.00	HUTONE CLEANERS 14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	GEN
Generator Info					
Generator No:		ON0446500		Choice of Contact: CO_OFFICIAL	
Approval Years:		2016		Contaminated Fac: No	
Status:				MHSW Facility: No	
PO Box No:				SIC Code: 812320	
Country:		Canada			
Co Admin:					
Phone No Admin:					
SIC Description:		DRY CLEANING AND LAUNDRY SERVICES (EXCEPT COIN-OPERATED)			
Waste Detail(s)					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Detail(s)					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
160	12 of 17	SSW/221.7	79.8 / 0.00	HUTONE CLEANERS 14 STAVEBANK ROAD NORTH	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
MISSISSAUGA ON L5G 2T4					
<u>Generator Info</u>					
Generator No:	ON0446500			Choice of Contact:	CO_OFFICIAL
Approval Years:	2015			Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	812320
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:	DRY CLEANING AND LAUNDRY SERVICES (EXCEPT COIN-OPERATED)				
<u>Waste Detail(s)</u>					
Waste Class:	241				
Waste Class Name:	HALOGENATED SOLVENTS				
<u>Waste Detail(s)</u>					
Waste Class:	213				
Waste Class Name:	PETROLEUM DISTILLATES				
160	13 of 17	SSW/221.7	79.8 / 0.00	HUTONE CLEANERS 14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	GEN
<u>Generator Info</u>					
Generator No:	ON0446500			Choice of Contact:	CO_OFFICIAL
Approval Years:	2014			Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	812320
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:	DRY CLEANING AND LAUNDRY SERVICES (EXCEPT COIN-OPERATED)				
<u>Waste Detail(s)</u>					
Waste Class:	241				
Waste Class Name:	HALOGENATED SOLVENTS				
<u>Waste Detail(s)</u>					
Waste Class:	213				
Waste Class Name:	PETROLEUM DISTILLATES				
160	14 of 17	SSW/221.7	79.8 / 0.00	HUTONE CLEANERS 14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	GEN
<u>Generator Info</u>					
Generator No:	ON0446500			Choice of Contact:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Approval Years:		As of Dec 2018		Contaminated Fac:	
Status:		Registered		MHSW Facility:	
PO Box No:				SIC Code:	
Country:		Canada			
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		213 L			
Waste Class Name:		Petroleum distillates			

160	15 of 17	SSW/221.7	79.8 / 0.00	Hutone Cleaners - Mississauga 14 Stavebank Rd Mississauga ON L5G2T4	CDRY

Legal Name of Company:
Region:
Type of Reporter:

Waste Quantity by Year

Reporting Year: 2008
Quantity of PERC (kg): -
Total Waste Water (kg): -
Total Waste Water (L): 114
Total Residue (kg): -
Total Residue (L): 114
Total Mix (kg): 0
Total Mix (L): -
Request for Confidentiality: No
Reason For Confidentiality:

Reporting Year: 2007
Quantity of PERC (kg): 121.5
Total Waste Water (kg): 0
Total Waste Water (L): -
Total Residue (kg): 15
Total Residue (L): -
Total Mix (kg): 0
Total Mix (L): -
Request for Confidentiality: No
Reason For Confidentiality: N/A

Reporting Year: 2006
Quantity of PERC (kg): 89
Total Waste Water (kg): 0
Total Waste Water (L): -
Total Residue (kg): 45
Total Residue (L): -
Total Mix (kg): 0
Total Mix (L): -
Request for Confidentiality: No
Reason For Confidentiality: N/A

Reporting Year: 2004
Quantity of PERC (kg): 70
Total Waste Water (kg): 0
Total Waste Water (L): -
Total Residue (kg): 182.25
Total Residue (L): -
Total Mix (kg): 0

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Total Mix (L):		-			
Request for Confidentiality:		No			
Reason For Confidentiality:		N/A			

160	16 of 17	SSW/221.7	79.8 / 0.00	HUTONE CLEANERS 14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	GEN

Generator Info

Generator No:	ON0446500	Choice of Contact:
Approval Years:	As of Oct 2019	Contaminated Fac:
Status:	Registered	MHSW Facility:
PO Box No:		SIC Code:
Country:	Canada	
Co Admin:		
Phone No Admin:		
SIC Description:		

Waste Detail(s)

Waste Class:	213 L
Waste Class Name:	Petroleum distillates

160	17 of 17	SSW/221.7	79.8 / 0.00	HUTONE CLEANERS 14 STAVEBANK ROAD NORTH MISSISSAUGA ON L5G 2T4	GEN

Generator Info

Generator No:	ON0446500	Choice of Contact:
Approval Years:	As of Nov 2021	Contaminated Fac:
Status:	Registered	MHSW Facility:
PO Box No:		SIC Code:
Country:	Canada	
Co Admin:		
Phone No Admin:		
SIC Description:		

Waste Detail(s)

Waste Class:	213 L
Waste Class Name:	Petroleum distillates

2017 Generator Info

Gen No:	ON0446500	Choice of Contact:	CO_OFFICIAL
ID:	3732	Phone No Official:	905-278-8363 Ext.
Contaminated Fac:	N	Phone No Admin:	
MHSW Facility:	N	County Ont:	PEEL (R. M.)
NAICS Code1:	812320	County Out:	
NAICS Code2:		District:	305
NAICS Code3:			
Gen Name:	HUTONE CLEANERS		
Gen Div:			
Gen Op Name:	HUTONE CLEANERS		
Gen Op Div:			
Site Adrs1:	14 STAVEBANK ROAD NORTH		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Bldg: Site Pobox: Province In: ONTARIO Site Adrs2: Site City: MISSISSAUGA Province Out: Site Postal Code: L5G 2T4 Site Country: Canada Co Official: BYUNG W. KO Co Admin:					
<u>2018 Generator Info</u>					
Gen No:	ON0446500			Choice of Contact:	CO_OFFICIAL
ID:	3651			Phone No Official:	905-278-8363 Ext.
Contaminated Fac:	N			Phone No Admin:	
MHSW Facility:	N			County Ont:	PEEL (R. M.)
NAICS Code1:	812320			County Out:	
NAICS Code2:				District:	305
NAICS Code3:					
Gen Name:	HUTONE CLEANERS				
Gen Div:					
Gen Op Name:	HUTONE CLEANERS				
Gen Op Div:					
Site Adrs1:	14 STAVEBANK ROAD NORTH				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	MISSISSAUGA				
Province Out:					
Site Postal Code:	L5G 2T4				
Site Country:	Canada				
Co Official:	BYUNG W. KO				
Co Admin:					
<u>2018 Generator Manifest</u>					
ID:	15444			Sum Received Qty:	200.0
Generator No:	ON0446500			Waste Class Name:	PETROLEUM DISTILLATES
Receiver Type:	035			Count Manifests:	2
Waste Char:	L			District:	305
Waste Code:	213				
<u>2019 Generator Info</u>					
Gen No:	ON0446500			Choice of Contact:	CO_OFFICIAL
ID:	3555			Phone No Official:	905-278-8363 Ext.
Contaminated Fac:	N			Phone No Admin:	
MHSW Facility:	N			County Ont:	PEEL (R. M.)
NAICS Code1:	812320			County Out:	
NAICS Code2:				District:	305
NAICS Code3:					
Gen Name:	HUTONE CLEANERS				
Gen Div:					
Gen Op Name:	HUTONE CLEANERS				
Gen Op Div:					
Site Adrs1:	14 STAVEBANK ROAD NORTH				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	MISSISSAUGA				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Province Out:					
Site Postal Code:		L5G 2T4			
Site Country:		Canada			
Co Official:		BYUNG W. KO			
Co Admin:					
2019 Generator Manifest					
ID:	15134			Sum Received Qty:	114.0
Generator No:	ON0446500			Waste Class Name:	PETROLEUM DISTILLATES
Receiver Type:	035			Count Manifests:	1
Waste Char:	L			District:	305
Waste Code:	213				
2020 Generator Info					
Gen No:	ON0446500			Choice of Contact:	CO_OFFICIAL
ID:	3458			Phone No Official:	905-278-8363 Ext.
Contaminated Fac:	N			Phone No Admin:	
MHSW Facility:	N			County Ont:	PEEL (R. M.)
NAICS Code1:	812320			County Out:	
NAICS Code2:				District:	305
NAICS Code3:					
Gen Name:	HUTONE CLEANERS				
Gen Div:					
Gen Op Name:	HUTONE CLEANERS				
Gen Op Div:					
Site Adrs1:	14 STAVEBANK ROAD NORTH				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	MISSISSAUGA				
Province Out:					
Site Postal Code:	L5G 2T4				
Site Country:	Canada				
Co Official:	BYUNG W. KO				
Co Admin:					
2020 Generator Manifest					
ID:	13619			Sum Received Qty:	110.0
Generator No:	ON0446500			Waste Class Name:	PETROLEUM DISTILLATES
Receiver Type:	035			Count Manifests:	1
Waste Char:	L			District:	305
Waste Code:	213				
2021 Generator Info					
Gen No:	ON0446500			Choice of Contact:	CO_OFFICIAL
ID:	3385			Phone No Official:	905-278-8363 Ext.
Contaminated Fac:	N			Phone No Admin:	
MHSW Facility:	N			County Ont:	PEEL (R. M.)
NAICS Code1:	812320			County Out:	
NAICS Code2:				District:	305
NAICS Code3:					
Gen Name:	HUTONE CLEANERS				
Gen Div:					
Gen Op Name:	HUTONE CLEANERS				
Gen Op Div:					
Site Adrs1:	14 STAVEBANK ROAD NORTH				
Site Bldg:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Pobox: Province In: ONTARIO Site Adrs2: Site City: MISSISSAUGA Province Out: Site Postal Code: L5G 2T4 Site Country: Canada Co Official: BYUNG W. KO Co Admin:					
<u>2021 Generator Manifest</u>					
ID: 13788 Generator No: ON0446500 Receiver Type: 035 Waste Char: L Waste Code: 213		Sum Received Qty: 60.0 Waste Class Name: PETROLEUM DISTILLATES Count Manifests: 1 District: 305			
<u>161</u>	1 of 1	NE/222.2	79.8 / 0.00	84 & 90 High Street East Mississauga ON L5G 1K4	EHS
Order No: 20190924039 Status: C Report Type: RSC Report (Urban) Report Date: 26-SEP-19 Date Received: 24-SEP-19 Previous Site Name: Lot/Building Size: Additional Info Ordered: City Directory		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .3 X: -79.583497 Y: 43.555938			
<u>162</u>	1 of 1	NW/223.3	78.8 / -1.00	Mary Fix Creek, north of the Port Credit Go Station MISSISSAUGA ON	SPL
Ref No: 1-HG8TA Year: Incident Dt: 6/3/2021 8:30:56 AM Dt MOE Arvl on Scn: MOE Reported Dt: 6/4/2021 2:42:58 PM Dt Document Closed: 6/8/2021 7:20:14 AM Site No: MOE Response: Desktop Response Site County/District: Site Geo Ref Meth: Site District Office: Halton-Peel District Office Nearest Watercourse: Mary Fix Creek Site Name: Site Address: Mary Fix Creek, north of the Port Credit Go Station Site Region: REGIONAL MUNICIPALITY OF PEEL Site Municipality: MISSISSAUGA Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: Incident Preceding Spill:		Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: 0 No Impact Agency Involved:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Incident Reason: Incident Summary: Mobilinx: 1000L release of rainwater to Mary Fix Creek Environment Impact: 0 No Impact Health Env Consequence: Nature of Impact: Contaminant Qty: 0 other - see notes Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: WATER Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Surface Water Activity Preceding Spill: Property 2nd Watershed: Lake Ontario and Niagara Peninsula Property Tertiary Watershed: 02HB-Credit - 16 Mile Sector Type: INDUSTRIAL BUILDING AND STRUCTURE CONSTRUCTION SAC Action Class: Call Report Locatn Geodata: {"integration_ids":["PR00001654666"],"wkts":["POINT (-79.5868783000 43.5559786000)","POINT (-79.5868783000 43.5559786000)"],"creation_date":"2021-06-04"} Time Reported: System Facility Address:					

<u>163</u>	1 of 1	SW/223.6	79.8 / 0.00	ON	BORE
Borehole ID: 639271 OGF ID: 215539668 Status: Type: Borehole Use: Geotechnical/Geological Investigation Completion Date: JAN-1965 Static Water Level: Primary Water Use: Not Used Sec. Water Use: Total Depth m: 2.7 Depth Ref: Ground Surface Depth Elev: Drill Method: Power auger Orig Ground Elev m: 81.7 Elev Reliabil Note: DEM Ground Elev m: 80.5 Concession: Location D: Survey D: Comments:					
Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD: 43.552593 Longitude DD: -79.586503 UTM Zone: 17 Easting: 614175 Northing: 4823153 Location Accuracy: Accuracy: Not Applicable					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: 218487710 Top Depth: 0 Bottom Depth: .1 Material Color: Material 1: Fill Material 2: Gravel Material 3: Material 4: Gsc Material Description: Stratum Description: FILL, GRAVEL.					
Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen: fill					
Geology Stratum ID: 218487712 Top Depth: 1.8 Mat Consistency: Material Moisture:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bottom Depth:2.4 Material Color:Brown Material 1:Silt Material 2:Sand Material 3:Clay Material 4: Gsc Material Description: Stratum Description:SILT,SAND,CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL. Geology Stratum ID:218487713 Top Depth:2.4 Bottom Depth:2.7 Material Color: Material 1:Sand Material 2:Silt Material 3:Clay Material 4: Gsc Material Description: Stratum Description:SAND-MEDIUM,SILT, CLAY. ALLUVIAL,AGE POST-GLACIAL. Geology Stratum ID:218487711 Top Depth:.1 Bottom Depth:1.8 Material Color:Brown Material 1:Sand Material 2:Silt Material 3:Clay Material 4: Gsc Material Description: Stratum Description:SAND,SILT,CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL.					
Source Source Type:Data Survey Source Orig:Geological Survey of Canada Source Date:1956-1972 Confidence:M Observatio: Source Name:Urban Geology Automated Information System (UGAIS) Source Details:File: TOR1B.txt RecordID: 072340 NTS_Sheet: 30M12A Confiden 1:Logs are approximately correct. Lack of information. Doubtful terminology. Source Appl:Spatial/Tabular Source Iden:1 Scale or Res:Varies Horizontal:NAD27 Verticalda:Mean Average Sea Level					
Source List Source Identifier:1 Source Type:Data Survey Source Date:1956-1972 Scale or Resolution:Varies Source Name:Urban Geology Automated Information System (UGAIS) Source Originators:Geological Survey of Canada Horizontal Datum:NAD27 Vertical Datum:Mean Average Sea Level Projection Name:Universal Transverse Mercator					
164	1 of 1	NNE/223.9	78.7 / -1.15	ON	BORE
Borehole ID:646205 OGF ID:215546588 Status: Type:Borehole Use:Geotechnical/Geological Investigation Completion Date:MAY-1968 Static Water Level: Primary Water Use:Not Used Sec. Water Use: Inclin FLG: SP Status:Initial Entry Surv Elev: Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD:43.556353					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Total Depth m:	8.2			Longitude DD:	-79.584682
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614315
Drill Method:	Diamond Drill			Northing:	4823573
Orig Ground Elev m:	81.1			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	82.9				
Concession:					
Location D:					
Survey D:					
Comments:					
 <u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218514022			Mat Consistency:	Dense
Top Depth:	0			Material Moisture:	
Bottom Depth:	3			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Silt			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Sand			Geologic Period:	
Material 4:				Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	SILT,CLAY,SAND. BROWN,GLACIAL,DENSE, AGE GLACIAL.				
Geology Stratum ID:	218514023			Mat Consistency:	Hard
Top Depth:	3			Material Moisture:	
Bottom Depth:	7.1			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	TILL,CLAY. GREY,GLACIAL,HARD,AGE GLACIAL.				
Geology Stratum ID:	218514024			Mat Consistency:	
Top Depth:	7.1			Material Moisture:	
Bottom Depth:	8.2			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Shale			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	Ordovician
Material 4:				Depositional Gen:	marine
Gsc Material Description:					
Stratum Description:	SHALE. GREY,MARINE,AGE ORDOVICIAN. 00000025AGE GLACIAL **Note: Many records provided by the department have a truncated [Stratum Description] field.				
 <u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR2.txt RecordID: 142270 NTS_Sheet: 30M12A				
Confiden 1:	Reliable information but incomplete.				
 <u>Source List</u>					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				

165	1 of 1	WNW/224.3	78.8 / -1.00	PORT CREDIT GO STATION PORT CREDIT ON	WWIS
Well ID:	7321814			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	11/07/2018
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z266907			Contractor:	6607
Tag:	A232747			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/732\7321814.pdf				

Additional Detail(s) (Map)

Well Completed Date:	01/19/2018
Year Completed:	2018
Depth (m):	4.5
Latitude:	43.5552750532576
Longitude:	-79.5876979521631
X:	-79.58769780180813
Y:	43.55527505058381
Path:	732\7321814.pdf

Bore Hole Information

Bore Hole ID:	1007307140	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	614073.00
Code OB Desc:		North83:	4823449.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	01/19/2018	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Materials Interval</u>					
Formation ID:		1007605523			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		1.5			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007605524			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		1.5			
Formation End Depth:		3.0			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007605525			
Layer:		3			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		3.0			
Formation End Depth:		4.5			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007605533			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		1.5			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		1007605532			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007605531			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007605522			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007605528			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.5			
Casing Diameter:		5.099999904632568			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007605529			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.5			
Screen End Depth:		4.5			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.400000095367432			
<u>Water Details</u>					
Water ID:		1007605527			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1007605526			
Diameter:		15.0			
Depth From:		0.0			
Depth To:		4.5			
Hole Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole Diameter UOM:		cm			
166	1 of 1	SE/225.4	79.7 / -0.13	DISTANT HORIZON MARINE 6 ELIZABETH ST S MISSISSAUGA ON L5G 2Y5	SCT
Established:		1979			
Plant Size (ft²):		1			
Employment:					
--Details--					
Description:		TRANSPORTATION EQUIPMENT, EXCEPT MOTOR VEHICLES			
SIC/NAICS Code:		5088			
167	1 of 5	SSW/225.6	79.8 / 0.00	The Corporation of the City of Mississauga 12 Stavbank Road Mississauga ON	SPL
Ref No:		6650-7ALNJR		Municipality No:	
Year:				Nature of Damage:	
Incident Dt:				Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:		1/6/2008		Impact to Health:	
Dt Document Closed:				Agency Involved:	
Site No:					
MOE Response:					
Site County/District:					
Site Geo Ref Meth:					
Site District Office:		Halton-Peel			
Nearest Watercourse:					
Site Name:		Grassy and treed area<UNOFFICIAL>			
Site Address:					
Site Region:					
Site Municipality:		Mississauga			
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Entity Operating Name:					
Client Name:		The Corporation of the City of Mississauga			
Client Type:					
Source Type:					
Incident Cause:		Pipe Or Hose Leak			
Incident Preceding Spill:					
Incident Reason:		Equipment Failure			
Incident Summary:		Sanitary sewage spill with grease to grassy area, clog			
Environment Impact:		Confirmed			
Health Env Consequence:					
Nature of Impact:		Soil Contamination			
Contaminant Qty:					
Contaminant Qty 1:					
Contaminant Unit:					
Contaminant Code:		44			
Contaminant Name:		SEWAGE,RAW UNCHLORINATED			
Contaminant Limit 1:					
Contam Limit Freq 1:					
Contaminant UN No 1:					
Receiving Medium:					
Activity Preceding Spill:					
Property 2nd Watershed:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Property Tertiary Watershed: Sector Type: Sewer SAC Action Class: Land Spills Call Report Locatn Geodata: Time Reported: System Facility Address:					
167	2 of 5	SSW/225.6	79.8 / 0.00	12 Stavebank Road Mississauga ON L5G 2T4	SPL
Ref No: 7860-7LSR8C Year: Incident Dt: Dt MOE Arvl on Scn: MOE Reported Dt: 11/27/2008 Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Halton-Peel Nearest Watercourse: Site Name: Spill Location<UNOFFICIAL> Site Address: Site Region: Site Municipality: Mississauga Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: Other Discharges Incident Preceding Spill: Incident Reason: Other - Reason not otherwise defined Incident Summary: Mississauga - Sanitary sewage spill to catch basin Environment Impact: Possible Health Env Consequence: Nature of Impact: Surface Water Pollution Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: 44 Contaminant Name: SEWAGE,RAW UNCHLORINATED Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Sewage Municipal SAC Action Class: Watercourse Spills Call Report Locatn Geodata: Time Reported: System Facility Address:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
167	3 of 5	SSW/225.6	79.8 / 0.00	CREDIT VILLAGE MARINA 12 STAVEBANK RD MISSISSAUGA ON L5G 2T4	RST
Headcode: 00824400 Headcode Desc: MARINAS Phone: List Name: Description:					
167	4 of 5	SSW/225.6	79.8 / 0.00	CREDIT VILLAGE MARINA 12 STAVEBANK RD MISSISSAUGA ON L5G2T4	RST
Headcode: 00824400 Headcode Desc: MARINAS Phone: 9056154880 List Name: Description:					
167	5 of 5	SSW/225.6	79.8 / 0.00	Credit Village Marina-Port Credit Harbour 12 Stavebank Road Mississauga ON	SPL
Ref No: 6618-AD8QHN Year: Incident Dt: 8/27/2016 Dt MOE Arvl on Scn: MOE Reported Dt: 8/27/2016 Dt Document Closed: Site No: NA MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Lake Ontario Site Name: 12 Stavebank Road, marina<UNOFFICIAL> Site Address: 12 Stavebank Road Site Region: Site Municipality: Mississauga Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Credit Village Marina-Port Credit Harbour Client Type: Source Type: Incident Cause: Incident Preceding Spill: Leak/Break Incident Reason: Deliberate Act Incident Summary: Credit Village Marina - Diesel spilled to Lake Ontario, Mississauga Environment Impact: Health Env Consequence: Nature of Impact: Contaminant Qty: 0 other - see incident description Contaminant Qty 1: 0 Contaminant Unit: other - see incident description Contaminant Code: 13 Contaminant Name: DIESEL FUEL					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Surface Water; Source Water Zone Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Miscellaneous Communal SAC Action Class: Watercourse Spills Call Report Locatn Geodata: Time Reported: System Facility Address:					
168	1 of 1	NE/225.7	79.8 / 0.00	Ann Street and High Street East Mississauga ON L5G	EHS
Order No: 22070500121 Status: C Report Type: Custom Report Report Date: 08-JUL-22 Date Received: 05-JUL-22 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.58375796 Y: 43.55610953					
169	1 of 1	NW/226.3	78.8 / -1.00	ON	BORE
Borehole ID: 833908 OGF ID: 215586039 Status: Decommissioned Type: Borehole Use: Geotechnical/Geological Investigation Completion Date: 03-FEB-1977 Static Water Level: 0.9 Primary Water Use: Sec. Water Use: Total Depth m: 6.1 Depth Ref: Ground Surface Depth Elev: Drill Method: Hollow stem auger Orig Ground Elev m: 82.3 Elev Reliabil Note: DEM Ground Elev m: 83.3 Concession: Location D: PORT CREDIT GO STATION * PLATFORM SHELTER Survey D: Comments:					
Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD: 43.556047 Longitude DD: -79.586813 UTM Zone: 17 Easting: 614143 Northing: 4823536 Location Accuracy: Accuracy: Within 10 metres					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: 6014843 Top Depth: 1.1 Bottom Depth: 2.7 Material Color: Material 1: Sand Material 2: Silt Material 3: Material 4: Gsc Material Description: Stratum Description: Silty fine sand, compact to very dense **Note: Many records provided by the department have a truncated [Stratum					
Mat Consistency: Compact Material Moisture: Material Texture: Fine Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Description] field.					
Geology Stratum ID:	6014844			Mat Consistency:	Very Stiff
Top Depth:	2.7			Material Moisture:	
Bottom Depth:	6.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Sand			Geologic Period:	
Material 4:	Gravel			Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	Het. mix of clayey silt, sand and gravel (glacial till), very stiff to hard **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	6014842			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	1.1			Material Texture:	
Material Color:				Non Geo Mat Type:	Fill-Misc
Material 1:	Silt			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Gravel			Geologic Period:	
Material 4:	organic material			Depositional Gen:	
Gsc Material Description:					
Stratum Description:	Clayey silt, sand and few gravel, traces of organics - fill **Note: Many records provided by the department have a truncated [Stratum Description] field.				
170	1 of 1	SE/226.5	79.8 / 0.00	LAKE SHORE 91/99 Mississauga ON	WWIS
Well ID:	7148418			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Test Hole			Date Received:	07/16/2010
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z114392			Contractor:	7241
Tag:	A099972			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/714\7148418.pdf				
Additional Detail(s) (Map)					
Well Completed Date:	06/10/2010				
Year Completed:	2010				
Depth (m):	4.572				
Latitude:	43.55297701891				
Longitude:	-79.5831709967224				
X:	-79.58317084688309				
Y:	43.55297701650207				
Path:	714\7148418.pdf				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Bore Hole Information</u>					
Bore Hole ID:	1003169219			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614443.00
Code OB Desc:				North83:	4823200.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	06/10/2010			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1003209303				
Layer:	2				
Color:	2				
General Color:	GREY				
Material 1:	06				
Material 1 Desc:	SILT				
Material 2:	28				
Material 2 Desc:	SAND				
Material 3:					
Material 3 Desc:					
Formation Top Depth:	8.0				
Formation End Depth:	15.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1003209302				
Layer:	1				
Color:	6				
General Color:	BROWN				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:					
Material 2 Desc:					
Material 3:	77				
Material 3 Desc:	LOOSE				
Formation Top Depth:	0.0				
Formation End Depth:	8.0				
Formation End Depth UOM:	ft				
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1003209305				
Layer:	1				
Plug From:	0.0				
Plug To:	1.0				
Plug Depth UOM:	ft				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003209307			
Layer:		3			
Plug From:		4.0			
Plug To:		15.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003209306			
Layer:		2			
Plug From:		1.0			
Plug To:		4.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003209313			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1003209301			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003209309			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		5.0			
Casing Diameter:		1.5			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1003209310			
Layer:		1			
Slot:		10			
Screen Top Depth:		5.0			
Screen End Depth:		15.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.75			
<u>Water Details</u>					
Water ID:		1003209308			
Layer:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Kind Code: Kind: Water Found Depth: Water Found Depth UOM: ft					
<u>Hole Diameter</u> Hole ID: 1003209304 Diameter: 10.920000076293945 Depth From: 0.0 Depth To: 15.0 Hole Depth UOM: ft Hole Diameter UOM: inch					
171	1 of 1	NE/226.8	79.8 / 0.00	High St. E., Ann St. Mississauga ON L5G	EHS
Order No: 20312600085 Status: C Report Type: Custom Report Report Date: 01-DEC-20 Date Received: 26-NOV-20 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .3 X: -79.5837371 Y: 43.5561117					
172	1 of 1	ENE/227.9	79.8 / 0.00	ON	BORE
Borehole ID: 646204 OGF ID: 215546587 Status: Type: Borehole Use: Geotechnical/Geological Investigation Completion Date: JUL-1969 Static Water Level: Primary Water Use: Not Used Sec. Water Use: Total Depth m: 9.9 Depth Ref: Ground Surface Depth Elev: Drill Method: Power auger Orig Ground Elev m: 79.7 Elev Reliabil Note: DEM Ground Elev m: 79.4 Concession: Location D: Survey D: Comments:					
Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD: 43.555156 Longitude DD: -79.582605 UTM Zone: 17 Easting: 614485 Northing: 4823443 Location Accuracy: Accuracy: Not Applicable					
<u>Borehole Geology Stratum</u> Geology Stratum ID: 218514020 Top Depth: 2.4 Bottom Depth: 2.5 Material Color: Grey Material 1: Till Material 2: Silt Material 3: Sand Material 4: Gravel Gsc Material Description: Stratum Description: TILL,SILT,SAND, GRAVEL. GREY,GLACIAL,DENSE, AGE GLACIAL.					
Mat Consistency: Dense Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen: glacial					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218514017 0 .1 Asphalt ASPHALT.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218514021 2.5 9.9 Grey Bedrock Shale Limestone BEDROCK, SHALE, LIMESTONE. GREY, MARINE, LAYERED, AGE ORDOVICIAN. 018 010 000500 **Note: Many records provided by the department have a truncated [Stratum Description] field.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	 Ordovician marine
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218514018 .1 1.5 Fill Silt Sand Gravel FILL, SILT, SAND, GRAVEL. DENSE.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Dense fill
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218514019 1.5 2.4 Brown Sand Silt SAND-MEDIUM, SILT. BROWN, GLACIAL, DENSE, AGE GLACIAL.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Dense Medium glacial
Source					
Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	Data Survey Geological Survey of Canada 1956-1972 M Urban Geology Automated Information System (UGAIS) File: TOR2.txt RecordID: 142260 NTS_Sheet: 30M12A Reliable information but incomplete.			Source Appl: Source Iden: Scale or Res: Horizontal: Verticalda:	Spatial/Tabular 1 Varies NAD27 Mean Average Sea Level
Source List					
Source Identifier: Source Type: Source Date: Scale or Resolution: Source Name:	1 Data Survey 1956-1972 Varies Urban Geology Automated Information System (UGAIS)			Horizontal Datum: Vertical Datum: Projection Name:	NAD27 Mean Average Sea Level Universal Transverse Mercator

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Originators:		Geological Survey of Canada			
173	1 of 2	N/228.3	78.8 / -1.00	26 ANN ST. MISSISSAUGA ON	WWIS
Well ID:		7341844	Flowing (Y/N):		
Construction Date:			Flow Rate:		
Use 1st:		Monitoring	Data Entry Status:		
Use 2nd:			Data Src:		
Final Well Status:		Observation Wells	Date Received: 09/16/2019		
Water Type:			Selected Flag: TRUE		
Casing Material:			Abandonment Rec:		
Audit No:		GNLFU7D8	Contractor: 6607		
Tag:		A271735	Form Version: 9		
Constructn Method:			Owner:		
Elevation (m):			County: PEEL		
Elevatn Reliabilty:			Lot:		
Depth to Bedrock:			Concession:		
Well Depth:			Concession Name:		
Overburden/Bedrock:			Easting NAD83:		
Pump Rate:			Northing NAD83:		
Static Water Level:			Zone:		
Clear/Cloudy:			UTM Reliability:		
Municipality:		MISSISSAUGA CITY (PORT CREDIT)			
Site Info:		MW 19-4 SH			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/734\7341844.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		08/19/2019			
Year Completed:		2019			
Depth (m):		36.576			
Latitude:		43.5564259320474			
Longitude:		-79.5853806219843			
X:		-79.58538047240486			
Y:		43.5564259296262			
Path:		734\7341844.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1007643207		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone: 17	
Code OB:				East83: 614258.00	
Code OB Desc:				North83: 4823580.00	
Open Hole:				Org CS: UTM83	
Cluster Kind:				UTMRC: 4	
Date Completed:		08/19/2019		UTMRC Desc: margin of error : 30 m - 100 m	
Remarks:				Location Method: wwr	
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007643851			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		17			
Material 1 Desc:		SHALE			
Material 2:		15			
Material 2 Desc:		LIMESTONE			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		27.0			
Formation End Depth:		120.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007643849			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		34			
Material 1 Desc:		TILL			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		15.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007643850			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		34			
Material 1 Desc:		TILL			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		15.0			
Formation End Depth:		27.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007644428			
Layer:		2			
Plug From:		1.0			
Plug To:		115.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007644293			
Layer:		1			
Plug From:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug To:					
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007644427			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007643576			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007643575			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007643428			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007644013			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		115.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007644093			
Layer:		1			
Slot:		10			
Screen Top Depth:		115.0			
Screen End Depth:		120.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.5			
<u>Results of Well Yield Testing</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pumping Test Method Desc:					
Pump Test ID:		1007643429			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007644189			
Diameter:		4.0			
Depth From:		30.0			
Depth To:		120.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Hole Diameter</u>					
Hole ID:		1007644188			
Diameter:		8.0			
Depth From:		0.0			
Depth To:		30.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
173	2 of 2	N/228.3	78.8 / -1.00	26 ANN ST. MISSISSAUGA ON	WWIS
Well ID:	7341883			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	09/16/2019
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	TOJ5WP3R			Contractor:	6607
Tag:	A271753			Form Version:	9
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY (PORT CREDIT)			
Site Info:		MW 19-4 DH			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/734\7341883.pdf			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	08/21/2019				
Year Completed:	2019				
Depth (m):	47.5488				
Latitude:	43.5564259320474				
Longitude:	-79.5853806219843				
X:	-79.58538047240486				
Y:	43.5564259296262				
Path:	734\7341883.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1007643324			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614258.00
Code OB Desc:				North83:	4823580.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	08/21/2019			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007643951				
Layer:	1				
Color:	6				
General Color:	BROWN				
Material 1:	34				
Material 1 Desc:	TILL				
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:	15.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007643952				
Layer:	2				
Color:	2				
General Color:	GREY				
Material 1:	34				
Material 1 Desc:	TILL				
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:	15.0				
Formation End Depth:	27.0				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007643953			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		17			
Material 1 Desc:		SHALE			
Material 2:		15			
Material 2 Desc:		LIMESTONE			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		27.0			
Formation End Depth:		156.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007644515			
Layer:		2			
Plug From:		1.0			
Plug To:		151.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007644514			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007644332			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007643627			
Method Construction Code:		3			
Method Construction:		Rotary (Reverse)			
Other Method Construction:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007643626			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007643628			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007643506			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007644049			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		151.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007644129			
Layer:		1			
Slot:		10			
Screen Top Depth:		151.0			
Screen End Depth:		156.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.5			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007643507			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole ID:		1007644239			
Diameter:		8.0			
Depth From:		0.0			
Depth To:		30.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
 <u>Hole Diameter</u>					
Hole ID:		1007644240			
Diameter:		4.0			
Depth From:		30.0			
Depth To:		156.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
174	1 of 1	WSW/228.4	79.8 / 0.00	ON	BORE
Borehole ID:	640869			Inclin FLG:	No
OGF ID:	215541264			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JAN-1965			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.553146
Total Depth m:	2.7			Longitude DD:	-79.58748
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614095
Drill Method:	Power auger			Northing:	4823213
Orig Ground Elev m:	83.2			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	82.6				
Concession:					
Location D:					
Survey D:					
Comments:					
 <u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218493861			Mat Consistency:	
Top Depth:	.1			Material Moisture:	
Bottom Depth:	.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL, GRAVEL.				
Geology Stratum ID:	218493862			Mat Consistency:	
Top Depth:	.1			Material Moisture:	
Bottom Depth:	2.7			Material Texture:	Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Stratum Description:		SAND-MEDIUM,SILT, CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL. LT, **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:	218493860			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ASPHALT.				
Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 088350 NTS_Sheet: 30M12A				
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.				
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
175	1 of 1	E/229.7	79.8 / 0.00	129 Lakeshore Road East Mississauga ON L5G 1E5	EHS
Order No:	22012000525			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	25-JAN-22			Search Radius (km):	.25
Date Received:	20-JAN-22			X:	-79.5823697
Previous Site Name:				Y:	43.5543931
Lot/Building Size:					
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans; City Directory				
176	1 of 1	NE/231.2	79.8 / 0.00	91 Park Street East Mississauga ON	WWIS
Well ID:	7408553			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	01/18/2022
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	LM6JDVNX			Contractor:	7282
Tag:	A333844			Form Version:	9
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:			Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:		
MISSISSAUGA CITY (PORT CREDIT) Job No. 57387, MW7					
PDF URL (Map):			https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/740\7408553.pdf		
Additional Detail(s) (Map)					
Well Completed Date: Year Completed: Depth (m): Latitude: Longitude: X: Y: Path:			12/15/2021 2021 43.556190433372 -79.5838137778357 -79.58381362781246 43.556190430497345 740\7408553.pdf		
Bore Hole Information					
Bore Hole ID: DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: Remarks: Location Method Desc: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:			1008929795 12/15/2021 on Water Well Record 		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug From:		0.0			
Plug To:					
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008929992			
Layer:		1			
Plug From:		0.0			
Plug To:		6.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008929994			
Layer:		3			
Plug From:		0.0			
Plug To:		51.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008929993			
Layer:		2			
Plug From:		0.0			
Plug To:		6.0			
Plug Depth UOM:		ft			
<u>Pipe Information</u>					
Pipe ID:		1008929839			
Casing No:		0			
Comment:					
Alt Name:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1008929840			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Water Details</u>					
Water ID:		1008929892			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Kind Code:		8			
Kind:		Untested			
Water Found Depth:		35.5			
Water Found Depth UOM:		ft			
177	1 of 1	ENE/233.5	79.8 / 0.00	ON	BORE
Borehole ID:	646203			Inclin FLG:	No
OGF ID:	215546586			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JUL-1969			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.555065
Total Depth m:	7.5			Longitude DD:	-79.582483
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614495
Drill Method:	Power auger			Northing:	4823433
Orig Ground Elev m:	79.2			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	78.8				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218514012			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Asphalt			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ASPHALT.				
Geology Stratum ID:	218514015			Mat Consistency:	Dense
Top Depth:	2.6			Material Moisture:	
Bottom Depth:	7.5			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Gravel			Geologic Period:	
Material 4:	Clay			Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	TILL,SILT,GRAVEL, CLAY. GREY,GLACIAL,VERY DENSE, LAYERED,AGE GLACIAL.				
Geology Stratum ID:	218514016			Mat Consistency:	
Top Depth:	7.5			Material Moisture:	
Bottom Depth:	7.5			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Bedrock			Geologic Formation:	
Material 2:	Shale			Geologic Group:	
Material 3:				Geologic Period:	Ordovician
Material 4:				Depositional Gen:	marine
Gsc Material Description:					
Stratum Description:	BEDROCK,SHALE. MARINE,AGE ORDOVICIAN. 022 010 0005004500085100				**Note: Many records provided by

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
the department have a truncated [Stratum Description] field.					
Geology Stratum ID:	218514013			Mat Consistency:	
Top Depth:	.1			Material Moisture:	Dry
Bottom Depth:	1.5			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Sand			Geologic Period:	
Material 4:	Clay			Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL,SILT,SAND,CLAY.DRY.				
Geology Stratum ID:	218514014			Mat Consistency:	Hard
Top Depth:	1.5			Material Moisture:	
Bottom Depth:	2.6			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	TILL,SILT,CLAY. BROWN,GLACIAL,HARD, AGE GLACIAL.				
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR2.txt RecordID: 142250 NTS_Sheet: 30M12A				
Confiden 1:	Reliable information but incomplete.				
<u>Source List</u>					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
178	1 of 1	ESE/233.9	79.6 / -0.22	99 LAKESHORE RD PORT CREDIT ON	WWIS
Well ID:	7211009			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	11/08/2013
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z179110			Contractor:	7472
Tag:	A155430			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY (PORT CREDIT)			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/721\7211009.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		05/06/2013			
Year Completed:		2013			
Depth (m):		12.1			
Latitude:		43.5530998175759			
Longitude:		-79.582908137046			
X:		-79.5829079873274			
Y:		43.55309981537821			
Path:		721\7211009.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1004629597		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614464.00
Code OB Desc:				North83:	4823214.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		05/06/2013		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004889458			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		17			
Material 1 Desc:		SHALE			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		6.0			
Formation End Depth:		12.100000381469727			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004889457			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		08			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 1 Desc:		FINE SAND			
Material 2:		66			
Material 2 Desc:		DENSE			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		6.0			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004889466			
Layer:		2			
Plug From:		8.5			
Plug To:		12.100000381469727			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004889465			
Layer:		1			
Plug From:		0.0			
Plug To:		8.5			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1004889464			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1004889456			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1004889461			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		9.100000381469727			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1004889462			
Layer:		1			
Slot:		10			
Screen Top Depth:		9.100000381469727			
Screen End Depth:		12.100000381469727			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.400000095367432			
<u>Water Details</u>					
Water ID:		1004889460			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1004889459			
Diameter:		21.0			
Depth From:		0.0			
Depth To:		12.100000381469727			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
179	1 of 1	NE/234.3	79.8 / 0.00	Park Street & Hurontario Street Mississauga ON	WWIS
Well ID:		7398230		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring		Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:		Observation Wells		Date Received:	09/16/2021
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:		7K89LCET		Contractor:	7472
Tag:		A333844		Form Version:	9
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY (PORT CREDIT)			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/739\7398230.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		07/08/2021			
Year Completed:		2021			
Depth (m):		15.8496			
Latitude:		43.5562172843983			
Longitude:		-79.5838007681375			
X:		-79.5838006184123			
Y:		43.55621728131299			
Path:		739\7398230.pdf			
<u>Bore Hole Information</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bore Hole ID:	1008786635			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614386.00
Code OB Desc:				North83:	4823559.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	07/08/2021			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1008787021				
Layer:	3				
Color:	2				
General Color:	GREY				
Material 1:	17				
Material 1 Desc:	SHALE				
Material 2:					
Material 2 Desc:					
Material 3:	73				
Material 3 Desc:	HARD				
Formation Top Depth:	25.0				
Formation End Depth:	52.0				
Formation End Depth UOM:	ft				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1008787020				
Layer:	2				
Color:	2				
General Color:	GREY				
Material 1:	05				
Material 1 Desc:	CLAY				
Material 2:	06				
Material 2 Desc:	SILT				
Material 3:	79				
Material 3 Desc:	PACKED				
Formation Top Depth:	4.0				
Formation End Depth:	25.0				
Formation End Depth UOM:	ft				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1008787019				
Layer:	1				
Color:	6				
General Color:	BROWN				
Material 1:	01				
Material 1 Desc:	FILL				
Material 2:					
Material 2 Desc:					
Material 3:	77				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		4.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008787267			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008787351			
Layer:		1			
Plug From:		0.0			
Plug To:		41.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008787352			
Layer:		2			
Plug From:		41.0			
Plug To:		52.0			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1008786831			
Method Construction Code:		E			
Method Construction:		Auger			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1008786755			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1008787108			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		42.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen ID:		1008787158			
Layer:		1			
Slot:		10			
Screen Top Depth:		42.0			
Screen End Depth:		52.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.5			
 <u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1008786756			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
 <u>Hole Diameter</u>					
Hole ID:		1008787210			
Diameter:		7.5			
Depth From:		0.0			
Depth To:		52.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
180	1 of 1	NNE/234.8	79.8 / 0.00	Park Street & Hurontario Street Mississauga ON	WWIS
Well ID:	7398199			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	09/16/2021
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	A9IW9OP2			Contractor:	7472
Tag:	A333801			Form Version:	9
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/739\7398199.pdf			
Additional Detail(s) (Map)					
Well Completed Date:		07/08/2021			
Year Completed:		2021			
Depth (m):		14.3256			
Latitude:		43.5562822879426			
Longitude:		-79.5839601953921			
X:		-79.58396004506427			
Y:		43.556282285700625			
Path:		739\7398199.pdf			
Bore Hole Information					
Bore Hole ID:		1008785701		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				East83:	
Code OB Desc:				North83:	
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	
Date Completed:		07/08/2021		UTMRC Desc:	
Remarks:				Location Method:	
Location Method Desc:		on Water Well Record		margin of error : 30 m - 100 m	
Elevrc Desc:				wwr	
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
Overburden and Bedrock					
Materials Interval					
Formation ID:		1008786035			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		01			
Material 1 Desc:		FILL			
Material 2:					
Material 2 Desc:					
Material 3:		77			
Material 3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		4.0			
Formation End Depth UOM:		ft			
Overburden and Bedrock					
Materials Interval					
Formation ID:		1008786036			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		79			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3 Desc:		PACKED			
Formation Top Depth:		4.0			
Formation End Depth:		25.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008786037			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		17			
Material 1 Desc:		SHALE			
Material 2:					
Material 2 Desc:					
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		25.0			
Formation End Depth:		47.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008786367			
Layer:		1			
Plug From:		0.0			
Plug To:		36.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008786368			
Layer:		2			
Plug From:		36.0			
Plug To:		47.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008786255			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1008785868			
Method Construction Code:		E			
Method Construction:		Auger			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1008785802			
Casing No:		0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Comment: Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1008786096			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		37.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1008786144			
Layer:		1			
Slot:		10			
Screen Top Depth:		37.0			
Screen End Depth:		47.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.5			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1008785803			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1008786205			
Diameter:		7.5			
Depth From:		0.0			
Depth To:		47.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
181	1 of 3	NE/235.2	79.8 / 0.00	90 High Street East, Mississauga ON	PINC
Incident Id:				Pipe Material:	
Incident No:	789716			Fuel Category:	Natural Gas
Incident Reported Dt:				Health Impact:	

411 erisinfo.com | Environmental Risk Information Services Order No: 25020500477

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Asmt Roll No: Project Type: POST2011 Approval Type: RSC based on Phase One and Two ESAs Applicable Standards: PDF Link: https://www.accessenvironment.ene.gov.on.ca/AEWeb/ae/ViewDocument.action?documentRefID=235951					

182	1 of 1	ESE/236.8	79.8 / 0.00	ON	BORE
Borehole ID: 640933 OGF ID: 215541328 Status: Type: Borehole Use: Geotechnical/Geological Investigation Completion Date: JAN-1965 Static Water Level: Primary Water Use: Not Used Sec. Water Use: Total Depth m: 2.4 Depth Ref: Ground Surface Depth Elev: Drill Method: Power auger Orig Ground Elev m: 78 Elev Reliabil Note: DEM Ground Elev m: 78.2 Concession: Location D: Survey D: Comments:					
Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD: 43.553534 Longitude DD: -79.582519 UTM Zone: 17 Easting: 614495 Northing: 4823263 Location Accuracy: Accuracy: Not Applicable					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: 218494145 Top Depth: 1.2 Bottom Depth: 1.5 Material Color: Brown Material 1: Sand Material 2: Silt Material 3: Clay Material 4: Gsc Material Description: Stratum Description: SAND-MEDIUM,SILT, CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL.					
Mat Consistency: Material Moisture: Material Texture: Medium Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen: alluvial					
Geology Stratum ID: 218494146 Top Depth: 1.5 Bottom Depth: 2.4 Material Color: Brown Material 1: Silt Material 2: Sand Material 3: Clay Material 4: Gsc Material Description: Stratum Description: SILT,SAND,CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL.					
Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen: alluvial					
Geology Stratum ID: 218494144 Top Depth: .5 Bottom Depth: 1.2 Material Color: Brown Material 1: Sand Material 2: Silt Material 3: Clay Material 4: Gsc Material Description: Stratum Description: SAND-MEDIUM,SILT, CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL.					
Mat Consistency: Material Moisture: Material Texture: Medium Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen: alluvial					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Geology Stratum ID:	218494142			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL, GRAVEL.				
Geology Stratum ID:	218494143			Mat Consistency:	
Top Depth:	.2			Material Moisture:	
Bottom Depth:	.5			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description:	SAND, SILT, CLAY. BROWN, ALLUVIAL, AGE POST-GLACIAL.				
 Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Ident:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR1B.txt RecordID: 088990 NTS_Sheet: 30M12A				
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.				
 Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
183	1 of 1	NNE/238.0	79.8 / 0.00	91 Park Street East Mississauga ON	WWIS
Well ID:	7408550			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	01/18/2022
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	AQ69R69V			Contractor:	7282
Tag:	A333801			Form Version:	9
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Clear/Cloudy:		UTM Reliability:			
Municipality:		MISSISSAUGA CITY (PORT CREDIT)			
Site Info:		Job No. 57387, MW6			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/740\7408550.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		12/15/2021			
Year Completed:		2021			
Depth (m):					
Latitude:		43.5563091389858			
Longitude:		-79.5839471857377			
X:		-79.58394703656239			
Y:		43.556309136475335			
Path:		740\7408550.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1008929786		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614374.00
Code OB Desc:				North83:	4823569.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		12/15/2021		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1008929916			
Layer:		1			
Color:					
General Color:					
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:					
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1008930021			
Layer:		1			
Plug From:		0.0			
Plug To:					
Plug Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008929983			
Layer:		1			
Plug From:		0.0			
Plug To:		6.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008929985			
Layer:		3			
Plug From:		0.0			
Plug To:		47.5			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008929984			
Layer:		2			
Plug From:		0.0			
Plug To:		6.0			
Plug Depth UOM:		ft			
<u>Pipe Information</u>					
Pipe ID:		1008929833			
Casing No:		0			
Comment:					
Alt Name:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1008929834			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Water Details</u>					
Water ID:		1008929890			
Layer:		1			
Kind Code:		8			
Kind:		Untested			
Water Found Depth:		38.75			
Water Found Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
184	1 of 1	N/238.7	79.2 / -0.65	ON	WWIS
Well ID: 7330113 Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: C44114 Tag: A259438 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: MISSISSAUGA CITY (PORT CREDIT) Site Info: Flowing (Y/N): Flow Rate: Data Entry Status: Yes Data Src: Date Received: 03/15/2019 Selected Flag: TRUE Abandonment Rec: Contractor: 7215 Form Version: 8 Owner: County: PEEL Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
Additional Detail(s) (Map)					
Bore Hole ID: 1007451879 Depth M: Year Completed: 2019 Well Completed Dt: 02/19/2019 Audit No: C44114 Path: Tag No: A259438 Contractor: 7215 Latitude: 43.5565090894966 Longitude: -79.5855520075791 Y: 43.55650908640124 X: -79.58555185832279					
Bore Hole Information					
Bore Hole ID: 1007451879 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 02/19/2019 Remarks: Location Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment: Elevation: Elevrc: Zone: 17 East83: 614244.00 North83: 4823589.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					
185	1 of 1	NE/239.1	79.8 / 0.00	91 Park St E Mississauga ON L5G4W1	EHS
Order No: 20180404020 Status: C Report Type: RSC Report (Urban) Report Date: 10-APR-18 Date Received: 04-APR-18 Previous Site Name: Lot/Building Size: Nearest Intersection: Municipality: Mississauga Client Prov/State: ON Search Radius (km): .3 X: -79.583872 Y: 43.556293					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Additional Info Ordered:					
186	1 of 1	NNE/239.2	79.0 / -0.89	88 Park Street East Mississauga ON L5G 2Z6	EHS
Order No:	22113000100			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	05-DEC-22			Search Radius (km):	.25
Date Received:	30-NOV-22			X:	-79.584654
Previous Site Name:				Y:	43.5564889
Lot/Building Size:					
Additional Info Ordered:	City Directory				
187	1 of 1	NW/239.9	78.8 / -1.00	ON	BORE
Borehole ID:	649445			Inclin FLG:	No
OGF ID:	215549820			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JUN-1969			Municipality:	
Static Water Level:	0.3			Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.556111
Total Depth m:	4			Longitude DD:	-79.586978
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614130
Drill Method:	Digging			Northing:	4823543
Orig Ground Elev m:	83.8			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	84.6				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218526999			Mat Consistency:	Dense
Top Depth:	0			Material Moisture:	
Bottom Depth:	3.4			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	SAND,SILT. BROWN,DENSE.				
Geology Stratum ID:	218527000			Mat Consistency:	Stiff
Top Depth:	3.4			Material Moisture:	
Bottom Depth:	4			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:	Sand			Depositional Gen:	
Gsc Material Description:					
Stratum Description:	TILL,SILT,CLAY,SAND.GREY,STIFF, WATER STABLE AT 274.1 FEET.0000004400110029	**Note: Many records			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

provided by the department have a truncated [Stratum Description] field.

Source

Source Type:	Data Survey	Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada	Source Iden:	1
Source Date:	1956-1972	Scale or Res:	Varies
Confidence:	H	Horizontal:	NAD27
Observatio:		Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)		
Source Details:	File: TOR3.txt RecordID: 201040 NTS_Sheet: 30M12A		
Confiden 1:	Logged by professional. Exact and complete description of material and properties.		

Source List

Source Identifier:	1	Horizontal Datum:	NAD27
Source Type:	Data Survey	Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972	Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies		
Source Name:	Urban Geology Automated Information System (UGAIS)		
Source Originators:	Geological Survey of Canada		

188	1 of 1	NNE/241.2	79.8 / 0.00	91 Park Street East Mississauga ON	WWIS

Well ID:	7408551	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Abandoned-Other	Date Received:	01/18/2022
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	Yes
Audit No:	NKHV665V	Contractor:	7282
Tag:	A333810	Form Version:	9
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliabilty:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:	Job No. 57387, MW5d		
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/740\7408551.pdf		

Additional Detail(s) (Map)

Well Completed Date:	12/15/2021
Year Completed:	2021
Depth (m):	
Latitude:	43.5564016066274
Longitude:	-79.5841431125652
X:	-79.58414296354694
Y:	43.55640160474728
Path:	740\7408551.pdf

Bore Hole Information

Bore Hole ID:	1008929789	Elevation:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614358.00
Code OB Desc:				North83:	4823579.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	12/15/2021			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1008929917			
Layer:		1			
Color:					
General Color:					
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:					
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1008930022			
Layer:		1			
Plug From:		0.0			
Plug To:					
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1008929987			
Layer:		2			
Plug From:		0.0			
Plug To:		6.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1008929988			
Layer:		3			
Plug From:		0.0			
Plug To:		50.5			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		1008929986			
Layer:		1			
Plug From:		0.0			
Plug To:		6.0			
Plug Depth UOM:		ft			
 <u>Pipe Information</u>					
Pipe ID:		1008929835			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1008929836			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
 <u>Water Details</u>					
Water ID:		1008929891			
Layer:		1			
Kind Code:		8			
Kind:		Untested			
Water Found Depth:		40.5			
Water Found Depth UOM:		ft			

189	1 of 2	SSE/241.2	79.7 / -0.11	VALLEY CLEANERS 53 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1C9	GEN

Generator Info

Generator No:	ON0529300	Choice of Contact:	
Approval Years:	86,87,88,89	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	9721
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	POWER LAUND./CLEANERS		

Waste Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Name:		241 HALOGENATED SOLVENTS			

189	2 of 2	SSE/241.2	79.7 / -0.11	VALLEY CLEANERS 40-068 53 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1C9	GEN

Generator Info

Generator No:	ON0529300	Choice of Contact:	
Approval Years:	92,93,94,95,96,97,98	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	9721
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	POWER LAUND./CLEANER		

Waste Detail(s)

Waste Class:	241
Waste Class Name:	HALOGENATED SOLVENTS

190	1 of 2	NNE/241.5	79.8 / 0.00	Park Street & Hurontario Street Mississauga ON	WWIS

Well ID:	7398198	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	09/16/2021
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	LBBUIXH4	Contractor:	7472
Tag:	A333810	Form Version:	9
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliabilty:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/739\7398198.pdf

Additional Detail(s) (Map)

Well Completed Date:	07/08/2021
Year Completed:	2021
Depth (m):	7.62
Latitude:	43.5564014533201
Longitude:	-79.5841307353698
X:	-79.5841305847663
Y:	43.556401450458374
Path:	739\7398198.pdf

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Bore Hole Information</u>					
Bore Hole ID:	1008785698			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614359.00
Code OB Desc:				North83:	4823579.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	07/08/2021			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1008786034				
Layer:	2				
Color:	2				
General Color:	GREY				
Material 1:	05				
Material 1 Desc:	CLAY				
Material 2:	06				
Material 2 Desc:	SILT				
Material 3:	79				
Material 3 Desc:	PACKED				
Formation Top Depth:	4.0				
Formation End Depth:	25.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1008786033				
Layer:	1				
Color:	6				
General Color:	BROWN				
Material 1:	01				
Material 1 Desc:	FILL				
Material 2:					
Material 2 Desc:					
Material 3:	77				
Material 3 Desc:	LOOSE				
Formation Top Depth:	0.0				
Formation End Depth:	4.0				
Formation End Depth UOM:	ft				
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1008786254				
Layer:	1				
Plug From:					
Plug To:					
Plug Depth UOM:	ft				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008786366			
Layer:		2			
Plug From:		14.0			
Plug To:		25.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008786365			
Layer:		1			
Plug From:		0.0			
Plug To:		14.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1008785867			
Method Construction Code:		E			
Method Construction:		Auger			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1008785800			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1008786095			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		15.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1008786143			
Layer:		1			
Slot:		10			
Screen Top Depth:		15.0			
Screen End Depth:		25.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.5			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1008785801			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pump Set At: Static Level: Final Level After Pumping: Recommended Pump Depth: Pumping Rate: Flowing Rate: Recommended Pump Rate: Levels UOM: Rate UOM: Water State After Test Code: Water State After Test: Pumping Test Method: Pumping Duration HR: Pumping Duration MIN: Flowing:					
Hole Diameter					
Hole ID: Diameter: Depth From: Depth To: Hole Depth UOM: Hole Diameter UOM:					
190	2 of 2	NNE/241.5	79.8 / 0.00	Park Street & Hurontario Street Mississauga ON	WWIS
Well ID: Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: Tag: Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: Selected Flag: Abandonment Rec: Contractor: Form Version: Owner: County: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/739\7398229.pdf			
Additional Detail(s) (Map)					
Well Completed Date: Year Completed: Depth (m): Latitude: Longitude: X: Y: Path:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Bore Hole Information</u>					
Bore Hole ID:	1008786632			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614359.00
Code OB Desc:				North83:	4823579.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	07/08/2021			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1008787018				
Layer:	3				
Color:	2				
General Color:	GREY				
Material 1:	17				
Material 1 Desc:	SHALE				
Material 2:					
Material 2 Desc:					
Material 3:	73				
Material 3 Desc:	HARD				
Formation Top Depth:	25.0				
Formation End Depth:	50.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1008787016				
Layer:	1				
Color:	6				
General Color:	BROWN				
Material 1:	01				
Material 1 Desc:	FILL				
Material 2:					
Material 2 Desc:					
Material 3:	77				
Material 3 Desc:	LOOSE				
Formation Top Depth:	0.0				
Formation End Depth:	4.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1008787017				
Layer:	2				
Color:	2				
General Color:	GREY				
Material 1:	05				
Material 1 Desc:	CLAY				
Material 2:	06				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 2 Desc:		SILT			
Material 3:		79			
Material 3 Desc:		PACKED			
Formation Top Depth:		4.0			
Formation End Depth:		25.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008787349			
Layer:		1			
Plug From:		0.0			
Plug To:		39.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008787350			
Layer:		2			
Plug From:		39.0			
Plug To:		50.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008787266			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1008786830			
Method Construction Code:		E			
Method Construction:		Auger			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1008786753			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1008787107			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		40.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Screen</u>					
Screen ID:	1008787157				
Layer:	1				
Slot:	10				
Screen Top Depth:	40.0				
Screen End Depth:	50.0				
Screen Material:	5				
Screen Depth UOM:	ft				
Screen Diameter UOM:	inch				
Screen Diameter:	2.5				
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:	1008786754				
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:	ft				
Rate UOM:	GPM				
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:	1008787209				
Diameter:	7.5				
Depth From:	0.0				
Depth To:	50.0				
Hole Depth UOM:	ft				
Hole Diameter UOM:	inch				
191	1 of 1	NW/242.0	78.8 / -1.00	ON	BORE
Borehole ID:	833902			Inclin FLG:	No
OGF ID:	215586033			SP Status:	Initial Entry
Status:	Decommissioned			Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	25-MAY-1972			Municipality:	
Static Water Level:	4.1			Lot:	
Primary Water Use:				Township:	
Sec. Water Use:				Latitude DD:	43.555883
Total Depth m:	5.9			Longitude DD:	-79.587374
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614098
Drill Method:	Boring			Northing:	4823517
Orig Ground Elev m:	85.5			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Within 10 metres
DEM Ground Elev m:	84.2				
Concession:					
Location D:	PORT CREDIT GO STATION * PLATFORM SHELTER				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Survey D:					
Comments:		W.L measured on May 26, 1972			
Borehole Geology Stratum					
Geology Stratum ID:	6014830			Mat Consistency:	Hard
Top Depth:	5.8			Material Moisture:	
Bottom Depth:	5.9			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:		Glacial till - hard **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:	6014828			Mat Consistency:	Loose
Top Depth:	0			Material Moisture:	
Bottom Depth:	4.1			Material Texture:	
Material Color:				Non Geo Mat Type:	Fill-Misc
Material 1:	Sand			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:	Coal fragments			Geologic Period:	
Material 4:	Wood Fragments			Depositional Gen:	
Gsc Material Description:					
Stratum Description:		Asphalt top 0.03m, sand and gravel (occasional pieces of coal and wood), (fill), loose to compact **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:	6014829			Mat Consistency:	Very Dense
Top Depth:	4.1			Material Moisture:	
Bottom Depth:	5.8			Material Texture:	Fine
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Boulders			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		Silty fine sand, brown, very dense, boulder **Note: Many records provided by the department have a truncated [Stratum Description] field.			
192	1 of 1	WNW/242.2	78.8 / -1.00	ON	BORE
Borehole ID:	833903			Inclin FLG:	No
OGF ID:	215586034			SP Status:	Initial Entry
Status:	Decommissioned			Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	26-MAY-1972			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:				Township:	
Sec. Water Use:				Latitude DD:	43.555439
Total Depth m:	6.9			Longitude DD:	-79.58783
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	614062
Drill Method:	Boring			Northing:	4823467
Orig Ground Elev m:	85.6			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Within 10 metres
DEM Ground Elev m:	83.9				
Concession:					
Location D:		PORT CREDIT GO STATION * PLATFORM SHELTER			
Survey D:					
Comments:		No W.L - hole caved in			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	6014831			Mat Consistency:	Compact
Top Depth:	0			Material Moisture:	
Bottom Depth:	4.7			Material Texture:	
Material Color:				Non Geo Mat Type:	Fill-Misc
Material 1:	Sand			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:	organic material			Depositional Gen:	
Gsc Material Description:					
Stratum Description:	Asphalt top 0.04m, sand and gravel, trace of silt, (trace of organic matter throughout), fill, compact to very loose **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	6014833			Mat Consistency:	Very Stiff
Top Depth:	6.4			Material Moisture:	
Bottom Depth:	6.9			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Sand			Geologic Period:	
Material 4:	Gravel			Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	Heterogeneous mixture of clayey silt, sand and gravel (glacial till), very stiff **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	6014832			Mat Consistency:	Very Stiff
Top Depth:	4.7			Material Moisture:	
Bottom Depth:	6.4			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Silt			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	Clayey silt, grey, very stiff **Note: Many records provided by the department have a truncated [Stratum Description] field.				
193	1 of 1	NW/242.3	78.8 / -1.00	PORT CREDIT GO STATION PORT CREDIT ON	WWIS
Well ID:	7243496			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	06/25/2015
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z203315			Contractor:	7147
Tag:	A175784			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/724\7243496.pdf				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		06/06/2015			
Year Completed:		2015			
Depth (m):		6.1			
Latitude:		43.5562098059175			
Longitude:		-79.5868342262533			
X:		-79.58683407634665			
Y:		43.55620980332893			
Path:		724\7243496.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	1005439505			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614141.00
Code OB Desc:				North83:	4823554.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	06/06/2015			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1005616493			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.20000000298023224			
Formation End Depth:		3.299999952316284			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1005616492			
Layer:		1			
Color:		2			
General Color:		GREY			
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.20000000298023224			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005616494			
Layer:		3			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		34			
Material 2 Desc:		TILL			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		3.299999952316284			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005616503			
Layer:		3			
Plug From:		2.799999952316284			
Plug To:		6.099999904632568			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005616502			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		2.799999952316284			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005616501			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005616500			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005616491			
Casing No:		0			
Comment:					
Alt Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:		1005616497			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.0999999046325684			
Casing Diameter:		5.0			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1005616498			
Layer:		1			
Slot:		.10			
Screen Top Depth:		3.0999999046325684			
Screen End Depth:		6.099999904632568			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.300000190734863			
<u>Water Details</u>					
Water ID:		1005616496			
Layer:		1			
Kind Code:		8			
Kind:		Untested			
Water Found Depth:		3.700000047683716			
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1005616495			
Diameter:		11.399999618530273			
Depth From:		0.0			
Depth To:		6.099999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

194	1 of 1	WNW/242.6	79.5 / -0.37	ON	BORE
Borehole ID:	833906	Inclin FLG:	No		
OGF ID:	215586037	SP Status:	Initial Entry		
Status:	Decommissioned	Surv Elev:	No		
Type:	Borehole	Piezometer:	No		
Use:	Geotechnical/Geological Investigation	Primary Name:			
Completion Date:	30-MAY-1972	Municipality:			
Static Water Level:		Lot:			
Primary Water Use:		Township:			
Sec. Water Use:		Latitude DD:	43.55551		
Total Depth m:	3.2	Longitude DD:	-79.587779		
Depth Ref:	Ground Surface	UTM Zone:	17		
Depth Elev:		Easting:	614066		
Drill Method:	Boring	Northing:	4823475		
Orig Ground Elev m:	85.6	Location Accuracy:			
Elev Reliabil Note:		Accuracy:	Within 10 metres		
DEM Ground Elev m:	83.9				
Concession:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Location D:		PORT CREDIT GO STATION * PLATFORM SHELTER			
Survey D:					
Comments:		Met practical refusal to driving at 1.52m (probable boulder), moved 0.76m west and resumed sampling at 1.83m			
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	6014838			Mat Consistency:	Loose
Top Depth:	0			Material Moisture:	
Bottom Depth:	3.2			Material Texture:	
Material Color:				Non Geo Mat Type:	Fill-Misc
Material 1:	Sand			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:	Wood Fragments			Depositional Gen:	
Gsc Material Description:					
Stratum Description:		Asphalt top 0.03m, sand and gravel, trace of silt, (occasional pieces of wood and brick), fill, loose to compact			
		**Note: Many records provided by the department have a truncated [Stratum Description] field.			
195	1 of 3	S/243.7	79.4 / -0.50	R.M. OF PEEL STAVEBANK RD./LAKESHORE RD. MISSISSAUGA CITY ON	CA
Certificate #:		3-0073-93-			
Application Year:		93			
Issue Date:		2/4/1993			
Approval Type:		Municipal sewage			
Status:		Approved			
Application Type:					
Client Name:					
Client Address:					
Client City:					
Client Postal Code:					
Project Description:					
Contaminants:					
Emission Control:					
195	2 of 3	S/243.7	79.4 / -0.50	R.M. OF PEEL STAVEBANK RD.S./LAKESHORE RD.W MISSISSAUGA CITY ON	CA
Certificate #:		7-0303-95-			
Application Year:		95			
Issue Date:		5/1/1995			
Approval Type:		Municipal water			
Status:		Approved			
Application Type:					
Client Name:					
Client Address:					
Client City:					
Client Postal Code:					
Project Description:					
Contaminants:					
Emission Control:					
195	3 of 3	S/243.7	79.4 / -0.50	R.M. OF PEEL STAVEBANK RD./LAKESHORE RD. MISSISSAUGA CITY ON	CA
Certificate #:		7-0048-93-			
Application Year:		93			
Issue Date:		2/4/1993			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Approval Type: Status: Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:		Municipal water Approved			
196	1 of 1	NNE/243.9	79.8 / 0.00	91 Park St E Mississauga ON L5G4W1	EHS
Order No: Status: Report Type: Report Date: Date Received: Previous Site Name: Lot/Building Size: Additional Info Ordered:		20140106044 C Custom Report 15-JAN-14 06-JAN-14 Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): X: Y:			
		20140106044 C Custom Report 15-JAN-14 06-JAN-14 ON .25 -79.583921 43.556359			
197	1 of 1	NNE/244.3	79.8 / 0.00	91 Park Street East Mississauga ON	WWIS
Well ID: Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: Tag: Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:		7408552 Monitoring Abandoned-Other 3DE8RMHS A333813 MISSISSAUGA CITY (PORT CREDIT) Job No. 57387, MW5s			
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: Selected Flag: Abandonment Rec: Contractor: Form Version: Owner: County: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:		01/18/2022 TRUE Yes 7282 9 PEEL			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/740\7408552.pdf			
Additional Detail(s) (Map)					
Well Completed Date: Year Completed: Depth (m): Latitude: Longitude: X: Y: Path:		12/15/2021 2021 43.5564284576916 -79.5841301029645 -79.58412995324848 43.55642845546882 740\7408552.pdf			

Bore Hole Information

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bore Hole ID:	1008929792			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614359.00
Code OB Desc:				North83:	4823582.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	12/15/2021			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1008929918				
Layer:	1				
Color:					
General Color:					
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:					
Formation End Depth UOM:	ft				
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1008930023				
Layer:	1				
Plug From:	0.0				
Plug To:					
Plug Depth UOM:	ft				
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1008929989				
Layer:	1				
Plug From:	0.0				
Plug To:	6.0				
Plug Depth UOM:	ft				
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1008929990				
Layer:	2				
Plug From:	0.0				
Plug To:	6.0				
Plug Depth UOM:	ft				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008929991			
Layer:		3			
Plug From:		0.0			
Plug To:		23.5			
Plug Depth UOM:		ft			
<u>Pipe Information</u>					
Pipe ID:		1008929837			
Casing No:		0			
Comment:					
Alt Name:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1008929838			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
198	1 of 1	SSW/244.5	79.8 / 0.00	20 STAVEBANK DR MISSISSAUGA ON	WWIS
Well ID:	7168028			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	09/01/2011
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z136783			Contractor:	7241
Tag:	A114329			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:	X				
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/716\7168028.pdf				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		07/24/2011			
Year Completed:		2011			
Depth (m):					
Latitude:		43.5523788250451			
Longitude:		-79.5864904629914			
X:		-79.58649031309352			
Y:		43.55237882268085			
Path:		716\7168028.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	1003558158			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614176.00
Code OB Desc:				North83:	4823129.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	07/24/2011			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1003917702				
Layer:	3				
Plug From:	8.0				
Plug To:	20.0				
Plug Depth UOM:	ft				
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1003917701				
Layer:	2				
Plug From:	1.0				
Plug To:	8.0				
Plug Depth UOM:	ft				
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1003917700				
Layer:	1				
Plug From:	0.0				
Plug To:	1.0				
Plug Depth UOM:	ft				
<u>Method of Construction & Well Use</u>					
Method Construction ID:	1003917699				
Method Construction Code:	D				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:	1003917691				
Casing No:	0				
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:	1003917695				
Layer:	1				
Material:	5				
Open Hole or Material:	PLASTIC				
Depth From:	0.0				
Depth To:	10.0				
Casing Diameter:	2.0				
Casing Diameter UOM:	inch				
Casing Depth UOM:	ft				
<u>Construction Record - Screen</u>					
Screen ID:	1003917696				
Layer:	1				
Slot:	10				
Screen Top Depth:	10.0				
Screen End Depth:	20.0				
Screen Material:	5				
Screen Depth UOM:	ft				
Screen Diameter UOM:	inch				
Screen Diameter:	2.25				
<u>Water Details</u>					
Water ID:	1003917694				
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:	ft				
<u>Hole Diameter</u>					
Hole ID:	1003917693				
Diameter:	6.0				
Depth From:	0.0				
Depth To:	20.0				
Hole Depth UOM:	ft				
Hole Diameter UOM:	inch				
199	1 of 6	ESE/244.6	79.0 / -0.84	Edwards lakeside Veterinary Clinic 46 Port Street East Mississauga ON L5G 1C1	GEN

Generator Info

Generator No: ON5788282 **Choice of Contact:**

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Approval Years: 03,04,05 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description:					
Contaminated Fac: MHSW Facility: SIC Code:					
<u>Waste Detail(s)</u>					
Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					
199	2 of 6	ESE/244.6	79.0 / -0.84	Edwards lakeside Veterinary Clinic 46 Port Street East Mississauga ON L5G 1C1	GEN
<u>Generator Info</u>					
Generator No: ON5788282 Approval Years: 2011 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description:					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 541940					
<u>Waste Detail(s)</u>					
Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					
199	3 of 6	ESE/244.6	79.0 / -0.84	Edwards lakeside Veterinary Clinic 46 Port Street East Mississauga ON L5G 1C1	GEN
<u>Generator Info</u>					
Generator No: ON5788282 Approval Years: As of Dec 2018 Status: Registered PO Box No: Country: Canada Co Admin: Phone No Admin: SIC Description:					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:					
<u>Waste Detail(s)</u>					
Waste Class: 146 U Waste Class Name: Other specified inorganic sludges, slurries or solids					
<u>Waste Detail(s)</u>					
Waste Class: 312 P Waste Class Name: Pathological wastes					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
199	4 of 6	ESE/244.6	79.0 / -0.84	Edwards lakeside Veterinary Clinic 46 Port Street East Mississauga ON L5G 1C1	GEN
<u>Generator Info</u>					
Generator No:	ON5788282			Choice of Contact:	
Approval Years:	As of Jul 2020			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:	312 P				
Waste Class Name:	Pathological wastes				
<u>Waste Detail(s)</u>					
Waste Class:	146 U				
Waste Class Name:	Other specified inorganic sludges, slurries or solids				
199	5 of 6	ESE/244.6	79.0 / -0.84	Edwards lakeside Veterinary Clinic 46 Port Street East Mississauga ON L5G 1C1	GEN
<u>Generator Info</u>					
Generator No:	ON5788282			Choice of Contact:	
Approval Years:	As of Nov 2021			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:	146 U				
Waste Class Name:	Other specified inorganic sludges, slurries or solids				
<u>Waste Detail(s)</u>					
Waste Class:	312 P				
Waste Class Name:	Pathological wastes				
199	6 of 6	ESE/244.6	79.0 / -0.84	Edwards lakeside Veterinary Clinic 46 Port Street East Mississauga ON L5G 1C1	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON5788282			Choice of Contact:	
Approval Years:	As of Oct 2022			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:	312 P				
Waste Class Name:	PATHOLOGICAL WASTES				
<u>Waste Detail(s)</u>					
Waste Class:	146 U				
Waste Class Name:	OTHER SPECIFIED INORGANICS				
<u>2018 Generator Info</u>					
Gen No:	ON5788282			Choice of Contact:	CO_OFFICIAL
ID:	23065			Phone No Official:	905-278-5000 Ext.
Contaminated Fac:	N			Phone No Admin:	905-278-5000 Ext.
MHSW Facility:	N			County Ont:	PEEL (R. M.)
NAICS Code1:	541940			County Out:	
NAICS Code2:				District:	305
NAICS Code3:					
Gen Name:	Edwards lakeside Veterinary Clinic				
Gen Div:					
Gen Op Name:	Edwards lakeside Veterinary Clinic				
Gen Op Div:					
Site Adrs1:	46 Port Street East				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Mississauga				
Province Out:					
Site Postal Code:	L5G 1C1				
Site Country:	Canada				
Co Official:	Geoff K . Edwards				
Co Admin:	Geoff K Edwards				
<u>2019 Generator Info</u>					
Gen No:	ON5788282			Choice of Contact:	CO_OFFICIAL
ID:	23163			Phone No Official:	905-278-5000 Ext.
Contaminated Fac:	N			Phone No Admin:	905-278-5000 Ext.
MHSW Facility:	N			County Ont:	PEEL (R. M.)
NAICS Code1:	541940			County Out:	
NAICS Code2:				District:	305
NAICS Code3:					
Gen Name:	Edwards lakeside Veterinary Clinic				
Gen Div:					
Gen Op Name:	Edwards lakeside Veterinary Clinic				
Gen Op Div:					
Site Adrs1:	46 Port Street East				
Site Bldg:					
Site Pobox:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Mississauga			
Province Out:					
Site Postal Code:		L5G 1C1			
Site Country:		Canada			
Co Official:		Geoff K . Edwards			
Co Admin:		Geoff K Edwards			
<u>2020 Generator Info</u>					
Gen No:	ON5788282			Choice of Contact:	CO_OFFICIAL
ID:	22891			Phone No Official:	905-278-5000 Ext.
Contaminated Fac:	N			Phone No Admin:	905-278-5000 Ext.
MHSW Facility:	N			County Ont:	PEEL (R. M.)
NAICS Code1:	541940			County Out:	
NAICS Code2:				District:	305
NAICS Code3:					
Gen Name:	Edwards lakeside Veterinary Clinic				
Gen Div:					
Gen Op Name:	Edwards lakeside Veterinary Clinic				
Gen Op Div:					
Site Adrs1:	46 Port Street East				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Mississauga				
Province Out:					
Site Postal Code:	L5G 1C1				
Site Country:	Canada				
Co Official:	Geoff K . Edwards				
Co Admin:	Geoff K Edwards				
<u>2021 Generator Info</u>					
Gen No:	ON5788282			Choice of Contact:	CO_OFFICIAL
ID:	23206			Phone No Official:	905-278-5000 Ext.
Contaminated Fac:	N			Phone No Admin:	905-278-5000 Ext.
MHSW Facility:	N			County Ont:	PEEL (R. M.)
NAICS Code1:	541940			County Out:	
NAICS Code2:				District:	305
NAICS Code3:					
Gen Name:	Edwards lakeside Veterinary Clinic				
Gen Div:					
Gen Op Name:	Edwards lakeside Veterinary Clinic				
Gen Op Div:					
Site Adrs1:	46 Port Street East				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Mississauga				
Province Out:					
Site Postal Code:	L5G 1C1				
Site Country:	Canada				
Co Official:	Geoff K . Edwards				
Co Admin:	Geoff K Edwards				

200

1 of 1

N/244.6

79.6 / -0.28

port credit go station
Mississauga ON

WWIS

Well ID:

7355171

Flowing (Y/N):

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Construction Date:			Flow Rate:		
Use 1st:	Test Hole			Data Entry Status:	
Use 2nd:	Monitoring			Data Src:	
Final Well Status:	Observation Wells			Date Received:	11/28/2018
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z275350			Contractor:	7383
Tag:	A239126			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/735\7355171.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	01/13/2018				
Year Completed:	2018				
Depth (m):	9.144				
Latitude:	43.5565769655308				
Longitude:	-79.5852161374119				
X:	-79.58521598732213				
Y:	43.55657696333066				
Path:	735\7355171.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1008221295			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	614271.00
Code OB Desc:				North83:	4823597.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	01/13/2018			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1008268351				
Layer:	2				
Color:					
General Color:					
Material 1:	06				
Material 1 Desc:	SILT				
Material 2:					
Material 2 Desc:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3: Material 3 Desc: Formation Top Depth: Formation End Depth: Formation End Depth UOM:					
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1008268352			
Layer:		3			
Color:					
General Color:					
Material 1:		34			
Material 1 Desc:		TILL			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:					
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1008268353			
Layer:		4			
Color:					
General Color:					
Material 1:		17			
Material 1 Desc:		SHALE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:					
Formation End Depth:		30.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1008268350			
Layer:		1			
Color:					
General Color:					
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:					
Formation End Depth UOM:					
<u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1008268740			
Layer:		2			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug From:		1.0			
Plug To:		19.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008268741			
Layer:		3			
Plug From:		19.0			
Plug To:		30.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008268739			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1008269236			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1008267822			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1008269425			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		20.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1008269595			
Layer:		1			
Slot:		10			
Screen Top Depth:		20.0			
Screen End Depth:		30.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.375			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1008269861			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Water Details</u>					
Water ID:		1008269724			
Layer:		1			
Kind Code:					
Kind:					
Water Found Depth:		19.0			
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1008269041			
Diameter:		8.5			
Depth From:		0.0			
Depth To:		30.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
201	1 of 1	SSE/244.9	79.4 / -0.48	Souvlaki Hut 51 Lakeshore Rd E Mississauga ON NA	SPL
Ref No:	6133-BRBP9N			Municipality No:	
Year:				Nature of Damage:	
Incident Dt:	2020/07/08			Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:	2020/07/08			Impact to Health:	2 - Minor Environment
Dt Document Closed:	2020/08/12			Agency Involved:	
Site No:	3644-BRDNSG				
MOE Response:	No				
Site County/District:	Regional Municipality of Peel				
Site Geo Ref Meth:	NA				
Site District Office:	Halton-Peel				
Nearest Watercourse:					
Site Name:	Souvlaki Hut				
Site Address:	51 Lakeshore Rd E				
Site Region:	Central				
Site Municipality:	Mississauga				
Site Lot:					
Site Conc:	NA				
Site Geo Ref Accu:	NA				
Site Map Datum:	NA				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
--Details-- Description: Software Publishers SIC/NAICS Code: 511210					
203	2 of 3	SSW/245.9	79.3 / -0.52	Engineered Management Systems Inc. 34 Lakeshore Rd E Mississauga ON L5G 1C8	SCT
Established:		1996			
Plant Size (ft²):		150			
Employment:		1			
203	3 of 3	SSW/245.9	79.3 / -0.52	Credit Valley Investments Limited 34 Lakeshore Road East Mississauga ON L5G 1C8	GEN
Generator Info Generator No: ON9834892 Approval Years: 05 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: Lessors of Non-Residential Buildings (except Mini-Warehouses) Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 531120					
Waste Detail(s) Waste Class: 221 Waste Class Name: LIGHT FUELS					
204	1 of 1	NNW/246.6	78.8 / -1.00	LSW Stage 5 Toronto ON	EHS
Order No: 23092101794				Nearest Intersection:	
Status: C				Municipality:	
Report Type: Custom Report				Client Prov/State: ON	
Report Date: 26-SEP-23				Search Radius (km): .25	
Date Received: 21-SEP-23				X: -79.58654469	
Previous Site Name:				Y: 43.5563723	
Lot/Building Size:					
Additional Info Ordered:					
205	1 of 1	ESE/247.2	79.3 / -0.50	9 HELENE STREET SOUTH, MISSISSAUGA ON	INC
Incident No: 1781856				Any Health Impact: No	
Incident ID:				Any Enviro Impact: No	
Instance No:				Service Intrap: Yes	
Status Code:				Was Prop Damaged: No	
Incident Status:				Reside App. Type:	
Incident Severity:				Commer App. Type:	
Task No: 5997940				Indus App. Type:	
Attribute Category: FS-Perform L1 Incident Insp				Institut App. Type:	
Context:				Depth Ground Cover:	

206	1 of 2	S/247.7	79.4 / -0.48	Credit Valley Investments Ltd. 34-48 Lakeshore Rd. E., Mississauga MISSISSAUGA ON L5G 1C8	DTNK

Licence No:		Facility Type:	
Registration No:	200204-3043	Fuel Type:	
Posse File No:		Corrosion Protection:	
Posse Reg No:		NBR:	
Instance No:		Contact Name:	c/o John Pallett
Status Name:		Contact Address:	P.O. Box 130
Tank Type:		Contact Address2:	
Tank Size:	1000 gal	Contact Suite:	
Tank Material:	Steel	Contact City:	Port Credit
Tk Age(as of 05/1992):	38 yrs	Contact Prov:	ON
Tank Address:	34-48 Lakeshore Rd. E., Mississauga	Contact Postal:	L5G 4L7
Instance Type:		Province:	
Instance Creation Dt:		Letter Sent:	7-Nov-02
Instance Install Dt:		Context:	
Item:		Distributor:	Ultramar
Item Desc:		Comments:	
Device Instld Loc:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Description: Original Source: CFOT Record Date: Up to Apr 2013					
206	2 of 2	S/247.7	79.4 / -0.48	CREDIT VALLEY NVESTMENTS LTD 34-48 LAKESHORE ROAD EAST MISSISSAUGA ON	CFOT
Inventory No: 61578155 Inventory Status: Active Installation Year: 1964 Capacity: 3784 Capacity Unit: Tank Type: Manufacturer: Model: Description:		Tank Material: Steel Corrosion Protect: Coating Overfill Protection: Inventory Context: FS Fuel Oil Tank Inventory Item: FS FUEL OIL TANK			
207	1 of 1	NNW/248.0	79.2 / -0.62	ON	BORE
Borehole ID: 640915 OGF ID: 215541310 Status: Type: Borehole Use: Geotechnical/Geological Investigation Completion Date: JAN-1965 Static Water Level: Primary Water Use: Not Used Sec. Water Use: Total Depth m: 2.1 Depth Ref: Ground Surface Depth Elev: Drill Method: Power auger Orig Ground Elev m: 83.7 Elev Reliabil Note: DEM Ground Elev m: 83.6 Concession: Location D: Survey D: Comments:		Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD: 43.556548 Longitude DD: -79.585915 UTM Zone: 17 Easting: 614215 Northing: 4823593 Location Accuracy: Accuracy: Not Applicable			
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: 218494057 Top Depth: .3 Bottom Depth: 1.5 Material Color: Brown Material 1: Sand Material 2: Silt Material 3: Clay Material 4: Gsc Material Description: Stratum Description: SAND,SILT,CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL.		Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen: alluvial			
Geology Stratum ID: 218494058 Top Depth: 1.5 Bottom Depth: 2.1 Material Color: Brown Material 1: Sand Material 2: Silt Material 3: Clay		Mat Consistency: Material Moisture: Material Texture: Medium Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 4:				Depositional Gen:	alluvial
Gsc Material Description:					
Stratum Description: SAND-MEDIUM,SILT, CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL. CI **Note: Many records provided by the department have a truncated [Stratum Description] field.					
Geology Stratum ID:		218494056	Mat Consistency:		
Top Depth:		.2	Material Moisture:		
Bottom Depth:		.3	Material Texture:		
Material Color:		Brown	Non Geo Mat Type:		
Material 1:		Sand	Geologic Formation:		
Material 2:		Silt	Geologic Group:		
Material 3:		Clay	Geologic Period:		
Material 4:			Depositional Gen: alluvial		
Gsc Material Description:					
Stratum Description: SAND,SILT,CLAY. BROWN,ALLUVIAL, AGE POST-GLACIAL.					
Geology Stratum ID:		218494055	Mat Consistency:		
Top Depth:		0	Material Moisture:		
Bottom Depth:		.2	Material Texture:		
Material Color:		Brown	Non Geo Mat Type:		
Material 1:		Fill	Geologic Formation:		
Material 2:		Gravel	Geologic Group:		
Material 3:			Geologic Period:		
Material 4:			Depositional Gen: fill		
Gsc Material Description:					
Stratum Description: FILL,GRAVEL. BROWN.					
Geology Stratum ID:		218494054	Mat Consistency:		
Top Depth:		0	Material Moisture:		
Bottom Depth:		0	Material Texture:		
Material Color:			Non Geo Mat Type:		
Material 1:		Asphalt	Geologic Formation:		
Material 2:			Geologic Group:		
Material 3:			Geologic Period:		
Material 4:			Depositional Gen:		
Gsc Material Description:					
Stratum Description: ASPHALT.					
<u>Source</u>					
Source Type:		Data Survey	Source Appl:		Spatial/Tabular
Source Orig:		Geological Survey of Canada	Source Iden:		1
Source Date:		1956-1972	Scale or Res:		Varies
Confidence:		M	Horizontal:		NAD27
Observatio:			Verticalda:		Mean Average Sea Level
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Details:		File: TOR1B.txt RecordID: 088810 NTS_Sheet: 30M12A			
Confiden 1:		Logs are approximately correct. Lack of information. Doubtful terminology.			
<u>Source List</u>					
Source Identifier:		1	Horizontal Datum:		NAD27
Source Type:		Data Survey	Vertical Datum:		Mean Average Sea Level
Source Date:		1956-1972	Projection Name:		Universal Transverse Mercator
Scale or Resolution:		Varies			
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Originators:		Geological Survey of Canada			
<u>208</u>	1 of 1	S/248.1	79.3 / -0.50	39 LAKESHORE ROAD EAST MISSISSAUGA ON L5G 1C9	EHS
Order No:		20080918006	Nearest Intersection:		
Status:		C	Municipality:		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Report Type: Site Report Report Date: 9/19/2008 Date Received: 9/18/2008 Previous Site Name: Lot/Building Size: Additional Info Ordered:				Client Prov/State: ON Search Radius (km): 0.25 X: -79.584735 Y: 43.552038	
209	1 of 2	ENE/248.3	79.8 / 0.00	EXCALIBUR INT'L CONSULTANTS 10 Hurontario St Mississauga ON L5G 3G7	SCT
Established: 1972 Plant Size (ft²): 1800 Employment: 3					
--Details-- Description: Other Publishers SIC/NAICS Code: 511190					
209	2 of 2	ENE/248.3	79.8 / 0.00	Excalibur International Consultants Ltd. 10 Hurontario St Mississauga ON L5G 3G7	SCT
Established: 1972 Plant Size (ft²): 1800 Employment: 4					
210	1 of 1	ENE/249.3	79.7 / -0.19	ON	BORE
Borehole ID: 646202 OGF ID: 215546585 Status: Type: Borehole Use: Geotechnical/Geological Investigation Completion Date: JUL-1967 Static Water Level: Primary Water Use: Not Used Sec. Water Use: Total Depth m: 7.8 Depth Ref: Ground Surface Depth Elev: Drill Method: Power auger Orig Ground Elev m: 79.3 Elev Reliabil Note: DEM Ground Elev m: 78.1 Concession: Location D: Survey D: Comments:				Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD: 43.554972 Longitude DD: -79.582238 UTM Zone: 17 Easting: 614515 Northing: 4823423 Location Accuracy: Accuracy: Not Applicable	
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: 218514008 Top Depth: .1 Bottom Depth: .5 Material Color: Material 1: Fill Material 2: Sand				Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3: Material 4: Gsc Material Description: Stratum Description:	Gravel FILL,SAND,GRAVEL.			Geologic Period: Depositional Gen:	fill
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218514009 .5 2.6 Brown Till Silt Clay TILL,SILT,CLAY. BROWN,GLACIAL,HARD, AGE GLACIAL.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Hard glacial
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218514007 0 .1 Asphalt			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218514010 2.6 7.8 Grey Till Silt Sand TILL,SILT,SAND. GREY,GLACIAL,DENSE, AGE GLACIAL.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Dense glacial
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218514011 7.8 7.8 Bedrock Shale BEDROCK,SHALE. MARINE,AGE ORDOVICIAN. 023 009 0001503700085068 **Note: Many records provided by the department have a truncated [Stratum Description] field.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	 Ordovician marine
Source					
Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	Data Survey Geological Survey of Canada 1956-1972 M Urban Geology Automated Information System (UGAIS) File: TOR2.txt RecordID: 142240 NTS_Sheet: 30M12A Reliable information but incomplete.			Source Appl: Source Iden: Scale or Res: Horizontal: Verticalda:	Spatial/Tabular 1 Varies NAD27 Mean Average Sea Level
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27

<i>Map Key</i>	<i>Number of Records</i>	<i>Direction/ Distance (m)</i>	<i>Elev/Diff (m)</i>	<i>Site</i>	<i>DB</i>
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				

Unplottable Summary

Total: 42 Unplottable sites

DB	Company Name/Site Name	Address	City	Postal
CA	MISSISSAUGA CITY	HURONTARIO STREET	MISSISSAUGA CITY ON	
CA	GOTTARDO PROPERTIES LTD. & GOTTARDO CORP	HURONTARIO ST. STREET A	MISSISSAUGA CITY ON	
CA	ONTARIO HYDRO	BOX 369	MISSISSAUGA CITY ON	
CA	ONTARIO HYDRO	BOX 369	MISSISSAUGA CITY ON	
CA		Lakeshore Road East, Helen Street, Port Street, and St. Lawrence Drive	Mississauga ON	
CA	JOSEPH GYETVAN	HURONTARIO ST.	MISSISSAUGA CITY ON	
CA	R.M. OF PEEL	STAVEBANK RD.	MISSISSAUGA CITY ON	
CA	MISSISSAUGA CITY CITY CENTRE PLAZA	HURONTARIO ST. PH. 1 TO 5	MISSISSAUGA CITY ON	
CA	MISSISSAUGA CITY	HIGH STREET, PORT CREDIT	MISSISSAUGA CITY ON	
CA	GEOFMAN PROPERTIES	PRIVATE LANE LAKESHORE RD.	MISSISSAUGA CITY ON	
CA	WHITNEY HOMES	QUEEN ST. E. STREET A	MISSISSAUGA CITY ON	
CA	G.L. BALL CLEARVIEW CREEK CANNELIZATION	LAKESHORE RD.	MISSISSAUGA CITY ON	
CA	WHITNEY HOMES	QUEEN ST. STREET A	MISSISSAUGA CITY ON	
CA	MISSISSAUGA CITY	STAVEBANK RD.	MISSISSAUGA CITY ON	
CA	MISSISSAUGA CITY	HURONTARIO ST., HERITAGE WALK	MISSISSAUGA CITY ON	
CA	E. ESCUBEDO, C. DIPLACIDO & R. LAYFIELD	HURONTARIO ST./STM-WATER MGT.	MISSISSAUGA CITY ON	
CA		Lakeshore Road East	Mississauga ON	
CA	Lakeshore Road East, Helen Street, Port Street, and St. Lawrence Drive	Lakeshore Road East	Mississauga ON	

CA	GOTTARDO PROPERTIES LTD. & GOTTARDO CORP	HURONTARIO ST. STREET A	MISSISSAUGA CITY ON	
CONV	Juan Gomez Ramirez	Lakeshore Road East	Mississauga ON	
ECA	Fram Builders (Durham) Corp.	Lakeshore Road East	Mississauga ON	M9W 6V1
ECA	The Regional Municipality of Peel	Stavebank Road	Mississauga ON	L6T 4B9
ECA	Fram Builders (Durham) Corp.	Lakeshore Road East	Mississauga ON	M9W 6V1
ECA	The Regional Municipality of Peel	Lakeshore Road East	Mississauga ON	L6T 4B9
GEN	CANADIAN NATIONAL RAILWAY	VARIOUS SITES WITHIN THE MOEE CENTRAL REGION	(SEE SCHEDULE "B") ON	
GEN	CANADIAN NATIONAL RAILWAY	VARIOUS SITES WITHIN THE MOEE CENTRAL REGION	(SEE SCHEDULE "B") ON	
GEN	BELL CANADA	VARIOUS BELL CANADA MANHOLES AND ACCESS CHAMBERS WITHIN THE MOE CENTRAL REG.	(SEE SCHEDULE "B") ON	
SPL	PETRO-CANADA	KEY LOCK STATION	MISSISSAUGA CITY ON	
SPL	ONTARIO HYDRO	PCB STORAGE SITE (TANK)	MISSISSAUGA CITY ON	
SPL	PETRO-CANADA	SERVICE STATION	MISSISSAUGA CITY ON	
SPL	CANADIAN NATIONAL RAILWAY	STORAGE TANKS	MISSISSAUGA CITY ON	
SPL	PETRO-CANADA	TANK TRUCK (CARGO)	MISSISSAUGA CITY ON	
SPL	ONTARIO HYDRO	TRANSFORMER	MISSISSAUGA CITY ON	
SPL	PETRO-CANADA	KEY LOCK STATION KEY LOCK STATION	MISSISSAUGA CITY ON	
SPL		PETRO-CANADA SERVICE STATION \	MISSISSAUGA CITY ON	
SPL	Enersource Hydro Mississauga Inc.		Mississauga ON	
SPL	Enersource Hydro Mississauga Inc.		Mississauga ON	
SPL		under Lakeshore Road	Mississauga ON	
WWIS		Lakeshore Rd. E.	Mississauga ON	
WWIS		Stavebank	Mississauga ON	

WWIS

Lakeshore Rd. E.

Mississauga ON

WWIS

Lakeshore Rd. E.

Mississauga ON

Unplottable Report

Site: MISSISSAUGA CITY
HURONTARIO STREET MISSISSAUGA CITY ON

Database:
CA

Certificate #: 3-1325-88-
Application Year: 88
Issue Date: 8/3/1988
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: GOTTARDO PROPERTIES LTD. & GOTTARDO CORP
HURONTARIO ST. STREET A MISSISSAUGA CITY ON

Database:
CA

Certificate #: 3-0471-88-
Application Year: 88
Issue Date: 5/5/1988
Approval Type: Municipal sewage
Status: Revised
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ONTARIO HYDRO
BOX 369 MISSISSAUGA CITY ON

Database:
CA

Certificate #: 8-3085-86-
Application Year: 86
Issue Date: 3/13/1987
Approval Type: Industrial air
Status: Approved in 1987
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description: FLY ASH STORAGE
Contaminants: Dustfall, Suspended Particulate Matter
Emission Control:

Site: ONTARIO HYDRO
BOX 369 MISSISSAUGA CITY ON

Database:
CA

Certificate #: 8-3005-88-
Application Year: 88

Issue Date: 5/12/1988
Approval Type: Industrial air
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description: COAL PILE
Contaminants:
Emission Control:

Site: **Lakeshore Road East, Helen Street, Port Street, and St. Lawrence Drive Mississauga ON**

Database:
CA

Certificate #: 6288-4QGS2N
Application Year: 00
Issue Date: 10/30/00
Approval Type: Municipal & Private water
Status: Approved
Application Type: New Certificate of Approval
Client Name: Fram Builders (Durham) Corp.
Client Address: 135 Queen's Plate Drive
Client City: Toronto
Client Postal Code: M9W 6V1
Project Description: Construction of watermain on Port street and St. Lawrence Drive.
Contaminants:
Emission Control:

Site: **JOSEPH GYETVAN
HURONTARIO ST. MISSISSAUGA CITY ON**

Database:
CA

Certificate #: 7-0850-87-
Application Year: 87
Issue Date: 6/25/1987
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **R.M. OF PEEL
STAVEBANK RD. MISSISSAUGA CITY ON**

Database:
CA

Certificate #: 7-0935-89-
Application Year: 89
Issue Date: 6/15/1989
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: MISSISSAUGA CITY CITY CENTRE PLAZA
HURONTARIO ST. PH. 1 TO 5 MISSISSAUGA CITY ON

Database:
CA

Certificate #: 7-2058-88-
Application Year: 88
Issue Date: 1/20/1989
Approval Type: Municipal water
Status: Approved in 1989
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: MISSISSAUGA CITY
HIGH STREET, PORT CREDIT MISSISSAUGA CITY ON

Database:
CA

Certificate #: 3-1102-93-
Application Year: 93
Issue Date: 9/27/1993
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: GEOFMAN PROPERTIES
PRIVATE LANE LAKESHORE RD. MISSISSAUGA CITY ON

Database:
CA

Certificate #: 7-0252-86-
Application Year: 86
Issue Date: 4/22/1986
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: WHITNEY HOMES
QUEEN ST. E. STREET A MISSISSAUGA CITY ON

Database:
CA

Certificate #: 7-1552-88-
Application Year: 88
Issue Date: 10/3/1988
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:

Contaminants:
Emission Control:

Site: G.L. BALL CLEARVIEW CREEK CANNELIZATION
LAKESHORE RD. MISSISSAUGA CITY ON

Database:
CA

Certificate #: 3-1828-88-
Application Year: 88
Issue Date: 9/28/1988
Approval Type: Municipal sewage
Status: Cancelled
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: WHITNEY HOMES
QUEEN ST. STREET A MISSISSAUGA CITY ON

Database:
CA

Certificate #: 3-1810-88-
Application Year: 88
Issue Date: 10/3/1988
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: MISSISSAUGA CITY
STAVEBANK RD. MISSISSAUGA CITY ON

Database:
CA

Certificate #: 3-1178-89-
Application Year: 89
Issue Date: 7/5/1989
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: MISSISSAUGA CITY
HURONTARIO ST., HERITAGE WALK MISSISSAUGA CITY ON

Database:
CA

Certificate #: 3-0914-97-
Application Year: 97
Issue Date: 8/18/1997
Approval Type: Municipal sewage
Status: Approved
Application Type:

Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: E. ESCUBEDO, C. DIPLACIDO & R. LAYFIELD
HURONTARIO ST./STM-WATER MGT. MISSISSAUGA CITY ON

Database:
CA

Certificate #: 3-0848-92-
Application Year: 92
Issue Date: 9/17/1992
Approval Type: Municipal sewage
Status: Cancelled
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Lakeshore Road East Mississauga ON

Database:
CA

Certificate #: 2788-4SGLXJ
Application Year: 00
Issue Date: 12/29/00
Approval Type: Municipal & Private sewage
Status: Approved
Application Type: New Certificate of Approval
Client Name: Corporation of the Regional Municipality of Peel
Client Address: 10 Peel Centre Drive
Client City: Brampton
Client Postal Code: L6T 4B9
Project Description: Sanitary sewers and appurtenances to be constructed in conjunction with Project No. 00-2210 in the City of Mississauga on Lakeshore Road East.
Contaminants:
Emission Control:

Site: Lakeshore Road East, Helen Street, Port Street, and St. Lawrence Drive
Lakeshore Road East Mississauga ON

Database:
CA

Certificate #: 8104-4QGR6K
Application Year: 00
Issue Date: 11/6/00
Approval Type: Municipal & Private sewage
Status: Approved
Application Type: New Certificate of Approval
Client Name: Fram Builders (Durham) Corp.
Client Address: 135 Queen's Plate Drive
Client City: Toronto
Client Postal Code: M9W 6V1
Project Description: Construction of storm and sanitary sewers on Lakeshore Road East, Helen Street, Port Street, St. Lawrence Drive and on three Easements,
Contaminants:
Emission Control:

Site: GOTTARDO PROPERTIES LTD. & GOTTARDO CORP
HURONTARIO ST. STREET A MISSISSAUGA CITY ON

Database:
CA

Certificate #: 7-0417-88-
Application Year: 88
Issue Date: 5/5/1988
Approval Type: Municipal water
Status: Revised
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Juan Gomez Ramirez
Lakeshore Road East Mississauga ON

Database:
CONV

File No:
Crown Brief No:
Court Location: Mississauga
Publication City:
Publication Title: Individual fined \$5,000 for Environmental Protection Act violation
Act: Environmental Protection Act (EPA)
Act(s):
First Matter:
Second Matter:
Investigation 1: The ministry's Environmental Investigations and Enforcement Branch
Investigation 2:
Penalty Imposed: Juan P. Gomez Ramirez was convicted of one violation under the Environmental Protection Act (EPA), fined \$5,000 plus a victim fine surcharge of \$1,250, and given seven months to pay.
Description: The conviction is for including false or misleading information in any document required to be submitted to the ministry.
Background: Juan Gomez Ramirez is a project manager employed by Rubicon Environmental (2008) Inc., an environmental consulting company.
At the relevant time, Juan Gomez Ramirez was working on a project involving the redevelopment of former industrial property on Lakeshore Road East in Mississauga, Ontario.
A Record of Site Condition (RSC) must be filed with the ministry to redevelop a property to a more sensitive use. The RSC establishes the environmental condition of the site and once accepted, the RSC is available for public review.
On February 16, 2021, the ministry received an electronic RSC submission from Rubicon for the property. The RSC was prepared by Juan Gomez Ramirez and contained several pieces of required supporting documentation including what was purported to be a certified parcel register document for the Lakeshore property. It was confirmed that this parcel register document had been digitally altered by Juan Gomez Ramirez and was not a true certified copy issued by the Land Registry Office.
The ministry's Environmental Investigations and Enforcement Branch investigated and laid charges which resulted in the conviction.
URL: <https://news.ontario.ca/en/court/1003559/individual-fined-5000-for-environmental-protection-act-violation>

Additional Details

Publication Date: September 28, 2023
Count:
Act:
Regulation:
Section:
Act/Regulation/Section:
Date of Offence: On or about February 16, 2021
Date of Conviction: July 18, 2023
Date Charged:
Charge Disposition:
Fine: \$5,000
Synopsis:

Site: Fram Builders (Durham) Corp.
Lakeshore Road East Mississauga ON M9W 6V1

Database:
ECA

Approval No: 8104-4QGR6K

MOE District:

Approval Date: 2000-11-06
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: Fram Builders (Durham) Corp.
Address: Lakeshore Road East
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/1122-4Q3S8T-14.pdf>
PDF Site Location:

City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: *The Regional Municipality of Peel*
Stavebank Road Mississauga ON L6T 4B9

Database:
ECA

Approval No: 9593-63BGUE
Approval Date: 2004-07-29
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-Municipal Drinking Water Systems
Project Type: Municipal Drinking Water Systems
Business Name: The Regional Municipality of Peel
Address: Stavebank Road
Full Address:
Full PDF Link:
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: *Fram Builders (Durham) Corp.*
Lakeshore Road East Mississauga ON M9W 6V1

Database:
ECA

Approval No: 6288-4QGS2N
Approval Date: 2000-10-30
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-Municipal and Private Water Works
Project Type: Municipal and Private Water Works
Business Name: Fram Builders (Durham) Corp.
Address: Lakeshore Road East
Full Address:
Full PDF Link:
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: *The Regional Municipality of Peel*
Lakeshore Road East Mississauga ON L6T 4B9

Database:
ECA

Approval No: 2788-4SGLXJ
Approval Date: 2000-12-29
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: The Regional Municipality of Peel
Address: Lakeshore Road East
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/6750-4S8KEW-14.pdf>
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Generator Info

Generator No:	ONR000703	Choice of Contact:	
Approval Years:	2013	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	482113
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	MAINLINE FREIGHT RAIL TRANSPORTATION		

Waste Detail(s)

Waste Class:	270
Waste Class Name:	OTHER SPECIFIED ORGANICS

Waste Detail(s)

Waste Class:	112
Waste Class Name:	ACID WASTE - HEAVY METALS

Waste Detail(s)

Waste Class:	243
Waste Class Name:	PCBS

Waste Detail(s)

Waste Class:	114
Waste Class Name:	OTHER INORGANIC ACID WASTES

Waste Detail(s)

Waste Class:	212
Waste Class Name:	ALIPHATIC SOLVENTS

Waste Detail(s)

Waste Class:	331
Waste Class Name:	WASTE COMPRESSED GASES

Waste Detail(s)

Waste Class:	148
Waste Class Name:	INORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class:	266
Waste Class Name:	PHENOLIC WASTES

Waste Detail(s)

Waste Class:	312
Waste Class Name:	PATHOLOGICAL WASTES

Waste Detail(s)

Waste Class: 221
Waste Class Name: LIGHT FUELS

Waste Detail(s)

Waste Class: 252
Waste Class Name: WASTE OILS & LUBRICANTS

Waste Detail(s)

Waste Class: 121
Waste Class Name: ALKALINE WASTES - HEAVY METALS

Waste Detail(s)

Waste Class: 262
Waste Class Name: DETERGENTS/SOAPS

Waste Detail(s)

Waste Class: 146
Waste Class Name: OTHER SPECIFIED INORGANICS

Waste Detail(s)

Waste Class: 213
Waste Class Name: PETROLEUM DISTILLATES

Waste Detail(s)

Waste Class: 241
Waste Class Name: HALOGENATED SOLVENTS

Waste Detail(s)

Waste Class: 251
Waste Class Name: OIL SKIMMINGS & SLUDGES

Waste Detail(s)

Waste Class: 211
Waste Class Name: AROMATIC SOLVENTS

Waste Detail(s)

Waste Class: 253
Waste Class Name: EMULSIFIED OILS

Waste Detail(s)

Waste Class: 135
Waste Class Name: REACTIVE ANION WASTES

Waste Detail(s)

Waste Class: 268
Waste Class Name: AMINES

Waste Detail(s)

Waste Class: 232
Waste Class Name: POLYMERIC RESINS

Waste Detail(s)

Waste Class: 254
Waste Class Name: TRANSFER STATION OILS WASTES

Waste Detail(s)

Waste Class: 269
Waste Class Name: NON-HALOGENATED PESTICIDES

Waste Detail(s)

Waste Class: 222
Waste Class Name: HEAVY FUELS

Waste Detail(s)

Waste Class: 113
Waste Class Name: ACID WASTE - OTHER METALS

Waste Detail(s)

Waste Class: 145
Waste Class Name: PAINT/PIGMENT/COATING RESIDUES

Waste Detail(s)

Waste Class: 122
Waste Class Name: ALKALINE WASTES - OTHER METALS

Waste Detail(s)

Waste Class: 263
Waste Class Name: ORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class: 231
Waste Class Name: LATEX WASTES

Site: CANADIAN NATIONAL RAILWAY
VARIOUS SITES WITHIN THE MOEE CENTRAL REGION (SEE SCHEDULE "B") ON

Database:
GEN

Generator Info

Generator No:	ONR000703	Choice of Contact:	
Approval Years:	2012	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	482113
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	Mainline Freight Rail Transportation		

Waste Detail(s)

Waste Class: 145
Waste Class Name: PAINT/PIGMENT/COATING RESIDUES

Waste Detail(s)

Waste Class: 113
Waste Class Name: ACID WASTE - OTHER METALS

Waste Detail(s)

Waste Class: 331
Waste Class Name: WASTE COMPRESSED GASES

Waste Detail(s)

Waste Class: 211
Waste Class Name: AROMATIC SOLVENTS

Waste Detail(s)

Waste Class: 148
Waste Class Name: INORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class: 222
Waste Class Name: HEAVY FUELS

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

Waste Detail(s)

Waste Class: 252
Waste Class Name: WASTE OILS & LUBRICANTS

Waste Detail(s)

Waste Class: 212
Waste Class Name: ALIPHATIC SOLVENTS

Waste Detail(s)

Waste Class: 263
Waste Class Name: ORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class: 221
Waste Class Name: LIGHT FUELS

Waste Detail(s)

Waste Class: 146
Waste Class Name: OTHER SPECIFIED INORGANICS

Waste Detail(s)

Waste Class: 243
Waste Class Name: PCBS

Waste Detail(s)

Waste Class: 122
Waste Class Name: ALKALINE WASTES - OTHER METALS

Waste Detail(s)

Waste Class: 262
Waste Class Name: DETERGENTS/SOAPS

Waste Detail(s)

Waste Class: 251
Waste Class Name: OIL SKIMMINGS & SLUDGES

Waste Detail(s)

Waste Class: 253
Waste Class Name: EMULSIFIED OILS

Waste Detail(s)

Waste Class: 213
Waste Class Name: PETROLEUM DISTILLATES

Waste Detail(s)

Waste Class: 270
Waste Class Name: OTHER SPECIFIED ORGANICS

Waste Detail(s)

Waste Class: 266
Waste Class Name: PHENOLIC WASTES

Waste Detail(s)

Waste Class: 114
Waste Class Name: OTHER INORGANIC ACID WASTES

Waste Detail(s)

Waste Class: 231
Waste Class Name: LATEX WASTES

Waste Detail(s)

Waste Class: 232
Waste Class Name: POLYMERIC RESINS

Waste Detail(s)

Waste Class: 269
Waste Class Name: NON-HALOGENATED PESTICIDES

Waste Detail(s)

Waste Class: 254
Waste Class Name: TRANSFER STATION OILS WASTES

Waste Detail(s)

Waste Class: 121
Waste Class Name: ALKALINE WASTES - HEAVY METALS

Waste Detail(s)

Waste Class: 268
Waste Class Name: AMINES

Waste Detail(s)

Waste Class: 135
Waste Class Name: REACTIVE ANION WASTES

Waste Detail(s)

Waste Class: 241
Waste Class Name: HALOGENATED SOLVENTS

Waste Detail(s)

Waste Class: 112
Waste Class Name: ACID WASTE - HEAVY METALS

Site: BELL CANADA
VARIOUS BELL CANADA MANHOLES AND ACCESS CHAMBERS WITHIN THE MOE CENTRAL REG. (SEE
SCHEDULE "B") ON

Database:
GEN

Generator Info

Generator No:	ONR000303	Choice of Contact:	
Approval Years:	2013	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	517110, 517210, 517510
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	WIRED TELECOMMUNICATIONS CARRIERS, WIRELESS TELECOMMUNICATIONS CARRIERS (EXCEPT SATELLITE)		

Waste Detail(s)

Waste Class: 252
Waste Class Name: WASTE OILS & LUBRICANTS

Waste Detail(s)

Waste Class: 221
Waste Class Name: LIGHT FUELS

Waste Detail(s)

Waste Class: 150
Waste Class Name: INERT INORGANIC WASTES

Waste Detail(s)

Waste Class: 253
Waste Class Name: EMULSIFIED OILS

Waste Detail(s)

Waste Class: 251
Waste Class Name: OIL SKIMMINGS & SLUDGES

Site: PETRO-CANADA
KEY LOCK STATION MISSISSAUGA CITY ON

Database:
SPL

Ref No: 80676
Year:
Incident Dt: 1/7/1993
Dt MOE Arvl on Scn:
MOE Reported Dt: 1/7/1993
Dt Document Closed:
Site No:
MOE Response:
Site County/District:
Site Geo Ref Meth:
Site District Office:
Nearest Watercourse:
Site Name:
Site Address:
Site Region:
Site Municipality: MISSISSAUGA CITY
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:
Client Name:
Client Type:
Source Type:
Incident Cause: OTHER CONTAINER LEAK
Incident Preceding Spill:
Incident Reason: EQUIPMENT FAILURE
Incident Summary: PETRO CANADA-89 L DIESEL FUEL TO PAD,NOZZLE FAILEDCONTAINED,CLEANED-UP.
Environment Impact: NOT ANTICIPATED
Health Env Consequence:
Nature of Impact:
Contaminant Qty:
Contaminant Qty 1:
Contaminant Unit:
Contaminant Code:
Contaminant Name:
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium: LAND
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class:
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site: ONTARIO HYDRO
PCB STORAGE SITE (TANK) MISSISSAUGA CITY ON

Database:
SPL

Ref No:	120906	Municipality No:	21102
Year:		Nature of Damage:	
Incident Dt:	11/16/1995	Discharger Report:	
Dt MOE Arvl on Scn:		Material Group:	
MOE Reported Dt:	11/16/1995	Impact to Health:	
Dt Document Closed:		Agency Involved:	
Site No:			
MOE Response:			
Site County/District:			
Site Geo Ref Meth:			
Site District Office:			
Nearest Watercourse:			
Site Name:			
Site Address:			
Site Region:			
Site Municipality:	MISSISSAUGA CITY		
Site Lot:			
Site Conc:			
Site Geo Ref Accu:			
Site Map Datum:			
Northing:			
Easting:			
Entity Operating Name:			
Client Name:			
Client Type:			
Source Type:			
Incident Cause:	OTHER CONTAINER LEAK		
Incident Preceding Spill:			
Incident Reason:	DAMAGE BY MOVING EQUIPMENT		
Incident Summary:	ONTARIO HYDRO:2.5L MINERAL OIL TO GROUND ANDCATCH BASIN (400PPM)		
Environment Impact:	POSSIBLE		
Health Env Consequence:			
Nature of Impact:	Water course or lake		
Contaminant Qty:			
Contaminant Qty 1:			
Contaminant Unit:			
Contaminant Code:			
Contaminant Name:			
Contaminant Limit 1:			
Contam Limit Freq 1:			
Contaminant UN No 1:			
Receiving Medium:	LAND / WATER		
Activity Preceding Spill:			
Property 2nd Watershed:			
Property Tertiary Watershed:			
Sector Type:			
SAC Action Class:			
Call Report Locatn Geodata:			
Time Reported:			
System Facility Address:			

Site: PETRO-CANADA
SERVICE STATION MISSISSAUGA CITY ON

Database:
SPL

Ref No:	8408	Municipality No:	21102
Year:		Nature of Damage:	
Incident Dt:	8/21/1988	Discharger Report:	
Dt MOE Arvl on Scn:		Material Group:	
MOE Reported Dt:	8/21/1988	Impact to Health:	
Dt Document Closed:		Agency Involved:	
Site No:			
MOE Response:			
Site County/District:			
Site Geo Ref Meth:			
Site District Office:			
Nearest Watercourse:			
Site Name:			
Site Address:			

Site Region:
Site Municipality: MISSISSAUGA CITY
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:
Client Name:
Client Type:
Source Type:
Incident Cause: PIPE/HOSE LEAK
Incident Preceding Spill:
Incident Reason: ERROR
Incident Summary: PETROCAN SERVICE CENTRE - UNKNOWN AMOUNT (SMALL) OF GASOLINE TO PAVEMENT.
Environment Impact:
Health Env Consequence:
Nature of Impact:
Contaminant Qty:
Contaminant Qty 1:
Contaminant Unit:
Contaminant Code:
Contaminant Name:
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium: LAND
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class:
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site: CANADIAN NATIONAL RAILWAY
 STORAGE TANKS MISSISSAUGA CITY ON

Database:
[SPL](#)

Ref No:	32667	Municipality No:	21102
Year:		Nature of Damage:	
Incident Dt:	3/14/1990	Discharger Report:	
Dt MOE Arvl on Scn:		Material Group:	
MOE Reported Dt:	3/14/1990	Impact to Health:	
Dt Document Closed:		Agency Involved:	
Site No:			
MOE Response:			
Site County/District:			
Site Geo Ref Meth:			
Site District Office:			
Nearest Watercourse:			
Site Name:			
Site Address:			
Site Region:			
Site Municipality:	MISSISSAUGA CITY		
Site Lot:			
Site Conc:			
Site Geo Ref Accu:			
Site Map Datum:			
Northing:			
Easting:			
Entity Operating Name:			
Client Name:			
Client Type:			
Source Type:			
Incident Cause:	CONTAINER OVERFLOW		
Incident Preceding Spill:			

Incident Reason: EQUIPMENT FAILURE
Incident Summary: BACKENTRY-CNR-OIL CONTAMINATION OF GROUND
Environment Impact:
Health Env Consequence:
Nature of Impact:
Contaminant Qty:
Contaminant Qty 1:
Contaminant Unit:
Contaminant Code:
Contaminant Name:
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium: LAND
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class:
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site: PETRO-CANADA
TANK TRUCK (CARGO) MISSISSAUGA CITY ON

Database:
SPL

Ref No: 51137 **Municipality No:** 21102
Year: **Nature of Damage:**
Incident Dt: 5/24/1991 **Discharger Report:**
Dt MOE Arvl on Scn: **Material Group:**
MOE Reported Dt: 5/24/1991 **Impact to Health:**
Dt Document Closed: **Agency Involved:**
Site No:
MOE Response:
Site County/District:
Site Geo Ref Meth:
Site District Office:
Nearest Watercourse:
Site Name:
Site Address:
Site Region:
Site Municipality: MISSISSAUGA CITY
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:
Client Name:
Client Type:
Source Type:
Incident Cause: PIPE/HOSE LEAK
Incident Preceding Spill:
Incident Reason: ERROR
Incident Summary: PETRO CANADA - 50 L. OF GAS TO GROUND AT 2125 DUNDAS STREET
Environment Impact: NOT ANTICIPATED
Health Env Consequence:
Nature of Impact:
Contaminant Qty:
Contaminant Qty 1:
Contaminant Unit:
Contaminant Code:
Contaminant Name:
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium: LAND

Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class:
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site: ONTARIO HYDRO
TRANSFORMER MISSISSAUGA CITY ON

Database:
[SPL](#)

Ref No:	66268	Municipality No:	21102
Year:		Nature of Damage:	
Incident Dt:	1/21/1992	Discharger Report:	
Dt MOE Arvl on Scn:		Material Group:	
MOE Reported Dt:	1/21/1992	Impact to Health:	
Dt Document Closed:		Agency Involved:	
Site No:			
MOE Response:			
Site County/District:			
Site Geo Ref Meth:			
Site District Office:			
Nearest Watercourse:			
Site Name:			
Site Address:			
Site Region:			
Site Municipality:	MISSISSAUGA CITY		
Site Lot:			
Site Conc:			
Site Geo Ref Accu:			
Site Map Datum:			
Northing:			
Easting:			
Entity Operating Name:			
Client Name:			
Client Type:			
Source Type:			
Incident Cause:	COOLING SYSTEM LEAK		
Incident Preceding Spill:			
Incident Reason:	EQUIPMENT FAILURE		
Incident Summary:	ONTARIO HYDRO-680 LITERS TRANSFORMER OIL TO GRND, SOME TO SEWER,RECOVERED.		
Environment Impact:	NOT ANTICIPATED		
Health Env Consequence:			
Nature of Impact:			
Contaminant Qty:			
Contaminant Qty 1:			
Contaminant Unit:			
Contaminant Code:			
Contaminant Name:			
Contaminant Limit 1:			
Contam Limit Freq 1:			
Contaminant UN No 1:			
Receiving Medium:	LAND		
Activity Preceding Spill:			
Property 2nd Watershed:			
Property Tertiary Watershed:			
Sector Type:			
SAC Action Class:			
Call Report Locatn Geodata:			
Time Reported:			
System Facility Address:			

Site: PETRO-CANADA
KEY LOCK STATION KEY LOCK STATION MISSISSAUGA CITY ON

Database:
[SPL](#)

Ref No:	81754	Municipality No:	21102

Year:		Nature of Damage:	
Incident Dt:	2/11/1993	Discharger Report:	
Dt MOE Arvl on Scn:		Material Group:	
MOE Reported Dt:	2/11/1993	Impact to Health:	
Dt Document Closed:		Agency Involved:	REPORT FAXED TO MCCR
Site No:			
MOE Response:			
Site County/District:			
Site Geo Ref Meth:			
Site District Office:			
Nearest Watercourse:			
Site Name:			
Site Address:			
Site Region:			
Site Municipality:	MISSISSAUGA CITY		
Site Lot:			
Site Conc:			
Site Geo Ref Accu:			
Site Map Datum:			
Northing:			
Easting:			
Entity Operating Name:			
Client Name:			
Client Type:			
Source Type:			
Incident Cause:	PIPE/HOSE LEAK		
Incident Preceding Spill:			
Incident Reason:	ERROR		
Incident Summary:	PETRO CANADA - 25 L OF DIESEL FUEL TO ASPHALT AT KEY LOCK STATION.		
Environment Impact:	NOT ANTICIPATED		
Health Env Consequence:			
Nature of Impact:			
Contaminant Qty:			
Contaminant Qty 1:			
Contaminant Unit:			
Contaminant Code:			
Contaminant Name:			
Contaminant Limit 1:			
Contam Limit Freq 1:			
Contaminant UN No 1:			
Receiving Medium:	LAND		
Activity Preceding Spill:			
Property 2nd Watershed:			
Property Tertiary Watershed:			
Sector Type:			
SAC Action Class:			
Call Report Locatn Geodata:			
Time Reported:			
System Facility Address:			

Site:	PETRO-CANADA SERVICE STATION \ MISSISSAUGA CITY ON	Database: SPL

Ref No:	123672	Municipality No:	21102
Year:		Nature of Damage:	
Incident Dt:	2/16/1996	Discharger Report:	
Dt MOE Arvl on Scn:		Material Group:	
MOE Reported Dt:	2/16/1996	Impact to Health:	
Dt Document Closed:		Agency Involved:	
Site No:			
MOE Response:			
Site County/District:			
Site Geo Ref Meth:			
Site District Office:			
Nearest Watercourse:			
Site Name:			
Site Address:			
Site Region:			

Site Municipality: MISSISSAUGA CITY
 Site Lot:
 Site Conc:
 Site Geo Ref Accu:
 Site Map Datum:
 Northing:
 Easting:
 Entity Operating Name:
 Client Name:
 Client Type:
 Source Type:
 Incident Cause:
 Incident Preceding Spill:
 Incident Reason:
 Incident Summary:
 Environment Impact:
 Health Env Consequence:
 Nature of Impact:
 Contaminant Qty:
 Contaminant Qty 1:
 Contaminant Unit:
 Contaminant Code:
 Contaminant Name:
 Contaminant Limit 1:
 Contam Limit Freq 1:
 Contaminant UN No 1:
 Receiving Medium: LAND
 Activity Preceding Spill:
 Property 2nd Watershed:
 Property Tertiary Watershed:
 Sector Type:
 SAC Action Class:
 Call Report Locatn Geodata:
 Time Reported:
 System Facility Address:

Site: Enersource Hydro Mississauga Inc.
 Mississauga ON

Database:
 SPL

Ref No:	8785-9KBJTE	Municipality No:
Year:		Nature of Damage:
Incident Dt:	2014/04/28	Discharger Report:
Dt MOE Arvl on Scn:		Material Group:
MOE Reported Dt:	2014/05/21	Impact to Health:
Dt Document Closed:		Agency Involved:
Site No:	NA	
MOE Response:		
Site County/District:		
Site Geo Ref Meth:		
Site District Office:		
Nearest Watercourse:		
Site Name:	6901 Glory Crt<UNOFFICIAL>	
Site Address:		
Site Region:		
Site Municipality:	Mississauga	
Site Lot:		
Site Conc:		
Site Geo Ref Accu:		
Site Map Datum:		
Northing:		
Easting:		
Entity Operating Name:		
Client Name:	Enersource Hydro Mississauga Inc.	
Client Type:		
Source Type:		
Incident Cause:	Leak/Break	
Incident Preceding Spill:		
Incident Reason:	Equipment Failure	

Incident Summary: Enersource Hydro: 118L non PCB transformer oil to grd
Environment Impact: Confirmed
Health Env Consequence:
Nature of Impact: Soil Contamination
Contaminant Qty: 118 L
Contaminant Qty 1: 118
Contaminant Unit: L
Contaminant Code: 15
Contaminant Name: TRANSFORMER OIL (N.O.S.)
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium:
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type: Transformer
SAC Action Class: Land Spills
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site: Enersource Hydro Mississauga Inc.
 Mississauga ON

Database:
 SPL

Ref No: 4022-9LERFW
Year:
Incident Dt: 2014/06/25
Dt MOE Arvl on Scn:
MOE Reported Dt: 2014/06/25
Dt Document Closed: 2014/07/10
Site No: NA
MOE Response: No Field Response
Site County/District:
Site Geo Ref Meth:
Site District Office:
Nearest Watercourse:
Site Name: Enola Ave, between The Greenway and Lakeshore<UNOFFICIAL>
Site Address:
Site Region:
Site Municipality: Mississauga
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:
Client Name: Enersource Hydro Mississauga Inc.
Client Type:
Source Type:
Incident Cause: Collision/Accident
Incident Preceding Spill:
Incident Reason: Unknown / N/A
Incident Summary: 40L pcb (14ppm) transformer oil to road, cb, cleaning
Environment Impact: Confirmed
Health Env Consequence:
Nature of Impact: Surface Water Pollution
Contaminant Qty: 40 L
Contaminant Qty 1: 40
Contaminant Unit: L
Contaminant Code: 15
Contaminant Name: TRANSFORMER OIL (N.O.S.)
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium:
Activity Preceding Spill:

Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type: Transformer
SAC Action Class: Watercourse Spills
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site:
under Lakeshore Road Mississauga ON

Database:
[SPL](#)

Ref No: 8707-9YNM5N
Year:
Incident Dt: 7/22/2015
Dt MOE Arvl on Scn:
MOE Reported Dt: 7/22/2015
Dt Document Closed: 9/17/2015
Site No: NA
MOE Response: No
Site County/District:
Site Geo Ref Meth:
Site District Office:
Nearest Watercourse:
Site Name: Cooksville Creek<UNOFFICIAL>
Site Address: under Lakeshore Road
Site Region:
Site Municipality: Mississauga
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:
Client Name:
Client Type:
Source Type:
Incident Cause:
Incident Preceding Spill:
Incident Reason: Deliberate Act
Incident Summary: RofPeel: sani siphon backup to Cooksville
Environment Impact:
Health Env Consequence:
Nature of Impact:
Contaminant Qty: 0 other - see incident description
Contaminant Qty 1: 0
Contaminant Unit: other - see incident description
Contaminant Code: 44
Contaminant Name: SEWAGE,RAW UNCHLORINATED
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium:
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type: Municipal Sewage
SAC Action Class: Watercourse Spills
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Municipality No:
Nature of Damage:
Discharger Report:
Material Group:
Impact to Health:
Agency Involved:

Site:
Lakeshore Rd. E. Mississauga ON

Database:
[WWIS](#)

Well ID: 7428674
Construction Date:
Flowing (Y/N):
Flow Rate:

Use 1st:	Monitoring	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Observation Wells	Date Received:	09/12/2022
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	GBL9UXN7	Contractor:	7472
Tag:	A357766	Form Version:	9
Constructn Method:		Owner:	
Elevation (m):		County:	PEEL
Elevatn Reliabilty:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MISSISSAUGA CITY (PORT CREDIT)		
Site Info:			

Bore Hole Information

Bore Hole ID:	1009202441	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	613822.00
Code OB Desc:		North83:	4823056.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	07/29/2022	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	www
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock Materials Interval

Formation ID:	1009202544
Layer:	4
Color:	2
General Color:	GREY
Material 1:	28
Material 1 Desc:	SAND
Material 2:	11
Material 2 Desc:	GRAVEL
Material 3:	79
Material 3 Desc:	PACKED
Formation Top Depth:	40.0
Formation End Depth:	62.0
Formation End Depth UOM:	ft

Overburden and Bedrock Materials Interval

Formation ID:	1009202542
Layer:	2
Color:	2
General Color:	GREY
Material 1:	34
Material 1 Desc:	TILL
Material 2:	
Material 2 Desc:	
Material 3:	79

Material 3 Desc: PACKED
Formation Top Depth: 4.0
Formation End Depth: 15.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 1009202543
Layer: 3
Color: 2
General Color: GREY
Material 1: 06
Material 1 Desc: SILT
Material 2:
Material 2 Desc:
Material 3: 79
Material 3 Desc: PACKED
Formation Top Depth: 15.0
Formation End Depth: 40.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 1009202541
Layer: 1
Color: 6
General Color: BROWN
Material 1: 05
Material 1 Desc: CLAY
Material 2: 01
Material 2 Desc: FILL
Material 3: 77
Material 3 Desc: LOOSE
Formation Top Depth: 0.0
Formation End Depth: 4.0
Formation End Depth UOM: ft

Annular Space/Abandonment
Sealing Record

Plug ID: 1009202641
Layer: 2
Plug From: 51.0
Plug To: 62.0
Plug Depth UOM: ft

Annular Space/Abandonment
Sealing Record

Plug ID: 1009202640
Layer: 1
Plug From: 0.0
Plug To: 51.0
Plug Depth UOM: ft

Annular Space/Abandonment
Sealing Record

Plug ID: 1009202620
Layer: 1
Plug From:
Plug To:
Plug Depth UOM: ft

Method of Construction & Well Use

Method Construction ID: 1009202500
Method Construction Code: E
Method Construction: Auger
Other Method Construction:

Pipe Information

Pipe ID: 1009202478
Casing No: 0
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 1009202571
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 52.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Screen

Screen ID: 1009202586
Layer: 1
Slot: 10
Screen Top Depth: 52.0
Screen End Depth: 62.0
Screen Material: 5
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 2.5

Results of Well Yield Testing

Pumping Test Method Desc:
Pump Test ID: 1009202479
Pump Set At:
Static Level:
Final Level After Pumping:
Recommended Pump Depth:
Pumping Rate:
Flowing Rate:
Recommended Pump Rate:
Levels UOM: ft
Rate UOM: GPM
Water State After Test Code:
Water State After Test:
Pumping Test Method:
Pumping Duration HR:
Pumping Duration MIN:
Flowing:

Hole Diameter

Hole ID: 1009202605
Diameter: 3.799999952316284
Depth From: 20.0
Depth To: 62.0

Hole Depth UOM: ft
Hole Diameter UOM: inch

Hole Diameter

Hole ID: 1009202604
Diameter: 7.5
Depth From: 0.0
Depth To: 20.0
Hole Depth UOM: ft
Hole Diameter UOM: inch

Site: Stavebank Mississauga ON **Database:** [WWIS](#)

Well ID:	7391932	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:		Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:		Date Received:	07/12/2021
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	Yes
Audit No:	Z353327	Contractor:	7610
Tag:		Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	--
Elevatn Reliabilty:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	---		
Site Info:			

Bore Hole Information

Bore Hole ID:	1008712225	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	
Code OB:		East83:	
Code OB Desc:		North83:	
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	9
Date Completed:	06/23/2021	UTMRC Desc:	unknown UTM
Remarks:		Location Method:	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock
Materials Interval

Formation ID: 1009912491
Layer: 1
Color:
General Color:
Material 1:
Material 1 Desc:
Material 2:
Material 2 Desc:
Material 3:

Material 3 Desc:
Formation Top Depth: 0.0
Formation End Depth:
Formation End Depth UOM:

**Annular Space/Abandonment
Sealing Record**

Plug ID: 1009913433
Layer: 1
Plug From: 0.0
Plug To: 5.300000190734863
Plug Depth UOM: m

Pipe Information

Pipe ID: 1009767780
Casing No: 0
Comment:
Alt Name:

Results of Well Yield Testing

Pumping Test Method Desc:
Pump Test ID: 1009915804
Pump Set At:
Static Level:
Final Level After Pumping:
Recommended Pump Depth:
Pumping Rate:
Flowing Rate:
Recommended Pump Rate:
Levels UOM: m
Rate UOM: LPM
Water State After Test Code:
Water State After Test:
Pumping Test Method: 0
Pumping Duration HR:
Pumping Duration MIN:
Flowing: No

Site:
Lakeshore Rd. E. Mississauga ON

Database:
[WWIS](#)

Well ID: 7428671
Construction Date:
Use 1st: Monitoring
Use 2nd:
Final Well Status: Observation Wells
Water Type:
Casing Material:
Audit No: 8THC67RI
Tag: A357736
Constructn Method:
Elevation (m):
Elevatn Reliability:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: MISSISSAUGA CITY
Site Info:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src:
Date Received: 09/12/2022
Selected Flag: TRUE
Abandonment Rec:
Contractor: 7472
Form Version: 9
Owner:
County: PEEL
Lot:
Concession:
Concession Name:
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID:	1009202432	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	616569.00
Code OB Desc:		North83:	4826178.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	07/29/2022	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	www
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock
Materials Interval

Formation ID:	1009202532
Layer:	1
Color:	6
General Color:	BROWN
Material 1:	01
Material 1 Desc:	FILL
Material 2:	
Material 2 Desc:	
Material 3:	77
Material 3 Desc:	LOOSE
Formation Top Depth:	0.0
Formation End Depth:	5.0
Formation End Depth UOM:	ft

Overburden and Bedrock
Materials Interval

Formation ID:	1009202533
Layer:	2
Color:	6
General Color:	BROWN
Material 1:	05
Material 1 Desc:	CLAY
Material 2:	06
Material 2 Desc:	SILT
Material 3:	79
Material 3 Desc:	PACKED
Formation Top Depth:	5.0
Formation End Depth:	15.0
Formation End Depth UOM:	ft

Overburden and Bedrock
Materials Interval

Formation ID:	1009202534
Layer:	3
Color:	2
General Color:	GREY
Material 1:	17
Material 1 Desc:	SHALE
Material 2:	
Material 2 Desc:	
Material 3:	73
Material 3 Desc:	HARD
Formation Top Depth:	15.0
Formation End Depth:	34.0

Formation End Depth UOM: ft

**Annular Space/Abandonment
Sealing Record**

Plug ID: 1009202617
Layer: 1
Plug From:
Plug To:
Plug Depth UOM: ft

**Annular Space/Abandonment
Sealing Record**

Plug ID: 1009202635
Layer: 2
Plug From: 28.0
Plug To: 34.0
Plug Depth UOM: ft

**Annular Space/Abandonment
Sealing Record**

Plug ID: 1009202634
Layer: 1
Plug From: 0.0
Plug To: 28.0
Plug Depth UOM: ft

**Method of Construction & Well
Use**

Method Construction ID: 1009202497
Method Construction Code: E
Method Construction: Auger
Other Method Construction:

Pipe Information

Pipe ID: 1009202472
Casing No: 0
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 1009202568
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 29.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Screen

Screen ID: 1009202583
Layer: 1
Slot: 10
Screen Top Depth: 29.0
Screen End Depth: 34.0
Screen Material: 5

Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 2.5

Results of Well Yield Testing

Pumping Test Method Desc:
Pump Test ID: 1009202473
Pump Set At:
Static Level:
Final Level After Pumping:
Recommended Pump Depth:
Pumping Rate:
Flowing Rate:
Recommended Pump Rate:
Levels UOM: ft
Rate UOM: GPM
Water State After Test Code:
Water State After Test:
Pumping Test Method:
Pumping Duration HR:
Pumping Duration MIN:
Flowing:

Hole Diameter

Hole ID: 1009202598
Diameter: 7.5
Depth From: 0.0
Depth To: 20.0
Hole Depth UOM: ft
Hole Diameter UOM: inch

Hole Diameter

Hole ID: 1009202599
Diameter: 3.799999952316284
Depth From: 20.0
Depth To: 34.0
Hole Depth UOM: ft
Hole Diameter UOM: inch

Site:

Lakeshore Rd. E. Mississauga ON

Database:
[WWIS](#)

Well ID: 7428672
Construction Date:
Use 1st: Monitoring
Use 2nd:
Final Well Status: Observation Wells
Water Type:
Casing Material:
Audit No: HMWT4E22
Tag: A357744
Constructn Method:
Elevation (m):
Elevatn Reliabilty:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: MISSISSAUGA CITY
Site Info:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src:
Date Received: 09/12/2022
Selected Flag: TRUE
Abandonment Rec:
Contractor: 7472
Form Version: 9
Owner:
County: PEEL
Lot:
Concession:
Concession Name:
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID:	1009202435	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	616910.00
Code OB Desc:		North83:	4826648.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	07/29/2022	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock**Materials Interval**

Formation ID:	1009202537
Layer:	3
Color:	2
General Color:	GREY
Material 1:	17
Material 1 Desc:	SHALE
Material 2:	
Material 2 Desc:	
Material 3:	73
Material 3 Desc:	HARD
Formation Top Depth:	15.0
Formation End Depth:	27.0
Formation End Depth UOM:	ft

Overburden and Bedrock**Materials Interval**

Formation ID:	1009202535
Layer:	1
Color:	6
General Color:	BROWN
Material 1:	01
Material 1 Desc:	FILL
Material 2:	
Material 2 Desc:	
Material 3:	77
Material 3 Desc:	LOOSE
Formation Top Depth:	0.0
Formation End Depth:	5.0
Formation End Depth UOM:	ft

Overburden and Bedrock**Materials Interval**

Formation ID:	1009202536
Layer:	2
Color:	6
General Color:	BROWN
Material 1:	05
Material 1 Desc:	CLAY
Material 2:	06
Material 2 Desc:	SILT
Material 3:	79
Material 3 Desc:	PACKED
Formation Top Depth:	5.0

Formation End Depth: 15.0
Formation End Depth UOM: ft

**Annular Space/Abandonment
Sealing Record**

Plug ID: 1009202618
Layer: 1
Plug From:
Plug To:
Plug Depth UOM: ft

**Annular Space/Abandonment
Sealing Record**

Plug ID: 1009202637
Layer: 2
Plug From: 21.0
Plug To: 27.0
Plug Depth UOM: ft

**Annular Space/Abandonment
Sealing Record**

Plug ID: 1009202636
Layer: 1
Plug From: 0.0
Plug To: 21.0
Plug Depth UOM: ft

**Method of Construction & Well
Use**

Method Construction ID: 1009202498
Method Construction Code: E
Method Construction: Auger
Other Method Construction:

Pipe Information

Pipe ID: 1009202474
Casing No: 0
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 1009202569
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 22.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Screen

Screen ID: 1009202584
Layer: 1
Slot: 10
Screen Top Depth: 22.0
Screen End Depth: 27.0

Screen Material: 5
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 2.5

Results of Well Yield Testing

Pumping Test Method Desc:
Pump Test ID: 1009202475
Pump Set At:
Static Level:
Final Level After Pumping:
Recommended Pump Depth:
Pumping Rate:
Flowing Rate:
Recommended Pump Rate:
Levels UOM: ft
Rate UOM: GPM
Water State After Test Code:
Water State After Test:
Pumping Test Method:
Pumping Duration HR:
Pumping Duration MIN:
Flowing:

Hole Diameter

Hole ID: 1009202601
Diameter: 3.799999952316284
Depth From: 20.0
Depth To: 27.0
Hole Depth UOM: ft
Hole Diameter UOM: inch

Hole Diameter

Hole ID: 1009202600
Diameter: 7.5
Depth From: 0.0
Depth To: 20.0
Hole Depth UOM: ft
Hole Diameter UOM: inch

Appendix: Database Descriptions

*Environmental Risk Information Services (ERIS) can search the following databases. The extent of historical information varies with each database and current information is determined by what is publicly available to ERIS at the time of update. **Note:** Databases denoted with " * " indicates that the database will no longer be updated. See the individual database description for more information.*

Abandoned Aggregate Inventory:

Provincial

[AAGR](#)

The MAAP Program maintains a database of abandoned pits and quarries. Please note that the database is only referenced by lot and concession and city/town location. The database provides information regarding the location, type, size, land use, status and general comments.*

Government Publication Date: Sept 2002*

Aggregate Inventory:

Provincial

[AGR](#)

This database of licensed and permitted pits and quarries is maintained by the Ontario Ministry of Natural Resources and Forestry (MNRF), as regulated under the Aggregate Resources Act, R.S.O. 1990. Aggregate site data has been divided into active and inactive sites. Active sites may be further subdivided into partial surrenders. In partial surrenders, defined areas of a site are inactive while the rest of the site remains active.

Government Publication Date: Up to Nov 2024

Abandoned Mine Information System:

Provincial

[AMIS](#)

The Abandoned Mines Information System contains data on known abandoned and inactive mines located on both Crown and privately held lands. The information was provided by the Ministry of Northern Development and Mines (MNDM), with the following disclaimer: "the database provided has been compiled from various sources, and the Ministry of Northern Development and Mines makes no representation and takes no responsibility that such information is accurate, current or complete". Reported information includes official mine name, status, background information, mine start/end date, primary commodity, mine features, hazards and remediation.

Government Publication Date: 1800-Apr 2024

Anderson's Waste Disposal Sites:

Private

[ANDR](#)

The information provided in this database was collected by examining various historical documents which aimed to characterize the likely position of former waste disposal sites from 1860 to present. The research initiative behind the creation of this database was to identify those sites that are missing from the Ontario MOE Waste Disposal Site Inventory, as well as to provide revisions and corrections to the positions and descriptions of sites currently listed in the MOE inventory. In addition to historic waste disposal facilities, the database also identifies certain auto wreckers and scrap yards that have been extrapolated from documentary sources. Please note that the data is not warranted to be complete, exhaustive or authoritative. The information was collected for research purposes only.

Government Publication Date: 1860s-Present

Aboveground Storage Tanks:

Provincial

[AST](#)

Historical listing of aboveground storage tanks made available by the Department of Natural Resources and Forestry. Includes tanks used to hold water or petroleum. This dataset has been retired as of September 25, 2014 and will no longer be updated.

Government Publication Date: May 31, 2014

Automobile Wrecking & Supplies:

Private

[AUWR](#)

This database provides an inventory of known locations that are involved in the scrap metal, automobile wrecking/recycling, and automobile parts & supplies industry. Information is provided on the company name, location and business type.

Government Publication Date: 1999-Apr 30, 2024

Borehole:

Provincial

[BORE](#)

A borehole is the generalized term for any narrow shaft drilled in the ground, either vertically or horizontally. The information here includes geotechnical investigations or environmental site assessments, mineral exploration, or as a pilot hole for installing piers or underground utilities. Information is from many sources such as the Ministry of Transportation (MTO) boreholes from engineering reports and projects from the 1950 to 1990's in Southern Ontario. Boreholes from the Ontario Geological Survey (OGS) including The Urban Geology Analysis Information System (UGAIS) and the York Peel Durham Toronto (YPDT) database of the Conservation Authority Moraine Coalition. This database will include fields such as location, stratigraphy, depth, elevation, year drilled, etc. For all water well data or oil and gas well data for Ontario please refer to WWIS and OOGW.

Government Publication Date: 1875-Jul 2018

Certificates of Approval:

Provincial CA

This database contains the following types of approvals: Air & Noise, Industrial Sewage, Municipal & Private Sewage, Waste Management Systems and Renewable Energy Approvals. The MOE in Ontario states that any facility that releases emissions to the atmosphere, discharges contaminants to ground or surface water, provides potable water supplies, or stores, transports or disposes of waste, must have a Certificate of Approval before it can operate lawfully. Fields include approval number, business name, address, approval date, approval type and status. This database will no longer be updated, as CofA's have been replaced by either Environmental Activity and Sector Registry (EASR) or Environmental Compliance Approval (ECA). Please refer to those individual databases for any information after Oct.31, 2011.

Government Publication Date: 1985-Oct 30, 2011*

Dry Cleaning Facilities:

Federal CDRY

List of dry cleaning facilities made available by Environment and Climate Change Canada. Environment and Climate Change Canada's Tetrachloroethylene (Use in Dry Cleaning and Reporting Requirements) Regulations (SOR/2003-79) are intended to reduce releases of tetrachloroethylene to the environment from dry cleaning facilities.

Government Publication Date: Jan 2004-Dec 2022

Commercial Fuel Oil Tanks:

Provincial CFOT

Locations of commercial underground fuel oil tanks. This is not a comprehensive or complete inventory of commercial fuel tanks in the province; this listing is a copy of records of registered commercial underground fuel oil tanks obtained under Access to Public Information.

Note that the following types of tanks do not require registration: waste oil tanks in apartments, office buildings, residences, etc.; aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Oct 2023

Chemical Manufacturers and Distributors:

Private CHEM

This database includes information from both a one time study conducted in 1992 and private source and is a listing of facilities that manufacture or distribute chemicals. The production of these chemical substances may involve one or more chemical reactions and/or chemical separation processes (i.e. fractionation, solvent extraction, crystallization, etc.).

Government Publication Date: 1999-Jan 31, 2020

Chemical Register:

Private CHM

This database includes a listing of locations of facilities within the Province or Territory that either manufacture and/or distributes chemicals.

Government Publication Date: 1999-Apr 30, 2024

Compressed Natural Gas Stations:

Private CNG

Canada has a network of public access compressed natural gas (CNG) refuelling stations. These stations dispense natural gas in compressed form at 3,000 pounds per square inch (psi), the pressure which is allowed within the current Canadian codes and standards. The majority of natural gas refuelling is located at existing retail gasoline that have a separate refuelling island for natural gas. This list of stations is made available by the Canadian Natural Gas Vehicle Alliance.

Government Publication Date: Dec 2012 -May 2024

Inventory of Coal Gasification Plants and Coal Tar Sites:

Provincial COAL

This inventory includes both the "Inventory of Coal Gasification Plant Waste Sites in Ontario-April 1987" and the Inventory of Industrial Sites Producing or Using Coal Tar and Related Tars in Ontario-November 1988) collected by the MOE. It identifies industrial sites that produced and continue to produce or use coal tar and other related tars. Detailed information is available and includes: facility type, size, land use, information on adjoining properties, soil condition, site operators/occupants, site description, potential environmental impacts and historic maps available. This was a one-time inventory.*

Government Publication Date: Apr 1987 and Nov 1988*

Compliance and Convictions:

Provincial CONV

This database summarizes the fines and convictions handed down by the Ontario courts beginning in 1989. Companies and individuals named here have been found guilty of environmental offenses in Ontario courts of law.

Government Publication Date: 1989-Nov 2024

Certificates of Property Use:

Provincial CPU

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include CPU's on the registry such as (EPA s. 168.6) - Certificate of Property Use.

Government Publication Date: 1994 - Nov 30, 2024

Drill Hole Database:

Provincial

[DRL](#)

The Ontario Drill Hole Database (ODHD) is offered by the Province of Ontario's Ministry of Mines. The dataset contains information for over 164,000 percussion, overburden, sonic and diamond-drill holes. The presence of assay results with cutoff values for gold, silver, copper, zinc, lead, nickel and platinum group elements is noted. Drill hole data are compiled from assessment files that have been submitted to the ministry in accordance with the Ontario Mining Act (OMA). Source assessment file numbers are captured for cross reference with the Ontario Assessment File Database (OAFD). Please note that limited data is available for southern Ontario, as it was the last area to be completed. The database was created when surveys submitted to the Ministry were converted in the Assessment File Research Image Database (AFRI) project. However, the degree of accuracy (coordinates) as to the exact location of drill holes is dependent upon the source document submitted. Levels of accuracy used to locate holes are: centering on the mining claim; a sketch of the mining claim; a 1:50,000 map; a detailed company map; or from submitted a "Report of Work".

Government Publication Date: 1886 - Aug 2024**Delisted Fuel Tanks:**

Provincial

[DTNK](#)

List of fuel storage tank sites that were once found in - and have since been removed from - the list of fuel storage tanks made available by the regulatory agency under Access to Public Information.

Government Publication Date: Oct 2023**Environmental Activity and Sector Registry:**

Provincial

[EASR](#)

On October 31, 2011, a smarter, faster environmental approvals system came into effect in Ontario. The EASR allows businesses to register certain activities with the ministry, rather than apply for an approval. The registry is available for common systems and processes, to which preset rules of operation can be applied. The EASR is currently available for: heating systems, standby power systems and automotive refinishing. Businesses whose activities aren't subject to the EASR may apply for an ECA (Environmental Compliance Approval). Please see our ECA database.

Government Publication Date: Oct 2011-Oct 31, 2024**Environmental Registry:**

Provincial

[EBR](#)

The Environmental Registry lists proposals, decisions and exceptions regarding policies, Acts, instruments, or regulations that could significantly affect the environment. Through the Registry, thirteen provincial ministries notify the public of upcoming proposals and invite their comments. For example, if a local business is requesting a permit, license, or certificate of approval to release substances into the air or water; these are notified on the registry. Data includes: Approval for discharge into the natural environment other than water (i.e. Air) - EPA s. 9, Approval for sewage works - OWRA s. 53(1), and EPA s. 27 - Approval for a waste disposal site. For information regarding Permit to Take Water (PTTW), Certificate of Property Use (CPU) and (ORD) Orders please refer to those individual databases.

Government Publication Date: 1994 - Nov 30, 2024**Environmental Compliance Approval:**

Provincial

[ECA](#)

On October 31, 2011, a smarter, faster environmental approvals system came into effect in Ontario. In the past, a business had to apply for multiple approvals (known as certificates of approval) for individual processes and pieces of equipment. Today, a business either registers itself, or applies for a single approval, depending on the types of activities it conducts. Businesses whose activities aren't subject to the EASR may apply for an ECA. A single ECA addresses all of a business's emissions, discharges and wastes. Separate approvals for air, noise and waste are no longer required. This database will also include Renewable Energy Approvals. For certificates of approval prior to Nov 1st, 2011, please refer to the CA database. For all Waste Disposal Sites please refer to the WDS database.

Government Publication Date: Oct 2011-Oct 31, 2024**Environmental Effects Monitoring:**

Federal

[EEM](#)

The Environmental Effects Monitoring program assesses the effects of effluent from industrial or other sources on fish, fish habitat and human usage of fisheries resources. Since 1992, pulp and paper mills have been required to conduct EEM studies under the Pulp and Paper Effluent Regulations. This database provides information on the mill name, geographical location and sub-lethal toxicity data.

Government Publication Date: 1992-2007***ERIS Historical Searches:**

Private

[EHS](#)

ERIS has compiled a database of all environmental risk reports completed since March 1999. Available fields for this database include: site location, date of report, type of report, and search radius. As per all other databases, the ERIS database can be referenced on both the map and "Statistical Profile" page.

Government Publication Date: 1999-Aug 31, 2024**Environmental Issues Inventory System:**

Federal

[EIIS](#)

The Environmental Issues Inventory System was developed through the implementation of the Environmental Issues and Remediation Plan. This plan was established to determine the location and severity of contaminated sites on inhabited First Nation reserves, and where necessary, to remediate those that posed a risk to health and safety; and to prevent future environmental problems. The EIIS provides information on the reserve under investigation, inventory number, name of site, environmental issue, site action (Remediation, Site Assessment), and date investigation completed.

Government Publication Date: 1992-2001*

Emergency Management Historical Event:

Provincial

EMHE

List of locations of historical occurrences of emergency events, including those assigned to the Ministry of Natural Resources by Order-In-Council (OIC) under the Emergency Management and Civil Protection Act, as well as events where MNR provided requested emergency response assistance. Many of these events will have involved community evacuations, significant structural loss, and/or involvement of MNR emergency response staff. These events fall into one of ten (10) type categories: Dam Failure; Drought / Low Water; Erosion; Flood; Forest Fire; Soil and Bedrock Instability; Petroleum Resource Center Event, EMO Requested Assistance, Continuity of Operations Event, Other Requested Assistance. EMHE record details are reproduced by ERIIS under License with the Ontario Ministry of Natural Resources © Queen's Printer for Ontario, 2017.

Government Publication Date: Apr 30, 2022

Environmental Penalty Annual Report:

Provincial

EPAR

This database contains data from Ontario's annual environmental penalty report published by the Ministry of the Environment and Climate Change. These reports provide information on environmental penalties for land or water violations issued to companies in one of the nine industrial sectors covered by the Municipal Industrial Strategy for Abatement (MISA) regulations.

Government Publication Date: Jan 1, 2011 - Dec 31, 2023

List of Expired Fuels Safety Facilities:

Provincial

EXP

List of facilities and tanks for which there was once a fuel registration. This is not a comprehensive or complete inventory of expired tanks/tank facilities in the province; this listing is a copy of previously registered tanks and facilities obtained under Access to Public Information. Includes private fuel outlets, bulk plants, fuel oil tanks, gasoline stations, marinas, propane filling stations, liquid fuel tanks, piping systems, etc; includes tanks which have been removed from the ground.

Notes: registration was not required for private fuel underground/aboveground storage tanks prior to January 1990, nor for furnace oil tanks prior to May 1, 2002; registration is not required for waste oil tanks in apartments, office buildings, residences, etc., or aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Oct 2023

Federal Convictions:

Federal

FCON

Environment Canada maintains a database referred to as the "Environmental Registry" that details prosecutions under the Canadian Environmental Protection Act (CEPA) and the Fisheries Act (FA). Information is provided on the company name, location, charge date, offence and penalty.

Government Publication Date: 1988-Jun 2007*

Contaminated Sites on Federal Land:

Federal

FCS

The Federal Contaminated Sites Inventory includes information on known federal contaminated sites under the custodianship of departments, agencies and consolidated Crown corporations as well as those that are being or have been investigated to determine whether they have contamination arising from past use that could pose a risk to human health or the environment. The inventory also includes non-federal contaminated sites for which the Government of Canada has accepted some or all financial responsibility. It does not include sites where contamination has been caused by, and which are under the control of, enterprise Crown corporations, private individuals, firms or other levels of government. Includes fire training sites and sites at which Per- and Polyfluoroalkyl Substances (PFAS) are a concern.

Government Publication Date: Jun 2000-Nov 2024

Fisheries & Oceans Fuel Tanks:

Federal

FOFT

Fisheries & Oceans Canada maintains an inventory of aboveground & underground fuel storage tanks located on Fisheries & Oceans property or controlled by DFO. Our inventory provides information on the site name, location, tank owner, tank operator, facility type, storage tank location, tank contents & capacity, and date of tank installation.

Government Publication Date: 1964-Sep 2019

Federal Identification Registry for Storage Tank Systems (FIRSTS):

Federal

FRST

A list of federally regulated Storage tanks from the Federal Identification Registry for Storage Tank Systems (FIRSTS). FIRSTS is Environment and Climate Change Canada's database of storage tank systems subject to the Storage Tank for Petroleum Products and Allied Petroleum Products Regulations. The main objective of the Regulations is to prevent soil and groundwater contamination from storage tank systems located on federal and aboriginal lands. Storage tank systems that do not have a valid identification number displayed in a readily visible location on or near the storage tank system may be refused product delivery.

Government Publication Date: Oct 31, 2021

Fuel Storage Tank:

Provincial

FST

List of registered private and retail fuel storage tanks. This is not a comprehensive or complete inventory of private and retail fuel storage tanks in the province; this listing is a copy of registered private and retail fuel storage tanks, obtained under Access to Public Information.

Notes: registration was not required for private fuel underground/aboveground storage tanks prior to January 1990, nor for furnace oil tanks prior to May 1, 2002; registration is not required for waste oil tanks in apartments, office buildings, residences, etc., or aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Oct 2023

Fuel Storage Tank - Historic:

Provincial

FSTH

The Fuels Safety Branch of the Ontario Ministry of Consumer and Commercial Relations maintained a database of all registered private fuel storage tanks. Public records of private fuel storage tanks are only available since the registration became effective in September 1989. This information is now collected by the Technical Standards and Safety Authority.

Government Publication Date: Pre-Jan 2010*

Ontario Regulation 347 Waste Generators Summary:

Provincial

GEN

Regulation 347 of the Ontario EPA defines a waste generation site as any site, equipment and/or operation involved in the production, collection, handling and/or storage of regulated wastes. A generator of regulated waste is required to register the waste generation site and each waste produced, collected, handled, or stored at the site. This database contains the registration number, company name and address of registered generators including the types of hazardous wastes generated. It includes data on waste generating facilities such as: drycleaners, waste treatment and disposal facilities, machine shops, electric power distribution etc. This information is a summary of all years from 1986 including the most currently available data. Some records may contain, within the company name, the phrase "See & Use..." followed by a series of letters and numbers. This occurs when one company is amalgamated with or taken over by another registered company. The number listed as "See & Use", refers to the new ownership and the other identification number refers to the original ownership. This phrase serves as a link between the 2 companies until operations have been fully transferred.

Government Publication Date: 1986-Nov 30, 2022

Greenhouse Gas Emissions from Large Facilities:

Federal

GHG

List of greenhouse gas emissions from large facilities made available by Environment Canada. Greenhouse gas emissions in kilotonnes of carbon dioxide equivalents (kt CO2 eq).

Government Publication Date: 2013-Apr 2024

TSSA Historic Incidents:

Provincial

HINC

List of historic incidences of spills and leaks of diesel, fuel oil, gasoline, natural gas, propane, and hydrogen recorded by the TSSA in their previous incident tracking system. The TSSA's Fuels Safety Program administers the Technical Standards & Safety Act 2000, providing fuel-related safety services associated with the safe transportation, storage, handling and use of fuels such as gasoline, diesel, propane, natural gas and hydrogen. Under this Act, the TSSA regulates fuel suppliers, storage facilities, transport trucks, pipelines, contractors and equipment or appliances that use fuels. Records are not verified for accuracy or completeness. This is not a comprehensive or complete inventory of historical fuel spills and leaks in the province. This listing is a copy of the data captured at one moment in time and is hence limited by the record date provided here.

Government Publication Date: 2006-June 2009*

Indian & Northern Affairs Fuel Tanks:

Federal

IAFT

The Department of Indian & Northern Affairs Canada (INAC) maintains an inventory of aboveground & underground fuel storage tanks located on both federal and crown land. Our inventory provides information on the reserve name, location, facility type, site/facility name, tank type, material & ID number, tank contents & capacity, and date of tank installation.

Government Publication Date: 1950-Aug 2003*

Fuel Oil Spills and Leaks:

Provincial

INC

Listing of spills and leaks of diesel, fuel oil, gasoline, natural gas, propane, and hydrogen reported to the Spills Action Centre (SAC). This is not a comprehensive or complete inventory of fuel-related leaks, spills, and incidents in the province; this listing is a copy of incidents reported to the SAC, obtained under Access to Public Information. Includes incidents from fuel-related hazards such as spills, fires, and explosions. Records are not verified for accuracy or completeness.

Government Publication Date: 31 Oct, 2023

Landfill Inventory Management Ontario:

Provincial

LIMO

The Landfill Inventory Management Ontario (LIMO) database is updated every year, as the Ministry of the Environment, Conservation and Parks compiles new and updated information. Includes small and large landfills currently operating as well as those which are closed and historic. Operators of larger landfills provide landfill information for the previous operating year to the ministry for LIMO including: estimated amount of total waste received, landfill capacity, estimated total remaining landfill capacity, fill rates, engineering designs, reporting and monitoring details, size of location, service area, approved waste types, leachate of site treatment, contaminant attenuation zone and more. The small landfills include information such as site owner, site location and certificate of approval # and status.

Government Publication Date: Mar 31, 2022

Canadian Mine Locations:

Private

MINE

This information is collected from the Canadian & American Mines Handbook. The Mines database is a national database that provides over 290 listings on mines (listed as public companies) dealing primarily with precious metals and hard rocks. Listed are mines that are currently in operation, closed, suspended, or are still being developed (advanced projects). Their locations are provided as geographic coordinates (x, y and/or longitude, latitude). As of 2002, data pertaining to Canadian smelters and refineries has been appended to this database.

Government Publication Date: 1998-2009*

Mineral Occurrences:

Provincial

MNR

In the early 70's, the Ministry of Northern Development and Mines created an inventory of approximately 19,000 mineral occurrences in Ontario, in regard to metallic and industrial minerals, as well as some information on building stones and aggregate deposits. Please note that the "Horizontal Positional Accuracy" is approximately +/- 200 m. Many reference elements for each record were derived from field sketches using pace or chain/tape measurements against claim posts or topographic features in the area. The primary limiting factor for the level of positional accuracy is the scale of the source material. The testing of horizontal accuracy of the source materials was accomplished by comparing the plan metric (X and Y) coordinates of that point with the coordinates of the same point as defined from a source of higher accuracy.

Government Publication Date: 1846-Feb 2024

National Analysis of Trends in Emergencies System (NATES):

Federal

NATE

In 1974 Environment Canada established the National Analysis of Trends in Emergencies System (NATES) database, for the voluntary reporting of significant spill incidents. The data was to be used to assist in directing the work of the emergencies program. NATES ran from 1974 to 1994. Extensive information is available within this database including company names, place where the spill occurred, date of spill, cause, reason and source of spill, damage incurred, and amount, concentration, and volume of materials released.

Government Publication Date: 1974-1994*

Non-Compliance Reports:

Provincial

NCPL

The Ministry of the Environment provides information about non-compliant discharges of contaminants to air and water that exceed legal allowable limits, from regulated industrial and municipal facilities. A reported non-compliance failure may be in regard to a Control Order, Certificate of Approval, Sectoral Regulation or specific regulation/act.

Government Publication Date: Dec 31, 2022

National Defense & Canadian Forces Fuel Tanks:

Federal

NDFT

The Department of National Defense and the Canadian Forces maintains an inventory of all aboveground & underground fuel storage tanks located on DND lands. Our inventory provides information on the base name, location, tank type & capacity, tank contents, tank class, date of tank installation, date tank last used, and status of tank as of May 2001. This database will no longer be updated due to the new National Security protocols which have prohibited any release of this database.

Government Publication Date: Up to May 2001*

National Defense & Canadian Forces Spills:

Federal

NDSP

The Department of National Defense and the Canadian Forces maintains an inventory of spills to land and water. All spill sites have been classified under the "Transportation of Dangerous Goods Act - 1992". Our inventory provides information on the facility name, location, spill ID #, spill date, type of spill, as well as the quantity of substance spilled & recovered.

Government Publication Date: Mar 1999-Nov 2023

National Defence & Canadian Forces Waste Disposal Sites:

Federal

NDWD

The Department of National Defence and the Canadian Forces maintains an inventory of waste disposal sites located on DND lands. Where available, our inventory provides information on the base name, location, type of waste received, area of site, depth of site, year site opened/closed and status.

Government Publication Date: 2001-Apr 2007*

National Energy Board Pipeline Incidents:

Federal

NEBI

Locations of pipeline incidents from 2008 to present, made available by the Canada Energy Regulator (CER) - previously the National Energy Board (NEB). Includes incidents reported under the Onshore Pipeline Regulations and the Processing Plant Regulations related to pipelines under federal jurisdiction, does not include incident data related to pipelines under provincial or territorial jurisdiction.

Government Publication Date: 2008-Dec 31, 2024

National Energy Board Wells:

Federal

NEBP

The NEBW database contains information on onshore & offshore oil and gas wells that are outside provincial jurisdiction(s) and are thereby regulated by the National Energy Board. Data is provided regarding the operator, well name, well ID No./UWI, status, classification, well depth, spud and release date.

Government Publication Date: 1920-Feb 2003*

National Environmental Emergencies System (NEES):

Federal

[NEES](#)

In 2000, the Emergencies program implemented NEES, a reporting system for spills of hazardous substances. For the most part, this system only captured data from the Atlantic Provinces, some from Quebec and Ontario and a portion from British Columbia. Data for Alberta, Saskatchewan, Manitoba and the Territories was not captured. However, NEES is also a repository for previous Environment Canada spill datasets. NEES is composed of the historic datasets ' or Trends ' which dates from approximately 1974 to present. NEES Trends is a compilation of historic databases, which were merged and includes data from NATES (National Analysis of Trends in Emergencies System), ARTS (Atlantic Regional Trends System), and NEES. In 2001, the Emergencies Program determined that variations in reporting regimes and requirements between federal and provincial agencies made national spill reporting and trend analysis difficult to achieve. As a consequence, the department has focused efforts on capturing data on spills of substances which fall under its legislative authority only (CEPA and FA). As such, the NEES database will be decommissioned in December 2004.

Government Publication Date: 1974-2003***National PCB Inventory:**

Federal

[NPCB](#)

Environment Canada's National PCB inventory includes information on in-use PCB containing equipment in Canada including federal, provincial and private facilities. Federal out-of-service PCB containing equipment and PCB waste owned by the federal government or by federally regulated industries such as airlines, railway companies, broadcasting companies, telephone and telecommunications companies, pipeline companies, etc. are also listed. Although it is not Environment Canada's mandate to collect data on non-federal PCB waste, the National PCB inventory includes some information on provincial and private PCB waste and storage sites. Some addresses provided may be Head Office addresses and are not necessarily the location of where the waste is being used or stored.

Government Publication Date: 1988-2008***National Pollutant Release Inventory:**

Federal

[NPR2](#)

The National Pollutant Release Inventory (NPRI) is Canada's public inventory of pollutant releases (to air, water and land), disposals, and transfers for recycling. The inventory, managed by Environment and Climate Change Canada, tracks over 300 substances. Under the authority of the Canadian Environmental Protection Act (CEPA), owners or operators of facilities that meet published reporting requirements are required to report to the NPRI.

Government Publication Date: Feb 2024**National Pollutant Release Inventory - Historic:**

Federal

[NPRI](#)

Environment Canada has defined the National Pollutant Release Inventory ("NPRI") as a federal government initiative designed to collect comprehensive national data regarding releases to air, water, or land, and waste transfers for recycling for more than 300 listed substances. This data holds historic records; current records are found in NPR2.

Government Publication Date: 1993-May 2017**Oil and Gas Wells:**

Private

[OGWE](#)

The Nickle's Energy Group (publisher of the Daily Oil Bulletin) collects information on drilling activity including operator and well statistics. The well information database includes name, location, class, status and depth. The main Nickle's database is updated on a daily basis, however, this database is updated on a monthly basis. More information is available at www.nickles.com.

Government Publication Date: 1988-May 31, 2024**Ontario Oil and Gas Wells:**

Provincial

[OOGW](#)

In 1998, the Ministry of Natural Resources (MNR) handed over to the Ontario Oil, Gas and Salt Resources (OGSR) Corporation, the responsibility of maintaining a database of oil and gas wells drilled in Ontario. The OGSR Library has over 20,000+ wells in their database. Information available for all wells in the ERIS database includes well owner/operator, location, permit issue date, and well cap date, license number, status, depth and the primary target (rock unit) of the well being drilled. All geology/stratigraphy table information, plus all water table information is also provided for each well record.

Government Publication Date: 1800-Aug 2024**Inventory of PCB Storage Sites:**

Provincial

[OPCB](#)

The Ontario Ministry of Environment, Waste Management Branch, maintains an inventory of PCB storage sites within the province. Ontario Regulation 11/82 (Waste Management - PCB) and Regulation 347 (Generator Waste Management) under the Ontario EPA requires the registration of inactive PCB storage equipment and/or disposal sites of PCB waste with the Ontario Ministry of Environment. This database contains information on: 1) waste quantities; 2) major and minor sites storing liquid or solid waste; and 3) a waste storage inventory.

Government Publication Date: 1987-Oct 2004; 2012-Dec 2013**Orders:**

Provincial

[ORD](#)

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include Orders on the registry such as (EPA s. 17) - Order for remedial work, (EPA s. 18) - Order for preventative measures, (EPA s. 43) - Order for removal of waste and restoration of site, (EPA s. 44) - Order for conformity with Act for waste disposal sites, (EPA s. 136) - Order for performance of environmental measures.

Government Publication Date: 1994 - Nov 30, 2024

Canadian Pulp and Paper:

Private

PAP

This information is part of the Pulp and Paper Canada Directory. The Directory provides a comprehensive listing of the locations of pulp and paper mills and the products that they produce.

Government Publication Date: 1999, 2002, 2004, 2005, 2009-2014

Parks Canada Fuel Storage Tanks:

Federal

PCFT

Canadian Heritage maintains an inventory of known fuel storage tanks operated by Parks Canada, in both National Parks and at National Historic Sites. The database details information on site name, location, tank install/removal date, capacity, fuel type, facility type, tank design and owner/operator.

Government Publication Date: 1920-Jan 2005*

Pesticide Register:

Provincial

PES

The Ontario Ministry of the Environment and Climate Change maintains a database of licensed operators and vendors of registered pesticides.

Government Publication Date: Oct 2011-Oct 31, 2024

Ontario PFAS Spills:

Provincial

PFAS

This specific list of spills includes those incidents where one or more of the listed contaminants are identified in the PFAS Structure List and/or PFAS Chemicals Without Explicit Structure List made available by the United States Environmental Protection Agency (US EPA), is originally sourced from the Ministry of the Environment, Conservation and Parks spills related data. Information from 1988-2002 was part of the ORIS (Occurrence Reporting Information System). The SAC (Spills Action Centre) handles all spills reported in Ontario. Regulations for spills in Ontario are part of the MOE's Environmental Protection Act, Part X.

Government Publication Date: 1988-Mar 2024; May 2024

NPRI Reporters - PFAS Substances:

Federal

PFCH

The National Pollutant Release Inventory (NPRI) is Canada's public inventory of releases, disposals, and transfers, tracking over 320 pollutants. Per - and polyfluoroalkyl substances (PFAS) are a group of over 4,700 human-made substances for which adverse environmental and health effects have been observed. This listing of PFAS substance reporters includes those NPRI facilities that reported substances that are found in either: a) the Comprehensive Global Database of PFASs compiled by the Organisation for Economic Co-operation and Development (OECD), b) the US Environmental Protection Agency (US EPA) Master List of PFAS Substances, c) the US EPA list of PFAS chemicals without explicit structures, or d) the US EPA list of PFAS structures (encompassing the largest set of structures having sufficient levels of fluorination to potentially impart PFAS-type properties).

Government Publication Date: Feb 2024

Potential PFAS Handlers from NPRI:

Federal

PFHA

The National Pollutant Release Inventory (NPRI) is Canada's public inventory of releases, disposals, and transfers, tracking over 320 pollutants. Per - and polyfluoroalkyl substances (PFAS) are a group of over 4,700 human-made substances for which adverse environmental and health effects have been observed. This list of potential PFAS handlers includes those NPRI facilities that reported business activity (NAICS code) included in the US Environmental Protection Agency (US EPA) list of Potential PFAS-Handling Industry Sectors, further described as operating in industry sectors where literature reviews indicate that PFAS may be handled and/or released. Inclusion of a facility in this listing does not indicate that PFAS are being manufactured, processed, used, or released by the facility - these are facilities that potentially handle PFAS based on their industrial profile.

Government Publication Date: Feb 2024

Pipeline Incidents:

Provincial

PINC

List of pipeline incidents (strikes, leaks, spills). This is not a comprehensive or complete inventory of pipeline incidents in the province; this listing is an historical copy of records previously obtained under Access to Public Information. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2021

Potential PFAS Handlers from EASR:

Provincial

PPHA

The Ontario Environmental Activity and Sector Registry (EASR), described in Ontario Regulation 245/11, allows businesses with less complex operations - and hence not requiring an Environmental Compliance Approval - to register their activities with the Ontario Ministry of the Environment, Conservation and Parks (MECP). This list of potential PFAS handlers includes those EASR facilities that reported business activity (NAICS code) included in the US Environmental Protection Agency (US EPA) list of Potential PFAS-Handling Industry Sectors, further described as operating in industry sectors where literature reviews indicate that PFAS may be handled and/or released. Inclusion of a facility in this listing does not indicate that PFAS are being manufactured, processed, used.

Government Publication Date: Jun 30, 2024

Private and Retail Fuel Storage Tanks:

Provincial

PRT

The Fuels Safety Branch of the Ontario Ministry of Consumer and Commercial Relations maintained a database of all registered private fuel storage tanks and licensed retail fuel outlets. This database includes an inventory of locations that have gasoline, oil, waste oil, natural gas and/or propane storage tanks on their property. The MCCR no longer collects this information. This information is now collected by the Technical Standards and Safety Authority (TSSA).

Government Publication Date: 1989-1996*

Permit to Take Water:

Provincial

PTTW

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include PTTW's on the registry such as OWRA s. 34 - Permit to take water.

Government Publication Date: 1994 - Nov 30, 2024

Ontario Regulation 347 Waste Receivers Summary:

Provincial

REC

Part V of the Ontario Environmental Protection Act ("EPA") regulates the disposal of regulated waste through an operating waste management system or a waste disposal site operated or used pursuant to the terms and conditions of a Certificate of Approval or a Provisional Certificate of Approval. Regulation 347 of the Ontario EPA defines a waste receiving site as any site or facility to which waste is transferred by a waste carrier. A receiver of regulated waste is required to register the waste receiving facility. This database represents registered receivers of regulated wastes, identified by registration number, company name and address, and includes receivers of waste such as: landfills, incinerators, transfer stations, PCB storage sites, sludge farms and water pollution control plants. This information is a summary of all years from 1986 including the most currently available data.

Government Publication Date: 1986-1990, 1992-2021

Record of Site Condition:

Provincial

RSC

The Record of Site Condition (RSC) is part of the Ministry of the Environment's Brownfields Environmental Site Registry. Protection from environmental cleanup orders for property owners is contingent upon documentation known as a record of site condition (RSC) being filed in the Environmental Site Registry. In order to file an RSC, the property must have been properly assessed and shown to meet the soil, sediment and groundwater standards appropriate for the use (such as residential) proposed to take place on the property. The Record of Site Condition Regulation (O. Reg. 153/04) details requirements related to site assessment and clean up. RSCs filed after July 1, 2011 will also be included as part of the new (O.Reg. 511/09). The Government of Ontario states that it is not responsible for the accuracy of the information in this Registry.

Government Publication Date: 1997-Sept 2001, Oct 2004-Dec 2024

Retail Fuel Storage Tanks:

Private

RST

This database includes an inventory of retail fuel outlet locations (including marinas) that have on their property gasoline, oil, waste oil, natural gas and / or propane storage tanks.

Government Publication Date: 1999-Apr 30, 2024

Scott's Manufacturing Directory:

Private

SCT

Scott's Directories is a data bank containing information on over 200,000 manufacturers across Canada. Even though Scott's listings are voluntary, it is the most comprehensive database of Canadian manufacturers available. Information concerning a company's address, plant size, and main products are included in this database.

Government Publication Date: 1992-Mar 2011*

Ontario Spills:

Provincial

SPL

List of spills and incidents made available by the Ministry of the Environment, Conservation and Parks. This database identifies information such as location (approximate), type and quantity of contaminant, date of spill, environmental impact, cause, nature of impact, etc. Information from 1988-2002 was part of the ORIS (Occurrence Reporting Information System). The SAC (Spills Action Centre) handles all spills reported in Ontario. Regulations for spills in Ontario are part of the MOE's Environmental Protection Act, Part X.

Government Publication Date: 1988-Jun 2024; Aug 2024; Oct 2024

Wastewater Discharger Registration Database:

Provincial

SRDS

Facilities that report either municipal treated wastewater effluent or industrial wastewater discharges under the Effluent Monitoring and Effluent Limits (EMEL) and Municipal/Industrial Strategy for Abatement Regulations. The Municipal/Industrial Strategy for Abatement (MISA) division of the Ontario Ministry of Environment keeps record of direct dischargers of toxic pollutants within nine sectors including: Electric Power Generation, Mining, Petroleum Refining, Organic Chemicals, Inorganic Chemicals, Pulp & Paper, Metal Casting, Iron & Steel, and Quarries.

Government Publication Date: 1990-Dec 31, 2021

Anderson's Storage Tanks:

Private

TANK

The information provided in this database was collected by examining various historical documents, which identified the location of former storage tanks, containing substances such as fuel, water, gas, oil, and other various types of miscellaneous products. Information is available in regard to business operating at tank site, tank location, permit year, permit & installation type, no. of tanks installed & configuration and tank capacity. Data contained within this database pertains only to the city of Toronto and is not warranted to be complete, exhaustive or authoritative. The information was collected for research purposes only.

Government Publication Date: 1915-1953*

Transport Canada Fuel Storage Tanks:

Federal

TCFT

List of fuel storage tanks currently or previously owned or operated by Transport Canada. This inventory also includes tanks on The Pickering Lands, which refers to 7,530 hectares (18,600 acres) of land in Pickering, Markham, and Uxbridge owned by the Government of Canada since 1972; properties on this land has been leased by the government since 1975, and falls under the Site Management Policy of Transport Canada, but is administered by Public Works and Government Services Canada. This inventory provides information on the site name, location, tank age, capacity and fuel type.

Government Publication Date: 1970 - Apr 2024

Variances for Abandonment of Underground Storage Tanks:

Provincial

[VAR](#)

Listing of variances granted for storage tank abandonment. This is not a comprehensive or complete inventory of tank abandonment variances in the province; this listing is a copy of tank abandonment variance records previously obtained under Access to Public Information. In Ontario, registered underground storage tanks must be removed within two years of disuse; if removal of a tank is not feasible, an application may be sought for a variance from this code requirement.

Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Waste Disposal Sites - MOE CA Inventory:

Provincial

[WDS](#)

The Ontario Ministry of Environment, Waste Management Branch, maintains an inventory of known open (active or inactive) and closed disposal sites in the Province of Ontario. Active sites maintain a Certificate of Approval, are approved to receive and are receiving waste. Inactive sites maintain Certificate(s) of Approval but are not receiving waste. Closed sites are not receiving waste. The data contained within this database was compiled from the MOE's Certificate of Approval database. Locations of these sites may be cross-referenced to the Anderson database described under ERI's Private Source Database section, by the CA number. All new Environmental Compliance Approvals handed out after Oct 31, 2011 for Waste Disposal Sites will still be found in this database.

Government Publication Date: Oct 2011 - Oct 31, 2024

Waste Disposal Sites - MOE 1991 Historical Approval Inventory:

Provincial

[WDSH](#)

In June 1991, the Ontario Ministry of Environment, Waste Management Branch, published the "June 1991 Waste Disposal Site Inventory", of all known active and closed waste disposal sites as of October 30st, 1990. For each "active" site as of October 31st 1990, information is provided on site location, site/CA number, waste type, site status and site classification. For each "closed" site as of October 31st 1990, information is provided on site location, site/CA number, closure date and site classification. Locations of these sites may be cross-referenced to the Anderson database described under ERI's Private Source Database section, by the CA number.

Government Publication Date: Up to Oct 1990*

Water Well Information System:

Provincial

[WWIS](#)

This database describes locations and characteristics of water wells found within Ontario in accordance with Regulation 903. It includes such information as coordinates, construction date, well depth, primary and secondary use, pump rate, static water level, well status, etc. Also included are detailed stratigraphy information, approximate depth to bedrock and the approximate depth to the water table.

Government Publication Date: Dec 31 2023

Definitions

Database Descriptions: This section provides a detailed explanation for each database including: source, information available, time coverage, and acronyms used. They are listed in alphabetic order.

Detail Report: This is the section of the report which provides the most detail for each individual record. Records are summarized by location, starting with the project property followed by records in closest proximity.

Distance: The distance value is the distance between plotted points, not necessarily the distance between the sites' boundaries. All values are an approximation.

Direction: The direction value is the compass direction of the site in respect to the project property and/or center point of the report.

Elevation: The elevation value is taken from the location at which the records for the site address have been plotted. All values are an approximation. Source: Google Elevation API.

Executive Summary: This portion of the report is divided into 3 sections:

'Report Summary'- Displays a chart indicating how many records fall on the project property and, within the report search radii.

'Site Report Summary'-Project Property'- This section lists all the records which fall on the project property. For more details, see the 'Detail Report' section.

'Site Report Summary-Surrounding Properties'- This section summarizes all records on adjacent properties, listing them in order of proximity from the project property. For more details, see the 'Detail Report' section.

Map Key: The map key number is assigned according to closest proximity from the project property. Map Key numbers always start at #1. The project property will always have a map key of '1' if records are available. If there is a number in brackets beside the main number, this will indicate the number of records on that specific property. If there is no number in brackets, there is only one record for that property.

The symbol and colour used indicates 'elevation': the red inverted triangle will dictate 'ERIS Sites with Lower Elevation', the yellow triangle will dictate 'ERIS Sites with Higher Elevation' and the orange square will dictate 'ERIS Sites with Same Elevation.'

Unplottables: These are records that could not be mapped due to various reasons, including limited geographic information. These records may or may not be in your study area, and are included as reference.

Appendix C Freedom of Information

Ministry of the Environment, Conservation and Parks

Freedom of Information Request for Property Information

Instructions

Use this form to:

- submit and pay for a new FOI request for access to records/information about a property
- pay for a deposit or a final fee on an existing FOI request

Fields marked with an asterisk (*) are mandatory.

Are you: *

- ☒ Submitting a new FOI Request for Property Information
- ☐ Paying a deposit or final fee for an existing FOI Request for Property Information

Section 1 – Description of Records Requested

Time Period for Records Requested

From (yyyy/mm/dd) *

To (yyyy/mm/dd) *

1990/01/01

2025/02/07

Type of Record(s) *

- ☒ All environmental records relating to the identified property/site exclusive of Environmental Approvals and Registrations
- ☐ Environmental Approvals and Registrations (e.g. Environmental Compliance Approvals; Certificate of Approval; Renewable Energy Approvals; Environmental Activity and Sector Registry Registrations)

Select only if you are seeking access to an Approval or Registration that is not publicly available or if you are also seeking supporting documents relating to the Approval or Registration.

Operator and vendor Pesticide Licenses from September 4, 2018, final Approvals and Registrations are publicly available on the Access Environment website at:

<https://www.accessenvironment.ene.gov.on.ca/AEWeb/ae/GoSearch.action?search=basic&lang=en>.

Records of Site Condition (RSC) records are publicly available on the Brownfields Environmental Site Registry (BSER).

- RSC records between 2004 to June 30, 2011 are available at:
<https://www.lrcsde.lrc.gov.on.ca/besrWebPublic/generalSearch>
- RSC records filed after July 2011 are available at:
https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/earchFiledRsc_search?request_locale=en

☐ Other Specific Document(s)

List any record(s) that should be excluded from the scope of your request (e.g. email correspondences; records originating from your organization/business; records already in your possession, prior year(s) annual reports for approvals)

Please provide any additional relevant information relating to your request. For example, does your request relate to any other ministry business? Please note that this information is being requested only in order to provide contextual information to the Access and Privacy Office and will not in any way affect or expedite the status of any related ministry business identified.

Section 2 – Requester Information

Last Name * First Name * Middle Initial

Yang Minxian

Business/Organization Name (if applicable or indicate "N/A") *

Toronto Inspection Limited

Project/Reference Number (if applicable)

6857

Are you submitting this request on behalf of a client? *

☐ Yes ☒ No

Mailing Address

Unit Number Street Number * Street Name *

16 110 Konrad Crescent

PO Box City/Town * Province * Postal Code *

Markham ON L3R 9X2

Telephone Number * Email Address *

905-940-8509 ext. 236 min@torontoinspection.com

Is there an alternate contact (e.g. office admin)? *

☒ Yes ☐ No

Alternate Contact

Last Name * First Name *

Goel Anita

Telephone Number * Email Address *

905-940-8509 ext. accounts@torontoinspection.com

Section 3 – Current Property Address Information

Is the property a:

☐ Park ☐ Lake ☐ First Nation Band ☐ Wind Farm ☐ Federal Land ☐ Island ☐ Unsurveyed Land

Are you requesting information about multiple addresses? *

☐ Yes ☒ No

Property Address

Unit Number Street Number Street Name

50 High Street East

Full Lot Number

Concession

Geographic Township

City/Town/Village *

Mississauga

Closest Intersection

Section 4 – Previous Property Address Information

Do you want the ministry to search all prior historical addresses for this property/site for the time period of the records requested? *

☐ Yes ☒ No

Section 5 – Supporting Documents

Please upload any documents (e.g. Maps) that are relevant to your FOI request.

The total size of all attachments must not be more than 8 MB.

1. File Name

Total File Size



June 17, 2025

Minxian Yang
Toronto Inspection Ltd.
110 Konrad Crescent, Unit 16
Markham, Ontario L3R 9X2
min@torontoinspection.com

Dear Minxian Yang:

RE: **MECP FOI A-2025-00864, Your Reference 6857 – Decision Letter**

This letter is in response to your request made pursuant to the Freedom of Information and Protection of Privacy Act (the Act) relating to:

50 High Street East, Mississauga
Timeframe: January 1, 1990 to February 7, 2025

After a thorough search through the ministry files, no records were located responsive to your request. The official responsible for making the access decision on your request is the undersigned. This file is now closed.

The ministry's District Office – Halton Peel, has advised that there may be inactive records in the Records Centre, Mississauga. If you would like us to retrieve these files, please submit a separate FOI request quoting this file number. The \$5 application fee will be applied towards any costs incurred with the retrieval of the records from the Records Centre. Please note there is no guarantee that any records will be located responsive to your request.

You may request a review of my decision within 30 days from the date of this letter by contacting the Information and Privacy Commissioner/Ontario at <http://www.ipc.on.ca>. Please note there may be a fee associated with submitting the appeal.

If you have any questions, please contact Jaskiran Gill at jaskiran.gill@ontario.ca.

Yours truly,
Jaskiran Gill

for
Josephine DeSouza
Manager, Access and Privacy Office

Appendix D TSSA Correspondence

RE: (PN 6857) Public Information Request for 50 High Street East, Mississauga

From: Public Information Services (publicinformationservices@tssa.org)

To: natalle@torontoinspection.com

Date: Wednesday, February 12, 2025 at 08:02 AM EST

NO RECORD FOUND IN CURRENT DATABASE

Hello,

Thank you for your request for confirmation of public information. TSSA has performed a preliminary search of TSSA's current database.

- We confirm that there are no records in our current database of any fuel storage tanks at the subject address(es).

This is not a confirmation that there are no records in the archives. For a further search in our archives, please go to the [TSSA Client Portal](#) to complete an Application for Release of Public Information.

Please refer to [How to Submit a Public Information Request \(tssa.org\)](#) for instructions.

The associated fee must be paid via credit card (Visa or MasterCard).

Once all steps have been successfully completed you will receive your payment receipt via email.

TSSA does not make any representations or warranties with respect to the accuracy or completeness of any records released. The requestor assumes all risk in using or relying on the information provided.

If you have any questions or concerns, please do not hesitate to contact our Public Information Release team at publicinformationservices@tssa.org.

Kind regards,



Kimberly Gage | Public Information Agent

Legal

345 Carlingview Drive

Toronto, Ontario M9W 6N9

Tel: +1 416-734-3348 | Fax: +1 416-734-3568 | E-Mail: kgage@tssa.org

www.tssa.org



Winner of 2022 5-Star Safety Cultures Award

From: Natalie Chan <natalle@torontoinspection.com>

Sent: Monday, February 10, 2025 3:16 PM

To: Public Information Services <publicinformationservices@tssa.org>

Subject: (PN 6857) Public Information Request for 50 High Street East, Mississauga

[CAUTION]: This email originated outside the organisation.

Please do not click links or open attachments unless you recognise the source of this email and know the content is safe.

Good afternoon,

Please inform if you have any on-file information including historical and current presence of fuel tanks or facilities at this location and surrounding properties, as well as any environmental investigation and/or remediation pertaining to this location or surrounding properties:

Mississauga, Ontario

- 1) 50 High Street East
- 2) 12 Helene Street North
- 3) 15 Elizabeth Street North
- 4) 7 Elizabeth Street North
- 5) 55 Park Street East
- 6) 17 Elizabeth Street North
- 7) 8 Helene Street North
- 8) 6 Helene Street North
- 9) 41 Park Street East
- 10) 45 Park Street East

Best Regards,

Natalle Chan, BES, EPT

Environmental Scientist

110 Konrad Crescent, Unit 16

Markham, Ontario, L3R 9X2

T: 905-940-8509 ext.298

W: torontoinspection.com

CONFIDENTIALITY NOTICE - This e-mail transmission, and any documents, files or previous e-mail messages attached to it may contain information that is confidential or legally privileged. If you are not the intended recipient, or a person responsible for delivering it to the intended recipient, you are hereby notified that you must not read this transmission and that any disclosure, copying, printing, distribution or use of any of the information contained in or attached to this transmission is STRICTLY PROHIBITED. If you have received this transmission in error, please immediately notify the sender by telephone or return e-mail and delete the original transmission and its attachments without reading or saving in any manner. Thank you.

This electronic message and any attached documents are intended only for the named recipients. This communication from the Technical Standards and Safety Authority may contain information that is privileged, confidential or otherwise protected from disclosure and it must not be disclosed, copied, forwarded or distributed without authorization. If you have received this message in error, please notify the sender immediately and delete the original message.

Appendix E Aerial Photographs



NOT TO SCALE

TorontoInspection
GEO-ENVIRONMENTAL CONSULTANTS

110 Konrad Crescent,
Unit 16
Markham, Ontario
L3R 9X2

Tel: 905-940 8509

Fax: 905-940 8192

Email : TIL@torontoinspection.com

TITLE: 1954 Aerial Photograph

LOCATION: 50 High Street East, Mississauga, Ontario

PROJECT NO. 6857-25-EA

DATE : November 2025

APPENDIX. F



NOT TO SCALE

TorontoInspection
GEO-ENVIRONMENTAL CONSULTANTS

110 Konrad Crescent,
Unit 16
Markham, Ontario
L3R 9X2

Tel: 905-940 8509

Fax: 905-940 8192

Email : TIL@torontoinspection.com

TITLE: 1960 Aerial Photograph

LOCATION: 50 High Street East, Mississauga, Ontario

PROJECT NO. 6857-25-EA

DATE : November 2025

APPENDIX. F



Source: City of Mississauga Interactive Map (1966)

NOT TO SCALE

TorontoInspection
GEO-ENVIRONMENTAL CONSULTANTS

110 Konrad Crescent,
Unit 16
Markham, Ontario
L3R 9X2

Tel: 905-940 8509

Fax: 905-940 8192

Email : TIL@torontoinspection.com

TITLE: 1966 Aerial Photograph

LOCATION: 50 High Street East, Mississauga, Ontario

PROJECT NO. 6857-25-EA

DATE : November 2025

APPENDIX. F



NOT TO SCALE

TorontoInspection
GEO-ENVIRONMENTAL CONSULTANTS

110 Konrad Crescent,
Unit 16
Markham, Ontario
L3R 9X2

Tel: 905-940 8509

Fax: 905-940 8192

Email : TIL@torontoinspection.com

TITLE: 1975 Aerial Photograph

LOCATION: 50 High Street East, Mississauga, Ontario

PROJECT NO. 6857-25-EA

DATE : November 2025

APPENDIX. F



NOT TO SCALE

TorontoInspection
GEO-ENVIRONMENTAL CONSULTANTS

Tel: 905-940 8509

Fax: 905-940 8192

Email : TIL@torontoinspection.com

110 Konrad Crescent,
Unit 16
Markham, Ontario
L3R 9X2

TITLE: 1980 Aerial Photograph

LOCATION: 50 High Street East, Mississauga, Ontario

PROJECT NO. 6857-25-EA

DATE : November 2025

APPENDIX. F



NOT TO SCALE

TorontoInspection
GEO-ENVIRONMENTAL CONSULTANTS

110 Konrad Crescent,
Unit 16
Markham, Ontario
L3R 9X2

Tel: 905-940 8509

Fax: 905-940 8192

Email : TIL@torontoinspection.com

TITLE: 1989 Aerial Photograph

LOCATION: 50 High Street East, Mississauga, Ontario

PROJECT NO. 6857-25-EA

DATE: November 2025

APPENDIX. F



NOT TO SCALE

TorontoInspection
GEO-ENVIRONMENTAL CONSULTANTS

110 Konrad Crescent,
Unit 16
Markham, Ontario
L3R 9X2

Tel: 905-940 8509

Fax: 905-940 8192

Email : TIL@torontoinspection.com

TITLE: 2000 Aerial Photograph

LOCATION: 50 High Street East, Mississauga, Ontario

PROJECT NO. 6857-25-EA

DATE : November 2025

APPENDIX. F



NOT TO SCALE

TorontoInspection
GEO-ENVIRONMENTAL CONSULTANTS

110 Konrad Crescent,
Unit 16
Markham, Ontario
L3R 9X2

Tel: 905-940 8509

Fax: 905-940 8192

Email : TIL@torontoinspection.com


TITLE: 2009 Aerial Photograph

LOCATION: 50 High Street East, Mississauga, Ontario

PROJECT NO. 6857-25-EA

DATE : November 2025

APPENDIX. F

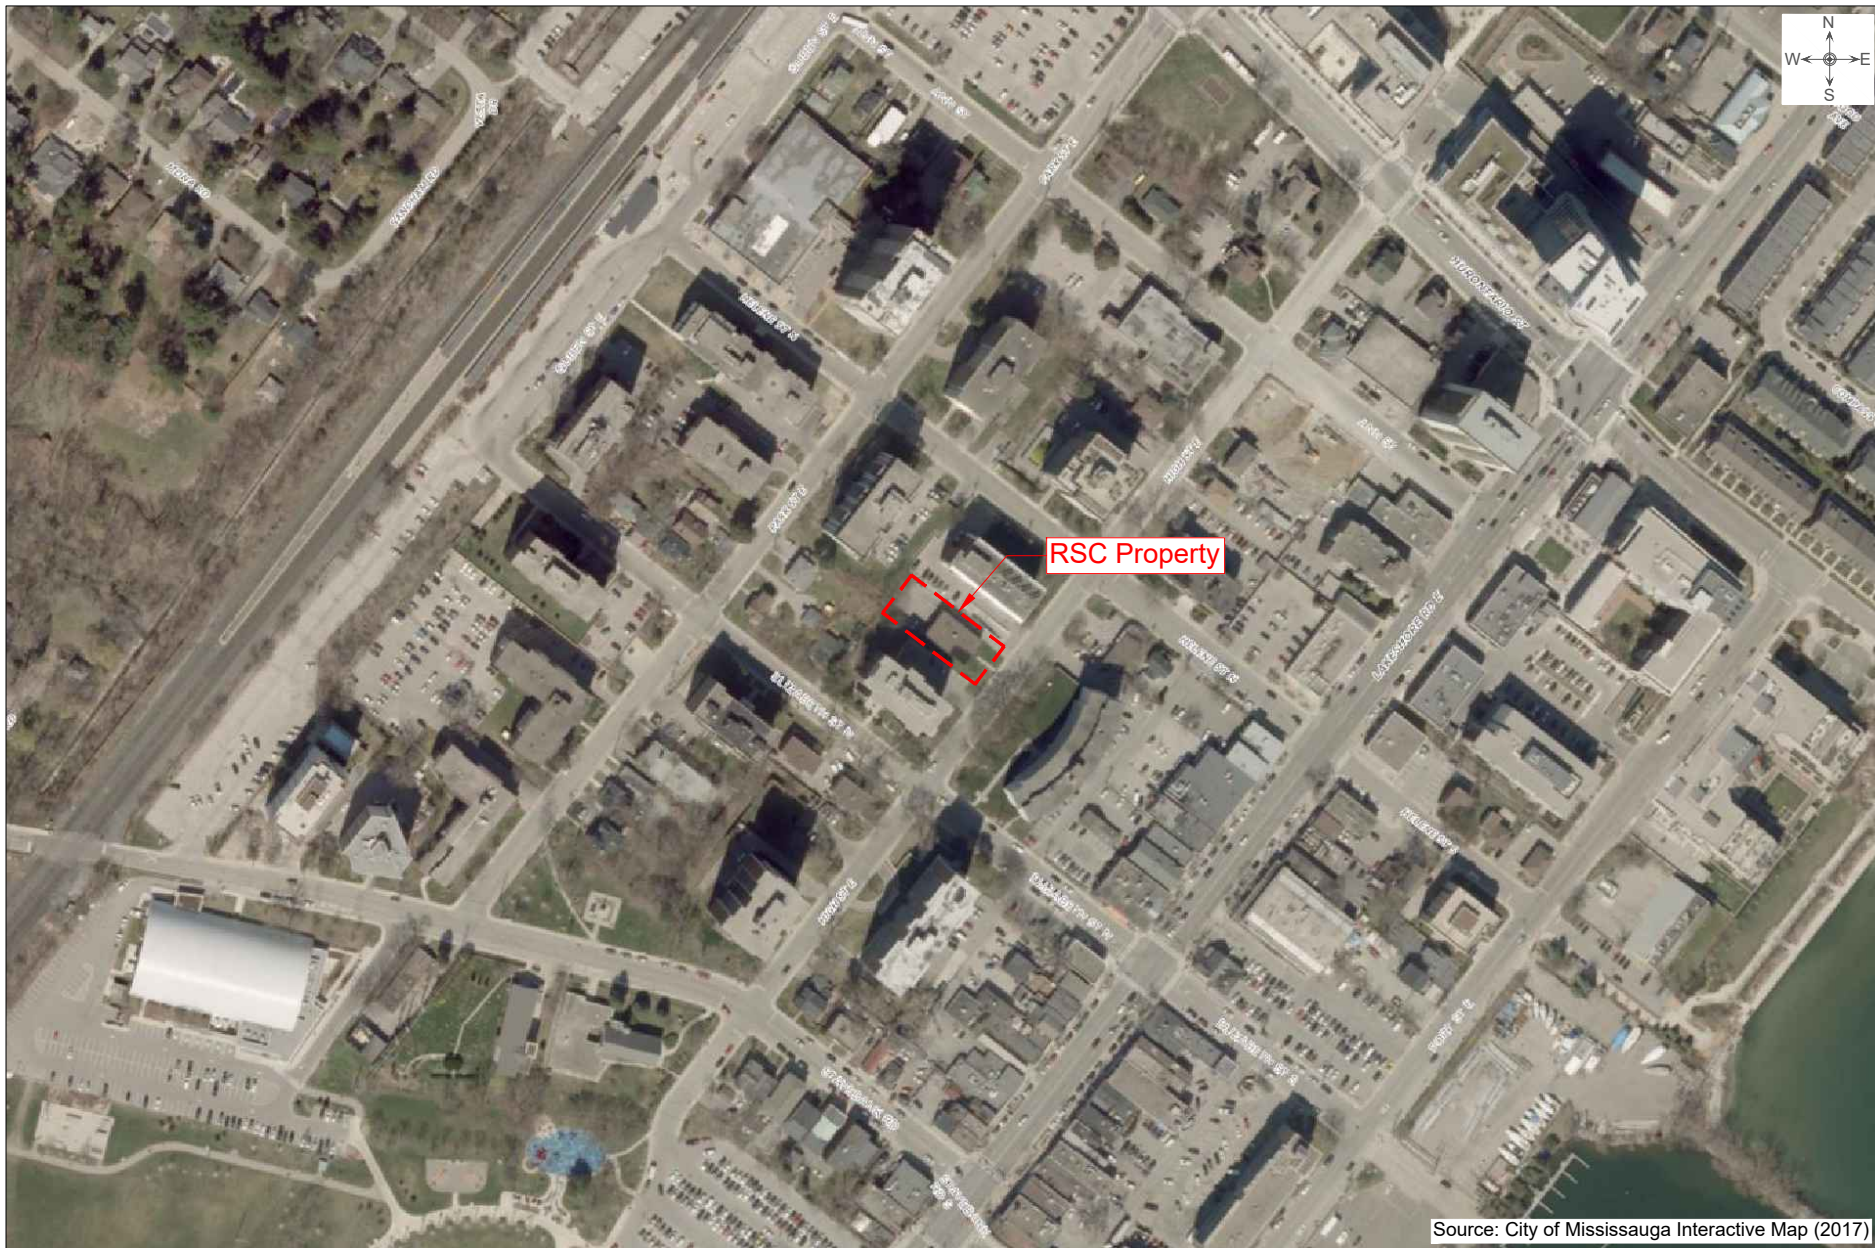

NOT TO SCALE

TorontoInspection
GEO-ENVIRONMENTAL CONSULTANTS

110 Konrad Crescent,
Unit 16
Markham, Ontario
L3R 9X2

Tel: 905-940 8509

Fax: 905-940 8192

Email : TIL@torontoinspection.com


TITLE: 2017 Aerial Photograph

LOCATION: 50 High Street East, Mississauga, Ontario

PROJECT NO. 6857-25-EA

DATE : November 2025

APPENDIX. F

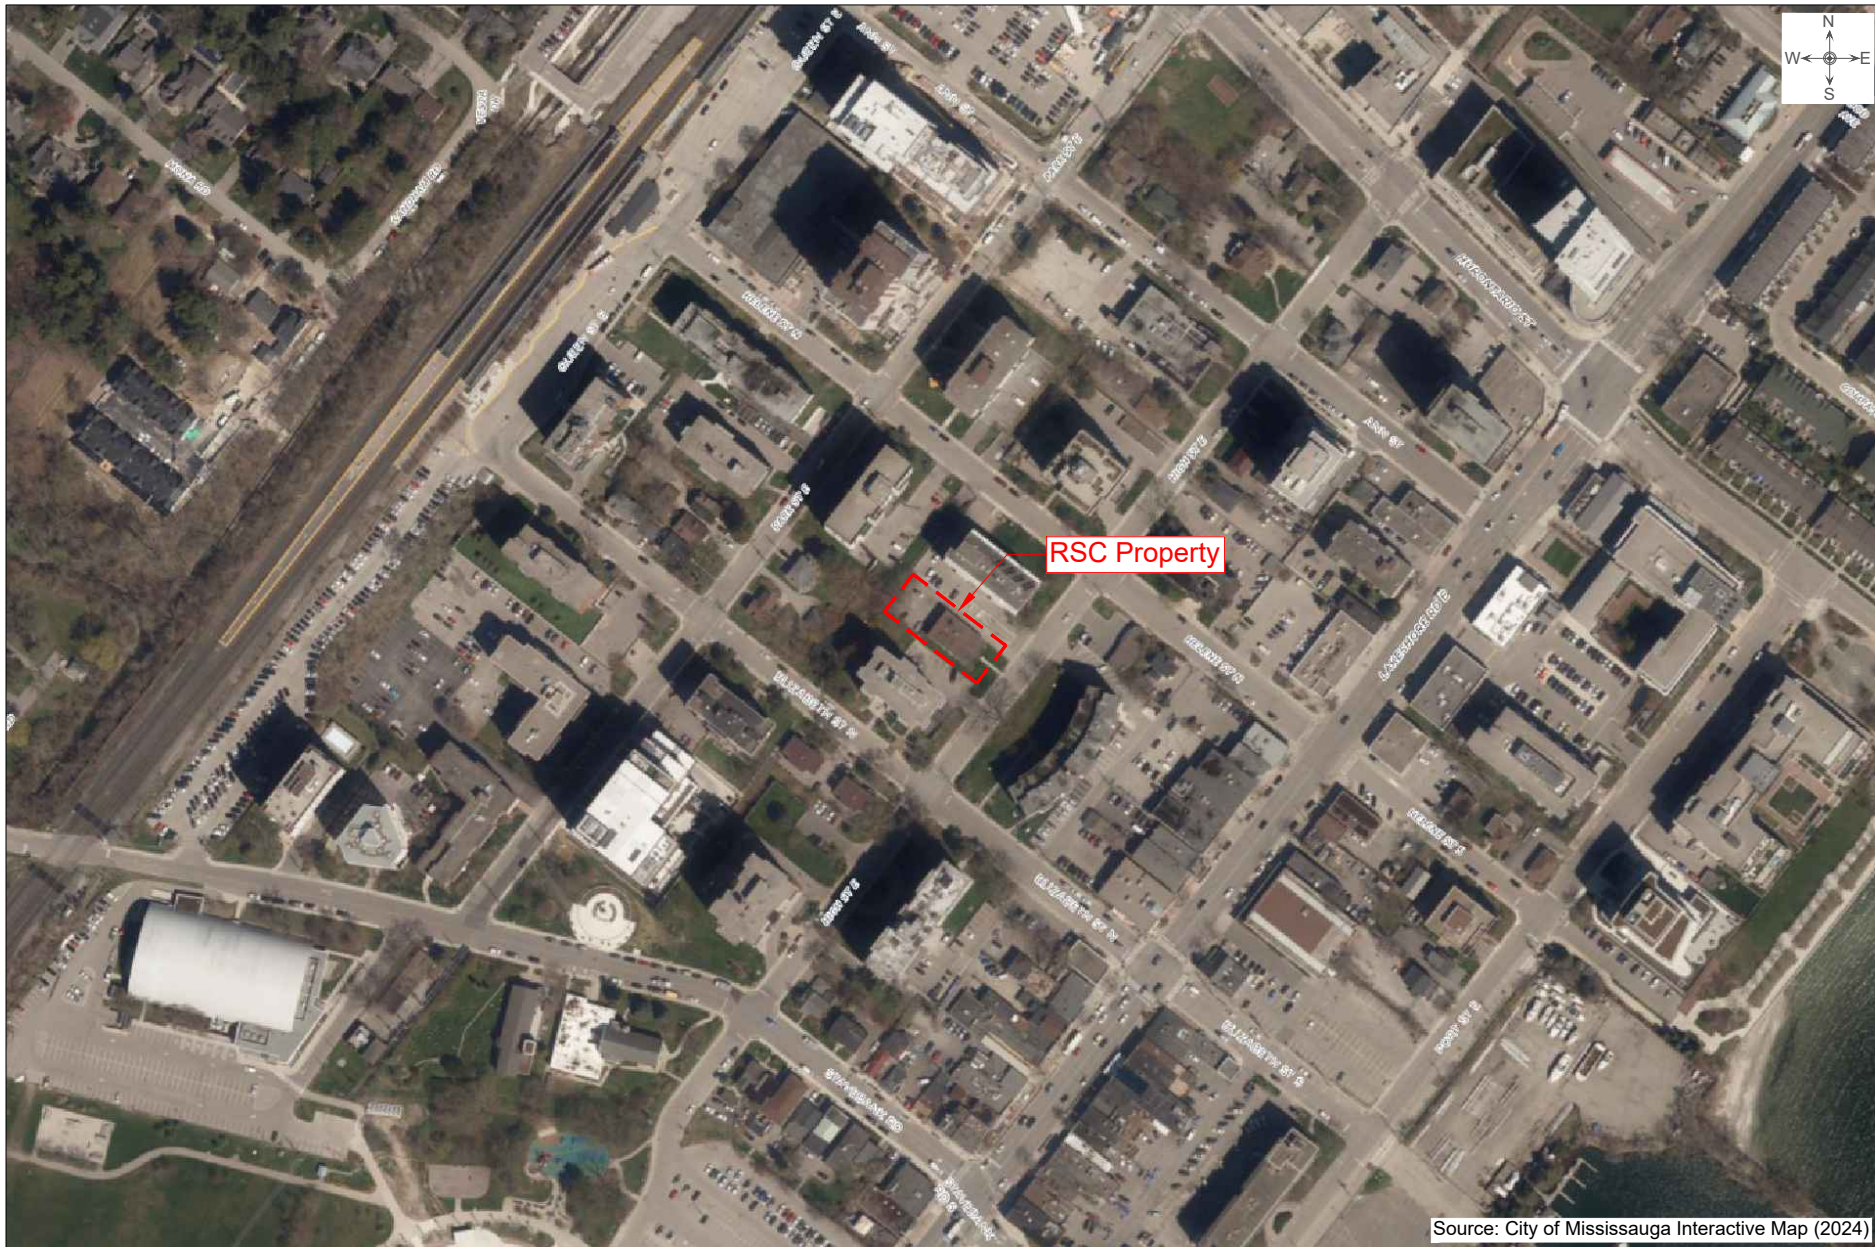

NOT TO SCALE

TorontoInspection
GEO-ENVIRONMENTAL CONSULTANTS

Tel: 905-940 8509

Fax: 905-940 8192

Email : TIL@torontoinspection.com

110 Konrad Crescent,
Unit 16
Markham, Ontario
L3R 9X2

TITLE: 2024 Aerial Photograph

LOCATION: 50 High Street East, Mississauga, Ontario

PROJECT NO. 6857-25-EA

DATE : November 2025

APPENDIX. F

Appendix F Site Photographs

Phase One Environmental Site Assessment - Site Photographs
50 High Street East, Mississauga, ON



P1 - South Elevation of the Subject Building




P2 - West Elevation of the Subject Building



P3 - North Elevation of the Subject Building



P4 - East Elevation of the Subject Building

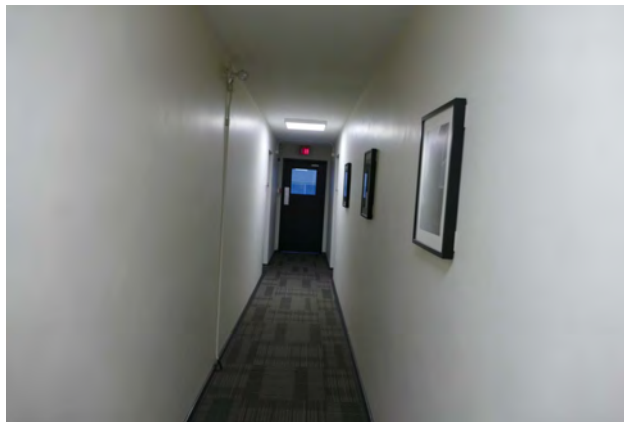

P5 - Typical Hallway Within the Subject Building



P6 - Typical Kitchen Area Within the Apartment Units

Phase One Environmental Site Assessment - Site Photographs
50 High Street East, Mississauga, ON



P7 - Typical Living Room Area



P8 - Typical Bedroom Within the Apartment Units



P9 - Typical Bathroom Within the Apartment Units



P10 - Typical Hot Water Radiator Observed Within the Stairwells



P11 - Interior of the Laundry Room



P12 - Washroom Within the Laundry Room

Phase One Environmental Site Assessment - Site Photographs
50 High Street East, Mississauga, ON



P13 - Interior of the Mechanical Room



P14 - Hot Water Boilers Within the Mechanical Room



P15 - Asphalt Paved Driveway on the East Portion of the Site



P16 - Parking Area on the North Portion of the Site



P17 - Adjacent Properties to the North and East



P18 - Neighbouring Property to the South

Phase One Environmental Site Assessment - Site Photographs
50 High Street East, Mississauga, ON



P19 - Neighbouring Properties to the Southeast



P20 - Adjacent Property to the West