

Phase One Environmental Site Assessment

Commercial Property
2155 Leanne Boulevard
Mississauga, Ontario
L5K 1K8

Presented to:

1000293648 Ontario Inc.
105 Six Point Road
Etobicoke, Ontario
M8Z 2X3



April 14, 2026

OHE Project No.: 31865

Submitted by:

OHE Consultants
Occupational Hygiene & Engineering
311 Matheson Boulevard East
Mississauga, Ontario
L4Z 1X8

TABLE OF CONTENTS

1	EXECUTIVE SUMMARY	1
2	INTRODUCTION.....	4
2(A)	PHASE ONE ESA PROPERTY.....	4
3	SCOPE OF INVESTIGATION	4
4	RECORDS REVIEW	5
4(A)	GENERAL	5
4(A)(I)	PHASE ONE ESA STUDY AREA DETERMINATION	5
4(A)(II)	FIRST DEVELOPED USE DETERMINATION	5
4(A)(III)	FIRE INSURANCE PLANS AND INSPECTION REPORTS	6
4(A)(IV)	CHAIN OF TITLE	9
4(A)(V)	ENVIRONMENTAL REPORTS	9
4(A)(VI)	OTHER SOURCES OF INFORMATION.....	14
4(B)	ENVIRONMENTAL SOURCE INFORMATION	23
4(B)(I)	ONTARIO MINISTRY OF THE ENVIRONMENT, CONSERVATION AND PARKS (MECP)	23
4(B)(II)	MINISTRY OF NATURAL RESOURCES AND FORESTRY (MNRF).....	25
4(B)(III)	ENVIRONMENT CANADA.....	25
4(B)(IV)	TECHNICAL STANDARDS & SAFETY AUTHORITY (TSSA)	25
4(B)(V)	ECOLOG ERIS.....	26
4(C)	PHYSICAL SETTINGS SOURCES.....	31
4(C)(I)	AERIAL PHOTOGRAPHS.....	31
4(C)(II)	TOPOGRAPHY, HYDROGEOLOGY, GEOLOGY	31
4(C)(III)	FILL MATERIALS.....	32
4(C)(IV)	WATER BODIES AND AREAS OF NATURAL SIGNIFICANCE.....	32
4(C)(V)	WELL RECORDS.....	32
4(D)	SITE OPERATING RECORDS.....	33
5	INTERVIEWS.....	33
6	SITE RECONNAISSANCE	33
6(A)	GENERAL REQUIREMENTS	33
6(B)	SPECIFIC OBSERVATIONS AT PHASE ONE ESA PROPERTY	34
6(B)(I)	ENHANCED INVESTIGATION PROPERTY	41
6(B)(II)	WRITTEN DESCRIPTION OF INVESTIGATION	41
7	REVIEW AND EVALUATION OF INFORMATION	41
7(I)	CURRENT AND PAST USES	41
7(II)	POTENTIALLY CONTAMINATING ACTIVITIES	41
7(III)	AREAS OF POTENTIAL ENVIRONMENTAL CONCERN.....	43
7(IV)	PHASE ONE ESA CONCEPTUAL SITE MODEL	43
8	CONCLUSIONS.....	44
8(I)	WHETHER A PHASE TWO ESA WILL BE REQUIRED FOR AN RSC.....	46

8(II) RSC BASED ON THE PHASE ONE ESA ALONE	46
8(III) SIGNATURES	46
8(IV) GENERAL STATEMENT OF LIMITATIONS	46
8(V) CLOSURE	48
9 REFERENCES	49

DRAWINGS:

- Drawing 1: Site Location
Drawing 2: Phase One ESA Property and Surrounding Land Use

TABLES:

- Table 1: Inspection Reports
Table 2: City Directories – Property
Table 3A: EcoLog ERIS – Property
Table 3B: EcoLog ERIS – Phase One ESA Study Area
Table 4: Adjacent Properties

APPENDICES:

- Appendix A: Regulatory Framework
Appendix B: Inspection Reports
Appendix C: Regulatory Correspondence
Appendix D: EcoLog ERIS Report
Appendix E: Aerial Photographs
Appendix F: Property Photographs
Appendix G: Assessor Qualifications

1 EXECUTIVE SUMMARY

OHE Consultants (OHE) was retained by 1000293648 Ontario Inc. to conduct a Phase One Environmental Site Assessment (ESA) for the commercial property located at 2155 Leanne Boulevard, Mississauga, Ontario (hereinafter referred to as the “Property”). The purpose of the Phase One ESA was to identify potential areas of contamination and environmental concerns due to onsite and/or offsite property uses, past or present. For the purposes of this report, Erin Mills Parkway is assumed to have a north-south orientation (i.e. parallel to the reference north). All directions noted throughout this report will therefore be based on the reference north.

As part of the Phase One ESA, OHE carried out a Property reconnaissance on February 27, 2026. Mr. Hasan Rahman of OHE conducted the Property reconnaissance.

The scope of work for the Property is tailored after the Canadian Standard Association’s (CSA) Phase I ESA Standard Z768-01 (R2022) and Ontario Regulation 153/04 (Record of Site Condition – Part XV.1 of the Environmental Protection Act), as amended. It includes a review of available historical information, a Property visit to examine for the presence of potential areas and contaminants of environmental concern, interviews with available personnel associated with the Property and a summary of the gathered information towards providing recommendations for further site assessment, if deemed necessary. Based on the Phase One ESA conducted by OHE through a review of available records, interviews and Property visit, the following observations were made:

Property History

Based on OHE’s review of gathered information, historical records review, Property reconnaissance, and the conducted interview, the Property appeared to be first residentially developed in as early as 1954 in the form of a residential dwelling on the southeast portion of the Property. The Property later appeared to be developed with the current commercial buildings (Buildings A and B) from approximately 1979/1980 until present.

Records Review

- The adjoining/neighbouring properties were mainly used for commercial and residential land uses.
- Multiple and various Phase One and Two ESAs, ground water monitoring programs and remediation activities have been previously completed (by others) at the

Property, and as a result, remaining soil and ground water volatile organic compound (VOC) contamination was reported. The identified contamination reportedly appeared to be primarily located within the immediate area of the onsite dry cleaning facility (i.e. Bridlewood Cleaners).

- The Property was partially (Building A) occupied by Bridlewood Cleaners from approximately 1986 to 2021, with reported use of perchloroethylene, and associated waste generation of halogenated solvents. Additionally, the Property was occupied by Giant Petroleum Inc. (potential office), and was also a waste generator of oils/sludges (petroleum based), as well as unspecified wastes from 2019 to 2021 (not all waste classes were noted for each year).

Based on the above, there is a potential for environmental impacts to soil and ground water quality at the Property from the above noted records.

- The south-adjoining property (2065 Leanne Boulevard) at an inferred up-gradient location was a historical waste generator of waste oils & lubricants from 2007 to 2011 (not all waste classes were noted for each year).
- The north-adjoining property (2185 Leanne Boulevard) at an inferred down/cross-gradient location was occupied by various gasoline service stations from 1985 until present. This adjoining property also had multiple and various fuel tank records, as well as a spill record.

Based on the above, there is a potential for environmental impacts to soil and ground water quality at the Property from the above noted records.

- Various waste generation, spill, automotive wrecking, or gasoline service station records were also identified at neighbouring properties at cross/down-gradient locations. Based on the distances and inferred cross/down-gradient locations of these records, the likelihood of potential environmental impacts to soil and ground water at the Property from those records appeared to be low.

Property Inspection

At the time of the Property reconnaissance, the Property comprised of two (2) attached commercial / office buildings as follows: The east Property building (Building A) and the west Property building (Building B) were each two (2)-storey buildings with no basement, and were each occupied by various commercial and office tenants.

Recommendations:

Based on OHE's review of gathered information, records review and Property inspection, Potentially Contaminating Activities (PCAs) were identified within the Phase One ESA Study Area, and as a result, the Property was deemed to comprise an Area of Potential Environmental Concern (APEC).

Based upon the findings of the Phase One ESA, including the previously identified (by others) soil and ground water contamination, OHE recommends a Delineation Phase Two ESA be carried out at the Property. The Phase Two ESA should address the area of potential environmental concern and associated contaminants of potential concern identified through this Phase One ESA with the goal of achieving lateral and vertical delineation.

This Executive Summary provides a brief summary of the findings. It is not intended to substitute for the complete report, nor does it discuss specific issues documented in the report. The Executive Summary is subject to the same limitations as stated in the report and should be read in conjunction with the complete report.

2 INTRODUCTION

2(a) Phase One ESA Property

OHE Consultants (OHE) was retained by 1000293648 Ontario Inc. to conduct a Phase One Environmental Site Assessment (ESA) for the commercial property located at 2155 Leanne Boulevard, Mississauga, Ontario (hereinafter referred to as the “Property”). The purpose of the Phase One ESA was to identify potential areas of contamination and environmental concerns due to onsite and/or offsite property uses, past or present. For the purposes of this report, Erin Mills Parkway is assumed to have a north-south orientation (i.e. parallel to the reference north). All directions noted throughout this report will therefore be based on the reference north.

1000293648 Ontario Inc.’s contact information is as follows: 105 Six Point Road, Etobicoke, Ontario, M8Z 2X3. OHE’s contact at 1000293648 Ontario Inc. is Mr. Waleed Nawaz.

The Phase One ESA Property is shown in Drawing 1, and the Phase One ESA Property and surrounding land use is shown in Drawing 2.

3 SCOPE OF INVESTIGATION

The scope of investigation for the Property is tailored after the Canadian Standard Association’s (CSA) Phase I ESA Standard Z768-01 (R2022), and Ontario Regulation 153/04 (Record of Site Condition – Part XV.1 of the Act) as amended. It includes a review of available historical information, a site reconnaissance of the Property along with personnel interview(s) to investigate the potential for contaminating activities or the potential presence of substances of environmental concern, and a summary of the gathered information towards providing appropriate recommendations, if required. In general, the scope of investigation includes the following tasks:

- Review of the current use of the Property and operations that may represent a potential concern to environmental conditions at the Property (i.e. soil and ground water);
- Liaise with appropriate government agencies to seek records of environmental regulatory non-compliance. Agencies may include the local municipality, the Ontario Ministry of the Environment, Conservation, and Parks (MECP), the Ontario Ministry of Natural Resources and Forestry (MNRF), local Conservation Authorities, and the Technical Standards & Safety Authority (TSSA);

- Review of the Property history with the use of fire insurance plans (FIPs), city directories and aerial photographs, where available;
- Review of relevant Property and local area environmental database records as made available through EcoLog Environmental Risk Information Service (ERIS);
- A site reconnaissance of physically / visually accessible areas of the Property in order to identify the presence of potentially contaminating activities or contaminants of potential concern;
- A review of Property occupant operations and environmentally-related documentation (if available);
- Reconnaissance of adjoining and neighboring properties (where visible from the Property and the public right-of-ways) in order to identify the presence of environmental concerns to the Property;
- Evaluation of the information collected from the records review and Property reconnaissance; and,
- Preparation and submission of a draft and final report documenting the above findings.

A copy of the Phase One ESA Regulatory Framework is included in Appendix A.

4 RECORDS REVIEW

4(a) General

4(a)(i) Phase One ESA Study Area Determination

The Phase One ESA Study Area consisted of the Property and adjacent properties situated totally or partially within 250 m of the Property boundaries (herein referred to as the “Phase One ESA Study Area”). This Phase One ESA Study Area was considered as adequate to describe potential environmental concerns with respect to the Property. Other properties within a 250 m radius were considered based upon potential environmental impact.

4(a)(ii) First Developed Use Determination

Based on OHE’s review of gathered information, historical records review, Property reconnaissance, and the conducted interview, the Property appeared to be first

residentially developed in as early as 1954 in the form of a residential dwelling on the southeast portion of the Property. The Property later appeared to be developed with the current commercial buildings (Buildings A and B) from approximately 1979/1980 until present.

4(a)(iii) Fire Insurance Plans and Inspection Reports

Fire Insurance Plans (FIPs) and Property Underwriters' Reports and Plans were searched through Enviroscan as part of Verisk Analytics Inc. and through ERIS (Environmental Risk Information System). A copy of the Verisk Enviroscan report and the ERIS report is included in Appendix B.

No FIPs were identified for the Phase One ESA Study Area, however the following inspection reports were identified for the Property:

Table 1: Inspection Reports

Inspection Reports	Description
1984 Inspection Report	<i>Inspection Report - 1984</i> <i>Konini Management</i> <i>2155 Leanne Boulevard</i> <i>Mississauga Ontario L5K 2K8</i> Based on the provided information, it appeared that this report pertained to "Building A" which was noted to be a two (2)-storey industrial building with no basement built in 1970. The building walls were noted to be concrete block, the floors were noted to be concrete, and the roof was noted to be non-combustible covered Class II metal deck on exposed steel. The heating system for the first floor was noted to be by way of ceiling suspended gas-fired unit heaters and hot air furnaces mounted on the roof, while the heating system for the second floor was noted to be low pressure gas fired boiler in the cut-off room in the adjoining, unsprinkled commercial building ("Building B"). The building air conditioning appeared to be non-central and by way of individual window-mounted units.
1997 COPE Report	<i>COPE Report - 1997</i> <i>Ralph Dennis Delorme</i> <i>2155 Leanne Boulevard</i> <i>Mississauga Ontario L5K 2K8</i> The first part of this report appeared to pertain to "Building A". It was not specified which of the two (2) Property buildings was labeled as "Building A", however based on the name of the tenants (in particular

	"Bridlewood Cleaners"), it was believed that "Building A" referred to the east Property building. The building was noted to be a two (2)-storey concrete block building with no basements, built in 1979. The building was noted to be centrally air conditioned. The building occupancy was noted as follows: • Bridlewood Cleaners; • 241 Pizza; • Royal Trust; • Club "T" Video; • Sheridan Convenience; • Swiss Chalet; • Golden Griddle; • Business Needs; • Compuwedge; • Hair By Jeffrey; and • offices; The second part of this report appeared to pertain to "Building B" which was believed to be the west Property building. The building was noted to be a two (2)-storey concrete block building with no basements, built in 1989. The building was noted to be centrally air conditioned. The building occupancy was noted as follows: • Morgan's Folk Art; and • offices;
1997 Inspection Report	<i>Inspection Report - 1997</i> <i>Ralph Dennis Delorme</i> 2155 Leanne Boulevard Mississauga Ontario L5K 2K8 This report appeared to pertain to both "Building A" and "Building B". "Building A" and "Building B" were each noted to be a two (2)-storey building with no basement, built in 1979. The walls were noted to be stucco board on concrete block. The first floor was noted to be concrete on grade, while the second floor was noted to be concrete on metal pan. The roof was noted to be Class II steel deck. The heating system for "Building A" was noted as follows: The first floor was heated in part by natural gas-fired, forced air suspended unit heaters venting to type "B" gas vents. The remainder of the building was heated by a natural gas-fired, combination heating and air-conditioning units located on the roof. The second floor area was heated by a low pressure natural gas-fired boiler, located in a cut-off room in the adjoining unsprinklered commercial building ("Building B"). "Building B" was noted to be heated by 100% safely and permanently installed electric baseboard heating. Both buildings were noted to be centrally air conditioned.

	The Property buildings' tenants were noted as follows: "Building A" – first floor: - Unit 1 & 2: Bridlewood Cleaners: use of Perchloroethylene was noted; - Unit 3: 231 Pizza; - Unit 4: Royal Trust; - Unit 5: Club T Video; - Unit 6: Sheridan Convenience; - Unit 7: Swiss Chalet restaurant; - Unit 8 & 9: Golden Griddle Pancake House; - Unit 10: Business Needs; - Unit 11: Compuwedge; - Unit 12: Hair By Jeffrey; "Building A" – second floor: - Offices; "Building B" – first floor: - Morgans Folkart Inc.; - offices; "Building B" – second floor: - offices;
1997 Siteplan Report	<i>Siteplan Report - 1997</i> <i>Ralph Dennis Delorne</i> <i>2155 Leanne Boulevard</i> <i>Mississauga Ontario L5K 2K8</i> This siteplan report appeared to illustrate the Property buildings (i.e. "Building A" and "Building B") in their current developed state, although the illustrated relative orientations of the buildings did not appear to exactly match those of the current buildings. The east Property building was marked as "A" with first floor marked as retail and the second floor marked as offices. The west Property building was marked as "B" with offices.
2002 Inspection Report	<i>Inspection Report - 2002</i> <i>1498481 Ontario Ltd. operating as Buffet Garden</i> <i>2155 Leanne Boulevard</i> <i>Mississauga Ontario L5K 2K8</i> This report appeared to pertain to "Building A" which was noted to be a two (2)-storey building with no basement built in 1979. Licensed Chinese Buffet Restaurant (Units 8 & 9), Cabalash Cuisine, and Swiss Chalet were noted as the tenants. The building was noted to be 80% masonry (concrete block). The floor was noted to be concrete on metal pan, and the roof was noted to be flat tar and gravel covered steel deck.

	The building heating was noted to be 100% natural gas-fired forced warm air.
2002 Inspection Report	<i>Inspection Report - 2002</i> <i>Thomas Dorman Associates Inc. Unit 112</i> <i>2155 Leanne Boulevard</i> <i>Mississauga Ontario L5K 2K8</i> This report appeared to pertain to "Building B" which was noted to be a two (2)-storey building with no basement. The construction year of the building was not noted. The building was noted to be occupied by a distributor of orthopedic implants and office. The building was noted to be 100% masonry (concrete block). The floor was noted to be concrete on metal pan, and the roof was noted to be flat tar and gravel covered concrete (50%) and steel deck (50%). The building heating was noted to be 100% natural gas-fired forced warm air.
2026 Precise Commercial Risk Assessment Report	<i>Precise Commercial Risk Assessment Report - 2026</i> <i>2155 Leanne Boulevard</i> <i>Mississauga Ontario L5K 2K8</i> This report appeared to pertain only to one (1) tenant at Building A, i.e. 241 Pizza. The building within which the above noted tenant was located was noted to be a two (2)-storey commercial building with no basement built in 1980 (estimated). The building foundation was noted to be reinforced concrete, the walls were noted to be masonry, the floors were noted to be a combination of concrete slab-on-grade (70%) and concrete on metal pan (30%), and the roof was noted to be flat torch-on covered steel deck. The building heating and cooling was noted to be by way of a roof-top natural gas-fired heating, ventilation, and air conditioning (HVAC) system.

4(a)(iv) Chain of Title

A land title search was not conducted on the Property as sufficient Property history information was obtained from other sources.

4(a)(v) Environmental Reports

The following previous environmental report was made available to OHE for review:

Summary of Findings – Phase One and Two Environmental Site Assessments, 2155 Leanne Boulevard, Mississauga, Ontario, prepared for 568911 Ontario Ltd., prepared by ECOH Management Inc., dated April 19, 2017

This report was a summary of ECOH Management Inc. (ECOH)'s findings pertaining to the Phase One and Two ESA activities completed at the Property.

The Property was approximately 2.3 hectares in area and was at the time occupied by two (2) multi-tenant two (2)-storey commercial buildings. The Property was bounded by an Esso gas station to the north, Erin Mills Parkway (followed by commercial properties) to the east, a long-term retirement residence to the south and Leanne Boulevard (followed by residential properties) to the west.

A series of environmental site assessment and remediation activities had been undertaken at the Property by various environmental engineering consulting firms between January 1995 and July 2015. The assessment activities included numerous Phase I/II ESA and groundwater monitoring programs and the remediation activities included various in-situ remediation programs (i.e. chemical oxidation injection events). The assessment and remediation activities were primarily focused on the investigation and remediation of the general area surrounding the commercial dry cleaning facility (i.e. Bridlewood Cleaners) located within the east site building.

As per the provisions of Ontario Regulation (O. Reg.) 153/04 (as amended), ECOH compared the historical soil and ground water analytical results provided within the historical ESA reports to the then applicable Ministry of the Environment and Climate Change (MOECC) Table 3 Site Condition Standards (SCS). Based on a review of the soil and ground water data with respect to the applicable MOECC Table 3 SCS, select volatile organic compound (VOC) parameters (i.e. tetrachloroethylene, trichloroethylene, cis-1,2-dichloroethylene and vinyl chloride) exceeded the MOECC Table 3 SCS in soil and/or ground water. The VOC impacts in soil and groundwater appeared to be primarily located within the immediate area of the dry cleaning facility (i.e. Bridlewood Cleaners), however, it was concluded that further assessment and site characterization was necessary to understand the full extent (both laterally and vertically) of the VOC impacts.

It was noted that as such, the Client requested that ECOH conduct a Phase Two ESA of the Property to further assess the VOC impacts and collect the necessary data and information to support the development of a Human Health and Ecological Risk

Assessment (HHERA). ECOH conducted the Phase Two ESA activities between April 2016 and April 2017.

The updated Phase One and Two ESA reports along with the HHERA were serving as supporting documentation in the future Record of Site Condition (RSC) submission to the then MOECC, as per provisions of O. Reg. 153/04 (as amended).

Phase One ESA:

Based on a review of historical documentation, including historical aerial photographs, it was concluded that the southeast portion of the Property was occupied by a residential dwelling circa the late 1950s to early 1960s, and as such, the first developed use of the Property was inferred as residential. The Property was developed into the current day property use circa 1979 when the west wing of the building was constructed (followed by the east wing construction in 1980).

Based on the Phase One ESA records review, interviews and site reconnaissance, various on-site and offsite PCAs were identified which resulted in three (3) areas of [potential] environmental concern (APECs/AECs) as follows:

- APEC 1/AEC 1: An operational commercial dry cleaning facility (i.e. Bridlewood Cleaners) was present on the Property and there were confirmed VOC impacts in soil and ground water within the vicinity and beneath the dry cleaning facility.
- APEC 2/AEC 2: De-icing activities via salt application were undertaken at the Property during winter months and there were confirmed electrical conductivity (EC) and sodium adsorption ratio (SAR) soil impacts within the asphalt covered areas at the Property.
- APEC 3: An Esso fuel station was located immediately north of the Property with the municipal address of 2185 Leanne Boulevard. It was noted that storage of fuel at this location could result in potential soil and/or ground water petroleum hydrocarbon (PHC) impacts which could potentially migrate onto the Property.

It was noted that given the identification of APECs on the Property and the presence of soil and ground water contamination on the Property, ECOH concluded that a Phase Two ESA must be undertaken at the Property.

Phase Two ESA:

The Phase Two ESA field activities were undertaken at the Property in between April 2016 and April 2017. The assessment activities included the advancement of thirty one (31) boreholes, fourteen (14) of which were instrumented with ground water monitoring wells.

As part of the soil sampling activities performed during the field investigations, a total of sixty seven (67) soil samples were collected from the thirty one (31) boreholes. As part of the ground water sampling activities, a total of twenty nine (29) ground water samples were collected from all existing (and accessible) and newly installed monitoring wells. Soil and ground water samples were submitted to ALS Laboratories for chemical analysis of scheduled parameters, including: petroleum hydrocarbon (PHC) fractions F1 – F4, VOCs, polycyclic aromatic hydrocarbons (PAHs), metals and salt constituents (including EC and SAR for soil and sodium (Na) and Chloride (Cl) for ground water). It was noted that based on the results of the soil and ground water assessment activities, the following findings were provided:

- The then MOECC Table 3 Full Depth Generic Site Condition Standards in a Non-Potable Ground Water Condition, with residential/parkland/institutional (RPI) property use and medium/fine soil texture were selected to assess the soil and ground water data.
- The soil stratigraphy at the Property generally comprised surficial material (topsoil or fill material), overlying a silty clay till which was underlain by shale bedrock.
- The hydrostratigraphic units identified during the Phase Two ESA activities included the silty clay and underlying shale bedrock. It was within the silty clay stratum, directly atop of the weathered shale, where a shallow ground water horizon resided, while a deeper ground water horizon resided within the competent shale bedrock.
- Ground water measurements showed static water within the shallow overburden material at depths ranging between 1.29 – 3.44 m below grade. Ground water measurements showed static water within the bedrock at depths ranging between 11.13 – 13.20 m below grade.
- The shallow ground water unit was interpreted to flow in a north-easterly direction and the deep bedrock ground water unit was inferred to flow in a southerly direction.

- The following Table 3 SCS exceedances were identified in soil samples collected from the Property:
 - o EC and SAR concentrations exceeded the MOECC Table 3 SCS in soil samples collected from fourteen (14) boreholes advanced throughout the Property. Generally, the soil samples which exceeded the MOECC Table 3 SCS were collected from the shallow silty clay soil strata at depths between 0.3 – 0.9 m below grade. The EC and SAR impacts in soil were reportedly horizontally and vertically delineated and were inferred to be attributed to the current (at the time) and historic application of de-icing salt.
 - o Tetrachloroethylene exceeded the MOECC Table 3 SCS in soil samples collected from four (4) borehole locations. The VOC impacts in soil generally resided directly atop the weathered shale and were reportedly horizontally and vertically delineated. The VOC impacts were associated with the historic dry cleaning activities performed at the Property within the commercial dry cleaning facility.
- The following Table 3 SCS exceedances were identified in ground water samples collected from the Property:
 - o Na and Cl concentrations exceeded the MOECC Table 3 SCS in ground water samples collected from two (2) monitoring wells. The Na and Cl impacts in ground water were reportedly horizontally delineated. The Na and Cl impacts were inferred to be attributed to the current (at the time) and historic application of de-icing salt.
 - o Several VOC parameters (cis-1,2-dichloroethylene, tetrachloroethylene, trichloroethylene and vinyl chloride) exceeded the applicable MOECC Table 3 SCS in ground water samples collected from five (5) monitoring wells. The VOC impacts in ground water were reportedly horizontally and vertically delineated. The VOC impacts were reportedly associated with the historic dry cleaning activities performed at the Property within the commercial dry cleaning facility.

VOC contaminant area and volumes:

It was noted that based on the identified soil and ground water impacts, and by applying the nearest compliant borehole/monitoring well locations as “clean” limits, ECOH estimated the VOC contaminant area to be approximately 1,200 m². The contaminant

area was reportedly primarily situated beneath the dry cleaning unit and extended marginally to the north, east, south and west. It was noted that based on this inferred area and the known vertical extent of impacts, ECOH estimated approximately 2,400 m³ of impacted soil.

Risk Management and Remediation Measures:

It was noted that at the time, the soil and ground water impacts at the Property were being addressed via a HHERA and the development of a risk management plan. It was noted that the risk management plan would likely include the application of select risk management measures (e.g. vapour mitigation measures, engineered cap barriers, health and safety and soil management plans, etc.) to mitigate any human health or ecological risk associated with the identified contaminant(s). Additionally, the approximate costs to excavate/remediate the contaminant footprint and dispose of approximately 2,400 m³ of non-hazardous impacted soil was also provided in the event the building were demolished in the future and one chose to remediate the soil and ground water VOC impacts via ex-situ applications (i.e. excavation and disposal).

4(a)(vi) Other Sources of Information

City of Mississauga Official Plan

The City of Mississauga's Official Plan (viewed online) indicated that the Property was situated within an area with an "Office" designation and a "Community Node" designation. The areas adjoining to the west and north of the Property were designated as "Residential Low Density II". The area to the south of the Property was designated as "Office". The area to the northeast of the Property was designated as "Motor Vehicle Commercial". The area adjoining to the east of the Property was designated as "Mixed Use".

City Directories

Available city directories were searched for the years 1958, 1966, 1970/1971, 1975, 1981, 1985, 1991, 1996, 2001, 2008, 2012, 2017, 2021, and 2023.

Table 2: City Directories – Property

Year	Property Occupant
1958, 1966, 1970/1971, 1975, 1981	address not listed
1985	• Bridlewood Cleaners; • Canadian Imperial Bank of Commerce; • Casaport Investment Ltd.; • Data General (Canada) Inc.; • Data Genl (Canada) Inc. administration & sales; • Datapunch; • The Engineering Flanagan Group; • Food Corp Limited; • Golden Griddle Pancake House; • International Child Care Inc.; • M&W Computers Inc.; • Mississauga Travel Ltd.; • Montebello Metal Inc.; • Royal Trust-Sheridan Corporate Centre; • Summers Wm F; • Uniglobe Mississauga Travel Ltd.;
1991	• Dr. M T Baboo; • Bridlewood Cleaners; • Dr. Henry Chol (dentist); • D L Farrel Insurance; • Food Corporation Limited; • Golden Griddle Pancake House; • Lepage Superintendent; • Summers Wm F Barr & Soli; • Wilkinson Tyrrel Mckay Insurance Brokers and Con; • 241 Pizza Store No.2;
1996	• Airport Indoor Mall; • Alexander De Mintich Accountants; • Arbor Living Centres Inc.; • Barbara Young Insurance; • Bridlewood Cleaners; • Club T Videos; • Collins Sales Association; • Corcoran Winfield; • Elvie Hall & Associates; • Equity Centre; • Erin Mills Academy of Martial; • Giant Petroleum Inc.; • Golden Griddle restaurants; • Greenbridge Management Inc.; • Michael Enzo Beauty Salon; • Ontario Residential Care Association; • Rent A Car Canada; • Ms. Jeeva A Shabeer (medical doctor); • Sheridan convenience Plus; • Sheridan Pharmacy;

Year	Property Occupant
	• State Farm Insurance; • Swill Chalet; • Peter Pepper Products; • Radiology Associates; • Sheridan Medical Association; • various individuals' names;
2001	• Alikhan & Associates; • ASN Canada FIA; • Associated Marketing Agency Links; • Bayshore Health Care Mississauga; • Brain Injury Association of Peel & Halton; • Bridlewood Cleaners; • Canadian National Mortgage Corporation; • Club T Videos; • Complete Family Chiropractic Care; • Computing Internet Solutions Inc.; • Compuwedge Ltd.; • CVP Financial Services; • DMS Foods Incorporated; • Golden Griddle Family Restaurants; • Greenbridge Management Inc.; • Hair By Jeffrey; • Hanjung Corporation; • Health Recovery Clinic; • Independent Rehabilitation Services; • Kelly Mckenzie & Associates; • Killen Richard & Associates Ltd.; • Latitude Management Ltd.; • Lepage Superintendent; • Mass-Ther Clinic; • Morgan's Folk Art Inc.; • Ontario Residential Care Association; • Peel-Halton Co-op Housing Federation; • Presot Fine Jewellery; • Primerica Financial Services ; • Ram International Private Investigators Inc.; • Royal Trust; • Servicad; • Servicecorp Canada Ltd.; • Sheridan Convenience Plus; • Sheridan Medical Associates; • Sheridan Pharmacy; • Specialty Claim Services Inc.; • State Farm Insurance Companies; • Swiss Chalet Rotisserie & Grill; • The Body Shop; • Trillium Health Care • Uma Engineering Ltd.; • Woodhouse & Associates Certified General Accountant; • Barbara Young Insurance Agency Ltd.;

Year	Property Occupant
	• Zante & Associates; • Various individuals' names;
2008	• Ace Tech Crop; • Allstate Insurance Company of Canada; • Andrea Casino Tours; • ASI; • ASN Canada FIA; • Associated Marketing Agency Links (including individuals' names); • David A Ball (lawyer); • Bon Appetite Catering; • Brain Injury Association of Peel & Halton; • Bridlewood Cleaners; • Buffet Garden; • Cabalash Caribbean Cuisine; • Carruthers Management Consultants Inc.; • Complete Family Chiropractic Care; • Cpus Engineering Staffing Solutions; • D H J Canada Inc.; • Digilabs Canada; • DMS Foods incorporated; • Erin Corporation Inc.; • Erin Mills Limousine Service; • Full Contact Marketing; • G D Jewell Engineering Inc.; • Hair By Jeffrey; • Health Recovery Clinic; • Health Recovery Group Inc.; • High Level Construction; • Independent Rehabilitation Services; • Kilisen Richards & Associates Ltd.; • Konini Management Limited; • Latitude Management Ltd.; • Lepage Superintendent; • Merge Counselling and Education Service; • Brian A Miller (accountant); • Northstar Multicorp; • Novurn Financing Inc.; • Ontario Residential Care Association; • Ontario Retirement Communities Association; • Oxford Learning Centre; • Peel Halton Coop Housing; • Peel Halton Housing Federation; • Peel Halton Coop Housing Federation; • Permius Inc.; • Quiznos Sub; • Kay fisher (realtor); • Richard Killen & Associates; • Royal Prime Bakers; • Royal Trust; • Sheridan Convenience Plus;

Year	Property Occupant
	• Sheridan Optometric Centre; • Simac; • Softron Tax; • Southern Chiropractic (doctor); • State Farm Insurance Companies; • Swiss Chalet Rotisserie & Grill; • Telecom Solutions Group; • Thai Cuisine Express Inc.; • The Body Shop; • Therapists Source; • Uhaul company Ltd.; • Usave Negotiators; • Yorkville Limo; • Barbara Young Insurance; • Zorbit Technologies Inc.;
2012	• Ace Tech Corp; • Actuben Consulting Inc.; • Alimak Hek Inc.; • Allstate Insurance Co.; • Alternative Building Consulting; • Andrea Casino Tours; • ASI; • ASN Canada FIA; • Associated Marketing Agency; • M T Baboo (medical doctor); • David A Ball; • Barbara Young Insurance Ltd.; • Benecaid Health Benefits; • Bon Appetit Catering; • C Bradley (medical doctor); • Brain Injury Association Of Peel; • Bridlewood Cleaners; • Calabash Caribbean Cuisine; • Canadian Integrated Business; • Canex Tours & Travel; • Carruthers Management Consultants; • Choices Child Adolescent; • Club T Videos; • Corcoran Winfield; • Cpus Engineering Staffing; • CVP Financial Service; • Data General Inc.; • Dhj Canada Inc.; • Jack Di Berardino (doctor of optometry); • Digi Labs Canada; • DMS Foods Inc.; • Equifirst; • Erin Corp Inc.; • Erin Mills Limousine Service; • Glenn Faris (medical doctor);

Year	Property Occupant
	• FCM On-Hold; • First American Marketing; • G D Jewell Engineering Inc.; • Stephen Gallant (medical doctor); • Hair By Jeffrey; • Hair Today; • Health Recovery Clinic; • High Level Construction; • Independent Rehabilitation Service; • Jeeva A Shabeer (medical doctor); • Kay Fisher Realty; • Konini Management Ltd.; • Kenneth S Laimon; • Shairoz Lalani; • Lattitude Management Ltd.; • Lepage Superintendent; • M S & Associates; • Mega Wraps; • Merge Counselling & Education; • Mortgage Centre; • Novum Financing Inc.; • Ontario Residential Care Association; • Oxford Learning Centre; • Pakistan Post; • Mohan Parha (doctor of dental surgery); • Peel-Halton Co-Op Housing Federation; • Permius Inc.; • Print Production & Design; • Quiznos Subs; • Rainbow Buffet; • Richard Killen & Associates Ltd.; • Rock Wellness & Sports Therapy; • Royal Prime Bakers; • Royal Trust; • Servicad; • Sheridan Convenience Plus; • Simac; • Softron Tax; • S Soriano (medical doctor); • Southern Chiropractic & Wellness; • Swiss Chalet Rotisserie/Grill; • Telecom Solutions Group; • Thai Cuisine Express Inc.; • U Haul Co Ltd.; • U-Save Negotiators; • Yorkville Limousine; • Zorbit Technologies Inc.;
2017	• 241 Pizza; • Ace Tech Corp; • Actuben Consulting Inc.;

Year	Property Occupant
	• Allstate Insurance Co-Canada; • Andrea Casino Tours; • ASI; • ASN Canada FIA; • Associated Marketing Agency; • M T Baboo (medical doctor); • David A Ball(attorney); • Barbara Young Insurance Ltd.; • Brain Injury Assn Of Peel; • Bridlewood Cleaners; • Calabash Caribbean Cuisine; • Canex Tours Travel; • Carruthers Management Consultant; • Centre Holidays; • Centum Empire Financial Service Inc.; • Chinese Medicine; • Core Resource Management; • Corner Office Leads; • Cpus Engineering Staffing; • Data General Inc.; • Jack Di Berardino (doctor of optometry); • DMS Foods Inc.; • Equifirst; • Erin Corp Inc.; • Erin Mills Limousine Service; • Flagman Service Inc.; • G D Jewell Engineering Inc.; • Stephen Gallant (medical doctor); • Hair By Jeffrey; • Health Recovery Clinic; • Health Recovery Group Inc.; • Hotdors Catering; • Independent Rehabilitation Service; • Irene Hill Massage Therapy; • Kay Fisher Realty; • Killen Landau Associates Ltd.; • Konini Management Ltd.; • L M Medical; • Lattitude Management Ltd.; • Lepage Superintendent; • K Lum (doctor of optometry); • Merge Counselling Education; • Danny Mus (doctor of optometry); • Music Fundamentals; • Novum Financing Inc.; • Ontario Retirement Communities; • Ontario Trillium Foundation; • Oxford Learning Centre; • Pakistan Post; • Mohan S Parhar (dentist); • Peel-Halton Co-Op Housing Federation;

Year	Property Occupant
	• Permius Inc.; • Quiznos Subs; • Rainbow Buffet; • Richard Killen & Associates Ltd.; • Royal Prime Bakers; • Royal Trust; • Senor Burrito; • Sheridan Convenience Plus; • Sheridan Optometric Centre; • Simac; • Smile Care Denture Centre; • State Farm Insurance Co.; • Swiss Chalet Rotisserie/Grill; • Tandoori Nights; • Team; • Telecom Solutions Group; • Thai Cuisine Experts Inc.; • URS Canada Inc.; • Workplace Compensation; • Yorkville Limousine Ltd.; • Yorkville Limousine Ltd.; • Zorbit Technologies Inc.;
2021	• A J LLP; • All Berljawsky LLP; • David A Ball(attorney); • Bridlewood Dry Cleaners Inc. • Calabash Caribbean Cuisine; • Centre Holidays; • Centum Empire Financial Service Inc.; • Century 21 Kelleher Real Estate; • Chopan Grill; • Countryside Travel Centre Holidays; • Cpus Engineering Staffing; • Divine Secrets; • DMS Foods Inc.; • Erin Mills Limousine Service; • Foundation Chiropraxy; • Stephen Gallant (medical doctor); • Hair By Jeffrey; • Healthy Body; • Hunter A Accounting; • Independent Rehabilitation Service; • Kay Fisher; • Konini Management Ltd.; • Lum Kathleen (doctor of optometry); • M Gouveia; • Mus Danny (doctor of optometry); • Natural Health Garden; • Northern Design; • Ontario Retirement Community Association;

Year	Property Occupant
	• Ontrack Accounting Bookkeeping Service; • Mohan S Parhar (dentists); • Peel-Halton Co-Op Housing Federation; • Pointts; • Proctor Internal Can Inc.; • Profex Logistics Service Inc.; • Richard Killen Associates Ltd.; • Senor Burrito; • Servicecorp Canada Ltd.; • Sheridan Optometric Centre; • Smile Care Denture Centre; • Dr. S Soriano; • Swiss Chalet Rotisserie/Grill; • Synergy Immigration; • Thai Cuisine Experts; • Travel The Skies; • Viva Dental Lab; • Wakeel Medical Centre; • Yorkville Limousine Ltd.; • Jessica Young (doctor of optometry);
2023	• A J Chartered Account; • Ace Tech Corp; • Ball Berljawsky LLP; • David A Ball (attorney); • Calabash Caribbean Cuisine; • Centre Holidays; • Centum Empire Financial Service Inc.; • Century 21 Kelleher Real Estate; • Countryside Travel Centre Holidays; • Cpus Engineering Staffing; • Digi Hype Media; • Divine Secrets; • DMS Foods Inc.; • Dr. HVAC; • Erin Mills Limousine Service; • Foundation Chiroprody; • Dr. Stephen Gallant; • Hair By Jeffrey; • Healthy Body; • Hunter A Accounting; • Independent Rehabilitation Service; • Kay Fisher; • Konini Management Ltd.; • M Gouveia; • Manta Ray Travel; • Danny Mus (doctor of optometry); • Mydrctcity; • Natural Health Garden; • Northern Design; • Ontario Retirement Community Association;

Year	Property Occupant
	• Ontario Trillium Foundation; • Ontrack Accounting Bookkeeping Service; • Dr. Mohan Parhar; • Peel-Halton Co-Op Housing Federation; • Pointts; • Profex Logistics Service Inc.; • Richards Upholstery Interior; • Senor Burrito; • Servicecorp Canada Ltd.; • Sheridan Optometric Centre; • Smile Care Denture Centre; • Dr. S Soriano; • Swiss Chalet Rotisserie/Grill; • Synergy Immigration; • Thai Cuisine Experts; • Travel The Skies; • Victory Vacations; • Viva Dental Lab; • Yorkville Limousine Ltd.; • Young Jessica (doctor of optometry);

The city directory search was also conducted for the Phase One ESA Study Area. Notable findings identified in the Phase One ESA Study Area are as follows:

2185 Leanne Boulevard, located adjoining to north of the Property at an inferred down/cross- gradient location was listed as Texaco Quick-Stop in 1985, Texaco Canada Inc. in 1991, ESSO / ESSO Generation in 1996, 2001, 2008, 2012, and 2017, and Circle K in 2021, and 2023.

2165 Erin Mills Parkway, located adjacent (across Erin Mills Parkway) to the northeast of the Property at an inferred down- gradient location was listed as Sam Asad Shell Gas Bar and Shell Canada Products Limited in 2001, and Sam Asad Shell Gas Bar in 2008.

2225 Erin Mills Parkway, located approximately 250 m northeast of the Property at an inferred down- gradient location was listed as Sketchley Cleaners in 2001.

4(b) Environmental Source Information

4(b)(i) Ontario Ministry of the Environment, Conservation and Parks (MECP)

Freedom of Information

A request was submitted by OHE to the MECP Freedom of Information (FOI) and Protection of Privacy Office in order to determine if there were any issued orders or violations associated with the Property, whether there have been any other

environmental concerns associated with the Property, (such as complaints, inspections, etc.) whether any environmental investigations have been carried out regarding the Property and to determine if the Spills Action Centre's (SAC) files contain any reported spills occurring in the Property vicinity. It should be noted that the SAC database was initiated in 1988 and many occurrences on file have only been reported voluntarily.

The MECP online web portal for FOI requests was not available / responsive at the time of preparing this report. A response to the MECP FOI request has not yet been received. A copy of the MECP FOI request is included in Appendix C.

Certificates of Approval and Renewable Energy Approvals

The MECP online inventory of Certificates of Approval and Renewable Energy Approvals did not indicate any records pertaining to the Property.

Resource Productivity and Recovery Authority

A review of the Resource Productivity and Recovery Authority (RPRA) online records indicated no Property-specific records.

Based on review of the EcoLog ERIS report (detailed later in this report), the Property was a waste generator of halogenated solvents, petroleum distillates, waste oils/sludges (petroleum based), and unspecified wastes from 1986 to 2021 (not all waste classes were noted for each year).

Records of Site Condition

The following Record of Site Condition (RSC) property was recorded in the MECP Brownfields Environmental Site Registry in the Phase One ESA Study Area, and was also identified in the EcoLog ERIS report:

- RSC ID: 22301, Vandyk-Vanmills Plaza Inc., 2185 Erin Mills Parkway, Mississauga, ON, L5K 1T8, Phase One and Two ESA RSC, filed on February 24, 2009:

This RSC property was located approximately 95 m northeast (across Erin Mills Parkway) of the Property at an interfered down-gradient location. The RSC was filed on February 24, 2009, and indicated the property land use change from commercial to commercial. The applicable Standards were Full Depth Site Conditions Standard, with Non-potable Ground Water, Coarse Textured Soil, for Industrial / Commercial / Community property use.

Based on available information, it appeared that soil was investigated for petroleum hydrocarbon (PHC) fractions F1-F4 and benzene, toluene, ethylbenzene, and xylenes (BTEX), while ground water was only investigation for BTEX.

It should be noted that considering the date of the RSC, only the RSC summary sheet was available, and as such the conceptual site model (CSM) or other presumably accompanying documents were not available for review.

4(b)(ii) Ministry of Natural Resources and Forestry (MNR)

The MNR's "Make A Map: Natural Heritage Areas" interactive mapping tool was reviewed with respect to the presence of Areas of Natural and Scientific Interest (ANSIs), Environmentally Significant Areas, Species at Risk, Provincially Significant Wetlands or other environmental significant land status designations.

No ANSIs, Environmentally Significant Areas, Species at Risk, Provincially Significant Wetlands or other environmental significant land status designations were identified within the Phase One ESA Study Area.

4(b)(iii) Environment Canada

No National Pollutant Release Inventory (NPRI) findings were identified for the Property or the Phase One ESA Study Area.

4(b)(iv) Technical Standards & Safety Authority (TSSA)

The TSSA was requested to review their databases for the Property for any registered USTs and aboveground storage tanks (ASTs) containing petroleum products.

On March 9, 2026, OHE was informed that the following records were identified within the Phase One ESA Study Area:

2185 Leanne Boulevard, located adjoining to north of the Property at an inferred down/cross- gradient location:

- fuel safety self-serve gasoline station, active;
- fuel safety cylinder exchange (propane), active;
- fuel safety liquid fuel tank (four (4) records), active;
- fuel safety liquid fuel tank (four (4) records), expired;

No registered storage tanks were identified listed for the Property.

A copy of the TSSA correspondence is included in Appendix C.

4(b)(v) EcoLog ERIS

EcoLog ERIS was retained to conduct an environmental information search of the Property and surrounding properties. A review of available databases was undertaken to identify potential environmental concerns at the Property caused by waste management issues, chemical storage or utilization, business operations, recorded incidents, accidents or recorded environmental issues, either currently or historically at or in the immediate vicinity (i.e. 250 m) of the Property. For a complete list of databases reviewed, a copy of the EcoLog ERIS report is provided in Appendix D.

The following Property-specific records were identified in the EcoLog ERIS report:

Table 3A: EcoLog ERIS – Property

Water Well Information System	Twenty two (22) well records as follows: • three (3) well records, dated October 22, 2012; • one (1) well record, dated May 14, 2014; • eight (8) well records, dated May 27, 2016; • five (5) well records, dated July 21, 2016; • five (5) well records, dated August 24, 2016;
Dry Cleaning Facilities	• Bridlewood Cleaners Inc., 325 kg of perchloroethylene reported in 2004 and 118 kg of perchloroethylene reported in 2005;
ERIS Historical Searches	• Custom Report, dated November 13, 2006; • Custom Express Report, dated September 5, 2012;
Ontario Regulation 347 Waste Generators Summary	• Bridlewood Cleaners, generator of halogenated solvents and petroleum distillates from 1986 to 2016 (not all waste classes were noted for each year); • Atlas Fin-Quest Inc., generator of waste oils/sludges (petroleum based as of October 2019); • Prime Real Estate Group Inc., generator of unspecified wastes from 2020 to 2021;
Scott's Manufacturing Directory	• Dr. Mohan Parhar, educational services, health services, and manufacturer (dentist), established on December 1, 1990;

The following table pertains to the Phase One ESA Study Area. The records were evaluated by OHE for potential environmental impact to the Property. Those records identified by OHE as being significant, or a potential environmental concern are discussed below:

Table 3B: EcoLog ERIS - Phase One ESA Study Area

Address:	2065 Leanne Boulevard
Distance from Property:	adjoining to the south of the Property at an inferred up-gradient location
Records:	Ontario Regulation 347 Waste Generators Summary: Southriim, generator of waste oils & lubricants from 2007 to 2011 (not all waste classes were noted for each year);
Address:	2185 Leanne Boulevard
Distance from Property:	adjoining to north of the Property at an inferred down/cross- gradient location
Records:	- Delisted Fuel Tanks: 1239973 Ontario Inc. operating as Esso Generation, two (2) records of fuel safety piping of which one (1) record date was up to March 2012, expired; - List of Expired Fuels Safety Facilities: 1239973 Ontario Inc. operating as Esso Generation, three (3) records of 45,400 (unspecified unit) fiberglass reinforced plastic (FRP) gasoline tank, and one (1) record of a 22,700 (unspecified unit) FRP diesel tank, all installed in 1981; - Fuel Storage Tank: Mac's Convenience Stores Inc., two (2) records of 65,000 L double wall FRP liquid fuel underground storage tanks (USTs), installed in 2007, active, one (1) record of a 25,000 L double wall FRP liquid fuel UST installed in 2007, active, one (1) record of a 50,000 L double wall FRP UST installed in 2007, active, and one (1) record of a 205,000 L double wall FRP liquid fuel UST (no installation year specified), active; - Fuel Storage Tank - Historic: 1239973 Ontario Inc operating as Esso Generation, self-serve gasoline service station, three (3) records of 45,400 (no units specified) single wall gasoline USTs, installed in 1981, removed, one (1) record of a 22,700 (no units specified) single wall diesel UST, installed in 1981, removed, as well as two (2) records of 65,000 (no units specified) double wall gasoline USTs, one (1) record of a 25,000 (no units specified) double wall diesel UST, and one (1) record of a 50,000 (no units specified) double wall gasoline UST, all installed in 2007, active; - Private and Retail Fuel Storage Tanks: Erin Mills ESSO, one (1) record of a 40,000 L retail tank, expired on June 30, 1995; - Private and Retail Fuel Storage Tanks: 1085399 Ontario Ltd. (attention Jim Mazerolle), one (1) record of a 40,000 L retail tank, expired on April 30, 1996; - Retail Fuel Storage Tanks: ESSO Generation, gasoline, oil & natural gas service station; - Ontario Spills: Trimac Transportation Services Esso Petroleum Service Station# 401027, spill of 200 L of gasoline to the lot, due

	to elbow connection leak, occurred on September 11, 1999, cleaned up;
Address:	intersection of Erin Mills Parkway and Fowler Drive
Distance from Property:	approximately 65 m northeast of the Property at an inferred down-gradient location
Records:	Fuel Oil Spills and Leaks: release of 100 L of petroleum product due to underground fuel tank being struck by backhoe, occurred on May 19, 2010;
Address:	1910 Fowler Drive
Distance from Property:	adjacent (across Erin Mills Parkway) to the east of the Property at an inferred down-gradient location
Records:	Ontario Regulation 347 Waste Generators Summary: Sherwin Williams Company, generator of wastes from the use of pigments, coatings and paints, polymeric resins, miscellaneous waste organic chemicals, waste compressed gases including cylinders, and organic laboratory chemicals from 2018 to 2025 (not all waste classes were noted for each year);
Address:	2131 Bosack Court
Distance from Property:	approximately 70 m west of the Property at an inferred up-gradient location
Records:	- Pesticide Register: A-Pro-Tek Extermination Services, operator, no other pertinent information provided; - Pesticide Register: 973822 Ontario Limited, various operator records, one (1) record indicated approval date of February 5, 2019, no other pertinent information provided; - Pesticide Register: Swat Pest Control/Farrell's Pest Control, vendor, no other pertinent information provided;
Address:	2165 Erin Mills Parkway
Distance from Property:	adjacent (across Erin Mills Parkway) to the northeast of the Property at an inferred down- gradient location
Records:	- Delisted Fuel Tanks: 972129 Ontario Limited operating as Shell Canada, fuel safety facility, expired, record date up to March 2012; - List of Expired Fuels Safety Facilities: 972129 Ontario Limited operating as Shell Canada, two (2) records of 45,400 (no units specified) steel gasoline tank(s), installed in 1970, as well as, a record of a 22,700 (no units specified) steel gasoline tank, installed in 1970 expired;

	• Fuel Storage Tank: Shell Canada Products, three (3) records of 35,000 L double wall FRP UST(s), installed in 1999, active, record of a 25,000 L double wall FRP UST, installed in 2004, active, and a record of a 130,000 L self-serve gasoline service station active; • Fuel Storage Tank – Historic: 972129 Ontario Limited operating as Shell Canada, two (2) records of 25,000 (unit not specified) double wall diesel USTs, installed in 2004, active, and three (3) records of 36,300 (unit not specified) double wall gasoline USTs, installed in 1999, active; • Ontario Regulation 347 Waste Generators Summary: Shell Canada, generator of light fuels and oil skimmings & sludges from 2006 to 2025 (not all waste classes were noted for each year); • Ontario Regulation 347 Waste Generators Summary: Shell Canada care of Minotaur Guardian Service Ltd., generator of oil skimmings & sludges and waste oils/sludges (petroleum based) from 2012 to in 2021; • Private and Retail Fuel Storage Tanks: B K Lakeview Service Ltd., record of a 113650 L retail tank, expired on January 31, 1995; • Private and Retail Fuel Storage Tanks: 1109289 Ontario Inc., record of a 113650 L retail tank, expired on March 31, 1996; • Retail Fuel Storage Tanks: Rourkes Don Shell Centre, gasoline, oil & natural gas service station; • Retail Fuel Storage Tanks: Sam Asaad Shell Gas Bar, gasoline, oil & natural gas service station; • Ontario Spills: Shell Canada Products Ltd., - o spill of 125 L of gasoline to ground at service station, due to valve/fitting leak or failure, occurred on February 9, 1990; - o spill of maximum 40 L of gasoline to storm sewer and creek, due to pipe/hose leak, occurred on December 13, 1997; - o spill of an unspecified volume of gasoline in monitoring well due to pipe/hose leak, reported on November 17, 1998, ground water pollution; - o an unspecified volume of liquid petroleum hydrocarbons found in two (2) monitoring wells, due to other container leak, reported on November 3, 1999, possible environmental impact; - o an unspecified volume of product (gasoline) found in ground, reason undetermined, occurred on October 13, 2004, soil and ground water contamination; • Ontario Spills: Shell Canada Limited, spill of 1 L of gasoline to ground, reason undetermined, occurred on January 10, 2004, cleaned;

	Ontario Spills: 2165 Erin Mills Parkway, spill of 1.5 L of gasoline to catch basin, occurred on November 30, 2006, confirmed environmental impact, cleaning;
Address:	2055 Fowler Court
Distance from Property:	approximately 70 m northeast of the Property at an inferred cross-gradient location
Records:	Automobile Wrecking & Supplies: Artia Scrap Metals, no other pertinent information provided;
Address:	1900 Fowler Drive
Distance from Property:	approximately 110 m east of the Property at an inferred down/cross-gradient location
Records:	- Ontario Regulation 347 Waste Generators Summary: Van Mills Medical Centre / Clinic, generator of pathological wastes from 2014 to 2024 (not all waste classes were noted for each year); - Ontario Regulation 347 Waste Generators Summary: Dr. B. Demarchi DPC / dental office, generator of pathological wastes from 2015 to 2022 (not all waste classes were noted for each year); - Ontario Spills: The Corporation of the City of Mississauga, spill of 44 L of raw unchlorinated sewage to ground and catch basin, due to overflow/surcharge, occurred on March 1, 2017;
Address:	2185 Erin Mills Parkway
Distance from Property:	approximately 95 m northeast (across Erin Mills Parkway) of the Property at an interfered down-gradient location
Records:	- Delisted Fuel Tanks: Kheriba Holding, fuel safety facility and piping, expired, records up to May 2013; - Delisted Fuel Tanks: Simcoe Energy & Technical Services Inc., fuel safety propane cylinder handling facility, expired, records up to May 2012; - List of Expired Fuels Safety Facilities: Kheriba Holding 2185 Erin Mills Parkway, three (3) records of 27,280 (no units specified) FRP liquid fuel tank(s), and a record of 22,730 (no units specified) FRP liquid fuel tank, all installed in 1991, expired; - Ontario Regulation 347 Waste Generators Summary: Petro Canada, generator of oil skimmings & sludges, and light fuels in 2005; - Private and Retail Fuel Storage Tanks: Myers Self-Serve, a record of 25,372 L retail tank, expired on November 30, 1994; - Private and Retail Fuel Storage Tanks: South Western Ontario Propane, record of 0 L tank , expired on July 31, 1995;

	• Private and Retail Fuel Storage Tanks: Mervet Zaia, record of 104,570 L tank , expired on March 31, 1996; • Ontario Spills: Petro-Canada, spill of 12 L of gasoline to ground, due to apparent negligence, occurred on April 20, 2003, soil contamination;

Two (2) borehole (BORE) and thirty three (33) water well information (WWIS) database records were included. The onsite water well records indicated that the soils consisted of brown sandy silt from the grade to approximately 0.9 m below grade underlain by grey clayey silt to approximately 3.3 m below grade, followed by great shale to approximately 3.7 m below grade.

4(c) Physical Settings Sources

4(c)(i) Aerial Photographs

Aerial photographs of the Property and surrounding area were examined for the following years: 1946, 1954, 1966, 1975, 1980, 1985, 1989, 1995, 2000, 2004, 2005, 2006, 2007, 2008, 2009, 2010, 2011, 2012, 2013, 2014, 2015, 2016, 2017, 2018, 2019, 2020, 2021, 2022, 2023, 2024, and 2025. The aerial photograph from 1946 was made available by way of ERIS and are included in Appendix D. The remaining aerial photographs were made available by way of Google earth™ and the City of Mississauga's interactive mapping website.

The aerial photographs from 1946 to 1975 appeared to indicate that the Property was undeveloped. The aerial photographs from 1980 onward indicated that the Property was developed with the current buildings (Buildings A and B) with the current shapes and configuration.

The aerial photographs from 1946 to 1975 appeared to indicate that the Phase One ESA Study Area was generally undeveloped. The aerial photographs from 1980 onward appeared to indicate the Phase One ESA Study Area to be progressively developed with land uses similar to the current commercial neighbouring properties. Erin Mills Parkway and North Sheridan Way could be observed in the aerial photographs from 1966 onward. Leanne Boulevard could also be observed in the aerial photographs from 1980 onward.

4(c)(ii) Topography, Hydrogeology, Geology

Based on OHE's review of relevant sources of information, a summary of topographic, geologic, and hydrogeological conditions for the Property and surrounding areas is provided as follows:

A review of Google earth™ indicated that the Property is situated at an approximate elevation of 132 m above mean sea level. The topography of the Property and local area identified during the Property reconnaissance indicated grades falling towards the east. Based on the observed shallow topography and presence of Loyalist Creek located approximately 600 m north of the Property running in a generally northwest-southeast direction, the inferred ground water flow direction is to the northeast.

Regional geological soil data were obtained via *Ontario Geological Survey 2010. Surficial geology of Southern Ontario; Ontario Geological Survey, Miscellaneous Release--Data 128-REV-OGS Earth Mapping Service, Google earth*. The surficial geography of the Phase One ESA Study Area consisted of Paleozoic bedrock. The bedrock geology of the Phase One ESA Study Area consisted of shale, limestone, dolostone, and siltstone of Georgian Bay Formation, Blue Mountain Formation, Billings Formation, Collingwood Member, and Eastview Member.

4(c)(iii) Fill Materials

No physical evidence as to the presence of fill materials was identified onsite during the Property reconnaissance. However, it is assumed fill was used in the development of the onsite building.

4(c)(iv) Water Bodies and Areas of Natural Significance

Based on OHE's review of relevant information, the nearest water body, Loyalist Creek, is located approximately 600 m north of the Property running in a generally northwest-southeast direction. Lake Ontario is located approximately 4 km southeast of the Property.

The City of Mississauga's Official Plan (viewed online) indicated that the Property was situated within an area with an "Office" designation and a "community node" designation. The areas adjoining to the west and north of the Property were designated as "Residential Low Density II". The area to the south of the Property was designated as "Office". The area to the northeast of the Property was designated as "Motor Vehicle Commercial". The area adjoining to the east of the Property was designated as "Mixed Use".

4(c)(v) Well Records

EcoLog ERIS was retained to conduct an environmental information search of the Property and surrounding properties (see Section 4(b)(v)), including well records. Thirty three (33) water well records were identified within the search area.

4(d) Site Operating Records

1000293648 Ontario Inc. was contacted with respect to historical site operating records. As per Ontario Regulation 153/04 (as amended), the following records are to be requested for an Enhanced Investigation Property:

1. Regulatory permits and records related to areas of potential environmental concern;
2. Inventories of chemicals, chemical usage and chemical storage areas;
3. Emergency Response Procedures, spill prevention and contingency plans;
4. A site plan of the facility;
5. Underground utility drawings;
6. Environmental monitoring data, including data created in response to an order or request of the MECP;
7. Process, production and maintenance documents related to areas of potential environmental concern;
8. Records of spills and records of discharges of contaminants, including records of spills and records of discharges of contaminants of which notice is required to be given to the MECP under the Act and records of such spills and discharges required to be kept pursuant to Ontario Regulation 675/98 (Classification and Exemption of Spills and Reporting of Discharges) made under the Act; and
9. Environmental audit reports.

No historical site operating records were made available to OHE by 1000293648 Ontario Inc.

5 INTERVIEWS

Mr. Ross Vasylyv, Operations Manager of the Property was interviewed during the Property reconnaissance due to his knowledge of the Property. The relevant information from this interview is included in this report where relevant.

6 SITE RECONNAISSANCE

6(a) General Requirements

The Property visit was conducted by Mr. Hasan Rahman of OHE on February 27, 2026. The temperature was approximately 7 °C and the weather was sunny. The Property reconnaissance and the inspection of the surrounding properties within 100 m of the Property were conducted from approximately 1:00 PM to approximately 5:00 P. Other properties within a 250 m radius were considered based upon potential environmental impact.

Property photographs are included in Appendix F.

6(b) Specific Observations at Phase One ESA Property

General Property Description

The Property consists of one building situated west of Erin Mills Parkway, approximately 90 m northeast of the intersection of Erin Mills Parkway and Leanne Boulevard in Mississauga, Ontario.

Property Entry and Exit Points

The entry and exit points from the Property were via a driveway off of Erin Mills Parkway, located on the southeast corner of the Property, as well as two (2) driveways off of Leanne Boulevard, located on the northwest and southwest corners of the Property.

Description of Property Structures and other Improvements

At the time of the Property reconnaissance, the Property comprised of two (2) attached commercial / office buildings as follows: The east Property building (Building A) and the west Property building (Building B) were each two (2)-storey buildings with no basement, and were each occupied by various commercial and office tenants.

Description of Property Occupants and Tenants

At the time of the Property reconnaissance, the Property was occupied by various commercial and office tenants. According to the tenants list provide by 1000293648 Ontario Inc., the Property tenants (including Buildings A and B) were as follows: Gents Custom Wear, 6435319 Canada Ltd., Thai Cuisine Experts, Toronto First Aid Centre, Recipe Unlimited Corporation, El Corral Products, 1448985 Ontario Inc., 2024075 Ontario Ltd., Healthy Body, Grey Willow Gifts, Golden Tree Kids Centre, Lycia Bernard, Akhlah Oklah, Shun-Hsiang Hu, Jacqueline Raposo, Julie Yagi-Fornos, Society Of Professional Engineers & Associates A E C L Sheridan Park, Richard Killen & Associates, Centre Holidays Inc., 2709266 Ontario Inc., TJ Foods Imports Inc., Dmytro Kashuba, Julie Yagi-Fornos, Seraj Society, Dr. Zafar-Iqbal Kayan, Dr. Henry Choi, Barrus Healthcare &, Maureen De Vera, Ace Tech Corporation, Proctor International, Dr. Stephen Gallant, and Sini Pengat.

Description of Property Utilities and Water Sources

The Property was serviced by Alectra Utilities Corporation for electricity, Enbridge for natural gas, Bell Canada for communications, and also municipally serviced for potable water and sewage.

Description of Property Exterior

The majority of the Property exterior (surrounding the Property buildings) comprised of asphalt paved areas including driveways or parking spaces. A landscaped area was also present on the southwest portion of the Property.

Adjacent Properties

The Property is situated in an area of commercial, residential, and industrial land use. The surrounding area within a 250 m radius of the Property was inspected by OHE on February 27, 20206. Lands surrounding the property were primarily identified as follows:

Table 4: Adjacent Properties

North:	2185 Leanne Boulevard (ESSI Circle K gasoline service station)
East:	• 1900 Erin Mills Parkway: commercial plaza; • 1910 Erin Mills Parkway: commercial plaza; • 1930 Erin Mills Parkway: commercial plaza; • 1944 Erin Mills Parkway: commercial plaza;
South:	• 2065 Leanne Boulevard (residential); • 0 Sheridan Way (vacant land);
West:	Leanne Boulevard, followed by: • 2147 Fifth Line West (residential); • 2579 Kenna Court (residential); • 2586 Kenna Court (residential); • 2590 Kenna Court (residential); • 2123 Bosack Court (residential);

The neighbouring properties within the Phase One ESA Study Area were primarily light commercial / residential in nature.

Asbestos-Containing Materials

Due to its insulation and fire retardant properties, asbestos was extensively used in building materials from the 1920s to the early 1970s. The health risk associated with asbestos occurs when asbestos fibres are released from various materials into the ambient air. Asbestos-containing materials (ACMs) that are in good condition generally should not present a health risk. However, in situations where the materials are

disturbed during maintenance or demolition activities, or where the material has deteriorated and has become friable, a health risk may be present.

At the time of the Property reconnaissance, potential non-friable ACMs observed at the physically / visually accessible areas within the Property included Transite cement panels, drywall joint compound and suspended ceiling tiles. Potential friable ACM in the form of sprayed fireproofing was also observed in the Property building. Based on the age of the building, other potential ACMs could also be present. It should be noted that a Designated Substance Survey (DSS) or an asbestos survey of the Property were not carried out as part of this Phase One ESA.

Polychlorinated Biphenyls (PCBs)

PCBs were commonly used as dielectric fluid in electrical equipment such as transformers and capacitors and in the ballasts of fluorescent light fixtures. The production of PCBs in North America started in 1929 and was stopped in the early 1980s. PCBs are an environmental concern because when released into the environment, they persist and tend to accumulate in the food chain. Fires involving equipment containing PCBs are considered dangerous because of the potentially toxic fumes that may be released. After 1981, manufacturers of fluorescent lamps ceased to use PCBs in the capacitors of lamp ballasts. Ontario Regulation 362/90 (as amended) under the Environmental Protection Act indicates that in order for a liquid to be considered PCB-containing the liquid must contain PCBs at a concentration of more than 50 parts per million (ppm) by weight.

The identified potentially PCB containing materials at the physically / visually accessible areas within the Property were limited to light ballasts.

Heavy Metal-Based Paints

Paint manufacturers historically added unregulated heavy metals, including lead, cadmium, and mercury to paint, because of their desirable properties such as rust prevention or as a bactericide. Emergent health concerns resulted in a reduction in the concentration of these elements in recent paint production. The Canadian government placed controls on lead content in paint under the authority of the Hazardous Products Liquid Coating Materials Regulations. These regulations specify a maximum lead content of 0.009% (weight percent in the dry paint film) in paints, enamels and other liquid coating materials for use on the interior or exterior surfaces of buildings, furniture or household products. The actual concentration of the heavy metals in the paint can vary greatly depending on how well the paints are mixed prior to application. For this

reason a random sampling program may be inconclusive as to the actual concentration of metals in paint. It is prudent to assume that the paint may contain heavy metals and where peeling paint is observed, it should be repaired. When major renovations or demolitions are proposed the painted surfaces should be extensively sampled and analyzed to confirm if abatement precautions are required. Under no circumstances should heat be used to remove the paint or cutting torches be applied to painted surfaces as hazardous levels of metals may be released in the fumes.

At the time of the Property reconnaissance, the painted surfaces identified at the physically / visually accessible areas within the Property appeared to be in fair condition with no obvious visual evidence of damage and/or peeling. It should be noted that, in the event of major building renovations or demolition work, a full DSS will be required. It should be noted that a DSS of the Property was not carried out as part of this Phase One ESA.

Mercury

Mercury is typically present in electrical panels, electrical equipment, fluorescent light bulbs and thermostats. Electrical panels and electrical equipment were observed at the physically / visually accessible areas within the Property. It should be noted that, in the event of major renovations or demolition work, a full DSS will be required.

Ozone Depleting Substances (ODSs)

Ozone Depleting Substances (ODSs) refer to any substances containing chlorofluorocarbon (CFC), hydrochlorofluorocarbon (HCFC), halon or any other chemicals capable of depleting the stratospheric ozone layer, which results in a higher level of ultraviolet (UV) radiation penetrating the earth's atmosphere. ODSs have been used in such applications as air-conditioning coolants, industrial solvents, foam and insulation products. Each province in Canada has passed legislation requiring mandatory recovery and reclamation of refrigerants during the maintenance of air-conditioning equipment.

Evidence of ODS-containing equipment was identified at the physically / visually accessible areas within the Property during the Property reconnaissance in the form of refrigerators and roof top air handling units. Any ODS-containing equipment should be maintained, serviced and / or decommissioned by licensed contractors in accordance with regulatory requirements.

Urea Formaldehyde Foam Insulation (UFFI)

UFFI was used in the mid-1970s as insulation in buildings but was banned after 1975. This material was not commonly used in commercial construction and is not a significant health concern in buildings with high ventilation rates.

Evidence of UFFI was not observed at the physically / visually accessible areas within the Property during the Property reconnaissance.

Underground Storage Tanks (USTs)

No obvious visual evidence of active and/or historical USTs were observed at the physically / visually accessible areas within the Property during the Property reconnaissance.

Aboveground Storage Tanks (ASTs)

No obvious visual evidence of active and/or historical ASTs were observed at the physically / visually accessible areas within the Property during the Property reconnaissance.

It should be noted that two (2) used cooking oil bins were observed on the exterior west side of Building A.

Hydraulic Hoists

No hydraulic hoists were observed at the physically / visually accessible areas within the Property during the Property reconnaissance.

Heating/Cooling System

The building heating and cooling was by way of a roof-top natural gas-fired heating, ventilation, and air conditioning (HVAC) system.

Mechanical Equipment

Mechanical equipment including elevators, vehicle hoists and compactors typically contains hydraulically operated devices. As equipment containing hydraulic oils is typically operated under high pressure, any leaks or equipment failure may result in a significant hydraulic oil release.

One (1) elevator was identified in Building B. No other specific mechanical equipment was identified at the physically / visually accessible areas of the Property during the Property reconnaissance.

Drains, Sumps, Grease Traps, Oil / Water Separators, and Pits

No drains, sumps, oil/water separators or pits were observed at the physically / visually accessible areas within the Property during the Property reconnaissance.

A grease interceptor was identified on the floor at the Swiss Chalet restaurant. Also, as previously noted, two (2) used cooking oil bins were observed on the exterior west side of Building A.

Railway Lines or Spurs

No railway lines or spurs were identified within the Phase One ESA Study Area.

Waste Management (Storage and Disposal)

Typical wastes associated with the land use of the Property appeared to be general operations related wastes. The generated wastes were reportedly temporarily stored in the exterior waste bins to be removed by municipal waste haulers on a weekly basis.

As previously noted, and based on review of the EcoLog ERIS report the Property was a waste generator of halogenated solvents, petroleum distillates, waste oils/sludges (petroleum based), and unspecified wastes from 1986 to 2021 (not all waste classes were noted for each year).

Wastewater Discharges

Wastewater discharges at the Property are assumed to be confined to sanitary sewer discharges, and storm water discharges to the storm sewer systems.

Onsite Wells and Sewage Works

No onsite wells or sewage works were observed at the physically / visually accessible areas within the Property during the Property reconnaissance.

Chemicals and Hazardous Materials Inventory and Management

The chemicals observed at the Property during the Property reconnaissance were limited to cleaning and janitorial chemicals and supplies.

The observed chemicals were noted to be stored in small lidded containers, and no obvious visual / olfactory evidence of spills or potential environmental issues associated with the stored chemicals was observed during the Property reconnaissance.

Amalgam Separators

No amalgam separators were observed at the physically / visually accessible areas within the Property during the Property reconnaissance.

Mould

No evidence as to the presence of mould was observed at the physically / visually accessible areas within the Property during the Property reconnaissance. It should be noted that the Phase One ESA did not include a full mould assessment.

Unidentified Substances

No unidentified substances were observed at the physically / visually accessible areas within the Property during the Property reconnaissance.

Pesticides/Herbicides

No evidence of pesticide or herbicide use was identified at the physically / visually accessible areas within the Property during the Property reconnaissance.

Spills, Stained Areas and Stressed Vegetation

No obvious visual/olfactory evidence of significant spills, stains and/or stressed vegetation was observed at the physically / visually accessible areas within the Property during the Property reconnaissance.

Radioactive Materials

No evidences of radioactive materials or equipment were observed at the physically / visually accessible areas within the Property during the Property reconnaissance.

Radon

Radon is a radioactive gas that is colourless, odourless, and tasteless. Radon is formed by the natural breakdown of radium in soil and rock and is therefore continually being emitted from the ground. Radon can pose a problem if it accumulates to excessive levels in an enclosed structure.

An assessment of the building for radon gas was not included in the Phase One ESA.

Air Emissions

No active air emissions were observed at the physically / visually accessible areas within the Property during the Property reconnaissance, save and except those associated with building heating and cooling.

Noise or Vibrations

No potential sources of significant noise or vibrations were observed or expected at the physically / visually accessible areas within the Property during the Property reconnaissance.

Energy Efficiency

Energy efficiency programs for the Property were not reported.

General Health and Safety Matters

A comprehensive health and safety inspection was not performed as part of this Phase One ESA.

6(b)(i) Enhanced Investigation Property

Ontario Regulation 153/04, as amended defines an Enhanced Investigation Property as a property that is used, or has ever been used, in whole or in part for an industrial use or for any of the following commercial uses,

- as a garage;
- as a bulk liquid dispensing facility, including a gasoline outlet; or
- for the operation of dry cleaning equipment.

Based on the information obtained during this Phase One ESA, the Property was not determined to be an Enhanced Investigation Property.

6(b)(ii) Written Description of Investigation

The investigation consisted of a Property inspection as well as inquiries to various regulatory agencies. In addition, a search was conducted of aerial photographs as well as various databases as made available through EcoLog ERIS.

7 REVIEW AND EVALUATION OF INFORMATION

7(i) Current and Past Uses

Based on OHE's review of gathered information, historical records review, Property reconnaissance, and the conducted interview, the Property appeared to be first residentially developed in as early as 1954 in the form of a residential dwelling on the southeast portion of the Property. The Property later appeared to be developed with the current commercial buildings (Buildings A and B) from approximately 1979/1980 until present.

7(ii) Potentially Contaminating Activities

Based on OHE's review of gathered information, records review and Property inspection, the following Potentially Contaminating Activities (PCAs) were identified:

On-Site Issues:

This section of the report summarizes on-site issues which may potentially impact the soil and ground water at the Property.

- Based on review of the previous environmental summary report (provided to OHE), multiple and various Phase One and Two ESAs, ground water monitoring programs and remediation activities have been previously completed (by others) at the Property, and as a result, remaining soil and ground water volatile organic compound (VOC) contamination was reported. The identified contamination reportedly appeared to be primarily located within the immediate area of the onsite dry cleaning facility (i.e. Bridlewood Cleaners).
- Based on review of available inspection reports, City Directories, and the EcoLog ERIS report, the Property was partially (Building A) occupied by Bridlewood Cleaners from approximately 1986 to 2021, with reported use of perchloroethylene, and associated waste generation of halogenated solvents. Additionally, the Property was occupied by Giant Petroleum Inc. (potential office), and was also a waste generator of oils/sludges (petroleum based), as well as unspecified wastes from 2019 to 2021 (not all waste classes were noted for each year).

Based on the above, there is a potential for environmental impacts to soil and ground water quality at the Property from the above noted records.

Off-Site Issues:

This section of the report summarizes off-site issues which may potentially impact the soil and ground water at the Property.

- Based on review of the EcoLog ERIS report, the south-adjointing property with the municipal address of 2065 Leanne Boulevard at an inferred up-gradient location was a historical waste generator of waste oils & lubricants from 2007 to 2011 (not all waste classes were noted for each year).
- Based on review of available City Directories, the EcoLog ERIS report, and the Property reconnaissance, the north-adjointing property with the municipal address of 2185 Leanne Boulevard at an inferred down/cross- gradient location was occupied by various gasoline service stations from 1985 until present. This adjoining property also had multiple and various fuel tank records, as well as a spill record.

Based on the above, there is a potential for environmental impacts to soil and ground water quality at the Property from the above noted records.

- Based on review of the EcoLog ERIS report, various waste generation, spill, automotive wrecking, or gasoline service station records were also identified at neighbouring properties at cross/down-gradient locations. Based on the distances and inferred cross/down-gradient locations of these records, the likelihood of potential environmental impacts to soil and ground water at the Property from those records appeared to be low.

This statement is made in the context of the commercial and residential nature and history of the Property and of other properties in the Phase One ESA Study Area.

7(iii) Areas of Potential Environmental Concern

Based on OHE's review of gathered information, records review and Property inspection, PCAs were identified within the Phase One ESA Study Area, and as a result, the Property was deemed to comprise an Area of Potential Environmental Concern (APEC).

7(iv) Phase One ESA Conceptual Site Model

Potentially Contaminating Activities and Contaminants of Potential Environmental Concern were identified in detail in Sections 7(ii) and 7(iii).

Based on OHE's review of gathered information, historical records review, Property reconnaissance, and the conducted interview, the Property appeared to be first residentially developed in as early as 1954 in the form of a residential dwelling on the southeast portion of the Property. The Property later appeared to be developed with the current commercial buildings (Buildings A and B) from approximately 1979/1980 until present.

Review of available records indicated that the Phase One ESA Study Area was historically mostly commercial and residential in use.

Based on OHE's review of relevant information, the nearest water body, Loyalist Creek, is located approximately 600 m north of the Property running in a generally northwest-southeast direction. Lake Ontario is located approximately 4 km southeast of the Property.

The City of Mississauga's Official Plan (viewed online) indicated that the Property was situated within an area with an "Office" designation and a "community node" designation. The areas adjoining to the west and north of the Property were designated as "Residential Low Density II". The area to the south of the Property was designated as "Office". The area to the northeast of the Property was designated as "Motor Vehicle Commercial". The area adjoining to the east of the Property was designated as "Mixed Use".

A review of Google earth™ indicated that the Property is situated at an approximate elevation of 132 m above mean sea level. The topography of the Property and local area identified during the Property reconnaissance indicated grades falling towards the east. Based on the observed shallow topography and presence of Loyalist Creek located approximately 600 m north of the Property running in a generally northwest-southeast direction, the inferred ground water flow direction is to the northeast.

Regional geological soil data were obtained via *Ontario Geological Survey 2010. Surficial geology of Southern Ontario; Ontario Geological Survey, Miscellaneous Release--Data 128-REV-OGS Earth Mapping Service, Google earth*. The surficial geography of the Phase One ESA Study Area consisted of Paleozoic bedrock. The bedrock geology of the Phase One ESA Study Area consisted of shale, limestone, dolostone, and siltstone of Georgian Bay Formation, Blue Mountain Formation, Billings Formation, Collingwood Member, and Eastview Member.

The accuracy of the Phase One ESA Conceptual Site Model was restricted to the accuracy of the information provided to OHE.

8 CONCLUSIONS

Property History

Based on OHE's review of gathered information, historical records review, Property reconnaissance, and the conducted interview, the Property appeared to be first residentially developed in as early as 1954 in the form of a residential dwelling on the southeast portion of the Property. The Property later appeared to be developed with the current commercial buildings (Buildings A and B) from approximately 1979/1980 until present.

Records Review

- The adjoining/neighbouring properties were mainly used for commercial and residential land uses.

- Based on review of the previous environmental summary report (provided to OHE), multiple and various Phase One and Two ESAs, ground water monitoring programs and remediation activities have been previously completed (by others) at the Property, and as a result, remaining soil and ground water VOC contamination was reported. The identified contamination reportedly appeared to be primarily located within the immediate area of the onsite dry cleaning facility (i.e. Bridlewood Cleaners).
- Based on review of available inspection reports, City Directories, and the EcoLog ERIS report, the Property was partially (Building A) occupied by Bridlewood Cleaners from approximately 1986 to 2021, with reported use of perchloroethylene, and associated waste generation of halogenated solvents. Additionally, the Property was occupied by Giant Petroleum Inc. (potential office), and was also a waste generator of oils/sludges (petroleum based), as well as unspecified wastes from 2019 to 2021 (not all waste classes were noted for each year).

Based on the above, there is a potential for environmental impacts to soil and ground water quality at the Property from the above noted records.

- Based on review of the EcoLog ERIS report, the south-adjointing property with the municipal address of 2065 Leanne Boulevard at an inferred up-gradient location was a historical waste generator of waste oils & lubricants from 2007 to 2011 (not all waste classes were noted for each year).
- Based on review of available City Directories, the EcoLog ERIS report, and the Property reconnaissance, the north-adjointing property with the municipal address of 2185 Leanne Boulevard at an inferred down/cross- gradient location was occupied by various gasoline service stations from 1985 until present. This adjoining property also had multiple and various fuel tank records, as well as a spill record.

Based on the above, there is a potential for environmental impacts to soil and ground water quality at the Property from the above noted records.

- Based on review of the EcoLog ERIS report, various waste generation, spill, automotive wrecking, or gasoline service station records were also identified at neighbouring properties at cross/down-gradient locations. Based on the distances and inferred cross/down-gradient locations of these records, the likelihood of

potential environmental impacts to soil and ground water at the Property from those records appeared to be low.

Property Inspection

- At the time of the Property reconnaissance, the Property comprised of two (2) attached commercial / office buildings as follows: The east Property building (Building A) and the west Property building (Building B) were each two (2)-storey buildings with no basement, and were each occupied by various commercial and office tenants.

Recommendations:

Based upon the findings of the Phase One ESA, including the previously identified (by others) soil and ground water contamination, OHE recommends a Delineation Phase Two ESA be carried out at the Property. The Phase Two ESA should address the area of potential environmental concern and associated contaminants of potential concern identified through this Phase One ESA with the goal of achieving lateral and vertical delineation.

8(i) Whether a Phase Two ESA Will Be Required for an RSC

Based upon the findings of the Phase One ESA, a Delineation Phase Two ESA will be required (among other requirements such as remediation / risk assessment, etc.) prior to submission of an RSC for the Property.

8(ii) RSC Based On the Phase One ESA Alone

As noted above, based upon the findings of the Phase One ESA, a Delineation Phase Two ESA will be required (among other requirements such as remediation / risk assessment, etc.) prior to submission of an RSC for the Property.

8(iii) Signatures

Signatures of the Qualified Person (Q.P.) and other parties associated with this report are included below. Saman Miralai, M.A.Sc., P.Eng., Q.P._{ESA}, supervised the Phase One ESA and confirmed the findings and conclusions of this study. Assessor qualifications are provided in Appendix G.

8(iv) General Statement of Limitations

All the information, conclusions, and recommendations presented in this document are based on our best professional knowledge, experience and judgment. The report is based on and limited to documents and verbal information supplied to OHE Consultants by the client, third parties, regulatory agencies, and by observations made during a

guided walk-through inspection of the buildings and Property. Our opinion cannot be extended to portions of the site, which were not available for direct observation due to obstruction by objects or coverings at the time of our investigation. Environmental testing of materials was not part of our scope of work.

There is no warranty expressed or implied by OHE Consultants that this investigation will uncover all potential environmental risks or liabilities associated with the site. We believe, however, that the level of detail carried out in this investigation is appropriate to meet the study objectives in accordance with the scope of work/terms of reference agreed to, between 1000293648 Ontario Inc. and OHE. We believe this report to be accurate. However, we cannot guarantee the completeness or accuracy of information supplied by any third party.

This report has been prepared for the exclusive use of 1000293648 Ontario Inc. with respect to the acquisition and development of the Property. Any other parties, who may have an interest in the site must do their own site assessment and interpretation to determine if the site conditions affect them.

The report may be relied upon by 1000293648 Ontario Inc. in determining whether to make a mortgage loan secured by the Property. 1000293648 Ontario Inc., any assignee or purchaser of the Mortgage and any agency rating securities secured by or representing an interest in the Mortgage shall be entitled to rely on the Report as if the Report was originally commissioned by them (within 1 year of the date of completion). The Report may be referred to in and/or included with materials offering the Mortgage or securities for sale.


8(v) Closure

We trust that the information presented herein meets your current requirements. Should you have any questions or require additional information, please do not hesitate to contact the undersigned at 905-890-9000.

OHE Consultants


Occupational Hygiene & Engineering

Prepared by:

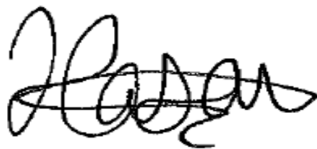

Hasan Rahman, B.Eng., EIT
Senior Project Specialist

Reviewed by:

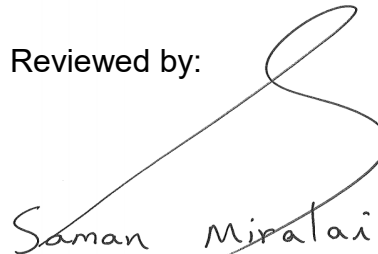

Saman Miralai, M.A.Sc., P.Eng., Q.P.E.S.A
Managing Consultant

Reviewed by:



Farid (Fred) Atrash, M.H.Sc., CIH, ROH
President

9 REFERENCES

A list of all documents and data cited in this report is provided as follows:

- OGSEARTH (Ontario Ministry of Northern Development, Mines and Forestry);
- The Atlas of Canada, Natural Resources Canada;
- EcoLog ERIS;
- Verisk Analytics Inc.;
- Aerial Photography, ERIS;
- Aerial Photography, Google earth™;
- Aerial Photography, City of Mississauga's interactive mapping website;
- The Ministry of Natural Resources and Forestry (MNRF);
- Freedom of Information and Protection of Privacy Office, MECP;
- Technical Standards & Safety Authority (TSSA);
- Certificate of Approval and Renewable Energy Approval database, MECP;
- City of Mississauga Interactive Map;
- City of Mississauga Official Plan;
- Brownfield Environmental Site Registry, MECP;
- Environment Canada National Pollutant Release Inventory (NPRI);
- *Summary of Findings – Phase One and Two Environmental Site Assessments, 2155 Leanne Boulevard, Mississauga, Ontario*, prepared for 568911 Ontario Ltd., prepared by ECOH Management Inc., dated April 19, 2017;

Drawings



Legend:



Notes:

Locations of site features are approximate and may vary from that shown

Drawing Title:

Site Location

Client Address:

Dunpar Homes
105 Six Point Road
Etobicoke, Ontario

Project Location:

Commercial Property
2155 Leanne Boulevard
Mississauga, Ontario

Project No: 31865



Date: March 2026

Scale: As Shown

Drawn By: NB

Approved By: SM

Drawing No:

1





Legend:

- Approximate Property Boundary 1
- Approximate Phase One ESA Study Area

Notes:

Locations of site features are approximate and may vary from that shown

Drawing Title:

Phase One ESA Property and Surrounding Land Use

Client Address:

Dunpar Homes
105 Six Point Road
Etobicoke, Ontario

Project Location:

Commercial Property
2155 Leanne Boulevard
Mississauga, Ontario

Project No: 31865



Date: March 2026

Scale: As Shown

Drawn By: NB

Approved By: SM

Drawing No:

2



Regulatory Framework

The following framework is designed to be an overview of applicable environmental and associated legislation and is not intended to be used as a comprehensive list.

Last updated: February 25, 2025

Federal Legislation

Canadian Environmental Protection Act, 1999

- PCB Regulations, SOR/2008-273
- Storage Tank Systems for Petroleum Products and Allied Petroleum Products Regulations, SOR/2008-197

Ontario Legislation

Environmental Protection Act, 1990

- Boilers, RRO 1990, Regulation 338;
- Classes of Contaminants - Exemptions, RRO 1990, Ontario Regulation 339;
- Classification and Exemption of Spills and Reporting of Discharges, Ontario Regulation 675/98;
- Designation of Waste, RRO 1990, Ontario Regulation 342;
- General - Waste Management, RRO 1990, Ontario Regulation 347;
- Industrial, Commercial and Institutional Source Separation Programs, Ontario Regulation 103/94;
- On-Site and Excess Soil Management, Ontario Regulation 406/19;
- Ozone Depleting Substances and Other Halocarbons, Ontario Regulation 463/10;
- Records of Site Condition - Part XV.1 of the Act, Ontario Regulation 153/04;
- Spill Prevention and Contingency Plans, Ontario Regulation 224/07;
- Spills, RRO 1990, Regulation 360;
- Waste Audits and Waste Reduction Work Plans, Ontario Regulation 102/94;
- Waste Disposal Sites and Waste Management Systems Subject to Approval Under or Exempt from the Environmental Assessment Act, Ontario Regulation 206/97;
- Waste Management - PCBs, RRO 1990, Ontario Regulation 362;

Technical Standards and Safety Act, 2000

- Boilers and Pressure Vessels, Ontario Regulation 220/01;
- Elevating Devices, Ontario Regulation 209/01;
- Fuel Industry Certificates, Ontario Regulation 215/01;



- Fuel Oil, Ontario Regulation 213/01;
- Gaseous Fuels, Ontario Regulation 212/01;
- Propane Storage and Handling, Ontario Regulation 211/01;

Ontario Water Resources Act

- Wells, RRO 1990, Ontario Regulation 903;

Building Code Act, 2002

- Building Code, Ontario Regulation 332/12;

Occupational Health and Safety Act, 1990

- Control of Exposure to Biological or Chemical Agents, RRO 1990, Ontario Regulation 833;
- Designated Substance - Asbestos on Construction Projects and in Buildings and Repair Operations, Ontario Regulation 278/05;
- Designated Substances, Ontario Regulation 490/09;
- Industrial Establishments, RRO 1990, Ontario Regulation 851;
- Noise, Ontario Regulation 381/15;
- Workplace Hazardous Materials Information System (WHMIS), RRO 1990, Ontario Regulation 860;

Guidelines

- *CCME Environmental Code of Practice for Aboveground and Underground Storage Tank Systems Containing Petroleum and Allied Petroleum Products*, 2003;
- *(Draft) Technical Guidance for Soil Vapour Intrusion Assessment*, Ontario Ministry of Environment, Conservation and Parks, January 4, 2021;



Inspection Reports



Enviroscan Report

Site address: 2155 Leanne Boulevard Mississauga ON
Project #: 26022500296
P.O. #: 172267
Requested by: Eleanor Goolab
Date Completed: 3/5/2026 2:37:30 PM

Search Area: 2155 Leanne Boulevard Mississauga ON



Historical Environmental Services Enviroscan Terms and Conditions

Terms and Conditions

Report

The documents (hereinafter referred to as the "Documents") to be released as part of the report (hereinafter referred to as the "Report") to be delivered to the purchaser as set out above are documents in Verisk's records relating to the described property (hereinafter referred to as the "Property"). Verisk makes no representations or warranties respecting the Documents whatsoever, including, without limitation, with respect to the completeness, accuracy or usefulness of the Documents, and does not represent or warrant that these are the only plans and reports prepared in association with the Property or in Verisk's possession at the time of Report delivery to the purchaser. The Documents are current as of the date(s) indicated on them. Interpretation of the Documents, if any, is by inference based upon the information which is apparent and obvious on the face of the Documents only. Verisk does not represent, warrant or guarantee that interpretations other than those referred to do not exist from other sources. The Report will be prepared for use by the purchaser of the services as shown above hereof only.

Disclaimer

Verisk disclaims responsibility for any losses or damages of any kind whatsoever, whether consequential or other, however caused, incurred or suffered, arising directly or indirectly as a result of the services (which services include, but are not limited to, the preparation of the Report provided hereunder), including but not limited to, any losses or damages arising directly or indirectly from any breach of contract, fundamental or otherwise, from reliance on Verisk Reports or from any tortious acts or omissions of Verisk's agents, employees or representatives.

Entire Agreement

The parties hereto acknowledge and agree to be bound by the terms and conditions hereof. The request form constitutes the entire agreement between the parties pertaining to the subject matter hereof and supersedes all prior and contemporaneous agreements, negotiations and discussions, whether oral or written, and there are no representations or warranties, or other agreements between the parties in connection with the subject matter hereof except as specifically set forth herein. No supplement, modification, waiver, or termination of the request shall be binding, unless confirmed in writing by the parties hereto.

Governing Document

In the event of any conflicts or inconsistencies between the provisions hereof and the Reports, the rights and obligations of the parties shall be deemed to be governed by the request form, which shall be the paramount document.

Law

This agreement shall be governed by and construed in accordance with the laws of the Province of Ontario and the laws of Canada applicable therein.

Report Index

Page Report Title

5	(1997) COPE Report - 1997 RALPH DENNIS DELORME 2155 LEANNE BL MISSISSAUGA ON L5K 2K8 Reference No: 11040019 (distance = 91 metres*)
13	(1997) Inspection Report - 1997 RALPH DENNIS DELORME 2155 LEANNE BL MISSISSAUGA ON L5K 2K8 Reference No: 11040019 (distance = 91 metres*)
25	(2002) Inspection Report - 2002 1498481 Ontario Ltd. o/a Buffet Garden 2155 Leanne Boulevard Mississauga ON L5K 2K8 (distance = 91 metres*)
35	(2002) Inspection Report - 2002 Thomas Dorman Associates Inc Unit 112 2155 Leanne Blvd Building 'B' (west) Mississauga ON L5K 2K8 (distance = 91 metres*)
45	(1984) Inspection Report - 1984 Konini Management 2155 Leanne Boulevard Mississauga ON L5K2K8 (distance = 7 metres*)
53	(1997) Siteplan Report - 1997 Ralph Dennis Delorne 2155 Leanne Boulevard Mississauga ON L5K2K8 (distance = 7 metres*)
55	(2026) PRECISE COMMERCIAL RISK ASSESSMENT Report - 2026 2155 Leanne Boulevard Mississauga ON L5K2K8 (distance = 0 metres*)

COPE Report - 1997 RALPH DENNIS DELORME 2155 LEANNE BL MISSISSAUGA ON L5K 2K8 Reference No: 11040019

AIS Ref No.: 11040019

1997

INSURERS' ADVISORY ORGANIZATION
CONFIDENTIAL - FOR USE OF MEMBERS ONLY
NOT FOR GENERAL DISTRIBUTION

2008-Nov-26
11:43 [Wed]

This document is owned by
Opta Information Intelligence
Inc. and is subject to copyright
protection. Please see the
full Terms and Conditions at
the front of this document.

COPE (Construction, Occupancy, Protection, Exposure) REPORT

Risk: RALPH DENNIS DELORME
2155 LEANNE BL
MISSISSAUGA ON
L5K 2K8

Reference No. 11040019 / Building No. 01 BLDG A

(Surveyed By P.C. TOMLINSON on 97.01.10)

Please note that the information contained in this report was gathered during
a physical inspection of the risk by an IAO Loss Control Representative.

If you wish to obtain building or contents rates for this risk, please refer
to the Rate Card in the list of products available for this risk.
Please call the IAO Help Desk or your local IAO Representative for help in
obtaining a rate for this risk, or do it yourself by going to www.iao.ca
and using the New X-rate to generate a new rate yourself.

IAO reports, prepared in compliance with commonly accepted risk control
standards existing at the time services are rendered, are developed from an
inspection of the premises and/or from data supplied by or on behalf of the
Purchaser. IAO does not purport to list all hazards. While changes and
modifications referred to in the reports are designed to upgrade protection
and loss prevention of the premises, IAO assumes no responsibility for
management and control of these activities. IAO will not be responsible to
the Purchaser for any loss or damages, whether consequential or other,
however caused, incurred or suffered, as a result of the service being
provided.

----- CODING -----

Industry Code: 651 - Office Buildings - (10 storeys or less)
Construction Code: 2 - Non-Combustible / Masonry Walls
Risk Classification: AS - Automatic Sprinklers
Protection Code: 6 - Sprinklered, Fully Protected, Gr 1-2
Combustibility M3

----- CONSTRUCTION -----

WALLS - MASONRY:
100% Concrete Block 300mm Thick C-2 Type: W-1

MASONRY and FIRE RESISTIVE FLOOR and ROOFS:
40% Concrete on Grade - Plan Hours: 3.00 Listed? N Type: D-1

NON-COMBUSTIBLE FLOORS and ROOFS:
27% Masonry Slabs (< 100mm/4 C-3
32% Class II Steel Deck - To C-6

COPE Report - 1997 RALPH DENNIS DELORME 2155 LEANNE BL MISSISSAUGA ON L5K 2K8 Reference No: 11040019

AIS Ref No.: 11040019

1997

----- SECONDARY CONSTRUCTION -----

HEIGHT:

Number of Storeys: 02
Basements: 0

Combustible Storeys Without Grade Access: 0

VERTICAL OPENINGS:

Stairs 1ST-2ND Comb.: 02 Const.: 3
Type: Non Comb. (V-3) .75Hrs-Walls/ .75Hrs-Doors

AREA:

Building Dimensions (m): 0 X 0 0 X 0 0 X 0

Grade: 2715 m2 Total: 4482 m2 Effective: 2715 m2

L1, L2 Area 60%

ROOF SURFACE:

100 % Approved

BUILDING CONDITION:

Good Type C--

Year Built: 1979 Air Conditioning: Central (100%)

Elevators: Pass.,

COMMON HAZARDS: 7211A2 - Central Heat Warm Air Gas
7211A2 - Central Heat Warm Air Gas
7211A1 - Central Heat Boiler

----- PROTECTION -----

MUNICIPAL PROTECTION:

Distance from Hydrants: Standard Congested Area: No
Distance to Fire Hall: < 2.5 km Accessibility: Good
FUS Protection Class: 04
Revised Class: 04
IAO Protection Class: 04

INTERNAL PROTECTION:

MANUAL FIRE FIGHTING EQUIPMENT: Non-Standard
None Extmet

STANDARD AUTOMATIC SPRINKLERS:

EF: 99 X RF: 95/100 X AT: 100/100 = Final 94

AUTOMATIC SPRINKLER ALARMS:

(1.d) To ULC-Listed Sta

This document is owned by Opta Information Intelligence Inc. and is subject to copyright protection. Please see the full Terms and Conditions at the front of this document.

COPE Report - 1997 RALPH DENNIS DELORME 2155 LEANNE BL MISSISSAUGA ON L5K 2K8 Reference No: 11040019

AIS Ref No.: 11040019

1997

----- EXPOSURE -----

COMMUNICATION CHARGES:

NonComb. F.R.Pass. / Ope

NONE NOTED:

----- OCCUPANCY - BRIDLEWOOD CLEANERS -----

Industry Code: 7220 - Laundries, Drycleaners, Dyers - Other than Se

Occupancy: 5141B - DRY CLEANING

Location: U1-2 Area: 194 m2 4.3% of Total

Combustibility Code: 03 - Combustible

Susceptibility Code: 03 - Moderate Damage

Special Hazard: 7308B2A - BOILER
7308C1B2 - PRESSES

----- OCCUPANCY - 241 PIZZA -----

Industry Code: 2051 - Bakeries and Confectionery

Occupancy: 6021A - PIZZERIA-TAKE-OUT

Location: U-3 Area: 69 m2 1.5% of Total

Combustibility Code: 03 - Combustible

Susceptibility Code: 04 - Heavy Damage

Special Hazard: 7308C1B2 - GAS OVENS

----- OCCUPANCY - ROYAL TRUST -----

Industry Code: 6021 - Commercial Banks

Occupancy: 5381 - BANK

Location: U-4 Area: 289 m2 6.4% of Total

Combustibility Code: 02 - Limited Combustibility

Susceptibility Code: 02 - Slight Damage

----- OCCUPANCY - CLUB "T" VIDEO -----

This document is owned by Opta Information Intelligence Inc. and is subject to copyright protection. Please see the full Terms and Conditions at the front of this document.

COPE Report - 1997 RALPH DENNIS DELORME 2155 LEANNE BL MISSISSAUGA ON L5K 2K8 Reference No: 11040019

AIS Ref No.: 11040019

1997

Industry Code: 5715 - RETAIL STORES: Furniture, Appliances, Floor

Occupancy: 5222A - VIDEO RENTALS

Location: U-5 Area: 142 m2 3.1% of Total

Combustibility Code: 03 - Combustible

Susceptibility Code: 04 - Heavy Damage

This document is owned by Opta Information Intelligence Inc. and is subject to copyright protection. Please see the full Terms and Conditions at the front of this document.

----- OCCUPANCY - SHERIDEAN CONVENIENCE -----

Industry Code: 5990 - Other Retail Stores (N.O.C.)

Occupancy: 5222A - CONVENIENCE STORE

Location: U-6 Area: 142 m2 3.1% of Total

Combustibility Code: 03 - Combustible

Susceptibility Code: 03 - Moderate Damage

----- OCCUPANCY - SWISS CHALET -----

Industry Code: 5812 - Restaurants - Refreshment Stands

Occupancy: 5212C - LICENSED RESTAURANT

Location: U-7 Area: 854 m2 19.0% of Total

Combustibility Code: 03 - Combustible

Susceptibility Code: 04 - Heavy Damage

Special Hazard: 7305B2C1 - REG CKNG APPRVD EXT SYST

----- OCCUPANCY - GOLDEN GRIDDLE -----

Industry Code: 5811 - Restaurants - Refreshment Stands

Occupancy: 5212C - RESTAURANT

Location: U8-9 Area: 523 m2 11.6% of Total

Combustibility Code: 03 - Combustible

Susceptibility Code: 04 - Heavy Damage

Special Hazard: 7305B2 - COOKING-NO CONTRACT

----- OCCUPANCY - BUSINESS NEEDS -----

COPE Report - 1997 RALPH DENNIS DELORME 2155 LEANNE BL MISSISSAUGA ON L5K 2K8 Reference No: 11040019

AIS Ref No.: 11040019

1997

This document is owned by Opta Information Intelligence Inc. and is subject to copyright protection. Please see the full Terms and Conditions at the front of this document.

Industry Code: 7408 - Miscellaneous Business Services (N.O.C.)

Occupancy: 5461A - BUSINESS SERVICES

Location: U-10 Area: 207 m2 4.6% of Total

Combustibility Code: 03 - Combustible

Susceptibility Code: 03 - Moderate Damage

----- OCCUPANCY - COMPUWEDGE -----

Industry Code: 5714 - RETAIL STORES: Furniture, Appliances, Floor

Occupancy: 5222A - RETAIL COMPUTERS ACCESSOR

Location: U-11 Area: 207 m2 4.6% of Total

Combustibility Code: 03 - Combustible

Susceptibility Code: 04 - Heavy Damage

----- OCCUPANCY - HAIRBY JEFFREY -----

Industry Code: 7297 - Miscellaneous Personal Service

Occupancy: 509 - BEAUTY PARLOUR

Location: U-12 Area: 207 m2 4.6% of Total

Combustibility Code: 02 - Limited Combustibility

Susceptibility Code: 03 - Moderate Damage

----- OCCUPANCY - OFFICES -----

Industry Code: 6610 - Office Tenants (N.O.C.)

Occupancy: 5381 - OFFICES

Location: 2ND Area: 1767 m2 39.4% of Total

Combustibility Code: 02 - Limited Combustibility

Susceptibility Code: 02 - Slight Damage

COPE Report - 1997 RALPH DENNIS DELORME 2155 LEANNE BL MISSISSAUGA ON L5K 2K8 Reference No: 11040019

AIS Ref No.: 11040019

1997

INSURERS' ADVISORY ORGANIZATION
CONFIDENTIAL - FOR USE OF MEMBERS ONLY
NOT FOR GENERAL DISTRIBUTION

2008-Nov-26
11:43 [Wed]

This document is owned by
Opta Information Intelligence
Inc. and is subject to copyright
protection. Please see the
full Terms and Conditions at
the front of this document.

COPE (Construction, Occupancy, Protection, Exposure) REPORT

Risk: RALPH DENNIS DELORME
2155 LEANNE BL
MISSISSAUGA ON
L5K 2K8

Reference No. 11040019 / Building No. 02 BLDG B

(Surveyed By P.C. TOMLINSON on 97.01.10)

Please note that the information contained in this report was gathered during
a physical inspection of the risk by an IAO Loss Control Representative.

If you wish to obtain building or contents rates for this risk, please refer
to the Rate Card in the list of products available for this risk.
Please call the IAO Help Desk or your local IAO Representative for help in
obtaining a rate for this risk, or do it yourself by going to www.iao.ca
and using the New X-rate to generate a new rate yourself.

IAO reports, prepared in compliance with commonly accepted risk control
standards existing at the time services are rendered, are developed from an
inspection of the premises and/or from data supplied by or on behalf of the
Purchaser. IAO does not purport to list all hazards. While changes and
modifications referred to in the reports are designed to upgrade protection
and loss prevention of the premises, IAO assumes no responsibility for
management and control of these activities. IAO will not be responsible to
the Purchaser for any loss or damages, whether consequential or other,
however caused, incurred or suffered, as a result of the service being
provided.

----- CODING -----

Industry Code: 651 - Office Buildings - (10 storeys or less)
Construction Code: 2 - Non-Combustible / Masonry Walls
Risk Classification: AS - Automatic Sprinklers
Protection Code: 6 - Sprinklered, Fully Protected, Gr 1-2
Combustibility F2

----- CONSTRUCTION -----

WALLS - MASONRY:
100% Concrete Block 300mm Thick C-2 Type: W-1

MASONRY and FIRE RESISTIVE FLOOR and ROOFS:
33% Concrete on Grade - Plan Hours: 3.00 Listed? N Type: D-1

NON-COMBUSTIBLE FLOORS and ROOFS:
33% Masonry Slabs (< 100mm/4 C-3
32% Class II Steel Deck - To C-6

COPE Report - 1997 RALPH DENNIS DELORME 2155 LEANNE BL MISSISSAUGA ON L5K 2K8 Reference No: 11040019

AIS Ref No.: 11040019

1997

----- SECONDARY CONSTRUCTION -----

HEIGHT:

Number of Storeys: 02
Basements: 0

Combustible Storeys Without Grade Access: 0

VERTICAL OPENINGS:

Stairs ST-2ND Comb.: 02 Const.: 2
Type: Non Comb. (V-3) .75Hrs-Walls/ .75Hrs-Doors

AREA:

Building Dimensions (m): 0 X 0 0 X 0 0 X 0

Grade: 2018 m2 Total: 4036 m2 Effective: 2018 m2

L1, L2 Area 98%

ROOF SURFACE:

100 % Approved

BUILDING CONDITION:

Good Type C--

Year Built: 1989 Air Conditioning: Central (100%)

COMMON HAZARDS: 7211B - Electric Heat-Perm

----- PROTECTION -----

MUNICIPAL PROTECTION:

Distance from Hydrants: Standard Congested Area: No
Distance to Fire Hall: < 2.5 km Accessibility: Good
FUS Protection Class: 02
Revised Class: 02
IAO Protection Class: 02

INTERNAL PROTECTION:

MANUAL FIRE FIGHTING EQUIPMENT: Non-Standard
None Extmet

----- EXPOSURE -----

COMMUNICATION CHARGES:

NonComb. F.R.Pass. / Enc

NONE NOTED:

----- OCCUPANCY - MORGAN'S FOLK ART -----

This document is owned by Opta Information Intelligence Inc. and is subject to copyright protection. Please see the full Terms and Conditions at the front of this document.

COPE Report - 1997 RALPH DENNIS DELORME 2155 LEANNE BL MISSISSAUGA ON L5K 2K8 Reference No: 11040019

AIS Ref No.: 11040019

1997

Industry Code: 5711 - RETAIL STORES: Furniture, Appliances, Floor

Occupancy: 5222A - ART GALLERY AND GIFT SHOP

Location: IST Area: 139 m2 3.4% of Total

Combustibility Code: 03 - Combustible

Susceptibility Code: 05 - Extreme Loss

This document is owned by Opta Information Intelligence Inc. and is subject to copyright protection. Please see the full Terms and Conditions at the front of this document.

----- OCCUPANCY - OFFICES -----

Industry Code: 6610 - Office Tenants (N.O.C.)

Occupancy: 5381 - OFFICES

Location: IST-2 Area: 3896 m2 96.5% of Total

Combustibility Code: 02 - Limited Combustibility

Susceptibility Code: 02 - Slight Damage

Inspection Report - 1997 RALPH DENNIS DELORME 2155 LEANNE BL MISSISSAUGA ON L5K 2K8 Reference No: 11040019

AIS Ref No.: 11040019

1997

CONFIDENTIAL

LOSS CONTROL ENGINEERING DEPARTMENT

Ontario

INSURED: Ralph Dennis Delorme 06 November 2008
(Building Owner)

2155 Leanne Boulevard File No. SR31800
Mississauga, Ontario Reference 104001
L5K 2K8

MAILING Sheridan Corporate Centre
ADDRESS: 2083 Lawrence Avenue West
Suite 5
Weston, Ontario
M9W 1H7

CONTACT: Mr Frank Altman

SURVEY-FIRE AND EXTENDED COVERAGE INSURANCE

The survey of the above property on January 10 & 14 1997 was made on behalf of participating insurance companies. The information gathered on this survey is used by these insurers to aid in deciding whether to underwrite the risk, and if so, at what cost.

The following comments were developed from this survey, and are based on conditions, practices observed, other pertinent data supplied by management personnel at the risk, and information secured at the time of survey.

Please note that the following recommendations have been made with the intention of pointing out those areas in which remedial action could have the beneficial effect of making your premises safer.

RECOMMENDATIONS IN CAPITAL LETTERS ARE OF PARTICULAR IMPORTANCE, AND THEIR EARLY IMPLEMENTATION IS ENCOURAGED.

Thank you for your co-operation during this visit, and please do not hesitate to get in touch with us if we can be of any further assistance.

Representative: P.C. Tomlinson

This document is owned by
Opta Information Intelligence
Inc. and is subject to copyright
protection. Please see the
full Terms and Conditions at
the front of this document.

Inspection Report - 1997 RALPH DENNIS DELORME 2155 LEANNE BL MISSISSAUGA ON L5K 2K8 Reference No: 11040019

AIS Ref No.: 11040019

...\Page 02

1997

This document is owned by
Opta Information Intelligence
Inc. and is subject to copyright
protection. Please see the
full Terms and Conditions at
the front of this document.

IAO reports, prepared in compliance with commonly accepted risk control standards existing at the time services are rendered, are developed from an inspection of the premises and/or from data supplied by or on behalf of the Purchaser. IAO does not purport to list all hazards. While changes and modifications referred to in the reports are designed to upgrade protection and loss prevention of the premises, IAO assumes no responsibility for management and control of these activities. IAO will not be responsible to the Purchaser for any loss or damages, whether consequential or other, however caused, incurred or suffered, as a result of the service being provided.

REMARKS:

1. This is the first survey of these premises since May, 1989.
2. The sprinkler system was tested and operated satisfactorily at time of survey.
3. This survey includes the office building known as Building "B".
4. Re: 241 Pizza - The missing ceiling tiles have been satisfactorily replaced. Recommendation 89-1 is deleted.
5. Re: Bridlewood Cleaners - The missing ceiling tiles in this unit have also been satisfactorily replaced. Recommendation 82-1 is deleted.

RECOMMENDATIONS:

BUILDING OWNER

- 97-1 (a) The flow alarm signal is presently taken from vane type flow devices only. To provide a more reliable method, a listed pressure switch should be installed and monitored from the alarm valve.

(b) The existing P.T.S. (Plug Type Switches) supervising all sprinkler protection shut-off control valves should be replaced with supervisory switches that conform to the intent of NFPA Standard No. 71 or 72. Plug type switches are only acceptable for use in pits where flooding may be a problem.
- 97-2 Serious consideration should be given to providing standard automatic sprinkler protection throughout the office building.
- 97-3 The missing fire extinguishers on the second floor of both buildings should be replaced with ULC listed portable fire extinguishers, with a minimum of a "2A" rating.
- 97-4 A full complement of (six or twelve) sprinklers similar to

Inspection Report - 1997 RALPH DENNIS DELORME 2155 LEANNE BL MISSISSAUGA ON L5K 2K8 Reference No: 11040019

AIS Ref No.: 11040019

...\Page 03

1997

This document is owned by
Opta Information Intelligence
Inc. and is subject to copyright
protection. Please see the
full Terms and Conditions at
the front of this document.

and of the same temperature rating as those installed should be provided, together with a sprinkler wrench in a spare sprinkler cabinet installed adjacent to the sprinkler valve.

241 PIZZA

97-1 Standard automatic sprinkler protection should be provided in the 6.1 m x 12.2 m (20' x 40') area at the rear of the unit.

97-2 All portable fire extinguishers should be serviced and tagged annually by an authorized representative to ensure reliability and proper working order.

SWISS CHALET

RESTAURANT

97-1 THE FIXED AUTOMATIC EXTINGUISHING SYSTEM SHOULD BE SERVICED SEMI-ANNUALLY THROUGH A MAINTENANCE CONTRACT BY AN AUTHORIZED REPRESENTATIVE TO ENSURE RELIABILITY AND PROPER WORKING ORDER. AT THE TIME OF THIS SURVEY, THE INSPECTION TAG WAS DATED MAY, 1996.

MORGANS FOLKART

INC.

97-1 All portable fire extinguishers should be serviced and tagged annually by an authorized representative to ensure reliability and proper working order.

RENT-A-HOME

97-1 All portable fire extinguishers should be serviced and tagged annually by an authorized representative to ensure reliability and proper working order.

Inspection Report - 1997 RALPH DENNIS DELORME 2155 LEANNE BL MISSISSAUGA ON L5K 2K8 Reference No: 11040019

AIS Ref No.: 11040019

1997

INSURERS' ADVISORY ORGANIZATION
Ontario

CONFIDENTIAL

INSPECTION REPORT

File No. 31800
Reference: 104001

Not on Plan

NAME OF RISK: Ralph Dennis Delorme
(Building Owner)

LOCATION: 2155 Leanne Boulevard
Mississauga, Ontario
L5K 2K8

SURVEYED BY: P.C. Tomlinson

SURVEY DATE: January 10 & 14 1997

IAO reports, prepared in compliance with commonly accepted risk control standards existing at the time services are rendered, are developed from an inspection of the premises and/or from data supplied by or on behalf of the Purchaser. IAO does not purport to list all hazards. While changes and modifications referred to in the reports are designed to upgrade protection and loss prevention of the premises, IAO assumes no responsibility for management and control of these activities. IAO will not be responsible to the Purchaser for any loss or damages, whether consequential or other, however caused, incurred or suffered, as a result of the service being provided.

GENERAL COMMENTS

OCCUPANCY: Multi-tenant commercial building.

CONSTRUCTION

FIRE DIVISIONS: See "Multiple Fire Section Sheets". This is one fire division but is considered to be two rating divisions due to the 9.15 m (30') length of the second floor communication.

HAZARDS

COMMON HAZARD:

Heating: Building "A": The first floor is heated in part by natural gas-fired, forced air suspended unit heaters venting to type "B" gas vents. The remainder of the building is heated by a natural gas-fired, combination heating and air-conditioning units located on the roof. The second floor area is heated by a low pressure natural gas-fired boiler, located in a

This document is owned by
Opta Information Intelligence
Inc. and is subject to copyright
protection. Please see the
full Terms and Conditions at
the front of this document.

Inspection Report - 1997 RALPH DENNIS DELORME 2155 LEANNE BL MISSISSAUGA ON L5K 2K8 Reference No: 11040019

AIS Ref No.: 11040019

1997

...\Page 2

This document is owned by Opta Information Intelligence Inc. and is subject to copyright protection. Please see the full Terms and Conditions at the front of this document.

cut-off room in the adjoining unsprinklered commercial building (Building "B").

Building "B": Is heated by 100% safely and permanently installed electric baseboard heating.

Fuel Supply: Independent gas connections.

Chimneys and Flues: Standard

Air-Conditioning: Central - 100% for both buildings.

Electrical: Safe. Circuit breakers used. Wiring installed in last 30 years.

SPECIAL HAZARDS: Safe. See "Tenants".

RADIOACTIVE MATERIAL: None

HIGH PILING: None

HOUSEKEEPING: Good

HAZARDOUS MATERIAL: None

EXPOSURES:

North	Protection Required: N	Protection Provided: N
	Light to a one storey adjacent, unsprinklered building detached by 9.15 m (30') of non-combustible construction, occupied as an auto service station. No protection is required.	

South	Protection Required: N	Protection Provided: N
	None	

East	Protection Required: N	Protection Provided: N
	None	

West	Protection Required: N	Protection Provided: N
	None	

ACTIVITY: 16 hrs/day, 7 days/wk.

Number of Production Workers: See "Tenants".

SMOKING RESTRICTED: See "Tenants".

ELECTRONIC DATA PROCESSING: Office computers.

Inspection Report - 1997 RALPH DENNIS DELORME 2155 LEANNE BL MISSISSAUGA ON L5K 2K8 Reference No: 11040019

AIS Ref No.: 11040019

...\Page 3

1997

PROCESS DESCRIPTION: See "Tenants".

PROTECTION

OVERALL GRADING: 99 (EF) x 95/100 (RF) x 100/100 (AT) = 94

(EF) - Minor unsprinklered areas.

(RF) - Missing hydraulic plaque from sprinkler riser.

Area Sprinklered (excluding concealed spaces): 99% Sprinklered - 100% Wet

Sprinkler Installation Date: 100%: 1979

Protection Against Freezing: In order.

Sprinkler Protection Required: Yes. See "Recommendation 97-1".

Equipment Standard: Yes

Alarms: Local alarm consists of an inside electric bells and outside water motor gong. The water flow pressure and gate valve are monitored on the annunciator panel located in the electrical room in Building "B" and in the main foyer of Building "B". Building "B" is the adjoining unsprinklered office building. The annunciator panel is monitored by the ULC central station of Chubb Alarms for trouble and fire. The gate valve in the sprinkler is currently supplied with a plug type switch (Recommendation made). There are also no flow switches on the sprinkler alarm valve and flow is monitored by vain type detectors on the first and second floor which are in turn tied into the annunciator panel. A recommendation is being made for a flow type switch to be installed in the alarm valve. (Grading = 5%)

Primary Water Supplies: Municipal - Standard

Secondary Water Supplies: No - not required.

ADDITIONAL SPRINKLER PROTECTION DETAILS:

Standard single supply from an 203.2 mm (8") connection to a 304.8 mm (12") municipal main in Leanne Boulevard fed both ways. Static pressure 448.5 kPa (65 psi), residual pressure 414 kPa (60 psi) with the 50.8 mm (2") drain flowing fully open. The water flow test conducted in 1987 indicated that 8272.6 L/min (2177 US gpm) at 414 kPa (60 psi) is available with a static pressure of 462.3 kPa (67 psi).

Hydraulically designed sprinkler system requires 3610 L/min (950 US gpm) at 338.1 kPa (49 psi) for a minimum density of 7.74 mm/min (.19 US gpm/sq ft) over a design area of 176.51 m² (1900 sq ft), with a 1330 L/min (350 US gpm) hose stream allowance. This sprinkler system is considered adequately designed for this Ordinary Hazard Group 2 occupancy.

This document is owned by
Opta Information Intelligence
Inc. and is subject to copyright
protection. Please see the
full Terms and Conditions at
the front of this document.

Inspection Report - 1997 RALPH DENNIS DELORME 2155 LEANNE BL MISSISSAUGA ON L5K 2K8 Reference No: 11040019

AIS Ref No.: 11040019

...\Page 4

1997

This document is owned by
Opta Information Intelligence
Inc. and is subject to copyright
protection. Please see the
full Terms and Conditions at
the front of this document.

OTHER PROTECTION:

Extinguishers: Inadequate. See "Tenants" (Recommendation made).

Standpipe and Hose: None

Watchman Service: None

Special Equipment: Non-standard. See "Tenants" (Recommendation made).

OUTSIDE PROTECTION:

Public Hydrants: Standard

Public Fire Department: Career.

Distance to Fire Hall: 2.42 km (1 1/2 miles)

F.U.S. Municipality Classificaiton: 2

Accessibility: To Property - Good

Into Building - Good

EXTENDED COVERAGE

No unusual hazards overall.

SPRINKLER LEAKAGE - Stock Skidded or Shelved: Yes

Stock Susceptible to Large Water Damage: In food service areas.

Floors Drained: No

RIOT, VANDALISM, MALICIOUS ACTS

Access Restricted: No

Guard Supervised: No

Yards Fenced: No

Yards Lit: Yes. The yard and property is lit by ordinary incandescent and flood lights attached to the outside walls of the building.

Remote from Populated Areas: No

EARTHQUAKE - Zone: 0

IMPACT HAZARDS:

By Aircraft: No

By Road Vehicles: A possibility from vehicles parking in all areas surrounding

Inspection Report - 1997 RALPH DENNIS DELORME 2155 LEANNE BL MISSISSAUGA ON L5K 2K8 Reference No: 11040019

AIS Ref No.: 11040019

...\Page 5

1997

This document is owned by
Opta Information Intelligence
Inc. and is subject to copyright
protection. Please see the
full Terms and Conditions at
the front of this document.

both buildings.

By Trains: No

By Floating Vessels: No

SMOKE DAMAGE - Susceptibility of stock to smoke damage: Severe in food service areas.

UNDESIRABLE FEATURES

PROMINENT:

None apparent.

OTHER:

1. Non-standard supervision equipment on sprinkler system.
2. Non-standard maintenance contract on fixed automatic extinguishing system.
3. Minor unsprinklered areas.
4. Missing hydraulic plaque.
5. Non-standard and outdated portable fire extinguishers.

MANAGEMENT - LOSS PREVENTION PROGRAMMES

Basic Fire Protection:

Control Required: Y Control Exercised: Satisfactory

Fire Protection Equipment Maintenance:

Control Required: Y Control Exercised: Unsatisfactory

Outdated portable fire extinguishers in several units.

Inspection Report - 1997 RALPH DENNIS DELORME 2155 LEANNE BL MISSISSAUGA ON L5K 2K8 Reference No: 11040019

AIS Ref No.: 11040019

...\Page 6

1997

This document is owned by
Opta Information Intelligence
Inc. and is subject to copyright
protection. Please see the
full Terms and Conditions at
the front of this document.

TENANTS

1. Asterisk (*) denotes change of occupancy since last survey.
2. Good housekeeping with a standard supply of portable extinguishers, unless otherwise stated.
3. If the building is sprinklered, then the overall grading of sprinklers and water supplies to all tenants is equal to that of the building grading, unless otherwise stated.

BUILDING "A" - FIRST FLOOR

(UNITS 1 & 2) BRIDLEWOOD CLEANERS (IBC Code: 7222)

Occupies 194.6255 m2 (2095 sq ft) for a dry cleaner, with clothing repair and pressing. Perchloroethylene is utilized as the cleaning solvent in safely arranged machines. Steam for the presses is provided by a natural gas-fired "Fulton" upright steam boiler, located in a separate non-combustible room at the rear of the building. This boiler vents to a type "B" gas vent and is equipped with all necessary combustion controls.

(UNIT 3) 231 PIZZA (IBC Code: 2051)

Occupies 69.8608 m2 (752 sq ft) for a take-out pizzeria. Two natural gas-fired ovens are utilized and are safely arranged. Standard automatic sprinkler protection is required in a 6.1 m x 12.2 m (20' x 40') area at the rear (Recommendation made). The supply of portable fire extinguishers is standard but bears outdated service tags (Recommendation made).

(UNIT 4) ROYAL TRUST (IBC Code: 6021)

Occupies 289.1048 m2 (3112 sq ft) for a savings and loan bank.

(UNIT 5) * CLUB T VIDEO (IBC Code: 5715)

Occupies 142.4157 m2 (1533 sq ft) for a retail sales and rental video store.

(UNIT 6) * SHERIDAN CONVENIENCE (IBC Code: 5990)

Occupies 142.4157 m2 (1533 sq ft) for a typical convenience/variety store.

(UNIT 7) SWISS CHALET RESTAURANT (IBC Code: 5812)

Occupies 853.3794 m2 (9186 sq ft) for a fully licensed restaurant. Commercial cooking equipment consists of self-contained natural gas-fired chicken roasters which are hooded, vented and provided with a dry chemical fixed automatic extinguishing system. Other cooking equipment includes various grills, ranges, stoves, charcoal broilers and deep fat fryers, which are also protected by a dry chemical, fixed automatic extinguishing system. The system has not been serviced within the last year and the date on the service tag is May, 1996 by Active Fire & Safety (Recommendation made). Emergency activation switches and emergency gas shut-off valves are also provided.

(UNITS 8 & 9) GOLDEN GRIDDLE PANCAKE HOUSE (IBC Code: 5812)

Occupies 523.2128 m2 (5632 sq ft) for a fully licensed restaurant. Cooking

Inspection Report - 1997 RALPH DENNIS DELORME 2155 LEANNE BL MISSISSAUGA ON L5K 2K8 Reference No: 11040019

AIS Ref No.: 11040019

1997

...\Page 7

This document is owned by
Opta Information Intelligence
Inc. and is subject to copyright
protection. Please see the
full Terms and Conditions at
the front of this document.

is conducted on natural gas-fired equipment consisting of various grills, charcoal broilers, stoves, deep fat fryers and ranges. All equipment is hooded, vented and protected by three fixed wet chemical automatic extinguishing systems, which are serviced on semi-annual basis by Safety First Fire Protection. The date of last service is September, 1996. Emergency gas shut-off and emergency activation switches are provided.

(UNIT 10) * BUSINESS NEEDS (IBC Code: 7108)

Occupies 83.61 m2 (900 sq ft) for a business service conducting services such as faxing messages, photocopying, typing, etc.

(UNIT 11) * COMPUWEDGE (IBC Code: 5714)

Occupies 206.9812 m2 (2228 sq ft) for the retail sales and service of computers and related accessories.

(UNIT 12) * HAIR BY JEFFREY (IBC Code: 7296)

Occupies 206.9812 m2 (2228 sq ft) for a men's and women's hairstyling salon.

BUILDING "A" - SECOND FLOOR (IBC Code: 6610)

Comprises 1765.1 m2 (19000 sq ft) for various offices. Portable fire extinguishers are missing (Recommendation made).

BUILDING "B" - FIRST FLOOR

MORGANS FOLKART INC (IBC Code: 5171)

Occupies 139.35 m2 (1500 sq ft) for a small art gallery with retail sales of crafts. Portable fire extinguishers are standard but outdated (Recommendation made).

The remainder of the first floor and second floor consists of various offices. Comprises 3892.51 m2 (41900 sq ft).

Inspection Report - 1997 RALPH DENNIS DELORME 2155 LEANNE BL MISSISSAUGA ON L5K 2K8 Reference No: 11040019

AIS Ref No.: 11040019

...\Page 8

1997

This document is owned by
Opta Information Intelligence
Inc. and is subject to copyright
protection. Please see the
full Terms and Conditions at
the front of this document.

MULTIPLE FIRE SECTION [1] SHEET:

LOCATION / BUILDING NO."A"

PERCENT SPRINKLERED:99%

OCCUPANCY: Offices, stores and restaurants.

BUILT IN: 1979

Additions: None

Repair: Good

Renovations and type: None.

HEIGHT: 2 Sto(s). = 8.845 m (29')

Basement: None

WALLS: Construction: Stucco board on concrete block.

Type of Walls: Independent, bearing

FLOORS: Grade Floor - Concrete on grade.

Second Floor - Concrete on metal pan.

ROOF: Class II steel deck.

AREA:

Grade: 2712.68 m2 (29200 sq ft)

Total: 4477.78 m2 (48200 sq ft)

Separation Walls: Drywall to the ceiling.

VERTICAL OPENINGS: Stairways extend from the first floor to the second floor enclosed in drywall shafts with self-closing metal doors at each floor opening.

Elevators: One passenger elevator.

INTERIOR FINISH - Walls: 90% non-combustible; 10% open

INTERIOR FINISH - Ceilings: 90% non-combustible; 10% open

COMBUSTIBLE CONCEALED SPACES: None

Inspection Report - 1997 RALPH DENNIS DELORME 2155 LEANNE BL MISSISSAUGA ON L5K 2K8 Reference No: 11040019

1997

AIS Ref No.: 11040019

...\Page 9

This document is owned by
Opta Information Intelligence
Inc. and is subject to copyright
protection. Please see the
full Terms and Conditions at
the front of this document.

MULTIPLE FIRE SECTION [2] SHEET:

LOCATION / BUILDING NO."B"

PERCENT SPRINKLERED:0%

OCCUPANCY: Office, with one retail store.

BUILT IN: 1979

Additions: None

Repair: Good

Renovations and type: None.

HEIGHT: 2 Sto.(s) = 8.845 m (29')

Basement: None

WALLS: Construction: Stucco board on concrete block.

Type of Walls: Independent, bearing

FLOORS: Grade Floor - Concrete on grade.

Second Floor - Concrete on metal pan.

ROOF: Class II steel deck roof.

AREA:

Grade: 2015.93 m2 (21700 sq ft)

Total: 4031.86 m2 (43400 sq ft)

Separation Walls: Drywall to the suspended mineral tile ceiling
finish.

VERTICAL OPENINGS: Stairs extend from the first floor to the second floor and
are situated in drywall enclosed shafts, with self-closing metal doors at each
floor opening.

Elevators: None

INTERIOR FINISH - Walls: 100% non-combustible

INTERIOR FINISH - Ceilings: 100% non-combustible

COMBUSTIBLE CONCEALED SPACES: None

Inspection Report - 2002 1498481 Ontario Ltd. o/a Buffet Garden 2155 Leanne Boulevard Mississauga ON L5K 2K8



Insurers' Advisory Organization Inc.
A subsidiary of Underwriters Adjustment Bureau Ltd.

Confidential

IAO All Risk

(Now available through the IAO Web-site; www.iao.ca)

INSPECTION REPORT

Supplement/s attached: ☐ Yes ☐ No

1.0 BASIC INFORMATION

Insured:		Policy Number	
Date of survey (YYYY/MM/DD):	2002/12/02	IAO Loss Control Specialist:	Trina Tallon
Person Contacted:	Shawn	Telephone No.	(905) 403-9633
Position			
Mailing Address if Different for risk:			IAO AIS No.: 11040019
	(unit # street # & name)	(City, Town, Village)	
Location Surveyed:	2155 Leanne Boulevard	Mississauga	Ontario (Province)
	(unit # street # & name)	(City, Town, Village)	L5K 2K8 (postal code)
Secondary address (If any)			(Province)
	(unit # street # & name)	(City, Town, Village)	(postal code)
IBC Territory Code	91	IBC Building Code: 6511	SR/MA File No.
Underwriter:		Broker:	

The **IAO Risk•Score** and comments contained in this report are based on conditions and practices observed during our survey and other pertinent data supplied by management personnel at the risk.

Recommendations in this report are made to point out those areas where remedial action could have the beneficial effect of making the above premises safer, and thus more desirable from an underwriting standpoint.

Thank you for choosing IAO to perform this inspection. Please do not hesitate to contact us if we can be of any further assistance.

2.0 IAO Risk•Score

Comments

	1	2	3	4	5	6	7	8	9	
Property	☐	☐	☒	☐	☐	☐	☐	☐	☐	<i>The building and all exterior areas appear to be in excellent condition with signs of regular care and maintenance from the owner.</i> <i>There were no unusual liability features or deficiencies noted on this inspection.</i> <i>Protection appears adequate at time of inspection.</i>
Liability	☐	☐	☒	☐	☐	☐	☐	☐	☐	
Crime	☐	☐	☒	☐	☐	☐	☐	☐	☐	
(1=Excellent & 9=Poor)										

RISK ALERT ISSUED: ☐ Yes ☒ No If yes, describe (A risk alert is a telephone notification to the Inspection requestor, of a situation which could imminently cause a serious loss. A Critical Recommendation will be issued to address the situation.)

Committed to Service Excellence

IAO reports, prepared in compliance with commonly accepted risk control standards existing at the time services are rendered, are developed from an inspection of the premises and/or from data supplied by or on behalf of the Purchaser. IAO does not purport to list all hazards. While changes and modifications referred to in the reports are designed to upgrade protection and loss prevention of the premises, IAO assumes no responsibility for management and control of these activities. IAO will not be responsible to the Purchaser for any losses or damages, whether consequential or other, however caused, incurred or suffered, as a result of the services being provided.

(All Risk Report – February 25, 2002 R 4)

This document is owned by Opta Information Intelligence Inc. and is subject to copyright protection. Please see the full Terms and Conditions at the front of this document.

SP201FORM

Meaning of the IAO Risk-Score: The IAO Score is a grading of the risk inspected versus other risks in this class. Similar to the "Commercial" Fire Protection Grading system in design, there is range of 9 categories, with a grading or "score" of 1 being the most desirable. The IAO Score is based on a number of objective criteria pertaining to the risk at the time of our survey, tempered with the experienced judgement of our Loss Control Specialist. As a general guideline, the scores mean the following criteria:

1-3	Risks in this range are well maintained, with no apparent moral hazards or management problems. Undesirable features are non-existent and recommendations, if any, are minor. Risks in this category are excellent (no deficiencies) to better than average for their class.
4-6	The maintenance of Risks in this range is considered average. Moral hazards are not apparent, but there may be possible management problems (e.g. poor housekeeping). Undesirable features noted are correctable, and recommendations will vary from desirable to important. Risks in this category are considered average for their class.
7-9	Risks in this range tend to be poorly maintained. Moral hazards and management problems (e.g. poor housekeeping and maintenance, poor attitude) are evident. Significant undesirable conditions are present and cannot or will not be corrected. Critical Recommendations may be present. Risks in this category are significantly below average for their class with little or no indication for improvement.

3.0 REMARKS

Insured is located on the south side of Leanne Boulevard and west of Erin Mills Parkway. The contact was interested in loss prevention and co-operative. The risk is a fully sprinklered building, but no inspection at time of this survey.

4.0 RECOMMENDATIONS

Please note that these recommendations are classified as either ☐ **Critical**, ☐ **Important**, or ☐ **Desirable Improvement**. "Critical" recommendations are those aimed at correcting undesirable feature/s which, if left unattended, could cause a serious loss and should be rectified immediately. This class of recommendation is only used in extreme situations. "Important" recommendations are intended to highlight undesirable feature/s which if left unattended, could cause a serious loss and should be rectified as soon as possible. "Desirable Improvement" recommendations are those aimed at correcting an undesirable feature which can be improved when feasible, to help reduce the risk of a loss.

☐ Listed below or ☒ None

☐ Critical	☐ Important	☐ Desirable Improvement

☐ Critical	☐ Important	☐ Desirable Improvement

☐ Critical	☐ Important	☐ Desirable Improvement

5.0 OCCUPANCY INFORMATION (IBC Occupancy Code 5812)

The Insured is

☐ Owner Occupant	☐ Non-occupant building owner	☒ Tenant
Name of building owner(if not Insured):	Konini Management	Number of years bldg. Owned: 5
Number of years at this location: 1	Area occupied (sq. m): 464.5	Business hours: 11:30 am - 9:30 pm
Days per week: 7 days	Annual Revenue (optional): N/A	Payroll (optional): N/A
Previous loss history past 3 years ☐ Yes ☒ No ☐ Undetermined	Previous loss history past 6 years ☐ Yes ☒ No ☐ Undetermined	
Explain loss history:		
Insured Values: Property: \$		Contents: \$300,000
Combustibility of Occupancy: M3		Susceptibility of Occupancy: S4-Heavy Damage

Occupancy : ☐ Major Tenant OR ☒ Insured IBC Industry Code: 5812		or ☐ refer to Occupancy Specific Supplement:
Occupancy Description: Licensed Chinese Buffet Restaurant (Units 8 & 9) occupying 464.5 sq. m.		
Special Hazard Code(s): GRP5 SH6		Description: Fully approved fixed extinguishing system.
Special Hazard Code(s):		Description:
Other classes of occupants: (immediate exposures)		
Name: Calabash Cuisine (Unit 10)	Area occupied: 207 sq. m	IBC Code 5812
Occupancy Description: Licensed deli.		
Special Hazard Code(s) : GRP5 SH6		Description: Fully approved fixed extinguishing system.
Special Hazard Code(s) :		Description:
Name: Swiss Chalet (Unit 7)	Area occupied: 854 sq. m	IBC Code 5812
Occupancy Description: Licensed restaurant.		
Special Hazard Code(s) GRP 5 SH6		Description: Fully approved fixed extinguishing system.
Special Hazard Code(s)		Description:
Areas not surveyed:		☒ For additional tenants see attached list

6.0 BUILDING CONSTRUCTION (IBC Major Construction Class 2)

Building condition:		☐ Above Average	☒ Average	☐ Moderate deficiencies	☐ Major deficiencies
Year built: (yyyy)		1979	Area occupied by insured (sq. m): 464.5		Combustibility of Building M3
Ground floor area (sq. m):		2715 sq. m	Total floor area (excl. bsmt.)		4482 sq. m
Height (excluding basement):		9.3 m	Number of Stories: 2 (above grade)		
Basement:		☐ Yes ☒ No	Area of basement: (sq. m)		Total area: 4482 sq. m
Additions (year & brief description):		N/A			
Renovations (year & brief description):		N/A			
Wall construction:	Reinforced Concrete % ()	Masonry: 80%: (Concrete Block)	Non Combustible: %: ()	Brick/stone veneer: %: ()	Wood frame: %: ()
	Other:		Panels in Walls 20 % Describe: Glass		

Floor Construction:	Concrete: %	Concrete on metal pan: 100 %	Wood joist: %	Other: %
Roof Type:	☒ Flat	☐ Sloped	☐ Peaked	☐ Other
Roof Construction:	☐ Concrete %	☒ Steel deck % 100	☐ Wood joist %	☐ Other: %
Roof Surface:	☒ Tar & gravel	☐ Metal	☐ Asphalt shingles	☐ Rubber Membrane
	☐ Wood Shakes	☐ Other		
Resurfaced:	☐ Yes	☒ No	Date:	
Interior Finish Walls:	Combustible: %	Non-combustible: 100 %	Open: %	
Interior Finish Ceilings:	Combustible: %	Non-combustible: 100 %	Open: %	
Vertical Openings:	☐ None	☒ Stairs	☐ Elevator	☐ Deck: ☐ Other
Horizontal Separation:	Major Partition Construction		☐ Not Applicable	☐ Frame ☐ Drywall on Studs
			☒ Concrete Block	☐ Other
	Proper Opening Protection:		☒ Yes	☐ No ☐ Not Applicable
Mezzanines: ☒ No ☐ Yes	Combustible: %	Non-combustible: %		Open: %
Mezzanines percentage of floor	%			
Combustible Concealed Spaces:	☒ No	☐ Yes	If yes, describe and %	
Concealed space properly protected	☐ No	☐ Yes	☒ Not applicable	Comment:
Building Description:				
	Shopping Mall ☐ Yes ☒ No		Industrial Mall ☐ Yes ☒ No	Strip Mall: ☒ Yes ☐ No
	Other Describe :			

7.0 EXPOSURES (Within 50m of risk)

	Distance	Height	Construction	Occupancy Hazard	Civic Number (optional)	Opening in Facing Wall	
						Yes	No
Front	<u>Open</u> m	___ sto.	--	--		☐	☐
Rear	<u>0</u> m	<u>2</u> sto.	Non-Combustible	Light		☐	☒
Left	<u>0</u> m	<u>2</u> sto.	Non-Combustible	Medium		☐	☒
Right	<u>0</u> m	<u>2</u> sto.	Non-Combustible	Medium		☐	☒

(For Malls) Describe partition walls between insured and other tenants. Concrete Block

8.0 COMMON HAZARDS (Heating, electrical, plumbing)

HEATING:

Forced warm air:	☐ Electric %	☒ Gas 100%	☐ Oil %	Other _____
Suspended unit heaters:	☐ Electric %	☐ Gas %	☐ Oil %	Other _____
Portable heaters:	☐ Electric %	☐ Gas %	☐ Oil %	Other _____
Electric baseboard units:	☐ %			
Hot water/steam	☐ Electric %	☐ Gas %	☐ Oil %	Other _____
Other	☐ Electric %	☐ Gas %	☐ Oil %	Other _____
Boiler:	☐ Yes	☒ No	Age (yyyy) _____ and Make: _____	Date of last Boiler Inspection: (yyyymmdd) _____
Appliances enclosed in a non-combustible room:	☐ Yes		☐ No	☒ Not required:
Combustible materials stored in the room:	☐ Yes		☐ No	☒ Not applicable
Fuel tanks:	☒ None	☐ Inside	☐ Outside	Age (yyyy) _____ Capacity (L)
	☐ Above ground	☐ Below ground		

Fill and vent piping: Inside		☐ Yes	☐ No	☒ N/A
Chimneys:	☐ Masonry	☒ ULC Factory built	☐ Unlabelled pre-fab	☐ Other _____
	☒ Standard	☐ Non-standard _____		
Installation defects:	☒ None	☐ Moderate	☐ Major	
Installation replaced:	☐ Yes	☒ No	(yyyy) _____ %	
Comment: _____				

ELECTRICAL:

Type:	☒ Conduit	☒ BX	☐ Non-metallic	☐ Knob & Tube _____	☐ Other _____
Temporary wiring or extension cords:	☒ No		☐ Yes _____		
Overcurrent protection:	☒ Circuit Breakers		Fuses:	☐ Ordinary	☐ Type P
Installation defects:	☒ None		☐ Moderate	☐ Major	
Installation (wiring) replaced:	☐ Yes		☒ No	(yyyy) _____ %	
Partial changes/extensions:	☐ Yes _____		☒ No		
Comments: _____					

PLUMBING:

Type:	☒ Copper	☒ Galvanized	☒ Plastic	☐ Other _____
Installation Replaced:	☐ Yes	☒ No	(yyyy) _____ %	
Condition:	☒ Good	☐ Fair	☐ Poor _____	
Installation appears safe:	☒ Yes	☐ No _____		

SMOKING:

Smoking Restricted:	☒ Yes	☐ No		
"No Smoking" Signs posted:	☒ Yes	☐ No	Enforced:	☒ Yes
				☐ No

HOUSEKEEPING:

☐ Good	☒ Average	☐ Poor	☐ Unacceptable
Comments: _____			

9.0 FIRE PROTECTION**PUBLIC:**

F.U.S. Protection Class: 02 Responding Fire Department: Mississauga H.P.A. IICC Protection Grade 6

☒ Full time ☐ Part Time/Volunteer ☐ Composite

Distance to Fire Department: 2.5 km Roads: ☒ Paved ☐ Unpaved Accessible Year-round: ☒ Yes ☐ No

☒ Public Water Supply ☐ Private Water Supply

No. Hydrants: 3 within 155 m, _____ within 156 - 305 m, _____ Over 305 m, ☐ None

PRIVATE:**Are the following adequate?**

	Yes	No	Date Last Serviced	Comments
Portable Extinguishers	☒	☐	<u>Feb. 2002</u>	<u>Adequate as to number and type.</u>
Standpipe/Inside Hoses	☐	☐	N/A ☒	_____
Watchman Service	☐	☐	N/A ☒	_____
Fire Detection System:	☐ None	☒ Full	☐ Partial, Describe: _____	
i) Type of Detectors:	Heat			
ii) Detectors properly located:	☒	☐	Describe: <u>Part of sprinkler system.</u>	

iii) Components listed by: ☒ ULC ☐ UL ☐ Other _____
iv) Maintenance contract: ☒ ☐ Company: Techstar Telephone #: (905) 272-9991
v) Connected to: ☐ ULC Listed Station ☐ Unlisted Service ☒ Fire/Police Department ☐ Local only
☐ Other: _____
Automatic Sprinkler Protection: ☐ None ☒ Full Premises ☐ Partial (describe): _____
☒ Sprinkler Supplement Attached ☐ Yes ☒ No

10.0 ALL RISK :

Information Confirmed by: Shawn

EARTHQUAKE

What is the earthquake zone:	<u>0</u>		
Is there any earthquake history in the area:	☐ Yes	☒ No	☐ Undetermined
If Yes , describe history _____			
Any evidence of the following:			
Significant exterior wall or foundation cracks noted?	☐ Yes	☒ No	Describe: _____
Sagging?	☐ Yes	☒ No	Describe: _____

FLOOD

Is this establishment located on a flood plain:	☐ Yes	☒ No	
Is it located near a body of water:	☐ Yes	☒ No	Describe: _____
Distance to nearest body of water:	_____	☒ None determined	
Is there a history of flooding:	☐ Yes	☒ No	If yes , give history: _____
Evidence of water damage:	☐ Yes	☒ No	Describe: _____
Years knowledge of risk: 1 yrs.			

WATER DAMAGE

Plumbing is: ☒ Copper ☐ Galvanized ☒ Plastic ☐ Other Describe: _____

Is there evidence of corrosion: ☐ Yes ☒ No Describe: _____

Is the building sprinklered: ☒ Yes ☐ No Comment: _____

Is stock susceptible to water damage: ☒ Yes ☐ No Describe: Food products.

Are all window/skylight openings adequately sealed: ☒ Yes ☐ No Describe: _____

Does water main pass under building: ☐ Yes ☒ No

Is the roof covering adequate: ☒ Yes ☐ No Most recent roof repair date, if applicable _____

Inside and/or roof storage tanks/process equipment ☐ Yes ☒ No Describe: _____

Tanks/equipment satisfactorily controlled: ☐ Yes ☐ No Describe: N/A

Is there use of: ☐ skids ☐ Shelving ☐ Floor Drains ☐ Covers over stock/equipment Describe: _____

Sewer Backup claim in the last three years: ☐ Yes ☒ No ☐ Describe: _____

COLLAPSE AND/OR SEWER BACKUP

Is there any history of collapse:	☐ Yes	☒ No	Describe: _____
Is there any history of sewer back-up:	☐ Yes	☒ No	Describe: _____
Are sewer back-up protection devices in place:	☐ Yes	☒ No	Describe: _____

ADDITIONAL PERILS

Is lightning protection in place:	☐ Yes	☒ No	Describe: _____
Is risk located within 5 km of airport:	☐ Yes	☒ No	Beneath a flight path: ☐ Yes ☒ No
Is the yard fenced:	☐ Yes	☒ No	Are gates locked when the premises are closed: ☐ Yes ☒ No
Is the yard and the exterior of the building lit:	☒ Yes ☐ No		
Is the risk located in a high wind/hail area:	☐ Yes	☒ No	Describe: _____
Are there visible signs of vandalism at the risk:	☐ Yes	☒ No	Describe: _____:
In the area:	☐ Yes	☒ No	Describe: _____
Is the risk protected from	Automobile	☒ Yes ☐ No	Describe: <u>Raised curb at front of building.</u>
Impact exposure:	Aircraft	☐ Yes ☒ No	Describe: _____
	Train	☐ Yes ☒ No	Describe: _____
	Boat	☐ Yes ☒ No	Describe: _____
Comments: _____			

11.0 BASIC PREMISES LIABILITY

The following appeared to be satisfactory:

Stairs, Ramps & Handrails:	Yes ☐ No ☐ N/A ☒	Comments: _____
Floor Surfaces & Coverings:	Yes ☒ No ☐ N/A ☐	Comments: <u>No unusual hazards noted.</u>
Walls & Ceilings:	Yes ☒ No ☐ N/A ☐	Comments: _____
Interior & Exterior Lighting:	Yes ☒ No ☐ N/A ☐	Comments: <u>Even and adequate</u>
<u>illumination.</u>		
Emergency Lighting	Yes ☒ No ☐ N/A ☐	Comments: _____
Interior & Exterior Housekeeping:	Yes ☒ No ☐ N/A ☐	Comments: <u>Building clean and well kept.</u>
Washrooms:	Yes ☒ No ☐ N/A ☐	Comments: <u>In good working order.</u>
Sidewalks, Yards & Parking Lots:	Yes ☒ No ☐ N/A ☐	Comments: <u>No deficiencies noted.</u>
Fire Exits:	Yes ☒ No ☐ N/A ☐	Comments: _____
Fire Alarm System (s):	Yes ☒ No ☐ N/A ☐	Comments: _____
Snow & Ice Removal:	Yes ☒ No ☐ N/A ☐	Comments: <u>Contractor</u>
Elevating devices in operation	Yes ☐ No ☐ N/A ☒	Comments: _____
TV Satellite Dishes /Exterior Signs	Yes ☒ No ☐ N/A ☐	Comments: <u>Signs secured well.</u>
CO detectors where required	Yes ☐ No ☐ N/A ☒	Comments: _____
Swimming Pool	Yes ☐ No ☐	Supplement attached
Other	Yes ☐ No ☐	Comments: _____

12.0 BASIC CRIME

☐ Refer to Expanded Crime Supplement

Crime Experience	☐ Low	☒ Moderate	☐ High
Type of Neighbourhood:	☒ Commercial	☐ Industrial	☐ Rural ☒ Residential ☐ Isolated
Neighbourhood appears to be:	☒ Stable	☐ Changing via: ☐ Expansion/growth ☐ Renovation ☐ Deterioration	
Visible malicious damage:	☐ Yes	☒ No	

BUSINESS

Automatic Teller Machine :	☐ Yes	☒ No		
Safe on Premises:	☐ Yes	☒ No	☐ Unable to Determine	
Guard Service:	☐ Yes	☒ No	☐ Unable to Determine	Describe:
Typical Stock:				
Smash & Grab exposure:	☐ Yes	☒ No	☐ Unable to Determine	
Comments:				

GENERAL PROTECTION**The following appeared to be satisfactory:**

Exterior Lighting:	☒ Yes	☐ No	☐ N/A	Comments: Very well lit - automatic lights.
Interior Lighting:	☒ Yes	☐ No	☐ N/A	Comments:
Roof Accessibility:	☒ Yes	☐ No	☐ N/A	Comments:
Police Patrols:	☒ Yes	☐ No	☐ N/A	Comments:
Yard Fenced:	☐ Yes	☐ No	☒ N/A	Describe:

SECURITY ALARM SYSTEM

Premises alarm system in use:	☐ N/A	☒ Yes	☐ No	☐ Disconnected	Date Installed: (yyyy) <u>2001</u>
Monitored by:	☒ ULC Listed Station	☐ Unlisted Station	☐ Local Alarm	☐ Unknown to Contact	☐ Unable to Determine

PHYSICAL PROTECTION

Door locks:	☒ Deadbolt	☐ Spring	☒ Panic	☐ Other	
Windows Protected:	☐ Yes	☐ No	☒ N/A	If yes , describe _____	
Other Openings:	☒ No	☐ Yes	Protected:	☒ No	☐ Yes

OTHER COMMENTS:

Inspection Report - 2002 Thomas Dorman Associates Inc Unit 112 2155 Leanne Blvd Building 'B' (west) Mississauga ON L5K 2K8



Insurers' Advisory Organization Inc.
A subsidiary of Underwriters Adjustment Bureau Ltd.

Confidential

IAO All Risk

(Now available through the IAO Web-site; www.iao.ca)

INSPECTION REPORT

Supplement/s attached: ☐ Yes ☐ No

1.0 BASIC INFORMATION

Insured:		Policy Number	
Date of survey (YYYY/MM/DD):	2002/12/07	IAO Loss Control Specialist:	Samuel Jayapalan
Person Contacted:	Thomas Dorman	Telephone No.	905 855 2111
Position			
Mailing Address if Different for risk:			IAO AIS No.: 11040019
	(unit # street # & name)	(City, Town, Village)	
Location Surveyed:	2155 Leanne Blvd Building 'B' (west)	Mississauga	Ontario (Province)
	(unit # street # & name)	(City, Town, Village)	L5K 2K8 (postal code)
Secondary address (If any)			(Province)
	(unit # street # & name)	(City, Town, Village)	(postal code)
IBC Territory Code	91	IBC Building Code: 5194	SR/MA File No.
Underwriter:		Broker:	

The **IAO Risk•Score** and comments contained in this report are based on conditions and practices observed during our survey and other pertinent data supplied by management personnel at the risk.

Recommendations in this report are made to point out those areas where remedial action could have the beneficial effect of making the above premises safer, and thus more desirable from an underwriting standpoint.

Thank you for choosing IAO to perform this inspection. Please do not hesitate to contact us if we can be of any further assistance.

2.0 IAO Risk•Score

Comments

	1	2	3	4	5	6	7	8	9	
Property	☐	☐	☒	☐	☐	☐	☐	☐	☐	Well kept Building No unusual conditions noted Adequate protection for occupancy class
Liability	☐	☐	☒	☐	☐	☐	☐	☐	☐	
Crime	☐	☐	☒	☐	☐	☐	☐	☐	☐	
(1=Excellent & 9=Poor)										

RISK ALERT ISSUED: ☐ Yes ☒ No If yes, describe (A risk alert is a telephone notification to the Inspection requestor, of a situation which could imminently cause a serious loss. A Critical Recommendation will be issued to address the situation.)

Committed to Service Excellence

IAO reports, prepared in compliance with commonly accepted risk control standards existing at the time services are rendered, are developed from an inspection of the premises and/or from data supplied by or on behalf of the Purchaser. IAO does not purport to list all hazards. While changes and modifications referred to in the reports are designed to upgrade protection and loss prevention of the premises, IAO assumes no responsibility for management and control of these activities. IAO will not be responsible to the Purchaser for any losses or damages, whether consequential or other, however caused, incurred or suffered, as a result of the services being provided.

(All Risk Report – February 25, 2002 R 4)

This document is owned by Opta Information Intelligence Inc. and is subject to copyright protection. Please see the full Terms and Conditions at the front of this document.

SP201FORM

Meaning of the IAO Risk-Score: The IAO Score is a grading of the risk inspected versus other risks in this class. Similar to the "Commercial" Fire Protection Grading system in design, there is range of 9 categories, with a grading or "score" of 1 being the most desirable. The IAO Score is based on a number of objective criteria pertaining to the risk at the time of our survey, tempered with the experienced judgement of our Loss Control Specialist. As a general guideline, the scores mean the following criteria:

1-3	Risks in this range are well maintained, with no apparent moral hazards or management problems. Undesirable features are non-existent and recommendations, if any, are minor. Risks in this category are excellent (no deficiencies) to better than average for their class.
4-6	The maintenance of Risks in this range is considered average. Moral hazards are not apparent, but there may be possible management problems (e.g. poor housekeeping). Undesirable features noted are correctable, and recommendations will vary from desirable to important. Risks in this category are considered average for their class.
7-9	Risks in this range tend to be poorly maintained. Moral hazards and management problems (e.g. poor housekeeping and maintenance, poor attitude) are evident. Significant undesirable conditions are present and cannot or will not be corrected. Critical Recommendations may be present. Risks in this category are significantly below average for their class with little or no indication for improvement.

3.0 REMARKS

Risk is located on Leanne Blvd in the commercial neighborhood of Mississauga. The building appears to be in good condition and seems to receive regular care and maintenance. Insured occupies the building as an office and distributors of orthopedic implants to hospitals. Risk is protected by security alarm with infrared motion detectors and is monitored by ULC listed monitoring station. The standard supply of portable fire extinguishers are serviced and tagged annually. The insured was receptive and interested in loss control.

4.0 RECOMMENDATIONS

Please note that these recommendations are classified as either ☐ **Critical**, ☐ **Important**, or ☐ **Desirable Improvement**. "**Critical**" recommendations are those aimed at correcting undesirable feature/s which, if left unattended, could cause a serious loss and should be rectified immediately. This class of recommendation is only used in extreme situations. "**Important**" recommendations are intended to highlight undesirable feature/s which if left unattended, could cause a serious loss and should be rectified as soon as possible. "**Desirable Improvement**" recommendations are those aimed at correcting an undesirable feature which can be improved when feasible, to help reduce the risk of a loss.

☐ Listed below or ☒ None

☐ Critical	☐ Important	☐ Desirable Improvement

☐ Critical	☐ Important	☐ Desirable Improvement

☐ Critical	☐ Important	☐ Desirable Improvement

5.0 OCCUPANCY INFORMATION (IBC Occupancy Code 5194)

The Insured is

☐ Owner Occupant	☐ Non-occupant building owner	☒ Tenant
Name of building owner(if not Insured):	568911 Ontario Ltd	Number of years bldg. Owned: 15
Number of years at this location:8	Area occupied (sq. m): 151	Business hours: 8 am - 5pm
Days per week: 5 days	Annual Revenue (optional):	Payroll (optional):
Previous loss history past 3 years ☐ Yes ☒ No ☐ Undetermined	Previous loss history past 6 years ☐ Yes ☒ No ☐ Undetermined	
Explain loss history:		
Insured Values: Property: \$		Contents: \$
Combustibility of Occupancy: M3		Susceptibility of Occupancy: S4-Heavy Damage

Occupancy : ☐ Major Tenant OR ☒ Insured IBC Industry Code:5194		or ☐ refer to Occupancy Specific Supplement:
Occupancy Description:Distributor of orthopedic implants and office		
Special Hazard Code(s):	Description:	
Special Hazard Code(s):	Description:	
Other classes of occupants: (immediate exposures)		
Name: Unit 111 to 130 on first floor and 200 -260 on second floor	Area occupied: 3746 sq.m.	IBC Code 6610
Occupancy Description:Offices		
Special Hazard Code(s) :	Description:	
Special Hazard Code(s) :	Description:	
Name: Sheridian Pharmacy Unit 124	Area occupied: 139 Sq.m.	IBC Code 5912
Occupancy Description: Drug store, cosmetics, etc..		
Special Hazard Code(s)	Description:	
Special Hazard Code(s)	Description:	
Areas not surveyed:	☐ For additional tenants see attached list	

6.0 BUILDING CONSTRUCTION (IBC Major Construction Class 2)

Building condition:	☒ Above Average	☐ Average	☐ Moderate deficiencies	☐ Major deficiencies
Year built: (yyyy)		Area occupied by insured (sq. m): 151		Combustibility of Building M3
Ground floor area (sq. m):	2018 sq. m	Total floor area (excl. bsmt.)		4036 sq. m
Height (excluding basement):	4.5 m	Number of Stories: 2 (above grade)		
Basement:	☐ Yes ☒ No	Area of basement: (sq. m)		Total area: 4036 sq. m
Additions (year & brief description):				
Renovations (year & brief description):				
Wall construction:	Reinforced Concrete % ()	Masonry: 100%: (CB)	Non Combustible: %: ()	Brick/stone veneer: %: ()
	Other:	Panels in Walls % Describe:		

Floor Construction:	Concrete: 100 %	Concrete on metal pan: %	Wood joist: %	Other: %
Roof Type:	☒ Flat	☐ Sloped	☐ Peaked	☐ Other
Roof Construction:	☒ Concrete 50%	☒ Steel deck % 50	☐ Wood joist %	☐ Other: %
Roof Surface:	☒ Tar & gravel	☐ Metal	☐ Asphalt shingles	☐ Rubber Membrane
	☐ Wood Shakes	☐ Other		
Resurfaced:	☐ Yes	☒ No	Date:	
Interior Finish Walls:	Combustible: %	Non-combustible: 100 %	Open: %	
Interior Finish Ceilings:	Combustible: %	Non-combustible: 100 %	Open: %	
Vertical Openings:	☐ None	☐ Stairs	☐ Elevator	☐ Deck: ☐ Other
Horizontal Separation:	Major Partition Construction	☐ Not Applicable	☐ Frame	☐ Drywall on Studs
		☐ Concrete Block	☐ Other	
	Proper Opening Protection:	☐ Yes	☐ No	☐ Not Applicable
Mezzanines: ☒ No ☐ Yes	Combustible: %	Non-combustible: %		Open: %
Mezzanines percentage of floor	%			
Combustible Concealed Spaces:	☒ No ☐ Yes	If yes, describe and %		
Concealed space properly protected	☐ No ☐ Yes	☐ Not applicable	Comment:	
Building Description:				
Shopping Mall ☐ Yes ☒ No Industrial Mall ☐ Yes ☒ No Strip Mall: ☐ Yes ☒ No				
Other Describe : 2 storeyed multi-tenanted building				

7.0 EXPOSURES (Within 50m of risk)

	Distance	Height	Construction	Occupancy Hazard	Civic Number (optional)	Opening in Facing Wall	
						Yes	No
Front	<u>Over 30</u> m	____ sto.	Open	None		☐	☒
Rear	<u>Over 30</u> m	____ sto.	Open	None		☐	☒
Left	<u>0</u> m	____ sto.	Blank Masonry	Medium		☐	☒
Right	<u>0</u> m	____ sto.	Blank Masonry	Medium		☐	☒

(For Malls) Describe partition walls between insured and other tenants.

8.0 COMMON HAZARDS (Heating, electrical, plumbing)

HEATING:

Forced warm air:	☐ Electric %	☒ Gas 100%	☐ Oil %	Other _____
Suspended unit heaters:	☐ Electric %	☐ Gas %	☐ Oil %	Other _____
Portable heaters:	☐ Electric %	☐ Gas %	☐ Oil %	Other _____
Electric baseboard units:	☐ %			
Hot water/steam	☐ Electric %	☐ Gas %	☐ Oil %	Other _____
Other	☐ Electric %	☐ Gas %	☐ Oil %	Other _____
Boiler:	☐ Yes ☒ No	Age (yyyy) _____ and Make: _____	Date of last Boiler Inspection: (yyyymmdd) _____	
Appliances enclosed in a non-combustible room:		☒ Yes	☐ No	☐ Not required:
Combustible materials stored in the room:		☐ Yes	☐ No	☐ Not applicable
Fuel tanks:	☒ None ☐ Inside ☐ Outside ☐ Above ground ☐ Below ground	Age (yyyy) _____ Capacity (L)		

Fill and vent piping: Inside		☐ Yes	☐ No	☐ N/A
Chimneys:	☐ Masonry	☐ ULC Factory built	☐ Unlabelled pre-fab	☒ Other <u>Type 'B' gas vent</u>
	☒ Standard	☐ Non-standard _____		
Installation defects:		☒ None	☐ Moderate	☐ Major
Installation replaced:		☐ Yes	☒ No	(yyyy) _____ %
Comment:				

ELECTRICAL:

Type:	☒ Conduit	☒ BX	☐ Non-metallic	☐ Knob & Tube _____	☐ Other _____
Temporary wiring or extension cords:		☒ No	☐ Yes _____		
Overcurrent protection:	☒ Circuit Breakers	Fuses:	☒ Ordinary	☐ Type P	☐ Type D
Installation defects:	☒ None	☐ Moderate	☐ Major		
Installation (wiring) replaced:	☐ Yes	☒ No	(yyyy) _____ %		
Partial changes/extensions:	☐ Yes _____	☒ No			
Comments: _____					

PLUMBING:

Type:	☒ Copper	☐ Galvanized	☐ Plastic	☐ Other _____
Installation Replaced:	☐ Yes	☒ No	(yyyy) _____ %	
Condition:	☒ Good	☐ Fair	☐ Poor _____	
Installation appears safe:	☒ Yes	☐ No _____		

SMOKING:

Smoking Restricted:	☒ Yes	☐ No		
"No Smoking" Signs posted:	☐ Yes	☒ No	Enforced:	☒ Yes ☐ No

HOUSEKEEPING:

☒ Good	☐ Average	☐ Poor	☐ Unacceptable
Comments: _____			

9.0 FIRE PROTECTION**PUBLIC:**

F.U.S. Protection Class: 02 Responding Fire Department: Mississauga IICC Protection Grade

☒ Full time ☐ Part Time/Volunteer ☐ Composite

Distance to Fire Department: 2 km Roads: ☒ Paved ☐ Unpaved Accessible Year-round: ☒ Yes ☐ No

☒ Public Water Supply ☐ Private Water Supply

No. Hydrants: 2 within 155 m, _____ within 156 - 305 m, _____ Over 305 m, ☐ None

PRIVATE:**Are the following adequate?**

	Yes	No	Date Last Serviced	Comments
Portable Extinguishers	☒	☐	<u>Aug 2002</u>	_____
Standpipe/Inside Hoses	☐	☐	N/A ☒	_____
Watchman Service	☐	☐	N/A ☒	_____
Fire Detection System:	☒ None	☐ Full	☐ Partial, Describe: _____	
i) Type of Detectors:				
ii) Detectors properly located:	☐	☐	Describe: _____	
iii) Components listed by:	☐ ULC	☐ UL	☐ Other _____	

iv) Maintenance contract: ☐ ☐ Company: _____ Telephone #: _____
v) Connected to: ☐ ULC Listed Station ☐ Unlisted Service ☐ Fire/Police Department ☐ Local only
☐ Other: _____
Automatic Sprinkler Protection: ☒ None ☐ Full Premises ☐ Partial (describe): _____
☐ Sprinkler Supplement Attached ☐ Yes ☐ No

10.0 ALL RISK :

Information Confirmed by: Thomas Dorman

EARTHQUAKE

What is the earthquake zone:	0		
Is there any earthquake history in the area:	☐ Yes	☒ No	☐ Undetermined
If Yes , describe history _____			
Any evidence of the following:			
Significant exterior wall or foundation cracks noted?	☐ Yes	☒ No	Describe: _____
Sagging?	☐ Yes	☒ No	Describe: _____

FLOOD

Is this establishment located on a flood plain:	☐ Yes	☒ No	
Is it located near a body of water:	☐ Yes	☒ No	Describe: _____
Distance to nearest body of water:	_____	☒ None determined	
Is there a history of flooding:	☐ Yes	☒ No	If yes , give history: _____
Evidence of water damage:	☐ Yes	☒ No	Describe: _____
Years knowledge of risk: 8 yrs.			

WATER DAMAGE

Plumbing is: ☒ Copper ☐ Galvanized ☐ Plastic ☐ Other Describe: _____

Is there evidence of corrosion: ☐ Yes ☒ No Describe: _____

Is the building sprinklered: ☐ Yes ☒ No Comment: _____

Is stock susceptible to water damage: ☐ Yes ☒ No Describe: _____

Are all window/skylight openings adequately sealed: ☒ Yes ☐ No Describe: _____

Does water main pass under building: ☐ Yes ☒ No

Is the roof covering adequate: ☒ Yes ☐ No Most recent roof repair date, if applicable _____

Inside and/or roof storage tanks/process equipment ☐ Yes ☐ No Describe: _____

Tanks/equipment satisfactorily controlled: ☐ Yes ☐ No Describe: _____

Is there use of: ☐ skids ☐ Shelving ☐ Floor Drains ☐ Covers over stock/equipment Describe: _____

Sewer Backup claim in the last three years: ☐ Yes ☒ No ☐ Describe: _____

COLLAPSE AND/OR SEWER BACKUP

Is there any history of collapse:	☐ Yes	☒ No	Describe: _____
Is there any history of sewer back-up:	☐ Yes	☒ No	Describe: _____
Are sewer back-up protection devices in place:	☐ Yes	☒ No	Describe: _____

ADDITIONAL PERILS

Is lightning protection in place:	☒ Yes	☐ No	Describe: _____	
Is risk located within 5 km of airport:	☐ Yes	☒ No	Beneath a flight path:	☐ Yes ☒ No
Is the yard fenced:	☐ Yes	☒ No	Are gates locked when the premises are closed:	☐ Yes ☒ No
Is the yard and the exterior of the building lit:	☒ Yes		☐ No	
Is the risk located in a high wind/hail area:	☐ Yes	☒ No	Describe: _____	
Are there visible signs of vandalism at the risk:	☐ Yes	☒ No	Describe: _____:	
In the area:	☐ Yes	☒ No	Describe: _____	
Is the risk protected from	Automobile	☒ Yes ☐ No	Describe: _____	
Impact exposure:	Aircraft	☐ Yes ☒ No	Describe: _____	
	Train	☐ Yes ☒ No	Describe: _____	
	Boat	☐ Yes ☒ No	Describe: _____	
Comments: _____				

11.0 BASIC PREMISES LIABILITY

The following appeared to be satisfactory:

Stairs, Ramps & Handrails:	Yes ☒ No ☐ N/A ☐	Comments: _____
Floor Surfaces & Coverings:	Yes ☒ No ☐ N/A ☐	Comments: _____
Walls & Ceilings:	Yes ☒ No ☐ N/A ☐	Comments: _____
Interior & Exterior Lighting:	Yes ☒ No ☐ N/A ☐	Comments: _____
Emergency Lighting	Yes ☒ No ☐ N/A ☐	Comments: _____
Interior & Exterior Housekeeping:	Yes ☒ No ☐ N/A ☐	Comments: _____
Washrooms:	Yes ☒ No ☐ N/A ☐	Comments: _____
Sidewalks, Yards & Parking Lots:	Yes ☒ No ☐ N/A ☐	Comments: _____
Fire Exits:	Yes ☒ No ☐ N/A ☐	Comments: _____
Fire Alarm System (s):	Yes ☐ No ☐ N/A ☒	Comments: _____
Snow & Ice Removal:	Yes ☒ No ☐ N/A ☐	Comments: _____
Elevating devices in operation	Yes ☒ No ☐ N/A ☐	Comments: _____
TV Satellite Dishes /Exterior Signs	Yes ☒ No ☐ N/A ☐	Comments: _____
CO detectors where required	Yes ☐ No ☐ N/A ☒	Comments: _____
Swimming Pool	Yes ☐ No ☐	Supplement attached ☐
Other	Yes ☐ No ☐	Comments: _____

12.0 BASIC CRIME

☐ Refer to Expanded Crime Supplement

Crime Experience	☐ Low	☒ Moderate	☐ High		
Type of Neighbourhood:	☒ Commercial	☐ Industrial	☐ Rural	☐ Residential	☐ Isolated
Neighbourhood appears to be:	☒ Stable Changing via:		☐ Expansion/growth	☐ Renovation	☐ Deterioration
Visible malicious damage:	☐ Yes	☒ No			

BUSINESS

Automatic Teller Machine :	☐ Yes	☒ No		
Safe on Premises:	☐ Yes	☒ No	☐ Unable to Determine	
Guard Service:	☐ Yes	☒ No	☐ Unable to Determine	Describe:
Typical Stock:	Value of stock is about \$ 500,000			
Smash & Grab exposure:	☐ Yes	☒ No	☐ Unable to Determine	
Comments:				

GENERAL PROTECTION**The following appeared to be satisfactory:**

Exterior Lighting:	☒ Yes	☐ No	☐ N/A	Comments:
Interior Lighting:	☒ Yes	☐ No	☐ N/A	Comments:
Roof Accessibility:	☐ Yes	☐ No	☒ N/A	Comments:
Police Patrols:	☒ Yes	☐ No	☐ N/A	Comments:
Yard Fenced:	☐ Yes	☐ No	☒ N/A	Describe:

SECURITY ALARM SYSTEM

Premises alarm system in use:	☐ N/A	☒ Yes	☐ No	☐ Disconnected	Date Installed: (yyyy)_____
Monitored by:	☒ ULC Listed Station	☐ Unlisted Station	☐ Local Alarm	☐ Unknown to Contact	☐ Unable to Determine

PHYSICAL PROTECTION

Door locks:	☒ Deadbolt	☒ Spring	☐ Panic	☐ Other	
Windows Protected:	☐ Yes	☒ No	☐ N/A	If yes, describe _____	
Other Openings:	☐ No	☒ Yes	Protected:	☐ No	☒ Yes

OTHER COMMENTS:

Inspection Report - 1984 Konini Management 2155 Leanne Boulevard Mississauga ON L5K2K8

NI

INSURERS' ADVISORY ORGANIZATION
TORONTO

CONFIDENTIAL

For Use of Members Only
Not For General Distribution

INSPECTION REPORT

File No. SR 31800

Plan Filed at IAO

SPECIAL RISKS DIVISION

SPRINKLER PROTECTION IN SERVICE

NAME OF RISK: *KONINE Management*
Mr. Gerda Jaine
~~A.E. LePage~~

LOCATION: 2155 Leanne Boulevard, Mississauga, Ontario

SURVEYED BY: R. Arbitrio

DATE: May 25 and 31, 1984

OCCUPANCY

1. (a) Multi-tenant industrial building.

CONSTRUCTION

2. (a) FIRE DIVISIONS: Single Fire Division
- (b) BUILT IN: 1979
- Repair: Good
- (c) HEIGHT: 2 Sto.(s) = 8.8m (29')
- (d) WALLS: (i) Construction: Concrete block
- (ii) Type: independent, bearing, non bearing, party.
(Other)
- (e) FLOORS: Concrete
- (f) ROOF: (i) Construction: Class II metal deck on exposed steel
- (ii) Roof Surface: Non-combustible (Other)

- (g) SUPPORTING STEEL: Adequately protected in all areas by enclosed plasterboard. The exposed steel beneath the metal deck and first floor has been sprayed with asbestos.
- (h) TOTAL GRADE FLOOR AREA: No information available
Total area: 2786.2 sq. m (29,960 sq. ft.)
Separation Walls: No information available
- (i) VERTICAL OPENINGS: Cut off. Stairways to the second floor are cut off.
Elevators: None Number of elevators: Freight or passenger
- (j) INTERIOR FINISH:
Exterior Walls: No information available
Interior Walls: No information available
Ceilings: No information available
- (k) (i) COMBUSTIBLE CONCEALED SPACES: None
Roof: % Ceiling: %
(ii) NON-COMBUSTIBLE CONCEALED SPACES: Major
(1) There is a 1.2m-1.8m (4'-6') deep unsprinklered ceiling space above the second floor office area and the area on the first floor.
- (l) SMOKE AND HEAT VENTING: Adequate

HAZARDS

3. (a) COMMON HAZARDS:

- (i) Heating: Safe. Heat for the second floor is provided by a low pressure, gas-fired boiler in a cut-off room in the adjoining, unsprinklered commercial building (Building "B"). Heat for the first floor is provided by ceiling suspended gas-fired unit heaters and hot air furnaces mounted on the roof. The cleaners are heated from process heat.

Chimneys and Flues: No information available

- (ii) Air None Type Central, Window
Conditioning: % Air Conditioned.

3(a) Cont'd

(iii) Electrical: Safe Unsafe Circuit breakers Fuses used
Wiring installed not updated in last 30 years 1979
Transformers PCB filled: No. (Other)

(b) SPECIAL HAZARDS: Safe. See "Tenants", Item 9.

(c) RADIOACTIVE MATERIALS: None

(d) HIGH PILING: None

(e) HOUSEKEEPING: Safe

(f) HAZARDOUS MATERIAL: None

→ (g) EXPOSURES:

		Protection Required	Provided
North	None	No	No
South	None	No	No
East	Severe	Yes	Yes

Adjoining a 2 storey concrete block, unsprinklered office building by way of a corridor on the second floor. The two buildings are separated by a 30.5cm (12") concrete block wall and Listed Class "A" fire door.

West	None	No	No

→ (h) ACTIVITY: Moderate Hrs/Day 9 Days/Wk 5

Number of Production Workers: See Tenants
~~No information available~~

(i) MAINTENANCE WELDING: No

(j) SMOKING RESTRICTED: No

(k) ELECTRONIC Data Processing Equipment: yes. See Under Tenants, above

(l) PROCESS DESCRIPTION:

This is a multi-tenant occupancy. See "Tenants", Item 9.

PROTECTION

4. (a) SPRINKLER PROTECTION:

OVERALL GRADING OF SPRINKLERS AND WATER SUPPLIES:

$$100(EF) \times 100/100(RF) \times 100/100(MT) = 100$$

(i) Area Sprinklered (excluding concealed spaces): 100%
100% Wet

- (ii) Date of Sprinklers: 100%: 1979
- (iii) Protection Against Freezing: Yes
Sections shut off in winter: ~~No information available~~ *none*
Sections on cold weather system: ~~No information available~~
Sections subject to freezing
Not adequately protected: No information available
- (iv) (a) Additional Sprinklers Required: No
(b) Unsprinklered Areas Not Requiring Sprinklers: No information available
- (v) Sprinkler Equipment Standard: Yes
- (vi) Alarms: Local alarms consist of inside electric bells and an outside water motor gong. The water pressure, ^{gate} and gate valve are monitored on the annunciator panel located in the electrical room in Building "B" and in the main foyer of Building "B". Building "B" is the adjoining, unsprinklered office building. *The annunciator panel is monitored by Chubb Alarms for trouble and fire (Grading = 15%)*
- (vii) Water Supplies:
- (a) Grading: Standard
- (b) Primary: Municipal - Standard
- (c) Secondary: Provided - None Required - No
- (d) Standard from a single 200mm (8") connection to a 300mm (12") municipal main in Leanne Boulevard. Static pressure 413.7 kPa (60 p.s.i.) ~~no residual pressure taken at the time of this survey.~~ *65-60* *8273* *914* *462* *2177 at 60 67*
- The hydraulically designed sprinkler system requires 3610 L/min (950 U.S. g.p.m.) at 338.1 kPa (49 p.s.i.) for a minimum density of 7.7 mm/min (0.19 U.S. g.p.m./sq. ft.) over 176.7 sq. m (1,900 sq. ft.) and 1330 L/min (350 U.S. g.p.m.) for hoses with low temperature rated sprinklers. A water flow test in February 1979 at Erin Mills Parkway and Fowler Drive indicates 3610 L/min (950 U.S. g.p.m.) is available at 393.3 kPa (57 p.s.i.).
- (viii) Additional System details: No
- Fire Department Pumper Connection: Yes

4. (b) OTHER PROTECTION

- (i) Extinguishers: Standard
- (ii) Standpipes and Hose: None

- (iii) Watchman Service: Non-Standard. A watchman is on duty from 4 p.m. to 12 a.m. on weekdays and from 12 p.m. to 8 p.m. during the weekends and does informal checks of the grounds.

Forced tour system: No

- (iv) Special Equipment and Apparatus: None

4. (c) OUTSIDE PROTECTION

- (i) Hydrants: Public: Standard

Private: Standard

Flushed: No

- (ii) Fire Dept. Public: Paid Distance to Fire Hall 3.2 km (2 miles)

Private: No

F.U.S. Classification of Municipality: No information available

- (iii) Accessibility:

To Property: Good

Into Building: Good

EXTENDED COVERAGE

5. (a) WINDSTORM: Unusual Hazards: No

- (b) LIGHTNING: Unusual Features: No

- (c) EXPLOSION: Unusual Features: No

- (d) SPRINKLER LEAKAGE: Stock Skidded or Shelved: Yes

Stock Susceptible to Large Water Damage:
No information available

Floors Drained: No

- (e) RIOT, VANDALISM, MALICIOUS ACTS:

Access restricted: No

Guard Supervised: No

Yards Fenced: No information available

Yards Lit: Yes

Remote from populated areas: No

- (f) EARTHQUAKE - Zone: No information available

- (g) IMPACT HAZARDS - by aircraft: No information available
- by road vehicles: No information available
 - by trains: No information available
 - by floating vessels: No information available
- (h) FLOOD HAZARDS: No information available
- (i) SMOKE - Susceptibility of Stock to Smoke Damage: No information available
- (j) COLLAPSE - Susceptibility to Collapse: No information available

6.

BUSINESS INTERRUPTION

- (a) Seasonal: No
- (b) Operation: 9 Hrs/Day 5 Days/Wk.
- (c) Interdependency: No
- (e) Computerized Programming: No
- (f) Single Train Production: No
- (g) Vital Machinery Custom Made: No
- (h) Private Power Generation: No
- Alternative Power Source: No
- (i) Production Dependent on Pollution Control Equipment: No
- (j) Other Important Features: No

7.

UNDESIRABLE FEATURES

Prominent: Local alarms only (Recommendation made).

Other: None.

8.

MANAGEMENT - LOSS PREVENTION PROGRAMMES

CONTROL REQUIRED: CONTROL EXERCISED:

- (a) Basic Fire Protection: No Satisfactory

(b) Self-inspection:	No	Satisfactory
(c) Maintenance of Fire Protection Equipment:	No	Satisfactory
(d) Pre-emergency Planning:	No	Satisfactory
(e) Plant Security:	No	Satisfactory
(f) Private Fire Brigade:	No	Satisfactory
(g) Smoking Regulations:	No	Satisfactory
(h) Welding, Cutting & Grinding:	No	Satisfactory
(i) Impairment Notification:	No	Satisfactory
(j) Preventive Maintenance:	No	Satisfactory

Comments: No information available

Siteplan Report - 1997 Ralph Dennis Delorne 2155 Leanne Boulevard Mississauga ON L5K2K8

PRECISE COMMERCIAL RISK ASSESSMENT Report - 2026

2155 Leanne Boulevard Mississauga ON L5K2K8




Company	Klick Insurance Underwriters Ltd
Policyholder	2826835 Ontario Inc O/A 241 Pizza
Address of Location	2155 Leanne Boulevard, Unit 3, Mississauga ON L5K 2K8
Policy Number	
Inspection Number	4187889
Date of Visit	January 21, 2026

RISK SUMMARY

Insured type	Tenant	Industry code	5814-00
Total bldg. area (sq.m/sq.f)	7,255.40 / 78,096	% of area occ. by Insured	1
% of area occ. by Tenant(s)	99	% Vacant	0
Construction Class	2 - Masonry non-combustible		
FUS Grade	1	Hydrants 150m	6
Adjusted FUS Grade	No	Firehall distance (km)	2.075
Rating	ACCEPTABLE RISK WITH IMPORTANT DEFICIENCIES		

RECOMMENDATION SUMMARY

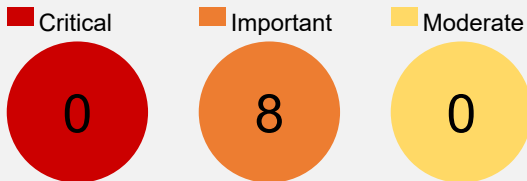

SUPPLEMENT SUMMARY

- Commercial cooking

Occupant: 2826835 Ontario Inc O/A 241 Pizza	3
Claims History	3
Recommendations	4
Primary Building Structure	7
Fire Underwriters Survey	10
Exposures	13
Liability	14
Commercial Cooking Supplement: 2826835 Ontario Inc O/A 241 Pizza	15
Photos	17

Statement of Purpose

The objective of this underwriting report which may include additional underwriting reports based on exposures identified and/or building evaluation is to provide insurance pricing and underwriting information about the described property and dwelling. It is based on a non-invasive, visual inspection of the property, conditions, practices observed at time of inspection and/or information supplied by the insured or insured's representative, using commonly accepted risk control standards, and/or in accordance with the underwriting requirements of the insurer. This report is intended to be used solely for underwriting purposes.

This report does not purport to list all conditions or hazards or imply that other exposures do not exist. It does not guarantee compliance with any standards, federal, provincial or municipal codes, ordinances or by-laws. No warranty of safety or function is implied.

If recommendations are included in this report, they are based on apparent and obvious conditions found at time of inspection and are provided in the interest of loss or injury prevention, to enhance safety and/or improve protection. Opta Precise Services LP does not represent that the implementation of any measures will necessarily eliminate the risk of loss, injury or exposure and does not assume any responsibility or legal liability for the outcomes directly relating to or arising from compliance of recommendations.

© Opta Precise Services LP

Occupant: 2826835 Ontario Inc O/A 241 Pizza

Occupancy type	Tenant

Major occupant	No

Occupant/business name	2826835 Ontario Inc O/A 241 Pizza

Description of occupant/business/building

2826835 Ontario Inc O/A 241 Pizza has been the tenant in this two-storey commercial building in Mississauga, ON, since 2021. The inspection was scheduled and conducted with the co-owner Sunil Bhavsar.

Insured business is a take-out unlicensed fast-food restaurant with two full-time employees, with an inventory of \$4,000 CAD. The menu includes traditional and specialty pizzas, chicken wings, and sides, with prices ranging from \$11.99 for a small build-your-own pizza to \$24.99 for a party-size option. With a monthly rent of \$2,900 CAD, excluding the utilities. The business operates from 11:00 AM to 10:00 PM Sunday through Thursday, with extended hours until 12:00 AM on Friday and Saturday.

Insured risk is provided with two means of egress; one providing access to the front area and commercial kitchen and one rear fire exit door. The customer area is separated by a cash register counter from the kitchen area. The cooking appliance are located to the rear and a corridor provides access to the rear food preparation area with stations and walk-in refrigeration systems. A common corridor with another tenant provides access to a rear fire exit door.

Square footage occupied	610

Occupant industry code	5814-00

Occupant industry description	Restaurants - take out meal service

Combustibility code	M3

Susceptibility code	S4

Occupant - Applicable Special Hazards	Yes

Cooking

- 5.11 Limited commercial cooking - limited protection

☐ Please see the Commercial Cooking supplement.

Claims History

Any claims/losses in past 5 years	No

Recommendations

Company	Klick Insurance Underwriters Ltd
Agent/Broker	
Policyholder	2826835 Ontario Inc O/A 241 Pizza
Address of Location	2155 Leanne Boulevard, Unit 3, Mississauga ON L5K 2K8
Policy Number	KFR339121921
Inspection Number	4187889
Date of Visit	January 21 ,2026


RECOMMENDATION SEVERITY DEFINITIONS:

CRITICAL: Hazard(s) or condition(s) which may cause significant financial loss or injury. Condition(s) identified may point to severe deterioration of a building component or critical non-compliance to codes, standards or best practices requiring immediate correction or replacement by a professional.

IMPORTANT: Hazard(s) or condition(s) that requires action or improvement in order to minimize the potential of financial loss or injury. Condition(s) identified may point to considerable deterioration of a building component or minor non-compliance to codes, standards or best practices which may or may not necessarily require correction or replacement by a professional.

MODERATE: Hazard(s) or condition(s) which may cause marginal financial loss or injury. Condition(s) identified may point to minor deterioration of a building component or minimal non-compliance to codes, standards or best practices requiring correction or replacement over a protracted time frame not necessarily requiring the services of a professional.

RECOMMENDATIONS

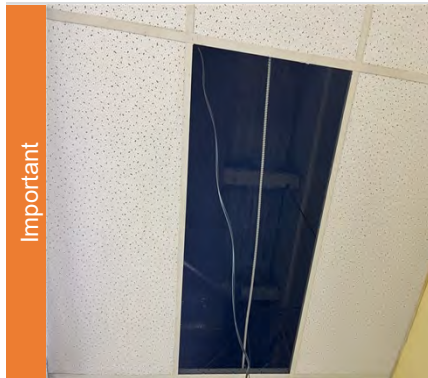

COM-BUILDING CONSTRUCTION - Missing ceiling tiles

Missing ceiling tiles were noted in multiple areas. Missing ceiling tiles could lead to fire spreading into a combustible space that is inaccessible to firefighters. Additionally, missing ceiling tiles may lead to compromised structural steel, which could be weakened by heat leading to a possible building collapse. To prevent the spread of smoke and fire, we recommend that all missing ceiling tiles be installed.

Important



COM-COMMERCIAL COOKING - No exhaust system tag

There is no tag on the exhaust system indicating when the last professional cleaning was performed. Accumulation of residues in and around cooking equipment is a fire hazard which may lead to significant losses. The entire exhaust system, including grease extractors, should be inspected at intervals of not greater than 7 days to determine if grease or other residues have been deposited within. When grease or other residues are evident as deposits within the hood, grease removal devices, or ducts, the system should be cleaned. Exhaust systems should be professionally cleaned at intervals not greater than 12 months. However, in cases of deep fat cooking, char broiling, or similar cooking operations, the systems should be cleaned at intervals not greater than 6 months. Records of tests and a schedule of future testing should be maintained in the kitchen office.

Important



COM-COMMERCIAL COOKING - Cooking appliances grease accumulation

The pizza oven were showing signs of significant grease build-up. Accumulations of grease deposits may increase the risk of a fire. Grease removal devices, fume hoods, fans, ducts and other appurtenances should be cleaned to bare metal at frequent intervals prior to surfaces becoming heavily contaminated with grease or oily sludge. To reduce grease accumulation and the potential for a fire and allow the fire system to function properly, we recommend that improvements be made to the cleaning schedule.

Important



COM-COMMERCIAL COOKING - Staff cleaning grease trap

At the time of inspection, it appeared that the staff was cleaning the grease trap. A grease trap/interceptor must be examined and cleaned at least once every 90 consecutive days; or when the total thickness of fats, oils and grease, and solids in the grease interceptor is equal to 25% or more of the wastewater depth. Due to the complexity of cleaning, examination, and inspection of the trap/interceptor, expertise or repair of replacement of parts, and the requirements for maintaining the requisite maintenance log, we strongly recommend that a professional be contracted to provide the service.

Important



COM-ELECTRICAL - Electrical extension cords used for permanent connections

Temporary electrical cords are being used as permanent electrical connections was noted in the commercial kitchen. Electrical cords are not rated for such use and amperage ratings of electrical cords are typically not known by persons using them. This presents a fire and shock hazard. To reduce the potential for losses, we recommend that the temporary cords be removed and permanent outlets be installed in the areas where additional power is needed.


Important



COM-ELECTRICAL - Loose wiring

Branch wiring were not properly secured in above the ceiling and in overall electrical wiring. Loose wires can cause connections to work loose, create a short circuit and possibly cause a fire. In order to ensure that the installed system is adequate and free of any potential electrical hazards, we recommend that a licensed electrician be retained to inspect and review the electrical system and electrical equipment. The system should be inspected to ensure that there are no major faults, weak points or loose connections and any necessary replacements/upgrades be made by a certified electrician to meet the safety requirements of the Code.

Important

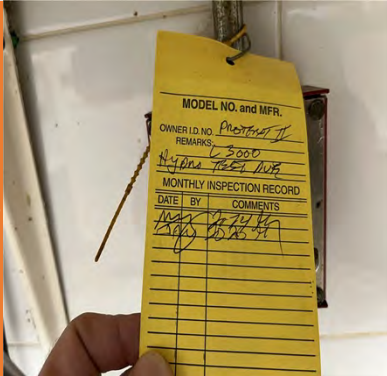

COM-PORTABLE FIRE EXTINGUISHERS - No hydrostatic testing

The fixed fire suppression system lacked adequate hydrostatic testing. The lack of hydrostatic testing may result in the system not adequately operating in the event of a fire. In order to ensure that the system will operate as designed, we recommend that hydrostatic testing be completed. All hydrostatic tests should be completed by certified professionals under strict guidelines with inspections occurring (at minimum) every 5 years.

Important



COM-LIFE SAFETY - Exit signs are not lit

Rear emergency exit sign was not lit which could lead to occupants being unable to locate an exit in an emergency. Emergency exit signage is especially important when smoky conditions exist and visibility is limited (ex. in a fire) as they will direct persons towards determined emergency routes. To ensure life safety and safe egress, we recommend that all emergency exit signs be continuously illuminated and inspected on a regular basis to ensure operation.

Primary Building Structure

Building number / name 2155 Leanne Boulevard, Unit 3 Mississauga, ON

Building Construction

IBC building construction class 2 - Masonry non-combustible

Year built 1980 Estimated

Additions / Renovations known Yes

☐ Details

The building has had renovation and cosmetic updates including repainting wall finishes and ceilings, updating flooring, adding or removing partition walls, and installing kitchen equipment where required. The work was conducted by the insured in 2021 utilizing contractors approved by building owner.

Storeys above grade 2.0

Average height per floor (Feet) 11 Feet

Average height per floor (Meters) 3 Meters

Ground floor square footage 55,064

Total square footage excluding basement 78,096

Basement No

Total square footage including basement 78,096

Ground floor square meters 5,115.65

Total square meters excluding basement 7,255.40

Total square meters including basement 7,255.40

Mezzanine No

Foundation type Reinforced concrete

☐ Reinforced concrete 100%

Wall construction Masonry

☐ Masonry 100%

Floor construction Concrete on metal pan, Concrete slab-on-grade

☐ Concrete slab-on-grade 70%

☐ Concrete on metal pan 30%

Roof construction Steel deck

☐ Steel deck 100%

Roof type Flat

☐ Flat 100%

Roof surface Torch-on

☐ Torch-on 100%

Has roof been resurfaced Yes

Roof last replaced Estimated, full replacement

Year roof resurfaced 2009

SECTION REMARKS

The roof is fully resurfaced by the building owner.

Mechanicals

HVAC

Heating installed in the building Yes

☐ Heating type Rooftop HV

Heating Type	%	Predominant Fuel Source
☐ Rooftop HV	100%	Natural gas

Air Conditioning

Any air conditioning Yes

Air conditioning Rooftop AC

☐ Rooftop AC 100%

HVAC Updates None

SECTION REMARKS

The owner of the plaza is responsible for the maintenance of the HVAC system through licenced contractors.

Electrical

Electrical installed in the building Yes

☐ Overcurrent protection Breaker, GFCI

☐ Wiring type BX, Non-metallic

☐ Electrical Updates Partial

SECTION REMARKS

Based on visual observations, a portion of the electrical system appears to be original with updates conducted approximately 35 years ago and additional updates conducted by the insured in 2021.

The insured is responsible for maintenance of the unit's electrical system through licenced electricians.

Temporary electrical cords are being used as permanent electrical connections was noted in commercial kitchen area.

Plumbing

☐ Plumbing installed in the building Yes

☐ Supply/waste line type Copper, Plastic

☐ Water supply Public

☐ Waste water connection Public

☐ Plumbing updates Partial

☐ Hot water tank Yes

☐ Total number of hot water tanks 1

☐ Total number of hot water tanks viewed 1

☐ Any tanks in excess of 10 years old	No

SECTION REMARKS

The plumbing system was partially upgraded in 2021 with replacement of PVC piping beneath sinks and replacement of the steel-braided supply hose in the staff washroom. The work was completed by the insured. Based on visual observations, the remaining plumbing components appear to be original. Per site contact, the hot water tank was installed by the insured in 2023. Access to the tank was unavailable due to the tank's installation location above the ceiling.

The insured is responsible for maintenance of the plumbing system through licensed plumbers.

Private Protection

☐ Sprinkler protection	Yes
☐ Serviced annually	Unknown (building owner responsible)
☐ Percentage of building sprinklered	100
☐ Standpipes/inside hoses	Yes
☐ Serviced annually	Unknown (building owner responsible)
☐ Fire alarm system	Yes
☐ Fire alarm coverage	Full
☐ Serviced annually	Unknown (building owner responsible)
☐ Fire extinguishers	Yes
☐ Serviced annually	No
☐ Intrusion alarm	No
☐ Local alarm	Fire, Sprinklers
☐ Video surveillance cameras	Yes
☐ Interior installation	Yes
☐ Exterior installation	No
☐ Is re-recording cycle time known	Yes
☐ Recording media	Hard drive

Video surveillance comments

The surveillance cameras have footage retained for 30 days.

SECTION REMARKS

Fire extinguishers were provided throughout the unit and were last serviced in January 2026 by Atlantic Fire & Safety.


Sprinklers are installed throughout the unit and likely the entire building; however, they were not tested at time of survey and are maintained by the building owner/landlord. The sprinkler riser was not accessible through the Insured's unit and no further information was obtained. WARNING: Unless the Supplement for the Automatic Sprinkler Systems is ordered, Precise Services cannot ensure that the system design(s) is in compliance with NFPA 13 - Standard for the Installation of Sprinkler Systems, and that the system is adequate for the protection of the risk.

Fire Underwriters Survey

Fire protection area	Mississauga
Responding firehall	Erindale - F.S. #107
Responding firehall road distance (km)	2.075
Firehall address	1963 Dundas St W, Mississauga, ON
Pumper flow credited per fire station (minimum) (imperial gal/min)	1,500
Water tanker capacity on trucks credited per fire station (minimum) (imperial gal)	800
Career firefighters credited per firehall (24/7)	4
Non career firefighters credited per firehall	0
Number of recognized public hydrants within (150 meters)	6
Number of recognized private hydrants within (150 meters)	2
Public fire protection classification (PFPC)	1
Risk SCOR	1
Territory code	91
Has FUS grade been adjusted	No
FUS message	

Although FUS indicates that there are 2 private hydrants within 150m, they are not the responsibility of the insured to maintain and service.

FUS map

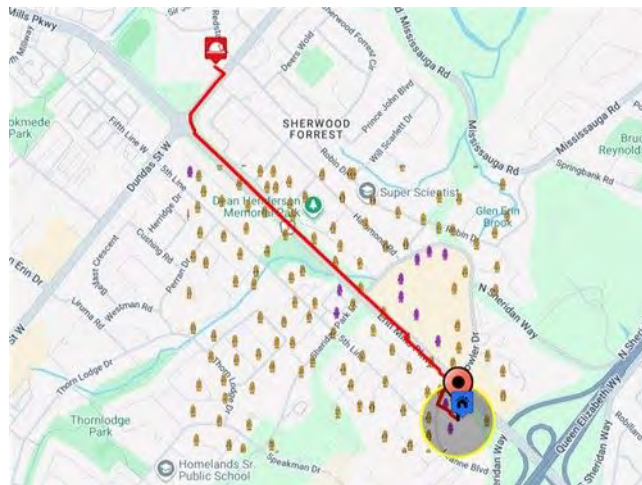

WILDFIRE GRADING INDEX

WILDFIRE RISK CLASS	LOW
HAZARD ZONE	NIL
	Level 1
WUI ZONE	1
	Zone 1
WILDFIRES IN AREA FREQUENCY	LOW
WILDFIRES IN AREA SEVERITY	LOW
FIRE REGIME	Mixedwood Plains-64
SLOPE	LOW
	East
FIRE DENSITY	0.007773

DEFINITIONS:

Wildfire Risk Class: A high/low relativity of wildfire risk at the specific location considering the severity of wildfire hazard, exposure to vegetative fuels and other factors.

Hazard Zone: The area/zone of a potentially damaging physical event, phenomenon, or human activity that could cause the loss of life or injury, property damage, social and economic disruption, or environmental degradation.

WUI Zones: Wildland Urban Interface – The severity of exposure to ignition processes from vegetation fuels in area determined using 3 levels of vegetation fuel exposure and associated ignition processes to a Value at Risk (0-30m radiant heat exposure; 0-100m short range ember exposure; and 100-500m long range ember exposure).

Wildfires in Area Frequency: Relative rating (Low, Medium, High, or Extreme) of the frequency of significant wildfires (wildfires with burned area over 50ha) within a 30 km radius of analysis point, over the most recent complete 30-year reference period.

Wildfires in Area Severity: Relative rating (Low, Medium, High or Extreme) of the severity of wildfires in terms of total burned area of significant wildfires (wildfires with burned area over 50ha) within a 30 km radius of analysis point, over the most recent complete 30-year reference period.

Fire Regime: The kind of fire activity or pattern of fires that generally characterize a given area. Some important elements of the characteristic pattern include fire cycle or fire interval, fire season, and the number, type, and intensity of fires.

Slope: Slope identifies the steepest downhill descent from the point. The lower the slope value, the flatter the terrain; the higher the slope value, the steeper the terrain.

Fire Density: A standardized relative measure of frequency of significant wildfires (defined as having a burned area greater than 50 ha) per unit area (1000 sq.km), per year for each delineated Homogenous Fire Regime Zone.

Exposures

Front building exposure(s) under 45.72 meters (150 feet)	No
Left building exposure(s) under 45.72 meters (150 feet)	Yes
☐ Distance (feet)	138
☐ Distance (meters)	42.1
☐ Construction of facing wall	Masonry
☐ Number of storeys	1.0
☐ Occupancy	Residential Dwelling
Right building exposure(s) under 45.72 meters (150 feet)	Yes
☐ Distance (feet)	100.0
☐ Distance (meters)	30.5
☐ Construction of facing wall	Masonry
☐ Number of storeys	1.0
☐ Occupancy	Commercial, Esso Gas Bar
Rear building exposure(s) under 45.72 meters (150 feet)	No

SECTION REMARKS

There are other tenants in the plaza, and Thai Cuisine Experts to the left and Gents Custom Wear to the right are the immediate exposures to the insured risk. No access was gained to the other commercial units in the building

Liability

Trip/slip and fall hazards	No
Stair/ramp hazards	N/A
Handrail/guardrail hazards	N/A
Parking area hazards	No
Snow and ice hazards	No
Smoking	Restricted
Housekeeping issues noted	Yes

☐ Details

The rear fire exit which is shared with other tenants was obstructed with the storage of materials.

Commercial Cooking Supplement: 2826835 Ontario Inc O/A 241 Pizza

Type of business	Takeout/Restaurant
Number of years in operation	4
Number of years at this location	4

Kitchen

Floor finishing	Tile
Wall finishing	Tile
Ceiling finishing	Acoustic ceiling tile
Finishing of walls adjacent or behind cooking appliances	Non-combustible

Cooking Appliances

Cooking appliance	Quantity	Automatic shut-off
Pizza oven - Natural Gas	1	Yes
Microwave - Electric	1	No

Grease trap installed	Yes
☐ Maintained	Yes
☐ By who	Staff
☐ Maintenance log posted	No
Any housekeeping issues noted	Yes

SECTION REMARKS

At the time of inspection, it appeared that the staff was cleaning the grease trap.

The pizza oven were showing signs of significant grease build-up.

Exhaust System

Is there an exhaust system	Yes
☐ Stainless steel hoods	Yes
☐ Filtering system	Baffle filters
☐ Exhaust ducts	Discharges outside through non-combustible material
☐ Any exhaust ducts extend over 20 feet	No
☐ Any cleanliness issues	No
☐ Last professional service/cleaning date known	No
☐ Any in-house cleaning procedures	No

Fire Extinguishing

Is there a fixed fire extinguishing system	Yes
Number of fire extinguishing systems	1

System 1 – Type	Wet chemical
☐ Manufacturer	ProTexII
☐ Model	L3000
☐ Is the system ULC1254.6/UL300 compliant	Yes
☐ Fire extinguishing system protects	Cooking appliances, Exhaust ducts, Exhaust hood
☐ Last professional service/cleaning date known	Yes
☐ Last professional service date	Jan 19, 2026
☐ Next professional service due	Jul 19, 2026
☐ Service company	Atlantic Fire & Safety
☐ Is there a type K extinguisher	Yes
☐ Serviced annually	Yes

SECTION REMARKS

The Type K Fire Extinguisher was last serviced by Atlantic Fire & Safety in January 2026.

The fixed fire suppression system was due for hydrostatic testing.

Refrigeration

Is there refrigeration equipment	Yes
☐ Number of refrigerators	3
☐ Number of freezers	1
☐ Number of walk-in coolers	1
☐ Dimensions	9' * 5'
☐ Number of walk-in freezers	0
☐ Light bulbs adequately protected from impact	Yes
☐ Does the refrigeration equipment appear adequate	Yes

Product Liability

Does the food preparation appear adequate	Yes
Is the food storage adequate	Yes
Is there a commercial dishwasher	Yes
Are pest reduction strategies in place	Yes
Are take-out services offered	Yes

SECTION REMARKS

West Lincoln Pest Management is hired by the insured for the monthly pest reduction control.

Photos



Front



Front Left



Front Left



Left



Front Right



Front Right



Rear Left



Rear Left



rear



Front Entrance



Front Area



Front Area



Gate to Kitchen



Cash Register Counter



Pizza Oven




Pizza Oven



Commercial Hood



Commercial Hood

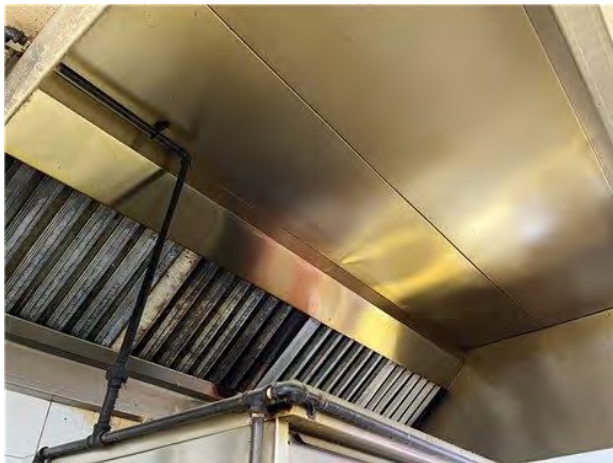

Commercial Hood




Fixed Fire Suppression System



Manual Pull Station



Manual Pull Station Tag

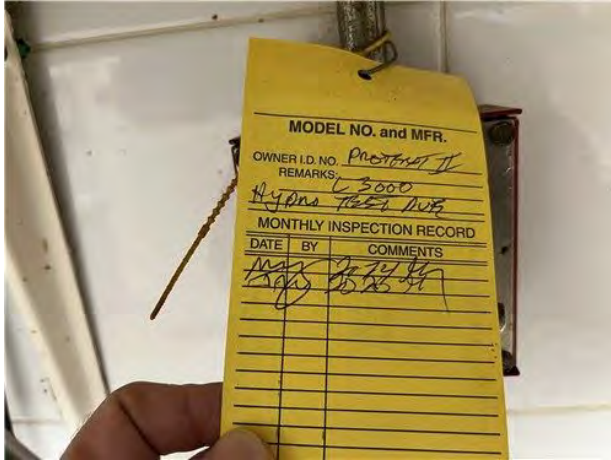

Manual Pull Station Tag



Type K Extinguisher



Type K Extinguisher Tag



Grease Trap



Corridor to Rear Kitchen



Rear Kitchen Area



Rear Prep Station



Rear Kitchen Area



Walk-In Cooler



Chest Freezer



Commercial Sink



Dough Mixer



Staff Washroom




Rear Fire Exit Corridor



Rear Fire Exit Door



Electrical

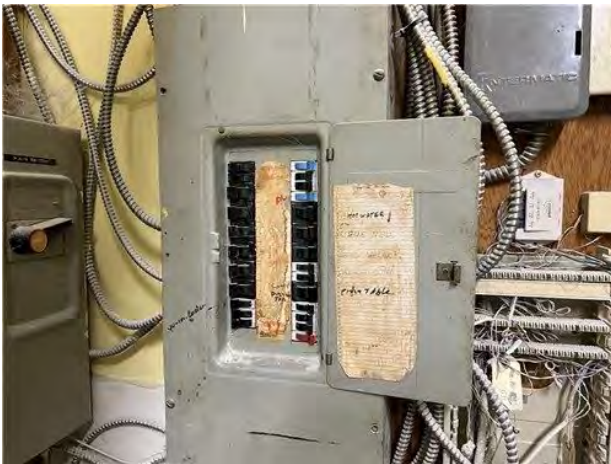

Electrical Panel



Plumbing



Hot Water Tank



Manual Pull Station



Fire Bell



Sprinkler Head



Emergency Exit Signage



Emergency Lighting



Fire Extinguisher



Fire Extinguisher Tag



Fire Extinguisher Tag



Surveillance Camera

Office

175 Commerce Valley Drive W
Markham, Ontario L3T 7Z3

1.877.244.9437

optaintel.ca



Verisk.com

©Verisk Analytics Inc. All rights reserved.

CONFIDENTIAL

**Regulatory Correspondence – Ontario Ministry of
Environment, Conservation and Parks**
*(The MECP online web portal for FOI requests was not
available / responsive at the time of preparing this report.)*


Regulatory Correspondence – Technical Standards & Safety Authority

From: [Public Information Services](#)
To: [Hasan Rahman \(OHE Consultants\)](#)
Subject: RE: Tank Record Search (OHE 31865)
Date: March 9, 2026 10:06:12 AM
Attachments: [~WRD0003.jpg](#)
[image001.png](#)
[image004.png](#)
[image005.png](#)
[image006.png](#)
[image007.png](#)
[image008.png](#)
[image009.png](#)

Hello ,

RECORD FOUND IN CURRENT DATABASE:

- We confirm that there are **fuels records** in our database at the subject address(es).

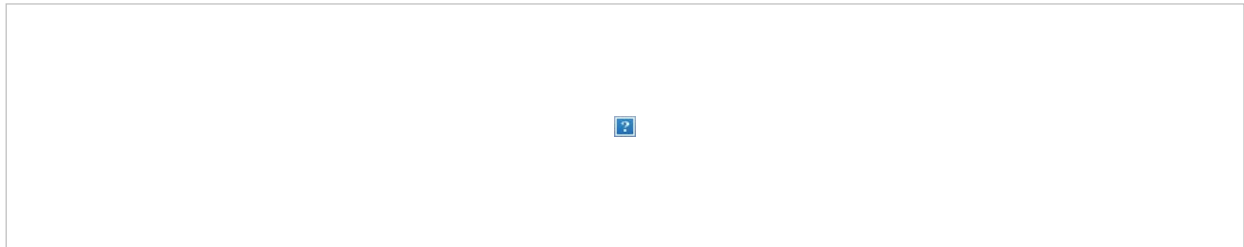

***NO OTHER RECORDS FOUND IN CURRENT DATABASE FOR THIS REQUEST**

For a further search in our archives, please go to the [TSSA Client Portal](#) to complete an Application for Release of Public Information. Please refer to [Training \(tssa.org\)](#) for instructions on how to use the portal. Please refer to [How to Submit a Public Information Request \(tssa.org\)](#) for instructions.

The associated fee must be paid via credit card (Visa or MasterCard).

Once all steps have been successfully completed you will receive your payment receipt via email.

TSSA does not make any representations or warranties with respect to the accuracy or completeness of any records released. The requestor assumes all risk in using or relying on the information provided.

If you have any questions or concerns, please do not hesitate to contact our Public Information Release team at publicinformation@tssa.org.

Kind regards,



Slavka Zahrebelny | Public Information & Records Agent
Public Information
345 Carlingview Drive
Toronto, Ontario M9W 6N9
Tel: +1 416-734-3585 | Fax: +1 416-734-6242 | E-Mail: szahrebelny@tssa.org
www.tssa.org




Winner of 2025 5-Star Safety Cultures Award

From: Hasan Rahman (OHE Consultants) <HRahman@oheconsultants.com>
Sent: March 6, 2026 4:29 PM
To: Public Information Services <publicinformation@tssa.org>
Cc: Sam Miralai (OHE Consultants) <SMiralai@oheconsultants.com>; Aleena Tahir <ATahir@tssa.org>
Subject: Tank Record Search (OHE 31865)

 [External Email >](#)

[⚠ CAUTION]: THIS EMAIL ORIGINATED OUTSIDE THE ORGANISATION.
DO NOT CLICK LINKS OR OPEN ATTACHMENTS UNLESS YOU KNOW THE SENDER AND ARE EXPECTING THIS EMAIL. PLEASE REPORT WITH THE PHISH REPORT BUTTON IF SUSPICIONS.

Hello TSSA,

Could you please conduct a tank record search for the following adjacent / adjoining properties:

- 2155 Leanne Boulevard, Mississauga
- 2065 Leanne Boulevard, Mississauga
- 2185 Leanne Boulevard, Mississauga
- 2165 Leanne Boulevard, Mississauga
- 1900 Erin Mills Parkway, Mississauga
- 1910 Erin Mills Parkway, Mississauga
- 1930 Erin Mills Parkway, Mississauga
- 2055 Fowler Court, Mississauga
- 2076 Leanne Boulevard, Mississauga
- 2147 Leanne Boulevard, Mississauga

Thank you,

Hasan Rahman, B.Eng., EIT
Senior Project Specialist
(905) 890-9000 Ext. 236
(647) 537-8765
hrahman@oheconsultants.com

||

This electronic message and any attached documents are intended only for the named recipients. This communication from the Technical Standards and Safety Authority may contain information that is privileged, confidential or otherwise protected from disclosure and it must not be disclosed, copied, forwarded or distributed without authorization. If you have received this message in error, please notify the sender immediately and delete the original message.

EcoLog ERIS Report



DATABASE REPORT

Project Property:	<i>2155 Leanne Blvd, Mississauga 2155 Leanne Boulevard Mississauga ON L5K 2K8</i>
Project No:	<i>31865</i>
Report Type:	<i>Standard Report</i>
Order No:	<i>26022500296</i>
Requested by:	<i>OHE Consultants</i>
Date Completed:	<i>February 27, 2026</i>

Environmental Risk Information Services

A division of Glacier Media Inc.

1.866.517.5204 | info@erisinfo.com | erisinfo.com

Table of Contents

Table of Contents.....	2
Executive Summary.....	3
Executive Summary: Report Summary.....	4
Executive Summary: Site Report Summary - Project Property.....	7
Executive Summary: Site Report Summary - Surrounding Properties.....	12
Executive Summary: Summary By Data Source.....	23
Map.....	41
Aerial.....	42
Topographic Map.....	43
Detail Report.....	44
Unplottable Summary.....	207
Unplottable Report.....	209
Appendix: Database Descriptions.....	220
Definitions.....	231

Notice: IMPORTANT LIMITATIONS and YOUR LIABILITY

Reliance on information in Report: This report DOES NOT replace a full Phase I Environmental Site Assessment but is solely intended to be used as a database review of environmental records.

License for use of information in Report: No page of this report can be used without this cover page, this notice and the project property identifier. The information in Report(s) may not be modified or re-sold.

Your Liability for misuse: Using this Service and/or its reports in a manner contrary to this Notice or your agreement will be in breach of copyright and contract and ERIS may obtain damages for such mis-use, including damages caused to third parties, and gives ERIS the right to terminate your account, rescind your license to any previous reports and to bar you from future use of the Service.

No warranty of Accuracy or Liability for ERIS: The information contained in this report has been produced by ERIS Information Limited Partnership ("ERIS") using various sources of information, including information provided by Federal and Provincial government departments. The report applies only to the address and up to the date specified on the cover of this report, and any alterations or deviation from this description will require a new report. This report and the data contained herein does not purport to be and does not constitute a guarantee of the accuracy of the information contained herein and does not constitute a legal opinion nor medical advice. Although ERIS has endeavored to present you with information that is accurate, ERIS disclaims, any and all liability for any errors, omissions, or inaccuracies in such information and data, whether attributable to inadvertence, negligence or otherwise, and for any consequences arising therefrom. Liability on the part of ERIS is limited to the monetary value paid for this report.

Trademark and Copyright: You may not use the ERIS trademarks or attribute any work to ERIS other than as outlined above. This Service and Report (s) are protected by copyright owned by ERIS Information Limited Partnership. Copyright in data used in the Service or Report(s) (the "Data") is owned by ERIS or its licensors. The Service, Report(s) and Data may not be copied or reproduced in whole or in any substantial part without prior written consent of ERIS.

Executive Summary

Property Information:

Project Property: 2155 Leanne Blvd, Mississauga
2155 Leanne Boulevard Mississauga ON L5K 2K8

Project No: 31865

Coordinates:

Latitude: 43.5258881
Longitude: -79.6521364
UTM Northing: 4,820,098.87
UTM Easting: 608,921.09
UTM Zone: 17T

Elevation: 429 FT
130.83 M

Order Information:

Order No: 26022500296
Date Requested: February 25, 2026
Requested by: OHE Consultants
Report Type: Standard Report

Historical/Products:

Aerial Photographs Aerials - National Collection
City Directory Search Smart CD Search
ERIS Xplorer [ERIS Xplorer](#)
Insurance Products Fire Insurance Maps/Inspection Reports/Site Plans

Executive Summary: Report Summary

Database	Name	Searched	Project Property	Within 0.25 km	Total
AAGR	Abandoned Aggregate Inventory	Y	0	0	0
AGR	Aggregate Inventory	Y	0	0	0
AMIS	Abandoned Mine Information System	Y	0	0	0
ANDR	Anderson's Waste Disposal Sites	Y	0	0	0
AST	Aboveground Storage Tanks	Y	0	0	0
AUWR	Automobile Wrecking & Supplies	Y	0	1	1
BORE	Borehole	Y	0	2	2
CA	Certificates of Approval	Y	0	4	4
CDRY	Dry Cleaning Facilities	Y	1	0	1
CFOT	Commercial Fuel Oil Tanks	Y	0	0	0
CHEM	Chemical Manufacturers and Distributors	Y	0	0	0
CHM	Chemical Register	Y	0	0	0
CNG	Compressed Natural Gas Stations	Y	0	0	0
COAL	Inventory of Coal Gasification Plants and Coal Tar Sites	Y	0	0	0
CONV	Compliance and Convictions	Y	0	0	0
CPU	Certificates of Property Use	Y	0	0	0
DRL	Drill Hole Database	Y	0	0	0
DTNK	Delisted Fuel Tanks	Y	0	7	7
EASR	Environmental Activity and Sector Registry	Y	0	0	0
EBR	Environmental Registry	Y	0	0	0
ECA	Environmental Compliance Approval	Y	0	2	2
EEM	Environmental Effects Monitoring	Y	0	0	0
EHS	ERIS Historical Searches	Y	2	11	13
EIIS	Environmental Issues Inventory System	Y	0	0	0
EMHE	Emergency Management Historical Event	Y	0	0	0
EOR	Environmental Offenders Registry	Y	0	0	0
EPAR	Environmental Penalty Annual Report	Y	0	0	0
ESNR	Excess Soil Registry	Y	0	0	0
EXP	List of Expired Fuels Safety Facilities	Y	0	11	11
FCON	Federal Convictions	Y	0	0	0
FCS	Contaminated Sites on Federal Land	Y	0	0	0
FOFT	Fisheries & Oceans Fuel Tanks	Y	0	0	0
FRST	Federal Identification Registry for Storage Tank Systems (FIRSTS)	Y	0	0	0
FST	Fuel Storage Tank	Y	0	10	10
FSTH	Fuel Storage Tank - Historic	Y	0	4	4
GEN	Ontario Regulation 347 Waste Generators Summary	Y	16	32	48
GHG	Greenhouse Gas Emissions from Large Facilities	Y	0	0	0

Database	Name	Searched	Project Property	Within 0.25 km	Total
HBAR	Historical Business Activity Risk	Y	0	0	0
HINC	TSSA Historic Incidents	Y	0	0	0
IAFT	Indian & Northern Affairs Fuel Tanks	Y	0	0	0
INC	Fuel Oil Spills and Leaks	Y	0	1	1
LIMO	Landfill Inventory Management Ontario	Y	0	0	0
MINE	Canadian Mine Locations	Y	0	0	0
MNR	Mineral Occurrences	Y	0	0	0
NATE	National Analysis of Trends in Emergencies System (NATES)	Y	0	0	0
NCPL	Non-Compliance Reports	Y	0	0	0
NDFT	National Defense & Canadian Forces Fuel Tanks	Y	0	0	0
NDSP	National Defense & Canadian Forces Spills	Y	0	0	0
NDWD	National Defence & Canadian Forces Waste Disposal Sites	Y	0	0	0
NEBI	National Energy Board Pipeline Incidents	Y	0	0	0
NEBP	National Energy Board Wells	Y	0	0	0
NEES	National Environmental Emergencies System (NEES)	Y	0	0	0
NOC	Notice of Contamination List	Y	0	0	0
NPCB	National PCB Inventory	Y	0	0	0
NPR2	National Pollutant Release Inventory	Y	0	0	0
NPRI	National Pollutant Release Inventory - Historic	Y	0	0	0
OGWE	Oil and Gas Wells	Y	0	0	0
OOGW	Ontario Oil and Gas Wells	Y	0	0	0
OPCB	Inventory of PCB Storage Sites	Y	0	0	0
ORD	Orders	Y	0	0	0
PAP	Canadian Pulp and Paper	Y	0	0	0
PCFT	Parks Canada Fuel Storage Tanks	Y	0	0	0
PES	Pesticide Register	Y	0	10	10
PFAS	Ontario PFAS Spills	Y	0	0	0
PFCH	NPRI Reporters - PFAS Substances	Y	0	0	0
PFHA	Potential PFAS Handlers from NPRI	Y	0	0	0
PINC	Pipeline Incidents	Y	0	2	2
PPHA	Potential PFAS Handlers from EASR	Y	0	0	0
PRT	Private and Retail Fuel Storage Tanks	Y	0	7	7
PTTW	Permit to Take Water	Y	0	0	0
REC	Ontario Regulation 347 Waste Receivers Summary	Y	0	0	0
RSC	Record of Site Condition	Y	0	1	1
RST	Retail Fuel Storage Tanks	Y	0	4	4
SCT	Scott's Manufacturing Directories	Y	1	1	2
SPL	Ontario Spills	Y	0	12	12
SRDS	Wastewater Discharger Registration Database	Y	0	0	0
TANK	Anderson's Storage Tanks	Y	0	0	0
TCFT	Transport Canada Fuel Storage Tanks	Y	0	0	0

<i>Database</i>	<i>Name</i>	<i>Searched</i>	<i>Project Property</i>	<i>Within 0.25 km</i>	<i>Total</i>
VAR	<i>Variances for Abandonment of Underground Storage Tanks</i>	Y	0	0	0
WDS	<i>Waste Disposal Sites - MOE CA Inventory</i>	Y	0	0	0
WDSH	<i>Waste Disposal Sites - MOE 1991 Historical Approval Inventory</i>	Y	0	0	0
WMS	<i>Waste Management Site</i>	Y	0	0	0
WWIS	<i>Water Well Information System</i>	Y	22	11	33
Total:			42	133	175

Executive Summary: Site Report Summary - Project Property

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev diff (m)	Page Number
<u>2</u>	WWIS		2155 LEANNE BOULEVARD Mississauga ON <i>Well ID: 7263526</i>	NNW/25.2	0.09	<u>44</u>
<u>3</u>	WWIS		2155 LEANNE BLVD CLARKSON ON <i>Well ID: 7220258</i>	NNE/27.4	-0.14	<u>46</u>
<u>4</u>	WWIS		2155 LEANNE BOULEVARD Mississauga ON <i>Well ID: 7263524</i>	NW/28.8	0.04	<u>49</u>
<u>6</u>	WWIS		2155 LEANNE BLVD. Mississauga ON <i>Well ID: 7269910</i>	NW/33.3	0.08	<u>52</u>
<u>7</u>	WWIS		2155 LEANNE BLVD. Mississauga ON <i>Well ID: 7269909</i>	NW/33.4	0.08	<u>55</u>
<u>8</u>	WWIS		2155 LEANNE BLVD. Mississauga ON <i>Well ID: 7269907</i>	NW/35.7	0.08	<u>57</u>
<u>10</u>	WWIS		2155 LEANNE BLVD. Mississauga ON <i>Well ID: 7269911</i>	NW/36.5	0.08	<u>60</u>
<u>11</u>	WWIS		2155 LEANNE BLVD. Mississauga ON <i>Well ID: 7269908</i>	NW/38.4	0.08	<u>62</u>
<u>12</u>	WWIS		2155 LEANNE BLVD Mississauga ON	NNW/43.5	0.12	<u>64</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev diff (m)	Page Number
Well ID: 7263530						
13	CDRY	BRIDLEWOOD CLEANERS INC	2155 LEANNE BLVD UNIT 1-2 MISSISSAUGA ON L5K2K8	NE/45.3	-0.98	67
13	EHS		2155 Leanne Boulevard Mississauga ON L5K 2K8	NE/45.3	-0.98	68
13	EHS		2155 Leanne Boulevard Mississauga ON L5K 2K8	NE/45.3	-0.98	68
13	GEN	BRIDLEWOOD CLEANERS	2155 LEANNE BOULEVARD MISSISSAUGA ON L5K 2K8	NE/45.3	-0.98	68
13	GEN	BRIDLEWOOD (SEE & USE ON0434300)	2155 LEANNE BOULEVARD MISSISSAUGA ON L5K 2K8	NE/45.3	-0.98	68
13	GEN	BRIDLEWOOD CLEANERS INC.	2155 LEANNE BOULEVARD MISSISSAUGA ON L5K 2K8	NE/45.3	-0.98	69
13	GEN	BRIDLEWOOD CLEANERS INC.	2155 LEANNE BOULEVARD MISSISSAUGA ON L5K 2K8	NE/45.3	-0.98	69
13	GEN	BRIDLEWOOD CLEANERS INC. 06-078	2155 LEANNE BOULEVARD MISSISSAUGA ON L5K 2K8	NE/45.3	-0.98	70
13	GEN	BRIDLEWOOD CLEANERS INC.	2155 LEANNE BOULEVARD MISSISSAUGA ON L5K 2K8	NE/45.3	-0.98	70

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev diff (m)</i>	<i>Page Number</i>
<u>13</u>	GEN	BRIDLEWOOD CLEANERS INC.	2155 LEANNE BOULEVARD MISSISSAUGA ON L5K 2K8	NE/45.3	-0.98	<u>70</u>
<u>13</u>	GEN	BRIDLEWOOD DRY CLEANERS INC.	1-2155 LEANNE BLVD MISSISSAUGA ON L5K 2K8	NE/45.3	-0.98	<u>71</u>
<u>13</u>	GEN	BRIDLEWOOD DRY CLEANERS INC.	1-2155 LEANNE BLVD MISSISSAUGA ON L5K 2K8	NE/45.3	-0.98	<u>71</u>
<u>13</u>	GEN	BRIDLEWOOD DRY CLEANERS INC.	1-2155 LEANNE BLVD MISSISSAUGA ON	NE/45.3	-0.98	<u>71</u>
<u>13</u>	GEN	BRIDLEWOOD DRY CLEANERS INC.	1-2155 LEANNE BLVD MISSISSAUGA ON L5K 2K8	NE/45.3	-0.98	<u>72</u>
<u>13</u>	GEN	8989613	2155 Leanne blvd suite 115 mississauga ON L5K 2K8	NE/45.3	-0.98	<u>72</u>
<u>13</u>	GEN	BRIDLEWOOD DRY CLEANERS INC.	1-2155 LEANNE BLVD MISSISSAUGA ON L5K 2K8	NE/45.3	-0.98	<u>72</u>
<u>13</u>	GEN	BRIDLEWOOD DRY CLEANERS INC.	1-2155 LEANNE BLVD MISSISSAUGA ON L5K 2K8	NE/45.3	-0.98	<u>73</u>
<u>13</u>	GEN	Atlas Fin-Quest Inc.	2155 Leanne Blvd Mississauga ON L5K2K8	NE/45.3	-0.98	<u>73</u>
<u>13</u>	GEN	Prime Real Estate Group Inc.	2155 Leanne Blvd. Mississauga ON L5K 2K8	NE/45.3	-0.98	<u>74</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev diff (m)	Page Number
13	SCT	Parhar Mohan Dr	2155 Leanne Blvd Mississauga ON L5K2K8	NE/45.3	-0.98	75
14	WWIS		2155 LEANNE BLVD MISSISSAUGA ON <i>Well ID:</i> 7190001	WNW/45.6	0.06	76
16	WWIS		2155 LEANNE BLVD Mississauga ON <i>Well ID:</i> 7263529	NNW/48.1	0.12	79
17	WWIS		2155 LEANNE BLVD Mississauga ON <i>Well ID:</i> 7263531	NW/49.6	0.13	82
18	WWIS		2155 LEANNE BLVD MISSISSAUGA ON <i>Well ID:</i> 7267398	E/62.9	-0.98	85
19	WWIS		2155 LEANNE BLVD MISSISSAUGA ON <i>Well ID:</i> 7267410	NNW/64.3	-0.44	88
20	WWIS		2155 LEANNE BLVD MISSISSAUGA ON <i>Well ID:</i> 7267409	N/65.2	-0.95	91
21	WWIS		2155 LEANNE BOULEVARD Mississauga ON <i>Well ID:</i> 7263527	NNW/70.2	-0.29	94
22	WWIS		2155 LEANNE BLVD MISSISSAUGA ON <i>Well ID:</i> 7190002	W/77.3	1.05	97

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev diff (m)	Page Number
<u>23</u>	WWIS		2155 LEANNE BLVD MISSISSAUGA ON <i>Well ID: 7267400</i>	ENE/84.6	-1.71	<u>100</u>
<u>24</u>	WWIS		2155 LEANNE BOULEVARD Mississauga ON <i>Well ID: 7263525</i>	NW/85.1	-0.11	<u>103</u>
<u>26</u>	WWIS		2155 LEANNE BLVD MISSISSAUGA ON <i>Well ID: 7267399</i>	SSW/91.7	0.05	<u>106</u>
<u>27</u>	WWIS		2155 LEANNE BOULEVARD MISSISSAUGA ON <i>Well ID: 7263528</i>	NNW/95.2	-0.98	<u>109</u>
<u>29</u>	WWIS		2155 LEANNE BLVD MISSISSAUGA ON <i>Well ID: 7190000</i>	N/105.2	-0.98	<u>112</u>

Executive Summary: Site Report Summary - Surrounding Properties

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>1</u>	EHS		Leanne Boulevard Mississauga ON	WNW/13.6	0.09	<u>115</u>
<u>5</u>	WWIS		ON Well ID: 7256325	NW/29.3	0.08	<u>115</u>
<u>9</u>	WWIS		ON Well ID: 7253066	NW/36.0	0.08	<u>116</u>
<u>15</u>	WWIS		215 LEANNE BLVD MISSISSAUGA ON Well ID: 7267489	NE/46.4	-0.98	<u>117</u>
<u>25</u>	GEN	Southriim	2065 Leanne Blvd Miss ON L5K 2L6	SE/90.5	-0.98	<u>120</u>
<u>25</u>	GEN	Southriim	2065 Leanne Blvd Miss ON L5K 2L6	SE/90.5	-0.98	<u>121</u>
<u>28</u>	WWIS		2185 LEANNE BLVD MISSISSAUGA ON Well ID: 7042139	NW/104.8	-0.83	<u>121</u>
<u>30</u>	DTNK	1239973 ONTARIO INC O/A ESSO GENERATION	2185 LEANNE BLVD MISSISSAUGA ON	NNW/105.3	-0.98	<u>125</u>
<u>30</u>	DTNK	1239973 ONTARIO INC O/A ESSO GENERATION	2185 LEANNE BLVD MISSISSAUGA ON	NNW/105.3	-0.98	<u>126</u>
<u>30</u>	EHS		2185 Leanne Boulevard Mississauga ON L5K 2L6	NNW/105.3	-0.98	<u>127</u>
<u>30</u>	EHS		2185 Leanne Blvd Mississauga ON L5K2L6	NNW/105.3	-0.98	<u>127</u>
<u>30</u>	EXP	1239973 ONTARIO INC O/A ESSO GENERATION	2185 LEANNE BLVD MISSISSAUGA ON	NNW/105.3	-0.98	<u>127</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>30</u>	EXP	1239973 ONTARIO INC O/A ESSO GENERATION	2185 LEANNE BLVD MISSISSAUGA ON	NNW/105.3	-0.98	<u>127</u>
<u>30</u>	EXP	1239973 ONTARIO INC O/A ESSO GENERATION	2185 LEANNE BLVD MISSISSAUGA ON	NNW/105.3	-0.98	<u>127</u>
<u>30</u>	EXP	1239973 ONTARIO INC O/A ESSO GENERATION	2185 LEANNE BLVD MISSISSAUGA ON	NNW/105.3	-0.98	<u>128</u>
<u>30</u>	FST	MAC'S CONVENIENCE STORES INC.	2185 LEANNE BLVD MISSISSAUGA ON	NNW/105.3	-0.98	<u>128</u>
<u>30</u>	FST	MAC'S CONVENIENCE STORES INC.	2185 LEANNE BLVD MISSISSAUGA ON	NNW/105.3	-0.98	<u>128</u>
<u>30</u>	FST	MAC'S CONVENIENCE STORES INC.	2185 LEANNE BLVD MISSISSAUGA ON	NNW/105.3	-0.98	<u>128</u>
<u>30</u>	FST	MAC'S CONVENIENCE STORES INC.	2185 LEANNE BLVD MISSISSAUGA ON	NNW/105.3	-0.98	<u>129</u>
<u>30</u>	FST	MAC'S CONVENIENCE STORES INC.	2185 LEANNE BLVD MISSISSAUGA ON	NNW/105.3	-0.98	<u>129</u>
<u>30</u>	FSTH	1239973 ONTARIO INC O/A ESSO GENERATION	2185 LEANNE BLVD MISSISSAUGA ON L5K 2L6	NNW/105.3	-0.98	<u>129</u>
<u>30</u>	FSTH	1239973 ONTARIO INC O/A ESSO GENERATION	2185 LEANNE BLVD MISSISSAUGA ON L5K 2L6	NNW/105.3	-0.98	<u>130</u>
<u>30</u>	PRT	ERIN MILLS ESSO	2185 LEANNE BLVD MISSISSAUGA ON L5K 2L6	NNW/105.3	-0.98	<u>130</u>
<u>30</u>	PRT	1085399 ONTARIO LTD ATT JIM MAZEROLLE	2185 LEANNE BLVD MISSISSAUGA ON L5K2L6	NNW/105.3	-0.98	<u>131</u>
<u>30</u>	RST	ESSO GENERATION	2185 LEANNE BLVD MISSISSAUGA ON L5K 2L6	NNW/105.3	-0.98	<u>131</u>

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
30	RST	ESSO GENERATION	2185 LEANNE BLVD MISSISSAUGA ON L5K2L6	NNW/105.3	-0.98	131
30	SPL	TRIMAC TRANSPORTATION SERVICES	ESSO PETROLEUM SERVICE STN # 401027 2185 LEANNE BLVD TANK TRUCK (CARGO) MISSISSAUGA CITY ON L5K 2L6	NNW/105.3	-0.98	131
31	EHS		Erin Mills Parkway Mississauga ON	E/132.9	-2.03	132
32	WWIS		ON Well ID: 7383918	NE/146.8	-2.99	132
33	EHS		2085 North Sheridan Way Mississauga ON L5K 2T2	SE/152.8	-0.98	133
33	EHS		2085 North Sheridan Way Mississauga, Ontario ON L5K 2T2	SE/152.8	-0.98	133
34	PINC	PIPELINE HIT - 1"	1930 FOWLER DRIVE UNIT#100T,, MISSISSAUGA,ON,L5K 0A1,CA ON	ENE/153.3	-3.59	134
34	SPL	Enbridge Gas Distribution Inc.	1930 Fowler Drive, unit 100C Mississauga ON	ENE/153.3	-3.59	134
35	WWIS		1401 KING ST E COURTICE ON Well ID: 7191831	NNE/169.0	-2.23	135
36	EHS		2085 North Sheridan Way Mississauga ON L5K 2L6	ESE/171.0	-0.98	138
37	INC		Erin Mills Parkway & Fowler Drive, Mississauga ON	N/171.8	-1.18	138
38	EHS		1910 Fowler Drive Suite A104 Mississauga ON L5K 0A1	NNE/178.3	-3.67	139

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>38</u>	GEN	Sherwin Williams Company	1910 Fowler Dr Suite A104 Mississauga ON L5K 0A1	NNE/178.3	-3.67	<u>139</u>
<u>38</u>	GEN	Sherwin Williams Company	1910 Fowler Dr Suite A104 Mississauga ON L5K 0A1	NNE/178.3	-3.67	<u>140</u>
<u>38</u>	GEN	Sherwin Williams Company	1910 Fowler Dr Suite A104 Mississauga ON L5K 0A1	NNE/178.3	-3.67	<u>141</u>
<u>38</u>	GEN	RBC	1910 FOWLER DR. UNIT A 100 MISSISSAUGA ON	NNE/178.3	-3.67	<u>141</u>
<u>38</u>	SCT	Sherwin-Williams Paint Store	1910 Fowler Dr Suite A104 Mississauga ON L5K0A1	NNE/178.3	-3.67	<u>142</u>
<u>39</u>	WWIS		ON Well ID: 7189084	NNE/181.6	-3.35	<u>143</u>
<u>40</u>	PES	A-PRO-TEK EXTERMINATION SERVICES	2131 BOSACK COURT MISSISSAUGA ON L5K 2M1	SW/183.7	2.91	<u>144</u>
<u>40</u>	PES	973822 ONTARIO LIMITED	2131 BOSACK COURT MISSISSAUGA ON L5K 2M1	SW/183.7	2.91	<u>144</u>
<u>40</u>	PES	SWAT PEST CONTROL/FARRELL'S PEST CONTROL	2131 BUSACK COURT MISSISSAUGA ON	SW/183.7	2.91	<u>145</u>
<u>40</u>	PES	A-PRO-TEK EXTERMINATION SERVICES	2131 BOSACK COURT MISSISSAUGA ON L5K 2M1	SW/183.7	2.91	<u>145</u>
<u>40</u>	PES	973822 ONTARIO LIMITED	2131 BOSACK CRT MISSISSAUGA ON L5K 2M1	SW/183.7	2.91	<u>145</u>
<u>41</u>	PES	973822 ONTARIO LIMITED	2131 BOSACK CRT MISSISSAUGA ON L5K2M1	SW/183.8	2.57	<u>146</u>
<u>41</u>	PES	973822 ONTARIO LIMITED	2131 BOSACK CRT MISSISSAUGA ON L5K2M1	SW/183.8	2.57	<u>146</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>41</u>	PES	973822 ONTARIO LIMITED	2131 BOSACK CRT MISSISSAUGA ON L5K2M1	SW/183.8	2.57	<u>147</u>
<u>41</u>	PES	973822 ONTARIO LIMITED	2131 BOSACK CRT MISSISSAUGA ON L5K2M1	SW/183.8	2.57	<u>147</u>
<u>41</u>	PES	973822 ONTARIO LIMITED	2131 BOSACK CRT MISSISSAUGA ON L5K 2M1	SW/183.8	2.57	<u>147</u>
<u>42</u>	CA	Shell Canada OP Inc. and Shell Canada Products Limited	2165 Erin Mills Parkway Mississauga ON L5K 1T7	NNE/187.0	-3.19	<u>148</u>
<u>42</u>	DTNK	972129 ONTARIO LIMITED O/A SHELL CANADA GAS STN	2165 ERIN MILLS PKWY MISSISSAUGA ON L5K 1T7	NNE/187.0	-3.19	<u>148</u>
<u>42</u>	DTNK	972129 ONTARIO LIMITED O/A SHELL CANADA GAS STN	2165 ERIN MILLS PKWY MISSISSAUGA ON	NNE/187.0	-3.19	<u>149</u>
<u>42</u>	ECA	Shell Canada OP Inc. and Shell Canada Products Limited	2165 Erin Mills Parkway Mississauga ON M2N 6Y2	NNE/187.0	-3.19	<u>149</u>
<u>42</u>	EHS		2165 Erin Mills Pky Mississauga ON L5K 1T7	NNE/187.0	-3.19	<u>150</u>
<u>42</u>	EXP	972129 ONTARIO LIMITED O/A SHELL CANADA GAS STN	2165 ERIN MILLS PKWY MISSISSAUGA ON	NNE/187.0	-3.19	<u>150</u>
<u>42</u>	EXP	972129 ONTARIO LIMITED O/A SHELL CANADA GAS STN	2165 ERIN MILLS PKWY MISSISSAUGA ON	NNE/187.0	-3.19	<u>150</u>
<u>42</u>	EXP	972129 ONTARIO LIMITED O/A SHELL CANADA GAS STN	2165 ERIN MILLS PKWY MISSISSAUGA ON	NNE/187.0	-3.19	<u>150</u>
<u>42</u>	FST	SHELL CANADA PRODUCTS	2165 ERIN MILLS PARKWAY MISSISSAUGA ON	NNE/187.0	-3.19	<u>151</u>
<u>42</u>	FST	SHELL CANADA PRODUCTS	2165 ERIN MILLS PARKWAY MISSISSAUGA ON	NNE/187.0	-3.19	<u>151</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>42</u>	FST	SHELL CANADA PRODUCTS	2165 ERIN MILLS PARKWAY MISSISSAUGA ON	NNE/187.0	-3.19	<u>151</u>
<u>42</u>	FST	SHELL CANADA PRODUCTS	2165 ERIN MILLS PARKWAY MISSISSAUGA ON	NNE/187.0	-3.19	<u>151</u>
<u>42</u>	FST	SHELL CANADA PRODUCTS	2165 ERIN MILLS PARKWAY MISSISSAUGA ON	NNE/187.0	-3.19	<u>152</u>
<u>42</u>	FSTH	972129 ONTARIO LIMITED O/A SHELL CANADA GAS STN	2165 ERIN MILLS PKWY MISSISSAUGA ON L5K 1T7	NNE/187.0	-3.19	<u>152</u>
<u>42</u>	FSTH	972129 ONTARIO LIMITED O/A SHELL CANADA GAS STN	2165 ERIN MILLS PKWY MISSISSAUGA ON L5K 1T7	NNE/187.0	-3.19	<u>152</u>
<u>42</u>	GEN	Shall Canada	2165 Erin Mills Parkway Mississauga ON L5K 1T7	NNE/187.0	-3.19	<u>153</u>
<u>42</u>	GEN	Shell Canada	2165 Erin Mills Parkway Mississauga ON L5K 1T7	NNE/187.0	-3.19	<u>153</u>
<u>42</u>	GEN	Shell Canada c/o Minotaur Guardian Service Ltd.	2165 Erin Mills Mississauga ON	NNE/187.0	-3.19	<u>154</u>
<u>42</u>	GEN	Shell Canada c/o Minotaur Guardian Service Ltd.	2165 Erin Mills Mississauga ON	NNE/187.0	-3.19	<u>154</u>
<u>42</u>	GEN	Shell Canada c/o Minotaur Guardian Service Ltd.	2165 Erin Mills Mississauga ON L5K 1T7	NNE/187.0	-3.19	<u>154</u>
<u>42</u>	GEN	Shell Canada c/o Minotaur Guardian Service Ltd.	2165 Erin Mills Mississauga ON L5K 1T7	NNE/187.0	-3.19	<u>155</u>
<u>42</u>	GEN	Shell Canada c/o Minotaur Guardian Service Ltd.	2165 Erin Mills Mississauga ON L5K 1T7	NNE/187.0	-3.19	<u>155</u>
<u>42</u>	GEN	Shell Canada c/o Minotaur Guardian Service Ltd.	2165 Erin Mills Mississauga ON L5K 1T7	NNE/187.0	-3.19	<u>155</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>42</u>	GEN	Shell Canada c/o Minotaur Guardian Service Ltd.	2165 Erin Mills Mississauga ON L5K 1T7	NNE/187.0	-3.19	<u>156</u>
<u>42</u>	GEN	Shell Canada c/o Minotaur Guardian Service Ltd.	2165 Erin Mills Mississauga ON L5K 1T7	NNE/187.0	-3.19	<u>156</u>
<u>42</u>	GEN	Shell Canada	2165 Erin Mills Mississauga ON	NNE/187.0	-3.19	<u>156</u>
<u>42</u>	PRT	B K LAKEVIEW SERVICE LTD	2165 ERIN MILLS PKWY MISSISSAUGA ON L5K 1T7	NNE/187.0	-3.19	<u>159</u>
<u>42</u>	PRT	1109289 ONTARIO INC	2165 ERIN MILLS PKWY MISSISSAUGA ON L5K1T7	NNE/187.0	-3.19	<u>159</u>
<u>42</u>	RST	ROURKES DON SHELL CENTRE	2165 ERIN MILLS PKY MISSISSAUGA ON L5K1T7	NNE/187.0	-3.19	<u>160</u>
<u>42</u>	RST	SAM ASAAD SHELL GAS BAR	2165 ERIN MILLS PKY MISSISSAUGA ON L5K1T7	NNE/187.0	-3.19	<u>160</u>
<u>42</u>	SPL	SHELL CANADA PRODUCTS LTD.	2165 ERIN MILLS (& FOWLER) SERVICE STATION MISSISSAUGA CITY ON L5K 1T7	NNE/187.0	-3.19	<u>160</u>
<u>42</u>	SPL	SHELL CANADA PRODUCTS LTD.	2165 ERIN MILLS PARKWAY SERVICE STATION MISSISSAUGA CITY ON L5K 1T7	NNE/187.0	-3.19	<u>161</u>
<u>42</u>	SPL	SHELL CANADA PRODUCTS LTD.	AT SHELL SERVICE STATION AT 2165 ERIN MILLS PKWY. AT FOWLER RD. SERVICE STATION MISSISSAUGA CITY ON L5K 1T7	NNE/187.0	-3.19	<u>162</u>
<u>42</u>	SPL	SHELL CANADA PRODUCTS LTD.	SHELL GAS STATION AT 2165 ERIN MILLS PARKWAY SERVICE STATION MISSISSAUGA CITY ON L5K 1T7	NNE/187.0	-3.19	<u>163</u>
<u>42</u>	SPL	Shell Canada OP Inc.	2165 Erin Mills Parkway Mississauga ON L5K 1T7	NNE/187.0	-3.19	<u>164</u>
<u>42</u>	SPL	Shell Canada Limited	2165 Erin Mills Pkwy Toronto ON	NNE/187.0	-3.19	<u>165</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
42	SPL	2165 Erin Mills Parkway	2165 Erin Mills Pky Mississauga ON	NNE/187.0	-3.19	166
43	WWIS		2165 ERIN MILLS PKWY lot 30 con 1 MISSISSAUGA ON Well ID: 4910029	N/189.2	-1.88	167
44	AUWR	ARTIA SCRAP METALS	2055 FOWLER CRT MISSISSAUGA ON L5K 1B7	NW/190.4	0.02	169
45	CA	R.M. OF PEEL	ERIN MILLS PKWY/N.SHERIDAN WAY MISSISSAUGA CITY ON	E/194.4	-2.04	170
45	CA	R.M. OF PEEL	ERIN MILLS PKWY/N.SHERIDAN WAY MISSISSAUGA CITY ON	E/194.4	-2.04	170
46	PINC		2132 Bosack Court, Mississauga ON	SW/201.3	1.97	170
47	SPL		2118 Fowler Lane Mississauga ON	W/201.5	3.39	171
48	EHS		1944 Fowler Drive Mississauga ON L5K 0A1	ENE/203.6	-2.73	172
49	GEN	Van Mills Medical Centre	1900 Fowler Dr Mississauga ON	NE/205.7	-5.03	172
50	EHS		1900, 1910, 1930, and 1944 Fowler Drive Mississauga ON L5K 1T7	NE/207.2	-4.79	175
50	GEN	Vanmills Medical Clinic	1900 Fowler Dr Mississauga ON L5K 0A1	NE/207.2	-4.79	176
50	GEN	Dr. B. Demarchi DPC	1900 Fowler Drive unit D107 Mississauga ON L5K0A1	NE/207.2	-4.79	176
50	GEN	Dr. B. Demarchi Dental Office	1900 Fowler Drive unit D107 Mississauga ON L5K0A1	NE/207.2	-4.79	176

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
50	GEN	Vanmills Medical Clinic	1900 Fowler Dr Mississauga ON L5K 0A1	NE/207.2	-4.79	177
50	GEN	Vanmills Medical Clinic	1900 Fowler Dr Mississauga ON L5K 0A1	NE/207.2	-4.79	177
50	GEN	Dr. B. Demarchi DPC	1900 Fowler Drive, unit D107 Mississauga ON L5K0A1	NE/207.2	-4.79	177
50	GEN	Vanmills Medical Clinic	1900 Fowler Dr Mississauga ON L5K 0A1	NE/207.2	-4.79	178
50	GEN	Vanmills Medical Clinic	1900 Fowler Dr Mississauga ON L5K 0A1	NE/207.2	-4.79	178
50	GEN	Dr. B. Demarchi DPC	1900 Fowler Drive, unit D107 Mississauga ON L5K0A1	NE/207.2	-4.79	179
50	GEN	Vanmills Medical Clinic	1900 Fowler Dr Mississauga ON L5K 0A1	NE/207.2	-4.79	179
50	GEN	Dr. B. Demarchi DPC	1900 Fowler Drive, unit D107 Mississauga ON L5K0A1	NE/207.2	-4.79	179
50	GEN	Dr. B. Demarchi DPC	1900 Fowler Drive, unit D107 Mississauga ON L5K0A1	NE/207.2	-4.79	180
50	SPL	The Corporation of the City of Mississauga	1900 Fowler Drive Mississauga ON	NE/207.2	-4.79	182
51	GEN	Sherwin Williams Company	1910 Fowler Dr, Suite A104 Mississauga ON	ENE/210.4	-3.86	183
52	CA	R.M. OF PEEL - LOT 31, CONC. 1 SDS	FIFTH LINE W./FOWLER LANE MISSISSAUGA CITY ON	WNW/213.3	3.02	187
53	WWIS		lot 12 con 3 ON	ENE/216.6	-2.91	187

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
			Well ID: 4907543			
54	ECA	The Corporation of the City of Mississauga	2085 Fowler Crt 2065 Fowler Court Mississauga ON L5B 3C1	WNW/221.9	2.58	191
55	BORE		ON	WNW/223.9	2.16	192
56	WWIS		2165 ERIN MILLS PKWY MISSISSAUGA ON Well ID: 4909673	N/224.7	-2.96	193
56	WWIS		2165 ERIN MILLS PRWY PEEL Mississauga ON Well ID: 7150023	N/224.7	-2.96	195
57	BORE		ON	ENE/225.5	-4.80	199
58	DTNK	KHERIBA HOLDING	2185 ERIN MILLS PKWY MISSISSAUGA ON L5K 1T8	N/238.9	-1.47	201
58	DTNK	SIMCOE ENERGY & TECHNICAL SERVICES INC *	2185 ERIN MILLS PKWY MISSISSAUGA ON	N/238.9	-1.47	202
58	DTNK	KHERIBA HOLDING	2185 ERIN MILLS PKWY MISSISSAUGA ON	N/238.9	-1.47	202
58	EXP	KHERIBA HOLDING	2185 ERIN MILLS PKWY MISSISSAUGA ON	N/238.9	-1.47	203
58	EXP	KHERIBA HOLDING	2185 ERIN MILLS PKWY MISSISSAUGA ON	N/238.9	-1.47	203
58	EXP	KHERIBA HOLDING	2185 ERIN MILLS PKWY MISSISSAUGA ON	N/238.9	-1.47	203
58	EXP	KHERIBA HOLDING	2185 ERIN MILLS PKWY MISSISSAUGA ON	N/238.9	-1.47	204
58	GEN	Petro Canada	2185 Erin Mills Parkway Mississauga ON L5K 1T8	N/238.9	-1.47	204

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
<u>58</u>	PRT	MYERS SELF SERVE	2185 ERIN MILLS PKWY MISSISSAUGA ON L5K 1T8	N/238.9	-1.47	<u>204</u>
<u>58</u>	PRT	SOUTH WESTERN ONTARIO PROPANE DIV 998131 ONTARIO L	2185 ERIN MILLS PKWY MISSISSAUGA ON L5K 1T8	N/238.9	-1.47	<u>204</u>
<u>58</u>	PRT	MERVET ZAIA	2185 ERIN MILLS PKWY MISSISSAUGA ON L5K1T8	N/238.9	-1.47	<u>205</u>
<u>58</u>	RSC	VANDYK-VANMILLS PLAZA INC.	2185 ERIN MILLS PKY ON MISSISSAUGA ON	N/238.9	-1.47	<u>205</u>
<u>58</u>	SPL	Petro-Canada	2185 Erin Mills Pkwy Mississauga ON L5K 1T8	N/238.9	-1.47	<u>205</u>

Executive Summary: Summary By Data Source

AUWR - Automobile Wrecking & Supplies

A search of the AUWR database, dated 1999-Apr 30, 2025 has found that there are 1 AUWR site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
ARTIA SCRAP METALS	2055 FOWLER CRT MISSISSAUGA ON L5K 1B7	NW	190.39	<u>44</u>

BORE - Borehole

A search of the BORE database, dated 1875-Jul 2018 has found that there are 2 BORE site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON	WNW	223.94	<u>55</u>

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON	ENE	225.48	<u>57</u>

CA - Certificates of Approval

A search of the CA database, dated 1985-Oct 30, 2011* has found that there are 4 CA site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
R.M. OF PEEL - LOT 31, CONC. 1 SDS	FIFTH LINE W./FOWLER LANE MISSISSAUGA CITY ON	WNW	213.32	<u>52</u>

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Shell Canada OP Inc. and Shell Canada Products Limited	2165 Erin Mills Parkway Mississauga ON L5K 1T7	NNE	186.97	<u>42</u>

R.M. OF PEEL	ERIN MILLS PKWY/N.SHERIDAN WAY MISSISSAUGA CITY ON	E	194.44	45
R.M. OF PEEL	ERIN MILLS PKWY/N.SHERIDAN WAY MISSISSAUGA CITY ON	E	194.44	45

CDRY - Dry Cleaning Facilities

A search of the CDRY database, dated Jan 2004-Dec 2023 has found that there are 1 CDRY site(s) within approximately 0.25 kilometers of the project property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
BRIDLEWOOD CLEANERS INC	2155 LEANNE BLVD UNIT 1-2 MISSISSAUGA ON L5K2K8	NE	45.26	13

DTNK - Delisted Fuel Tanks

A search of the DTNK database, dated Oct 2023 has found that there are 7 DTNK site(s) within approximately 0.25 kilometers of the project property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
1239973 ONTARIO INC O/A ESSO GENERATION	2185 LEANNE BLVD MISSISSAUGA ON	NNW	105.28	30
1239973 ONTARIO INC O/A ESSO GENERATION	2185 LEANNE BLVD MISSISSAUGA ON	NNW	105.28	30
972129 ONTARIO LIMITED O/A SHELL CANADA GAS STN	2165 ERIN MILLS PKWY MISSISSAUGA ON L5K 1T7	NNE	186.97	42
972129 ONTARIO LIMITED O/A SHELL CANADA GAS STN	2165 ERIN MILLS PKWY MISSISSAUGA ON	NNE	186.97	42
KHERIBA HOLDING	2185 ERIN MILLS PKWY MISSISSAUGA ON L5K 1T8	N	238.92	58
SIMCOE ENERGY & TECHNICAL SERVICES INC *	2185 ERIN MILLS PKWY MISSISSAUGA ON	N	238.92	58

KHERIBA HOLDING	2185 ERIN MILLS PKWY MISSISSAUGA ON	N	238.92	58

ECA - Environmental Compliance Approval

A search of the ECA database, dated Oct 2011 - Jan 31, 2026 has found that there are 2 ECA site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
The Corporation of the City of Mississauga	2085 Fowler Crt 2065 Fowler Court Mississauga ON L5B 3C1	WNW	221.91	54

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Shell Canada OP Inc. and Shell Canada Products Limited	2165 Erin Mills Parkway Mississauga ON M2N 6Y2	NNE	186.97	42

EHS - ERIS Historical Searches

A search of the EHS database, dated 1999-Nov 30, 2025 has found that there are 13 EHS site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	Leanne Boulevard Mississauga ON	WNW	13.56	1

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	2155 Leanne Boulevard Mississauga ON L5K 2K8	NE	45.26	13
	2155 Leanne Boulevard Mississauga ON L5K 2K8	NE	45.26	13
	2185 Leanne Boulevard Mississauga ON L5K 2L6	NNW	105.28	30

2185 Leanne Blvd Mississauga ON L5K2L6	NNW	105.28	30
Erin Mills Parkway Mississauga ON	E	132.89	31
2085 North Sheridan Way Mississauga ON L5K 2T2	SE	152.77	33
2085 North Sheridan Way Mississauga, Ontario ON L5K 2T2	SE	152.77	33
2085 North Sheridan Way Mississauga ON L5K 2L6	ESE	171.01	36
1910 Fowler Drive Suite A104 Mississauga ON L5K 0A1	NNE	178.30	38
2165 Erin Mills Pky Mississauga ON L5K 1T7	NNE	186.97	42
1944 Fowler Drive Mississauga ON L5K 0A1	ENE	203.64	48
1900, 1910, 1930, and 1944 Fowler Drive Mississauga ON L5K 1T7	NE	207.24	50

EXP - List of Expired Fuels Safety Facilities

A search of the EXP database, dated Oct 2023 has found that there are 11 EXP site(s) within approximately 0.25 kilometers of the project property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
1239973 ONTARIO INC O/A ESSO GENERATION	2185 LEANNE BLVD MISSISSAUGA ON	NNW	105.28	30
1239973 ONTARIO INC O/A ESSO GENERATION	2185 LEANNE BLVD MISSISSAUGA ON	NNW	105.28	30

1239973 ONTARIO INC O/A ESSO GENERATION	2185 LEANNE BLVD MISSISSAUGA ON	NNW	105.28	30
1239973 ONTARIO INC O/A ESSO GENERATION	2185 LEANNE BLVD MISSISSAUGA ON	NNW	105.28	30
972129 ONTARIO LIMITED O/A SHELL CANADA GAS STN	2165 ERIN MILLS PKWY MISSISSAUGA ON	NNE	186.97	42
972129 ONTARIO LIMITED O/A SHELL CANADA GAS STN	2165 ERIN MILLS PKWY MISSISSAUGA ON	NNE	186.97	42
972129 ONTARIO LIMITED O/A SHELL CANADA GAS STN	2165 ERIN MILLS PKWY MISSISSAUGA ON	NNE	186.97	42
KHERIBA HOLDING	2185 ERIN MILLS PKWY MISSISSAUGA ON	N	238.92	58
KHERIBA HOLDING	2185 ERIN MILLS PKWY MISSISSAUGA ON	N	238.92	58
KHERIBA HOLDING	2185 ERIN MILLS PKWY MISSISSAUGA ON	N	238.92	58
KHERIBA HOLDING	2185 ERIN MILLS PKWY MISSISSAUGA ON	N	238.92	58

FST - Fuel Storage Tank

A search of the FST database, dated Oct 2023 has found that there are 10 FST site(s) within approximately 0.25 kilometers of the project property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
MAC'S CONVENIENCE STORES INC.	2185 LEANNE BLVD MISSISSAUGA ON	NNW	105.28	30

MAC'S CONVENIENCE STORES INC.	2185 LEANNE BLVD MISSISSAUGA ON	NNW	105.28	30
MAC'S CONVENIENCE STORES INC.	2185 LEANNE BLVD MISSISSAUGA ON	NNW	105.28	30
MAC'S CONVENIENCE STORES INC.	2185 LEANNE BLVD MISSISSAUGA ON	NNW	105.28	30
MAC'S CONVENIENCE STORES INC.	2185 LEANNE BLVD MISSISSAUGA ON	NNW	105.28	30
SHELL CANADA PRODUCTS	2165 ERIN MILLS PARKWAY MISSISSAUGA ON	NNE	186.97	42
SHELL CANADA PRODUCTS	2165 ERIN MILLS PARKWAY MISSISSAUGA ON	NNE	186.97	42
SHELL CANADA PRODUCTS	2165 ERIN MILLS PARKWAY MISSISSAUGA ON	NNE	186.97	42
SHELL CANADA PRODUCTS	2165 ERIN MILLS PARKWAY MISSISSAUGA ON	NNE	186.97	42
SHELL CANADA PRODUCTS	2165 ERIN MILLS PARKWAY MISSISSAUGA ON	NNE	186.97	42

FSTH - Fuel Storage Tank - Historic

A search of the FSTH database, dated Pre-Jan 2010* has found that there are 4 FSTH site(s) within approximately 0.25 kilometers of the project property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
1239973 ONTARIO INC O/A ESSO GENERATION	2185 LEANNE BLVD MISSISSAUGA ON L5K 2L6	NNW	105.28	30
1239973 ONTARIO INC O/A ESSO GENERATION	2185 LEANNE BLVD MISSISSAUGA ON L5K 2L6	NNW	105.28	30

972129 ONTARIO LIMITED O/A SHELL CANADA GAS STN	2165 ERIN MILLS PKWY MISSISSAUGA ON L5K 1T7	NNE	186.97	42
972129 ONTARIO LIMITED O/A SHELL CANADA GAS STN	2165 ERIN MILLS PKWY MISSISSAUGA ON L5K 1T7	NNE	186.97	42

GEN - Ontario Regulation 347 Waste Generators Summary

A search of the GEN database, dated 1986-Mar 31, 2025 has found that there are 48 GEN site(s) within approximately 0.25 kilometers of the project property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
BRIDLEWOOD CLEANERS	2155 LEANNE BOULEVARD MISSISSAUGA ON L5K 2K8	NE	45.26	13
BRIDLEWOOD (SEE & USE ON0434300)	2155 LEANNE BOULEVARD MISSISSAUGA ON L5K 2K8	NE	45.26	13
BRIDLEWOOD CLEANERS INC.	2155 LEANNE BOULEVARD MISSISSAUGA ON L5K 2K8	NE	45.26	13
BRIDLEWOOD CLEANERS INC.	2155 LEANNE BOULEVARD MISSISSAUGA ON L5K 2K8	NE	45.26	13
BRIDLEWOOD CLEANERS INC. 06-078	2155 LEANNE BOULEVARD MISSISSAUGA ON L5K 2K8	NE	45.26	13
BRIDLEWOOD CLEANERS INC.	2155 LEANNE BOULEVARD MISSISSAUGA ON L5K 2K8	NE	45.26	13
BRIDLEWOOD CLEANERS INC.	2155 LEANNE BOULEVARD MISSISSAUGA ON L5K 2K8	NE	45.26	13
BRIDLEWOOD DRY CLEANERS INC.	1-2155 LEANNE BLVD MISSISSAUGA ON L5K 2K8	NE	45.26	13

BRIDLEWOOD DRY CLEANERS INC.	1-2155 LEANNE BLVD MISSISSAUGA ON L5K 2K8	NE	45.26	<u>13</u>
BRIDLEWOOD DRY CLEANERS INC.	1-2155 LEANNE BLVD MISSISSAUGA ON	NE	45.26	<u>13</u>
BRIDLEWOOD DRY CLEANERS INC.	1-2155 LEANNE BLVD MISSISSAUGA ON L5K 2K8	NE	45.26	<u>13</u>
8989613	2155 Leanne blvd suite 115 mississauga ON L5K 2K8	NE	45.26	<u>13</u>
BRIDLEWOOD DRY CLEANERS INC.	1-2155 LEANNE BLVD MISSISSAUGA ON L5K 2K8	NE	45.26	<u>13</u>
BRIDLEWOOD DRY CLEANERS INC.	1-2155 LEANNE BLVD MISSISSAUGA ON L5K 2K8	NE	45.26	<u>13</u>
Atlas Fin-Quest Inc.	2155 Leanne Blvd Mississauga ON L5K2K8	NE	45.26	<u>13</u>
Prime Real Estate Group Inc.	2155 Leanne Blvd. Mississauga ON L5K 2K8	NE	45.26	<u>13</u>
Southriim	2065 Leanne Blvd Miss ON L5K 2L6	SE	90.54	<u>25</u>
Southriim	2065 Leanne Blvd Miss ON L5K 2L6	SE	90.54	<u>25</u>
RBC	1910 FOWLER DR. UNIT A 100 MISSISSAUGA ON	NNE	178.30	<u>38</u>
Sherwin Williams Company	1910 Fowler Dr Suite A104 Mississauga ON L5K 0A1	NNE	178.30	<u>38</u>
Sherwin Williams Company	1910 Fowler Dr Suite A104 Mississauga ON L5K 0A1	NNE	178.30	<u>38</u>

Sherwin Williams Company	1910 Fowler Dr Suite A104 Mississauga ON L5K 0A1	NNE	178.30	<u>38</u>
Shall Canada	2165 Erin Mills Parkway Mississauga ON L5K 1T7	NNE	186.97	<u>42</u>
Shell Canada	2165 Erin Mills Parkway Mississauga ON L5K 1T7	NNE	186.97	<u>42</u>
Shell Canada c/o Minotaur Guardian Service Ltd.	2165 Erin Mills Mississauga ON	NNE	186.97	<u>42</u>
Shell Canada c/o Minotaur Guardian Service Ltd.	2165 Erin Mills Mississauga ON	NNE	186.97	<u>42</u>
Shell Canada c/o Minotaur Guardian Service Ltd.	2165 Erin Mills Mississauga ON L5K 1T7	NNE	186.97	<u>42</u>
Shell Canada c/o Minotaur Guardian Service Ltd.	2165 Erin Mills Mississauga ON L5K 1T7	NNE	186.97	<u>42</u>
Shell Canada c/o Minotaur Guardian Service Ltd.	2165 Erin Mills Mississauga ON L5K 1T7	NNE	186.97	<u>42</u>
Shell Canada c/o Minotaur Guardian Service Ltd.	2165 Erin Mills Mississauga ON L5K 1T7	NNE	186.97	<u>42</u>
Shell Canada c/o Minotaur Guardian Service Ltd.	2165 Erin Mills Mississauga ON L5K 1T7	NNE	186.97	<u>42</u>
Shell Canada c/o Minotaur Guardian Service Ltd.	2165 Erin Mills Mississauga ON L5K 1T7	NNE	186.97	<u>42</u>
Shell Canada c/o Minotaur Guardian Service Ltd.	2165 Erin Mills Mississauga ON L5K 1T7	NNE	186.97	<u>42</u>
Shell Canada	2165 Erin Mills Mississauga ON	NNE	186.97	<u>42</u>

Van Mills Medical Centre	1900 Fowler Dr Mississauga ON	NE	205.67	<u>49</u>
Vanmills Medical Clinic	1900 Fowler Dr Mississauga ON L5K 0A1	NE	207.24	<u>50</u>
Dr. B. Demarchi DPC	1900 Fowler Drive unit D107 Mississauga ON L5K0A1	NE	207.24	<u>50</u>
Dr. B. Demarchi Dental Office	1900 Fowler Drive unit D107 Mississauga ON L5K0A1	NE	207.24	<u>50</u>
Vanmills Medical Clinic	1900 Fowler Dr Mississauga ON L5K 0A1	NE	207.24	<u>50</u>
Vanmills Medical Clinic	1900 Fowler Dr Mississauga ON L5K 0A1	NE	207.24	<u>50</u>
Dr. B. Demarchi DPC	1900 Fowler Drive, unit D107 Mississauga ON L5K0A1	NE	207.24	<u>50</u>
Vanmills Medical Clinic	1900 Fowler Dr Mississauga ON L5K 0A1	NE	207.24	<u>50</u>
Vanmills Medical Clinic	1900 Fowler Dr Mississauga ON L5K 0A1	NE	207.24	<u>50</u>
Dr. B. Demarchi DPC	1900 Fowler Drive, unit D107 Mississauga ON L5K0A1	NE	207.24	<u>50</u>
Vanmills Medical Clinic	1900 Fowler Dr Mississauga ON L5K 0A1	NE	207.24	<u>50</u>
Dr. B. Demarchi DPC	1900 Fowler Drive, unit D107 Mississauga ON L5K0A1	NE	207.24	<u>50</u>
Vanmills Medical Clinic	1900 Fowler Dr Mississauga ON L5K 0A1	NE	207.24	<u>50</u>
Dr. B. Demarchi DPC	1900 Fowler Drive, unit D107 Mississauga ON L5K0A1	NE	207.24	<u>50</u>
Dr. B. Demarchi DPC	1900 Fowler Drive, unit D107 Mississauga ON L5K0A1	NE	207.24	<u>50</u>

Sherwin Williams Company	1910 Fowler Dr, Suite A104 Mississauga ON	ENE	210.40	51
Petro Canada	2185 Erin Mills Parkway Mississauga ON L5K 1T8	N	238.92	58

INC - Fuel Oil Spills and Leaks

A search of the INC database, dated Oct 2023 has found that there are 1 INC site(s) within approximately 0.25 kilometers of the project property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	Erin Mills Parkway & Fowler Drive, Mississauga ON	N	171.81	37

PES - Pesticide Register

A search of the PES database, dated Oct 2011 - Jan 31, 2026 has found that there are 10 PES site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
A-PRO-TEK EXTERMINATION SERVICES	2131 BOSACK COURT MISSISSAUGA ON L5K 2M1	SW	183.67	40
973822 ONTARIO LIMITED	2131 BOSACK COURT MISSISSAUGA ON L5K 2M1	SW	183.67	40
973822 ONTARIO LIMITED	2131 BOSACK CRT MISSISSAUGA ON L5K 2M1	SW	183.67	40
A-PRO-TEK EXTERMINATION SERVICES	2131 BOSACK COURT MISSISSAUGA ON L5K 2M1	SW	183.67	40
SWAT PEST CONTROL/FARRELL'S PEST CONTROL	2131 BUSACK COURT MISSISSAUGA ON	SW	183.67	40

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
973822 ONTARIO LIMITED	2131 BOSACK CRT MISSISSAUGA ON L5K 2M1	SW	183.83	41
973822 ONTARIO LIMITED	2131 BOSACK CRT MISSISSAUGA ON L5K2M1	SW	183.83	41
973822 ONTARIO LIMITED	2131 BOSACK CRT MISSISSAUGA ON L5K2M1	SW	183.83	41
973822 ONTARIO LIMITED	2131 BOSACK CRT MISSISSAUGA ON L5K2M1	SW	183.83	41
973822 ONTARIO LIMITED	2131 BOSACK CRT MISSISSAUGA ON L5K2M1	SW	183.83	41

PINC - Pipeline Incidents

A search of the PINC database, dated Feb 28, 2021 has found that there are 2 PINC site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	2132 Bosack Court, Mississauga ON	SW	201.27	46

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
PIPELINE HIT - 1"	1930 FOWLER DRIVE UNIT#100T., MISSISSAUGA,ON,L5K 0A1,CA ON	ENE	153.32	34

PRT - Private and Retail Fuel Storage Tanks

A search of the PRT database, dated 1989-1996* has found that there are 7 PRT site(s) within approximately 0.25 kilometers of the project property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
1085399 ONTARIO LTD ATT JIM MAZEROLLE	2185 LEANNE BLVD MISSISSAUGA ON L5K2L6	NNW	105.28	30

ERIN MILLS ESSO	2185 LEANNE BLVD MISSISSAUGA ON L5K 2L6	NNW	105.28	30
1109289 ONTARIO INC	2165 ERIN MILLS PKWY MISSISSAUGA ON L5K1T7	NNE	186.97	42
B K LAKEVIEW SERVICE LTD	2165 ERIN MILLS PKWY MISSISSAUGA ON L5K 1T7	NNE	186.97	42
MERVET ZAIA	2185 ERIN MILLS PKWY MISSISSAUGA ON L5K1T8	N	238.92	58
MYERS SELF SERVE	2185 ERIN MILLS PKWY MISSISSAUGA ON L5K 1T8	N	238.92	58
SOUTH WESTERN ONTARIO PROPANE DIV 998131 ONTARIO L	2185 ERIN MILLS PKWY MISSISSAUGA ON L5K 1T8	N	238.92	58

RSC - Record of Site Condition

A search of the RSC database, dated 1997-Sept 2001, Oct 2004 - 31 Jan, 2026 has found that there are 1 RSC site(s) within approximately 0.25 kilometers of the project property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
VANDYK-VANMILLS PLAZA INC.	2185 ERIN MILLS PKY ON MISSISSAUGA ON	N	238.92	58

RST - Retail Fuel Storage Tanks

A search of the RST database, dated 1999-Apr 30, 2025 has found that there are 4 RST site(s) within approximately 0.25 kilometers of the project property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
ESSO GENERATION	2185 LEANNE BLVD MISSISSAUGA ON L5K2L6	NNW	105.28	30
ESSO GENERATION	2185 LEANNE BLVD MISSISSAUGA ON L5K 2L6	NNW	105.28	30

SAM ASAAD SHELL GAS BAR	2165 ERIN MILLS PKY MISSISSAUGA ON L5K1T7	NNE	186.97	42
ROURKES DON SHELL CENTRE	2165 ERIN MILLS PKY MISSISSAUGA ON L5K1T7	NNE	186.97	42

SCT - Scott's Manufacturing Directories

A search of the SCT database, dated 1992-Mar 2011; Feb 2025 has found that there are 2 SCT site(s) within approximately 0.25 kilometers of the project property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Parhar Mohan Dr	2155 Leanne Blvd Mississauga ON L5K2K8	NE	45.26	13
Sherwin-Williams Paint Store	1910 Fowler Dr Suite A104 Mississauga ON L5K0A1	NNE	178.30	38

SPL - Ontario Spills

A search of the SPL database, dated 1988-Dec 2025 has found that there are 12 SPL site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	2118 Fowler Lane Mississauga ON	W	201.45	47

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
TRIMAC TRANSPORTATION SERVICES	ESSO PETROLEUM SERVICE STN # 401027 2185 LEANNE BLVD TANK TRUCK (CARGO) MISSISSAUGA CITY ON L5K 2L6	NNW	105.28	30
Enbridge Gas Distribution Inc.	1930 Fowler Drive, unit 100C Mississauga ON	ENE	153.32	34
SHELL CANADA PRODUCTS LTD.	AT SHELL SERVICE STATION AT 2165 ERIN MILLS PKWY. AT FOWLER RD. SERVICE STATION MISSISSAUGA CITY ON L5K 1T7	NNE	186.97	42

SHELL CANADA PRODUCTS LTD.	SHELL GAS STATION AT 2165 ERIN MILLS PARKWAY SERVICE STATION MISSISSAUGA CITY ON L5K 1T7	NNE	186.97	42
Shell Canada Limited	2165 Erin Mills Pkwy Toronto ON	NNE	186.97	42
2165 Erin Mills Parkway	2165 Erin Mills Pky Mississauga ON	NNE	186.97	42
SHELL CANADA PRODUCTS LTD.	2165 ERIN MILLS PARKWAY SERVICE STATION MISSISSAUGA CITY ON L5K 1T7	NNE	186.97	42
SHELL CANADA PRODUCTS LTD.	2165 ERIN MILLS (& FOWLER) SERVICE STATION MISSISSAUGA CITY ON L5K 1T7	NNE	186.97	42
Shell Canada OP Inc.	2165 Erin Mills Parkway Mississauga ON L5K 1T7	NNE	186.97	42
The Corporation of the City of Mississauga	1900 Fowler Drive Mississauga ON	NE	207.24	50
Petro-Canada	2185 Erin Mills Pkwy Mississauga ON L5K 1T8	N	238.92	58

WWIS - Water Well Information System

A search of the WWIS database, dated Jul 31, 2025 has found that there are 33 WWIS site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	2155 LEANNE BOULEVARD Mississauga ON <i>Well ID: 7263526</i>	NNW	25.24	2
	2155 LEANNE BOULEVARD Mississauga ON <i>Well ID: 7263524</i>	NW	28.76	4

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON	NW	29.31	<u>5</u>
	Well ID: 7256325			
	2155 LEANNE BLVD. Mississauga ON	NW	33.28	<u>6</u>
	Well ID: 7269910			
	2155 LEANNE BLVD. Mississauga ON	NW	33.45	<u>7</u>
	Well ID: 7269909			
	2155 LEANNE BLVD. Mississauga ON	NW	35.67	<u>8</u>
	Well ID: 7269907			
	ON	NW	35.97	<u>9</u>
	Well ID: 7253066			
	2155 LEANNE BLVD. Mississauga ON	NW	36.52	<u>10</u>
	Well ID: 7269911			
	2155 LEANNE BLVD. Mississauga ON	NW	38.44	<u>11</u>
	Well ID: 7269908			
	2155 LEANNE BLVD Mississauga ON	NNW	43.54	<u>12</u>
	Well ID: 7263530			
	2155 LEANNE BLVD MISSISSAUGA ON	WNW	45.61	<u>14</u>
	Well ID: 7190001			
	2155 LEANNE BLVD Mississauga ON	NNW	48.08	<u>16</u>
	Well ID: 7263529			
	2155 LEANNE BLVD Mississauga ON	NW	49.56	<u>17</u>
	Well ID: 7263531			
	2155 LEANNE BLVD MISSISSAUGA ON	W	77.26	<u>22</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	<i>Well ID:</i> 7190002			
	2155 LEANNE BLVD MISSISSAUGA ON	SSW	91.71	<u>26</u>
	<i>Well ID:</i> 7267399			
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	2155 LEANNE BLVD CLARKSON ON	NNE	27.41	<u>3</u>
	<i>Well ID:</i> 7220258			
	215 LEANNE BLVD MISSISSAUGA ON	NE	46.38	<u>15</u>
	<i>Well ID:</i> 7267489			
	2155 LEANNE BLVD MISSISSAUGA ON	E	62.94	<u>18</u>
	<i>Well ID:</i> 7267398			
	2155 LEANNE BLVD MISSISSAUGA ON	NNW	64.28	<u>19</u>
	<i>Well ID:</i> 7267410			
	2155 LEANNE BLVD MISSISSAUGA ON	N	65.16	<u>20</u>
	<i>Well ID:</i> 7267409			
	2155 LEANNE BOULEVARD Mississauga ON	NNW	70.16	<u>21</u>
	<i>Well ID:</i> 7263527			
	2155 LEANNE BLVD MISSISSAUGA ON	ENE	84.63	<u>23</u>
	<i>Well ID:</i> 7267400			
	2155 LEANNE BOULEVARD Mississauga ON	NW	85.06	<u>24</u>
	<i>Well ID:</i> 7263525			
	2155 LEANNE BOULEVARD MISSISSAUGA ON	NNW	95.23	<u>27</u>
	<i>Well ID:</i> 7263528			
	2185 LEANNE BLVD MISSISSAUGA ON	NW	104.78	<u>28</u>

Well ID: 7042139

2155 LEANNE BLVD MISSISSAUGA ON	N	105.24	<u>29</u>

Well ID: 7190000

ON	NE	146.76	<u>32</u>

Well ID: 7383918

1401 KING ST E COURTICE ON	NNE	168.98	<u>35</u>

Well ID: 7191831

ON	NNE	181.63	<u>39</u>

Well ID: 7189084

2165 ERIN MILLS PKWY lot 30 con 1 MISSISSAUGA ON	N	189.18	<u>43</u>

Well ID: 4910029

lot 12 con 3 ON	ENE	216.58	<u>53</u>


Well ID: 4907543

2165 ERIN MILLS PRWY PEEL Mississauga ON	N	224.75	<u>56</u>

Well ID: 7150023

2165 ERIN MILLS PKWY MISSISSAUGA ON	N	224.75	<u>56</u>


Well ID: 4909673

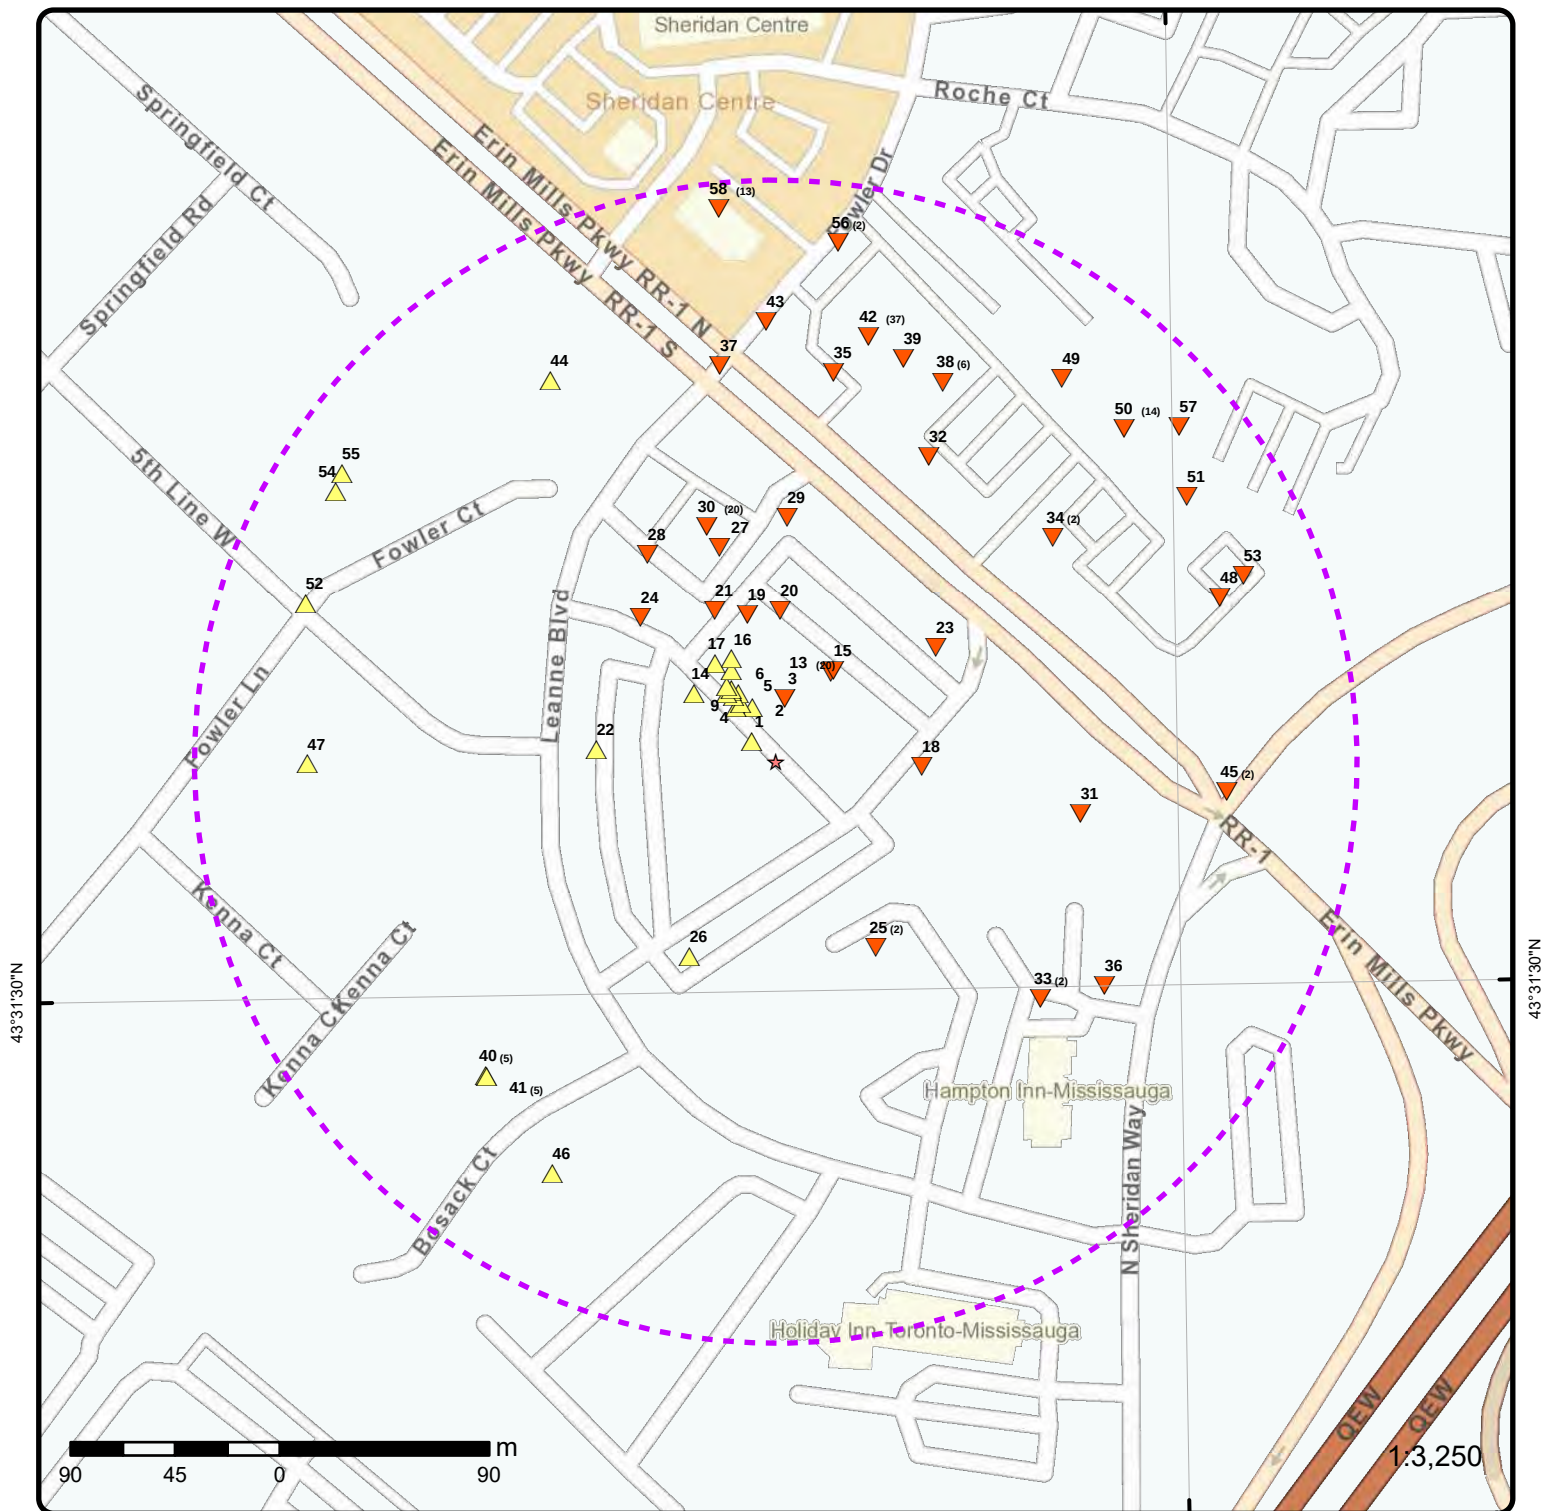

Map: 0.25 Kilometer Radius

Order Number: 26022500296

Address: 2155 Leanne Boulevard, Mississauga, ON

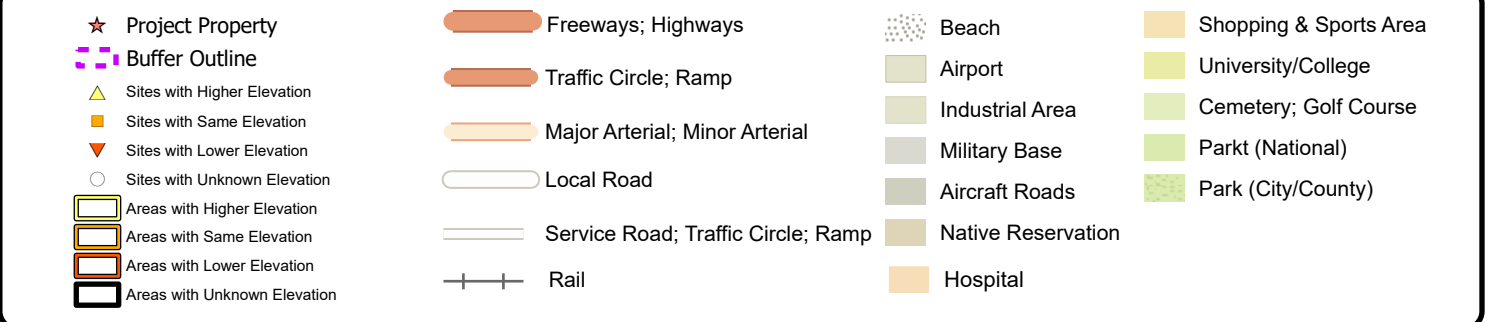

79°39'30"W

79°38'30"W

79°38'30"W

43°32'N


43°32'N

43°31'30"N

43°31'30"N

43°31'N

43°31'N

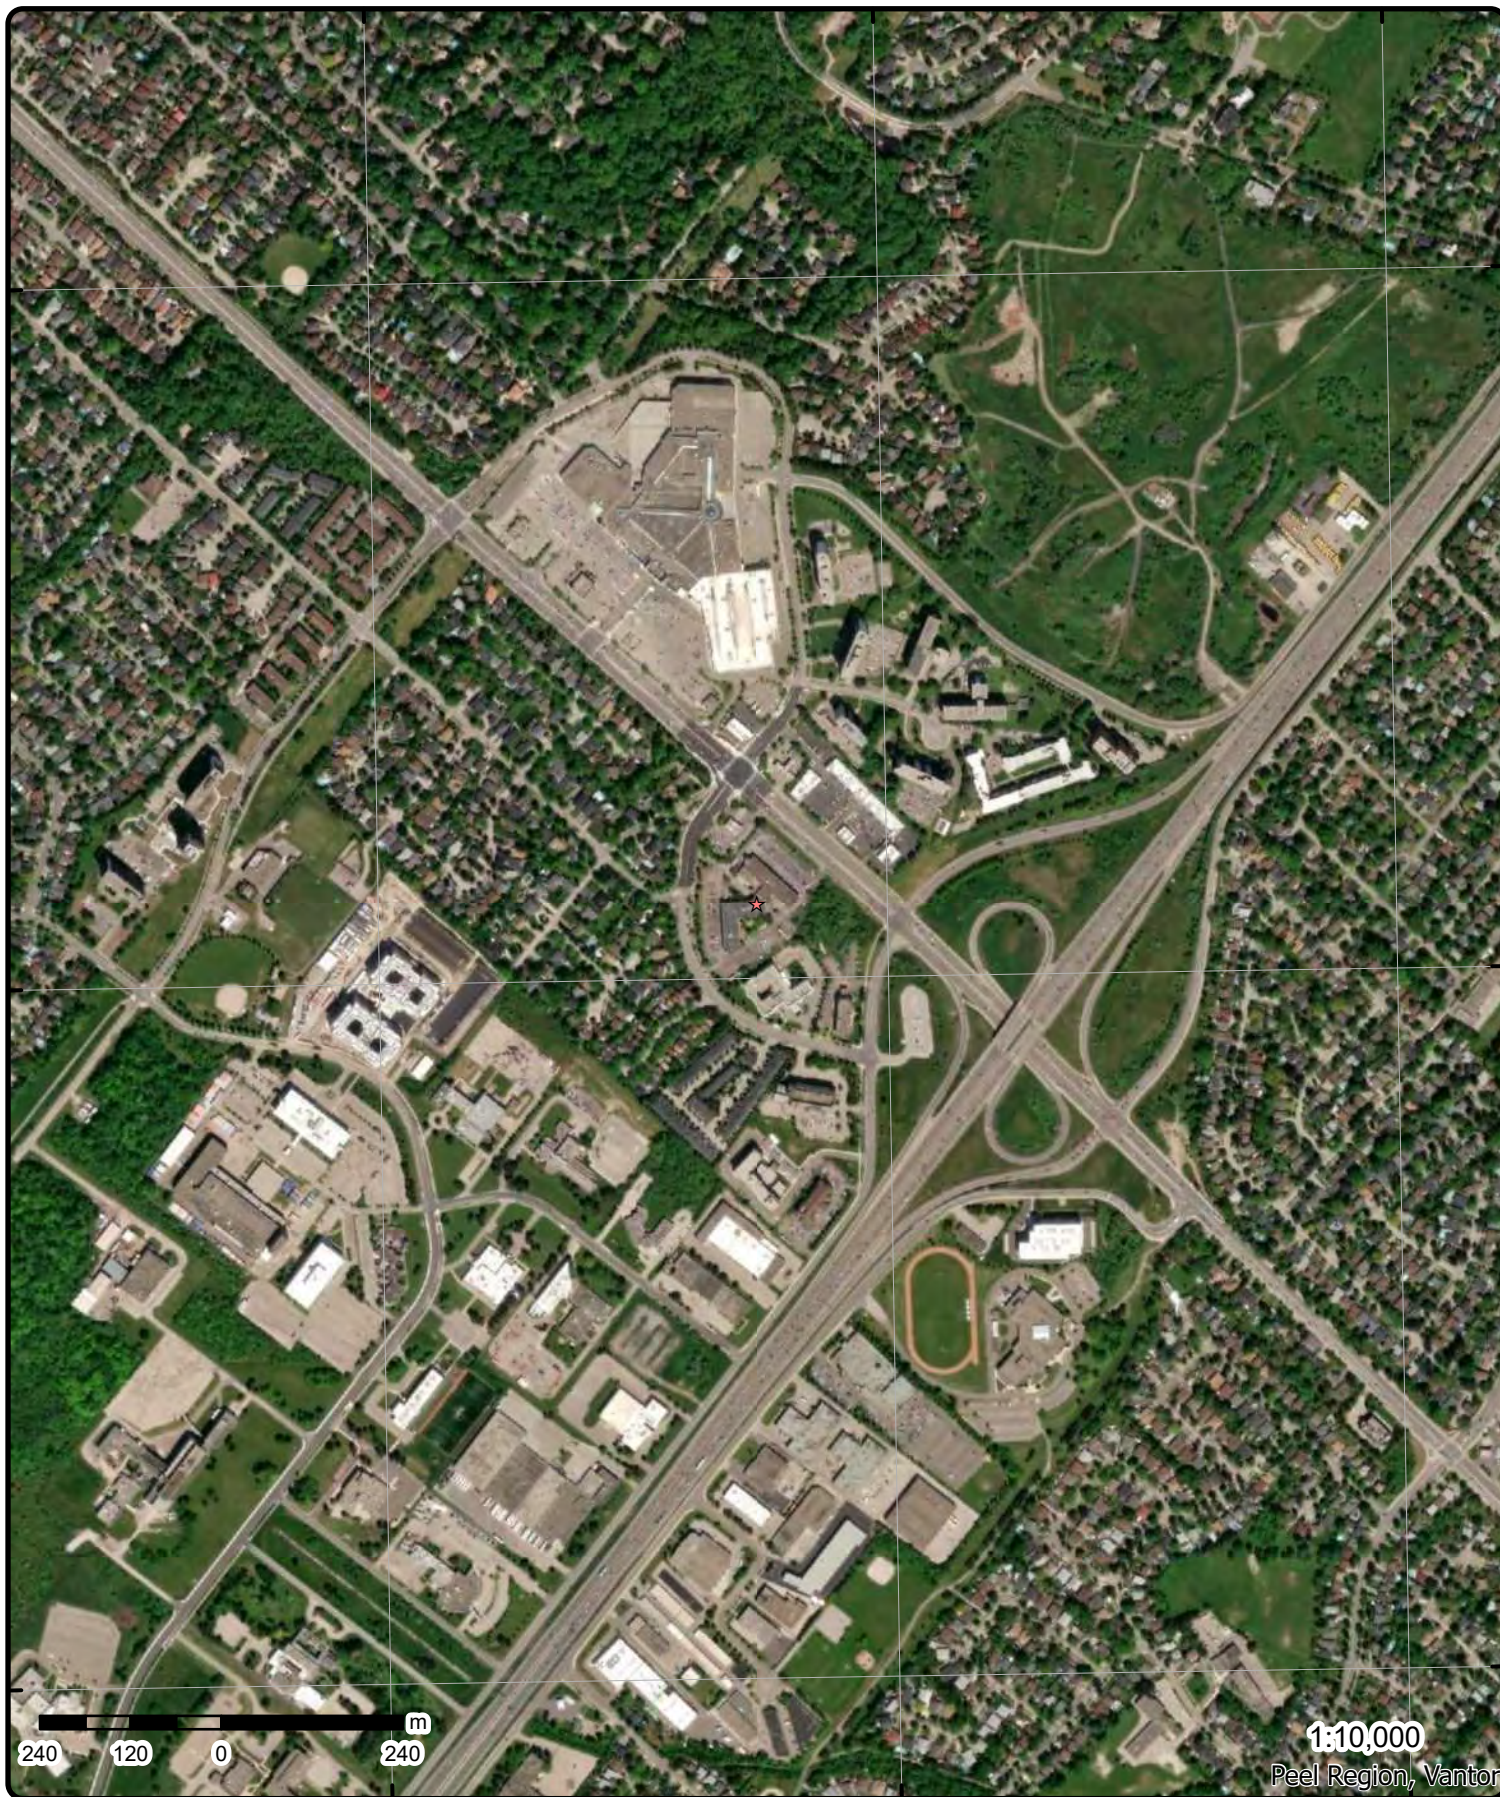

Aerial

Year: 2023


Order Number: 26022500296

Address: 2155 Leanne Boulevard, Mississauga, ON



Source: ESRI World Imagery

© ERIS Information Limited Partnership

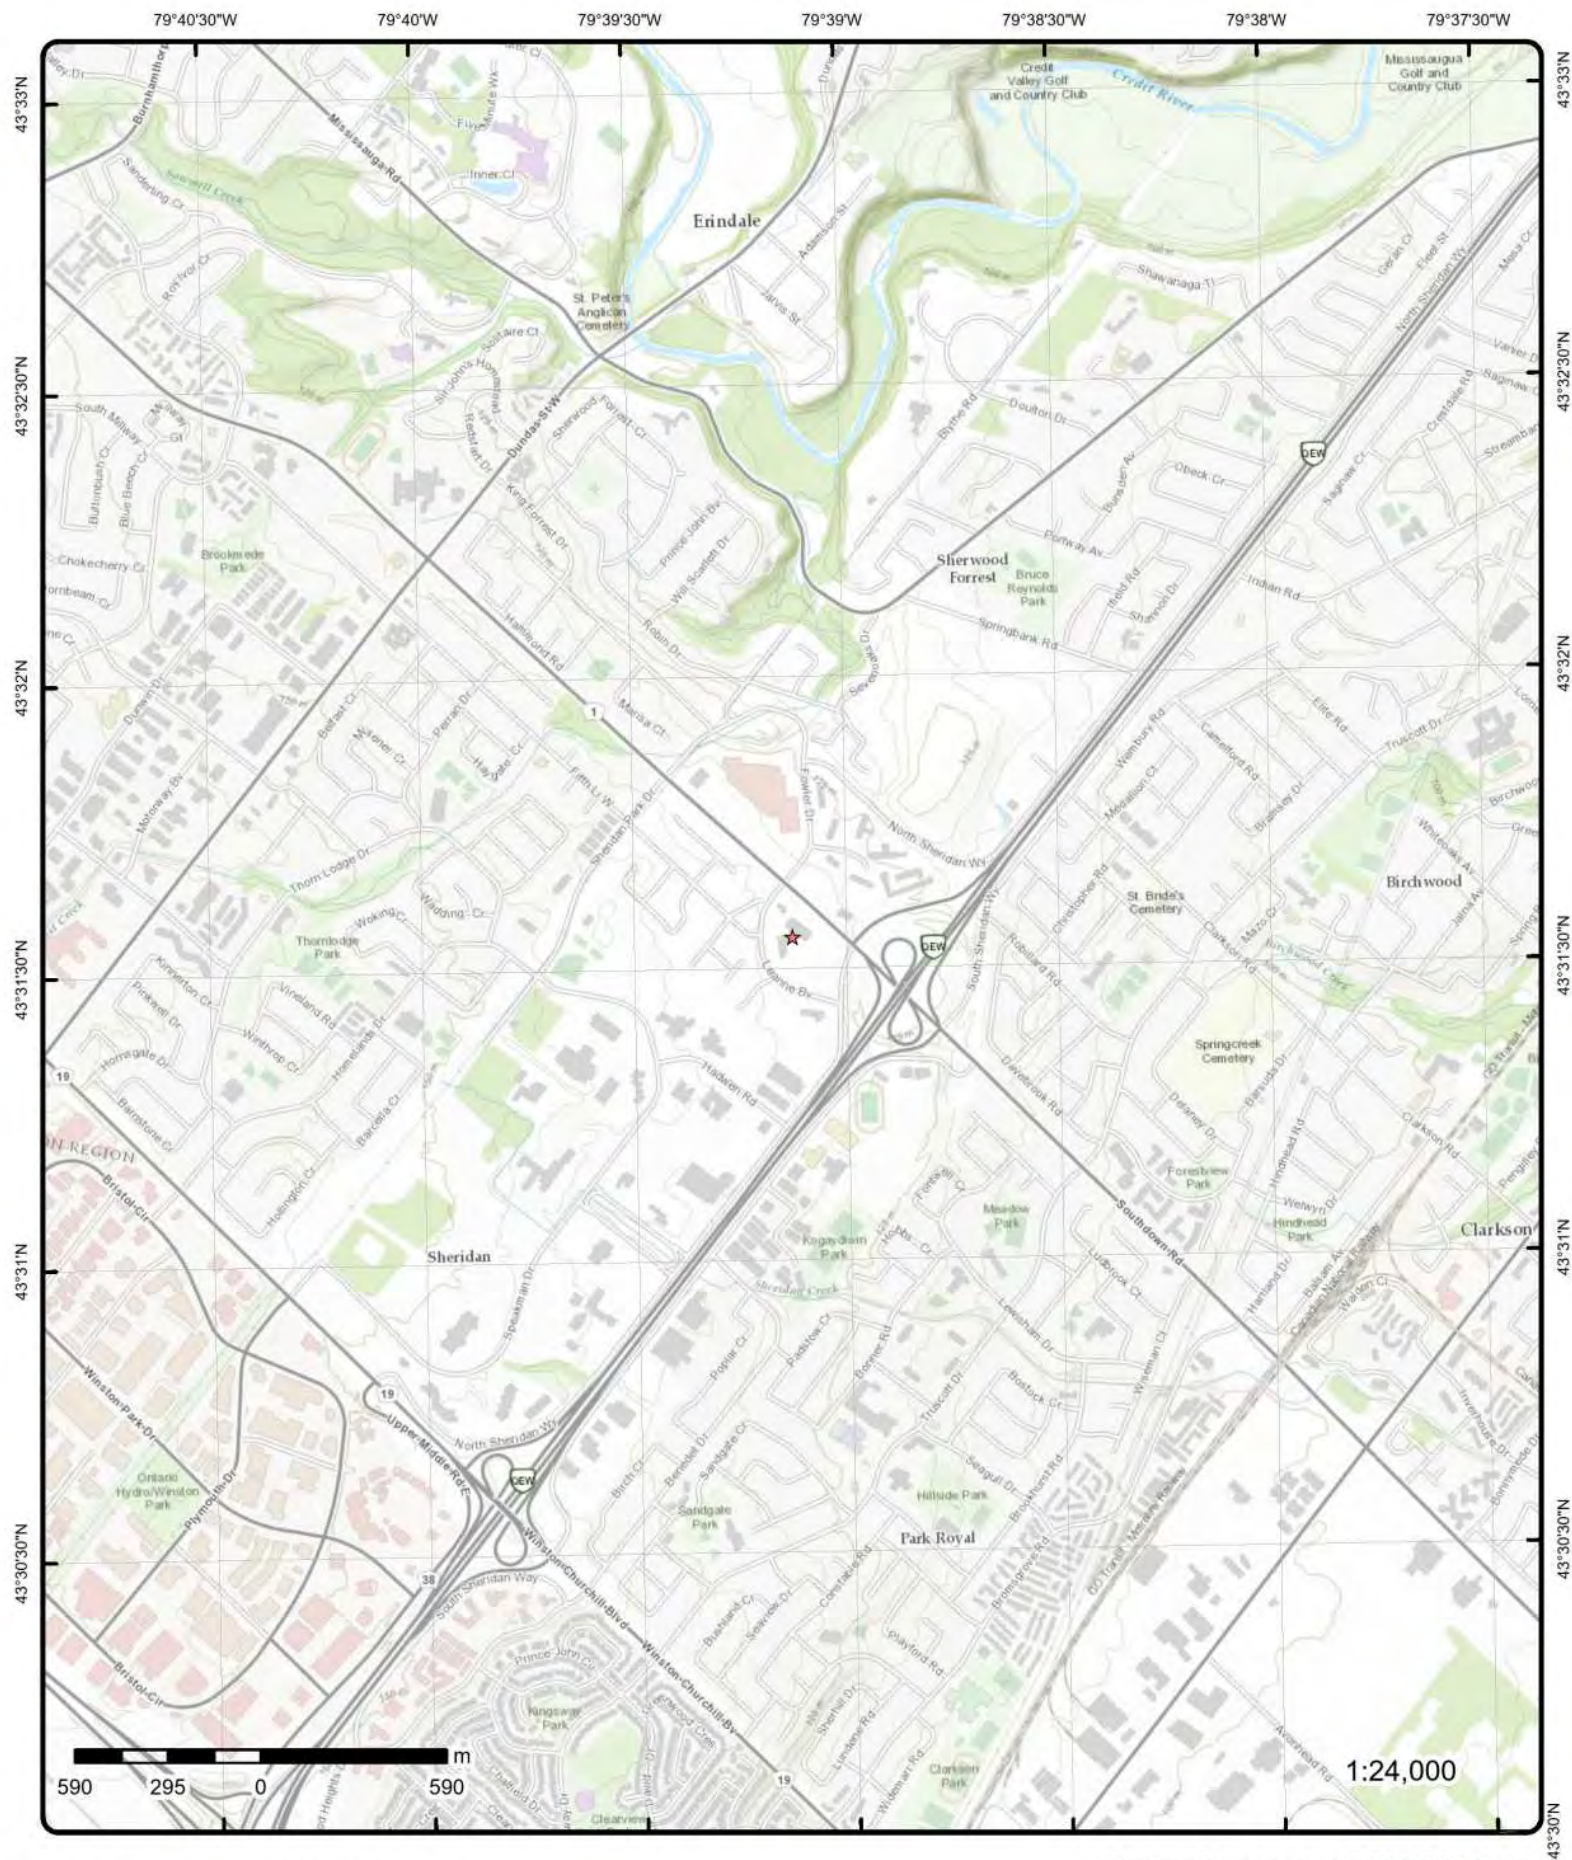

Topographic Map

Address: 2155 Leanne Boulevard, ON

Source: ESRI World Topographic Map

Order Number: 26022500296



© ERIS Information Limited Partnership

Detail Report

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
2	1 of 1	NNW/25.2	130.9 / 0.09	2155 LEANNE BOULEVARD Mississauga ON	WWIS
Well ID:		7263526	Flowing (Y/N):		
Construction Date:			Flow Rate:		
Use 1st:		Monitoring and Test Hole	Data Entry Status:		
Use 2nd:		0	Data Src:		
Final Well Status:		Monitoring and Test Hole	Date Received:		05/27/2016
Water Type:			Selected Flag:		TRUE
Casing Material:			Abandonment Rec:		
Audit No:		Z231599	Contractor:		7241
Tag:		A195070	Form Version:		7
Constructn Method:			Owner:		
Elevation (m):			County:		PEEL
Elevatn Reliabilty:			Lot:		
Depth to Bedrock:			Concession:		
Well Depth:			Concession Name:		
Overburden/Bedrock:			Easting NAD83:		
Pump Rate:			Northing NAD83:		
Static Water Level:			Zone:		
Clear/Cloudy:			UTM Reliability:		
Municipality:		MISSISSAUGA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/726\7263526.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		04/13/2016			
Year Completed:		2016			
Depth (m):		3.048			
Latitude:		43.5260977878436			
Longitude:		-79.6522566263408			
Point X:		-79.65225647655724			
Point Y:		43.526097785849814			
Path:		726\7263526.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1006012946	Elevation:		
DP2BR:			Elevrc:		
Spatial Status:			Zone:		17
Code OB:			East83:		608911.00
Code OB Desc:			North83:		4820122.00
Open Hole:			Org CS:		UTM83
Cluster Kind:			UTMRC:		4
Date Completed:		04/13/2016	UTMRC Desc:		margin of error : 30 m - 100 m
Remarks:			Location Method:		wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006119221			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		3.0			
Formation End Depth:		10.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006119220			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		3.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006119231			
Layer:		3			
Plug From:		3.0			
Plug To:		10.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006119229			
Layer:		1			
Plug From:		0.0			
Plug To:		0.5			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006119230			
Layer:		2			
Plug From:		0.5			
Plug To:		3.0			
Plug Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006119228			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006119219			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006119224			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		4.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006119225			
Layer:		1			
Slot:		10			
Screen Top Depth:		4.0			
Screen End Depth:		10.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.25			
<u>Water Details</u>					
Water ID:		1006119223			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006119222			
Diameter:		6.0			
Depth From:		0.0			
Depth To:		10.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>3</u>	1 of 1	NNE/27.4	130.7 / -0.14	2155 LEANNE BLVD CLARKSON ON	WWIS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well ID:	7220258			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	05/14/2014
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z158168			Contractor:	6032
Tag:	A138135			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/722\7220258.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	07/08/2013				
Year Completed:	2013				
Depth (m):	6.096				
Latitude:	43.5261317528323				
Longitude:	-79.6520826255074				
Point X:	-79.65208247653231				
Point Y:	43.52613175089155				
Path:	722\7220258.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1004753441			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	608925.00
Code OB Desc:				North83:	4820126.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	07/08/2013			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1005148733				
Layer:	2				
Color:	3				
General Color:	BLUE				
Material 1:	17				
Material 1 Desc:	SHALE				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 2:					
Material 2 Desc:					
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		10.0			
Formation End Depth:		20.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1005148732			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		0.0			
Formation End Depth:		10.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1005148741			
Layer:		2			
Plug From:		1.0			
Plug To:		4.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1005148740			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1005148739			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005148731			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005148736			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		5.0			
Casing Diameter:		1.7999999523162842			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1005148737			
Layer:		1			
Slot:					
Screen Top Depth:		5.0			
Screen End Depth:		20.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.0			
 <u>Water Details</u>					
Water ID:		1005148735			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
 <u>Hole Diameter</u>					
Hole ID:		1005148734			
Diameter:		8.0			
Depth From:		0.0			
Depth To:		20.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
4	1 of 1	NW/28.8	130.9 / 0.04	2155 LEANNE BOULEVARD Mississauga ON	WWIS
Well ID:	7263524			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	05/27/2016
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z231598			Contractor:	7241
Tag:	A197680			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY				
Site Info:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/726\7263524.pdf			
Additional Detail(s) (Map)					
Well Completed Date:	04/13/2016				
Year Completed:	2016				
Depth (m):	3.6576				
Latitude:	43.5260988087769				
Longitude:	-79.6523432258154				
Point X:	-79.65234307591962				
Point Y:	43.52609880649255				
Path:	726\7263524.pdf				
Bore Hole Information					
Bore Hole ID:	1006012940		Elevation:		
DP2BR:			Elevrc:		
Spatial Status:			Zone:		17
Code OB:			East83:		608904.00
Code OB Desc:			North83:		4820122.00
Open Hole:			Org CS:		UTM83
Cluster Kind:			UTMRC:		4
Date Completed:	04/13/2016		UTMRC Desc:		margin of error : 30 m - 100 m
Remarks:			Location Method:		wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
Overburden and Bedrock Materials Interval					
Formation ID:	1006119094				
Layer:	1				
Color:	6				
General Color:	BROWN				
Material 1:	06				
Material 1 Desc:	SILT				
Material 2:	28				
Material 2 Desc:	SAND				
Material 3:	77				
Material 3 Desc:	LOOSE				
Formation Top Depth:	0.0				
Formation End Depth:	3.0				
Formation End Depth UOM:	ft				
Overburden and Bedrock Materials Interval					
Formation ID:	1006119095				
Layer:	2				
Color:	2				
General Color:	GREY				
Material 1:	06				
Material 1 Desc:	SILT				
Material 2:	05				
Material 2 Desc:	CLAY				
Material 3:	66				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3 Desc:		DENSE			
Formation Top Depth:		3.0			
Formation End Depth:		11.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006119096			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		17			
Material 1 Desc:		SHALE			
Material 2:					
Material 2 Desc:					
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		11.0			
Formation End Depth:		12.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006119105			
Layer:		2			
Plug From:		0.5			
Plug To:		3.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006119106			
Layer:		3			
Plug From:		3.0			
Plug To:		12.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006119104			
Layer:		1			
Plug From:		0.0			
Plug To:		0.5			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1006119103			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1006119093			
Casing No:		0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Comment: Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006119099			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		4.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006119100			
Layer:		1			
Slot:		10			
Screen Top Depth:		4.0			
Screen End Depth:		12.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.25			
<u>Water Details</u>					
Water ID:		1006119098			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006119097			
Diameter:		6.0			
Depth From:		0.0			
Depth To:		12.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
6 1 of 1 NW/33.3 130.9 / 0.08 2155 LEANNE BLVD. Mississauga ON WWIS					
Well ID:	7269910			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	08/24/2016
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	Z235170			Contractor:	7241
Tag:				Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY			
Site Info:		WKQ-009175 A0-A0			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/726\7269910.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		07/12/2016			
Year Completed:		2016			
Depth (m):					
Latitude:		43.526152673517			
Longitude:		-79.6523296518349			
Point X:		-79.65232950237525			
Point Y:		43.52615267170204			
Path:		726\7269910.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1006225633		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	608905.00
Code OB Desc:				North83:	4820128.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		07/12/2016		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006250167			
Layer:					
Color:					
General Color:					
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006250175			
Laver:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug From:		0.0			
Plug To:		0.5			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006250176			
Layer:		2			
Plug From:		0.5			
Plug To:		16.0			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1006250174			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1006250166			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1006250170			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:					
Casing Diameter:		1.25			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1006250171			
Layer:		1			
Slot:					
Screen Top Depth:					
Screen End Depth:		16.0			
Screen Material:					
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:					
 <u>Water Details</u>					
Water ID:		1006250169			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1006250168			
Diameter:					
Depth From:					
Depth To:					
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
7	1 of 1	NW/33.4	130.9 / 0.08	2155 LEANNE BLVD. Mississauga ON	WWIS
Well ID:	7269909			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	08/24/2016
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	Z235171			Contractor:	7241
Tag:				Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY				
Site Info:	WKQ-009175 A0-A0				
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/726\7269909.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	07/12/2016				
Year Completed:	2016				
Depth (m):					
Latitude:	43.5261439634394				
Longitude:	-79.652354594999				
Point X:	-79.65235444499027				
Point Y:	43.52614396078362				
Path:	726\7269909.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1006225627			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	608903.00
Code OB Desc:				North83:	4820127.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	07/12/2016			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006250156			
Layer:					
Color:					
General Color:					
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006250164			
Layer:		1			
Plug From:		0.0			
Plug To:		0.5			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006250165			
Layer:		2			
Plug From:		0.5			
Plug To:		20.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006250163			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006250155			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006250159			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006250160			
Layer:		1			
Slot:					
Screen Top Depth:					
Screen End Depth:		20.0			
Screen Material:					
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:					
<u>Water Details</u>					
Water ID:		1006250158			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006250157			
Diameter:					
Depth From:					
Depth To:					
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
8	1 of 1	NW/35.7	130.9 / 0.08	2155 LEANNE BLVD. Mississauga ON	WWIS
Well ID:	7269907			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	08/24/2016
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	Z235169			Contractor:	7241
Tag:				Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY				
Site Info:	WKQ-009175 A0-A0				
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/726\7269907.pdf				
<u>Additional Detail(s) (Map)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well Completed Date:		07/12/2016			
Year Completed:		2016			
Depth (m):					
Latitude:		43.5261621128086			
Longitude:		-79.652366565497			
Point X:		-79.65236641503603			
Point Y:		43.52616211081156			
Path:		726\7269907.pdf			
 <u>Bore Hole Information</u>					
Bore Hole ID:	1006225621			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	608902.00
Code OB Desc:				North83:	4820129.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	07/12/2016			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006250135				
Layer:					
Color:					
General Color:					
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1006250143				
Layer:	1				
Plug From:	0.0				
Plug To:	0.5				
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1006250144				
Layer:	2				
Plug From:	0.5				
Plug To:	19.0				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006250142			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006250134			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006250138			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:					
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006250139			
Layer:		1			
Slot:					
Screen Top Depth:					
Screen End Depth:		19.0			
Screen Material:					
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:					
<u>Water Details</u>					
Water ID:		1006250137			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006250136			
Diameter:					
Depth From:					
Depth To:					
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:					
		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:					
		1006250186			
Layer:					
		1			
Plug From:					
		0.0			
Plug To:					
		6.0			
Plug Depth UOM:					
		ft			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:					
		1006250185			
Method Construction Code:					
		D			
Method Construction:					
		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:					
		1006250177			
Casing No:					
		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:					
		1006250181			
Layer:					
		1			
Material:					
		5			
Open Hole or Material:					
		PLASTIC			
Depth From:					
		10.0			
Depth To:					
Casing Diameter:					
		1.5			
Casing Diameter UOM:					
		inch			
Casing Depth UOM:					
		ft			
<u>Construction Record - Screen</u>					
Screen ID:					
		1006250182			
Layer:					
		1			
Slot:					
Screen Top Depth:					
Screen End Depth:					
		6.0			
Screen Material:					
Screen Depth UOM:					
		ft			
Screen Diameter UOM:					
		inch			
Screen Diameter:					
<u>Water Details</u>					
Water ID:					
		1006250180			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer: Kind Code: Kind: Water Found Depth: Water Found Depth UOM: ft					
Hole Diameter					
Hole ID: Diameter: Depth From: Depth To: Hole Depth UOM: Hole Diameter UOM: ft inch					
11	1 of 1	NW/38.4	130.9 / 0.08	2155 LEANNE BLVD. Mississauga ON	WWIS
Well ID: Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: Tag: Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:		7269908 Not Used Abandoned-Other Z213282 </			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Remarks:				Location Method:	WWW
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006250146			
Layer:					
Color:					
General Color:					
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006250153			
Layer:		1			
Plug From:		0.0			
Plug To:		0.5			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006250154			
Layer:		2			
Plug From:		0.5			
Plug To:		15.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1006250152			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006250145			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing ID: 1006250149					
Layer: 1					
Material: 5					
Open Hole or Material: PLASTIC					
Depth From: 0.0					
Depth To:					
Casing Diameter: 2.0					
Casing Diameter UOM: inch					
Casing Depth UOM: ft					
<u>Construction Record - Screen</u>					
Screen ID: 1006250150					
Layer: 1					
Slot:					
Screen Top Depth:					
Screen End Depth: 15.0					
Screen Material:					
Screen Depth UOM: ft					
Screen Diameter UOM: inch					
Screen Diameter:					
<u>Water Details</u>					
Water ID: 1006250148					
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM: ft					
<u>Hole Diameter</u>					
Hole ID: 1006250147					
Diameter:					
Depth From:					
Depth To:					
Hole Depth UOM: ft					
Hole Diameter UOM: inch					
12	1 of 1	NNW/43.5	131.0 / 0.12	2155 LEANNE BLVD Mississauga ON	WWIS
Well ID: 7263530					
Construction Date:					
Use 1st: Monitoring and Test Hole					
Use 2nd: 0					
Final Well Status: Monitoring and Test Hole					
Water Type:					
Casing Material:					
Audit No: Z231404					
Tag: A197825					
Constructn Method:					
Elevation (m):					
Elevatn Reliability:					
Depth to Bedrock:					
Well Depth:					
Overburden/Bedrock:					
Pump Rate:					
Static Water Level:					
Clear/Cloudy:					
Municipality: MISSISSAUGA CITY					
Flowing (Y/N):					
Flow Rate:					
Data Entry Status:					
Data Src:					
Date Received: 05/27/2016					
Selected Flag: TRUE					
Abandonment Rec:					
Contractor: 7241					
Form Version: 7					
Owner:					
County: PEEL					
Lot:					
Concession:					
Concession Name:					
Easting NAD83:					
Northing NAD83:					
Zone:					
UTM Reliability:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Info:		WKQ-008900			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/726\7263530.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		04/20/2016			
Year Completed:		2016			
Depth (m):		3.9624			
Latitude:		43.5262431286842			
Longitude:		-79.6523647615995			
Point X:		-79.65236461211067			
Point Y:		43.5262431267199			
Path:		726\7263530.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1006012986		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				17	
Code OB Desc:				East83:	
Open Hole:				608902.00	
Cluster Kind:				North83:	
Date Completed:		04/20/2016		4820138.00	
Remarks:				Org CS:	
Location Method Desc:		on Water Well Record		UTM83	
Elevrc Desc:				UTMRC:	
Location Source Date:				4	
Improvement Location Source:				UTMRC Desc:	
Improvement Location Method:				margin of error : 30 m - 100 m	
Source Revision Comment:				Location Method:	
Supplier Comment:				wwr	
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006120222			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		4.0			
Formation End Depth:		13.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006120220			
Layer:		1			
Color:		2			
General Color:		GREY			
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.5			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006120221			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		01			
Material 1 Desc:		FILL			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.5			
Formation End Depth:		4.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006120230			
Layer:		1			
Plug From:		0.0			
Plug To:		0.5			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006120231			
Layer:		2			
Plug From:		0.5			
Plug To:		5.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006120232			
Layer:		3			
Plug From:		5.0			
Plug To:		13.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1006120229			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006120219			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing No: Comment: Alt Name:		0			
<u>Construction Record - Casing</u>					
Casing ID:		1006120225			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		6.0			
Casing Diameter:		1.5			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006120226			
Layer:		1			
Slot:		10			
Screen Top Depth:		6.0			
Screen End Depth:		13.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.75			
<u>Water Details</u>					
Water ID:		1006120224			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006120223			
Diameter:		3.5			
Depth From:		0.0			
Depth To:		13.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			

[13](#)

1 of 20

NE/45.3

129.8 / -0.98

BRIDLEWOOD CLEANERS INC
2155 LEANNE BLVD UNIT 1-2
MISSISSAUGA ON L5K2K8

CDRY

Legal Name of Company:

Region:

Type of Reporter:

Waste Quantity by Year

Reporting Year: 2005
Quantity of PERC (kg): 118
Total Waste Water (kg): 0
Total Waste Water (L): -
Total Residue (kg): 90

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Total Residue (L): - Total Mix (kg): 0 Total Mix (L): - Request for Confidentiality: No Reason for Confidentiality: N/A Reporting Year: 2004 Quantity of PERC (kg): 325 Total Waste Water (kg): - Total Waste Water (L): 184 Total Residue (kg): - Total Residue (L): 332 Total Mix (kg): 0 Total Mix (L): - Request for Confidentiality: No Reason for Confidentiality: N/A					
13	2 of 20	NE/45.3	129.8 / -0.98	2155 Leanne Boulevard Mississauga ON L5K 2K8	EHS
Order No: 20061102030 Status: C Report Type: Custom Report Report Date: 11/13/2006 Date Received: 11/2/2006 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps And /or Site Plans Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): 0.25 X: -79.652218 Y: 43.526038					
13	3 of 20	NE/45.3	129.8 / -0.98	2155 Leanne Boulevard Mississauga ON L5K 2K8	EHS
Order No: 20120904012 Status: C Report Type: Custom Report Report Date: 05-SEP-12 Date Received: 04-SEP-12 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.652125 Y: 43.526582					
13	4 of 20	NE/45.3	129.8 / -0.98	BRIDLEWOOD CLEANERS 2155 LEANNE BOULEVARD MISSISSAUGA ON L5K 2K8	GEN
Generator Info Generator No: ON0414700 Approval Years: 86,87,88,89,90 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: *** NOT DEFINED ***					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 0000					
13	5 of 20	NE/45.3	129.8 / -0.98	BRIDLEWOOD (SEE & USE ON0434300) 2155 LEANNE BOULEVARD	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
MISSISSAUGA ON L5K 2K8					
<u>Generator Info</u>					
Generator No:	ON0414700			Choice of Contact:	
Approval Years:	92,93,94			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	0000
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	*** NOT DEFINED ***				
13	6 of 20	NE/45.3	129.8 / -0.98	BRIDLEWOOD CLEANERS INC. 2155 LEANNE BOULEVARD MISSISSAUGA ON L5K 2K8	GEN
<u>Generator Info</u>					
Generator No:	ON0434300			Choice of Contact:	
Approval Years:	86,87,88,89,90			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	9721
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	POWER LAUND./CLEANERS				
<u>Waste Detail(s)</u>					
Waste Class:	241				
Waste Class Name:	HALOGENATED SOLVENTS				
13	7 of 20	NE/45.3	129.8 / -0.98	BRIDLEWOOD CLEANERS INC. 2155 LEANNE BOULEVARD MISSISSAUGA ON L5K 2K8	GEN
<u>Generator Info</u>					
Generator No:	ON0434300			Choice of Contact:	
Approval Years:	92,93,97,98,99,00,01,02,03,04,05,06,07,08			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	9721
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	POWER LAUND./CLEANER				
<u>Waste Detail(s)</u>					
Waste Class:	213				
Waste Class Name:	PETROLEUM DISTILLATES				
<u>Waste Detail(s)</u>					
Waste Class:	241				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		HALOGENATED SOLVENTS			
13	8 of 20	NE/45.3	129.8 / -0.98	BRIDLEWOOD CLEANERS INC. 06-078 2155 LEANNE BOULEVARD MISSISSAUGA ON L5K 2K8	GEN
<u>Generator Info</u>					
Generator No:		ON0434300		Choice of Contact:	
Approval Years:		94,95,96		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code: 9721	
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		POWER LAUND./CLEANER			
<u>Waste Detail(s)</u>					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
13	9 of 20	NE/45.3	129.8 / -0.98	BRIDLEWOOD CLEANERS INC. 2155 LEANNE BOULEVARD MISSISSAUGA ON L5K 2K8	GEN
<u>Generator Info</u>					
Generator No:		ON0434300		Choice of Contact:	
Approval Years:		2009		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code: 812320	
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		Dry Cleaning and Laundry Services (except Coin-Operated)			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
13	10 of 20	NE/45.3	129.8 / -0.98	BRIDLEWOOD CLEANERS INC. 2155 LEANNE BOULEVARD MISSISSAUGA ON L5K 2K8	GEN
<u>Generator Info</u>					
Generator No:		ON0434300		Choice of Contact:	
Approval Years:		2010		Contaminated Fac:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: MHSW Facility: SIC Code: 812320 Dry Cleaning and Laundry Services (except Coin-Operated)					
Waste Detail(s) Waste Class: Waste Class Name: 213 PETROLEUM DISTILLATES Waste Detail(s) Waste Class: Waste Class Name: 241 HALOGENATED SOLVENTS					
13	11 of 20	NE/45.3	129.8 / -0.98	BRIDLEWOOD DRY CLEANERS INC. 1-2155 LEANNE BLVD MISSISSAUGA ON L5K 2K8	GEN
Generator Info Generator No: Approval Years: Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: ON4562965 2011 Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 812320					
13	12 of 20	NE/45.3	129.8 / -0.98	BRIDLEWOOD DRY CLEANERS INC. 1-2155 LEANNE BLVD MISSISSAUGA ON L5K 2K8	GEN
Generator Info Generator No: Approval Years: Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: ON4562965 2012 Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 812320 Dry Cleaning and Laundry Services (except Coin-Operated)					
13	13 of 20	NE/45.3	129.8 / -0.98	BRIDLEWOOD DRY CLEANERS INC. 1-2155 LEANNE BLVD MISSISSAUGA ON	GEN
Generator Info Generator No: Approval Years: Status: ON4562965 2013 Choice of Contact: Contaminated Fac: MHSW Facility:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PO Box No: Country: Co Admin: Phone No Admin: SIC Description:					
				SIC Code: 812320	
DRY CLEANING AND LAUNDRY SERVICES (EXCEPT COIN-OPERATED)					
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
13	14 of 20	NE/45.3	129.8 / -0.98	BRIDLEWOOD DRY CLEANERS INC. 1-2155 LEANNE BLVD MISSISSAUGA ON L5K 2K8	GEN
<u>Generator Info</u>					
Generator No:		ON4562965		Choice of Contact:	CO_OFFICIAL
Approval Years:		2016		Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	812320
Country:		Canada			
Co Admin:					
Phone No Admin:					
SIC Description:		DRY CLEANING AND LAUNDRY SERVICES (EXCEPT COIN-OPERATED)			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
13	15 of 20	NE/45.3	129.8 / -0.98	8989613 2155 Leanne blvd suite 115 mississauga ON L5K 2K8	GEN
<u>Generator Info</u>					
Generator No:		ON3864357		Choice of Contact:	CO_OFFICIAL
Approval Years:		2016		Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	621110
Country:		Canada			
Co Admin:		ATIF AQEEL			
Phone No Admin:		9059160300 Ext.			
SIC Description:		OFFICES OF PHYSICIANS			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
13	16 of 20	NE/45.3	129.8 / -0.98	BRIDLEWOOD DRY CLEANERS INC. 1-2155 LEANNE BLVD MISSISSAUGA ON L5K 2K8	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON4562965			Choice of Contact:	CO_OFFICIAL
Approval Years:	2015			Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	812320
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:	DRY CLEANING AND LAUNDRY SERVICES (EXCEPT COIN-OPERATED)				
<u>Waste Detail(s)</u>					
Waste Class:	213				
Waste Class Name:	PETROLEUM DISTILLATES				
13	17 of 20	NE/45.3	129.8 / -0.98	BRIDLEWOOD DRY CLEANERS INC. 1-2155 LEANNE BLVD MISSISSAUGA ON L5K 2K8	GEN
<u>Generator Info</u>					
Generator No:	ON4562965			Choice of Contact:	CO_OFFICIAL
Approval Years:	2014			Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	812320
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:	DRY CLEANING AND LAUNDRY SERVICES (EXCEPT COIN-OPERATED)				
<u>Waste Detail(s)</u>					
Waste Class:	213				
Waste Class Name:	PETROLEUM DISTILLATES				
13	18 of 20	NE/45.3	129.8 / -0.98	Atlas Fin-Quest Inc. 2155 Leanne Blvd Mississauga ON L5K2K8	GEN
<u>Generator Info</u>					
Generator No:	ON5508407			Choice of Contact:	
Approval Years:	As of Oct 2019			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:	251 L				
Waste Class Name:	Waste oils/sludges (petroleum based)				
<u>2019 Generator Info</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Gen No: ID: Contaminated Fac: MHSW Facility: NAICS Code1: NAICS Code2: NAICS Code3: Gen Name: Gen Div: Gen Op Name: Gen Op Div: Site Adrs1: Site Bldg: Site Pobox: Province In: Site Adrs2: Site City: Province Out: Site Postal Code: Site Country: Co Official: Co Admin:	ON5508407 22001 N N 532310 Atlas Fin-Quest Inc. Atlas Fin-Quest Inc. Atlas Fin-Quest Inc. 2155 Leanne Blvd ONTARIO Mississauga L5K2K8 Canada Tony Sang			Choice of Contact: Phone No Official: Phone No Admin: County Ont: County Out: District:	CO_OFFICIAL 905-855-8889 Ext. PEEL (R. M.) 305

13	19 of 20	NE/45.3	129.8 / -0.98	Prime Real Estate Group Inc. 2155 Leanne Blvd. Mississauga ON L5K 2K8	GEN

Generator Info

Generator No: Approval Years: Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description:	ON4596723 As of Jan 2021 Registered Canada	Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:

Waste Detail(s)

Waste Class:	252 L
Waste Class Name:	Waste crankcase oils and lubricants

2020 Generator Info

Gen No: ID: Contaminated Fac: MHSW Facility: NAICS Code1: NAICS Code2: NAICS Code3: Gen Name: Gen Div: Gen Op Name: Gen Op Div: Site Adrs1: Site Bldg: Site Pobox: Province In:	ON4596723 17985 N N 531310 Prime Real Estate Group Inc. Prime Real Estate Group Inc. Prime Real Estate Group Inc. 2155 Leanne Blvd. ONTARIO	Choice of Contact: Phone No Official: Phone No Admin: County Ont: County Out: District:	CO_ADMIN 4379139262 Ext. 439139013 Ext. LAMBTON 103

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Adrs2: Site City:Mississauga Province Out: Site Postal Code:L5K 2K8 Site Country:Canada Co Official:Gabriela Reid Co Admin:Kerri Constable					
2020 Generator Manifest					
ID:38087				Sum Received Qty:900.0	
Generator No:ON4596723				Waste Class Name:WASTE OILS & LUBRICANTS	
Receiver Type:035				Count Manifests:2	
Waste Char:L				District:302	
Waste Code:252					
13	20 of 20	NE/45.3	129.8 / -0.98	Parhar Mohan Dr 2155 Leanne Blvd Mississauga ON L5K2K8	SCT
Scott S ID:304038697					
Latitude:43.5257493					
Longitude:-79.6527097					
Details					
Bus Type 1:Educational Services				Employee Count:1	
Bus Type 2:Health Services				Square Footage:0	
Bus Type 3:Manufacturer				Estimated Sales:Under \$1 Million	
Product Cat 1:Dentist				Export Indicator:	
Product Cat 2:				Export Country 1:	
Product Cat 3:				Export Country 2:	
Product Cat 4:				Export Country 3:	
Product Cat 5:				Export Country 4:	
Product Cat 6:				Export Country 5:	
Product Cat 7:				Export Country 6:	
Product Cat 8:				Geocoded by:Address	
Company Name:Parhar Mohan Dr					
Address Line 1:2155 Leanne Blvd					
Address Line 2:					
City:Mississauga					
Province:ON					
Postal Code:L5K2K8					
Census Division:Peel Regional Municipality; ON					
Metro Area:Toronto					
Year Established:1988					
Head Office Indicator:					
Parent Company Nm:					
Parent Cmpny Addr 1:					
Parent Cmpny Addr 2:					
Parent Cmpny City:					
Parent Cmpny Prov:					
Parent Cmpy PC:					
Parent Cmpy Cntry:					
Head Office Nm:					
H Office Addr Line 1:					
H Office Addr Line 2:					
Head Office City:					
Head Office Province:					
Head Office PC:					
Head Office Cntry:					
Telephone:905-855-2700					
Fax:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Website:		https://www.parhardentistry.com/			
Pri NAICS Desc:		339110-Medical Equipment and Supplies Manufacturing			
NAICS Code 1:		339110-Medical Equipment and Supplies Manufacturin			
NAICS Code 2:		611310-Universities			
NAICS Code 3:		621210-Offices of Dentists			
NAICS Code 4:		621390-Offices of All Other Health Practitioners			
NAICS Code 5:					
<u>Historical Details</u>					
Established:		01-DEC-90			
Plant Size (ft²):		330			
Employment:					
<u>Historical Details</u>					
Description:		Wholesale Trade Agents and Brokers			
SIC/NAICS Code:		419120			

14	1 of 1	WNW/45.6	130.9 / 0.06	2155 LEANNE BLVD MISSISSAUGA ON	WWIS
Well ID:	7190001	Flowing (Y/N):			
Construction Date:		Flow Rate:			
Use 1st:	Monitoring and Test Hole	Data Entry Status:			
Use 2nd:	0	Data Src:			
Final Well Status:	Observation Wells	Date Received:		10/22/2012	
Water Type:		Selected Flag:		TRUE	
Casing Material:		Abandonment Rec:			
Audit No:	Z158450	Contractor:		7241	
Tag:	A120882	Form Version:		7	
Constructn Method:		Owner:			
Elevation (m):		County:		PEEL	
Elevatn Reliabilty:		Lot:			
Depth to Bedrock:		Concession:			
Well Depth:		Concession Name:			
Overburden/Bedrock:		Easting NAD83:			
Pump Rate:		Northing NAD83:			
Static Water Level:		Zone:			
Clear/Cloudy:		UTM Reliability:			
Municipality:	MISSISSAUGA CITY				
Site Info:	WKQ-005301 A0-A02				
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/719\7190001.pdf				

Additional Detail(s) (Map)

Well Completed Date: 09/24/2012
Year Completed: 2012
Depth (m): 1.8288
Latitude: 43.5261554443219
Longitude: -79.6525647077824
Point X: -79.65256455817244
Point Y: 43.52615544182948
Path: 719\7190001.pdf

Bore Hole Information

Bore Hole ID: 1004186307
DP2BR:
Spatial Status:

Elevation:
Elevrc:
Zone: 17

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Code OB:				East83:	608886.00
Code OB Desc:				North83:	4820128.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	09/24/2012			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004507742			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		3.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004507743			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		3.0			
Formation End Depth:		6.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1004507751			
Layer:		1			
Plug From:		6.0			
Plug To:		2.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1004507752			
Layer:		2			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug From:		2.0			
Plug To:		0.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1004507750			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:		DIRECT PUSH			
<u>Pipe Information</u>					
Pipe ID:		1004507741			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1004507746			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		3.0			
Depth To:		0.0			
Casing Diameter:		1.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1004507747			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.0			
Screen End Depth:		6.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.25			
<u>Water Details</u>					
Water ID:		1004507745			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1004507744			
Diameter:		2.5			
Depth From:		0.0			
Depth To:		6.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
16	1 of 1	NNW/48.1	131.0 / 0.12	2155 LEANNE BLVD Mississauga ON	WWIS
Well ID:		7263529	Flowing (Y/N):		
Construction Date:			Flow Rate:		
Use 1st:		Monitoring and Test Hole	Data Entry Status:		
Use 2nd:		0	Data Src:		
Final Well Status:		Monitoring and Test Hole	Date Received:		05/27/2016
Water Type:			Selected Flag:		TRUE
Casing Material:			Abandonment Rec:		
Audit No:		Z231406	Contractor:		7241
Tag:		A197823	Form Version:		7
Constructn Method:			Owner:		
Elevation (m):			County:		PEEL
Elevatn Reliabilty:			Lot:		
Depth to Bedrock:			Concession:		
Well Depth:			Concession Name:		
Overburden/Bedrock:			Easting NAD83:		
Pump Rate:			Northing NAD83:		
Static Water Level:			Zone:		
Clear/Cloudy:			UTM Reliability:		
Municipality:		MISSISSAUGA CITY			
Site Info:		WKQ-008900			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/726\7263529.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		04/20/2016			
Year Completed:		2016			
Depth (m):		5.1816			
Latitude:		43.5262881375034			
Longitude:		-79.652363759431			
Point X:		-79.65236360958718			
Point Y:		43.52628813565558			
Path:		726\7263529.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1006012983	Elevation:		
DP2BR:			Elevrc:		
Spatial Status:			Zone:		17
Code OB:			East83:		608902.00
Code OB Desc:			North83:		4820143.00
Open Hole:			Org CS:		UTM83
Cluster Kind:			UTMRC:		4
Date Completed:		04/20/2016	UTMRC Desc:		margin of error : 30 m - 100 m
Remarks:			Location Method:		
Location Method Desc:		on Water Well Record	wwr		
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006120106			
Layer:		1			
Color:		2			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
General Color:		GREY			
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.5			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006120108			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		4.0			
Formation End Depth:		17.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006120107			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		01			
Material 1 Desc:		FILL			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.5			
Formation End Depth:		4.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006120116			
Layer:		1			
Plug From:		0.0			
Plug To:		0.5			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006120117			
Layer:		2			
Plug From:		0.5			
Plug To:		6.0			
Plug Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006120118			
Layer:		3			
Plug From:		6.0			
Plug To:		17.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006120115			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006120105			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006120111			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		7.0			
Casing Diameter:		1.5			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006120112			
Layer:		1			
Slot:		10			
Screen Top Depth:		7.0			
Screen End Depth:		17.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.75			
<u>Water Details</u>					
Water ID:		1006120110			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole ID:		1006120109			
Diameter:		3.5			
Depth From:		0.0			
Depth To:		17.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
17	1 of 1	NW/49.6	131.0 / 0.13	2155 LEANNE BLVD Mississauga ON	WWIS
Well ID:		7263531		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring and Test Hole		Data Entry Status:	
Use 2nd:		0		Data Src:	
Final Well Status:		Monitoring and Test Hole		Date Received:	
Water Type:				05/27/2016	
Casing Material:				Selected Flag:	
Audit No:		Z231167		TRUE	
Tag:		A184919		Abandonment Rec:	
Constructn Method:				Contractor:	
Elevation (m):				7241	
Elevatn Reliabilty:				Form Version:	
Depth to Bedrock:				7	
Well Depth:				Owner:	
Overburden/Bedrock:				County:	
Pump Rate:				PEEL	
Static Water Level:				Lot:	
Clear/Cloudy:				Concession:	
Municipality:		MISSISSAUGA CITY		Concession Name:	
Site Info:		WKQ-008941		Easting NAD83:	
				Northing NAD83:	
				Zone:	
				UTM Reliability:	
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/726\7263531.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		04/28/2016			
Year Completed:		2016			
Depth (m):		3.81			
Latitude:		43.5262711548309			
Longitude:		-79.6524507600236			
Point X:		-79.65245061049795			
Point Y:		43.52627115285546			
Path:		726\7263531.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1006012997		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				17	
Code OB Desc:				East83:	
Open Hole:				608895.00	
Cluster Kind:				North83:	
Date Completed:		04/28/2016		4820141.00	
Remarks:				Org CS:	
Location Method Desc:		on Water Well Record		UTM83	
Elevrc Desc:				UTMRC:	
Location Source Date:				4	
Improvement Location Source:				UTMRC Desc:	
Improvement Location Method:				margin of error : 30 m - 100 m	
Source Revision Comment:				Location Method:	
Supplier Comment:				wwr	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006120269			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		5.0			
Formation End Depth:		12.5			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006120267			
Layer:		1			
Color:		2			
General Color:		GREY			
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.5			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006120268			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		01			
Material 1 Desc:		FILL			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.5			
Formation End Depth:		5.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006120277			
Layer:		1			
Plug From:		0.0			
Plug To:		0.5			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		1006120278			
Layer:		2			
Plug From:		0.5			
Plug To:		3.5			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006120279			
Layer:		3			
Plug From:		3.5			
Plug To:		12.5			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006120276			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006120266			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006120272			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		4.5			
Casing Diameter:		1.5			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006120273			
Layer:		1			
Slot:		10			
Screen Top Depth:		4.5			
Screen End Depth:		12.5			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.75			
<u>Water Details</u>					
Water ID:		1006120271			
Layer:					
Kind Code:					
Kind:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006120270			
Diameter:		3.5			
Depth From:		0.0			
Depth To:		12.5			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			

18	1 of 1	E/62.9	129.8 / -0.98	2155 LEANNE BLVD MISSISSAUGA ON	WWIS
Well ID:		7267398		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring and Test Hole		Data Entry Status:	
Use 2nd:		0		Data Src:	
Final Well Status:		Monitoring and Test Hole		Date Received:	07/21/2016
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:		Z235006		Contractor:	7241
Tag:		A185000		Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY			
Site Info:		WKQ-009099 A0-A04			

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/726\7267398.pdf

Additional Detail(s) (Map)

Well Completed Date: 06/15/2016
Year Completed: 2016
Depth (m): 3.6576
Latitude: 43.5258620930452
Longitude: -79.6513585323452
Point X: -79.65135838256506
Point Y: 43.52586209074886
Path: 726\7267398.pdf

Bore Hole Information

Bore Hole ID:	1006165430	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	608984.00
Code OB Desc:		North83:	4820097.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	06/15/2016	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1006172767			
Layer:		1			
Color:		8			
General Color:		BLACK			
Material 1:		27			
Material 1 Desc:		OTHER			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		3.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1006172768			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		3.0			
Formation End Depth:		8.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1006172769			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		17			
Material 1 Desc:		SHALE			
Material 2:					
Material 2 Desc:					
Material 3:		92			
Material 3 Desc:		WEATHERED			
Formation Top Depth:		8.0			
Formation End Depth:		12.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1006172777			
Layer:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug From:		12.0			
Plug To:		4.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006172778			
Layer:		2			
Plug From:		4.0			
Plug To:		0.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006172779			
Layer:		3			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006172776			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006172766			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006172772			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		5.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006172773			
Layer:		1			
Slot:		.10			
Screen Top Depth:		5.0			
Screen End Depth:		12.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.25			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Water Details</u>					
Water ID:		1006172771			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006172770			
Diameter:		6.0			
Depth From:		0.0			
Depth To:		12.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
19	1 of 1	NNW/64.3	130.4 / -0.44	2155 LEANNE BLVD MISSISSAUGA ON	WWIS
Well ID:	7267410			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	07/21/2016
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z235007			Contractor:	7241
Tag:	A185045			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY				
Site Info:	WKQ-009099 A0-A04				
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/726\7267410.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	06/15/2016				
Year Completed:	2016				
Depth (m):	3.6576				
Latitude:	43.5264581500857				
Longitude:	-79.6522733511786				
Point X:	-79.65227320135415				
Point Y:	43.52645814775638				
Path:	726\7267410.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1006165645			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	608909.00

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Code OB Desc:				North83:	4820162.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		06/15/2016		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006172957			
Layer:		1			
Color:		8			
General Color:		BLACK			
Material 1:		27			
Material 1 Desc:		OTHER			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		3.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006172958			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		3.0			
Formation End Depth:		8.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006172959			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		17			
Material 1 Desc:		SHALE			
Material 2:					
Material 2 Desc:					
Material 3:		92			
Material 3 Desc:		WEATHERED			
Formation Top Depth:		8.0			
Formation End Depth:		12.0			
Formation End Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006172967			
Layer:		1			
Plug From:		12.0			
Plug To:		4.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006172969			
Layer:		3			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006172968			
Layer:		2			
Plug From:		4.0			
Plug To:		0.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006172966			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006172956			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006172962			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		5.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006172963			
Layer:		1			
Slot:		.10			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen Top Depth:		5.0			
Screen End Depth:		12.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.25			
<u>Water Details</u>					
Water ID:		1006172961			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006172960			
Diameter:		6.0			
Depth From:		0.0			
Depth To:		12.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			

20	1 of 1	N/65.2	129.9 / -0.95	2155 LEANNE BLVD MISSISSAUGA ON	WWIS
Well ID:	7267409			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	07/21/2016
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z235003			Contractor:	7241
Tag:	A185044			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY				
Site Info:	WKQ-009099 A0-A04				
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/726\7267409.pdf				

Additional Detail(s) (Map)

Well Completed Date: 06/15/2016
 Year Completed: 2016
 Depth (m): 3.6576
 Latitude: 43.5264741115593
 Longitude: -79.6520997502619
 Point X: -79.65209960018267
 Point Y: 43.52647410986747
 Path: 726\7267409.pdf

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Bore Hole Information</u>					
Bore Hole ID:	1006165620			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	608923.00
Code OB Desc:				North83:	4820164.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	06/15/2016			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1006172944				
Layer:	2				
Color:	6				
General Color:	BROWN				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:	05				
Material 2 Desc:	CLAY				
Material 3:					
Material 3 Desc:					
Formation Top Depth:	3.0				
Formation End Depth:	8.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1006172943				
Layer:	1				
Color:	8				
General Color:	BLACK				
Material 1:	27				
Material 1 Desc:	OTHER				
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:	3.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1006172945				
Layer:	3				
Color:	2				
General Color:	GREY				
Material 1:	17				
Material 1 Desc:	SHALE				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 2:					
Material 2 Desc:					
Material 3:		92			
Material 3 Desc:		WEATHERED			
Formation Top Depth:		8.0			
Formation End Depth:		12.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006172954			
Layer:		2			
Plug From:		4.0			
Plug To:		0.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006172955			
Layer:		3			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006172953			
Layer:		1			
Plug From:		12.0			
Plug To:		4.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1006172952			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006172942			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006172948			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		5.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Screen</u>					
Screen ID:		1006172949			
Layer:		1			
Slot:		.10			
Screen Top Depth:		5.0			
Screen End Depth:		12.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.25			
<u>Water Details</u>					
Water ID:		1006172947			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006172946			
Diameter:		6.0			
Depth From:		0.0			
Depth To:		12.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
21	1 of 1	NNW/70.2	130.5 / -0.29	2155 LEANNE BOULEVARD Mississauga ON	WWIS
Well ID:	7263527			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	05/27/2016
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z218140			Contractor:	7241
Tag:	A195072			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/726\7263527.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	04/13/2016				
Year Completed:	2016				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth (m):		3.048			
Latitude:		43.5264781954026			
Longitude:		-79.6524461503187			
Point X:		-79.65244600032715			
Point Y:		43.52647819241296			
Path:		726\7263527.pdf			
 <u>Bore Hole Information</u>					
Bore Hole ID:	1006012949			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	608895.00
Code OB Desc:				North83:	4820164.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	04/13/2016			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006119234				
Layer:	2				
Color:	2				
General Color:	GREY				
Material 1:	06				
Material 1 Desc:	SILT				
Material 2:	05				
Material 2 Desc:	CLAY				
Material 3:	66				
Material 3 Desc:	DENSE				
Formation Top Depth:	3.0				
Formation End Depth:	10.0				
Formation End Depth UOM:	ft				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006119233				
Layer:	1				
Color:	6				
General Color:	BROWN				
Material 1:	06				
Material 1 Desc:	SILT				
Material 2:	28				
Material 2 Desc:	SAND				
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	0.0				
Formation End Depth:	3.0				
Formation End Depth UOM:	ft				
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID: 1006119244					
Layer: 3					
Plug From: 3.0					
Plug To: 10.0					
Plug Depth UOM: ft					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID: 1006119243					
Layer: 2					
Plug From: 0.5					
Plug To: 3.0					
Plug Depth UOM: ft					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID: 1006119242					
Layer: 1					
Plug From: 0.0					
Plug To: 0.5					
Plug Depth UOM: ft					
<u>Method of Construction & Well Use</u>					
Method Construction ID: 1006119241					
Method Construction Code: D					
Method Construction: Direct Push					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID: 1006119232					
Casing No: 0					
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID: 1006119237					
Layer: 1					
Material: 5					
Open Hole or Material: PLASTIC					
Depth From: 0.0					
Depth To: 4.0					
Casing Diameter: 2.0					
Casing Diameter UOM: inch					
Casing Depth UOM: ft					
<u>Construction Record - Screen</u>					
Screen ID: 1006119238					
Layer: 1					
Slot: 10					
Screen Top Depth: 4.0					
Screen End Depth: 10.0					
Screen Material: 5					
Screen Depth UOM: ft					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen Diameter UOM:		inch			
Screen Diameter:		2.25			
<u>Water Details</u>					
Water ID:		1006119236			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006119235			
Diameter:		6.0			
Depth From:		0.0			
Depth To:		10.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
22	1 of 1	W/77.3	131.9 / 1.05	2155 LEANNE BLVD MISSISSAUGA ON	WWIS
Well ID:		7190002		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring and Test Hole		Data Entry Status:	
Use 2nd:		0		Data Src:	
Final Well Status:		Observation Wells		Date Received:	10/22/2012
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:		Z158448		Contractor:	7241
Tag:		A120884		Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY			
Site Info:		WKQ-005301 A0-A02			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/719\7190002.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		09/24/2012			
Year Completed:		2012			
Depth (m):		1.6764			
Latitude:		43.5259455251404			
Longitude:		-79.6530891130541			
Point X:		-79.65308896304597			
Point Y:		43.52594552294094			
Path:		719\7190002.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1004186310		Elevation:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	608844.00
Code OB Desc:				North83:	4820104.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	09/24/2012			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004507755			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		2.0			
Formation End Depth:		5.5			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004507754			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		2.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1004507764			
Layer:		2			
Plug From:		3.0			
Plug To:		0.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		1004507763			
Layer:		1			
Plug From:		5.5			
Plug To:		3.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1004507762			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:		DIRECT PUSH			
<u>Pipe Information</u>					
Pipe ID:		1004507753			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1004507758			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		3.5			
Depth To:		0.0			
Casing Diameter:		1.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1004507759			
Layer:		1			
Slot:		10			
Screen Top Depth:		5.5			
Screen End Depth:		3.5			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.25			
<u>Water Details</u>					
Water ID:		1004507757			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1004507756			
Diameter:		2.5			
Depth From:		0.0			
Depth To:		5.5			
Hole Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole Diameter UOM:		inch			
23	1 of 1	ENE/84.6	129.1 / -1.71	2155 LEANNE BLVD MISSISSAUGA ON	WWIS
Well ID:		7267400		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring and Test Hole		Data Entry Status:	
Use 2nd:		0		Data Src:	
Final Well Status:		Monitoring and Test Hole		Date Received:	07/21/2016
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:		Z235004		Contractor:	7241
Tag:		A185135		Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY			
Site Info:		WKQ-009099 A0-A04			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/726\7267400.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		06/15/2016			
Year Completed:		2016			
Depth (m):		6.7056			
Latitude:		43.5263203070932			
Longitude:		-79.6512740742583			
Point X:		-79.6512739247452			
Point Y:		43.52632030482923			
Path:		726\7267400.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1006165447		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	608990.00
Code OB Desc:				North83:	4820148.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		06/15/2016		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006172799			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		3.0			
Formation End Depth:		8.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006172798			
Layer:		1			
Color:		8			
General Color:		BLACK			
Material 1:		27			
Material 1 Desc:		OTHER			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		3.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006172800			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		17			
Material 1 Desc:		SHALE			
Material 2:					
Material 2 Desc:					
Material 3:		92			
Material 3 Desc:		WEATHERED			
Formation Top Depth:		8.0			
Formation End Depth:		22.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006172809			
Layer:		2			
Plug From:		4.0			
Plug To:		0.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006172810			
Layer:		3			
Plug From:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug To:					
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006172808			
Layer:		1			
Plug From:		12.0			
Plug To:		4.0			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1006172807			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1006172797			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1006172803			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		5.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1006172804			
Layer:		1			
Slot:		.10			
Screen Top Depth:		5.0			
Screen End Depth:		12.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.25			
 <u>Water Details</u>					
Water ID:		1006172802			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1006172801			
Diameter:		6.0			
Depth From:		0.0			
Depth To:		12.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
24	1 of 1	NW/85.1	130.7 / -0.11	2155 LEANNE BOULEVARD Mississauga ON	WWIS
Well ID:	7263525			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	05/27/2016
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z231600			Contractor:	7241
Tag:	A197681			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/726\7263525.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	04/13/2016				
Year Completed:	2016				
Depth (m):	3.6576				
Latitude:	43.5264558560715				
Longitude:	-79.652842637279				
Point X:	-79.65284248692502				
Point Y:	43.52645585380191				
Path:	726\7263525.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1006012943			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	608863.00
Code OB Desc:				North83:	4820161.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	04/13/2016			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006119149			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		4.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006119151			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:					
Material 1 Desc:					
Material 2:		17			
Material 2 Desc:		SHALE			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		11.0			
Formation End Depth:		12.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006119150			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		4.0			
Formation End Depth:		11.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006119159			
Layer:		1			
Plug From:		0.0			
Plug To:		0.5			
Plug Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006119160			
Layer:		2			
Plug From:		0.5			
Plug To:		3.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006119161			
Layer:		3			
Plug From:		3.0			
Plug To:		12.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006119158			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006119148			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006119154			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		4.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006119155			
Layer:		1			
Slot:		10			
Screen Top Depth:		4.0			
Screen End Depth:		12.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.25			
<u>Water Details</u>					
Water ID:		1006119153			
Layer:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Kind Code: Kind: Water Found Depth: Water Found Depth UOM: ft					
<u>Hole Diameter</u>					
Hole ID: 1006119152 Diameter: 6.0 Depth From: 0.0 Depth To: 12.0 Hole Depth UOM: ft Hole Diameter UOM: inch					
26	1 of 1	SSW/91.7	130.9 / 0.05	2155 LEANNE BLVD MISSISSAUGA ON	WWIS
Well ID: 7267399 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: 0 Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z235005 Tag: A184880 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: MISSISSAUGA CITY Site Info: WKQ-009099 A0-A04 PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/726\7267399.pdf					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 07/21/2016 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: PEEL Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 06/15/2016 Year Completed: 2016 Depth (m): 3.6576 Latitude: 43.5251385364334 Longitude: -79.6526120950621 Point X: -79.65261194527643 Point Y: 43.52513853349669 Path: 726\7267399.pdf					
<u>Bore Hole Information</u>					
Bore Hole ID: 1006165433 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 06/15/2016 Remarks:					
Elevation: Elevrc: Zone: 17 East83: 608884.00 North83: 4820015.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006172782			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:		34			
Material 3 Desc:		TILL			
Formation Top Depth:					
Formation End Depth:		8.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006172781			
Layer:		1			
Color:		8			
General Color:		BLACK			
Material 1:		27			
Material 1 Desc:		OTHER			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:					
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006172783			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		17			
Material 1 Desc:		SHALE			
Material 2:					
Material 2 Desc:					
Material 3:		92			
Material 3 Desc:		WEATHERED			
Formation Top Depth:		8.0			
Formation End Depth:		12.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		1006172792			
Layer:		2			
Plug From:		4.0			
Plug To:		0.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006172793			
Layer:		3			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006172791			
Layer:		1			
Plug From:		12.0			
Plug To:		4.0			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1006172790			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1006172780			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1006172786			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		5.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1006172787			
Layer:		1			
Slot:		.10			
Screen Top Depth:		5.0			
Screen End Depth:		10.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen Diameter:		2.25			
<u>Water Details</u>					
Water ID:		1006172785			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006172784			
Diameter:		6.0			
Depth From:		0.0			
Depth To:		10.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			

27	1 of 1	NNW/95.2	129.8 / -0.98	2155 LEANNE BOULEVARD MISSISSAUGA ON	WWIS
Well ID:		7263528		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Test Hole		Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:		Monitoring and Test Hole		Date Received:	05/27/2016
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:		Z218139		Contractor:	7241
Tag:		A195071		Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/726\7263528.pdf			

Additional Detail(s) (Map)

Well Completed Date:	04/13/2016
Year Completed:	2016
Depth (m):	3.048
Latitude:	43.5267209513494
Longitude:	-79.6524159959005
Point X:	-79.65241584656623
Point Y:	43.52672094869661
Path:	726\7263528.pdf

Bore Hole Information

Bore Hole ID:	1006012980	Elevation:	
DP2BR:		Elevrc:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Spatial Status:				Zone:	17
Code OB:				East83:	608897.00
Code OB Desc:				North83:	4820191.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		04/13/2016	UTMRC Desc:		margin of error : 30 m - 100 m
Remarks:		Location Method:		wwr	
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006120051			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		3.0			
Formation End Depth:		10.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006120050			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		3.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006120059			
Layer:		2			
Plug From:		0.5			
Plug To:		3.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006120058			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Plug From:		0.0			
Plug To:		0.5			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006120060			
Layer:		3			
Plug From:		3.0			
Plug To:		10.0			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1006120057			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1006120049			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1006120054			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		4.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1006120055			
Layer:		1			
Slot:		10			
Screen Top Depth:		4.0			
Screen End Depth:		10.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.25			
 <u>Water Details</u>					
Water ID:		1006120053			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1006120052			
Diameter:		6.0			
Depth From:		0.0			
Depth To:		10.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
29	1 of 1	N/105.2	129.8 / -0.98	2155 LEANNE BLVD MISSISSAUGA ON	WWIS
Well ID:	7190000			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Observation Wells			Date Received:	10/22/2012
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z158542			Contractor:	7241
Tag:	A138480			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MISSISSAUGA CITY				
Site Info:	WKQ-005305 A0-A03				
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/719\7190000.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	09/25/2012				
Year Completed:	2012				
Depth (m):	3.048				
Latitude:	43.5268337444265				
Longitude:	-79.6520546166995				
Point X:	-79.65205446700884				
Point Y:	43.52683374134167				
Path:	719\7190000.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1004186304			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	608926.00
Code OB Desc:				North83:	4820204.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	09/25/2012			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Improvement Location Method: Source Revision Comment: Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004507730			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		17			
Material 1 Desc:		SHALE			
Material 2:					
Material 2 Desc:					
Material 3:		92			
Material 3 Desc:		WEATHERED			
Formation Top Depth:		8.0			
Formation End Depth:		10.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004507729			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		05			
Material 3 Desc:		CLAY			
Formation Top Depth:		0.0			
Formation End Depth:		8.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004507738			
Layer:		1			
Plug From:		10.0			
Plug To:		4.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004507739			
Layer:		2			
Plug From:		4.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004507740			
Layer:		3			
Plug From:		1.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug To:		0.0			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1004507737			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:		DIRECT PUSH			
 <u>Pipe Information</u>					
Pipe ID:		1004507728			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1004507733			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		5.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1004507734			
Layer:		1			
Slot:		10			
Screen Top Depth:		5.0			
Screen End Depth:		10.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.25			
 <u>Water Details</u>					
Water ID:		1004507732			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
 <u>Hole Diameter</u>					
Hole ID:		1004507731			
Diameter:		4.25			
Depth From:		0.0			
Depth To:		10.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
1	1 of 1	WNW/13.6	130.9 / 0.09	Leanne Boulevard Mississauga ON	EHS
Order No: 20150922011				Nearest Intersection:	
Status: C				Municipality:	
Report Type: RSC Premium Package (Urban)				Client Prov/State: ON	
Report Date: 28-SEP-15				Search Radius (km): .3	
Date Received: 22-SEP-15				X: -79.652262	
Previous Site Name:				Y: 43.525969	
Lot/Building Size:					
Additional Info Ordered: City Directory					
5	1 of 1	NW/29.3	130.9 / 0.08	ON	WWIS
Well ID: 7256325				Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status: Yes	
Use 2nd:				Data Src:	
Final Well Status:				Date Received: 01/19/2016	
Water Type:				Selected Flag: TRUE	
Casing Material:				Abandonment Rec:	
Audit No: C26103				Contractor: 7215	
Tag: A163875				Form Version: 8	
Constructn Method:				Owner:	
Elevation (m):				County: PEEL	
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality: MISSISSAUGA CITY					
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/725\7256325.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 07/07/2014					
Year Completed: 2014					
Depth (m):					
Latitude: 43.5261165206162					
Longitude: -79.652318082229					
Point X: -79.65231793208125					
Point Y: 43.526116518836744					
Path: 725\7256325.pdf					
<u>Bore Hole Information</u>					
Bore Hole ID: 1005870868		Elevation:			
DP2BR:		Elevrc:			
Spatial Status:		Zone: 17			
Code OB:		East83: 608906.00			
Code OB Desc:		North83: 4820124.00			
Open Hole:		Org CS: UTM83			
Cluster Kind:		UTMRC: 4			
Date Completed: 07/07/2014		UTMRC Desc: margin of error : 30 m - 100 m			
Remarks:		Location Method: wwr			
Location Method Desc: on Water Well Record					
Elevrc Desc:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
9	1 of 1	NW/36.0	130.9 / 0.08	ON	WWIS
Well ID: 7253066 Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: C30543 Tag: A182921 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: MISSISSAUGA CITY Site Info: PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/725\7253066.pdf					
Flowing (Y/N):					
Flow Rate:					
Data Entry Status: Yes					
Data Src:					
Date Received: 11/27/2015					
Selected Flag: TRUE					
Abandonment Rec:					
Contractor: 7215					
Form Version: 8					
Owner:					
County: PEEL					
Lot:					
Concession:					
Concession Name:					
Easting NAD83:					
Northing NAD83:					
Zone:					
UTM Reliability:					
Additional Detail(s) (Map)					
Well Completed Date: 04/27/2015					
Year Completed: 2015					
Depth (m):					
Latitude: 43.526153402723					
Longitude: -79.6523915086599					
Point X: -79.65239135944766					
Point Y: 43.52615340054586					
Path: 725\7253066.pdf					
Bore Hole Information					
Bore Hole ID: 1005820095					
DP2BR:					
Spatial Status:					
Code OB:					
Code OB Desc:					
Open Hole:					
Cluster Kind:					
Date Completed: 04/27/2015					
Remarks:					
Location Method Desc: on Water Well Record					
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
Elevation: Elevrc: Zone: 17 East83: 608900.00 North83: 4820128.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
15	1 of 1	NE/46.4	129.8 / -0.98	215 LEANNE BLVD MISSISSAUGA ON	WWIS
Well ID: 7267489 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: 0 Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z235093 Tag: A184910 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: MISSISSAUGA CITY Site Info: WKQ-009134 A0-A00 Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 07/21/2016 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: PEEL Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability: PDF URL (Map):https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/726\7267489.pdf Well Completed Date: 06/27/2016 Year Completed: 2016 Depth (m): 40 Latitude: 43.5262367103851 Longitude: -79.6518204208178 Point X: -79.65182027095145 Point Y: 43.52623670782342 Path: 726\7267489.pdf Bore Hole ID: 1006165410 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 06/27/2016 Remarks: Location Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment: Elevation: Elevrc: Zone: 17 East83: 608946.00 North83: 4820138.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr Overburden and Bedrock Materials Interval Formation ID: 1006175331 Layer: 4 Color: 2 General Color: GREY					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 1:		17			
Material 1 Desc:		SHALE			
Material 2:					
Material 2 Desc:					
Material 3:		26			
Material 3 Desc:		ROCK			
Formation Top Depth:		10.0			
Formation End Depth:		40.0			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006175328			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		01			
Material 1 Desc:		FILL			
Material 2:					
Material 2 Desc:					
Material 3:		77			
Material 3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		2.0			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006175330			
Layer:		3			
Color:		6			
General Color:		BROWN			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		5.0			
Formation End Depth:		10.0			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006175329			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		2.0			
Formation End Depth:		5.0			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Sealing Record</u>					
Plug ID:		1006175341			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006175342			
Layer:		2			
Plug From:		1.0			
Plug To:		5.0			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006175343			
Layer:		3			
Plug From:		5.0			
Plug To:		34.0			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006175344			
Layer:		4			
Plug From:		34.0			
Plug To:		40.0			
Plug Depth UOM:		m			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1006175340			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006175327			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006175336			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		35.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Screen</u>					
Screen ID:		1006175337			
Layer:		1			
Slot:		10			
Screen Top Depth:		35.0			
Screen End Depth:		40.0			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		2.0999999046325684			
<u>Water Details</u>					
Water ID:		1006175335			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1006175332			
Diameter:		6.0			
Depth From:		0.0			
Depth To:		10.0			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1006175333			
Diameter:		5.0			
Depth From:		10.0			
Depth To:		15.0			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1006175334			
Diameter:		3.5			
Depth From:		15.0			
Depth To:		40.0			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>25</u>	1 of 2	SE/90.5	129.8 / -0.98	Southriim 2065 Leanne Blvd Miss ON L5K 2L6	GEN

Generator Info

Generator No:	ON8908518	Choice of Contact:	
Approval Years:	07,08	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	621494

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Country: Co Admin: Phone No Admin: SIC Description: Community Health Centres					
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
25	2 of 2	SE/90.5	129.8 / -0.98	Southriim 2065 Leanne Blvd Miss ON L5K 2L6	GEN
<u>Generator Info</u>					
Generator No:		ON8908518		Choice of Contact:	
Approval Years:		2011		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code: 621494	
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
28	1 of 1	NW/104.8	130.0 / -0.83	2185 LEANNE BLVD MISSISSAUGA ON	WWIS
Well ID:		7042139		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Not Used		Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:		Observation Wells		Date Received: 03/29/2007	
Water Type:				Selected Flag: TRUE	
Casing Material:				Abandonment Rec:	
Audit No:		Z46590		Contractor: 6032	
Tag:		A005284		Form Version: 3	
Constructn Method:				Owner:	
Elevation (m):				County: PEEL	
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7042139.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		03/07/2007			
Year Completed:		2007			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth (m):		5.18			
Latitude:		43.5266984663504			
Longitude:		-79.6528001129832			
Point X:		-79.65279996336659			
Point Y:		43.52669846362642			
Path:		704\7042139.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	11764636			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	608866.00
Code OB Desc:				North83:	4820188.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	03/07/2007			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	933096121				
Layer:	3				
Color:	6				
General Color:	BROWN				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:	06				
Material 2 Desc:	SILT				
Material 3:	34				
Material 3 Desc:	TILL				
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	933096124				
Layer:	6				
Color:	2				
General Color:	GREY				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:	06				
Material 2 Desc:	SILT				
Material 3:	34				
Material 3 Desc:	TILL				
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		933096123			
Layer:		5			
Color:		2			
General Color:		GREY			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		34			
Material 3 Desc:		TILL			
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		933096126			
Layer:		8			
Color:		2			
General Color:		GREY			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		34			
Material 3 Desc:		TILL			
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		933096122			
Layer:		4			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		34			
Material 3 Desc:		TILL			
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		933096120			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		34			
Material 3 Desc:		TILL			
Formation Top Depth:		5.179999828338623			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth:					
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933096125			
Layer:		7			
Color:		2			
General Color:		GREY			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		34			
Material 3 Desc:		TILL			
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933096119			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		34			
Material 3 Desc:		TILL			
Formation Top Depth:		0.0			
Formation End Depth:		5.179999828338623			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933316285			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933316286			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		0.6100000143051147			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933316287			
Layer:		3			
Plug From:		0.6100000143051147			
Plug To:		1.6799999475479126			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		967042139			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11772356			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930897457			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.049999952316284			
Casing Diameter:		5.0			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		933423764			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.049999952316284			
Screen End Depth:		5.179999828338623			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.0			
<u>Hole Diameter</u>					
Hole ID:		11850935			
Diameter:		20.0			
Depth From:		0.0			
Depth To:		5.179999828338623			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
30	1 of 20	NNW/105.3	129.8 / -0.98	1239973 ONTARIO INC O/A ESSO GENERATION 2185 LEANNE BLVD MISSISSAUGA ON	DTNK

Delisted Expired Fuel Safety
Facilities

Instance No:	11546573	Expired Date:	
Status:	EXPIRED	Max Hazard Rank:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Instance ID:	89741			Facility Location:	
Instance Type:	FS Piping			Facility Type:	
Instance Creation Dt:				Fuel Type 2:	
Instance Install Dt:				Fuel Type 3:	
Item Description:				Panam Related:	
Manufacturer:				Panam Venue Nm:	
Model:				External Identifier:	
Serial No:				Item:	
ULC Standard:				Piping Steel:	
Quantity:				Piping Galvanized:	
Unit of Measure:				Tank Single Wall St:	
Overfill Prot Type:				Piping Underground:	
Creation Date:				Tank Underground:	
Next Periodic Str DT:				Source:	
TSSA Base Sched Cycle 2:					
TSSAMax Hazard Rank 1:					
TSSA Risk Based Periodic Yn:					
TSSA Volume of Directives:					
TSSA Periodic Exempt:					
TSSA Statutory Interval:					
TSSA Recd Insp Interva:					
TSSA Recd Tolerance:					
TSSA Program Area:					
TSSA Program Area 2:					
Description:	FS Piping				
Original Source:	EXP				
Record Date:	Up to Mar 2012				

Delisted Expired Fuel Safety Facilities

Instance No:	11546580	Expired Date:	
Status:	EXPIRED	Max Hazard Rank:	
Instance ID:	89914	Facility Location:	
Instance Type:	FS Piping	Facility Type:	
Instance Creation Dt:		Fuel Type 2:	
Instance Install Dt:		Fuel Type 3:	
Item Description:		Panam Related:	
Manufacturer:		Panam Venue Nm:	
Model:		External Identifier:	
Serial No:		Item:	
ULC Standard:		Piping Steel:	
Quantity:		Piping Galvanized:	
Unit of Measure:		Tank Single Wall St:	
Overfill Prot Type:		Piping Underground:	
Creation Date:		Tank Underground:	
Next Periodic Str DT:		Source:	
TSSA Base Sched Cycle 2:			
TSSAMax Hazard Rank 1:			
TSSA Risk Based Periodic Yn:			
TSSA Volume of Directives:			
TSSA Periodic Exempt:			
TSSA Statutory Interval:			
TSSA Recd Insp Interva:			
TSSA Recd Tolerance:			
TSSA Program Area:			
TSSA Program Area 2:			
Description:	FS Piping		
Original Source:	EXP		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Record Date:		Up to Mar 2012			
30	3 of 20	NNW/105.3	129.8 / -0.98	2185 Leanne Boulevard Mississauga ON L5K 2L6	EHS
Order No:		20070220013		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		CAN - Complete Report		Client Prov/State:	
Report Date:		2/28/2007		Search Radius (km):	
Date Received:		2/20/2007		X:	
Previous Site Name:				Y:	
Lot/Building Size:					
Additional Info Ordered:		Fire Insur. Maps And /or Site Plans			
30	4 of 20	NNW/105.3	129.8 / -0.98	2185 Leanne Blvd Mississauga ON L5K2L6	EHS
Order No:		20150429092		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Standard Report		Client Prov/State:	
Report Date:		06-MAY-15		Search Radius (km):	
Date Received:		29-APR-15		X:	
Previous Site Name:				Y:	
Lot/Building Size:					
Additional Info Ordered:		City Directory			
30	5 of 20	NNW/105.3	129.8 / -0.98	1239973 ONTARIO INC O/A ESSO GENERATION 2185 LEANNE BLVD MISSISSAUGA ON	EXP
Inventory No:		11546532		Tank Material:	
Inventory Status:		EXPIRED		Corrosion Protect:	
Installation Year:		1981		Overfill Protection:	
Capacity:		45400		Inventory Context:	
Capacity Unit:				Inventory Item:	
Tank Type:					
Manufacturer:					
Model:					
Description:		2009VBS			
Previous Fuel Type:		Gasoline			
30	6 of 20	NNW/105.3	129.8 / -0.98	1239973 ONTARIO INC O/A ESSO GENERATION 2185 LEANNE BLVD MISSISSAUGA ON	EXP
Inventory No:		11546549		Tank Material:	
Inventory Status:		EXPIRED		Corrosion Protect:	
Installation Year:		1981		Overfill Protection:	
Capacity:		45400		Inventory Context:	
Capacity Unit:				Inventory Item:	
Tank Type:					
Manufacturer:					
Model:					
Description:		2009VBS			
Previous Fuel Type:		Gasoline			
30	7 of 20	NNW/105.3	129.8 / -0.98	1239973 ONTARIO INC O/A ESSO GENERATION 2185 LEANNE BLVD	EXP

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
MISSISSAUGA ON					
Inventory No:	11546554			Tank Material:	Fiberglass (FRP)
Inventory Status:	EXPIRED			Corrosion Protect:	Fiberglass
Installation Year:	1981			Overfill Protection:	
Capacity:	45400			Inventory Context:	FS Liquid Fuel Tank
Capacity Unit:				Inventory Item:	FS LIQUID FUEL TANK
Tank Type:					
Manufacturer:					
Model:					
Description:	2009VBS				
Previous Fuel Type:	Gasoline				
30	8 of 20	NNW/105.3	129.8 / -0.98	1239973 ONTARIO INC O/A ESSO GENERATION 2185 LEANNE BLVD MISSISSAUGA ON	EXP
Inventory No:	11546562			Tank Material:	Fiberglass (FRP)
Inventory Status:	EXPIRED			Corrosion Protect:	Fiberglass
Installation Year:	1981			Overfill Protection:	
Capacity:	22700			Inventory Context:	FS Liquid Fuel Tank
Capacity Unit:				Inventory Item:	FS LIQUID FUEL TANK
Tank Type:					
Manufacturer:					
Model:					
Description:	2009VBS				
Previous Fuel Type:	Diesel				
30	9 of 20	NNW/105.3	129.8 / -0.98	MAC'S CONVENIENCE STORES INC. 2185 LEANNE BLVD MISSISSAUGA ON	FST
Inventory No:	49498778			Tank Material:	Fiberglass (FRP)
Inventory Status:	active			Corrosion Protect:	Fiberglass
Installation Year:	2007			Overfill Protection:	
Capacity:	65000			Inventory Context:	FS Liquid Fuel
Capacity Unit:	L			Inventory Item:	FS Liquid Fuel Tank
Tank Type:	Double Wall UST				
Manufacturer:					
Model:					
Description:	2009VBS				
30	10 of 20	NNW/105.3	129.8 / -0.98	MAC'S CONVENIENCE STORES INC. 2185 LEANNE BLVD MISSISSAUGA ON	FST
Inventory No:	49498775			Tank Material:	Fiberglass (FRP)
Inventory Status:	active			Corrosion Protect:	Fiberglass
Installation Year:	2007			Overfill Protection:	
Capacity:	65000			Inventory Context:	FS Liquid Fuel
Capacity Unit:	L			Inventory Item:	FS Liquid Fuel Tank
Tank Type:	Double Wall UST				
Manufacturer:					
Model:					
Description:	2009VBS				
30	11 of 20	NNW/105.3	129.8 / -0.98	MAC'S CONVENIENCE STORES INC. 2185 LEANNE BLVD	FST

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
				MISSISSAUGA ON	
Inventory No:	49498776			Tank Material:	Fiberglass (FRP)
Inventory Status:	active			Corrosion Protect:	Fiberglass
Installation Year:	2007			Overfill Protection:	
Capacity:	25000			Inventory Context:	FS Liquid Fuel
Capacity Unit:	L			Inventory Item:	FS Liquid Fuel Tank
Tank Type:	Double Wall UST				
Manufacturer:					
Model:					
Description:	2009VBS new install by Demik				
30	12 of 20	NNW/105.3	129.8 / -0.98	MAC'S CONVENIENCE STORES INC. 2185 LEANNE BLVD MISSISSAUGA ON	FST
Inventory No:	49498777			Tank Material:	Fiberglass (FRP)
Inventory Status:	active			Corrosion Protect:	Fiberglass
Installation Year:	2007			Overfill Protection:	
Capacity:	50000			Inventory Context:	FS Liquid Fuel
Capacity Unit:	L			Inventory Item:	FS Liquid Fuel Tank
Tank Type:	Double Wall UST				
Manufacturer:					
Model:					
Description:	2009VBS installed by Demik Construction 2007				
30	13 of 20	NNW/105.3	129.8 / -0.98	MAC'S CONVENIENCE STORES INC. 2185 LEANNE BLVD MISSISSAUGA ON	FST
Inventory No:	9792106			Tank Material:	
Inventory Status:	Active			Corrosion Protect:	
Installation Year:				Overfill Protection:	
Capacity:	205000			Inventory Context:	Liquid Fuels
Capacity Unit:	L			Inventory Item:	FS Gasoline Station - Self Serve
Tank Type:					
Manufacturer:					
Model:					
Description:					
30	14 of 20	NNW/105.3	129.8 / -0.98	1239973 ONTARIO INC O/A ESSO GENERATION 2185 LEANNE BLVD MISSISSAUGA ON L5K 2L6	FSTH
License Issue Date:	9/3/2002				
Tank Status:	Licensed				
Tank Status As Of:	August 2007				
Operation Type:	Retail Fuel Outlet				
Facility Type:	Gasoline Station - Self Serve				
--Details--					
Status:	Removed				
Year of Installation:	1981				
Corrosion Protection:					
Capacity:	45400				
Tank Fuel Type:	Liquid Fuel Single Wall UST - Gasoline				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status: Removed Year of Installation: 1981 Corrosion Protection: Capacity: 45400 Tank Fuel Type: Liquid Fuel Single Wall UST - Gasoline Status: Removed Year of Installation: 1981 Corrosion Protection: Capacity: 22700 Tank Fuel Type: Liquid Fuel Single Wall UST - Diesel Status: Removed Year of Installation: 1981 Corrosion Protection: Capacity: 45400 Tank Fuel Type: Liquid Fuel Single Wall UST - Gasoline					
30	15 of 20	NNW/105.3	129.8 / -0.98	1239973 ONTARIO INC O/A ESSO GENERATION 2185 LEANNE BLVD MISSISSAUGA ON L5K 2L6	FSTH
License Issue Date: 9/3/2002 Tank Status: Licensed Tank Status As Of: December 2008 Operation Type: Retail Fuel Outlet Facility Type: Gasoline Station - Self Serve --Details-- Status: Active Year of Installation: 2007 Corrosion Protection: Capacity: 65000 Tank Fuel Type: Liquid Fuel Double Wall UST - Gasoline Status: Active Year of Installation: 2007 Corrosion Protection: Capacity: 25000 Tank Fuel Type: Liquid Fuel Double Wall UST - Diesel Status: Active Year of Installation: 2007 Corrosion Protection: Capacity: 50000 Tank Fuel Type: Liquid Fuel Double Wall UST - Gasoline Status: Active Year of Installation: 2007 Corrosion Protection: Capacity: 65000 Tank Fuel Type: Liquid Fuel Double Wall UST - Gasoline					
30	16 of 20	NNW/105.3	129.8 / -0.98	ERIN MILLS ESSO 2185 LEANNE BLVD MISSISSAUGA ON L5K 2L6	PRT
Location ID: 9153 Type: retail Expiry Date: 1995-06-30					

131 erisinfo.com | Environmental Risk Information Services Order No: 26022500296

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: PIPE/HOSE LEAK Incident Preceding Spill: Incident Reason: NEGLIGENCE (APPARENT) Incident Summary: TRIMAC-200 L GASOLINE TO LOT,ELBO CONNECTION LEAK,FD,REGION,CLEANED-UP. Environment Impact: POSSIBLE Health Env Consequence: Nature of Impact: Multi Media Pollution Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: LAND / WATER Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address: Source Sector Type: Conservtn Auth Name: Primary Watershed: Quaternary Watershed: Offsite Impacts: Waterbody Impacted:					

31	1 of 1	E/132.9	128.8 / -2.03	Erin Mills Parkway Mississauga ON	EHS
Order No: 20071203012 Status: C Report Type: CAN - Complete Report Report Date: 12/12/2007 Date Received: 12/3/2007 Previous Site Name: Lot/Building Size: 0.65 acres Additional Info Ordered: Fire Insur. Maps And /or Site Plans; Title Search; Topographical Maps					
Nearest Intersection: Erin Mills Parkway and North Sheridan Way Municipality: Peel Client Prov/State: Search Radius (km): 0.25 X: -79.65052 Y: 43.525669					

32	1 of 1	NE/146.8	127.8 / -2.99	ON	WWIS
Well ID: 7383918 Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: C51195 Tag: A310736 Constructn Method: Elevation (m):					
Flowing (Y/N): Flow Rate: Data Entry Status: Yes Data Src: Date Received: 03/23/2021 Selected Flag: TRUE Abandonment Rec: Contractor: 7215 Form Version: 8 Owner: County: PEEL					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:				Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	
		MISSISSAUGA CITY			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/738\7383918.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		01/13/2021			
Year Completed:		2021			
Depth (m):					
Latitude:		43.5270588892229			
Longitude:		-79.651294739691			
Point X:		-79.65129459041671			
Point Y:		43.527058886354574			
Path:		738\7383918.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1008638101		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				17	
Code OB Desc:				East83:	
Open Hole:				608987.00	
Cluster Kind:				North83:	
Date Completed:		01/13/2021		4820230.00	
Remarks:				Org CS:	
Location Method Desc:		on Water Well Record		UTM83	
Elevrc Desc:				UTMRC:	
Location Source Date:				4	
Improvement Location Source:				UTMRC Desc:	
Improvement Location Method:				margin of error : 30 m - 100 m	
Source Revision Comment:				Location Method:	
Supplier Comment:				wwr	
33	1 of 2	SE/152.8	129.8 / -0.98	2085 North Sheridan Way Mississauga ON L5K 2T2	EHS
Order No:		20060418028		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Complete Report		Client Prov/State:	
Report Date:		4/27/2006		ON	
Date Received:		4/18/2006		Search Radius (km):	
Previous Site Name:				0.25	
Lot/Building Size:				X:	
Additional Info Ordered:				-79.650691	
				Y:	
				43.524595	
33	2 of 2	SE/152.8	129.8 / -0.98	2085 North Sheridan Way Mississauga, Ontario ON L5K 2T2	EHS
Order No:		20090605015		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Standard Select Report		Client Prov/State:	
Report Date:		6/10/2009		ON	
Date Received:		6/5/2009		Search Radius (km):	
				0.25	
				X:	
				-79.650641	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Previous Site Name: Lot/Building Size: Additional Info Ordered:				Y: 43.52451	
34	1 of 2	ENE/153.3	127.2 / -3.59	PIPELINE HIT - 1" 1930 FOWLER DRIVE UNIT#100T,, MISSISSAUGA,ON,L5K 0A1,CA ON	PINC
Incident Id: Incident No: 1263932 Incident Reported Dt: 10/16/2013 Type: FS-Pipeline Incident Status Code: Tank Status: Pipeline Damage Reason Est Task No: Spills Action Centre: Fuel Type: Fuel Occurrence Tp: Date of Occurrence: Occurrence Start Dt: Depth: Customer Acct Name: PIPELINE HIT - 1" Incident Address: 1930 FOWLER DRIVE UNIT#100T,,MISSISSAUGA,ON,L5K 0A1,CA Operation Type: Pipeline Type: Regulator Type: Summary: Reported By: Affiliation: Occurrence Desc: Damage Reason: Notes:		Pipe Material: Fuel Category: Health Impact: Environment Impact: Property Damage: Service Interrupt: Enforce Policy: Public Relation: Pipeline System: PSIG: Attribute Category: Regulator Location: Method Details:			
34	2 of 2	ENE/153.3	127.2 / -3.59	Enbridge Gas Distribution Inc. 1930 Fowler Drive, unit 100C Mississauga ON	SPL
Ref No: 5380-9CJNK7 Year: Incident Dt: 2013/10/16 Dt MOE Arvl on Scn: MOE Reported Dt: 2013/10/16 Dt Document Closed: 2013/11/01 Site No: MOE Response: Referral to others Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Vandyk Vanguard<UNOFFICIAL> Site Address: 1930 Fowler Drive, unit 100C Site Region: Site Municipality: Mississauga Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Enbridge Gas Distribution Inc.		Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Client Type: Source Type: Incident Cause: Leak/Break Incident Preceding Spill: Incident Reason: Operator/Human Error Incident Summary: TSSA: 1 inch line strike, made safe Environment Impact: Confirmed Health Env Consequence: Nature of Impact: Air Pollution Contaminant Qty: 0 other - see incident description Contaminant Qty 1: 0 Contaminant Unit: other - see incident description Contaminant Code: 35 Contaminant Name: NATURAL GAS (METHANE) Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Pipeline/Components SAC Action Class: Air Spills - Gases and Vapours Call Report Locatn Geodata: Time Reported: System Facility Address: Source Sector Type: Conservtn Auth Name: Primary Watershed: Quaternary Watershed: Offsite Impacts: Waterbody Impacted:					

35	1 of 1	NNE/169.0	128.6 / -2.23	1401 KING ST E COURTICE ON	WWIS
Well ID: 7191831 Construction Date: Use 1st: Test Hole Use 2nd: Final Well Status: Test Hole Water Type: Casing Material: Audit No: Z159940 Tag: A136184 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: MISSISSAUGA CITY Site Info: PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/719\7191831.pdf Additional Detail(s) (Map) Well Completed Date: 10/05/2012 Year Completed: 2012					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 11/21/2012 Selected Flag: TRUE Abandonment Rec: Contractor: 7215 Form Version: 7 Owner: County: PEEL Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth (m):		4.8768			
Latitude:		43.5273889357829			
Longitude:		-79.6517947542171			
Point X:		-79.65179460419385			
Point Y:		43.527388933419495			
Path:		719\7191831.pdf			
 <u>Bore Hole Information</u>					
Bore Hole ID:	1004208087			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	608946.00
Code OB Desc:				North83:	4820266.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	10/05/2012			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1004535339				
Layer:	1				
Color:	6				
General Color:	BROWN				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:	06				
Material 2 Desc:	SILT				
Material 3:	27				
Material 3 Desc:	OTHER				
Formation Top Depth:	0.0				
Formation End Depth:	16.0				
Formation End Depth UOM:	ft				
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1004535348				
Layer:	2				
Plug From:	5.0				
Plug To:	1.0				
Plug Depth UOM:	ft				
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1004535349				
Layer:	3				
Plug From:	1.0				
Plug To:	0.0				
Plug Depth UOM:	ft				
 <u>Annular Space/Abandonment</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Sealing Record</u>					
Plug ID:		1004535347			
Layer:		1			
Plug From:		16.0			
Plug To:		5.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1004535346			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1004535338			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1004535343			
Layer:		2			
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:					
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		1004535342			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		6.0			
Depth To:		0.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1004535344			
Layer:		1			
Slot:		10			
Screen Top Depth:		16.0			
Screen End Depth:		6.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.0			
<u>Water Details</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water ID:		1004535341			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
 <u>Hole Diameter</u>					
Hole ID:		1004535340			
Diameter:		8.0			
Depth From:		16.0			
Depth To:		0.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
36	1 of 1	ESE/171.0	129.8 / -0.98	2085 North Sheridan Way Mississauga ON L5K 2L6	EHS
Order No:	20310500264			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	RSC Report (Urban)			Client Prov/State:	ON
Report Date:	10-NOV-20			Search Radius (km):	.3
Date Received:	05-NOV-20			X:	-79.65040603
Previous Site Name:				Y:	43.52500212
Lot/Building Size:					
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans; City Directory; Aerial Photos				
37	1 of 1	N/171.8	129.7 / -1.18	Erin Mills Parkway & Fowler Drive, Mississauga ON	INC
Incident No:	390162			Any Health Impact:	No
Incident ID:	2541792			Any Enviro Impact:	Yes
Instance No:				Service Intrap:	No
Status Code:	Causal Analysis Complete			Was Prop Damaged:	No
Incident Status:				Reside App. Type:	
Incident Severity:				Commer App. Type:	
Task No:	2898652			Indus App. Type:	
Attribute Category:	FS-Perform L1 Incident Insp			Institut App. Type:	
Context:				Depth Ground Cover:	
Date of Occurrence:	2010/05/19 00:00:00			Operation Pressure:	
Time of Occurrence:	13:20:00			Equipment Type:	
Occr Insp Start Dt:	2010/05/20 00:00:00			Equipment Model:	
Incident Creat On:				Serial No:	
Instance Creat Dt:				Cylinder Capacity:	
Instance Install Dt:				Cylinder Cap Units:	
Approx Quant Rel:	100 LITRES			Cylinder Mat Type:	
Tank Capacity:				Pump Flow Rate Cap:	
Fuels Occur Type:	Discovery of a Petroleum Product			Contam. Migrated:	Unknown
Occur Type Rpt:				Near Body of Water:	No
Occur Category:				Drainage System:	No
Fuel Type Involved:	Fuel Oil			Sub Surface Contam:	UNKNOWN
Fuel Type Reported:				Tank Material Type:	
Enforcement Policy:	NULL			Tank Storage Type:	
Prc Escalation Req:	NULL			Tank Location Type:	
Item:					
Item Description:					
Device Installed Location:					
Venting Type:					
Vent Conn Mater:					
Vent Chimney Mater:					
Pipeline Type:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pipeline Involved: Pipe Material: Regulator Location: Regulator Type: Liquid Prop Make: Liquid Prop Model: Liquid Prop Serial No: Liquid Prop Notes: Inventory Address: Erin Mills Parkway & Fowler Drive, Mississauga - Discovery of Product Invent Postal Code: Notes: Contact Natural Env: Yes Aff Prop Use Water: No Occurence Narrative: u/g fuel tank struck by backhoe Operation Type Involved: Construction Site (including excavation)					
38	1 of 6	NNE/178.3	127.2 / -3.67	1910 Fowler Drive Suite A104 Mississauga ON L5K 0A1	EHS
Order No: 20110616022 Status: C Report Type: Site Report Report Date: 6/17/2011 Date Received: 6/16/2011 1:14:17 PM Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: OH Search Radius (km): 0.25 X: -79.651567 Y: 43.528027					
38	2 of 6	NNE/178.3	127.2 / -3.67	Sherwin Williams Company 1910 Fowler Dr Suite A104 Mississauga ON L5K 0A1	GEN
<u>Generator Info</u>					
Generator No: ON9160487 Approval Years: As of Dec 2018 Status: Registered PO Box No: Country: Canada Co Admin: Phone No Admin: SIC Description:					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:					
<u>Waste Detail(s)</u>					
Waste Class: 145 I Waste Class Name: Wastes from the use of pigments, coatings and paints					
<u>Waste Detail(s)</u>					
Waste Class: 145 L Waste Class Name: Wastes from the use of pigments, coatings and paints					
<u>Waste Detail(s)</u>					
Waste Class: 232 I Waste Class Name: Polymeric resins					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		232 L			
Waste Class Name:		Polymeric resins			
<u>Waste Detail(s)</u>					
Waste Class:		263 I			
Waste Class Name:		Misc. waste organic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		331 I			
Waste Class Name:		Waste compressed gases including cylinders			
38	3 of 6	NNE/178.3	127.2 / -3.67	Sherwin Williams Company 1910 Fowler Dr Suite A104 Mississauga ON L5K 0A1	GEN
<u>Generator Info</u>					
Generator No:	ON9160487			Choice of Contact:	
Approval Years:	As of Jul 2020			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		145 I			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
<u>Waste Detail(s)</u>					
Waste Class:		145 L			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
<u>Waste Detail(s)</u>					
Waste Class:		232 L			
Waste Class Name:		Polymeric resins			
<u>Waste Detail(s)</u>					
Waste Class:		331 I			
Waste Class Name:		Waste compressed gases including cylinders			
<u>Waste Detail(s)</u>					
Waste Class:		232 I			
Waste Class Name:		Polymeric resins			
<u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		263 I			
Waste Class Name:		Misc. waste organic chemicals			

38	4 of 6	NNE/178.3	127.2 / -3.67	Sherwin Williams Company 1910 Fowler Dr Suite A104 Mississauga ON L5K 0A1	GEN

Generator Info

Generator No:	ON9160487	Choice of Contact:
Approval Years:	As of Nov 2021	Contaminated Fac:
Status:	Registered	MHSW Facility:
PO Box No:		SIC Code:
Country:	Canada	
Co Admin:		
Phone No Admin:		
SIC Description:		

Waste Detail(s)

Waste Class:	145 I
Waste Class Name:	Wastes from the use of pigments, coatings and paints

Waste Detail(s)

Waste Class:	263 I
Waste Class Name:	Misc. waste organic chemicals

Waste Detail(s)

Waste Class:	232 L
Waste Class Name:	Polymeric resins

Waste Detail(s)

Waste Class:	145 L
Waste Class Name:	Wastes from the use of pigments, coatings and paints

Waste Detail(s)

Waste Class:	232 I
Waste Class Name:	Polymeric resins

Waste Detail(s)

Waste Class:	331 I
Waste Class Name:	Waste compressed gases including cylinders

38	5 of 6	NNE/178.3	127.2 / -3.67	RBC 1910 FOWLER DR. UNIT A 100 MISSISSAUGA ON	GEN

Generator Info (as of Dec 2024)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No:		ON001061054			
Generator Company Name:		RBC			
Street:		1910 FOWLER DR. UNIT A 100			
City:		MISSISSAUGA			
Province State:		Ontario			
Country:		Canada			
Postal Code:		L5K 0A1			
Waste Class:		212 I			
Waste Class Decoded:					
212 - ALIPHATIC SOLVENTS					
<u>Generator Info (as of Apr 2025)</u>					
Generator Company Name:		RBC			
Generator Site Address:		1910 FOWLER DR. UNIT A 100			
City:		MISSISSAUGA			
Province State:		Ontario			
Country:		Canada			
Postal Code:		L5K 0A1			
Waste Class:		212 I			
Waste Class Decoded:					
212 - ALIPHATIC SOLVENTS					
Waste Characteristic Decoded:					
I - Ignitable					
38	6 of 6	NNE/178.3	127.2 / -3.67	Sherwin-Williams Paint Store 1910 Fowler Dr Suite A104 Mississauga ON L5K0A1	SCT
Scott S ID:		55139763			
Latitude:		43.527394			
Longitude:		-79.6511414			
<u>Details</u>					
Bus Type 1:		Distributor		Employee Count: 6	
Bus Type 2:		Manufacturer's Sales Office		Square Footage: 3000	
Bus Type 3:		Wholesaler		Estimated Sales: N/A	
Product Cat 1:		Home improvement store		Export Indicator: N	
Product Cat 2:		Paint manufacturer		Export Country 1:	
Product Cat 3:		Paint store		Export Country 2:	
Product Cat 4:		Painting		Export Country 3:	
Product Cat 5:		Paintings store		Export Country 4:	
Product Cat 6:		Paints		Export Country 5:	
Product Cat 7:		Wallpaper store		Export Country 6:	
Product Cat 8:				Geocoded by: Address	
Company Name:		Sherwin-Williams Paint Store			
Address Line 1:		1910 Fowler Dr Suite A104			
Address Line 2:					
City:		Mississauga			
Province:		ON			
Postal Code:		L5K0A1			
Census Division:		Peel Regional Municipality; ON			
Metro Area:		Toronto			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Year Established: Head Office Indicator: N Parent Company Nm: Parent Cmpny Addr 1: Parent Cmpny Addr 2: Parent Cmpny City: Parent Cmpny Prov: Parent Cmpny PC: Parent Cmpny Cntry: Head Office Nm: The Sherwin-Williams Company H Office Addr Line 1: 950 Raymur Ave H Office Addr Line 2: Head Office City: Vancouver Head Office Province: BC Head Office PC: V6A3L5 Head Office Cntry: Telephone: 905-822-8543 Fax: 403-328-7040 Website: http://www.sherwin-williams.ca/en/%3Futm_source%3Dgoogle%26utm_medium%3Dlocal_listing%26utm_campaign%3Dtag_local_listing Pri NAICS Desc: 416340-Paint; Glass and Wallpaper Merchant Wholesalers NAICS Code 1: 416340-Paint; Glass and Wallpaper Merchant Wholesa NAICS Code 2: NAICS Code 3: NAICS Code 4: NAICS Code 5:					
39	1 of 1	NNE/181.6	127.5 / -3.35	ON	WWIS
Well ID: 7189084 Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: C19351 Tag: Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: MISSISSAUGA CITY Site Info: Flowing (Y/N): Flow Rate: Data Entry Status: Yes Data Src: Date Received: 09/27/2012 Selected Flag: TRUE Abandonment Rec: Contractor: 7215 Form Version: 8 Owner: County: PEEL Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/718\7189084.pdf					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 07/16/2012 Year Completed: 2012 Depth (m): Latitude: 43.5274385685607 Longitude: -79.6514224023272 Point X: -79.6514225262267 Point Y: 43.52743856649557 Path: 718\7189084.pdf					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Bore Hole Information</u>					
Bore Hole ID:	1004215165			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	608976.00
Code OB Desc:				North83:	4820272.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	07/16/2012			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
40	1 of 5	SW/183.7	133.7 / 2.91	A-PRO-TEK EXTERMINATION SERVICES 2131 BOSACK COURT MISSISSAUGA ON L5K 2M1	PES
Detail Licence No:				Operator Box:	
Licence No:				Operator Class:	
Status:				Operator No:	
Approval Date:				Operator Type:	
Report Source:				Oper Area Code:	
Licence Type:	Operator			Oper Phone No:	
Licence Type Code:				Operator Ext:	
Licence Class:				Operator Lot:	
Licence Control:				Oper Concession:	
Latitude:				Operator Region:	
Longitude:				Operator District:	
Lot:				Operator County:	
Concession:				Op Municipality:	
Region:				Post Office Box:	
District:				MOE District:	
County:				SWP Area Name:	
Trade Name:					
PDF URL:					
40	2 of 5	SW/183.7	133.7 / 2.91	973822 ONTARIO LIMITED 2131 BOSACK COURT MISSISSAUGA ON L5K 2M1	PES
Detail Licence No:				Operator Box:	
Licence No:				Operator Class:	
Status:				Operator No:	
Approval Date:				Operator Type:	
Report Source:				Oper Area Code:	
Licence Type:	Operator			Oper Phone No:	
Licence Type Code:				Operator Ext:	
Licence Class:				Operator Lot:	
Licence Control:				Oper Concession:	
Latitude:				Operator Region:	
Longitude:				Operator District:	
Lot:				Operator County:	
Concession:				Op Municipality:	
Region:				Post Office Box:	
District:				MOE District:	
County:				SWP Area Name:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Trade Name: PDF URL:					
40	3 of 5	SW/183.7	133.7 / 2.91	SWAT PEST CONTROL/FARRELL'S PEST CONTROL 2131 BUSACK COURT MISSISSAUGA ON	PES
Detail Licence No: Licence No: Status: Approval Date: Report Source: Licence Type: Vendor Licence Type Code: Licence Class: Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:		Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: Oper Phone No: Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:			
40	4 of 5	SW/183.7	133.7 / 2.91	A-PRO-TEK EXTERMINATION SERVICES 2131 BOSACK COURT MISSISSAUGA ON L5K 2M1	PES
Detail Licence No: Licence No: Status: Approval Date: Report Source: Licence Type: Operator Licence Type Code: 02 Licence Class: Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:		Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: Oper Phone No: Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:			
40	5 of 5	SW/183.7	133.7 / 2.91	973822 ONTARIO LIMITED 2131 BOSACK CRT MISSISSAUGA ON L5K 2M1	PES
Detail Licence No: Licence No: Status: Approval Date: Report Source: Licence Type: Operator		Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: Oper Phone No:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Licence Type Code: Licence Class: Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL: Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:					
41	1 of 5	SW/183.8	133.4 / 2.57	973822 ONTARIO LIMITED 2131 BOSACK CRT MISSISSAUGA ON L5K2M1	PES
Detail Licence No: Licence No: 08055 Status: Approval Date: Report Source: Legacy Licenses (Excluding TS) Licence Type: Operator Licence Type Code: 02 Licence Class: 01 Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL: Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: 905 Oper Phone No: 2577246 Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:					
41	2 of 5	SW/183.8	133.4 / 2.57	973822 ONTARIO LIMITED 2131 BOSACK CRT MISSISSAUGA ON L5K2M1	PES
Detail Licence No: Licence No: 09993 Status: Approval Date: Report Source: Legacy Licenses (Excluding TS) Licence Type: Operator Licence Type Code: 02 Licence Class: 01 Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL: Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: 905 Oper Phone No: 2577246 Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:					

147 erisinfo.com | Environmental Risk Information Services Order No: 26022500296

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Concession: Region: District: County: Trade Name: PDF URL:					
Op Municipality: Post Office Box: MOE District: Halton-Peel SWP Area Name: Credit Valley http://www.accessenvironment.ene.gov.on.ca/AEWeb/ae/ViewDocument.action?documentRefID=2123502					
42	1 of 37	NNE/187.0	127.6 / -3.19	Shell Canada OP Inc. and Shell Canada Products Limited 2165 Erin Mills Parkway Mississauga ON L5K 1T7	CA
Certificate #: 1243-65SNFH Application Year: 2004 Issue Date: 10/22/2004 Approval Type: Industrial Sewage Works Status: Approved Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:					
42	2 of 37	NNE/187.0	127.6 / -3.19	972129 ONTARIO LIMITED O/A SHELL CANADA GAS STN 2165 ERIN MILLS PKWY MISSISSAUGA ON L5K 1T7	DTNK
<u>Delisted Expired Fuel Safety Facilities</u> Instance No: 9456990 Status: EXPIRED Instance ID: Instance Type: FS Facility Instance Creation Dt: Instance Install Dt: Item Description: Manufacturer: Model: Serial No: ULC Standard: Quantity: Unit of Measure: Overfill Prot Type: Creation Date: Next Periodic Str DT: TSSA Base Sched Cycle 2: TSSAMax Hazard Rank 1: TSSA Risk Based Periodic Yn: TSSA Volume of Directives: TSSA Periodic Exempt: TSSA Statutory Interval: TSSA Recd Insp Interva: TSSA Recd Tolerance: TSSA Program Area: TSSA Program Area 2:					
Expired Date: 8/28/1998 Max Hazard Rank: Facility Location: Facility Type: Fuel Type 2: Fuel Type 3: Panam Related: Panam Venue Nm: External Identifier: Item: Piping Steel: Piping Galvanized: Tank Single Wall St: Piping Underground: Tank Underground: Source:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Description: Original Source: Record Date:					
		EXP Up to May 2013			
42	3 of 37	NNE/187.0	127.6 / -3.19	972129 ONTARIO LIMITED O/A SHELL CANADA GAS STN 2165 ERIN MILLS PKWY MISSISSAUGA ON	DTNK
<u>Delisted Expired Fuel Safety Facilities</u>					
Instance No: 11561508 Status: EXPIRED Instance ID: 90618 Instance Type: FS Piping Instance Creation Dt: Instance Install Dt: Item Description: Manufacturer: Model: Serial No: ULC Standard: Quantity: Unit of Measure: Overfill Prot Type: Creation Date: Next Periodic Str DT: TSSA Base Sched Cycle 2: TSSAMax Hazard Rank 1: TSSA Risk Based Periodic Yn: TSSA Volume of Directives: TSSA Periodic Exempt: TSSA Statutory Interval: TSSA Recd Insp Interva: TSSA Recd Tolerance: TSSA Program Area: TSSA Program Area 2: Description: FS Piping Original Source: EXP Record Date: Up to Mar 2012					
Expired Date: Max Hazard Rank: Facility Location: Facility Type: Fuel Type 2: Fuel Type 3: Panam Related: Panam Venue Nm: External Identifier: Item: Piping Steel: Piping Galvanized: Tank Single Wall St: Piping Underground: Tank Underground: Source:					
42	4 of 37	NNE/187.0	127.6 / -3.19	Shell Canada OP Inc. and Shell Canada Products Limited 2165 Erin Mills Parkway Mississauga ON M2N 6Y2	ECA
Approval No: 1243-65SNFH Approval Date: 2004-10-22 Status: Approved Record Type: ECA Link Source: IDS SWP Area Name: Credit Valley Approval Type: ECA-INDUSTRIAL SEWAGE WORKS Project Type: INDUSTRIAL SEWAGE WORKS Business Name: Shell Canada OP Inc. and Shell Canada Products Limited Address: 2165 Erin Mills Parkway Full Address: Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/1864-62AJAM-14.pdf PDF Site Location:					
MOE District: Halton-Peel City: Longitude: -79.65158 Latitude: 43.52755 Geometry X: Geometry Y:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
42	5 of 37	NNE/187.0	127.6 / -3.19	2165 Erin Mills Pky Mississauga ON L5K 1T7	EHS
Order No: 20040216011 Status: C Report Type: Complete Report Report Date: 2/20/04 Date Received: 2/16/04 Previous Site Name: Lot/Building Size: Lot = 56 m x 48 m Additional Info Ordered: Fire Insur. Maps and/or Site Plans; Aerials Photos and/or Topographical Maps		Nearest Intersection: Erin Mills Parkway and Fowler Drive Municipality: Peel Client Prov/State: ON Search Radius (km): 0.25 X: -79.652061 Y: 43.527595			
42	6 of 37	NNE/187.0	127.6 / -3.19	972129 ONTARIO LIMITED O/A SHELL CANADA GAS STN 2165 ERIN MILLS PKWY MISSISSAUGA ON	EXP
Inventory No: 10855838 Inventory Status: EXPIRED Installation Year: 1970 Capacity: 45400 Capacity Unit: Tank Type: Manufacturer: Model: Description: Previous Fuel Type: Gasoline		Tank Material: Steel Corrosion Protect: Sacrificial anode Overfill Protection: Inventory Context: FS Liquid Fuel Tank Inventory Item: FS LIQUID FUEL TANK			
42	7 of 37	NNE/187.0	127.6 / -3.19	972129 ONTARIO LIMITED O/A SHELL CANADA GAS STN 2165 ERIN MILLS PKWY MISSISSAUGA ON	EXP
Inventory No: 10855820 Inventory Status: EXPIRED Installation Year: 1970 Capacity: 45400 Capacity Unit: Tank Type: Manufacturer: Model: Description: Previous Fuel Type: Gasoline		Tank Material: Steel Corrosion Protect: Sacrificial anode Overfill Protection: Inventory Context: FS Liquid Fuel Tank Inventory Item: FS LIQUID FUEL TANK			
42	8 of 37	NNE/187.0	127.6 / -3.19	972129 ONTARIO LIMITED O/A SHELL CANADA GAS STN 2165 ERIN MILLS PKWY MISSISSAUGA ON	EXP
Inventory No: 10855829 Inventory Status: EXPIRED Installation Year: 1970 Capacity: 22700 Capacity Unit: Tank Type: Manufacturer: Model: Description: Previous Fuel Type: Gasoline		Tank Material: Steel Corrosion Protect: Sacrificial anode Overfill Protection: Inventory Context: FS Liquid Fuel Tank Inventory Item: FS LIQUID FUEL TANK			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
42	9 of 37	NNE/187.0	127.6 / -3.19	SHELL CANADA PRODUCTS 2165 ERIN MILLS PARKWAY MISSISSAUGA ON	FST
Inventory No:	11582283			Tank Material:	Fiberglass (FRP)
Inventory Status:	active			Corrosion Protect:	Fiberglass
Installation Year:	1999			Overfill Protection:	
Capacity:	35000			Inventory Context:	FS Liquid Fuel
Capacity Unit:	L			Inventory Item:	FS Liquid Fuel Tank
Tank Type:		Double Wall UST			
Manufacturer:					
Model:					
Description:		2009VBS 2008V			
42	10 of 37	NNE/187.0	127.6 / -3.19	SHELL CANADA PRODUCTS 2165 ERIN MILLS PARKWAY MISSISSAUGA ON	FST
Inventory No:	11582278			Tank Material:	Fiberglass (FRP)
Inventory Status:	active			Corrosion Protect:	Fiberglass
Installation Year:	1999			Overfill Protection:	
Capacity:	35000			Inventory Context:	FS Liquid Fuel
Capacity Unit:	L			Inventory Item:	FS Liquid Fuel Tank
Tank Type:		Double Wall UST			
Manufacturer:					
Model:					
Description:		2009VBS 2008V VeederRoot			
42	11 of 37	NNE/187.0	127.6 / -3.19	SHELL CANADA PRODUCTS 2165 ERIN MILLS PARKWAY MISSISSAUGA ON	FST
Inventory No:	11582267			Tank Material:	Fiberglass (FRP)
Inventory Status:	active			Corrosion Protect:	Fiberglass
Installation Year:	1999			Overfill Protection:	
Capacity:	35000			Inventory Context:	FS Liquid Fuel
Capacity Unit:	L			Inventory Item:	FS Liquid Fuel Tank
Tank Type:		Double Wall UST			
Manufacturer:					
Model:					
Description:		2009VBS 2008V Veeder Root			
42	12 of 37	NNE/187.0	127.6 / -3.19	SHELL CANADA PRODUCTS 2165 ERIN MILLS PARKWAY MISSISSAUGA ON	FST
Inventory No:	30892664			Tank Material:	Fiberglass (FRP)
Inventory Status:	active			Corrosion Protect:	Fiberglass
Installation Year:	2004			Overfill Protection:	
Capacity:	25000			Inventory Context:	FS Liquid Fuel
Capacity Unit:	L			Inventory Item:	FS Liquid Fuel Tank
Tank Type:		Double Wall UST			
Manufacturer:					
Model:					
Description:		2009VBS 2008V			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
42	13 of 37	NNE/187.0	127.6 / -3.19	SHELL CANADA PRODUCTS 2165 ERIN MILLS PARKWAY MISSISSAUGA ON	FST
Inventory No: 30746755 Inventory Status: Active Installation Year: Capacity: 130000 Capacity Unit: L Tank Type: Manufacturer: Model: Description:		Tank Material: Corrosion Protect: Overfill Protection: Inventory Context: Liquid Fuels Inventory Item: FS Gasoline Station - Self Serve			
42	14 of 37	NNE/187.0	127.6 / -3.19	972129 ONTARIO LIMITED O/A SHELL CANADA GAS STN 2165 ERIN MILLS PKWY MISSISSAUGA ON L5K 1T7	FSTH
License Issue Date: 5/30/2005 Tank Status: Licensed Tank Status As Of: August 2007 Operation Type: Retail Fuel Outlet Facility Type: Gasoline Station - Self Serve					
--Details-- Status: Active Year of Installation: 2004 Corrosion Protection: Capacity: 25000 Tank Fuel Type: Liquid Fuel Double Wall UST - Diesel					
42	15 of 37	NNE/187.0	127.6 / -3.19	972129 ONTARIO LIMITED O/A SHELL CANADA GAS STN 2165 ERIN MILLS PKWY MISSISSAUGA ON L5K 1T7	FSTH
License Issue Date: 5/30/2005 1:38:00 PM Tank Status: Licensed Tank Status As Of: December 2008 Operation Type: Retail Fuel Outlet Facility Type: Gasoline Station - Self Serve					
--Details-- Status: Active Year of Installation: 2004 Corrosion Protection: Capacity: 25000 Tank Fuel Type: Liquid Fuel Double Wall UST - Diesel					
Status: Active Year of Installation: 1999 Corrosion Protection: Capacity: 36300 Tank Fuel Type: Liquid Fuel Double Wall UST - Gasoline					
Status: Active Year of Installation: 1999					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Corrosion Protection: Capacity: 36300 Tank Fuel Type: Liquid Fuel Double Wall UST - Gasoline Status: Active Year of Installation: 1999 Corrosion Protection: Capacity: 36300 Tank Fuel Type: Liquid Fuel Double Wall UST - Gasoline					
42	16 of 37	NNE/187.0	127.6 / -3.19	Shell Canada 2165 Erin Mills Parkway Mississauga ON L5K 1T7	GEN
<u>Generator Info</u>					
Generator No:	ON4518306			Choice of Contact:	
Approval Years:	06			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	447190
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	Other Gasoline Stations				
<u>Waste Detail(s)</u>					
Waste Class:	221				
Waste Class Name:	LIGHT FUELS				
42	17 of 37	NNE/187.0	127.6 / -3.19	Shell Canada 2165 Erin Mills Parkway Mississauga ON L5K 1T7	GEN
<u>Generator Info</u>					
Generator No:	ON8999762			Choice of Contact:	
Approval Years:	06			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	447110
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	Gasoline Stations with Convenience Stores				
<u>Waste Detail(s)</u>					
Waste Class:	221				
Waste Class Name:	LIGHT FUELS				
<u>Waste Detail(s)</u>					
Waste Class:	251				
Waste Class Name:	OIL SKIMMINGS & SLUDGES				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
42	18 of 37	NNE/187.0	127.6 / -3.19	Shell Canada c/o Minotaur Guardian Service Ltd. 2165 Erin Mills Mississauga ON	GEN

Generator Info

Generator No:	ON4952286	Choice of Contact:	
Approval Years:	2012	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	447110
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	Gasoline Stations with Convenience Stores		

42	19 of 37	NNE/187.0	127.6 / -3.19	Shell Canada c/o Minotaur Guardian Service Ltd. 2165 Erin Mills Mississauga ON	GEN

Generator Info

Generator No:	ON4952286	Choice of Contact:	
Approval Years:	2013	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	447110
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	251
Waste Class Name:	OIL SKIMMINGS & SLUDGES

42	20 of 37	NNE/187.0	127.6 / -3.19	Shell Canada c/o Minotaur Guardian Service Ltd. 2165 Erin Mills Mississauga ON L5K 1T7	GEN

Generator Info

Generator No:	ON4952286	Choice of Contact:	CO_ADMIN
Approval Years:	2016	Contaminated Fac:	No
Status:		MHSW Facility:	No
PO Box No:		SIC Code:	447110
Country:	Canada		
Co Admin:	Ken Bouchard		
Phone No Admin:	6042176413 Ext.		
SIC Description:	447110		

Waste Detail(s)

Waste Class:	251
Waste Class Name:	OIL SKIMMINGS & SLUDGES

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
42	21 of 37	NNE/187.0	127.6 / -3.19	Shell Canada c/o Minotaur Guardian Service Ltd. 2165 Erin Mills Mississauga ON L5K 1T7	GEN

Generator Info

Generator No:	ON4952286	Choice of Contact:	CO_ADMIN
Approval Years:	2015	Contaminated Fac:	No
Status:		MHSW Facility:	No
PO Box No:		SIC Code:	447110
Country:	Canada		
Co Admin:	Ken Bouchard		
Phone No Admin:	6042176413 Ext.		
SIC Description:	447110		

Waste Detail(s)

Waste Class:	251
Waste Class Name:	OIL SKIMMINGS & SLUDGES

42	22 of 37	NNE/187.0	127.6 / -3.19	Shell Canada c/o Minotaur Guardian Service Ltd. 2165 Erin Mills Mississauga ON L5K 1T7	GEN

Generator Info

Generator No:	ON4952286	Choice of Contact:	CO_ADMIN
Approval Years:	2014	Contaminated Fac:	No
Status:		MHSW Facility:	No
PO Box No:		SIC Code:	447110
Country:	Canada		
Co Admin:	Kelly West		
Phone No Admin:	519-647-3729 Ext.		
SIC Description:	447110		

Waste Detail(s)

Waste Class:	251
Waste Class Name:	OIL SKIMMINGS & SLUDGES

42	23 of 37	NNE/187.0	127.6 / -3.19	Shell Canada c/o Minotaur Guardian Service Ltd. 2165 Erin Mills Mississauga ON L5K 1T7	GEN

Generator Info

Generator No:	ON4952286	Choice of Contact:	
Approval Years:	As of Dec 2018	Contaminated Fac:	
Status:	Registered	MHSW Facility:	
PO Box No:		SIC Code:	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		251 L			
Waste Class Name:		Waste oils/sludges (petroleum based)			
42	24 of 37	NNE/187.0	127.6 / -3.19	Shell Canada c/o Minotaur Guardian Service Ltd. 2165 Erin Mills Mississauga ON L5K 1T7	GEN
<u>Generator Info</u>					
Generator No:		ON4952286	Choice of Contact:		
Approval Years:		As of Jul 2020	Contaminated Fac:		
Status:		Registered	MHSW Facility:		
PO Box No:			SIC Code:		
Country:		Canada			
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		251 L			
Waste Class Name:		Waste oils/sludges (petroleum based)			
42	25 of 37	NNE/187.0	127.6 / -3.19	Shell Canada c/o Minotaur Guardian Service Ltd. 2165 Erin Mills Mississauga ON L5K 1T7	GEN
<u>Generator Info</u>					
Generator No:		ON4952286	Choice of Contact:		
Approval Years:		As of Nov 2021	Contaminated Fac:		
Status:		Registered	MHSW Facility:		
PO Box No:			SIC Code:		
Country:		Canada			
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		251 L			
Waste Class Name:		Waste oils/sludges (petroleum based)			
42	26 of 37	NNE/187.0	127.6 / -3.19	Shell Canada 2165 Erin Mills Mississauga ON	GEN
<u>Generator Info</u>					
Generator No:		ON4952286	Choice of Contact:		
Approval Years:		As of Oct 2022	Contaminated Fac:		
Status:		Registered	MHSW Facility:		
PO Box No:			SIC Code:		
Country:		Canada			
Co Admin:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Phone No Admin: SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		251 L			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
<u>Generator Info (as of Dec 2024)</u>					
Generator No:		ON4952286			
Generator Company Name:		Shell Canada			
Street:		2165 Erin Mills			
City:		Mississauga			
Province State:		Ontario			
Country:		Canada			
Postal Code:		L5K1T7			
Waste Class:		251 L			
Waste Class Decoded:					
251 - OIL SKIMMINGS & SLUDGES					
<u>Generator Info (as of Apr 2025)</u>					
Generator Company Name:		Shell Canada			
Generator Site Address:		2165 Erin Mills			
City:		Mississauga			
Province State:		Ontario			
Country:		Canada			
Postal Code:		L5K1T7			
Waste Class:		251 L			
Waste Class Decoded:					
251 - OIL SKIMMINGS & SLUDGES					
Waste Characteristic Decoded:					
L - Liquid Industrial Waste					
<u>2017 Generator Info</u>					
Gen No:	ON4952286	Choice of Contact:	CO_ADMIN		
ID:	19635	Phone No Official:	6042176413 Ext.		
Contaminated Fac:	N	Phone No Admin:	6042176413 Ext.		
MHSW Facility:	N	County Ont:	PEEL (R. M.)		
NAICS Code1:	447110	County Out:			
NAICS Code2:		District:	305		
NAICS Code3:					
Gen Name:	Shell Canada c/o Minotaur Guardian Service Ltd.				
Gen Div:					
Gen Op Name:	Shell Canada c/o Minotaur Guardian Service Ltd.				
Gen Op Div:					
Site Adrs1:	2165 Erin Mills				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Mississauga				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Province Out:					
Site Postal Code:		L5K 1T7			
Site Country:		Canada			
Co Official:		Ken Bouchard			
Co Admin:		Ken Bouchard			
2018 Generator Info					
Gen No:	ON4952286	Choice of Contact:		CO_ADMIN	
ID:	19742	Phone No Official:		6042176413 Ext.	
Contaminated Fac:	N	Phone No Admin:		6042176413 Ext.	
MHSW Facility:	N	County Ont:		PEEL (R. M.)	
NAICS Code1:	447110	County Out:			
NAICS Code2:		District:		305	
NAICS Code3:					
Gen Name:	Shell Canada c/o Minotaur Guardian Service Ltd.				
Gen Div:					
Gen Op Name:	Shell Canada c/o Minotaur Guardian Service Ltd.				
Gen Op Div:					
Site Adrs1:	2165 Erin Mills				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Mississauga				
Province Out:					
Site Postal Code:	L5K 1T7				
Site Country:	Canada				
Co Official:	Ken Bouchard				
Co Admin:	Ken Bouchard				
2019 Generator Info					
Gen No:	ON4952286	Choice of Contact:		CO_ADMIN	
ID:	19754	Phone No Official:		6042176413 Ext.	
Contaminated Fac:	N	Phone No Admin:		6042176413 Ext.	
MHSW Facility:	N	County Ont:		PEEL (R. M.)	
NAICS Code1:	447110	County Out:			
NAICS Code2:		District:		305	
NAICS Code3:					
Gen Name:	Shell Canada c/o Minotaur Guardian Service Ltd.				
Gen Div:					
Gen Op Name:	Shell Canada c/o Minotaur Guardian Service Ltd.				
Gen Op Div:					
Site Adrs1:	2165 Erin Mills				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Mississauga				
Province Out:					
Site Postal Code:	L5K 1T7				
Site Country:	Canada				
Co Official:	Ken Bouchard				
Co Admin:	Ken Bouchard				
2020 Generator Info					
Gen No:	ON4952286	Choice of Contact:		CO_ADMIN	
ID:	19468	Phone No Official:		6042176413 Ext.	
Contaminated Fac:	N	Phone No Admin:		6042176413 Ext.	
MHSW Facility:	N	County Ont:		PEEL (R. M.)	
NAICS Code1:	447110	Countyv Out:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
NAICS Code2:				District:	305
NAICS Code3:					
Gen Name:		Shell Canada c/o Minotaur Guardian Service Ltd.			
Gen Div:					
Gen Op Name:		Shell Canada c/o Minotaur Guardian Service Ltd.			
Gen Op Div:					
Site Adrs1:		2165 Erin Mills			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Mississauga			
Province Out:					
Site Postal Code:		L5K 1T7			
Site Country:		Canada			
Co Official:		Ken Bouchard			
Co Admin:		Ken Bouchard			
 <u>2021 Generator Info</u>					
Gen No:	ON4952286			Choice of Contact:	CO_ADMIN
ID:	19605			Phone No Official:	6042176413 Ext.
Contaminated Fac:	N			Phone No Admin:	6042176413 Ext.
MHSW Facility:	N			County Ont:	PEEL (R. M.)
NAICS Code1:	447110			County Out:	
NAICS Code2:				District:	305
NAICS Code3:					
Gen Name:		Shell Canada c/o Minotaur Guardian Service Ltd.			
Gen Div:					
Gen Op Name:		Shell Canada c/o Minotaur Guardian Service Ltd.			
Gen Op Div:					
Site Adrs1:		2165 Erin Mills			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Mississauga			
Province Out:					
Site Postal Code:		L5K 1T7			
Site Country:		Canada			
Co Official:		Ken Bouchard			
Co Admin:		Ken Bouchard			
<u>42</u>	27 of 37	NNE/187.0	127.6 / -3.19	B K LAKEVIEW SERVICE LTD 2165 ERIN MILLS PKWY MISSISSAUGA ON L5K 1T7	PRT
Location ID:	9076				
Type:	retail				
Expiry Date:	1995-01-31				
Capacity (L):	113650				
Licence #:	0010411001				
<u>42</u>	28 of 37	NNE/187.0	127.6 / -3.19	1109289 ONTARIO INC 2165 ERIN MILLS PKWY MISSISSAUGA ON L5K1T7	PRT
Location ID:	9076				
Type:	retail				
Expiry Date:	1996-03-31				
Capacity (L):	113650				
Licence #:	0076440981				

160 erisinfo.com | Environmental Risk Information Services Order No: 26022500296

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: LAND Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address: Source Sector Type: Conservtn Auth Name: Primary Watershed: Quaternary Watershed: Offsite Impacts: Waterbody Impacted:					
42	32 of 37	NNE/187.0	127.6 / -3.19	SHELL CANADA PRODUCTS LTD. 2165 ERIN MILLS PARKWAY SERVICE STATION MISSISSAUGA CITY ON L5K 1T7	SPL
Ref No:	150273			Municipality No:	21102
Year:				Nature of Damage:	
Incident Dt:	12/13/1997			Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:	12/13/1997			Impact to Health:	
Dt Document Closed:				Agency Involved:	FD, WORKS
Site No:					
MOE Response:					
Site County/District:					
Site Geo Ref Meth:					
Site District Office:					
Nearest Watercourse:					
Site Name:					
Site Address:					
Site Region:					
Site Municipality:		MISSISSAUGA CITY			
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Entity Operating Name:					
Client Name:					
Client Type:					
Source Type:					
Incident Cause:		PIPE/HOSE LEAK			
Incident Preceding Spill:					
Incident Reason:		ERROR			
Incident Summary:		SHELL CANADA PRODUCTS- MAX 40 L GASOLINE TO STORM SEWER AND CREEK.			
Environment Impact:		POSSIBLE			
Health Env Consequence:					
Nature of Impact:		Water course or lake			
Contaminant Qty:					
Contaminant Qty 1:					
Contaminant Unit:					
Contaminant Code:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: WATER Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address: Source Sector Type: Conservtn Auth Name: Primary Watershed: Quaternary Watershed: Offsite Impacts: Waterbody Impacted:					
42	33 of 37	NNE/187.0	127.6 / -3.19	SHELL CANADA PRODUCTS LTD. AT SHELL SERVICE STATION AT 2165 ERIN MILLS PKWY. AT FOWLER RD. SERVICE STATION MISSISSAUGA CITY ON L5K 1T7	SPL
Ref No: 162135 Year: Incident Dt: // Dt MOE Arvl on Scn: MOE Reported Dt: 11/17/1998 Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Site Address: Site Region: Site Municipality: MISSISSAUGA CITY Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: PIPE/HOSE LEAK Incident Preceding Spill: Incident Reason: MATERIAL FAILURE Incident Summary: SHELL CANADA - GASOLINE IN MONITORING WELL DUE TO PIPE LEAK. Environment Impact: POSSIBLE Health Env Consequence: Nature of Impact: Groundwater pollution Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name:					
				Municipality No: 21102 Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: LAND / WATER Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address: Source Sector Type: Conservtn Auth Name: Primary Watershed: Quaternary Watershed: Offsite Impacts: Waterbody Impacted:					
42	34 of 37	NNE/187.0	127.6 / -3.19	SHELL CANADA PRODUCTS LTD. SHELL GAS STATION AT 2165 ERIN MILLS PARKWAY SERVICE STATION MISSISSAUGA CITY ON L5K 1T7	SPL
Ref No: 174496 Year: Incident Dt: // Dt MOE Arvl on Scn: MOE Reported Dt: 11/3/1999 Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Site Address: Site Region: Site Municipality: MISSISSAUGA CITY Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: OTHER CONTAINER LEAK Incident Preceding Spill: Incident Reason: UNKNOWN Incident Summary: SHELL SERVICE STN- LPH FOUND IN 2 MINITORING WELLS. Environment Impact: POSSIBLE Health Env Consequence: Nature of Impact: Multi Media Pollution Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1:					
Municipality No: 21102 Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant UN No 1: Receiving Medium: LAND Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address: Source Sector Type: Conservtn Auth Name: Primary Watershed: Quaternary Watershed: Offsite Impacts: Waterbody Impacted:					
42	35 of 37	NNE/187.0	127.6 / -3.19	Shell Canada OP Inc. 2165 Erin Mills Parkway Mississauga ON L5K 1T7	SPL
Ref No: 3146-65QTMB Year: Incident Dt: 10/13/2004 Dt MOE Arvl on Scn: MOE Reported Dt: 10/13/2004 Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Halton-Peel Nearest Watercourse: Site Name: 2165 ERIN MILLS PARKWAY Site Address: Site Region: Central Site Municipality: Mississauga Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: NA Easting: NA Entity Operating Name: Client Name: Shell Canada OP Inc. Client Type: Source Type: Incident Cause: Unknown Incident Preceding Spill: Incident Reason: Unknown - Reason not determined Incident Summary: Shell Retail: Product found in ground, redevelop Environment Impact: Confirmed Health Env Consequence: Nature of Impact: Groundwater Pollution; Soil Contamination Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: 12 Contaminant Name: GASOLINE Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Land & Water Activity Preceding Spill:					
Municipality No: Nature of Damage: Discharger Report: Material Group: Oil Impact to Health: Agency Involved:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Service Station SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address: Source Sector Type: Conservtn Auth Name: Primary Watershed: Quaternary Watershed: Offsite Impacts: Waterbody Impacted:					
42	36 of 37	NNE/187.0	127.6 / -3.19	Shell Canada Limited 2165 Erin Mills Pkwy Toronto ON	SPL
Ref No: 7408-5V3FZN Year: Incident Dt: 1/10/2004 Dt MOE Arvl on Scn: MOE Reported Dt: 1/10/2004 Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Toronto Nearest Watercourse: Site Name: SHELL SERVICE STATION<UNOFFICIAL> Site Address: Site Region: Central Site Municipality: Toronto Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Shell Canada Limited Client Type: Source Type: Incident Cause: Pipe Or Hose Leak Incident Preceding Spill: Incident Reason: Unknown - Reason not determined Incident Summary: Shell, 1 L gasoline to ground, cleaned Environment Impact: Not Anticipated Health Env Consequence: Nature of Impact: Soil Contamination Contaminant Qty: 1 L Contaminant Qty 1: Contaminant Unit: L Contaminant Code: 12 Contaminant Name: GASOLINE Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Land Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Service Station					
Municipality No: Nature of Damage: Discharger Report: Material Group: Oil Impact to Health: Agency Involved:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address: Source Sector Type: Conservtn Auth Name: Primary Watershed: Quaternary Watershed: Offsite Impacts: Waterbody Impacted:		Spill to Land			
42	37 of 37	NNE/187.0	127.6 / -3.19	2165 Erin Mills Parkway 2165 Erin Mills Pky Mississauga ON	SPL
Ref No: 2407-6W2LEX Year: Incident Dt: 11/30/2006 Dt MOE Arvl on Scn: MOE Reported Dt: 11/30/2006 Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Halton-Peel Nearest Watercourse: Site Name: 2165 Erin Mills Parkway Site Address: 2165 Erin Mills Pky Site Region: Site Municipality: Mississauga Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: NA Entity Operating Name: Client Name: Client Type: Source Type: Other Motor Vehicle Incident Cause: Incident Preceding Spill: Incident Reason: Incident Summary: Shell Stn: 1.5L fuel spilled some to CB, clng Environment Impact: Confirmed Health Env Consequence: Nature of Impact: Contaminant Qty: 1.5 L Contaminant Qty 1: 1.5 Contaminant Unit: L Contaminant Code: 12 Contaminant Name: GASOLINE Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
System Facility Address: Source Sector Type: Conservtn Auth Name: Primary Watershed: Quaternary Watershed: Offsite Impacts: Waterbody Impacted:					
43	1 of 1	N/189.2	128.9 / -1.88	2165 ERIN MILLS PKWY lot 30 con 1 MISSISSAUGA ON	WWIS
Well ID: 4910029 Construction Date: Use 1st: Use 2nd: Final Well Status: Observation Wells Water Type: Casing Material: Audit No: Z10227 Tag: A010208 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: MISSISSAUGA CITY (PORT CREDIT) Site Info:		Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 01/18/2006 Selected Flag: TRUE Abandonment Rec: Contractor: 6607 Form Version: 3 Owner: County: PEEL Lot: 030 Concession: 01 Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/491\4910029.pdf			
Additional Detail(s) (Map)					
Well Completed Date: 03/02/2004 Year Completed: 2004 Depth (m): 4 Latitude: 43.5275912052304 Longitude: -79.6521491206557 Point X: -79.65214897147662 Point Y: 43.52759120282079 Path: 491\4910029.pdf					
Bore Hole Information					
Bore Hole ID: 11555263 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 03/02/2004 Remarks: Location Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment:		Elevation: Elevrc: Zone: 17 East83: 608917.00 North83: 4820288.00 Org CS: UTM83 UTMRC: 3 UTMRC Desc: margin of error : 10 - 30 m Location Method: wwr			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933044440			
Layer:		1			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		2.799999952316284			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933044441			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		17			
Material 1 Desc:		SHALE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		2.799999952316284			
Formation End Depth:		4.0			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933287453			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933287454			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		0.8999999761581421			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		964910029			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Pipe Information</u>					
Pipe ID:		11564870			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930875438			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.0			
Casing Diameter:		5.0			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		933417559			
Layer:		1			
Slot:		001			
Screen Top Depth:		1.0			
Screen End Depth:		4.0			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.400000095367432			
<u>Water Details</u>					
Water ID:		934072285			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		2.799999952316284			
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		11686912			
Diameter:		10.0			
Depth From:		2.799999952316284			
Depth To:		4.0			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		11686911			
Diameter:		21.0			
Depth From:		0.0			
Depth To:		2.799999952316284			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
44	1 of 1	NW/190.4	130.8 / 0.02	ARTIA SCRAP METALS 2055 FOWLER CRT	AUWR

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
MISSISSAUGA ON L5K 1B7					
Headcode: Headcode Desc: Phone: List Name: Description:		1169400 Scrap Metals 9058232849			
45	1 of 2	E/194.4	128.8 / -2.04	R.M. OF PEEL ERIN MILLS PKWY/N.SHERIDAN WAY MISSISSAUGA CITY ON	CA
Certificate #: Application Year: Issue Date: Approval Type: Status: Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:		7-0503-97- 97 6/23/1997 Municipal water Approved			
45	2 of 2	E/194.4	128.8 / -2.04	R.M. OF PEEL ERIN MILLS PKWY/N.SHERIDAN WAY MISSISSAUGA CITY ON	CA
Certificate #: Application Year: Issue Date: Approval Type: Status: Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:		3-0662-97- 97 6/23/1997 Municipal sewage Approved			
46	1 of 1	SW/201.3	132.8 / 1.97	2132 Bosack Court, Mississauga ON	PINC
Incident Id: Incident No: Incident Reported Dt: Type: Status Code: Tank Status: Task No: Spills Action Centre: Fuel Type: Fuel Occurrence Tp: Date of Occurrence: Occurrence Start Dt: Depth:		2632752 476468 FS-Pipeline Incident Pipeline Damage Reason Est RC Established 3126382		Pipe Material: Fuel Category: Health Impact: Environment Impact: Property Damage: Service Interrupt: Enforce Policy: Public Relation: Pipeline System: PSIG: Attribute Category: Regulator Location: Method Details:	
		Natural Gas Pipeline Strike 8/10/2010 0:00 2010/11/05		Natural Gas No No No Yes Yes No FS-Perform P-line Inc Invest E-mail	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Customer Acct Name: Incident Address: Operation Type: Construction Site (pipeline strike) Pipeline Type: Regulator Type: Summary: 2132 Bosack Court, Mississauga - 1/2" Pipeline Hit Reported By: Eric Jorgensen - Enbridge Affiliation: Industry Stakeholder (Licensee/Registration/Certificate Holder, Facility Owner, etc.) Occurrence Desc: Damage Reason: Excavation practices not sufficient Notes:					
47	1 of 1	W/201.5	134.2 / 3.39	2118 Fowler Lane Mississauga ON	SPL
Ref No: 0073-A2GNLS Year: Incident Dt: 9/18/2015 Dt MOE Arvl on Scn: MOE Reported Dt: 9/18/2015 Dt Document Closed: 11/27/2015 Site No: NA MOE Response: No Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Moved gas meter<UNOFFICIAL> Site Address: 2118 Fowler Lane Site Region: Site Municipality: Mississauga Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: Incident Preceding Spill: Incident Reason: Operator/Human Error Incident Summary: Enbridge customer moved meter, meter is still live. Meter pin locked. Environment Impact: Health Env Consequence: Nature of Impact: Contaminant Qty: 0 other - see incident description Contaminant Qty 1: 0 Contaminant Unit: other - see incident description Contaminant Code: 35 Contaminant Name: NATURAL GAS (METHANE) Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Unknown / N/A SAC Action Class: TSSA - Fuel Safety Branch - Hydrocarbon Fuel Release/Spill Call Report Locatn Geodata: Time Reported:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
System Facility Address: Source Sector Type: Conservtn Auth Name: Primary Watershed: Quaternary Watershed: Offsite Impacts: Waterbody Impacted:					
48	1 of 1	ENE/203.6	128.1 / -2.73	1944 Fowler Drive Mississauga ON L5K 0A1	EHS
Order No: 25062000039 Status: C Report Type: RSC Report (Urban) Report Date: 25-JUN-25 Date Received: 20-JUN-25 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .3 X: -79.64975871 Y: 43.52649478					
49	1 of 1	NE/205.7	125.8 / -5.03	Van Mills Medical Centre 1900 Fowler Dr Mississauga ON	GEN
<u>Generator Info</u>					
Generator No: ON8623871 Approval Years: As of Oct 2022 Status: Registered PO Box No: Country: Canada Co Admin: Phone No Admin: SIC Description:					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:					
<u>Waste Detail(s)</u>					
Waste Class: 312 P Waste Class Name: PATHOLOGICAL WASTES					
<u>Generator Info (as of Dec 2024)</u>					
Generator No: ON8623871 Generator Company Name: Van Mills Medical Centre Street: 1900 Fowler Dr City: Mississauga Province State: Ontario Country: Canada Postal Code: L5K0A1 Waste Class: 312 P					
Waste Class Decoded: 312 - PATHOLOGICAL WASTES					
<u>Generator Info (as of Apr 2025)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator Company Name:		Van Mills Medical Centre			
Generator Site Address:		1900 Fowler Dr			
City:		Mississauga			
Province State:		Ontario			
Country:		Canada			
Postal Code:		L5K0A1			
Waste Class:		312 P			
Waste Class Decoded:					
312 - PATHOLOGICAL WASTES					
Waste Characteristic Decoded:					
P - Pathological					
<u>2017 Generator Info</u>					
Gen No:	ON8623871			Choice of Contact:	CO_ADMIN
ID:	33739			Phone No Official:	905 403 8200 Ext.
Contaminated Fac:	N			Phone No Admin:	800-263-1857 Ext.
MHSW Facility:	N			County Ont:	METROPOLITAN TORONTO
NAICS Code1:	621110			County Out:	
NAICS Code2:				District:	301
NAICS Code3:					
Gen Name:	Vanmills Medical Clinic				
Gen Div:					
Gen Op Name:	Vanmills Medical Clinic				
Gen Op Div:					
Site Adrs1:	1900 Fowler Dr				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Mississauga				
Province Out:					
Site Postal Code:	L5K 0A1				
Site Country:	Canada				
Co Official:	Sadaf Ayaz				
Co Admin:	Sam Gray				
<u>2017 Generator Manifest</u>					
ID:	61539			Sum Received Qty:	32.0
Generator No:	ON8623871			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	035			Count Manifests:	6
Waste Char:	P			District:	302
Waste Code:	312				
<u>2018 Generator Info</u>					
Gen No:	ON8623871			Choice of Contact:	CO_ADMIN
ID:	34384			Phone No Official:	905 403 8200 Ext.
Contaminated Fac:	N			Phone No Admin:	800-263-1857 Ext.
MHSW Facility:	N			County Ont:	METROPOLITAN TORONTO
NAICS Code1:	621110			County Out:	
NAICS Code2:				District:	301
NAICS Code3:					
Gen Name:	Vanmills Medical Clinic				
Gen Div:					
Gen Op Name:	Vanmills Medical Clinic				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Gen Op Div:					
Site Adrs1:		1900 Fowler Dr			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Mississauga			
Province Out:					
Site Postal Code:		L5K 0A1			
Site Country:		Canada			
Co Official:		Sadaf Ayaz			
Co Admin:		Sam Gray			
<u>2018 Generator Manifest</u>					
ID:		61950		Sum Received Qty:	18.5
Generator No:		ON8623871		Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:		035		Count Manifests:	3
Waste Char:		P		District:	302
Waste Code:		312			
<u>2019 Generator Info</u>					
Gen No:		ON8623871		Choice of Contact:	CO_ADMIN
ID:		34807		Phone No Official:	905 403 8200 Ext.
Contaminated Fac:		N		Phone No Admin:	800-263-1857 Ext.
MHSW Facility:		N		County Ont:	METROPOLITAN TORONTO
NAICS Code1:		621110		County Out:	
NAICS Code2:				District:	301
NAICS Code3:					
Gen Name:		Vanmills Medical Clinic			
Gen Div:					
Gen Op Name:		Vanmills Medical Clinic			
Gen Op Div:					
Site Adrs1:		1900 Fowler Dr			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Mississauga			
Province Out:					
Site Postal Code:		L5K 0A1			
Site Country:		Canada			
Co Official:		Sadaf Ayaz			
Co Admin:		Sam Gray			
<u>2019 Generator Manifest</u>					
ID:		61805		Sum Received Qty:	36.0
Generator No:		ON8623871		Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:		035		Count Manifests:	5
Waste Char:		P		District:	302
Waste Code:		312			
<u>2020 Generator Info</u>					
Gen No:		ON8623871		Choice of Contact:	CO_ADMIN
ID:		34541		Phone No Official:	905 403 8200 Ext.
Contaminated Fac:		N		Phone No Admin:	800-263-1857 Ext.
MHSW Facility:		N		County Ont:	METROPOLITAN TORONTO
NAICS Code1:		621110		County Out:	
NAICS Code2:				District:	301

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
NAICS Code3:					
Gen Name:		Vanmills Medical Clinic			
Gen Div:					
Gen Op Name:		Vanmills Medical Clinic			
Gen Op Div:					
Site Adrs1:		1900 Fowler Dr			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Mississauga			
Province Out:					
Site Postal Code:		L5K 0A1			
Site Country:		Canada			
Co Official:		Sadaf Ayaz			
Co Admin:		Sam Gray			
<u>2020 Generator Manifest</u>					
ID:	58114			Sum Received Qty:	555.0
Generator No:	ON8623871			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	035			Count Manifests:	4
Waste Char:	P			District:	302
Waste Code:	312				
<u>2021 Generator Info</u>					
Gen No:	ON8623871			Choice of Contact:	CO_ADMIN
ID:	35361			Phone No Official:	905 403 8200 Ext.
Contaminated Fac:	N			Phone No Admin:	800-263-1857 Ext.
MHSW Facility:	N			County Ont:	METROPOLITAN TORONTO
NAICS Code1:	621110			County Out:	
NAICS Code2:				District:	301
NAICS Code3:					
Gen Name:		Vanmills Medical Clinic			
Gen Div:					
Gen Op Name:		Vanmills Medical Clinic			
Gen Op Div:					
Site Adrs1:		1900 Fowler Dr			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Mississauga			
Province Out:					
Site Postal Code:		L5K 0A1			
Site Country:		Canada			
Co Official:		Sadaf Ayaz			
Co Admin:		michael M			
<u>2021 Generator Manifest</u>					
ID:	60631			Sum Received Qty:	21.0
Generator No:	ON8623871			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	035			Count Manifests:	3
Waste Char:	P			District:	302
Waste Code:	312				
50	1 of 14	NE/207.2	126.0 / -4.79	1900, 1910, 1930, and 1944 Fowler Drive Mississauga ON L5K 1T7	EHS
Order No:	24051500058			Nearest Intersection:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status: C Report Type: Standard Report Report Date: 21-MAY-24 Date Received: 15-MAY-24 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans; City Directory					
Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.6502544 Y: 43.5271553					

50	2 of 14	NE/207.2	126.0 / -4.79	Vanmills Medical Clinic 1900 Fowler Dr Mississauga ON L5K 0A1	GEN

Generator Info

Generator No:	ON8623871	Choice of Contact:	CO_ADMIN
Approval Years:	2016	Contaminated Fac:	No
Status:		MHSW Facility:	No
PO Box No:		SIC Code:	621110
Country:	Canada		
Co Admin:	Sam Gray		
Phone No Admin:	800-263-1857 Ext.		
SIC Description:	OFFICES OF PHYSICIANS		

Waste Detail(s)

Waste Class:	312
Waste Class Name:	PATHOLOGICAL WASTES

50	3 of 14	NE/207.2	126.0 / -4.79	Dr. B. Demarchi DPC 1900 Fowler Drive unit D107 Mississauga ON L5K0A1	GEN

Generator Info

Generator No:	ON2901884	Choice of Contact:	CO_ADMIN
Approval Years:	2016	Contaminated Fac:	No
Status:		MHSW Facility:	No
PO Box No:		SIC Code:	621210
Country:	Canada		
Co Admin:	claud demarchi		
Phone No Admin:	9058237600 Ext.		
SIC Description:	OFFICES OF DENTISTS		

Waste Detail(s)

Waste Class:	312
Waste Class Name:	PATHOLOGICAL WASTES

50	4 of 14	NE/207.2	126.0 / -4.79	Dr. B. Demarchi Dental Office 1900 Fowler Drive unit D107 Mississauga ON L5K0A1	GEN

Generator Info

Generator No:	ON2901884	Choice of Contact:	CO_ADMIN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Approval Years: 2015 Status: PO Box No: Country: Canada Co Admin: claudé demarchi Phone No Admin: 9058237600 Ext. SIC Description: OFFICES OF DENTISTS Waste Detail(s) Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					
50	5 of 14	NE/207.2	126.0 / -4.79	Vanmills Medical Clinic 1900 Fowler Dr Mississauga ON L5K 0A1	GEN
Generator Info Generator No: ON8623871 Approval Years: 2015 Status: PO Box No: Country: Canada Co Admin: Sam Gray Phone No Admin: 800-263-1857 Ext. SIC Description: OFFICES OF PHYSICIANS Waste Detail(s) Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					
50	6 of 14	NE/207.2	126.0 / -4.79	Vanmills Medical Clinic 1900 Fowler Dr Mississauga ON L5K 0A1	GEN
Generator Info Generator No: ON8623871 Approval Years: 2014 Status: PO Box No: Country: Canada Co Admin: Sam Gray Phone No Admin: 800-263-1857 Ext. SIC Description: OFFICES OF PHYSICIANS Waste Detail(s) Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					
50	7 of 14	NE/207.2	126.0 / -4.79	Dr. B. Demarchi DPC 1900 Fowler Drive, unit D107 Mississauga ON L5K0A1	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON2901884			Choice of Contact:	
Approval Years:	As of Dec 2018			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:	312 P				
Waste Class Name:	Pathological wastes				
50	8 of 14	NE/207.2	126.0 / -4.79	Vanmills Medical Clinic 1900 Fowler Dr Mississauga ON L5K 0A1	GEN
<u>Generator Info</u>					
Generator No:	ON8623871			Choice of Contact:	
Approval Years:	As of Dec 2018			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:	312 P				
Waste Class Name:	Pathological wastes				
50	9 of 14	NE/207.2	126.0 / -4.79	Vanmills Medical Clinic 1900 Fowler Dr Mississauga ON L5K 0A1	GEN
<u>Generator Info</u>					
Generator No:	ON8623871			Choice of Contact:	
Approval Years:	As of Jul 2020			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:	312 P				
Waste Class Name:	Pathological wastes				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
50	10 of 14	NE/207.2	126.0 / -4.79	Dr. B. Demarchi DPC 1900 Fowler Drive, unit D107 Mississauga ON L5K0A1	GEN
<u>Generator Info</u>					
Generator No:		ON2901884		Choice of Contact:	
Approval Years:		As of Jul 2020		Contaminated Fac:	
Status:		Registered		MHSW Facility:	
PO Box No:				SIC Code:	
Country:		Canada			
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			

50	11 of 14	NE/207.2	126.0 / -4.79	Vanmills Medical Clinic 1900 Fowler Dr Mississauga ON L5K 0A1	GEN
<u>Generator Info</u>					
Generator No:	ON8623871	Choice of Contact:			
Approval Years:	As of Nov 2021	Contaminated Fac:			
Status:	Registered	MHSW Facility:			
PO Box No:		SIC Code:			
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:	312 P				
Waste Class Name:	Pathological wastes				

50	12 of 14	NE/207.2	126.0 / -4.79	Dr. B. Demarchi DPC 1900 Fowler Drive, unit D107 Mississauga ON L5K0A1	GEN
<u>Generator Info</u>					
Generator No:		ON2901884		Choice of Contact:	
Approval Years:		As of Nov 2021		Contaminated Fac:	
Status:		Registered		MHSW Facility:	
PO Box No:				SIC Code:	
Country:		Canada			
Co Admin:					
Phone No Admin:					
SIC Description:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			

50	13 of 14	NE/207.2	126.0 / -4.79	Dr. B. Demarchi DPC 1900 Fowler Drive, unit D107 Mississauga ON L5K0A1	GEN

Generator Info

Generator No:	ON2901884	Choice of Contact:	
Approval Years:	As of Oct 2022	Contaminated Fac:	
Status:	Registered	MHSW Facility:	
PO Box No:		SIC Code:	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	312 P
Waste Class Name:	PATHOLOGICAL WASTES

2017 Generator Info

Gen No:	ON2901884	Choice of Contact:	CO_ADMIN
ID:	11802	Phone No Official:	9058237600 Ext.
Contaminated Fac:	N	Phone No Admin:	9058237600 Ext.
MHSW Facility:	N	County Ont:	PEEL (R. M.)
NAICS Code1:	621210	County Out:	
NAICS Code2:		District:	305
NAICS Code3:			
Gen Name:	Dr. B. Demarchi DPC		
Gen Div:			
Gen Op Name:	Dr. B. Demarchi DPC		
Gen Op Div:			
Site Adrs1:	1900 Fowler Drive, unit D107		
Site Bldg:			
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	Mississauga		
Province Out:			
Site Postal Code:	L5K0A1		
Site Country:	Canada		
Co Official:	Ban Demarchi		
Co Admin:	claud demarchi		

2017 Generator Manifest

ID:	33644	Sum Received Qty:	16.0
Generator No:	ON2901884	Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	035	Count Manifests:	2
Waste Char:	P	District:	306
Waste Code:	312		

2018 Generator Info

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Gen No:	ON2901884			Choice of Contact:	CO_ADMIN
ID:	11574			Phone No Official:	9058237600 Ext.
Contaminated Fac:	N			Phone No Admin:	9058237600 Ext.
MHSW Facility:	N			County Ont:	PEEL (R. M.)
NAICS Code1:	621210			County Out:	
NAICS Code2:				District:	305
NAICS Code3:					
Gen Name:		Dr. B. Demarchi DPC			
Gen Div:					
Gen Op Name:		Dr. B. Demarchi DPC			
Gen Op Div:					
Site Adrs1:		1900 Fowler Drive, unit D107			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Mississauga			
Province Out:					
Site Postal Code:		L5K0A1			
Site Country:		Canada			
Co Official:		Ban Demarchi			
Co Admin:		claud demarchi			
2018 Generator Manifest					
ID:	33389			Sum Received Qty:	13.0
Generator No:	ON2901884			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	035			Count Manifests:	1
Waste Char:	P			District:	306
Waste Code:	312				
2019 Generator Info					
Gen No:	ON2901884			Choice of Contact:	CO_ADMIN
ID:	11282			Phone No Official:	9058237600 Ext.
Contaminated Fac:	N			Phone No Admin:	9058237600 Ext.
MHSW Facility:	N			County Ont:	PEEL (R. M.)
NAICS Code1:	621210			County Out:	
NAICS Code2:				District:	305
NAICS Code3:					
Gen Name:		Dr. B. Demarchi DPC			
Gen Div:					
Gen Op Name:		Dr. B. Demarchi DPC			
Gen Op Div:					
Site Adrs1:		1900 Fowler Drive, unit D107			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Mississauga			
Province Out:					
Site Postal Code:		L5K0A1			
Site Country:		Canada			
Co Official:		Ban Demarchi			
Co Admin:		claud demarchi			
2019 Generator Manifest					
ID:	32605			Sum Received Qty:	9.0
Generator No:	ON2901884			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	035			Count Manifests:	1
Waste Char:	P			District:	306
Waste Code:	312				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>2020 Generator Info</u>					
Gen No:	ON2901884			Choice of Contact:	CO_ADMIN
ID:	10914			Phone No Official:	9058237600 Ext.
Contaminated Fac:	N			Phone No Admin:	9058237600 Ext.
MHSW Facility:	N			County Ont:	PEEL (R. M.)
NAICS Code1:	621210			County Out:	
NAICS Code2:				District:	305
NAICS Code3:					
Gen Name:	Dr. B. Demarchi DPC				
Gen Div:					
Gen Op Name:	Dr. B. Demarchi DPC				
Gen Op Div:					
Site Adrs1:	1900 Fowler Drive, unit D107				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Mississauga				
Province Out:					
Site Postal Code:	L5K0A1				
Site Country:	Canada				
Co Official:	Ban Demarchi				
Co Admin:	claud demarchi				
<u>2020 Generator Manifest</u>					
ID:	29885			Sum Received Qty:	14.0
Generator No:	ON2901884			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	035			Count Manifests:	1
Waste Char:	P			District:	306
Waste Code:	312				
<u>2021 Generator Info</u>					
Gen No:	ON2901884			Choice of Contact:	CO_ADMIN
ID:	10735			Phone No Official:	9058237600 Ext.
Contaminated Fac:	N			Phone No Admin:	9058237600 Ext.
MHSW Facility:	N			County Ont:	PEEL (R. M.)
NAICS Code1:	621210			County Out:	
NAICS Code2:				District:	305
NAICS Code3:					
Gen Name:	Dr. B. Demarchi DPC				
Gen Div:					
Gen Op Name:	Dr. B. Demarchi DPC				
Gen Op Div:					
Site Adrs1:	1900 Fowler Drive, unit D107				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Mississauga				
Province Out:					
Site Postal Code:	L5K0A1				
Site Country:	Canada				
Co Official:	Ban Demarchi				
Co Admin:	claud demarchi				
50	14 of 14	NE/207.2	126.0 / -4.79	The Corporation of the City of Mississauga 1900 Fowler Drive Mississauga ON	SPL

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Ref No: 4765-AK2J4R Year: Incident Dt: 3/1/2017 Dt MOE Arvl on Scn: MOE Reported Dt: 3/1/2017 Dt Document Closed: Site No: NA MOE Response: No Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Sewage Spill<UNOFFICIAL> Site Address: 1900 Fowler Drive Site Region: Site Municipality: Mississauga Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: 4820204 Easting: 609063 Entity Operating Name: Client Name: The Corporation of the City of Mississauga Client Type: Source Type: Incident Cause: Incident Preceding Spill: Overflow/Surcharge Incident Reason: Weather Conditions Incident Summary: RofP raw sewage spilled to ground and cb - Mississauga Environment Impact: Health Env Consequence: Nature of Impact: Contaminant Qty: 4500 L Contaminant Qty 1: 4500 Contaminant Unit: L Contaminant Code: 44 Contaminant Name: SEWAGE,RAW UNCHLORINATED Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Land; Surface Water Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Miscellaneous Communal SAC Action Class: Watercourse Spills Call Report Locatn Geodata: Time Reported: System Facility Address: Source Sector Type: Conservtn Auth Name: Primary Watershed: Quaternary Watershed: Offsite Impacts: Waterbody Impacted: Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:					
51	1 of 1	ENE/210.4	127.0 / -3.86	Sherwin Williams Company 1910 Fowler Dr, Suite A104 Mississauga ON	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON9160487			Choice of Contact:	
Approval Years:	As of Oct 2022			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:	232 L				
Waste Class Name:	POLYMERIC RESINS				
<u>Waste Detail(s)</u>					
Waste Class:	263 I				
Waste Class Name:	ORGANIC LABORATORY CHEMICALS				
<u>Waste Detail(s)</u>					
Waste Class:	145 I				
Waste Class Name:	PAINT/PIGMENT/COATING RESIDUES				
<u>Waste Detail(s)</u>					
Waste Class:	145 L				
Waste Class Name:	PAINT/PIGMENT/COATING RESIDUES				
<u>Waste Detail(s)</u>					
Waste Class:	232 I				
Waste Class Name:	POLYMERIC RESINS				
<u>Waste Detail(s)</u>					
Waste Class:	331 I				
Waste Class Name:	WASTE COMPRESSED GASES				
<u>Generator Info (as of Dec 2024)</u>					
Generator No:	ON9160487				
Generator Company Name:	Sherwin Williams Company				
Street:	1910 Fowler Dr, Suite A104				
City:	Mississauga				
Province State:	Ontario				
Country:	Canada				
Postal Code:	L5K0A1				
Waste Class:	232 I,145 L,145 I,232 L,331 I,263 I				
Waste Class Decoded:					
232 - POLYMERIC RESINS; 145 - PAINT/PIGMENT/COATING RESIDUES; 145 - PAINT/PIGMENT/COATING RESIDUES; 232 - POLYMERIC RESINS; 331 - WASTE COMPRESSED GASES; 263 - ORGANIC LABORATORY CHEMICALS					
<u>Generator Info (as of Apr 2025)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Generator Company Name: Sherwin Williams Company
Generator Site Address: 1910 Fowler Dr, Suite A104
City: Mississauga
Province State: Ontario
Country: Canada
Postal Code: L5K0A1
Waste Class: 232 I, 145 L, 145 I, 232 L, 331 I, 263 I

Waste Class Decoded:

232 - POLYMERIC RESINS; 145 - PAINT/PIGMENT/COATING RESIDUES; 145 - PAINT/PIGMENT/COATING RESIDUES; 232 - POLYMERIC RESINS; 331 - WASTE COMPRESSED GASES; 263 - ORGANIC LABORATORY CHEMICALS

Waste Characteristic Decoded:

I - Ignitable; L - Liquid Industrial Waste; I - Ignitable; L - Liquid Industrial Waste; I - Ignitable; I - Ignitable

2017 Generator Info

Gen No:	ON9160487	Choice of Contact:	CO_ADMIN
ID:	35765	Phone No Official:	905-507-0166 Ext.133
Contaminated Fac:	N	Phone No Admin:	905-507-0166 Ext.101
MHSW Facility:	N	County Ont:	METROPOLITAN TORONTO
NAICS Code1:	444120	County Out:	
NAICS Code2:		District:	301
NAICS Code3:			
Gen Name:	Sherwin Williams Company		
Gen Div:			
Gen Op Name:	Sherwin Williams Company		
Gen Op Div:			
Site Adrs1:	1910 Fowler Dr		
Site Bldg:			
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:	Suite A104		
Site City:	Mississauga		
Province Out:			
Site Postal Code:	L5K 0A1		
Site Country:	Canada		
Co Official:	Scott Mitchell		
Co Admin:	Paula Braga		

2017 Generator Manifest

ID:	64028	Sum Received Qty:	168.0
Generator No:	ON9160487	Waste Class Name:	PAINT/PIGMENT/COATING RESIDUES
Receiver Type:	035	Count Manifests:	1
Waste Char:	L	District:	203
Waste Code:	145		

2018 Generator Info

Gen No:	ON9160487	Choice of Contact:	CO_ADMIN
ID:	36459	Phone No Official:	905-507-0166 Ext.133
Contaminated Fac:	N	Phone No Admin:	905-507-0166 Ext.101
MHSW Facility:	N	County Ont:	METROPOLITAN TORONTO
NAICS Code1:	444120	County Out:	
NAICS Code2:		District:	301
NAICS Code3:			
Gen Name:	Sherwin Williams Company		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Gen Div:					
Gen Op Name:		Sherwin Williams Company			
Gen Op Div:					
Site Adrs1:		1910 Fowler Dr			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:		Suite A104			
Site City:		Mississauga			
Province Out:					
Site Postal Code:		L5K 0A1			
Site Country:		Canada			
Co Official:		Scott Mitchell			
Co Admin:		Paula Braga			
<u>2018 Generator Manifest</u>					
ID:		64503	Sum Received Qty:		300.0
Generator No:		ON9160487	Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES
Receiver Type:		035	Count Manifests:		1
Waste Char:		I	District:		203
Waste Code:		145			
<u>2019 Generator Info</u>					
Gen No:		ON9160487	Choice of Contact:		CO_ADMIN
ID:		36960	Phone No Official:		905-507-0166 Ext.133
Contaminated Fac:		N	Phone No Admin:		905-507-0166 Ext.101
MHSW Facility:		N	County Ont:		METROPOLITAN TORONTO
NAICS Code1:		444120	County Out:		
NAICS Code2:			District:		301
NAICS Code3:					
Gen Name:		Sherwin Williams Company			
Gen Div:					
Gen Op Name:		Sherwin Williams Company			
Gen Op Div:					
Site Adrs1:		1910 Fowler Dr			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:		Suite A104			
Site City:		Mississauga			
Province Out:					
Site Postal Code:		L5K 0A1			
Site Country:		Canada			
Co Official:		Micah DePeuter			
Co Admin:		Paula Braga			
<u>2020 Generator Info</u>					
Gen No:		ON9160487	Choice of Contact:		CO_ADMIN
ID:		36707	Phone No Official:		905-507-0166 Ext.133
Contaminated Fac:		N	Phone No Admin:		905-507-0166 Ext.101
MHSW Facility:		N	County Ont:		METROPOLITAN TORONTO
NAICS Code1:		444120	County Out:		
NAICS Code2:			District:		301
NAICS Code3:					
Gen Name:		Sherwin Williams Company			
Gen Div:					
Gen Op Name:		Sherwin Williams Company			
Gen Op Div:					
Site Adrs1:		1910 Fowler Dr			
Site Bldg:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Pobox: Province In: ONTARIO Site Adrs2: Suite A104 Site City: Mississauga Province Out: Site Postal Code: L5K 0A1 Site Country: Canada Co Official: Micah DePeuter Co Admin: Paula Braga					
<u>2021 Generator Info</u>					
Gen No: ON9160487 ID: 37668 Contaminated Fac: N MHSW Facility: N NAICS Code1: 444120 NAICS Code2: NAICS Code3: Gen Name: Sherwin Williams Company Gen Div: Gen Op Name: Sherwin Williams Company Gen Op Div: Site Adrs1: 1910 Fowler Dr Site Bldg: Site Pobox: Province In: ONTARIO Site Adrs2: Suite A104 Site City: Mississauga Province Out: Site Postal Code: L5K 0A1 Site Country: Canada Co Official: Micah DePeuter Co Admin: Paula Braga					
Choice of Contact: CO_ADMIN Phone No Official: 905-507-0166 Ext.133 Phone No Admin: 905-507-0166 Ext.101 County Ont: METROPOLITAN TORONTO County Out: District: 301					
52	1 of 1	WNW/213.3	133.8 / 3.02	R.M. OF PEEL - LOT 31, CONC. 1 SDS FIFTH LINE W./FOWLER LANE MISSISSAUGA CITY ON	CA
Certificate #: 7-0587-92- Application Year: 92 Issue Date: 6/26/1992 Approval Type: Municipal water Status: Approved Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:					
53	1 of 1	ENE/216.6	127.9 / -2.91	lot 12 con 3 ON	WWIS
Well ID: 4907543 Construction Date: Use 1st: Irrigation Use 2nd: Final Well Status: Water Supply Water Type:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: 1 Date Received: 07/30/1991 Selected Flag: TRUE					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Material:				Abandonment Rec:	
Audit No:	79192			Contractor:	1663
Tag:				Form Version:	1
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	012
Depth to Bedrock:				Concession:	03
Well Depth:				Concession Name:	CIR R
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/490\4907543.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		08/07/1990			
Year Completed:		1990			
Depth (m):		29.8704			
Latitude:		43.5265800393352			
Longitude:		-79.6496311136216			
Point X:		-79.64963096408242			
Point Y:		43.526580036579176			
Path:		490\4907543.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	10322102			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	609122.30
Code OB Desc:				North83:	4820179.00
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	3
Date Completed:	08/07/1990			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	gps
Location Method Desc:		from gps			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		932059157			
Layer:		4			
Color:		3			
General Color:		BLUE			
Material 1:		17			
Material 1 Desc:		SHALE			
Material 2:		85			
Material 2 Desc:		SOFT			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		68.0			
Formation End Depth:		93.0			
Formation End Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		932059155			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		11			
Material 1 Desc:		GRAVEL			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		15.0			
Formation End Depth:		42.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		932059158			
Layer:		5			
Color:		3			
General Color:		BLUE			
Material 1:		17			
Material 1 Desc:		SHALE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		93.0			
Formation End Depth:		98.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		932059154			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		11			
Material 1 Desc:		GRAVEL			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		15.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		932059156			
Layer:		3			
Color:		3			
General Color:		BLUE			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		28			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 2 Desc:		SAND			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		42.0			
Formation End Depth:		68.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933170348			
Layer:		1			
Plug From:		0.0			
Plug To:		39.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933170349			
Layer:		2			
Plug From:		45.0			
Plug To:		98.0			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		964907543			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		10870672			
Casing No:		1			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		930531407			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:		39.0			
Casing Diameter:		1.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Casing</u>					
Casing ID:		930531408			
Layer:		2			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:		43.0			
Casing Diameter:		5.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		933360276			
Layer:		1			
Slot:		020			
Screen Top Depth:		39.0			
Screen End Depth:		42.0			
Screen Material:					
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		6.0			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:		PUMP			
Pump Test ID:		994907543			
Pump Set At:					
Static Level:		26.0			
Final Level After Pumping:		42.0			
Recommended Pump Depth:					
Pumping Rate:		10.0			
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		1			
Water State After Test:		CLEAR			
Pumping Test Method:		1			
Pumping Duration HR:		3			
Pumping Duration MIN:		0			
Flowing:		No			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		934785754			
Test Type:		Recovery			
Test Duration:		45			
Test Level:		26.0			
Test Level UOM:		ft			
<u>Water Details</u>					
Water ID:		933795658			
Layer:		1			
Kind Code:		5			
Kind:		Not stated			
Water Found Depth:		26.0			
Water Found Depth UOM:		ft			
54	1 of 1	WNW/221.9	133.4 / 2.58	The Corporation of the City of Mississauga 2085 Fowler Crt 2065 Fowler Court Mississauga ON L5B 3C1	ECA
Approval No:		3923-BGCR9K		MOE District:	
Approval Date:		2019-10-03		City:	
Status:		Approved		Longitude:	
Record Type:		ECA		Latitude:	
Link Source:		IDS		Geometry X:	
SWP Area Name:				Geometry Y:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3: Material 4: Gsc Material Description: Stratum Description:				Geologic Period: Depositional Gen:	
		SILT(46),CLAY(38). BROWN.			
Source					
Source Type:		Data Survey		Source Appl: Spatial/Tabular	
Source Orig:		Geological Survey of Canada		Source Iden: 1	
Source Date:		1956-1972		Scale or Res: Varies	
Confidence:		H		Horizontal: NAD27	
Observatio:				Verticalda: Mean Average Sea Level	
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Details:		File: TOR3.txt RecordID: 252870 NTS_Sheet: 30M12B			
Confiden 1:		Logged by professional. Exact and complete description of material and properties.			
Source List					
Source Identifier:		1		Horizontal Datum: NAD27	
Source Type:		Data Survey		Vertical Datum: Mean Average Sea Level	
Source Date:		1956-1972		Projection Name: Universal Transverse Mercator	
Scale or Resolution:		Varies			
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Originators:		Geological Survey of Canada			
56	1 of 2	N/224.7	127.9 / -2.96	2165 ERIN MILLS PKWY MISSISSAUGA ON	WWIS
Well ID:		4909673		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:		Observation Wells		Date Received: 03/04/2005	
Water Type:				Selected Flag: TRUE	
Casing Material:				Abandonment Rec:	
Audit No:		Z24243		Contractor: 6607	
Tag:		A015782		Form Version: 3	
Constructn Method:				Owner:	
Elevation (m):				County: PEEL	
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY (PORT CREDIT)			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/490\4909673.pdf			
Additional Detail(s) (Map)					
Well Completed Date:		01/27/2005			
Year Completed:		2005			
Depth (m):		1.8			
Latitude:		43.5278927424982			
Longitude:		-79.6517587811659			
Point X:		-79.65175863112539			
Point Y:		43.52789273959467			
Path:		490\4909673.pdf			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Bore Hole Information</u>					
Bore Hole ID:	11323406			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	608948.00
Code OB Desc:				North83:	4820322.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	01/27/2005			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	933021105				
Layer:	2				
Color:	2				
General Color:	GREY				
Material 1:	06				
Material 1 Desc:	SILT				
Material 2:	05				
Material 2 Desc:	CLAY				
Material 3:	66				
Material 3 Desc:	DENSE				
Formation Top Depth:	0.5				
Formation End Depth:	1.7999999523162842				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	933021104				
Layer:	1				
Color:	6				
General Color:	BROWN				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:	11				
Material 2 Desc:	GRAVEL				
Material 3:	01				
Material 3 Desc:	FILL				
Formation Top Depth:	0.0				
Formation End Depth:	0.5				
Formation End Depth UOM:	m				
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	933266623				
Layer:	1				
Plug From:	0.0				
Plug To:	0.30000001192092896				
Plug Depth UOM:	m				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933266624			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		0.800000011920929			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		964909673			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11338261			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930866474			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		0.8999999761581421			
Casing Diameter:		5.099999904632568			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		933412158			
Layer:		1			
Slot:		10			
Screen Top Depth:		0.8999999761581421			
Screen End Depth:		1.7999999523162842			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.400000095367432			
<u>Hole Diameter</u>					
Hole ID:		11543298			
Diameter:		20.0			
Depth From:		0.0			
Depth To:		1.7999999523162842			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>56</u>	2 of 2	N/224.7	127.9 / -2.96	2165 ERIN MILLS PRWY PEEL Mississauga ON	WWIS
Well ID:	7150023			Flowing (Y/N):	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	08/16/2010
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	M07265			Contractor:	6607
Tag:	A015782			Form Version:	5
Constructn Method:				Owner:	
Elevation (m):				County:	PEEL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MISSISSAUGA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/715\7150023.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		07/09/2010			
Year Completed:		2010			
Depth (m):					
Latitude:		43.5278927424982			
Longitude:		-79.6517587811659			
Point X:		-79.65175863112539			
Point Y:		43.52789273959467			
Path:		715\7150023.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1004571897		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	608948.00
Code OB Desc:				North83:	4820329.00
Open Hole:				Org CS:	UTM83
Cluster Kind:		This is a record from cluster log sheet		UTMRC:	4
Date Completed:		04/09/2010		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	WWR
Location Method Desc:					
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004571902			
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Sealing Record</u>					
Plug ID:		1004571901			
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1004571900			
Method Construction Code:					
Method Construction:					
Other Method Construction:		BORING			
<u>Pipe Information</u>					
Pipe ID:		1004571903			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1004571905			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:		0.8999999761581421			
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1004571904			
Layer:		1			
Slot:					
Screen Top Depth:		0.8999999761581421			
Screen End Depth:		1.7999999523162842			
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1004571906			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:					
Water State After Test Code:					
Water State After Test:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pumping Test Method: Pumping Duration HR: Pumping Duration MIN: Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1004571899			
Diameter:		21.0			
Depth From:					
Depth To:		1.7999999523162842			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Bore Hole Information</u>					
Bore Hole ID:	1003290832			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	608948.00
Code OB Desc:				North83:	4820322.00
Open Hole:	No			Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	07/09/2010			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1004571909			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1004571910			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		1.0			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1004571911			
Layer:		3			
Plug From:		1.0			
Plug To:		1.7999999523162842			
Plug Depth UOM:		m			
<u>Method of Construction & Well</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Use</u>					
Method Construction ID:		1004571916			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1004571907			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1004571912			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		0.8999999761581421			
Casing Diameter:		5.099999904632568			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Casing</u>					
Casing ID:		1004571913			
Layer:		2			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.8999999761581421			
Depth To:		1.7999999523162842			
Casing Diameter:		5.099999904632568			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1004571914			
Layer:		1			
Slot:		10			
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.099999904632568			
<u>Hole Diameter</u>					
Hole ID:		1004571908			
Diameter:		21.0			
Depth From:		0.0			
Depth To:		1.7999999523162842			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
57	1 of 1	ENE/225.5	126.0 / -4.80	ON	BORE

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Borehole ID:	654530			Inclin FLG:	No
OGF ID:	215554875			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	JUN-1967			Municipality:	
Static Water Level:	0.2			Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.527159
Total Depth m:	23.8			Longitude DD:	-79.649961
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	609095
Drill Method:	Power auger			Northing:	4820243
Orig Ground Elev m:	127			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	127				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218543764			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	1.8			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Soil			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	SOIL.				
Geology Stratum ID:	218543765			Mat Consistency:	
Top Depth:	1.8			Material Moisture:	
Bottom Depth:	5.8			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Bedrock			Geologic Period:	
Material 4:	Sandstone			Depositional Gen:	
Gsc Material Description:					
Stratum Description:	CLAY,SILT,ROCK, SANDSTONE. BROWN, WATER STABLE AT 419.1 FEET.				
Geology Stratum ID:	218543766			Mat Consistency:	
Top Depth:	5.8			Material Moisture:	
Bottom Depth:	16.5			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	CLAY,SILT. GREY.				
Geology Stratum ID:	218543767			Mat Consistency:	
Top Depth:	16.5			Material Moisture:	Wet
Bottom Depth:	23.8			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Silt			Geologic Formation:	
Material 2:	Shale			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Gsc Material Description:					
Stratum Description:		SILT, SHALE. BROWN, WET.			
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	H			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: TOR3.txt RecordID: 251950 NTS_Sheet: 30M12B				
Confiden 1:	Logged by professional. Exact and complete description of material and properties.				
<u>Source List</u>					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
58	1 of 13	N/238.9	129.4 / -1.47	KHERIBA HOLDING 2185 ERIN MILLS PKWY MISSISSAUGA ON L5K 1T8	DTNK
<u>Delisted Expired Fuel Safety Facilities</u>					
Instance No:	9747511			Expired Date:	7/1/2003
Status:	EXPIRED			Max Hazard Rank:	
Instance ID:				Facility Location:	
Instance Type:	FS Facility			Facility Type:	
Instance Creation Dt:				Fuel Type 2:	
Instance Install Dt:				Fuel Type 3:	
Item Description:				Panam Related:	
Manufacturer:				Panam Venue Nm:	
Model:				External Identifier:	
Serial No:				Item:	
ULC Standard:				Piping Steel:	
Quantity:				Piping Galvanized:	
Unit of Measure:				Tank Single Wall St:	
Overfill Prot Type:				Piping Underground:	
Creation Date:				Tank Underground:	
Next Periodic Str DT:				Source:	
TSSA Base Sched Cycle 2:					
TSSAMax Hazard Rank 1:					
TSSA Risk Based Periodic Yn:					
TSSA Volume of Directives:					
TSSA Periodic Exempt:					
TSSA Statutory Interval:					
TSSA Recd Insp Interva:					
TSSA Recd Tolerance:					
TSSA Program Area:					
TSSA Program Area 2:					
Description:					
Original Source:	EXP				
Record Date:	Up to May 2013				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
58	2 of 13	N/238.9	129.4 / -1.47	SIMCOE ENERGY & TECHNICAL SERVICES INC * 2185 ERIN MILLS PKWY MISSISSAUGA ON	DTNK

Delisted Expired Fuel Safety Facilities

Instance No:	10095883	Expired Date:	
Status:	EXPIRED	Max Hazard Rank:	
Instance ID:	11934	Facility Location:	
Instance Type:	FS Facility	Facility Type:	
Instance Creation Dt:		Fuel Type 2:	
Instance Install Dt:		Fuel Type 3:	
Item Description:		Panam Related:	
Manufacturer:		Panam Venue Nm:	
Model:		External Identifier:	
Serial No:		Item:	
ULC Standard:		Piping Steel:	
Quantity:		Piping Galvanized:	
Unit of Measure:		Tank Single Wall St:	
Overfill Prot Type:		Piping Underground:	
Creation Date:		Tank Underground:	
Next Periodic Str DT:		Source:	
TSSA Base Sched Cycle 2:			
TSSAMax Hazard Rank 1:			
TSSA Risk Based Periodic Yn:			
TSSA Volume of Directives:			
TSSA Periodic Exempt:			
TSSA Statutory Interval:			
TSSA Recd Insp Interva:			
TSSA Recd Tolerance:			
TSSA Program Area:			
TSSA Program Area 2:			
Description:	FS Propane Cylr Handling Facility		
Original Source:	EXP		
Record Date:	Up to Mar 2012		

58	3 of 13	N/238.9	129.4 / -1.47	KHERIBA HOLDING 2185 ERIN MILLS PKWY MISSISSAUGA ON	DTNK

Delisted Expired Fuel Safety Facilities

Instance No:	11330272	Expired Date:	
Status:	EXPIRED	Max Hazard Rank:	
Instance ID:	79090	Facility Location:	
Instance Type:	FS Piping	Facility Type:	
Instance Creation Dt:		Fuel Type 2:	
Instance Install Dt:		Fuel Type 3:	
Item Description:		Panam Related:	
Manufacturer:		Panam Venue Nm:	
Model:		External Identifier:	
Serial No:		Item:	
ULC Standard:		Piping Steel:	
Quantity:		Piping Galvanized:	
Unit of Measure:		Tank Single Wall St:	
Overfill Prot Type:		Piping Underground:	
Creation Date:		Tank Underground:	
Next Periodic Str DT:		Source:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
TSSA Base Sched Cycle 2: TSSAMax Hazard Rank 1: TSSA Risk Based Periodic Yn: TSSA Volume of Directives: TSSA Periodic Exempt: TSSA Statutory Interval: TSSA Recd Insp Interva: TSSA Recd Tolerance: TSSA Program Area: TSSA Program Area 2: Description: FS Piping Original Source: EXP Record Date: Up to Mar 2012					
58	4 of 13	N/238.9	129.4 / -1.47	KHERIBA HOLDING 2185 ERIN MILLS PKWY MISSISSAUGA ON	EXP
Inventory No: 11330228 Inventory Status: EXPIRED Installation Year: 1991 Capacity: 27280 Capacity Unit: Tank Type: Manufacturer: Model: Description: **cnxld per Petro Canada letter june 13/03- removal of petroleum storage on june 30/03 Previous Fuel Type: Gasoline					
Tank Material: Fiberglass (FRP) Corrosion Protect: Fiberglass Overfill Protection: Inventory Context: FS Liquid Fuel Tank Inventory Item: FS LIQUID FUEL TANK					
58	5 of 13	N/238.9	129.4 / -1.47	KHERIBA HOLDING 2185 ERIN MILLS PKWY MISSISSAUGA ON	EXP
Inventory No: 10855844 Inventory Status: EXPIRED Installation Year: 1991 Capacity: 22730 Capacity Unit: Tank Type: Manufacturer: Model: Description: **cnxld per Petro Canada letter june 13/03- removal of petroleum storage on june 30/03 Previous Fuel Type: Gasoline					
Tank Material: Fiberglass (FRP) Corrosion Protect: Fiberglass Overfill Protection: Inventory Context: FS Liquid Fuel Tank Inventory Item: FS LIQUID FUEL TANK					
58	6 of 13	N/238.9	129.4 / -1.47	KHERIBA HOLDING 2185 ERIN MILLS PKWY MISSISSAUGA ON	EXP
Inventory No: 11330252 Inventory Status: EXPIRED Installation Year: 1991 Capacity: 27280 Capacity Unit: Tank Type: Manufacturer: Model: Description: **cnxld per Petro Canada letter june 13/03- removal of petroleum storage on june 30/03 Previous Fuel Type: Gasoline					
Tank Material: Fiberglass (FRP) Corrosion Protect: Fiberglass Overfill Protection: Inventory Context: FS Liquid Fuel Tank Inventory Item: FS LIQUID FUEL TANK					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
58	7 of 13	N/238.9	129.4 / -1.47	KHERIBA HOLDING 2185 ERIN MILLS PKWY MISSISSAUGA ON	EXP
Inventory No:		11330206		Tank Material:	Fiberglass (FRP)
Inventory Status:		EXPIRED		Corrosion Protect:	Fiberglass
Installation Year:		1991		Overfill Protection:	
Capacity:		27280		Inventory Context:	FS Liquid Fuel Tank
Capacity Unit:				Inventory Item:	FS LIQUID FUEL TANK
Tank Type:					
Manufacturer:					
Model:					
Description:		**cnxld per Petro Canada letter june 13/03- removal of petroleum storage on june 30/03			
Previous Fuel Type:		Gasoline			
58	8 of 13	N/238.9	129.4 / -1.47	Petro Canada 2185 Erin Mills Parkway Mississauga ON L5K 1T8	GEN
<u>Generator Info</u>					
Generator No:		ON1887316		Choice of Contact:	
Approval Years:		05		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	419120
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		Petroleum Product Agents and Brokers			
<u>Waste Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
58	9 of 13	N/238.9	129.4 / -1.47	MYERS SELF SERVE 2185 ERIN MILLS PKWY MISSISSAUGA ON L5K 1T8	PRT
Location ID:		9077			
Type:		retail			
Expiry Date:		1994-11-30			
Capacity (L):		25372			
Licence #:		0052936001			
58	10 of 13	N/238.9	129.4 / -1.47	SOUTH WESTERN ONTARIO PROPANE DIV 998131 ONTARIO L 2185 ERIN MILLS PKWY MISSISSAUGA ON L5K 1T8	PRT
Location ID:		9077			
Type:		retail			
Expiry Date:		1995-07-31			

205 erisinfo.com | Environmental Risk Information Services Order No: 26022500296

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Nearest Watercourse:					
Site Name:		PETROCANADA STATION - 2185 ERIN MILLS PKWY.<UNOFFICIAL>			
Site Address:					
Site Region:		Central			
Site Municipality:		Mississauga			
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Entity Operating Name:					
Client Name:		Petro-Canada			
Client Type:					
Source Type:					
Incident Cause:		Pipe Or Hose Leak			
Incident Preceding Spill:					
Incident Reason:		Negligence (Apparent) - Caused by lack of diligence			
Incident Summary:		Fuel spill to grnd @ PetroCanada Str.			
Environment Impact:		Possible			
Health Env Consequence:					
Nature of Impact:		Soil Contamination			
Contaminant Qty:		30 L			
Contaminant Qty 1:					
Contaminant Unit:		L			
Contaminant Code:		12			
Contaminant Name:		GASOLINE			
Contaminant Limit 1:					
Contam Limit Freq 1:					
Contaminant UN No 1:					
Receiving Medium:		Land			
Activity Preceding Spill:					
Property 2nd Watershed:					
Property Tertiary Watershed:					
Sector Type:		Tank Truck			
SAC Action Class:		Spill to Land			
Call Report Locatn Geodata:					
Time Reported:					
System Facility Address:					
Source Sector Type:					
Conservtn Auth Name:					
Primary Watershed:					
Quaternary Watershed:					
Offsite Impacts:					
Waterbody Impacted:					

Unplottable Summary

Total: 32 Unplottable sites

DB	Company Name/Site Name	Address	City	Postal
CA	J. PEREZ CONSTRUCTION LTD.	PRIVATE ST. FIFTH LINE WEST	MISSISSAUGA CITY ON	
CA	FRIEDMAN GROUP	NORTH SHERIDAN WAY	MISSISSAUGA CITY ON	
CA	MISSISSAUGA CITY	FOWLER LANE	MISSISSAUGA CITY ON	
CA	MISSISSAUGA CITY FIFTH LINE WEST	FIFTH LINE WEST	MISSISSAUGA CITY ON	
CA	R.M. OF PEEL	ERIN MILLS PARKWAY	MISSISSAUGA CITY ON	
CA	UNITED LANDS CORPORATION LTD.	FIFTH LINE WEST	MISSISSAUGA CITY ON	
CA	GREYROCK COMMERCIAL	SHERIDAN MEWS LEANNE BLVD.	MISSISSAUGA CITY ON	
CA	UNITED LANDS CORPORATION LTD.	FIFTH LINE WEST TOWNHOUSES	MISSISSAUGA CITY ON	
CA	R.M. OF PEEL	FIFTH LINE WEST	MISSISSAUGA CITY ON	
CA	ONTARIO CLEAN WATER AGENCY	ERIN MILLS PARKWAY	MISSISSAUGA CITY ON	
CA	DANIELS EQUITIES CORPORATION	FIFTH LINE WEST	MISSISSAUGA CITY ON	
CA	GREYROCK COMMERCIAL	SHERIDAN MEWS LEANNE BLVD.	MISSISSAUGA CITY ON	
CA	J. PEREZ CONSTRUCTION LTD.	PRIVATE ST. FIFTH LINE WEST	MISSISSAUGA CITY ON	
CA	1500 Diameter Streetsville Feedermain	Erin Mills Parkway	Mississauga ON	
CA	MISSISSAUGA CITY	FIFTH LINE WEST	MISSISSAUGA CITY ON	
CA	DANIELS EQUITIES CORPORATION	FIFTH LINE WEST	MISSISSAUGA CITY ON	
ECA	The Regional Municipality of Peel	Erin Mills Pky	Mississauga ON	L6T 4B9
ECA	The Regional Municipality of Peel	Erin Mills Pky	Mississauga ON	L6T 3Y3

ECA	The Regional Municipality of Peel	Erin Mills Pky	Mississauga ON	L6T 4B9
EHS		North Sheridan Way	Mississauga ON	
GEN	GOEYECARE INC	Erin Mills Parkway Millway Plaza	Mississauga ON	
GEN	GOEYECARE INC	Erin Mills Parkway Millway Plaza	Mississauga ON	L5L 1W8
GEN	Prism Eye Institute Inc.	Erin Mills Parkway Millway Plaza	Mississauga ON	L5L 1W8
GEN	GOEYECARE INC	Erin Mills Parkway Millway Plaza	Mississauga ON	
GEN	GOEYECARE INC	Erin Mills Parkway Millway Plaza	Mississauga ON	
GEN	GOEYECARE INC	Erin Mills Parkway Millway Plaza	Mississauga ON	
GEN	GOEYECARE INC	Erin Mills Parkway Millway Plaza	Mississauga ON	
GEN	Prism Eye Institute Inc.	Erin Mills Parkway Millway Plaza	Mississauga ON	L5L 1W8
GEN	GOEYECARE INC	Erin Mills Parkway Millway Plaza	Mississauga ON	L5L 1W8
SPL	TRANSPORT TRUCK	ERIN MILLS PARKWAY MOTOR VEHICLE (OPERATING FLUID)	TORONTO CITY ON	
SPL	The Regional Municipality of Peel	NB Erin Mills Pkwy just south of Erin Mills Centre Blvd.	Mississauga ON	
SPL		Fifth Line West	Mississauga ON	

Unplottable Report

Site: J. PEREZ CONSTRUCTION LTD.
PRIVATE ST. FIFTH LINE WEST MISSISSAUGA CITY ON

Database:
CA

Certificate #: 3-0604-86-
Application Year: 86
Issue Date: 6/5/1986
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: FRIEDMAN GROUP
NORTH SHERIDAN WAY MISSISSAUGA CITY ON

Database:
CA

Certificate #: 3-1867-86-
Application Year: 86
Issue Date: 12/29/1986
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: MISSISSAUGA CITY
FOWLER LANE MISSISSAUGA CITY ON

Database:
CA

Certificate #: 3-1917-86-
Application Year: 86
Issue Date: 12/29/1986
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: MISSISSAUGA CITY FIFTH LINE WEST
FIFTH LINE WEST MISSISSAUGA CITY ON

Database:
CA

Certificate #: 3-0542-88-
Application Year: 88

Issue Date: 4/26/1988
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **R.M. OF PEEL**
ERIN MILLS PARKWAY MISSISSAUGA CITY ON

Database:
CA

Certificate #: 3-0969-89-
Application Year: 89
Issue Date: 5/31/1989
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **UNITED LANDS CORPORATION LTD.**
FIFTH LINE WEST MISSISSAUGA CITY ON

Database:
CA

Certificate #: 3-1792-89-
Application Year: 89
Issue Date: 8/30/1989
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **GREYROCK COMMERCIAL**
SHERIDAN MEWS LEANNE BLVD. MISSISSAUGA CITY ON

Database:
CA

Certificate #: 3-1785-89-
Application Year: 89
Issue Date: 9/18/1989
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: UNITED LANDS CORPORATION LTD.
FIFTH LINE WEST TOWNHOUSES MISSISSAUGA CITY ON

Database:
CA

Certificate #: 7-1492-89-
Application Year: 89
Issue Date: 8/30/1989
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: R.M. OF PEEL
FIFTH LINE WEST MISSISSAUGA CITY ON

Database:
CA

Certificate #: 7-1091-87-
Application Year: 87
Issue Date: 8/4/1987
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ONTARIO CLEAN WATER AGENCY
ERIN MILLS PARKWAY MISSISSAUGA CITY ON

Database:
CA

Certificate #: 7-1107-94-
Application Year: 94
Issue Date: 11/30/1994
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: DANIELS EQUITIES CORPORATION
FIFTH LINE WEST MISSISSAUGA CITY ON

Database:
CA

Certificate #: 7-1424-87-
Application Year: 87
Issue Date: 9/22/1987
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:

Contaminants:
Emission Control:

Site: GREYROCK COMMERCIAL
SHERIDAN MEWS LEANNE BLVD. MISSISSAUGA CITY ON

Database:
CA

Certificate #: 7-1482-89-
Application Year: 89
Issue Date: 9/18/1989
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: J. PEREZ CONSTRUCTION LTD.
PRIVATE ST. FIFTH LINE WEST MISSISSAUGA CITY ON

Database:
CA

Certificate #: 7-0453-86-
Application Year: 86
Issue Date: 6/5/1986
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: 1500 Diameter Streetsville Feedermain
Erin Mills Parkway Mississauga ON

Database:
CA

Certificate #: 1530-4YWK9A
Application Year: 01
Issue Date: 7/31/01
Approval Type: Municipal & Private water
Status: Approved
Application Type: New Certificate of Approval
Client Name: Corporation of the Regional Municipality of Peel
Client Address: 10 Peel Centre Drive
Client City: Brampton
Client Postal Code: L6T 4B9
Project Description: This application is for the construction of watermain and appurtenances to be constructed on Erin Mills Parkway.
Contaminants:
Emission Control:

Site: MISSISSAUGA CITY
FIFTH LINE WEST MISSISSAUGA CITY ON

Database:
CA

Certificate #: 3-0161-86-
Application Year: 86
Issue Date: 3/14/1986
Approval Type: Municipal sewage
Status: Approved
Application Type:

Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: DANIELS EQUITIES CORPORATION
FIFTH LINE WEST MISSISSAUGA CITY ON

Database:
CA

Certificate #: 3-1721-87-
Application Year: 87
Issue Date: 9/22/1987
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: The Regional Municipality of Peel
Erin Mills Pky Mississauga ON L6T 4B9

Database:
ECA

Approval No: 5150-9ENR22
Approval Date: 2014-01-10
Status: Revoked and/or Replaced
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: The Regional Municipality of Peel
Address: Erin Mills Pky
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/7800-9E8M8B-14.pdf>
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: The Regional Municipality of Peel
Erin Mills Pky Mississauga ON L6T 3Y3

Database:
ECA

Approval No: 0567-7BKMD3
Approval Date: 2008-02-08
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-Municipal Drinking Water Systems
Project Type: Municipal Drinking Water Systems
Business Name: The Regional Municipality of Peel
Address: Erin Mills Pky
Full Address:
Full PDF Link:
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: The Regional Municipality of Peel
Erin Mills Pky Mississauga ON L6T 4B9

Database:
ECA

Approval No: 8247-92QSTT

MOE District:

Approval Date: 2012-12-11
Status: Revoked and/or Replaced
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: The Regional Municipality of Peel
Address: Erin Mills Pky
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/0770-92AT2H-14.pdf>
PDF Site Location:

Site: **North Sheridan Way Mississauga ON** **Database:** **EHS**

Order No: 20020107003
Status: C
Report Type: Complete Report
Report Date: 1/16/02
Date Received: 1/7/02
Previous Site Name:
Lot/Building Size: Six storey hotel
Additional Info Ordered:

Nearest Intersection: Erin Mills Parkway and North Sheridan Way
Municipality: Region of Peel
Client Prov/State: ON
Search Radius (km): 0.25
X: -79.65047
Y: 43.524954

Site: **GOEYECARE INC** **Database:** **GEN**
Erin Mills Parkway Millway Plaza Mississauga ON

Generator Info

Generator No: ON9409907
Approval Years: 2009
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: Offices of Physicians

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 621110

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

Site: **GOEYECARE INC** **Database:** **GEN**
Erin Mills Parkway Millway Plaza Mississauga ON L5L 1W8

Generator Info

Generator No: ON9409907
Approval Years: 2014
Status:
PO Box No:
Country: Canada
Co Admin: Barbara Bowie
Phone No Admin: 9054563937 Ext.225
SIC Description: OFFICES OF PHYSICIANS

Choice of Contact: CO_ADMIN
Contaminated Fac: No
MHSW Facility: No
SIC Code: 621110

Waste Detail(s)

Waste Class: 312

Waste Class Name: PATHOLOGICAL WASTES

Site: Prism Eye Institute Inc.
Erin Mills Parkway Millway Plaza Mississauga ON L5L 1W8

Database:
GEN

Generator Info

Generator No: ON9409907
Approval Years: As of Dec 2018
Status: Registered
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description:

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code:

Waste Detail(s)

Waste Class: 312 P
Waste Class Name: Pathological wastes

Site: GOEYECARE INC
Erin Mills Parkway Millway Plaza Mississauga ON

Database:
GEN

Generator Info

Generator No: ON9409907
Approval Years: 2012
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: Offices of Physicians

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 621110

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

Site: GOEYECARE INC
Erin Mills Parkway Millway Plaza Mississauga ON

Database:
GEN

Generator Info

Generator No: ON9409907
Approval Years: 2013
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: OFFICES OF PHYSICIANS

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 621110

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

Site: GOEYECARE INC
Erin Mills Parkway Millway Plaza Mississauga ON

Database:
GEN

Generator Info

Generator No:	ON9409907	Choice of Contact:	
Approval Years:	2010	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	621110
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	Offices of Physicians		

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

Site: GOEYECARE INC
Erin Mills Parkway Millway Plaza Mississauga ON

Database:
GEN

Generator Info

Generator No:	ON9409907	Choice of Contact:	
Approval Years:	2011	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	621110
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	Offices of Physicians		

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

Site: Prism Eye Institute Inc.
Erin Mills Parkway Millway Plaza Mississauga ON L5L 1W8

Database:
GEN

Generator Info

Generator No:	ON9409907	Choice of Contact:	CO_ADMIN
Approval Years:	2016	Contaminated Fac:	No
Status:		MHSW Facility:	No
PO Box No:		SIC Code:	621110
Country:	Canada		
Co Admin:	Hardeep Thind		
Phone No Admin:	9054563937 Ext.263		
SIC Description:	OFFICES OF PHYSICIANS		

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

Site: GOEYECARE INC
Erin Mills Parkway Millway Plaza Mississauga ON L5L 1W8

Database:
GEN

Generator Info

Generator No:	ON9409907	Choice of Contact:	CO_ADMIN
Approval Years:	2015	Contaminated Fac:	No
Status:		MHSW Facility:	No
PO Box No:		SIC Code:	621110
Country:	Canada		
Co Admin:	Barbara Bowie		
Phone No Admin:	9054563937 Ext.225		
SIC Description:	OFFICES OF PHYSICIANS		

Waste Detail(s)

Waste Class:	312
Waste Class Name:	PATHOLOGICAL WASTES

Site:	TRANSPORT TRUCK ERIN MILLS PARKWAY MOTOR VEHICLE (OPERATING FLUID) TORONTO CITY ON

Database:
SPL

Ref No:	200051	Municipality No:	01106
Year:		Nature of Damage:	
Incident Dt:	5/7/2001	Discharger Report:	
Dt MOE Arvl on Scn:		Material Group:	
MOE Reported Dt:	5/7/2001	Impact to Health:	
Dt Document Closed:		Agency Involved:	
Site No:			
MOE Response:			
Site County/District:			
Site Geo Ref Meth:			
Site District Office:			
Nearest Watercourse:			
Site Name:			
Site Address:			
Site Region:			
Site Municipality:	TORONTO CITY		
Site Lot:			
Site Conc:			
Site Geo Ref Accu:			
Site Map Datum:			
Northing:			
Easting:			
Entity Operating Name:			
Client Name:			
Client Type:			
Source Type:			
Incident Cause:	PROCESS UPSET		
Incident Preceding Spill:			
Incident Reason:	EQUIPMENT FAILURE		
Incident Summary:	WESTON BAKERY TRUCK 15L DIESEL/ANTIFREEZE SPILL TO GROUND CLEANED		
Environment Impact:	Possible		
Health Env Consequence:			
Nature of Impact:	Soil contamination		
Contaminant Qty:			
Contaminant Qty 1:			
Contaminant Unit:			
Contaminant Code:			
Contaminant Name:			
Contaminant Limit 1:			
Contam Limit Freq 1:			
Contaminant UN No 1:			
Receiving Medium:	Land		
Activity Preceding Spill:			
Property 2nd Watershed:			
Property Tertiary Watershed:			
Sector Type:			
SAC Action Class:			
Call Report Locatn Geodata:			

Time Reported:
System Facility Address:
Source Sector Type:
Conservtn Auth Name:
Primary Watershed:
Quaternary Watershed:
Offsite Impacts:
Waterbody Impacted:

Site: The Regional Municipality of Peel
NB Erin Mills Pkwy just south of Erin Mills Centre Blvd. Mississauga ON

Database:
SPL

Ref No:	4140-ACANFJ	Municipality No:
Year:		Nature of Damage:
Incident Dt:	2016/07/28	Discharger Report:
Dt MOE Arvl on Scn:		Material Group:
MOE Reported Dt:	2016/07/28	Impact to Health:
Dt Document Closed:		Agency Involved:
Site No:	NA	
MOE Response:	No	
Site County/District:		
Site Geo Ref Meth:		
Site District Office:		
Nearest Watercourse:		
Site Name:	Oil Slick on Road<UNOFFICIAL>	
Site Address:	NB Erin Mills Pkwy just south of Erin Mills Centre Blvd.	
Site Region:		
Site Municipality:	Mississauga	
Site Lot:		
Site Conc:		
Site Geo Ref Accu:		
Site Map Datum:		
Northing:	4823878	
Easting:	604257	
Entity Operating Name:		
Client Name:	The Regional Municipality of Peel	
Client Type:		
Source Type:		
Incident Cause:		
Incident Preceding Spill:	Leak/Break	
Incident Reason:	Material Failure - Poor Design/Substandard Material	
Incident Summary:	RoP: 20L Hyraulic oil to ground - Cleaned	
Environment Impact:		
Health Env Consequence:		
Nature of Impact:		
Contaminant Qty:	20 L	
Contaminant Qty 1:	20	
Contaminant Unit:	L	
Contaminant Code:	15	
Contaminant Name:	HYDRAULIC OIL	
Contaminant Limit 1:		
Contam Limit Freq 1:		
Contaminant UN No 1:		
Receiving Medium:	Land	
Activity Preceding Spill:		
Property 2nd Watershed:		
Property Tertiary Watershed:		
Sector Type:	Miscellaneous Industrial	
SAC Action Class:	Land Spills	
Call Report Locatn Geodata:		
Time Reported:		
System Facility Address:		
Source Sector Type:		
Conservtn Auth Name:		
Primary Watershed:		
Quaternary Watershed:		
Offsite Impacts:		
Waterbody Impacted:		

Site:**Fifth Line West Mississauga ON****Database:****SPL**

Ref No:	5074-9YNG9X	Municipality No:	
Year:		Nature of Damage:	
Incident Dt:	7/21/2015	Discharger Report:	
Dt MOE Arvl on Scn:		Material Group:	
MOE Reported Dt:	7/22/2015	Impact to Health:	
Dt Document Closed:	8/26/2015	Agency Involved:	
Site No:	NA		
MOE Response:	No		
Site County/District:			
Site Geo Ref Meth:			
Site District Office:			
Nearest Watercourse:			
Site Name:	tssa<UNOFFICIAL>		
Site Address:	Fifth Line West		
Site Region:			
Site Municipality:	Mississauga		
Site Lot:			
Site Conc:			
Site Geo Ref Accu:			
Site Map Datum:			
Northing:			
Easting:			
Entity Operating Name:			
Client Name:			
Client Type:			
Source Type:			
Incident Cause:			
Incident Preceding Spill:			
Incident Reason:	Operator/Human Error		
Incident Summary:	TSSA: line strike 1/2", Fifth Line, made safe		
Environment Impact:			
Health Env Consequence:			
Nature of Impact:			
Contaminant Qty:	1 number (count)		
Contaminant Qty 1:	1		
Contaminant Unit:	number (count)		
Contaminant Code:	35		
Contaminant Name:	METHANE GAS, COMPRESSED (NATURAL GAS)		
Contaminant Limit 1:			
Contam Limit Freq 1:			
Contaminant UN No 1:			
Receiving Medium:			
Activity Preceding Spill:			
Property 2nd Watershed:			
Property Tertiary Watershed:			
Sector Type:	Miscellaneous Communal		
SAC Action Class:	Air Spills - Gases and Vapours		
Call Report Locatn Geodata:			
Time Reported:			
System Facility Address:			
Source Sector Type:			
Conservtn Auth Name:			
Primary Watershed:			
Quaternary Watershed:			
Offsite Impacts:			
Waterbody Impacted:			

Appendix: Database Descriptions

*Environmental Risk Information Services (ERIS) can search the following databases. The extent of historical information varies with each database and current information is determined by what is publicly available to ERIS at the time of update. **Note:** Databases denoted with " * " indicates that the database will no longer be updated. See the individual database description for more information.*

Abandoned Aggregate Inventory:

Provincial

[AAGR](#)

The MAAP Program maintains a database of abandoned pits and quarries. Please note that the database is only referenced by lot and concession and city/town location. The database provides information regarding the location, type, size, land use, status and general comments.*

Government Publication Date: Sept 2002*

Aggregate Inventory:

Provincial

[AGR](#)

This database of licensed and permitted pits and quarries is maintained by the Ontario Ministry of Natural Resources and Forestry (MNRF), as regulated under the Aggregate Resources Act, R.S.O. 1990. Aggregate site data has been divided into active and inactive sites. Active sites may be further subdivided into partial surrenders. In partial surrenders, defined areas of a site are inactive while the rest of the site remains active.

Government Publication Date: Up to Oct 2025

Abandoned Mine Information System:

Provincial

[AMIS](#)

The Abandoned Mines Information System contains data on known abandoned and inactive mines located on both Crown and privately held lands. The information was provided by the Ministry of Northern Development and Mines (MNDM), with the following disclaimer: "the database provided has been compiled from various sources, and the Ministry of Northern Development and Mines makes no representation and takes no responsibility that such information is accurate, current or complete". Reported information includes official mine name, status, background information, mine start/end date, primary commodity, mine features, hazards and remediation.

Government Publication Date: 1800-May 2025

Anderson's Waste Disposal Sites:

Private

[ANDR](#)

The information provided in this database was collected by examining various historical documents which aimed to characterize the likely position of former waste disposal sites from 1860 to present. The research initiative behind the creation of this database was to identify those sites that are missing from the Ontario MOE Waste Disposal Site Inventory, as well as to provide revisions and corrections to the positions and descriptions of sites currently listed in the MOE inventory. In addition to historic waste disposal facilities, the database also identifies certain auto wreckers and scrap yards that have been extrapolated from documentary sources. Please note that the data is not warranted to be complete, exhaustive or authoritative. The information was collected for research purposes only.

Government Publication Date: 1860s-Present

Aboveground Storage Tanks:

Provincial

[AST](#)

Historical listing of aboveground storage tanks made available by the Department of Natural Resources and Forestry. Includes tanks used to hold water or petroleum. This dataset has been retired as of September 25, 2014 and will no longer be updated.

Government Publication Date: May 31, 2014

Automobile Wrecking & Supplies:

Private

[AUWR](#)

This database provides an inventory of known locations that are involved in the scrap metal, automobile wrecking/recycling, and automobile parts & supplies industry. Information is provided on the company name, location and business type.

Government Publication Date: 1999-Apr 30, 2025

Borehole:

Provincial

[BORE](#)

A borehole is the generalized term for any narrow shaft drilled in the ground, either vertically or horizontally. The information here includes geotechnical investigations or environmental site assessments, mineral exploration, or as a pilot hole for installing piers or underground utilities. Information is from many sources such as the Ministry of Transportation (MTO) boreholes from engineering reports and projects from the 1950 to 1990's in Southern Ontario. Boreholes from the Ontario Geological Survey (OGS) including The Urban Geology Analysis Information System (UGAIS) and the York Peel Durham Toronto (YPDT) database of the Conservation Authority Moraine Coalition. This database will include fields such as location, stratigraphy, depth, elevation, year drilled, etc. For all water well data or oil and gas well data for Ontario please refer to WWIS and OOGW.

Government Publication Date: 1875-Jul 2018

Certificates of Approval:

Provincial CA

This database contains the following types of approvals: Air & Noise, Industrial Sewage, Municipal & Private Sewage, Waste Management Systems and Renewable Energy Approvals. The MOE in Ontario states that any facility that releases emissions to the atmosphere, discharges contaminants to ground or surface water, provides potable water supplies, or stores, transports or disposes of waste, must have a Certificate of Approval before it can operate lawfully. Fields include approval number, business name, address, approval date, approval type and status. This database will no longer be updated, as CofA's have been replaced by either Environmental Activity and Sector Registry (EASR) or Environmental Compliance Approval (ECA). Please refer to those individual databases for any information after Oct.31, 2011.

Government Publication Date: 1985-Oct 30, 2011*

Dry Cleaning Facilities:

Federal CDRY

List of dry cleaning facilities made available by Environment and Climate Change Canada. Environment and Climate Change Canada's Tetrachloroethylene (Use in Dry Cleaning and Reporting Requirements) Regulations (SOR/2003-79) are intended to reduce releases of tetrachloroethylene to the environment from dry cleaning facilities.

Government Publication Date: Jan 2004-Dec 2023

Commercial Fuel Oil Tanks:

Provincial CFOT

Locations of commercial underground fuel oil tanks. This is not a comprehensive or complete inventory of commercial fuel tanks in the province; this listing is a copy of records of registered commercial underground fuel oil tanks obtained under Access to Public Information.

Note that the following types of tanks do not require registration: waste oil tanks in apartments, office buildings, residences, etc.; aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Oct 2023

Chemical Manufacturers and Distributors:

Private CHEM

This database includes information from both a one time study conducted in 1992 and private source and is a listing of facilities that manufacture or distribute chemicals. The production of these chemical substances may involve one or more chemical reactions and/or chemical separation processes (i.e. fractionation, solvent extraction, crystallization, etc.).

Government Publication Date: 1999-Jan 31, 2020

Chemical Register:

Private CHM

This database includes a listing of locations of facilities within the Province or Territory that either manufacture and/or distributes chemicals.

Government Publication Date: 1999-Apr 30, 2025

Compressed Natural Gas Stations:

Private CNG

Canada has a network of public access compressed natural gas (CNG) refuelling stations. These stations dispense natural gas in compressed form at 3,000 pounds per square inch (psi), the pressure which is allowed within the current Canadian codes and standards. The majority of natural gas refuelling is located at existing retail gasoline that have a separate refuelling island for natural gas. This list of stations is made available by the Canadian Natural Gas Vehicle Alliance.

Government Publication Date: Dec 2012 -Nov 2025

Inventory of Coal Gasification Plants and Coal Tar Sites:

Provincial COAL

This inventory includes both the "Inventory of Coal Gasification Plant Waste Sites in Ontario-April 1987" and the Inventory of Industrial Sites Producing or Using Coal Tar and Related Tars in Ontario-November 1988) collected by the MOE. It identifies industrial sites that produced and continue to produce or use coal tar and other related tars. Detailed information is available and includes: facility type, size, land use, information on adjoining properties, soil condition, site operators/occupants, site description, potential environmental impacts and historic maps available. This was a one-time inventory.*

Government Publication Date: Apr 1987 and Nov 1988*

Compliance and Convictions:

Provincial CONV

This database summarizes the fines and convictions handed down by the Ontario courts beginning in 1989. Companies and individuals named here have been found guilty of environmental offenses in Ontario courts of law.

Government Publication Date: 1989-Aug 2025

Certificates of Property Use:

Provincial CPU

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include CPU's on the registry such as (EPA s. 168.6) - Certificate of Property Use.

Government Publication Date: 1994 - Dec 31, 2025

Drill Hole Database:

Provincial

[DRL](#)

The Ontario Drill Hole Database (ODHD) is offered by the Province of Ontario's Ministry of Mines. The dataset contains information for over 164,000 percussion, overburden, sonic and diamond-drill holes. The presence of assay results with cutoff values for gold, silver, copper, zinc, lead, nickel and platinum group elements is noted. Drill hole data are compiled from assessment files that have been submitted to the ministry in accordance with the Ontario Mining Act (OMA). Source assessment file numbers are captured for cross reference with the Ontario Assessment File Database (OAFD). Please note that limited data is available for southern Ontario, as it was the last area to be completed. The database was created when surveys submitted to the Ministry were converted in the Assessment File Research Image Database (AFRI) project. However, the degree of accuracy (coordinates) as to the exact location of drill holes is dependent upon the source document submitted. Levels of accuracy used to locate holes are: centering on the mining claim; a sketch of the mining claim; a 1:50,000 map; a detailed company map; or from submitted a "Report of Work".

Government Publication Date: 1886 - Jul 2025

Delisted Fuel Tanks:

Provincial

[DTNK](#)

List of fuel storage tank sites that were once found in - and have since been removed from - the list of fuel storage tanks made available by the regulatory agency under Access to Public Information.

Government Publication Date: Oct 2023

Environmental Activity and Sector Registry:

Provincial

[EASR](#)

On October 31, 2011, a smarter, faster environmental approvals system came into effect in Ontario. The EASR allows businesses to register certain activities with the ministry, rather than apply for an approval. The registry is available for common systems and processes, to which preset rules of operation can be applied. The EASR is currently available for: heating systems, standby power systems and automotive refinishing. Businesses whose activities aren't subject to the EASR may apply for an ECA (Environmental Compliance Approval). Please see our ECA database.

Government Publication Date: Oct 2011 - Jan 31, 2026

Environmental Registry:

Provincial

[EBR](#)

The Environmental Registry lists proposals, decisions and exceptions regarding policies, Acts, instruments, or regulations that could significantly affect the environment. Through the Registry, thirteen provincial ministries notify the public of upcoming proposals and invite their comments. For example, if a local business is requesting a permit, license, or certificate of approval to release substances into the air or water; these are notified on the registry. Data includes: Approval for discharge into the natural environment other than water (i.e. Air) - EPA s. 9, Approval for sewage works - OWRA s. 53(1), and EPA s. 27 - Approval for a waste disposal site. For information regarding Permit to Take Water (PTTW), Certificate of Property Use (CPU) and (ORD) Orders please refer to those individual databases.

Government Publication Date: 1994 - Dec 31, 2025

Environmental Compliance Approval:

Provincial

[ECA](#)

On October 31, 2011, a smarter, faster environmental approvals system came into effect in Ontario. In the past, a business had to apply for multiple approvals (known as certificates of approval) for individual processes and pieces of equipment. Today, a business either registers itself, or applies for a single approval, depending on the types of activities it conducts. Businesses whose activities aren't subject to the EASR may apply for an ECA. A single ECA addresses all of a business's emissions, discharges and wastes. Separate approvals for air, noise and waste are no longer required. This database will also include Renewable Energy Approvals. For certificates of approval prior to Nov 1st, 2011, please refer to the CA database. For all Waste Disposal Sites please refer to the WDS database.

Government Publication Date: Oct 2011 - Jan 31, 2026

Environmental Effects Monitoring:

Federal

[EEM](#)

The Environmental Effects Monitoring program assesses the effects of effluent from industrial or other sources on fish, fish habitat and human usage of fisheries resources. Since 1992, pulp and paper mills have been required to conduct EEM studies under the Pulp and Paper Effluent Regulations. This database provides information on the mill name, geographical location and sub-lethal toxicity data.

Government Publication Date: 1992-2007*

ERIS Historical Searches:

Private

[EHS](#)

ERIS has compiled a database of all environmental risk reports completed since March 1999. Available fields for this database include: site location, date of report, type of report, and search radius. As per all other databases, the ERIS database can be referenced on both the map and "Statistical Profile" page.

Government Publication Date: 1999-Nov 30, 2025

Environmental Issues Inventory System:

Federal

[EIIS](#)

The Environmental Issues Inventory System was developed through the implementation of the Environmental Issues and Remediation Plan. This plan was established to determine the location and severity of contaminated sites on inhabited First Nation reserves, and where necessary, to remediate those that posed a risk to health and safety; and to prevent future environmental problems. The EIIS provides information on the reserve under investigation, inventory number, name of site, environmental issue, site action (Remediation, Site Assessment), and date investigation completed.

Government Publication Date: 1992-2001*

Emergency Management Historical Event:

Provincial

EMHE

List of locations of historical occurrences of emergency events, including those assigned to the Ministry of Natural Resources by Order-In-Council (OIC) under the Emergency Management and Civil Protection Act, as well as events where MNR provided requested emergency response assistance. Many of these events will have involved community evacuations, significant structural loss, and/or involvement of MNR emergency response staff. These events fall into one of ten (10) type categories: Dam Failure; Drought / Low Water; Erosion; Flood; Forest Fire; Soil and Bedrock Instability; Petroleum Resource Center Event, EMO Requested Assistance, Continuity of Operations Event, Other Requested Assistance. EMHE record details are reproduced by ERIIS under License with the Ontario Ministry of Natural Resources © Queen's Printer for Ontario, 2017.

Government Publication Date: Apr 30, 2022

Environmental Offenders Registry:

Federal

EOR

The Environmental Offenders Registry, enforced by Environment and Climate Change Canada and Parks Canada, tracks corporations convicted under specific federal environmental laws. The registry includes corporate convictions resulting from court proceedings. Court prosecutions are one of several enforcement measures used when violations or potential violations are detected. Other measures like tickets, warning letters, or compliance orders may also be employed to restore compliance. Although not affected by the Environmental Enforcement Act, convictions obtained by Environment and Climate Change Canada under the Species at Risk Act and the Pollution Prevention Provisions of the Fisheries Act are also included.

Government Publication Date: Nov 30, 2025

Environmental Penalty Annual Report:

Provincial

EPAR

This database contains data from Ontario's annual environmental penalty report published by the Ministry of the Environment, Conservation and Parks (MECP). These reports provide information on environmental penalties for land or water violations issued to companies in one of the nine industrial sectors covered by the Municipal Industrial Strategy for Abatement (MISA) regulations.

Government Publication Date: Jan 1, 2011 - Dec 31, 2024

Excess Soil Registry:

Provincial

ESNR

The Excess Soil Registry is made available by the Resource Productivity and Recovery Authority (RPRA). Excess soil is soil dug up mainly during construction and excavation activities that must be removed from the development site because it cannot or will not be reused. The Minister of the Environment, Conservation and Parks directed the RPRA to establish and maintain the Excess Soil Registry, enabling regulated parties to comply with registration and filing notice requirements, the ministry to access data, and the public to view information from those filings. From January 1, 2023, construction and development project leaders, as well as operators and owners of soil Reuse Sites, and Residential Development Soil Depot sites, must file notices detailing how excess soil is reused and disposed of in compliance with Ontario's Excess Soil Regulation.

Government Publication Date: Aug 31, 2025

List of Expired Fuels Safety Facilities:

Provincial

EXP

List of facilities and tanks for which there was once a fuel registration. This is not a comprehensive or complete inventory of expired tanks/tank facilities in the province; this listing is a copy of previously registered tanks and facilities obtained under Access to Public Information. Includes private fuel outlets, bulk plants, fuel oil tanks, gasoline stations, marinas, propane filling stations, liquid fuel tanks, piping systems, etc; includes tanks which have been removed from the ground.

Notes: registration was not required for private fuel underground/aboveground storage tanks prior to January 1990, nor for furnace oil tanks prior to May 1, 2002; registration is not required for waste oil tanks in apartments, office buildings, residences, etc., or aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Oct 2023

Federal Convictions:

Federal

FCON

Environment Canada maintains a database referred to as the "Environmental Registry" that details prosecutions under the Canadian Environmental Protection Act (CEPA) and the Fisheries Act (FA). Information is provided on the company name, location, charge date, offence and penalty.

Government Publication Date: 1988-Jun 2007*

Contaminated Sites on Federal Land:

Federal

FCS

The Federal Contaminated Sites Inventory includes information on known federal contaminated sites under the custodianship of departments, agencies and consolidated Crown corporations as well as those that are being or have been investigated to determine whether they have contamination arising from past use that could pose a risk to human health or the environment. The inventory also includes non-federal contaminated sites for which the Government of Canada has accepted some or all financial responsibility. It does not include sites where contamination has been caused by, and which are under the control of, enterprise Crown corporations, private individuals, firms or other levels of government. Includes fire training sites and sites at which Per- and Polyfluoroalkyl Substances (PFAS) are a concern.

Government Publication Date: Jun 2000-Oct 2025

Fisheries & Oceans Fuel Tanks:

Federal

FOFT

Fisheries & Oceans Canada maintains an inventory of aboveground & underground fuel storage tanks located on Fisheries & Oceans property or controlled by DFO. Our inventory provides information on the site name, location, tank owner, tank operator, facility type, storage tank location, tank contents & capacity, and date of tank installation.

Government Publication Date: 1964-Sep 2019

Federal Identification Registry for Storage Tank Systems (FIRSTS):

Federal

FRST

A list of federally regulated Storage tanks from the Federal Identification Registry for Storage Tank Systems (FIRSTS). FIRSTS is Environment and Climate Change Canada's database of storage tank systems subject to the Storage Tank for Petroleum Products and Allied Petroleum Products Regulations. The main objective of the Regulations is to prevent soil and groundwater contamination from storage tank systems located on federal and aboriginal lands. Storage tank systems that do not have a valid identification number displayed in a readily visible location on or near the storage tank system may be refused product delivery.

Government Publication Date: Oct 31, 2021

Fuel Storage Tank:

Provincial

FST

List of registered private and retail fuel storage tanks. This is not a comprehensive or complete inventory of private and retail fuel storage tanks in the province; this listing is a copy of registered private and retail fuel storage tanks, obtained under Access to Public Information.

Notes: registration was not required for private fuel underground/aboveground storage tanks prior to January 1990, nor for furnace oil tanks prior to May 1, 2002; registration is not required for waste oil tanks in apartments, office buildings, residences, etc., or aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Oct 2023

Fuel Storage Tank - Historic:

Provincial

FSTH

The Fuels Safety Branch of the Ontario Ministry of Consumer and Commercial Relations maintained a database of all registered private fuel storage tanks. Public records of private fuel storage tanks are only available since the registration became effective in September 1989. This information is now collected by the Technical Standards and Safety Authority.

Government Publication Date: Pre-Jan 2010*

Ontario Regulation 347 Waste Generators Summary:

Provincial

GEN

Regulation 347 of the Ontario EPA defines a waste generation site as any site, equipment and/or operation involved in the production, collection, handling and/or storage of regulated wastes. A generator of regulated waste is required to register the waste generation site and each waste produced, collected, handled, or stored at the site. This database contains the registration number, company name and address of registered generators including the types of hazardous wastes generated. It includes data on waste generating facilities such as: drycleaners, waste treatment and disposal facilities, machine shops, electric power distribution etc. This information is a summary of all years from 1986 including the most currently available data. As of January 1, 2023, businesses and institutions subject to the amended Reg. 347: General – Waste Management are required to report their activities and pay fees through Resource Productivity & Recovery Authority (RPRA) online Hazardous Waste Program Registry (HWPR) rather than the Hazardous Waste Information Network (HWIN) system previously operated by the Ministry of the Environment, Conservation and Parks (MECP). Some records may contain, within the company name, the phrase "See & Use..." followed by a series of letters and numbers. This occurs when one company is amalgamated with or taken over by another registered company. The number listed as "See & Use", refers to the new ownership and the other identification number refers to the original ownership. This phrase serves as a link between the 2 companies until operations have been fully transferred.

Government Publication Date: 1986-Mar 31, 2025

Greenhouse Gas Emissions from Large Facilities:

Federal

GHG

List of greenhouse gas emissions from large facilities made available by Environment Canada. Greenhouse gas emissions in kilotonnes of carbon dioxide equivalents (kt CO₂ eq).

Government Publication Date: 2013-Feb 2025

Historical Business Activity Risk:

Federal

HBAR

Proprietary list of sites identified as potentially having engaged in business activity that poses a higher-than-normal risk of contamination. Records originate from historical city directories, and are included in this list based on broad business categories Potentially Hazardous Chemical Users and Fuel and Automotive, including but not limited to Dry Cleaners and Fuel Stations, Garages, etc. Inclusion in this list does not indicate that there is or ever has been contamination; rather, sites are included in this list due to their potential for having engaged in a business activity presenting an elevated risk of contamination. The list was compiled from various city directories including BC Directories, Hendersons, Mights, Sun Directories, Vernons, and Wrights; spanning roughly 1920s through 1960 depending on information available by city.

This list is currently limited to sites as reported in the following provinces: Alberta, British Columbia, Saskatchewan, Manitoba, New Brunswick, Nova Scotia, Ontario, and Quebec.

Government Publication Date: 1920s - 1960

TSSA Historic Incidents:

Provincial

HINC

List of historic incidences of spills and leaks of diesel, fuel oil, gasoline, natural gas, propane, and hydrogen recorded by the TSSA in their previous incident tracking system. The TSSA's Fuels Safety Program administers the Technical Standards & Safety Act 2000, providing fuel-related safety services associated with the safe transportation, storage, handling and use of fuels such as gasoline, diesel, propane, natural gas and hydrogen. Under this Act, the TSSA regulates fuel suppliers, storage facilities, transport trucks, pipelines, contractors and equipment or appliances that use fuels. Records are not verified for accuracy or completeness. This is not a comprehensive or complete inventory of historical fuel spills and leaks in the province. This listing is a copy of the data captured at one moment in time and is hence limited by the record date provided here.

Government Publication Date: 2006-June 2009*

Indian & Northern Affairs Fuel Tanks:

Federal

IAFT

The Department of Indian & Northern Affairs Canada (INAC) maintains an inventory of aboveground & underground fuel storage tanks located on both federal and crown land. Our inventory provides information on the reserve name, location, facility type, site/facility name, tank type, material & ID number, tank contents & capacity, and date of tank installation.

Government Publication Date: 1950-Aug 2003*

Fuel Oil Spills and Leaks:

Provincial

INC

Listing of spills and leaks of diesel, fuel oil, gasoline, natural gas, propane, and hydrogen reported to the Spills Action Centre (SAC). This is not a comprehensive or complete inventory of fuel-related leaks, spills, and incidents in the province; this listing is a copy of incidents reported to the SAC, obtained under Access to Public Information. Includes incidents from fuel-related hazards such as spills, fires, and explosions. Records are not verified for accuracy or completeness.

Government Publication Date: Oct 2023

Landfill Inventory Management Ontario:

Provincial

LIMO

The Landfill Inventory Management Ontario (LIMO) database is updated every year, as the Ministry of the Environment, Conservation and Parks compiles new and updated information. Includes small and large landfills currently operating as well as those which are closed and historic. Operators of larger landfills provide landfill information for the previous operating year to the ministry for LIMO including: estimated amount of total waste received, landfill capacity, estimated total remaining landfill capacity, fill rates, engineering designs, reporting and monitoring details, size of location, service area, approved waste types, leachate of site treatment, contaminant attenuation zone and more. The small landfills include information such as site owner, site location and certificate of approval # and status.

Government Publication Date: Mar 31, 2022

Canadian Mine Locations:

Private

MINE

This information is collected from the Canadian & American Mines Handbook. The Mines database is a national database that provides over 290 listings on mines (listed as public companies) dealing primarily with precious metals and hard rocks. Listed are mines that are currently in operation, closed, suspended, or are still being developed (advanced projects). Their locations are provided as geographic coordinates (x, y and/or longitude, latitude). As of 2002, data pertaining to Canadian smelters and refineries has been appended to this database.

Government Publication Date: 1998-2009*

Mineral Occurrences:

Provincial

MNR

In the early 70's, the Ministry of Northern Development and Mines created an inventory of approximately 19,000 mineral occurrences in Ontario, in regard to metallic and industrial minerals, as well as some information on building stones and aggregate deposits. Please note that the "Horizontal Positional Accuracy" is approximately +/- 200 m. Many reference elements for each record were derived from field sketches using pace or chain/tape measurements against claim posts or topographic features in the area. The primary limiting factor for the level of positional accuracy is the scale of the source material. The testing of horizontal accuracy of the source materials was accomplished by comparing the plan metric (X and Y) coordinates of that point with the coordinates of the same point as defined from a source of higher accuracy.

Government Publication Date: 1846-Feb 2025

National Analysis of Trends in Emergencies System (NATES):

Federal

NATE

In 1974 Environment Canada established the National Analysis of Trends in Emergencies System (NATES) database, for the voluntary reporting of significant spill incidents. The data was to be used to assist in directing the work of the emergencies program. NATES ran from 1974 to 1994. Extensive information is available within this database including company names, place where the spill occurred, date of spill, cause, reason and source of spill, damage incurred, and amount, concentration, and volume of materials released.

Government Publication Date: 1974-1994*

Non-Compliance Reports:

Provincial

NCPL

The Ministry of the Environment Conservation and Parks (MECP) provides information about non-compliant discharges of contaminants to air and water that exceed legal allowable limits, from regulated industrial and municipal facilities. A reported non-compliance failure may be in regard to a Control Order, Certificate of Approval, Sectoral Regulation or specific regulation/act. MECP publicly releases the Environmental Compliance Report (ECR) on the Ontario Data Catalogue. In Ontario, all facilities with regulated wastewater discharges or air emissions under the Ontario Water Resources Act and the Environmental Protection Act must monitor and report any cases where approved operating limits have been exceeded.

Government Publication Date: Dec 31, 2024

National Defense & Canadian Forces Fuel Tanks:

Federal

NDFT

The Department of National Defense and the Canadian Forces maintains an inventory of all aboveground & underground fuel storage tanks located on DND lands. Our inventory provides information on the base name, location, tank type & capacity, tank contents, tank class, date of tank installation, date tank last used, and status of tank as of May 2001. This database will no longer be updated due to the new National Security protocols which have prohibited any release of this database.

Government Publication Date: Up to May 2001*

National Defense & Canadian Forces Spills:

Federal

NDSP

The Department of National Defense and the Canadian Forces maintains an inventory of spills to land and water. All spill sites have been classified under the "Transportation of Dangerous Goods Act - 1992". Our inventory provides information on the facility name, location, spill ID #, spill date, type of spill, as well as the quantity of substance spilled & recovered.

Government Publication Date: Mar 1999-Nov 2023

National Defence & Canadian Forces Waste Disposal Sites:

Federal

NDWD

The Department of National Defence and the Canadian Forces maintains an inventory of waste disposal sites located on DND lands. Where available, our inventory provides information on the base name, location, type of waste received, area of site, depth of site, year site opened/closed and status.

Government Publication Date: 2001-Apr 2007*

National Energy Board Pipeline Incidents:

Federal

NEBI

Locations of pipeline incidents from 2008 to present, made available by the Canada Energy Regulator (CER) - previously the National Energy Board (NEB). Includes incidents reported under the Onshore Pipeline Regulations and the Processing Plant Regulations related to pipelines under federal jurisdiction, does not include incident data related to pipelines under provincial or territorial jurisdiction.

Government Publication Date: 2008-Nov 30, 2025

National Energy Board Wells:

Federal

NEBP

The NEBW database contains information on onshore & offshore oil and gas wells that are outside provincial jurisdiction(s) and are thereby regulated by the National Energy Board. Data is provided regarding the operator, well name, well ID No./UWI, status, classification, well depth, spud and release date.

Government Publication Date: 1920-Feb 2003*

National Environmental Emergencies System (NEES):

Federal

NEES

In 2000, the Emergencies program implemented NEES, a reporting system for spills of hazardous substances. For the most part, this system only captured data from the Atlantic Provinces, some from Quebec and Ontario and a portion from British Columbia. Data for Alberta, Saskatchewan, Manitoba and the Territories was not captured. However, NEES is also a repository for previous Environment Canada spill datasets. NEES is composed of the historic datasets 'or Trends' which dates from approximately 1974 to present. NEES Trends is a compilation of historic databases, which were merged and includes data from NATES (National Analysis of Trends in Emergencies System), ARTS (Atlantic Regional Trends System), and NEES. In 2001, the Emergencies Program determined that variations in reporting regimes and requirements between federal and provincial agencies made national spill reporting and trend analysis difficult to achieve. As a consequence, the department has focused efforts on capturing data on spills of substances which fall under its legislative authority only (CEPA and FA). As such, the NEES database will be decommissioned in December 2004.

Government Publication Date: 1974-2003*

Notice of Contamination List:

Federal

NOC

This dataset contains Notice of Contamination (NOC) submissions reported to the Canada Energy Regulator (CER), including the most recent annual update information where applicable. Regulated companies are required to submit an NOC when contamination is identified or encountered during any phase of a facility's lifecycle and confirmed through analytical sampling, or when contamination resulting from an incident cannot be remediated within 12 weeks of being reported to the CER. Blank values in the Annual Update Year and annual update fields indicate that the site has achieved remediation closure, has been identified as third-party contamination, or was reported recently and does not yet require an annual update.

Government Publication Date: Nov, 2025

National PCB Inventory:

Federal

NPCB

Environment Canada's National PCB inventory includes information on in-use PCB containing equipment in Canada including federal, provincial and private facilities. Federal out-of-service PCB containing equipment and PCB waste owned by the federal government or by federally regulated industries such as airlines, railway companies, broadcasting companies, telephone and telecommunications companies, pipeline companies, etc. are also listed. Although it is not Environment Canada's mandate to collect data on non-federal PCB waste, the National PCB inventory includes some information on provincial and private PCB waste and storage sites. Some addresses provided may be Head Office addresses and are not necessarily the location of where the waste is being used or stored.

Government Publication Date: 1988-2008*

National Pollutant Release Inventory:

Federal

NPR2

The National Pollutant Release Inventory (NPRI) is Canada's public inventory of pollutant releases (to air, water and land), disposals, and transfers for recycling. The inventory, managed by Environment and Climate Change Canada, tracks over 300 substances. Under the authority of the Canadian Environmental Protection Act (CEPA), owners or operators of facilities that meet published reporting requirements are required to report to the NPRI.

Government Publication Date: Feb 2024

National Pollutant Release Inventory - Historic:

Federal

NPRI

Environment Canada has defined the National Pollutant Release Inventory ("NPRI") as a federal government initiative designed to collect comprehensive national data regarding releases to air, water, or land, and waste transfers for recycling for more than 300 listed substances. This data holds historic records; current records are found in NPR2.

Government Publication Date: 1993-May 2017

Oil and Gas Wells:

Private

OGWE

The Nickle's Energy Group (publisher of the Daily Oil Bulletin) collects information on drilling activity including operator and well statistics. The well information database includes name, location, class, status and depth. The main Nickle's database is updated on a daily basis, however, this database is updated on a monthly basis. More information is available at www.nickles.com.

Government Publication Date: 1988-Dec 31, 2025

Ontario Oil and Gas Wells:

Provincial

OOGW

In 1998, the Ministry of Natural Resources (MNR) handed over to the Ontario Oil, Gas and Salt Resources (OGSR) Corporation, the responsibility of maintaining a database of oil and gas wells drilled in Ontario. The OGSR Library has over 20,000+ wells in their database. Information available for all wells in the ERIS database includes well owner/operator, location, permit issue date, and well cap date, license number, status, depth and the primary target (rock unit) of the well being drilled. All geology/stratigraphy table information, plus all water table information is also provided for each well record.

Government Publication Date: 1800-May 2025

Inventory of PCB Storage Sites:

Provincial

OPCB

The Ontario Ministry of Environment, Waste Management Branch, maintains an inventory of PCB storage sites within the province. Ontario Regulation 11/82 (Waste Management - PCB) and Regulation 347 (Generator Waste Management) under the Ontario EPA requires the registration of inactive PCB storage equipment and/or disposal sites of PCB waste with the Ontario Ministry of Environment. This database contains information on: 1) waste quantities; 2) major and minor sites storing liquid or solid waste; and 3) a waste storage inventory.

Government Publication Date: 1987-Oct 2004; 2012-Dec 2013

Orders:

Provincial

ORD

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include Orders on the registry such as (EPA s. 17) - Order for remedial work, (EPA s. 18) - Order for preventative measures, (EPA s. 43) - Order for removal of waste and restoration of site, (EPA s. 44) - Order for conformity with Act for waste disposal sites, (EPA s. 136) - Order for performance of environmental measures.

Government Publication Date: 1994 - Dec 31, 2025

Canadian Pulp and Paper:

Private

PAP

This information is part of the Pulp and Paper Canada Directory. The Directory provides a comprehensive listing of the locations of pulp and paper mills and the products that they produce.

Government Publication Date: 1999, 2002, 2004, 2005, 2009-2014

Parks Canada Fuel Storage Tanks:

Federal

PCFT

Canadian Heritage maintains an inventory of known fuel storage tanks operated by Parks Canada, in both National Parks and at National Historic Sites. The database details information on site name, location, tank install/removal date, capacity, fuel type, facility type, tank design and owner/operator.

Government Publication Date: 1920-Jan 2005*

Pesticide Register:

Provincial

PES

The Ontario Ministry of the Environment and Climate Change maintains a database of licensed operators and vendors of registered pesticides.

Government Publication Date: Oct 2011 - Jan 31, 2026

Ontario PFAS Spills:

Provincial

PFAS

This specific list of spills includes those incidents where one or more of the listed contaminants are identified in the PFAS Structure List and/or PFAS Chemicals Without Explicit Structure List made available by the United States Environmental Protection Agency (US EPA), is originally sourced from the Ministry of the Environment, Conservation and Parks spills related data. Information from 1988-2002 was part of the ORIS (Occurrence Reporting Information System). The SAC (Spills Action Centre) handles all spills reported in Ontario. Regulations for spills in Ontario are part of the MOE's Environmental Protection Act, Part X.

Government Publication Date: 1988-Jun 2024; Aug 2024; Oct-Nov 2024

NPRI Reporters - PFAS Substances:

Federal

PFCH

The National Pollutant Release Inventory (NPRI) is Canada's public inventory of releases, disposals, and transfers, tracking over 320 pollutants. Per- and polyfluoroalkyl substances (PFAS) are a group of over 4,700 human-made substances for which adverse environmental and health effects have been observed. This listing of PFAS substance reporters includes those NPRI facilities that reported substances that are found in either: a) the Comprehensive Global Database of PFASs compiled by the Organisation for Economic Co-operation and Development (OECD), b) the US Environmental Protection Agency (US EPA) Master List of PFAS Substances, c) the US EPA list of PFAS chemicals without explicit structures, or d) the US EPA list of PFAS structures (encompassing the largest set of structures having sufficient levels of fluorination to potentially impart PFAS-type properties).

Government Publication Date: Feb 2024**Potential PFAS Handlers from NPRI:**

Federal

PFHA

The National Pollutant Release Inventory (NPRI) is Canada's public inventory of releases, disposals, and transfers, tracking over 320 pollutants. Per- and polyfluoroalkyl substances (PFAS) are a group of over 4,700 human-made substances for which adverse environmental and health effects have been observed. This list of potential PFAS handlers includes those NPRI facilities that reported business activity (NAICS code) included in the US Environmental Protection Agency (US EPA) list of Potential PFAS-Handling Industry Sectors, further described as operating in industry sectors where literature reviews indicate that PFAS may be handled and/or released. Inclusion of a facility in this listing does not indicate that PFAS are being manufactured, processed, used, or released by the facility - these are facilities that potentially handle PFAS based on their industrial profile.

Government Publication Date: Feb 2024**Pipeline Incidents:**

Provincial

PINC

List of pipeline incidents (strikes, leaks, spills). This is not a comprehensive or complete inventory of pipeline incidents in the province; this listing is an historical copy of records previously obtained under Access to Public Information. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2021**Potential PFAS Handlers from EASR:**

Provincial

PPHA

The Ontario Environmental Activity and Sector Registry (EASR), described in Ontario Regulation 245/11, allows businesses with less complex operations - and hence not requiring an Environmental Compliance Approval - to register their activities with the Ontario Ministry of the Environment, Conservation and Parks (MECP). This list of potential PFAS handlers includes those EASR facilities that reported business activity (NAICS code) included in the US Environmental Protection Agency (US EPA) list of Potential PFAS-Handling Industry Sectors, further described as operating in industry sectors where literature reviews indicate that PFAS may be handled and/or released. Inclusion of a facility in this listing does not indicate that PFAS are being manufactured, processed, used.

Government Publication Date: Jun 30, 2024**Private and Retail Fuel Storage Tanks:**

Provincial

PRT

The Fuels Safety Branch of the Ontario Ministry of Consumer and Commercial Relations maintained a database of all registered private fuel storage tanks and licensed retail fuel outlets. This database includes an inventory of locations that have gasoline, oil, waste oil, natural gas and/or propane storage tanks on their property. The MCCR no longer collects this information. This information is now collected by the Technical Standards and Safety Authority (TSSA).

Government Publication Date: 1989-1996***Permit to Take Water:**

Provincial

PTTW

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include PTTW's on the registry such as OWRA s. 34 - Permit to take water.

Government Publication Date: 1994 - Dec 31, 2025**Ontario Regulation 347 Waste Receivers Summary:**

Provincial

REC

Part V of the Ontario Environmental Protection Act ("EPA") regulates the disposal of regulated waste through an operating waste management system or a waste disposal site operated or used pursuant to the terms and conditions of a Certificate of Approval or a Provisional Certificate of Approval. Regulation 347 of the Ontario EPA defines a waste receiving site as any site or facility to which waste is transferred by a waste carrier. A receiver of regulated waste is required to register the waste receiving facility. This database represents registered receivers of regulated wastes, identified by registration number, company name and address, and includes receivers of waste such as: landfills, incinerators, transfer stations, PCB storage sites, sludge farms and water pollution control plants. This information is a summary of all years from 1986 including the most currently available data.

Government Publication Date: 1986-1990, 1992-2021**Record of Site Condition:**

Provincial

RSC

The Record of Site Condition (RSC) is part of the Ministry of the Environment's Brownfields Environmental Site Registry. Protection from environmental cleanup orders for property owners is contingent upon documentation known as a record of site condition (RSC) being filed in the Environmental Site Registry. In order to file an RSC, the property must have been properly assessed and shown to meet the soil, sediment and groundwater standards appropriate for the use (such as residential) proposed to take place on the property. The Record of Site Condition Regulation (O. Reg. 153/04) details requirements related to site assessment and clean up. RSCs filed after July 1, 2011 will also be included as part of the new (O.Reg. 511/09). The Government of Ontario states that it is not responsible for the accuracy of the information in this Registry.

Government Publication Date: 1997-Sept 2001, Oct 2004 - 31 Jan, 2026

Retail Fuel Storage Tanks:

Private

RST

This database includes an inventory of retail fuel outlet locations (including marinas) that have on their property gasoline, oil, waste oil, natural gas and / or propane storage tanks.

Government Publication Date: 1999-Apr 30, 2025

Scott's Manufacturing Directories:

Private

SCT

Scott's Directories is a data bank containing information on various manufacturers across Canada. Even though Scott's listings are voluntary, it is the most comprehensive database of Canadian manufacturers available. Information concerning a company's address, plant size, applicable NAICS Codes, and product categories are included in this database.

Government Publication Date: 1992-Mar 2011; Feb 2025

Ontario Spills:

Provincial

SPL

List of spills and incidents made available by the Ministry of the Environment, Conservation and Parks. This database identifies information such as location (approximate), type and quantity of contaminant, date of spill, environmental impact, cause, nature of impact, etc. Information from 1988-2002 was part of the ORIS (Occurrence Reporting Information System). The SAC (Spills Action Centre) handles all spills reported in Ontario. Regulations for spills in Ontario are part of the MOE's Environmental Protection Act, Part X.

Government Publication Date: 1988-Dec 2025

Wastewater Discharger Registration Database:

Provincial

SRDS

Facilities that report either municipal treated wastewater effluent or industrial wastewater discharges under the Effluent Monitoring and Effluent Limits (EMEL) and Municipal/Industrial Strategy for Abatement Regulations. The Municipal/Industrial Strategy for Abatement (MISA) division of the Ontario Ministry of Environment keeps record of direct dischargers of toxic pollutants within nine sectors including: Electric Power Generation, Mining, Petroleum Refining, Organic Chemicals, Inorganic Chemicals, Pulp & Paper, Metal Casting, Iron & Steel, and Quarries.

Government Publication Date: 1990-Dec 31, 2023

Anderson's Storage Tanks:

Private

TANK

The information provided in this database was collected by examining various historical documents, which identified the location of former storage tanks, containing substances such as fuel, water, gas, oil, and other various types of miscellaneous products. Information is available in regard to business operating at tank site, tank location, permit year, permit & installation type, no. of tanks installed & configuration and tank capacity. Data contained within this database pertains only to the city of Toronto and is not warranted to be complete, exhaustive or authoritative. The information was collected for research purposes only.

Government Publication Date: 1915-1953*

Transport Canada Fuel Storage Tanks:

Federal

TCFT

List of fuel storage tanks currently or previously owned or operated by Transport Canada. This inventory also includes tanks on The Pickering Lands, which refers to 7,530 hectares (18,600 acres) of land in Pickering, Markham, and Uxbridge owned by the Government of Canada since 1972; properties on this land has been leased by the government since 1975, and falls under the Site Management Policy of Transport Canada, but is administered by Public Works and Government Services Canada. This inventory provides information on the site name, location, tank age, capacity and fuel type.

Government Publication Date: 1970 - Apr 2024

Variances for Abandonment of Underground Storage Tanks:

Provincial

VAR

Listing of variances granted for storage tank abandonment. This is not a comprehensive or complete inventory of tank abandonment variances in the province; this listing is a copy of tank abandonment variance records previously obtained under Access to Public Information. In Ontario, registered underground storage tanks must be removed within two years of disuse; if removal of a tank is not feasible, an application may be sought for a variance from this code requirement.

Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Waste Disposal Sites - MOE CA Inventory:

Provincial

WDS

The Ontario Ministry of Environment, Waste Management Branch, maintains an inventory of known open (active or inactive) and closed disposal sites in the Province of Ontario. Active sites maintain a Certificate of Approval, are approved to receive and are receiving waste. Inactive sites maintain Certificate(s) of Approval but are not receiving waste. Closed sites are not receiving waste. The data contained within this database was compiled from the MOE's Certificate of Approval database. Locations of these sites may be cross-referenced to the Anderson database described under ERIS's Private Source Database section, by the CA number. All new Environmental Compliance Approvals handed out after Oct 31, 2011 for Waste Disposal Sites will still be found in this database.

Government Publication Date: Oct 2011 - Jan 31, 2026

Waste Disposal Sites - MOE 1991 Historical Approval Inventory:

Provincial

[WDSH](#)

In June 1991, the Ontario Ministry of Environment, Waste Management Branch, published the "June 1991 Waste Disposal Site Inventory", of all known active and closed waste disposal sites as of October 30st, 1990. For each "active" site as of October 31st 1990, information is provided on site location, site/CA number, waste type, site status and site classification. For each "closed" site as of October 31st 1990, information is provided on site location, site/CA number, closure date and site classification. Locations of these sites may be cross-referenced to the Anderson database described under ERIS's Private Source Database section, by the CA number.

Government Publication Date: Up to Oct 1990*

Waste Management Site:

Provincial

[WMS](#)

This data contains Waste Disposal Site types collected by the Ministry of Natural Resource (MNR). The new data class brings over data from the Waste Management Information System (WMIS), which is an MS Access based database used by MNR to track Waste Management Sites. This was married with the spatial data from Waste Disposal Sites where possible. Different Waste Disposal Site types collected by the Ministry of Natural Resources include: compost disposal, hazardous waste disposal, household waste disposal, industrial waste disposal, septic drying bed, septic field, sewage disposal, tile bed, and transfer station. The data is currently under development, meaning the data is currently in the process of being created by the MNR.

Government Publication Date: April 30, 2025

Water Well Information System:

Provincial

[WWIS](#)

This database consists of information submitted by well contractors detailing locations and characteristics of water wells found within Ontario in accordance with Regulation 903. It includes such information as coordinates, construction date, well depth, primary and secondary use, pump rate, static water level, well status, etc. Also included are detailed stratigraphy information, approximate depth to bedrock and the approximate depth to the water table. The database is provided by the Ontario Ministry of Environment, Conservation and Parks.

Government Publication Date: Jul 31, 2025

Definitions

Database Descriptions: This section provides a detailed explanation for each database including: source, information available, time coverage, and acronyms used. They are listed in alphabetic order.

Detail Report: This is the section of the report which provides the most detail for each individual record. Records are summarized by location, starting with the project property followed by records in closest proximity.

Distance: The distance value is the distance between plotted points, not necessarily the distance between the sites' boundaries. All values are an approximation.

Direction: The direction value is the compass direction of the site in respect to the project property and/or center point of the report.

Elevation: The elevation value is taken from the location at which the records for the site address have been plotted. All values are an approximation. Source: Google Elevation API.

Executive Summary: This portion of the report is divided into 3 sections:

'Report Summary'- Displays a chart indicating how many records fall on the project property and, within the report search radii.

'Site Report Summary'-Project Property'- This section lists all the records which fall on the project property. For more details, see the 'Detail Report' section.

'Site Report Summary-Surrounding Properties'- This section summarizes all records on adjacent properties, listing them in order of proximity from the project property. For more details, see the 'Detail Report' section.

Map Key: The map key number is assigned according to closest proximity from the project property. Map Key numbers always start at #1. The project property will always have a map key of '1' if records are available. If there is a number in brackets beside the main number, this will indicate the number of records on that specific property. If there is no number in brackets, there is only one record for that property.

The symbol and colour used indicates 'elevation': the red inverted triangle will dictate 'ERIS Sites with Lower Elevation', the yellow triangle will dictate 'ERIS Sites with Higher Elevation' and the orange square will dictate 'ERIS Sites with Same Elevation.'

Unplottables: These are records that could not be mapped due to various reasons, including limited geographic information. These records may or may not be in your study area, and are included as reference.

Aerial Photographs



HISTORICAL AERIALS

Project Property: 2155 Leanne Blvd, Mississauga
2155 Leanne Boulevard
Mississauga ON L5K 2K8

Project No: 31865

Requested By: OHE Consultants

Order No: 26022500296

Date Completed: February 25, 2026

Aerial Maps included in this report are produced by the sources listed above and are to be used for research purposes including a phase I report. Maps are not to be resold as commercial property. ERIS provides no warranty of accuracy or liability. The information contained in this report has been produced using aerial photos listed in above sources by ERIS Information Inc. (in the US) and ERIS Information Limited Partnership (in Canada), both doing business as 'ERIS'. The maps contained in this report do not purport to be and do not constitute a guarantee of the accuracy of the information contained herein. Although ERIS has endeavored to present information that is accurate, ERIS disclaims, any and all liability for any errors, omissions, or inaccuracies in such information and data, whether attributable to inadvertence, negligence or otherwise, and for any consequences arising therefrom. Liability on the part of ERIS is limited to the monetary value paid for this report.

Environmental Risk Information Services

A division of Glacier Media Inc.

1.866.517.5204 | info@erisinfo.com | erisinfo.com

Date	Source	Scale	Comments
1946	National Air Photo Library	6,000	



150
Meters

Property

Year: 1946
Source: NAPL
Scale: 6,000
Comment:

Address: 2155 Leanne Boulevard, Mississauga, ON
Approx Center: -79.6521364,43.5258881

Order No: 26022500296



Property Photographs



Photograph 1: View of a portion of the north elevation of Building B at the Property, looking south.



Photograph 2: View of a portion of the north elevations of Buildings A and B at the Property, looking southeast.



Photograph 3: View of a portion of the north elevation of Building A at the Property, looking south.



Photograph 4: View of the east elevation of Building A at the Property, looking west.



Photograph 5: View of a portion of the south elevation of Building B at the Property, looking north.



Photograph 6: View of a portion of the south elevation of Building A at the Property, looking north.



Photograph 7: View of a portion of the south elevation of the Property buildings (in between Buildings A and B), looking north.




Photograph 8: View of the recycling and garbage dumpsters located to the northwest of Building B at the Property.




Photograph 9: View of the used cooking oil bins located to the northwest of Building B at the Property.



Photograph 10: View of makeshift storage located to the southwest of Building A at the Property.

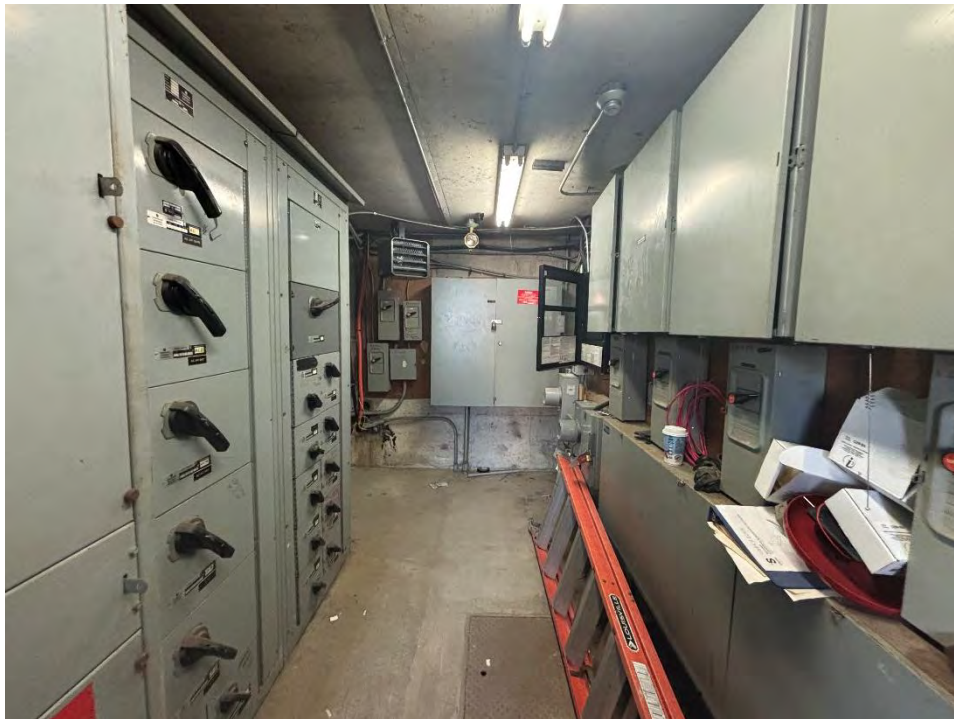


Photograph 11: View of the electrical room located to the east of Building B at the Property.

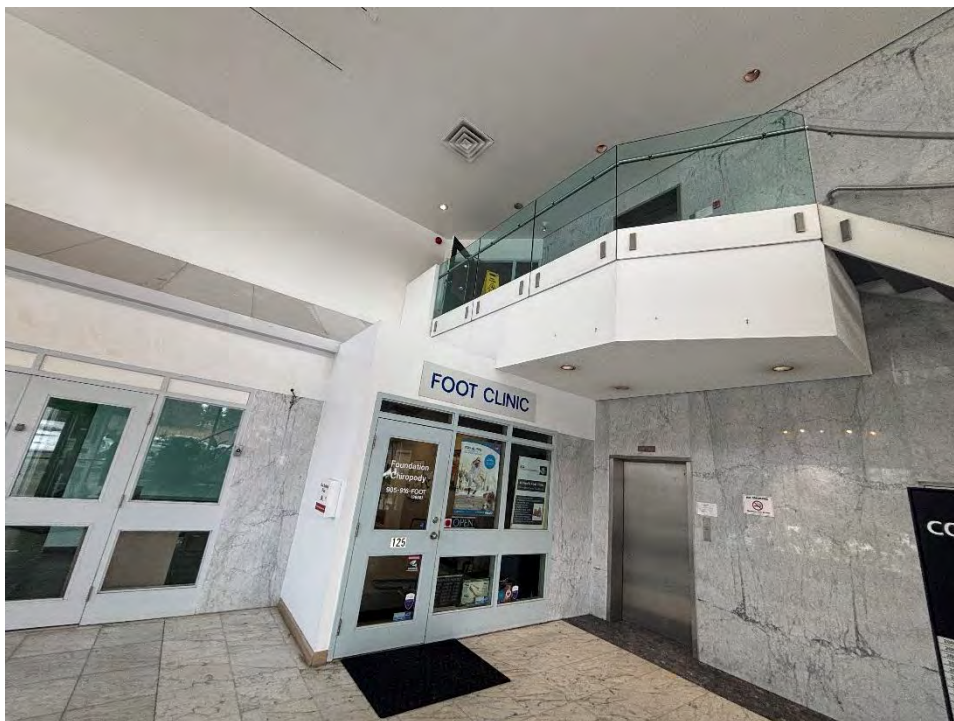

Photograph 12: View of the main lobby of Building B at the Property.




Photograph 13: View of Unit 242 (vacant) located on the second floor of Building B at the Property.

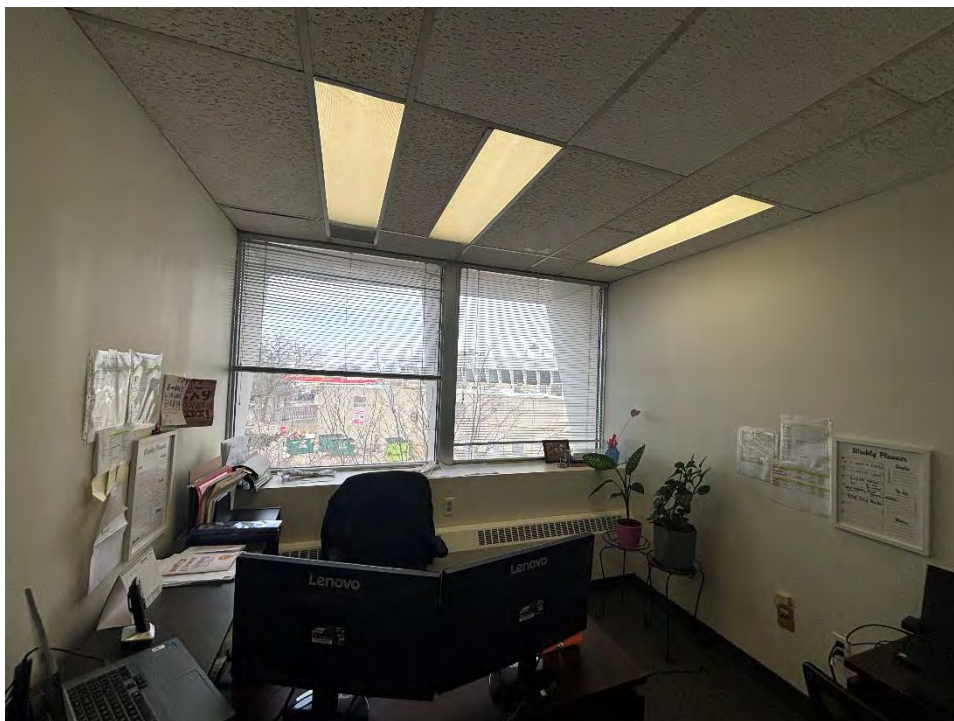

Photograph 14: View of Unit 236 (Aaxel Insurance Brokers Ltd.) located on the second floor of Building B at the Property.



Photograph 15: View of Unit 246 (Dr. Henry Choi) located on the second floor of Building B at the Property.

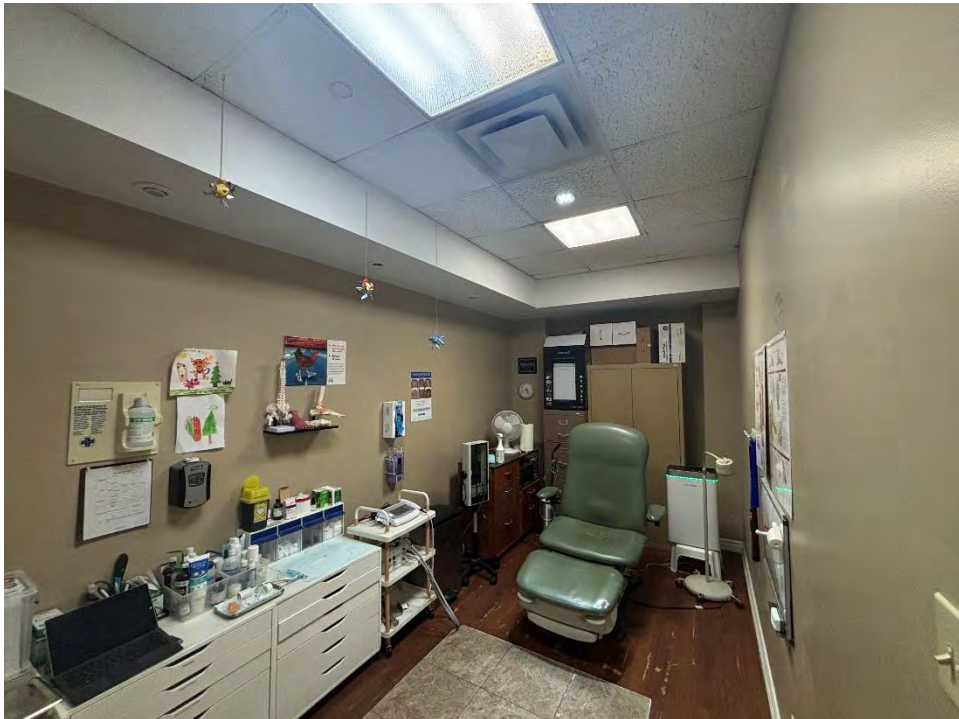

Photograph 16: View of Unit 125 (Foundation Chiroprody) located on the second floor of Building B at the Property.



Photograph 17: View of Unit 107 (vacant) located on the ground floor of Building A at the Property.



Photograph 18: View of Unit 118 (Richards Upholstery) located on the ground floor of Building B at the Property.



Photograph 19: View of potential non-friable asbestos-containing Transite cement panels on the exterior canopies of Building B at the Property.



Photograph 20: View of potential friable asbestos-containing sprayed fireproofing located on the ceiling deck of Building B at the Property.



Photograph 21: View of the lower roof of Building A at the Property.



Photograph 22: View of the roof of Building B at the Property.



Photograph 23: View of the upper roof of Building A at the Property.



Photograph 24: View of the boiler room of Building B at the Property.



Photograph 25: View of the elevator room on the ground floor of Building B at the Property.



Photograph 26: View of the grease interceptor located in Unit 106 (Swiss Chalet) in Building A at the Property.

Assessors Qualifications

Hasan Rahman, B.Eng., EIT
Project Resource, Environmental

Summary

For the duration of the contract, Hasan will provide day-to-day professional project delivery including field assessments, project coordination, budget and schedule tracking and report preparation. Hasan will report to Sam Miralai.

With over four years of experience, Mr. Hasan has been involved in a wide variety of environmental projects, demonstrating a strong skill set in both on-site work and project management. His experience includes conducting Phase One and Phase Two Environmental Site Assessments (ESAs), overseeing site remediation, and managing underground storage tank (UST) removals. He is also proficient in confirmatory soil sampling and hazardous materials assessments. In addition to his technical skills, Mr. Hasan is experienced in project coordination and client liaison. He has successfully applied his expertise across diverse occupational settings, including government organizations, residential apartments, commercial and retail buildings, industrial facilities, and educational institutions.

Education

Bachelor of Environmental Engineering

Carleton University, Ottawa, Ontario

09/2014 - 04/2019

Environmental Consulting Experience

OHE Consultants, 2022 - Present

→ Phase One Environmental Site Assessments:

- Involved in Phase One Environmental Site Assessments for a number of residential, commercial and industrial properties in Ontario. This included the completion of thorough site inspections, reviewing of historical background information, communication with regulatory agencies and stakeholders, and report preparation in accordance with CSA Z768-01 Standard and Ontario Regulation 153/04, as amended.

→ Phase Two Environmental Site Assessments:

- Completed various Phase Two Environmental Site Assessments for industrial and commercial properties throughout Ontario. This included soil and groundwater sampling, project coordination, supervision of drilling contractors and excavators, groundwater monitoring well installation, elevation survey, data interpretation and report preparation.

→ Site Remediation:

- Conducted various soil and ground water remediation projects for various sites in the Greater Toronto Area. Activities included site supervision, confirmatory soil sampling, ground water monitoring and sampling, communication with contractors during excavation and removal of contaminated material, data analysis and report preparation.

→ **Other Environmental Activities:**

- Supervised the removal of storage tanks, collected soil samples, and prepared reports detailing the field activities.
- Observed the decommissioning of ground water monitoring wells and drafted letter reports summarizing field activities.

Previous Relevant Experience

Mr. Hasan's experience in his previous role at Ecoh Management Inc. directly aligns with the services OHE provides. He has a proven background in conducting Phase One and Phase Two Environmental Site Assessments (ESAs), overseeing site remediation, and managing underground storage tank (UST) removals. His expertise also includes performing hazardous materials assessments and ensuring all projects adhere to relevant regulatory standards. This comprehensive experience demonstrates his ability to deliver a wide range of environmental consulting services with a strong focus on technical precision and project management.

Training

- Workplace Hazardous Materials Information System (WHMIS), Annual Updates
- Working at Heights, Updates
- Ministry of Labour, Worker and Supervisor Health and Safety Awareness, 2022

Saman (Sam) Miralai, M.A.Sc., P.Eng., QP_{ESA}

PEO License: 100190583

Project Manager, Environmental

Cell: 416 278 4954

Email: SMiralai@oheconsultants.com

Summary

For the duration of the contract, Sam will manage all assigned environmental projects from a detailed technical and professional perspective. His responsibilities will include project oversight, environmental analysis and report writing, budget tracking, project scheduling, contractor management as well as the supervision of resource staff.

Mr. Miralai has over fifteen (15) years of environmental experience including phase one and two environmental site assessments (ESAs), remediation, health and safety protocols, storage tank compliance, record of site condition (RSC) submission, hydrogeology, environmental chemistry, environmental fate and transport, environmental baseline study and impact assessment (EBS & EIA) as well as hydrological, watershed, wetland and water quality conservation studies. Sam has also Conducted detailed background reviews including expected soil type and stratigraphy, expected groundwater levels and other characteristics, as well as remedial options and technologies. He is also a registered professional engineer (P.Eng.) with extensive working knowledge of Ontario Regulation 153/04 (as amended) as well as Canadian Standards Association (CSA) ESA Standards.

Education

Master of Applied Science **2006**

Environmental Engineering, Dalhousie University, Halifax, Nova Scotia, Canada

Bachelor of Science **2003**

Civil Engineering – Hydraulics, Iran University of Science & Technology (IUST), Tehran, Iran

Designations

- **Professional Engineers of Ontario**
- **Qualified Person (QP_{ESA}) as per Ontario Regulation 153/04**

Environmental Consulting Experience

OHE Consultants, 2017 – Present

→ **Phase One Environmental Site Assessments (ESAs):**

- Project manager and site assessor of various Phase One ESAs in Ontario including commercial, industrial, and residential properties for various clients.
- Conducted detailed background reviews including environmental registries, EcoLog ERIS reports, city directories, fire insurance maps (FIPs), aerial photographs, topographic and geological maps, as well as other pertinent historical information.
- Conducted site visits including the subject property and adjoining/neighbouring properties.
- Prepared Phase One ESA proposals, reports and invoices.

→ **Phase Two Environmental Site Assessments:**

- Project manager and site assessor for various Phase Two ESAs in Ontario including commercial, industrial, and residential properties for various clients.
- Conducted detailed background reviews including expected soil type and stratigraphy, expected groundwater levels and other characteristics, and required drilling equipment.
- Supervised drilling activities and conducted soil and groundwater sampling with various sampling technologies and methods.
- Prepared Phase Two ESA proposals, reports and invoices.

→ **Site Remediation:**

- Project manager and site assessor for various remediation projects in Ontario including commercial, industrial, and residential properties for various clients.
- Conducted detailed background reviews including expected soil type and stratigraphy, expected groundwater levels and other characteristics, as well as remedial options and technologies.
- Supervised remediation activities including excavation, backfilling, test pitting, in-situ chemical oxidation and conducted verification sampling.
- Prepared remediation proposals, reports and invoices.

→ **Record of Site Condition (RSC):**

- Conducted Phase One, Phase Two and remediation projects as per the Ontario Regulation 153/04 (as amended) compliant with the requirements of submitting RSCs.
- Gathered the required documents as attachments for the RSC submissions.
- Filling out the online RSC submission forms including maximum parameter concentrations.
- Corresponded with the Ontario Ministry of the Environment and Climate Change (MOECC) regarding any required RSC submission corrections.

→ **Other Activities:**

- Peer review of technical documents and reports;

Previous Relevant Experience

Sam's experience at firms such as WSP Canada Inc., MMM Group Limited and S2S Environmental Inc. has also provided him with a solid foundation in managing complex environmental projects. His background included: Environmental Site Assessments (ESAs): Extensive project management experience with both Phase One and Two ESAs, ensuring all work adheres to CSA Standards and O.Reg. 153/04 (as amended); Remediation and Site Delineation: Expertise in managing a variety of remediation projects, including in-situ and ex-situ methods, UST removal, and chemical oxidation. This also includes the delineation of soil and groundwater contamination and the successful submission of Records of Site Condition (RSCs); Technical Compliance & Peer Review: A strong history of performing peer reviews on technical documents and reports, ensuring adherence to quality and regulatory standards set by agencies like the MOECC (now the MECP).

Training

- Workplace Hazardous Materials Information System (WHMIS), Annual Updates
- Ministry of Labour, Worker and Supervisor Health and Safety Awareness
- Ground Disturbance Training, 2016

Farid (Fred) Atrash, B.Sc., M.H.Sc., CIH, ROH
Project Lead/ Delivery/ Quality Control

Phone: 416 817 1411

Email: fred@oheconsultants.com

Summary

As the single point of contact for this contract, Fred will provide comprehensive technical and professional leadership for your project. He will manage all aspects, from client communications and overall project oversight to analysis, report writing, coordination with assigned project managers, budget tracking, scheduling, and staff supervision.

As the Owner and Founder of OHE, Fred personally maintains strong client relationships and guarantees overall quality control for every assigned project. With over 25 years of experience, he is a proven professional who has delivered technical expertise, crucial on-site sampling and supervision, and thorough report preparation and sign-off for countless high-profile assignments. Fred's ability to serve a wide range of clients including municipalities, government agencies, financial institutions, property management groups, retail companies, healthcare, and manufacturing facilities emphasizes his adaptability and comprehensive understanding of diverse environmental and health and safety needs. Fred's expertise further spans employee exposure assessments, the development and implementation of specific industrial hygiene programs, and critical air quality assessments. He is adept at creating effective asbestos management programs and designing designated substance abatement management programs. His skills also include crafting contract specifications, conducting thorough bid evaluations, providing expert project management and supervision, and developing and implementing impactful training programs. During the COVID-19 pandemic, Fred played a vital role in developing and reviewing infection control and cleaning procedures, conducting onsite investigations, and guiding operational planning.

Education

Masters of Health Science, Major: Occupational and Environmental Health **1993**
University of Toronto, Toronto, Ontario, Canada

Bachelor of Science, Major: Environmental Health **1989**
American University of Beirut, Beirut, Lebanon

Designations

- **Registered Occupational Hygienist (ROH)**
- **Certified Industrial Hygienist(CIH)**

Environmental Consulting Experience

OHE Consultants, 2001 – Present

→ Asbestos and Hazardous Materials Management

Contract specifications and bid evaluations; Development of asbestos and hazardous materials management programs; Design of asbestos abatement programs; Development and administration of employee asbestos training programs; Managed, supervised and conducted building surveys for the presence and condition of asbestos- containing materials and hazardous materials; Project management and supervision.

→ **Polychlorinated Biphenyls (PCBs) Management**

Building survey for the presence of PCB; Development of PCB management plans; Development and administration of PCB training programs; Preparation of PCB storage room specifications; Preparation and review of contract documents for PCB disposal.

→ **Building Microbial Contamination Management**

Investigation of building mechanical systems for risk of Legionella growth and Sampling of building systems for the presence of Legionella; Design of Legionella Control Program; Contract specifications and bid evaluations; Development and administration of employee training programs; Design and implementation of air and bulk sampling studies; Development of microbial contamination management programs; Design of microbial contamination abatement programs; Management, supervision and execution of building surveys for the presence of microbial contamination; Project management and supervision.

→ **Occupational and Environmental Hygiene**

Corporate environmental and occupational health & safety policy and programs development, implementation and training; Air sampling and analysis; Noise surveys and control programs; Ventilation systems assessments and design; Specialized and general industrial hygiene surveys; Designated substances audits, assessments and control programs; Workplace Hazardous Materials Information Systems (WHMIS) education and training programs and manuals development; Material Safety Data Sheets (MSDSs) review and management; Job hazards assessment and analysis; Specific industrial hygiene program development (respiratory protection programs, hearing conservation programs, confined space entry programs); Legal compliance audits.

→ **Indoor Air Quality**

Design of duct cleaning programs, preparation of contract specifications, bids evaluation and project management and supervision; Detailed evaluation of heating, ventilation and air-conditioning systems; Development of indoor air quality management programs; Lighting and noise assessments; Measurements of comfort factors and sampling and analysis of air contaminants; Microbial contamination investigations; Walk through risk assessments to identify sources of indoor air contaminants.

→ **Infection Prevention and Control**

Prepared specifications and procedures to be followed by contractors during abatement/construction work in hospitals; Prepared, executed and supervised air sampling programs for fungi and particulate during construction projects as part of infection control; Carried out inspections of infection control containments as part of renovation projects in existing hospitals; Completed inspections during the construction of new hospitals to ensure that prescribed infection control measures and procedures were being followed; Designed and completed programs to determine the efficiency of cleaning activities in hospitals using different products and materials; Completed gap analysis of hospitals tendering documents for construction projects with respect to infection control requirements; Completed risk assessments and presented recommendations concerning the replacement of main water supplies in hospitals;

Prepared and delivered training sessions on infection control including presenting at the Healthcare Facilities Symposium and Expo.

→ **Safety**

Development of safety programs; Evaluation of compliance with applicable regulations; Safety audits and evaluations; Safety inspections.

→ **Training**

Designed, prepared and conducted training seminars for employees of national corporate clients on environmental and occupational health and safety issues, WHMIS and waste management.

Training

- OHE Asbestos in Buildings: Identification, Assessment and Remediation, Updates
- OHE Fungi (Mould) in Buildings: Identification, Assessment and Remediation, Updates
- OHE Designated Substance Awareness and Management Training, Updates
- OHE Lead Abatement Training, Updates
- OHE Hazardous Materials Management Training, Updates
- OHE Fall Arrest Awareness Training, Updates
- OHE PCM Analysis Training, Updates
- OHE Fall Prevention Awareness Training, Updates
- OHE Respiratory Protection, Updates
- OHE Occupational Health and Safety Act, Updates
- OHE Confined Spaces, Recognition, Assessment and Control, Updates
- OHE WHMIS, Updates
- OHE Personal Protective Equipment, Updates
- OHE Chemical Spills and Releases, Updates
- OHE Accident Investigation Policy and Procedures, Updates
- OHE Working Around Electricity, Updates
- OHE Workplace Violence and Harassment Policy and Procedures, Updates
- Working at Heights Training, Updates
- TTC Subway Rule Book Training, Updates
- Webinar: EMLAB P&K, Mold and Health Effects, 2015
- OHE Accessible Customer Service Course, 2014
- Ministry of Labour, Worker and Supervisor Health and Safety Awareness Training, 2014
- Ontario Hospital Association, Freedom of Information – For Hospital Staff, 2013
- NITON Analyzers XRF Training for Operation, Radiation Safety & System Maintenance, 2009
- Team 1 Academy, Confined Spaces Entry and Rescue Training, 2011
- Occupational Safety Group, Train the Trainer Day, 2007

Memberships

- The Canadian Registration Board of Occupational Hygienist
- The Occupational Hygiene Association of Ontario
- The American Board of Industrial Hygiene
- The American Industrial Hygiene Association

Conferences and Professional Development Courses Attended

- Available upon request.